

DTIC FILE COPY

MTL TR 88-20

AD

2

FLAME CUTTING TEXTURED STEEL ARMOR

AD-A196 033

WILLIAM S. RICCI

FABRICATION AND TECHNOLOGY DEMONSTRATION BRANCH

JOHN A. SACCOCCIO


MATERIALS TESTING AND EVALUATION BRANCH

June 1988

Approved for public release; distribution unlimited.



US ARMY
LABORATORY COMMAND
MATERIALS TECHNOLOGY LABORATORY

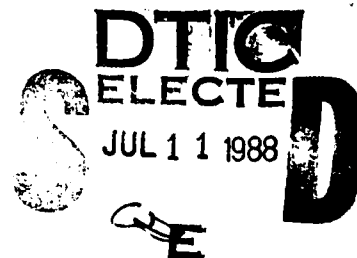

U.S. ARMY MATERIALS TECHNOLOGY LABORATORY
Watertown, Massachusetts 02172-0001

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

Mention of any trade names or manufacturers in this report shall not be construed as advertising nor as an official indorsement or approval of such products or companies by the United States Government.

DISPOSITION INSTRUCTIONS

Destroy this report when it is no longer needed.
Do not return it to the originator.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

Block No. 20

ABSTRACT

Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat. The delayed nature of the transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking. Recommended practices for flame cutting textured steel armor are presented.

Accession For	
NTIS GRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A-1	



UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

INTRODUCTION

Undesirable metallurgical transformations and high tensile residual stresses¹ in the region of flame cut edges have necessitated the use of high preheat temperatures, often in excess of 550°F,² for the flame cutting of high strength steels. In addition, grinding is generally required for all thermal cut surfaces, not subjected to welding, if cut surfaces are on a part that is dynamically loaded.^{3,4,5} The combination of high preheat temperatures and secondary grinding requirements translates to high cutting costs for high hardenability armor steels. The purpose of the work presented here is to establish oxy-fuel cutting guidelines for an ultrahigh hardenability armor steel, textured steel.⁶ *hydrogen induced cracking (HIC) is a problem in this type of steel*

EXPERIMENTAL

Two inch thick textured steel plate was used in all flame cutting experiments. The chemical composition of the textured steel used is shown in Table 1. Typical mechanical properties of this material are shown in Table 2.

Cuts were made with a Linde CM 250 oxy-fuel shape cutter. A constant set of cutting parameters was used for all cutting trials, Table 3.

Table 1. CHEMICAL COMPOSITION OF TEXTURED STEEL

Weight Percent								
C	Mn	Ni	Cr	Mo	Si	P	S	Cu
0.40	0.58	5.43	0.11	0.46	1.24	0.006	0.005	0.97

Table 2. TYPICAL MECHANICAL PROPERTIES OF TEXTURED STEEL ARMOR

YS 0.2% Offset (ksi)	UTS (ksi)	Elong. (%)	R.A. (%)	Charpy Impact Energy, 22°F (ft-lb)
237	303	13.1	46	17.5

Table 3. FLAME CUTTING PARAMETERS

Fuel Gas: Acetylene
Fuel Gas Pressure: 6.5 psi
Preheat Flame Op Pressure: 20 psi
Cutting Op Pressure: 10 psi
Cutting Tip: #8
Cutting speed: 10 ipm

1. BJORHOVDE, R., BROZZETTI, J., ALPSTEN, G. A., and TALL, L. *Residual Stresses in Thick Welded Plates*. Welding Journal, v. 51, no. 9, August 1972, p. 392s-405s.
2. RUGE, J. *Transformations and Reactions in the Heat Affected Zone During the Welding and Oxygen Cutting of Steel*. Welding in the World, v. 4, no. 3, 1966, p. 142-153.
3. GOLDBERG, F. *Influence of Thermal Cutting and Its Quality on the Fatigue Strength of Steel*. Welding Journal, v. 52, no. 9, September 1973, p. 392s-404s.
4. NIBBERING, J. J. W., THOMAS, H., and BOS, T. J. *The Properties of Plasma Cut Edges*. Welding in the World, v. 18, no. 9-10, 1980, p. 182-195.
5. BERGGVIST, L., and SPERLE, J. *Fatigue Strength of High Strength Steel Beams with Thermally Cut Surfaces*. Welding in the World, v. 18, no. 9/10, 1980, p. 210-220.
6. ZARKADES, A. *Improved High Strength Armor Steel Through Texturing*. U.S. Army Materials Technology Laboratory, AMMRC TR 79-52, September 1979.

An electric furnace was used for preheating plates for cutting. Preheat temperatures were kept below the tempering temperature of the base material, 350°F. Preheat time was two hours. Plates were pierced before preheating so that flame cutting could begin within two minutes from the time when the plates were withdrawn from the furnace.

Original plate size was 3' x 2'. Rectangular shapes were cut. Cuts originated from pierced holes, at a corner of the rectangular shape and 4" from plate edges, in order to maximize restraint conditions. All cuts were 4" from plate edges and at least 12" long.

All flame cut edges were inspected visually immediately after cutting and with liquid penetrant after cooling below 100°F. Inspection was carried out initially at hourly intervals, and progressed to 24-hour intervals. If discontinuities were found, mating cut surfaces were compared to determine if flaws existed prior to flame cutting.

RESULTS

The cutting parameters used produced high quality cuts with square kerf edges and minimum dross and serration depth. Results from a hardness traverse across a flame cut edge in a plate cut without preheat are shown in Figure 1.

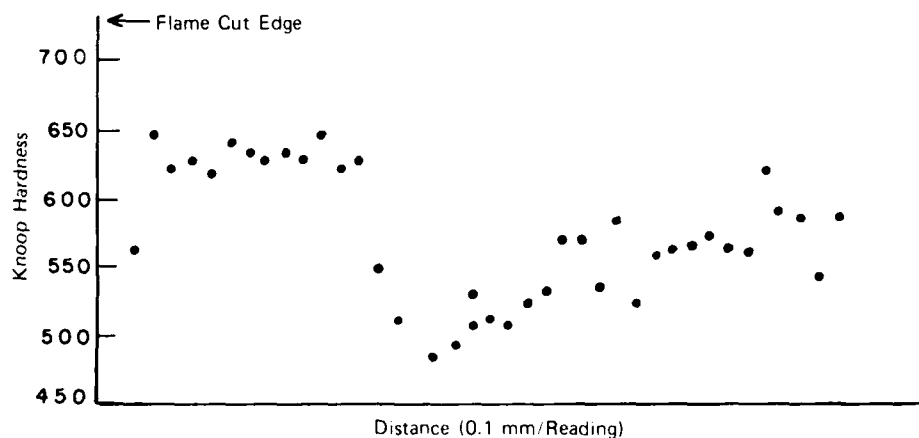


Figure 1. Hardness traverse across a flame cut edge in a plate cut without preheat.

Nondestructive testing results are summarized in Table 4. Lamellar cracks, with a stepped fracture appearance similar to that of a lamellar tear, were observed on all cut edges of plates cut without preheat. Cut edges of plates preheated to temperatures less than 325°F had transverse cracks, all occurring after a delay period of up to three weeks. These cracks, approximately 0.75" long, originated at the bottom edge of the cut and were only found on cut surfaces perpendicular to the rolling direction.

Table 4. NONDESTRUCTIVE INSPECTION RESULTS

Preheat Temperature	Inspection Results
Room Temperature	Lamellar and Transverse Edge Cracks - After 3 Days
200°F	Transverse Edge Cracks - After 3 Days
235°F	Transverse Edge Cracks - After 21 Days
275°F	Transverse Edge Cracks - After 3 Days
325°F	No Cracks
350°F	No Cracks

DISCUSSION

The delayed nature of the observed transverse edge cracking suggests that a hydrogen induced cracking mechanism may be operative. Preheat, therefore, is not only necessary for reducing hardness and residual stress values, but is also necessary for allowing additional time for atomic hydrogen to diffuse away from crack sensitive, martensitic heat affected zones.

Residual stresses from prior plate processing and the fact that thermal gradients increase with increasing distance from the preheating flames of the cutting nozzle³ could explain why transverse cracks originated at the bottom side of the cut. Localized preheating with a cutting torch (from one side only) is, therefore, discouraged not only because it is difficult to control and overtempering of the base material is likely, but also because it may actually aggravate cracking tendencies.

The probability of transverse cracking is expected to increase with decreasing plate thickness due to the more severe thermal cycling encountered at the higher cutting speeds employed.² Also, the practice of flame cutting over a water table is not recommended due to the increased availability of diffusible hydrogen in the cut edge environment

CONCLUSIONS

Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat.

The delayed nature of the observed transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking.

The recommended preheat temperature for heavy sections of textured steel armor is approximately 325°F.

Preheating with a flame torch and cutting over a water table is not recommended, especially for thick sections.

DISTRIBUTION LIST

No. of Copies	To
1	Office of the Under Secretary of Defense for Research and Engineering, The Pentagon, Washington, DC 20301
	Commander, U.S. Army Laboratory Command, 2800 Powder Mill Road, Adelphi, MD 20783-1145
1	ATTN: AMSLC-IM-TL
	Commander, Defense Technical Information Center, Cameron Station, Building 5, 5010 Duke Street, Alexandria, VA 22304-6145
2	ATTN: DTIC-FDAC
	Metals and Ceramics Information Center, Battelle Columbus Laboratories, 505 King Avenue, Columbus, OH 43201
1	ATTN: Mr. Robert J. Fiorentino, Program Manager
1	Defense Advanced Research Projects Agency, Defense Sciences Office/MSD, 1400 Wilson Boulevard, Arlington, VA 22209
	Headquarters, Department of the Army, Washington, DC 20314
1	ATTN: DAEN-RDM, Mr. J. J. Healy
	Commander, U.S. Air Force Wright Aeronautical Laboratories, Wright-Patterson Air Force Base, OH 45433
1	ATTN: AFWAL/MLC
1	AFWAL/MLLP, D. M. Forney, Jr.
1	AFWAL/MLBC, Mr. Stanley Schulman
1	AFWAL/MLLS, Dr. Terence M. F. Ronald
1	AFWAL/FIBEC, Dr. Steve Johnson
1	Edward J. Morrissey, AFWAL/MLTE, Wright-Patterson Air Force Base, OH 45433
	Commander, Army Research Office, P.O. Box 12211, Research Triangle Park, NC 27709-2211
1	ATTN: Information Processing Office
1	Dr. George Mayer
	Commander, U.S. Army Materiel Command, 5001 Eisenhower Avenue, Alexandria, VA 22333
1	ATTN: AMCLD
	Commander, U.S. Army Armament, Munitions and Chemical Command, Dover, NJ 07801
1	ATTN: Mr. Harry E. Pebly, Jr., PLASTEC, Director
	Commander, U.S. Army Aviation Systems Command, 4300 Goodfellow Blvd., St. Louis, MO 63120
1	ATTN: AMDAV-NS, Harold Law
	Director, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD 21005
1	ATTN: SLCBR-TSB-S (STINFO)
	Commander, U.S. Army Electronics Research and Development Command, Fort Monmouth, NJ 07703
1	ATTN: AMDSD-L
1	AMDSD-E
	Commander, U.S. Army Foreign Science and Technology Center, 220 7th Street, N.E., Charlottesville, VA 22901
1	ATTN: Military Tech
	Commander, U.S. Army Materiel Systems Analysis Activity, Aberdeen Proving Ground, MD 21005
1	ATTN: AMXSY-MP, H. Cohen
	Commander, U.S. Army Missile Command, Redstone Scientific Information Center, Redstone Arsenal, AL 35898-5241
1	ATTN: AMSMI-RD-CS-R/ILL Open Lit
1	AMSMI-RLM
1	AMSMI-RLA, Dr. James J. Richardson

No. of Copies	To
	Commander, U.S. Army Belvoir Research, Development and Engineering Center, Fort Belvoir, VA 22060-5606
1	ATTN: STRBE-D
1	STRBE-FS, Fuel & Water Supply Division
1	STRBE-N
1	STRBE-VL
	Commander, U.S. Army Aviation Applied Technology Directorate, Aviation Research and Technology Activity (AVSCOM), Fort Eustis, VA 23604-5577
1	ATTN: SAVRT-TY-AFP, Mr. James Gomez, Aerospace Engineer
	Commander, U.S. Army Tank-Automotive Command, Warren, MI 48090
1	ATTN: AMSTA-RCKM
	Director, Benet Weapons Laboratory, LCWSL, USA AMCOM, Watervliet, NY 12189
1	ATTN: AMSMC-LCB-TL
1	AMSMC-LCB-PS, Dr. I. Ahmad
	David Taylor Naval Ship Research and Development Center, Annapolis, MD 21402
1	ATTN: Dr. Michael Vassilaros - Code 2814
	Office of Naval Technology, 800 N. Quincy Street, Arlington, VA 20017
1	ATTN: Mr. J. J. Kelly - Code MAT 0715
	Naval Research Laboratory, Washington, DC 20375
1	ATTN: Code 5830
1	Dr. G. R. Yoder - Code 6384
1	Dr. S. C. Sanday - Code 6370
	Chief of Naval Research, Arlington, VA 22217
1	ATTN: Code 471
1	Dr. Steven G. Fishman
	Naval Sea Systems Command, Washington, DC 20362
1	ATTN: Mr. Marlin Kinna - 62R4
	Naval Air Development Center, Warminster, PA 18974
1	ATTN: Dr. E. U. Lee - Code 60632
	Naval Surface Weapons Center, White Oak, Silver Spring, MD 20910
1	ATTN: John V. Foltz - Code R32
1	Dr. Herbert Newborn - Code R34
	National Aeronautics and Space Administration, Washington, DC 20546
1	ATTN: Mr. Michael A. Greenfield, Program Manager for Materials, Code RTM-6
	National Aeronautics and Space Administration, Lewis Research Center, Cleveland, OH 44135
1	ATTN: Dr. James A. DiCarlo, Mail Stop 106-1
	National Aeronautics and Space Administration, Marshall Space Flight Center, Huntsville, AL 35812
1	ATTN: R. J. Schwinghammer, EH01, Dir, M&P Lab
1	Mr. W. A. Wilson, EH41, Bldg. 4612
	The Boeing Vertol Company, P.O. Box 16858, Philadelphia, PA 19142
1	ATTN: Mr. Robert L. Pinckney, Mail Stop P62-06
1	Mr. Joseph W. Lenski, Jr., Mail Stop P32-09
	E. I. DuPont De Nemours and Company, Inc., Textile Fibers Department, Pioneering Research Laboratory, Experimental Station, Wilmington, DE 19898
1	ATTN: Blake R. Bichlmeir
	Mr. Rex C. Claridge, TRW, Incorporated, Manufacturing Division, Mail Stop 01-2210, 1 Space Park, Redondo Beach, CA 90278
1	Dr. James A. Cornie, Materials Processing Center, Bldg. 8, Room 237, Massachusetts Institute of Technology, 77 Massachusetts Avenue, Cambridge, MA 01239

No. of Copies	To
1	Dr. Bhagwan K. Das, Engineering Technology Supervisor, The Boeing Company, P.O. Box 3999, Seattle, WA 98124
1	Leroy Davis, NETCO, 592 Dryad Road, Santa Monica, CA 9042-1318
1	Mr. Joseph F. Dolowy, Jr., President, DWA Composite Specialties, Inc., 21133 Superior Street, Chatsworth, CA 91311
1	Mr. Robert E. Fisher, President, AMERCOM, Inc., 8948 Fullbright Avenue, Chatsworth, CA 91311
1	Mr. Louis A. Gonzalez, Kaman Tempo, 816 State Street, Santa Barbara, CA 93101
1	Prof. James G. Goree, Dept. of Mechanical Engineering, Clemson University, Clemson, SC 29631
1	William F. Grant, AVCO Specialty Materials Division, 2 Industrial Avenue, Lowell, MA 01851
1	Mr. Jacob Gubbay, Charles Stark Draper Laboratories, 555 Technology Square, Mail Station 27, Cambridge, MA 02139
1	Mr. John E. Hack, Southwest Research Institute, 6220 Culebra Road, San Antonio, TX 78284
1	Dr. H. A. Katzman, The Aerospace Corporation, P.O. Box 92957 Los Angeles, CA 90009
	Lockheed California Company, Burbank, CA 91520
1	ATTN: Mr. Rod F. Simenz, Department of Materials and Processes
	Lockheed Georgia Company, 86 South Cobb Drive, Marietta, GA 30063
1	ATTN: Materials and Processes Engineering Department
1	Mr. James Carroll
	Material Concepts, Inc., 2747 Harrison Road, Columbus, OH 43204
1	ATTN: Mr. Stan J. Paprocki
1	Mr. David Goddard
1	Dr. Mohan S. Misra, Martin Marietta Aerospace, P.O. Box 179, Denver, CO 80201
1	Mr. Patrick J. Moore, Staff Engineer, Lockheed Missiles and Space Company, Organization 62-60, Building 104, P.O. Box 504, Sunnyvale, CA 94086
1	R. Byron Pipes, Professor & Director, Center for Composite Materials, University of Delaware, Newark, DE 19711
1	Dr. Karl M. Prewo, Principal Scientist, United Technologies Research Center, Mail Stop 24, East Hartford, CT 06108
1	Dr. B. W. Rosen, Materials Sciences Corporation, Gwynedd Plaza 11, Bethlehem Pike, Spring House, PA 19477
1	Prof. Marc H. Richman, Division of Engineering, Brown University, Providence, RI 02912
1	Mr. Ronald P. Tye, Energy Materials Testing Laboratory, Biddeford Industrial Park, Biddeford, ME 04005
1	Prof. Franklin E. Wawner, Department of Materials Science, School of Engineering and Applied Sciences, University of Virginia, Charlottesville, VA 22903
1	Dr. Carl Zweben, General Electric Company, Valley Forge Space Center/M4018, P.O.Box 8555, Philadelphia, PA 19101
	Director, U.S. Army Materials Technology Laboratory, Watertown, MA 02172-0001
2	ATTN: SLCMT-IML
2	Authors

U.S. Army Materials Technology Laboratory, Watertown, Massachusetts 02172-0001 FLAME CUTTING TEXTURED STEEL ARMOR William S. Ricci and John A. Saccoccio Technical Report MTL TR 88-20, June 1988, 5 pp - illus-tables, D/A Project IL263102D071 Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat. The delayed nature of the transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking. Recommended practices for flame cutting textured steel armor are presented.	AD UNCLASSIFIED UNLIMITED DISTRIBUTION Key Words Cutting Flame Textured	U.S. Army Materials Technology Laboratory, Watertown, Massachusetts 02172-0001 FLAME CUTTING TEXTURED STEEL ARMOR William S. Ricci and John A. Saccoccio Technical Report MTL TR 88-20, June 1988, 5 pp - illus-tables, D/A Project IL263102D071 Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat. The delayed nature of the transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking. Recommended practices for flame cutting textured steel armor are presented.	AD UNCLASSIFIED UNLIMITED DISTRIBUTION Key Words Cutting Flame Textured
--	--	--	--

U.S. Army Materials Technology Laboratory, Watertown, Massachusetts 02172-0001 FLAME CUTTING TEXTURED STEEL ARMOR William S. Ricci and John A. Saccoccio Technical Report MTL TR 88-20, June 1988, 5 pp - illus-tables, D/A Project IL263102D071 Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat. The delayed nature of the transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking. Recommended practices for flame cutting textured steel armor are presented.	AD UNCLASSIFIED UNLIMITED DISTRIBUTION Key Words Cutting Flame Textured	U.S. Army Materials Technology Laboratory, Watertown, Massachusetts 02172-0001 FLAME CUTTING TEXTURED STEEL ARMOR William S. Ricci and John A. Saccoccio Technical Report MTL TR 88-20, June 1988, 5 pp - illus-tables, D/A Project IL263102D071 Lamellar and transverse edge cracks develop when textured steel armor is flame cut without preheat. The delayed nature of the transverse edge cracking suggests a contributing failure mechanism of hydrogen induced cracking. Recommended practices for flame cutting textured steel armor are presented.	AD UNCLASSIFIED UNLIMITED DISTRIBUTION Key Words Cutting Flame Textured
--	--	--	--