

AD-A106 206


HORNER AND SHIFRIN INC ST LOUIS MO
NATIONAL DAM SAFETY PROGRAM, VATTEROTT LAKE DAM (MO 30429), UPP--ETC(U)
MAR 81 R E SAUTHOFF, A B BECKER
DACW43-81-C-0002

F/G 13/13

NL

UNCLASSIFIED

1 OF 1
AD-A
115206

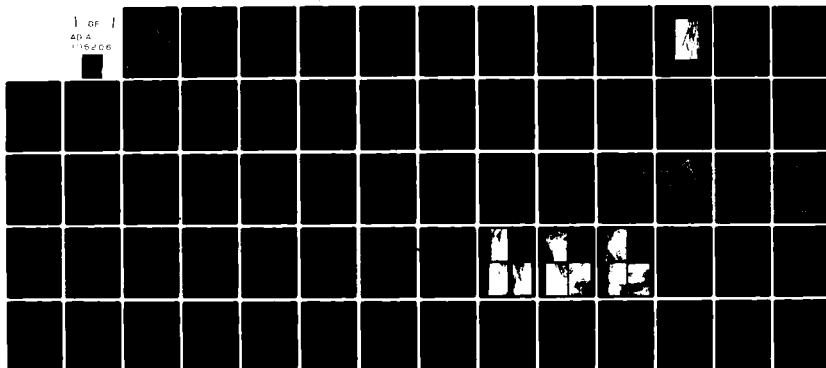

END

DATE

FILED

11-81

DTIC

AC A106206

LEVEL II

①

UPPER MISSISSIPPI - KASKASKIA - ST. LOUIS BASIN

**VATTEROTT LAKE DAM
JEFFERSON COUNTY, MISSOURI
MO 30429**

**DTIC
ELECTE
OCT 26 1981
S E**

PHASE 1 INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM



**United States Army
Corps of Engineers**

*... Serving the Army
... Serving the Nation*

St. Louis District

DTIC FILE COPY

**PREPARED BY: U.S. ARMY ENGINEER DISTRICT, ST. LOUIS
FOR: STATE OF MISSOURI**

This document has been approved
for public release and sale; its
distribution is unlimited.

MARCH 1981

81 10 21

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM	
1. REPORT NUMBER	2. GOVT ACCESSION NO. AD-A400	3. RECIPIENT'S CATALOG NUMBER	
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Vatterott Lake Dam (MO 30429) Jefferson County, Missouri		5. TYPE OF REPORT & PERIOD COVERED 9 Final Report	
		6. PERFORMING ORG. REPORT NUMBER	
7. AUTHOR(s) Horner & Shifrin, Inc.		8. CONTRACT OR GRANT NUMBER(s) 13 DACW43-81-C-0062	
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS	
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		12. REPORT DATE 11 March 1981 (12) 66	
		13. NUMBER OF PAGES Approximately 70	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) 10 Ralph E. /Sauthoff Albert B. /Becker, Jr		15. SECURITY CLASS. (of this report) UNCLASSIFIED	
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report) Approved for release; distribution unlimited.			
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) 6 National Dam Safety Program. Vatterott Lake Dam (MO 30429), Upper Mississippi - Kaskaskia - St. Louis Basin, Jefferson County, Missouri. Phase I Inspection Report.			
18. SUPPLEMENTARY NOTES			
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams			
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.			

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED 442 555

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)



SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

INSTRUCTIONS FOR PREPARATION OF REPORT DOCUMENTATION PAGE

RESPONSIBILITY. The controlling DoD office will be responsible for completion of the Report Documentation Page, DD Form 1473, in all technical reports prepared by or for DoD organizations.

CLASSIFICATION. Since this Report Documentation Page, DD Form 1473, is used in preparing announcements, bibliographies, and data banks, it should be unclassified if possible. If a classification is required, identify the classified items on the page by the appropriate symbol.

COMPLETION GUIDE

General. Make Blocks 1, 4, 5, 6, 7, 11, 13, 15, and 16 agree with the corresponding information on the report cover. Leave Blocks 2 and 3 blank.

Block 1. Report Number. Enter the unique alphanumeric report number shown on the cover.

Block 2. Government Accession No. Leave Blank. This space is for use by the Defense Documentation Center.

Block 3. Recipient's Catalog Number. Leave blank. This space is for the use of the report recipient to assist in future retrieval of the document.

Block 4. Title and Subtitle. Enter the title in all capital letters exactly as it appears on the publication. Titles should be unclassified whenever possible. Write out the English equivalent for Greek letters and mathematical symbols in the title (see "Abstracting Scientific and Technical Reports of Defense-sponsored RDT/E," AD-667 000). If the report has a subtitle, this subtitle should follow the main title, be separated by a comma or semicolon if appropriate, and be initially capitalized. If a publication has a title in a foreign language, translate the title into English and follow the English translation with the title in the original language. Make every effort to simplify the title before publication.

Block 5. Type of Report and Period Covered. Indicate here whether report is interim, final, etc., and, if applicable, inclusive dates of period covered, such as the life of a contract covered in a final contractor report.

Block 6. Performing Organization Report Number. Only numbers other than the official report number shown in Block 1, such as series numbers for in-house reports or a contractor/grantee number assigned by him, will be placed in this space. If no such numbers are used, leave this space blank.

Block 7. Author(s). Include corresponding information from the report cover. Give the name(s) of the author(s) in conventional order (for example, John R. Doe or, if author prefers, J. Robert Doe). In addition, list the affiliation of an author if it differs from that of the performing organization.

Block 8. Contract or Grant Number(s). For a contractor or grantee report, enter the complete contract or grant number(s) under which the work reported was accomplished. Leave blank in in-house reports.

Block 9. Performing Organization Name and Address. For in-house reports enter the name and address, including office symbol, of the performing activity. For contractor or grantee reports enter the name and address of the contractor or grantee who prepared the report and identify the appropriate corporate division, school, laboratory, etc., of the author. List city, state, and ZIP Code.

Block 10. Program Element, Project, Task Area, and Work Unit Numbers. Enter here the number code from the applicable Department of Defense form, such as the DD Form 1498, "Research and Technology Work Unit Summary" or the DD Form 1634, "Research and Development Planning Summary," which identifies the program element, project, task area, and work unit or equivalent under which the work was authorized.

Block 11. Controlling Office Name and Address. Enter the full, official name and address, including office symbol, of the controlling office. (Equates to funding/sponsoring agency. For definition see DoD Directive 5200.20, "Distribution Statements on Technical Documents.")

Block 12. Report Date. Enter here the day, month, and year or month and year as shown on the cover.

Block 13. Number of Pages. Enter the total number of pages.

Block 14. Monitoring Agency Name and Address (if different from Controlling Office). For use when the controlling or funding office does not directly administer a project, contract, or grant, but delegates the administrative responsibility to another organization.

Blocks 15 & 15a. Security Classification of the Report: Declassification/Downgrading Schedule of the Report. Enter in 15 the highest classification of the report. If appropriate, enter in 15a the declassification/downgrading schedule of the report, using the abbreviations for declassification/downgrading schedules listed in paragraph 4-207 of DoD 5200.1-R.

Block 16. Distribution Statement of the Report. Insert here the applicable distribution statement of the report from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 17. Distribution Statement (of the abstract entered in Block 20, if different from the distribution statement of the report). Insert here the applicable distribution statement of the abstract from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 18. Supplementary Notes. Enter information not included elsewhere but useful, such as: Prepared in cooperation with . . . Translation of (or by) . . . Presented at conference of . . . To be published in . . .

Block 19. Key Words. Select terms or short phrases that identify the principal subjects covered in the report, and are sufficiently specific and precise to be used as index entries for cataloging, conforming to standard terminology. The DoD "Thesaurus of Engineering and Scientific Terms" (TEST), AD-672 000, can be helpful.

Block 20. Abstract. The abstract should be a brief (not to exceed 200 words) factual summary of the most significant information contained in the report. If possible, the abstract of a classified report should be unclassified and the abstract to an unclassified report should consist of publicly-releasable information. If the report contains a significant bibliography or literature survey, mention it here. For information on preparing abstracts see "Abstracting Scientific and Technical Reports of Defense-Sponsored RDT&E," AD-667 000.

UPPER MISSISSIPPI - KASKASKIA - ST. LOUIS BASIN

VATTEROTT LAKE DAM

JEFFERSON COUNTY, MISSOURI

MO 30429

PHASE 1 INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM



**United States Army
Corps of Engineers**

*Serving the Army
Serving the Nation*

St. Louis District

Accession For	
NTIS GR&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	☐
By _____	
Distribution/ _____	
Availability Codes	
Dist	Avail and/or Special
A	

PREPARED BY: U.S. ARMY ENGINEER DISTRICT, ST. LOUIS
FOR: STATE OF MISSOURI

MARCH 1981



DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 TUCKER BOULEVARD, NORTH
ST. LOUIS, MISSOURI 63101

REPLY TO:
ATTENTION OF

LMSD-P

SUBJECT: Vatterott Lake Dam Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Vatterott Lake Dam (MO 30429):

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

- 1) Spillway will not pass 50 percent of the Probable Maximum Flood without overtopping the dam.
- 2) Overtopping of the dam could result in failure of the dam.
- 3) Dam failure significantly increases the hazard to loss of life downstream.

SIGNED

SUBMITTED BY: _____
Chief, Engineering Division

10 Apr 81
Date

SIGNED

APPROVED BY: _____
Colonel, CE, District Engineer

14 Apr 81
Date

VATTEROTT LAKE DAM

MISSOURI INVENTORY NO. 30429

JEFFERSON COUNTY, MISSOURI

PHASE I INSPECTION REPORT

NATIONAL DAM SAFETY PROGRAM

PREPARED BY:

HORNER & SHIFRIN, INC.

5200 OAKLAND AVENUE

ST. LOUIS, MISSOURI 63110

FOR

U. S. ARMY ENGINEER DISTRICT, ST. LOUIS

CORPS OF ENGINEERS

MARCH 1981

HS-8088

PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM

Name of Dam:	Vatterott Lake Dam
State Located:	Missouri
County Located:	Jefferson
Stream:	Tributary of Sandy Creek
Date of Inspection:	6 November 1980

The Vatterott Lake Dam, which according to the St. Louis District, Corps of Engineers, is of high hazard potential, was visually inspected by engineering personnel of Horner & Shifrin, Inc., Consulting Engineers, St. Louis, Missouri. The purpose of this inspection was to assess the general condition of the dam with respect to safety and, based upon this inspection and available data, determine if the dam poses an inordinate danger to human life or property. Evaluation of this dam was performed in accordance with the "Phase I" investigation procedures prescribed in "Recommended Guidelines for Safety Inspection of Dams", dated May 1975.

The following summarizes the findings of the visual inspection and the results of certain hydrologic/hydraulic investigations performed under the direction of the inspection team. Based on the visual inspection and the results of these hydrologic/hydraulic investigations, the present general condition of the dam is considered to be less than satisfactory. Deficiencies observed during the inspection which are considered to have an adverse effect on the overall safety and future operation of the dam include such items as seepage, erosion of the embankment, trees and dense brush on the dam, possible dam settlement, an obstructed spillway approach, a badly eroded spillway outlet channel, and a large marshy area just downstream of the dam that could be detrimental to the stability of the embankment.


According to the criteria set forth in the recommended guidelines, the magnitude of the spillway design flood for the Vatterott Lake Dam, which according to Table 1 of the guidelines, is classified as intermediate in size,


is specified, according to Table 3 of the guidelines for a high hazard dam of intermediate size, to be the Probable Maximum Flood (PMF). The Probable Maximum Flood (PMF) is the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region.

Results of a hydrologic/hydraulic analysis indicated that the spillway is inadequate to pass lake outflow resulting from a storm of PMF magnitude or the outflow resulting from the 1 percent (100-year frequency) flood without overtopping the dam. The spillway is capable, however, of passing lake outflow resulting from the ten percent chance (10-year frequency) flood and the outflow corresponding to about 11 percent of the PMF. According to the St. Louis District, Corps of Engineers, the length of the downstream damage zone, should failure of the dam occur, is estimated to be three miles. Accordingly, within the possible damage zone are six dwellings, including three mobile homes, a sewage treatment lagoon, State Highway 21, and a covered bridge at Lemay Ferry Road and the stream crossing.

A review of available data did not disclose that seepage or stability analyses of this dam were performed. This is considered a deficiency and should be rectified.

It is recommended that the Owner take the necessary action in the near future to correct or control the deficiencies and safety defects reported herein. The provision of additional spillway capacity should be pursued on a high priority basis since the existing spillways are considered to be seriously inadequate.


Ralph E. Sauthoff
P. E. Missouri E-19090


Albert B. Becker, Jr.
P. E. Missouri E-9168



PHASE 1 INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
VATTEROTT LAKE DAM - MO 30429

TABLE OF CONTENTS

<u>Paragraph No.</u>	<u>Title</u>	<u>Page No.</u>
SECTION 1 - PROJECT INFORMATION		
1.1	General	1-1
1.2	Description of Project	1-1
1.3	Pertinent Data	1-4
SECTION 2 - ENGINEERING DATA		
2.1	Design	2-1
2.2	Construction	2-1
2.3	Operation	2-1
2.4	Evaluation	2-2
SECTION 3 - VISUAL INSPECTION		
3.1	Findings	3-1
3.2	Evaluation	3-5
SECTION 4 - OPERATIONAL PROCEDURES		
4.1	Procedures	4-1
4.2	Maintenance of Dam	4-1
4.3	Maintenance of Operating Facilities	4-1
4.4	Description of Any Warning System in Effect	4-1
4.5	Evaluation	4-1

<u>Paragraph No.</u>	<u>Title</u>	<u>Page No.</u>
	SECTION 5 - HYDRAULIC/HYDROLOGIC	
5.1	Evaluation of Features	5-1
	SECTION 6 - STRUCTURAL STABILITY	
6.1	Evaluation of Structural Stability	6-1
	SECTION 7 - ASSESSMENT/REMEDIAL MEASURES	
7.1	Dam Assessment	7-1
7.2	Remedial Measures	7-2

LIST OF PLATES

<u>Plate No.</u>	<u>Title</u>
1	Regional Vicinity Map
2	Lake Watershed Map
3	Dam Plan & Profile
4	Dam Cross-Sections
5	Spillway Profile & Cross-Section

APPENDIX A - INSPECTION PHOTOGRAPHS

<u>Page No.</u>	<u>Title</u>
A-1 through A-3	Inspection Photographs

APPENDIX B - HYDROLOGIC AND HYDRAULIC ANALYSES

<u>Page No.</u>	<u>Title</u>
B-1 thru B-3	Hydrologic and Hydraulic Computations
B-4 thru B-8	Computer Input Data
B-9 thru B-12	Computer Output Data
B-13	Lake Surface Area, Elevation and Storage Volume, Summary of Dam Safety Analyses for PMF
B-14	Summary of Dam Safety Analyses for 1 Percent Chance and 10 Percent Chance Floods
B-15	Inflow-Outflow Hydrographs for PMF and 1 Percent Chance Floods

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
VATTEROTT LAKE DAM - MO 30429
SECTION 1 - PROJECT INFORMATION

1.1 GENERAL

a. Authority. The National Dam Inspection Act, Public Law 92-367, dated 8 August 1972, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a program of safety inspection of dams throughout the United States. Pursuant to the above, the St. Louis District, Corps of Engineers, directed that a safety inspection of the Vatterott Lake Dam be made.

b. Purpose of Inspection. The purpose of this visual inspection was to make an assessment of the general condition of the above dam with respect to safety and, based upon available data and this inspection, determine if the dam poses an inordinate danger to human life or property.

c. Evaluation Criteria. This evaluation was performed in accordance with the "Phase I" investigation procedures as prescribed in "Recommended Guidelines for Safety Inspection of Dams," Appendix D to "Report to the Chief of Engineers on the National Program of Inspection of Non-Federal Dams," dated May 1975.

1.2 DESCRIPTION OF PROJECT

a. Description of Dam and Appurtenances. The Vatterott Lake Dam is an earthfill type embankment rising approximately 40 feet above the downstream toe of the barrier at its lowest point of foundation surface. This low point ordinarily occurs at the location of the original stream crossing, but in this case, was found to be near the center of the dam where a low area exists, which, according to the Owner, was present prior to construction of the dam. The embankment has an upstream slope of approximately 1v on 1.9h which extends from the dam crest to a 12-foot wide berm located about 1 foot below the normal waterline. Below the berm, the upstream slope is unknown. Above the

berm, the upstream face of the dam is protected by limestone riprap. The slope of the downstream face of the dam varies somewhat, but appears to be no steeper than 1v on 2.5h. The width of the dam crest is on the order of 30 feet and a roadway surfaced with crushed limestone traverses the top of the dam. The length of the dam is approximately 650 feet. A plan and profile of the dam is shown on Plate 3, and cross-sections of the dam at the location of the original stream and the low area to the left of the original stream, are shown on Plate 4. An overview photograph of the dam is shown following the preface at the front of the report. At normal pool elevation, the reservoir impounded by the dam occupies approximately 14 acres.

The dam has both a principal and an emergency spillway. The principal spillway is a culvert type consisting of three 24-inch diameter corrugated metal pipes and is located at the right, or west, abutment. The pipes are uncontrolled. A concrete slab protects the top of the dam at the location of the spillway pipes. The slab also serves as the invert for a shallow trapezoidal section which will function as an emergency spillway if required. Just downstream of the spillway pipes, the spillway outlet channel, which is common to both spillways, is protected for about 30 feet with concrete pavement. However, erosion has badly undermined the pavement and it is broken into numerous large sections exposing the subgrade in many places. Beyond the paved section, sandstone bedrock is exposed in the channel invert. The outlet channel joins a natural draw at a point about 350 feet downstream of the center of the dam; the draw, in turn, joins the original stream channel about 400 feet downstream of the dam center. A cross-section of the two spillways and a profile of the spillway channel are shown on Plate 5.

b. Location. The dam is located on an unnamed tributary of Sandy Creek, about 1.5 miles north and 0.5 mile west of the junction of Glade Chapel Road and State Highway 21; approximately 1.5 miles northwest of the community of Goldman, Missouri, as shown on the Regional Vicinity Map, Plate 1. The dam is located within the southeast one-quarter of Section 2, Township 41 North, Range 4 East, in Jefferson County.

c. Size Classification. The size classification based on the height of the dam and storage capacity, is categorized as intermediate. (Per Table 1, Recommended Guidelines for Safety Inspection of Dams.)

d. Hazard Classification. The Vatterott Lake Dam, according to the St. Louis District, Corps of Engineers, has a high hazard potential, meaning that if the dam should fail, there may be loss of life, serious damage to homes, or extensive damage to agricultural, industrial and commercial facilities, important public utilities, main highways, or railroads. The estimated flood damage zone, should failure of the dam occur, as determined by the St. Louis District, extends three miles downstream of the dam. Within the possible damage zone are six dwellings, including three mobile homes, a sewage treatment lagoon, State Highway 21, and a covered bridge at Lemay Ferry Road and the stream crossing. Those features lying within the downstream damage zone reported by the Corps of Engineers, St. Louis District, were verified by the inspection team.

e. Ownership. The lake and dam are owned by Harvey Vatterott, Sr. Mr. Vatterott's address is: Vatterott Realty & Building Company, Box 10637, St. Louis, Missouri 63129.

f. Purpose of Dam. The dam impounds water for recreational use.

g. Design and Construction History. According to the Owner, the dam was constructed in about 1962 by Herman Mathias, a local excavating contractor. The Owner reported that the proportions of the dam, i.e., the slopes and crest width, were selected by Ted Hurtgen, Sr., of Jefferson County Surveying Company, Hillsboro, Missouri. However, the Owner indicated that he was responsible for the design of the dam's spillway. The Owner also reported that the downstream side of the dam was pressure grouted in 1966; however, the identity of the Contractor that performed the work could not be recalled. No records of the design of the embankment or construction of the dam are known to exist.

h. Normal Operational Procedure. The lake level is unregulated. Lake outflow is governed by the capacities of three 24-inch diameter, culvert type pipes.

1.3 PERTINENT DATA

a. Drainage Area. The drainage area tributary to the lake is for the most part in a native state covered with timber. The watershed above the dam amounts to approximately 231 acres. The watershed area is outlined on Plate 2.

b. Discharge at Damsite.

- (1) Estimated known maximum flood at damsite ... 63 cfs* (W.S.Elev. 587.8)
- (2) Spillway capacity (principal + emergency) ... 81 cfs (W.S.Elev. 588.0)
 - a. Principal ... 50 cfs
 - b. Emergency ... 31 cfs

c. Elevation (Ft. above MSL). Except where noted, the following elevations were determined by survey and are based on topographic data shown on the 1954 Belew Creek, Missouri, Quadrangle Map, 7.5 Minute Series, photorevised 1968 and 1974.

- (1) Observed pool ... 584.6
- (2) Normal pool ... 585.0
- (3) Spillway crest
 - a. Principal ... 585.0
 - b. Emergency ... 587.6
- (4) Maximum experienced pool ... 587.8*
- (5) Top of dam 588.0 (min.)
- (6) Streambed at centerline of dam ... 551₊ (Est.)
- (7) Maximum tailwater ... Unknown
- (8) Observed tailwater ... None

d. Reservoir.

- (1) Length at normal pool (Elev. 585.0) ... 1,600 ft.
- (2) Length at maximum pool (Elev. 588.0) ... 1,700 ft.

*Approximate; Owner reported that his son-in-law had observed evidence indicating that flow had passed emergency spillway; however, actual depth of flow is unknown.

e. Storage.

- (1) Normal pool ... 156 ac. ft.
- (2) Top of dam ... 200 ac. ft.

f. Reservoir Surface Area.

- (1) Normal pool ... 14 acres
- (2) Top of dam (incremental) ... 15 acre

g. Dam. The height of the dam is defined to be the overall vertical distance from the lowest point of foundation surface at the downstream toe of the barrier to the top of the dam.

- (1) Type ... Earthfill
- (2) Length ... 650 ft.
- (3) Height ... 40 ft.
- (4) Top width ... 30 ft. (min.)
- (5) Side slopes
 - a. Upstream ... 1v on 1.9h (above wave berm)
 - b. Downstream ... 1v on 2.5h (max.)
- (6) Cutoff ... Core trench*
- (7) Slope protection
 - a. Upstream ... Limestone riprap
 - b. Downstream ... Grass

h. Principal Spillway.

- (1) Type ... Culvert, uncontrolled, three 24-inch diameter corrugated metal pipes
- (2) Location ... Right abutment
- (3) Crest ... Elevation 585.0 (center pipe)
- (4) Approach channel ... Lake
- (5) Outlet channel ... Earth cut, irregular trapezoidal section

*Per Owner.

i. Emergency Spillway.

- (1) Type ... Uncontrolled, trapezoidal section, concrete invert
- (2) Location ... Right abutment, above spillway pipes
- (3) Crest ... Elevation 587.6
- (4) Approach channel ... Lake
- (5) Outlet channel ... Same as for principal spillway

j. Lake Drawdown Facility ... None

SECTION 2 - ENGINEERING DATA

2.1 DESIGN

Data relative to the design of the dam were unavailable. According to the Owner, the proportions of the dam, i.e., the slopes of the dam (1v on 3h upstream and 1v on 2h downstream) and crest width, were selected by Ted Hurtgen, Sr. of Jefferson County Surveying Company, Hillsboro, Missouri. According to Ted Hurtgen, Jr. (Mr. Hurtgen, Sr. is deceased), there are no records of the design. In any event, the Owner mentioned that stability analyses of the dam were not performed. As previously indicated, the size of the spillway outlet was determined by the Owner.

2.2 CONSTRUCTION

As previously stated, the dam was constructed about 1962 by Herman Mathias, a local excavating contractor. The Owner reported that test borings were not drilled, but that the subsurface rock profile of the areas to be occupied by the dam and reservoir was determined by seismic sounding prior to construction. According to the Owner, a core trench for seepage cutoff was excavated along the axis of the dam. The average depth of the trench was approximately 5 feet, and it extended to rock throughout. The Owner stated that neither the area to be occupied by the lake nor the valley just downstream of the dam were disturbed during construction, but that the material used to backfill the core trench and construct the embankment was clay obtained from the hillsides just east and west of the dam. The Owner also recalled that the embankment material was compacted using a sheepsfoot roller. Records of the construction of the dam were unavailable. Efforts to contact Mr. Mathias were unsuccessful.

2.3 OPERATION

The lake level is uncontrolled and governed by the upstream elevation (crest) of the invert of the center pipe of three 24-inch diameter pipes. The Owner reported that the lake level is normally at or near the spillway crest; however, the level has dropped about 1 foot during very dry weather, such as

occurred this past summer. No indication was found that the dam has been overtopped. The Owner reported that the dam has never been overtopped and that to his knowledge, the highest lake level experienced to date produced a depth of flow that just exceeded the crest of the concrete slab emergency spillway located just above the three 24-inch diameter pipes.

2.4 EVALUATION

a. Availability. Engineering data for assessing the design of the dam and spillways were unavailable.

b. Adequacy. No data available. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS

a. General. A visual inspection of the Vatterott Lake Dam was made by Horner & Shifrin engineering personnel, R. E. Sauthoff, Civil Engineer, H. B. Lockett, Hydrologist, and A. B. Becker, Jr., Civil and Soils Engineer, on 6 November 1980. An examination of the dam area was also made by an engineering geologist, Jerry D. Higgins, Ph.D., a consultant retained by Horner & Shifrin for the purpose of assessing the site geology. Also examined at the time of the inspection were the areas and features below the dam within the potential flood damage zone. Photographs of the dam taken at the time of the inspection are included on pages A-1 through A-3 of Appendix A. The locations of the photographs taken during the inspection are indicated on Plate 3.

b. Site Geology. Vatterott Lake is located in a southward-flowing tributary to Sandy Creek. The topography around the lake site is moderately sloping, with relief between the lake and surrounding drainage divides ranging up to approximately 290 feet. The area is included within the northeastern part of the Ozark Plateaus Physiographic Province.

The bedrock formations consist of gently northeastward-dipping Ordovician-age sedimentary strata of the Jefferson City-Cotter and St. Peter formations. The dam and reservoir are located entirely on the Jefferson City-Cotter formation, and much of the drainage basin is underlain by the St. Peter formation. The actual formation contact is covered by colluvium. Exposures of the base of the St. Peter formation were evident along the base of the steep slope on the west side of the reservoir, and weathered sand exposures were noted near the east abutment. The Jefferson City-Cotter formation is exposed in the spillway channel. No faulting was observed or reported in the vicinity of the dam site.

The Jefferson City-Cotter formation is a light brown, medium-to-finely crystalline dolomite or argillaceous dolomite. It is thin- to medium-bedded, often argillaceous, and cherty. Solution enlargement of joints and bedding planes is common, and the contact between bedrock and the overlying soils is

generally very irregular as a result of the solution weathering. These solution features are commonly the cause of reservoir leakage when the soil cover is thin. The St. Peter formation is a white, fine- to medium-grained pure quartz sandstone. It is massively bedded and, although loosely cemented, exposed rock surfaces are generally case-hardened by weathering processes. Weathered exposures around the dam site are red-brown in color and friable. Exposures on the west side of the reservoir are not highly weathered and are white in color.

The soils in the vicinity of the reservoir are composed principally of clay (CL, Unified Soil Classification System) derived from the in-place weathering of the dolomites. At the base of the valley walls, sandy colluvium has mixed with the clay residuum forming a somewhat sandy clay (CL to SC). These soils do not appear to be especially susceptible to erosion or seepage, although some minor erosion was noted in the sandy soils below the east abutment.

The most significant geologic condition noted at the site is the permeable bedrock and its susceptibility to solution weathering. At the time of inspection, it appeared that there was no excessive water loss from the reservoir. No other geologic conditions were observed that would be expected to adversely affect the performance of the dam embankment.

c. Dam. The visible portions of the upstream and downstream faces of the dam as well as the dam crest (see Photos 1, 2 and 3) were examined and found to be in sound condition, although an erosion gully approximately 1.5 feet deep and 3 feet wide was noticed in the downstream slope near the top of the dam in the vicinity of station 1+50, and numerous smaller gullies, on the order of 1 foot deep and up to 2 feet wide, were found just above the toe of the downstream slope. Limestone riprap, average size about 12 inches with some stones up to 24 inches, existed across the entire upstream face of the dam. The riprap extended from the wave berm to an elevation about 1.5 feet above the normal waterline. No erosion of the upstream face of the dam was noticed, although the riprap was somewhat sparse near the left end of the dam. Above the riprap and across almost the entire upstream face of the dam, small willow trees up to 2 inches in diameter and sprouting willow tree stumps

up to 6 inches in diameter were observed. The crushed stone roadway traversing the top of the dam was in reasonably good condition except near the left end of the dam where the road section was rutted and the stone surfacing was missing. Trees, up to 10 inches in diameter, and several areas of dense brush were observed on the downstream face of the dam. The turf cover on the embankment, a combination of fescue, lespedeza and weeds up to 4 feet high, covered the otherwise unprotected areas of the dam. No animal burrows were noticed; however, because of the dense brush and high grass on the downstream slope, it cannot be concluded that none exist. Examination of a soil sample obtained from the downstream side of the embankment near the center of the dam, indicated the surficial material of the dam to be a yellow-brown, slightly sandy, silty lean clay (CL) of low-to-medium plasticity.

According to survey data obtained during the inspection, the top of the dam in the vicinity of the original stream crossing was found to be approximately 0.9 foot lower than the top of the dam at its highest point. It is possible that the dam has experienced some settlement, particularly through the area of the original stream location.

Some seepage, as evidenced by soft ground, standing water, and cattails, was observed at the toe of the dam between stations 3+00 and 5+00 and near the left abutment (see Photo 3) between stations 6+40 and 6+90. The amount of seepage could not be quantified since flow was indistinguishable.

A large marshy area, with standing water, cattails and willow trees, approximately 230 feet wide and several hundred feet long (see Photo 4) in the direction of the valley was observed just downstream of the dam. No provisions for drainage of the area were noticed. The Owner reported that this low area existed prior to construction of the dam. However, judging by the topography adjacent to the original stream, it did appear that the area had been a source of borrow for some unknown purpose.

The upstream and downstream ends of the three 24-inch diameter corrugated metal pipes of the principal spillway (see Photos 5 and 6) were examined and found to be in satisfactory condition. As far as could be determined, the bituminous coating on the interior of the pipes appeared to be intact;

however, some minor rusting of the exterior galvanized surface at the scarfed ends of the pipes was noted. Dense undergrowth consisting of small willow trees and horsetails (see Photo 7) congested the area immediately upstream of the pipes. Just downstream of the pipes, the spillway outlet channel through the paved section, a distance of about 30 feet, was badly eroded. Erosion had undermined the concrete pavement up to a depth of about 3 feet beginning at the ends of the pipes (see Photo 6), and large sections of pavement, on the order of 3 feet wide by 6 feet long, (see Photo 8) were strewn about the channel invert. At an elevation approximately 3 feet below the end of the center pipe, some seepage was observed emerging from the vertical bank. Seepage observed within the spillway channel just downstream of the paved section (see Photo 9) was estimated to be on the order of 0.5 gpm. Downstream of the paved section, the outlet channel was found to be in satisfactory condition, although some minor erosion of the channel banks was noted. The concrete slab that serves to protect the dam and function as the invert of the emergency spillway was also examined and found to be in good condition. No evidence of cracking or spalling of the surface of the concrete slab was noticed.

d. Appurtenant Structures. No appurtenant structures were observed at this dam site.

e. Downstream Channel. Except at road and highway crossings, the channel downstream of the dam within the potential flood damage zone is unimproved. The channel section is irregular, of variable width, and for the most part, lined with trees.

f. Reservoir. For the most part, the hillsides contingent to the reservoir are covered with trees. A small house is located adjacent to the west side of the lake. No significant erosion of the lake banks was observed. At the time of the inspection, the lake was about 0.4 foot below normal pool level and the water within the reservoir was clear. The amount of sediment within the lake could not be determined at the time of the inspection; however, due to the vegetation covering the surrounding area, it is not expected to be significant.

3.2 EVALUATION

The deficiencies observed during the inspection and noted herein are not considered significant to warrant immediate remedial action. However, it is recommended that, as soon as practical, the eroded areas of the outlet channel just downstream of the spillway pipes be restored and some durable form of protection be provided in order to prevent future erosion of the channel banks and invert by spillway releases.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 PROCEDURES

The spillway is uncontrolled. The lake surface level is governed by precipitation runoff, evaporation, seepage, and the capacity of the uncontrolled spillway.

4.2 MAINTENANCE OF DAM

According to the Owner, the dam has not experienced problems with sliding, cracking, burrowing animals, settlement of the dam, or excessive seepage. It was reported that trees were removed from the upstream face of the dam 2 years ago, and that they will again be removed next year. The Owner stated that trees on the downstream face have not been removed and that the grass on the dam crest is cut at least once during the growing season.

As previously indicated, the downstream side of the dam was pressure grouted in 1966. The Owner reported that some seepage was observed within the original stream channel at a point about 50 feet from the toe of the dam prior to grouting. The Owner indicated that grouting of the dam was done more as a precaution than as a necessity.

4.3 MAINTENANCE OF OPERATING FACILITIES

No facilities requiring operation exist at this dam.

4.4 DESCRIPTION OF ANY WARNING SYSTEM IN EFFECT

The inspection did not reveal the existence of a dam failure warning system.

4.5 EVALUATION

It is recommended that maintenance of the dam include the removal of trees and brush on the downstream face of the dam as well as more frequent cutting

of grass during the growing season. Measures should be taken to prevent further erosion of the outlet channel just downstream of the spillway. Clearing of the area just upstream of the spillway is also advised since the vegetation that exists in this area is an obstruction that can impede lake outflow. It is also recommended that a detailed inspection of the dam be instituted on a regular basis by an engineer experienced in the design and construction of dams and that records be kept of all inspections made and remedial measures taken.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 EVALUATION OF FEATURES

- a. Design Data. Design data were not available.
- b. Experience Data. The drainage area and lake surface area were developed from the 1954 Belew Creek, Missouri, Quadrangle Map, photorevised 1968 and 1974. The proportions and dimensions of the spillway and dam were developed from surveys made during the inspection. Records of rainfall, streamflow or flood data for the watershed were not available.

Due to the fact that the watershed for this reservoir is relatively small, and since there is no history of excessive reservoir leakage, the lake level was assumed to be at normal pool as a result of antecedent storms prior to occurrence of the PMF and the probabilistic storms.

According to the St. Louis District, Corps of Engineers, the estimated flood damage zone, should failure of the dam occur, extends three miles downstream of the dam.

- c. Visual Observations.

(1) The principal spillway consists of three 24-inch diameter corrugated metal pipes about 49 feet long. The spillway, a culvert type structure, passes through the abutment at the right end of the dam. The concrete pavement that serves to protect the channel just downstream of the pipes is badly undermined and broken.

(2) The concrete paved section above the spillway pipes will function as an emergency spillway for lake outflow. However, the low point of the dam crest was found to be only 0.4 foot higher than the crest of this spillway, which severely limits its capacity to provide relief for lake surcharge.

(3) A common outlet channel serves both spillways. The outlet channel directs flow away from the embankment. The channel joins a natural draw at a point approximately 350 feet downstream of the center of the dam; the natural draw joins the original stream channel about 400 feet downstream of the dam center. Releases within the capacity of the spillway outlets will not endanger the dam.

d. Overtopping Potential. The spillway is inadequate to pass the probable maximum flood, 1/2 the probable maximum flood, or the 1 percent chance (100-year frequency) flood, without overtopping the dam. The results of the dam overtopping analysis are as follows:

(Note: The data appearing in the following table have been extracted from the computer output data appearing in Appendix B. Decimal values have been rounded to the nearest one-tenth in order to prevent assumption of unwarranted accuracy.)

<u>Ratio of PMF</u>	<u>Q-Peak Inflow (cfs)</u>	<u>Q-Peak Outflow (cfs)</u>	<u>Max. Lake W.S. Elev.</u>	<u>Max. Depth (Ft.) of Flow over Dam (Elev. 588.0)</u>	<u>Duration of Overtopping of Dam (Hrs.)</u>
0.50	2,574	2,315	589.4	1.4	7.6
1.00	5,149	4,909	590.1	2.1	11.2
1% Chance Flood	1,215	159	588.3	0.3	2.0
10% Chance Flood	704	37	587.1	0.0	0.0

Since the crest of the emergency spillway is protected from erosion by lake outflow and since the low point in the embankment was found to be only 0.4 foot higher than the crest of the emergency spillway, the top of the embankment was assumed to be the lowest point, elevation 588.0, in the dam crest. The flow safely passing the spillways just prior to overtopping amounts to approximately 81 cfs, which is the routed outflow corresponding to about 11 percent of the probable maximum flood inflow. This flow is greater than the lake outflow resulting from the 10 percent chance (10-year frequency)

flood. During peak flow of the probable maximum flood, the greatest depth of flow over the dam is projected to be 2.1 feet and overtopping will extend across the entire length of the dam.

e. Evaluation. Experience with embankments constructed of similar material (a silty lean clay of low-to-medium plasticity) to that used to construct this dam have shown evidence that the material under certain conditions, such as high velocity flow, can be very erodible. An example of such erosion exists within the spillway outlet channel just downstream of the 24-inch diameter outlet pipes. Such a condition exists during the PMF when large lake outflow, accompanied by high flow velocities, occurs. For the PMF condition where the depth of flow over the dam crest, a maximum of 2.1 feet, and the duration of flow over the dam, 11.2 hours, are substantial, damage by erosion to the crest and downstream face of the dam is expected. The extent of these damages is not predictable within the scope of this investigation; however, there is a possibility that they could result in failure by erosion of the dam. A similar, but not as severe, condition also exists during occurrence of the one-half PMF event.

f. Reference. Procedures and data for determining the probable maximum flood, the 100-year frequency flood, the 10-year frequency flood, and the discharge rating curve for flow passing the spillway and dam crest are presented on pages B-1 through B-3 of Appendix B. Listings of the HEC-1 (Dam Safety Version) input data for the probable maximum flood, the 100-year frequency flood, and the 10-year frequency flood are shown on pages B-4 through B-8. Computer output data, including unit hydrograph ordinates, tabulation of PMF rainfall, loss and inflow data are shown on pages B-9 through B-12; tabulation of lake surface area, elevation and storage volume and tabulation titled "Summary of Dam Safety Analysis" for the PMF is shown on page B-13; "Summary of Dam Safety Analysis" for the 1 percent chance (100-year frequency) flood and the 10 percent chance (10-year frequency) flood are shown on page B-14. Inflow-outflow hydrographs for the PMF and the 1 percent chance flood are presented on page B-15.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

a. Visual Observations. Visual observations of conditions which adversely affect the structural stability of the dam are discussed in Section 3, paragraph 3.1c.

b. Design and Construction Data. No design or construction data relating to the structural stability of the dam were available. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.

c. Operating Records. No appurtenant structures or facilities requiring operation exist at this dam. According to the Owner, no records of the lake level, spillway discharge, dam settlement, or lake seepage are kept.

d. Post Construction Changes. According to the Owner, with the exception of pressure grouting the downstream side of the dam in 1966, no post construction changes have been made or have occurred since completion of the dam which would affect the structural stability of the dam.

e. Seismic Stability. The dam is located within a Zone II seismic probability area. An earthquake of the magnitude that might occur in this area would not be expected to cause structural damage to a well constructed earthen dam of this size provided that static stability conditions are satisfactory and conventional safety margins exist. However, it is recommended that the prescribed seismic loading for this zone be applied in any stability analyses performed for this dam.

SECTION 7 - ASSESSMENT/REMEDIAL MEASURES

7.1 DAM ASSESSMENT

a. Safety. A hydraulic analysis indicated that the spillways, principal plus emergency, are capable of passing lake outflow of about 81 cfs without the level of the lake exceeding the low point in the top of the dam. A hydrologic analysis of the lake watershed area, as discussed in Section 5, paragraph 5.1d, indicates that for storm runoff of probable maximum flood magnitude, the lake outflow would be about 4,909 cfs, and that for the 1 percent chance (100-year frequency) flood, the lake outflow would be about 159 cfs. A similar analysis indicated that for the 10 percent chance (10-year frequency) flood, the lake outflow would be approximately 37 cfs. Since the existing spillway is inadequate to pass lake outflow resulting from a storm of PMF magnitude (the recommended spillway design flood for this dam) without overtopping the dam, the possibility exists that overtopping could result in failure by erosion of the dam. A description of the features within the potential flood damage zone should failure of the dam occur is presented in Section 1, paragraph 1.2d.

Seepage and stability analyses of the dam were not available for review, and therefore, no judgment could be made with respect to the structural stability of the dam.

Several items were noticed during the inspection that could adversely affect the safety and future operation of the dam. These items include seepage, erosion of the embankment, trees and dense brush on the dam proper, possible dam settlement, an obstructed spillway approach, a badly eroded spillway outlet channel, and a large marshy area just downstream of the dam that could be detrimental to the stability of the embankment.

b. Adequacy of Information. Due to lack of design and construction data, the assessments reported herein were based on external conditions as determined during the visual inspection. The assessments of the hydrology of the watershed and capacity of the spillways were based on a hydraulic/hydrologic study as indicated in Section 5. Seepage and stability analyses

comparable to the requirements of "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.

c. Urgency. The remedial measures recommended in paragraph 7.2 for the items concerning the safety of the dam noted in paragraph 7.1a should be accomplished within the near future. The provision of additional spillway capacity should be pursued on a high priority basis since the existing spillways are considered to be seriously inadequate.

d. Necessity for Phase II. Based on the results of the Phase I inspection, a Phase II investigation is not recommended.

e. Seismic Stability. The dam is located within a Zone II seismic probability area. An earthquake of the magnitude that might occur in this area would not be expected to cause structural damage to a well constructed earthen dam of this size provided that static stability conditions are satisfactory and conventional safety margins exist. However, it is recommended that the prescribed seismic loading for this zone be applied in any stability analyses performed for this dam.

7.2 REMEDIAL MEASURES

a. Recommendations. The following action is recommended.

(1) Based upon criteria set forth in the recommended guidelines, spillway size and/or height of dam should be increased in order to pass lake outflow resulting from a storm of probable maximum flood magnitude.

(2) Obtain the necessary soil data and perform dam seepage and stability analyses in order to determine the structural stability of the dam for all operational conditions. Seepage and stability analyses should be performed by a qualified professional engineer experienced in the design and construction of earthen dams.

(3) Restore the dam crest to a uniform elevation and monitor the top of the dam through the area of suspected settlement in order to determine the

extent of possible future settlement and the remedial work required to compensate for such settlement. In any event, the crest of the dam should be uniform throughout without low areas that reduce dam freeboard and penalize spillway capacity. It should be noted that the low point of the top of the dam was found to be only 0.4 foot higher than the crest of the emergency spillway.

b. Operations and Maintenance (O & M) Procedures. The following O & M procedures are recommended:

(1) Provide some means of controlling seepage evident in the areas adjacent to the downstream toe of the dam. Uncontrolled seepage can lead to a piping condition (progressive internal erosion) which could result in failure of the dam. Drainage of the areas affected by seepage including elimination of the large marshy area just downstream of the dam should be one of the objectives of the seepage control measures since saturation of the soil weakens the foundation which could impair the stability of the dam.

(2) Remove the trees and the undergrowth that can conceal animal burrows from the dam proper. Tree roots and animal burrows can provide passageways for lake seepage that can also develop into a piping condition. Maintain the turf cover on the dam at a height that will not conceal animal burrows or hinder inspection of the dam. Removal of large trees should be under the guidance of an engineer experienced in the design and construction of earthen dams since indiscriminate clearing could jeopardize the safety of the dam.



(3) Restore the eroded areas of the dam, including the area within the spillway outlet channel immediately downstream of the spillway pipes. Loss of material due to erosion can be detrimental to the structural stability of the dam, or in the case of the outlet channel, to the stability of the section where the spillway pipes are founded. The spillway channel should be protected as necessary to prevent erosion by lake outflow.

(4) Remove the small trees and undergrowth within the reservoir area just upstream of the spillway pipes that could impede flow to the pipes

resulting in loss of spillway capacity. The existing spillway pipes should be maintained free of trash and debris that could obstruct flow resulting in a loss of capacity of the outlet. If difficulty is anticipated in maintaining the spillway pipes clean, it is recommended that trash racks be installed on their upstream ends.

(5) Provide maintenance of all areas of the dam on a regularly scheduled basis in order to insure features of being in satisfactory operational condition.

(6) A detailed inspection of the dam should be instituted on a regular basis by an engineer experienced in the design and construction of dams. It is also recommended, for future reference, that records be kept of all inspections made and remedial measures taken.

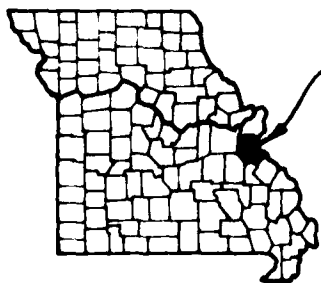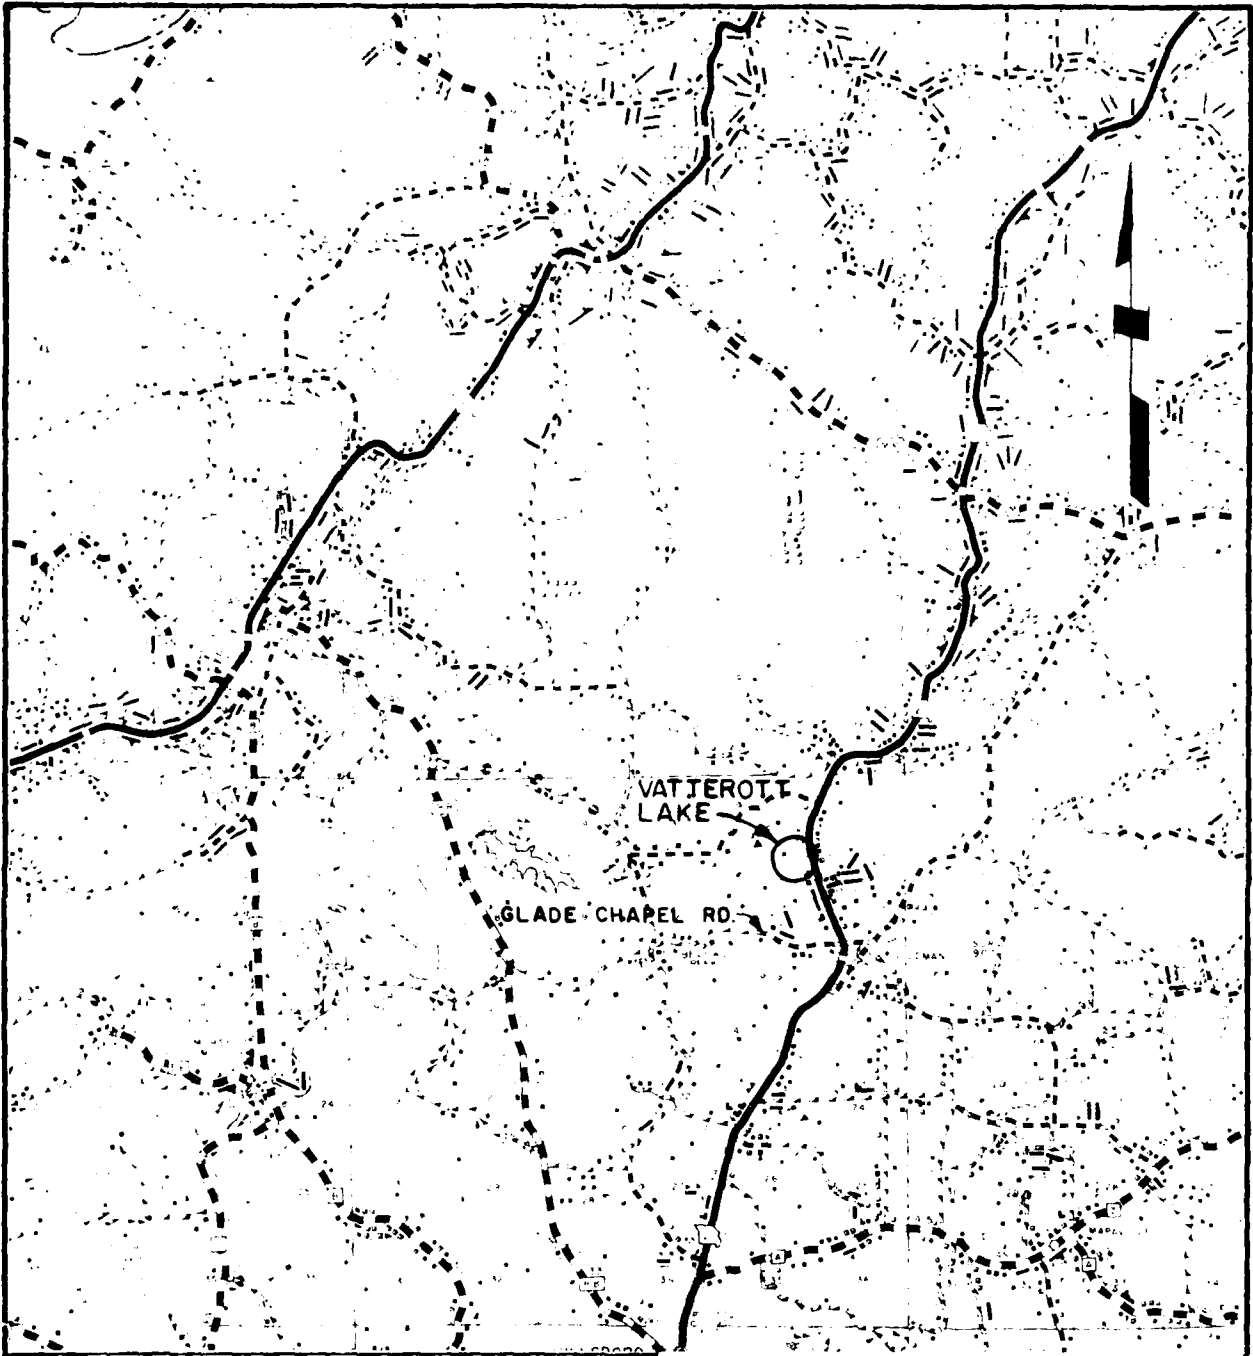


JEFFERSON
COUNTY


LOCATION MAP


VATTEROTT LAKE




REGIONAL VICINITY MAP

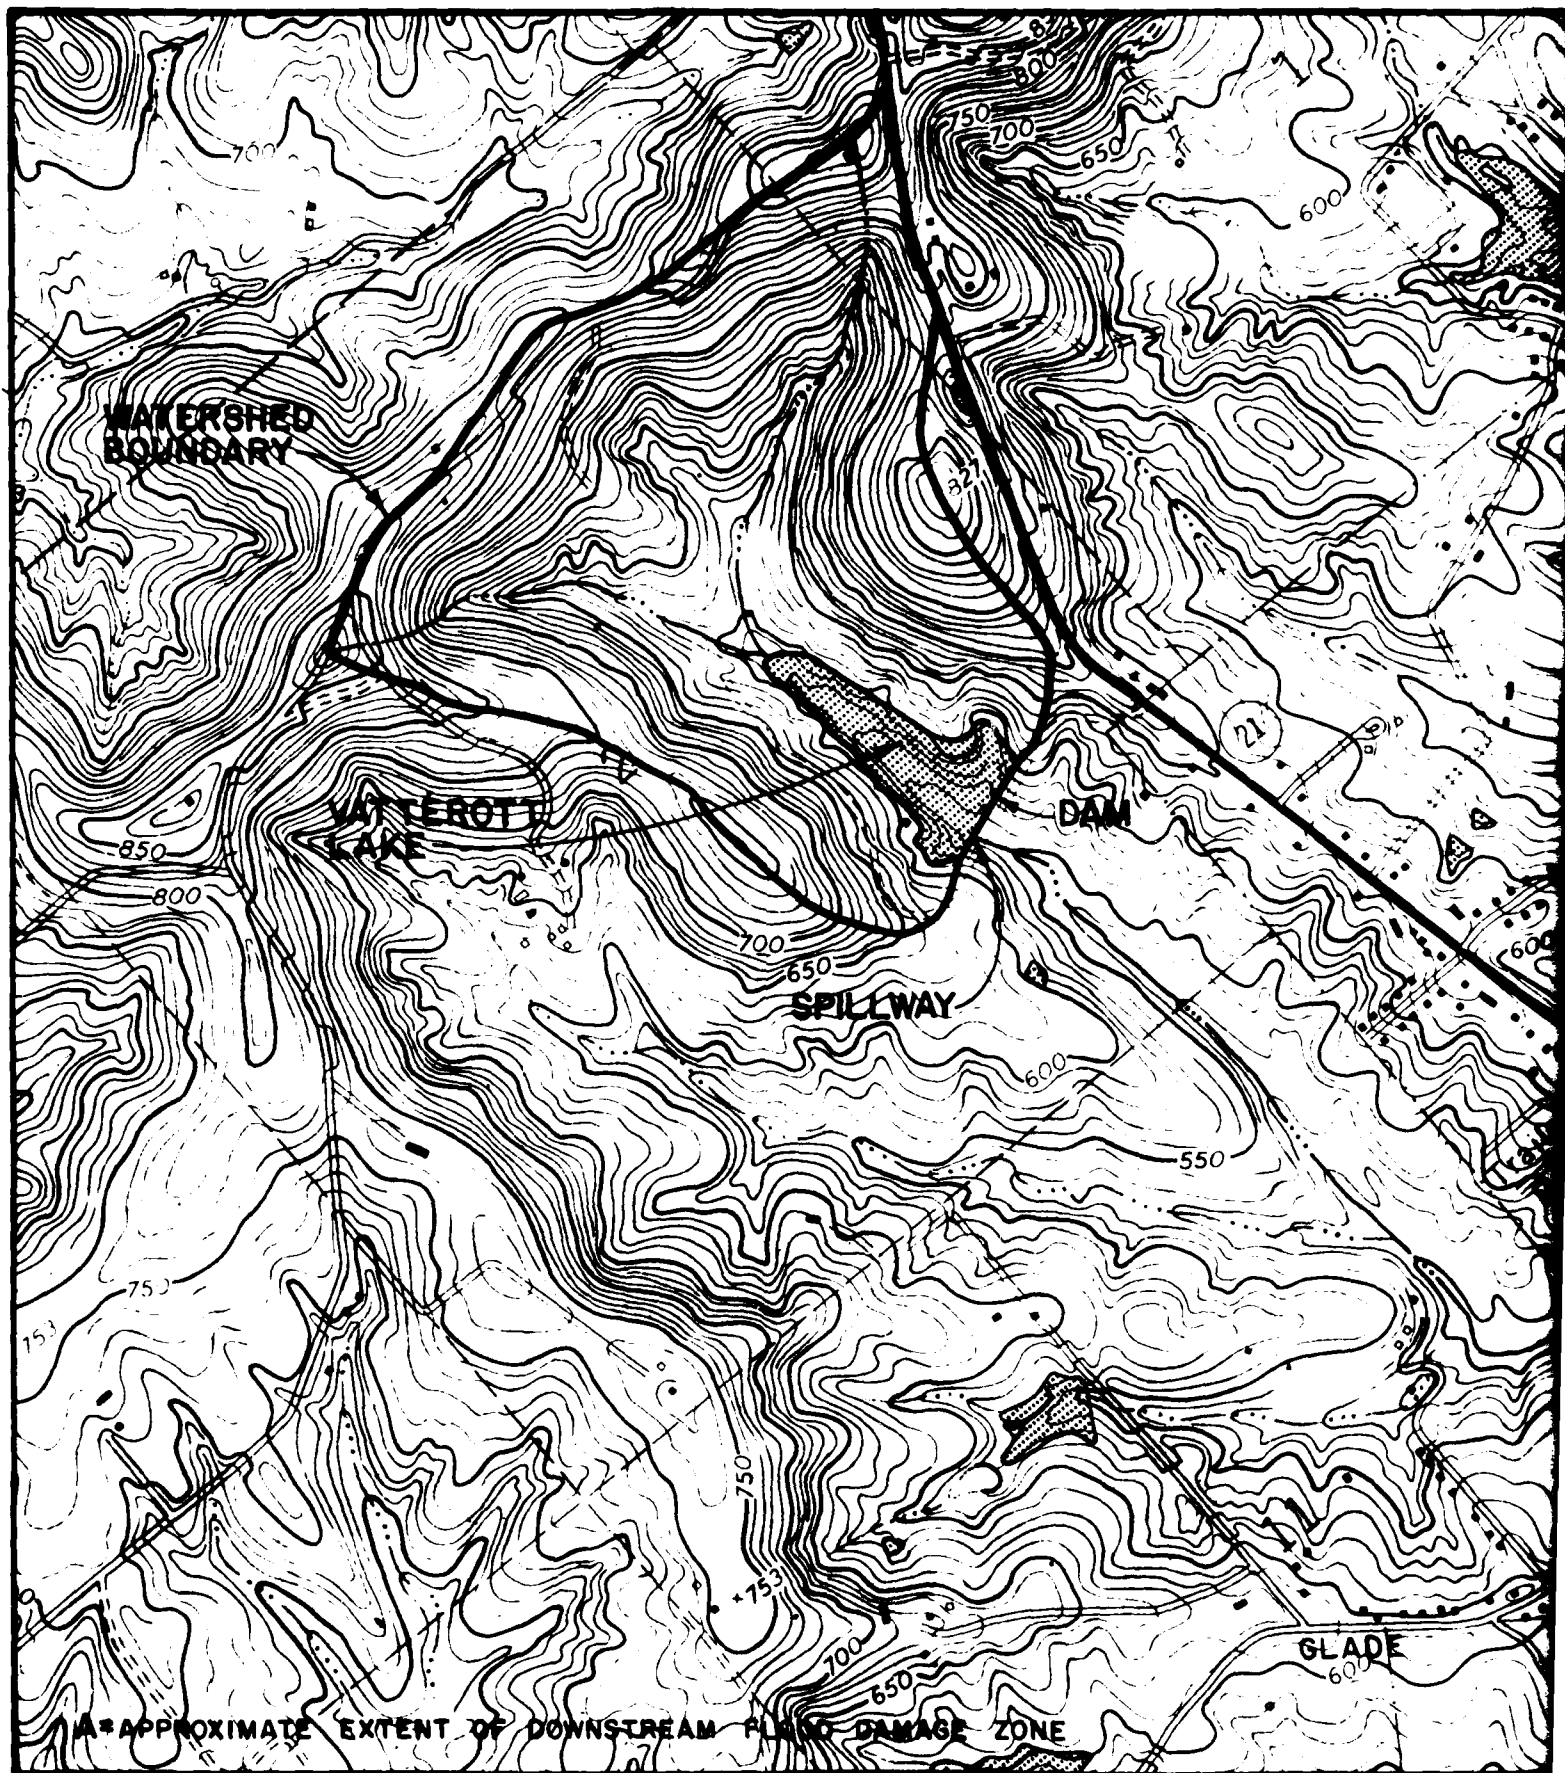

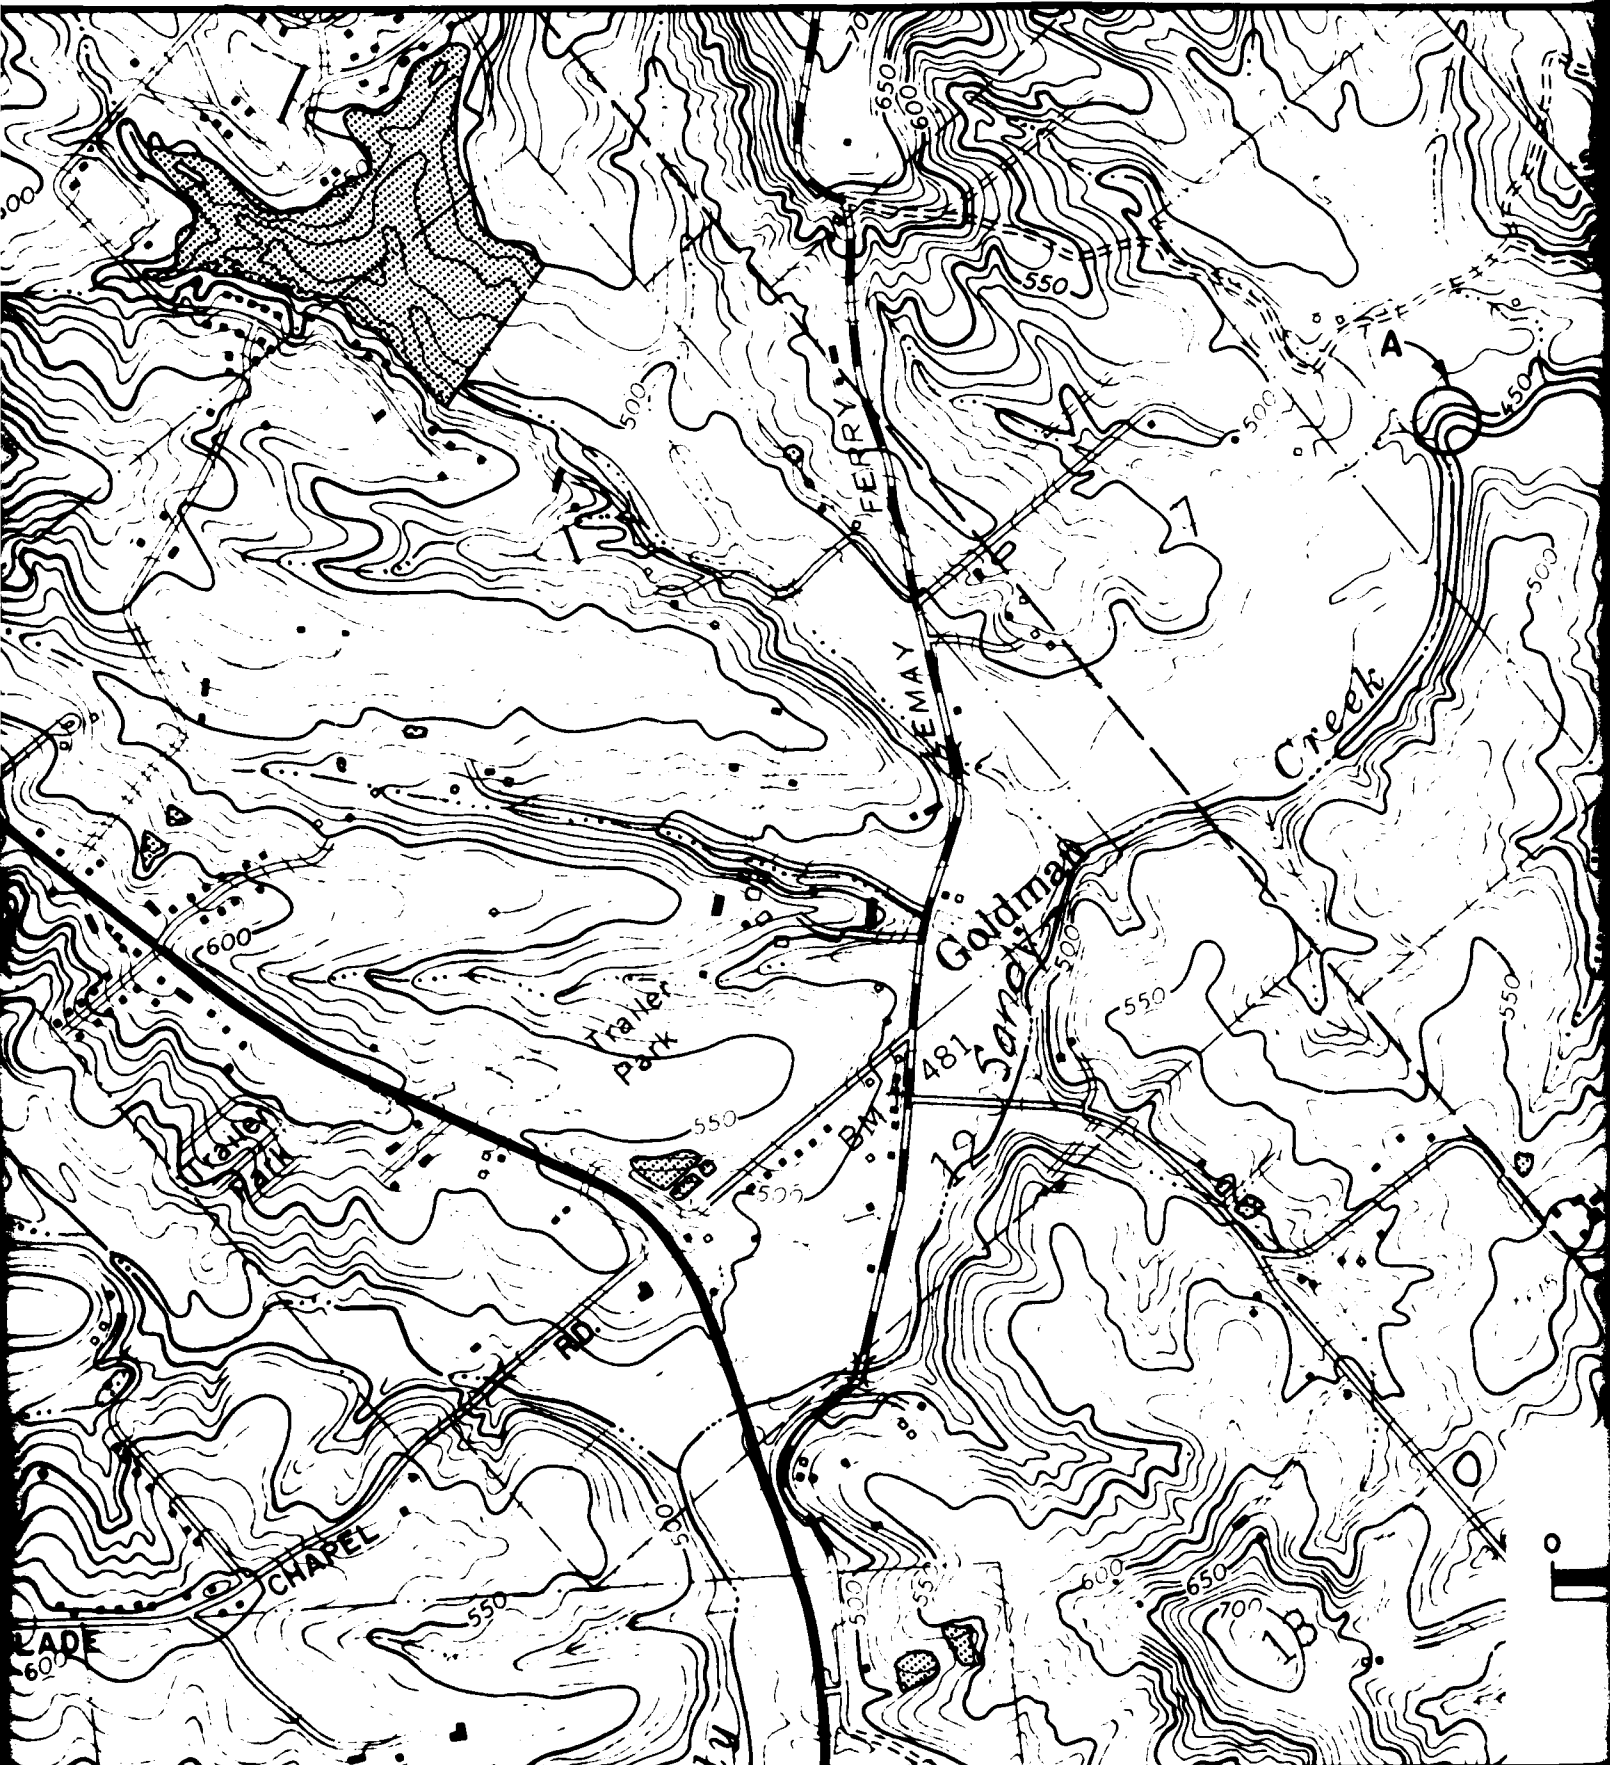


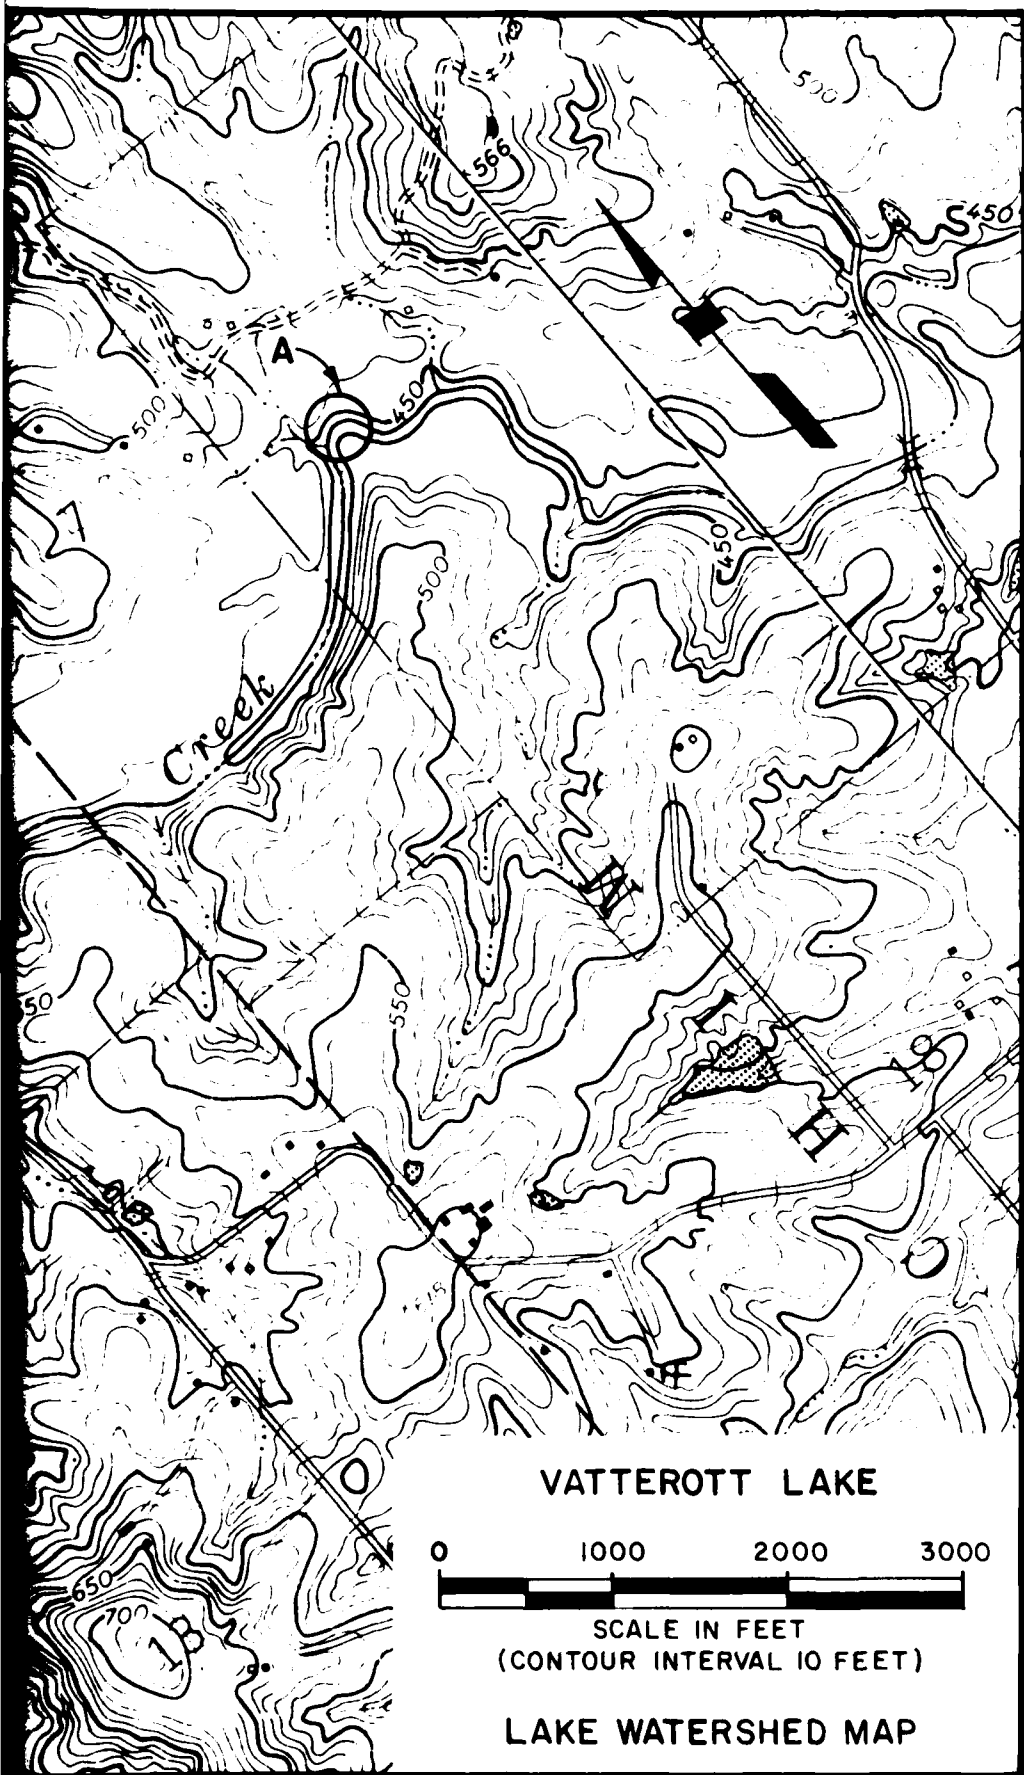

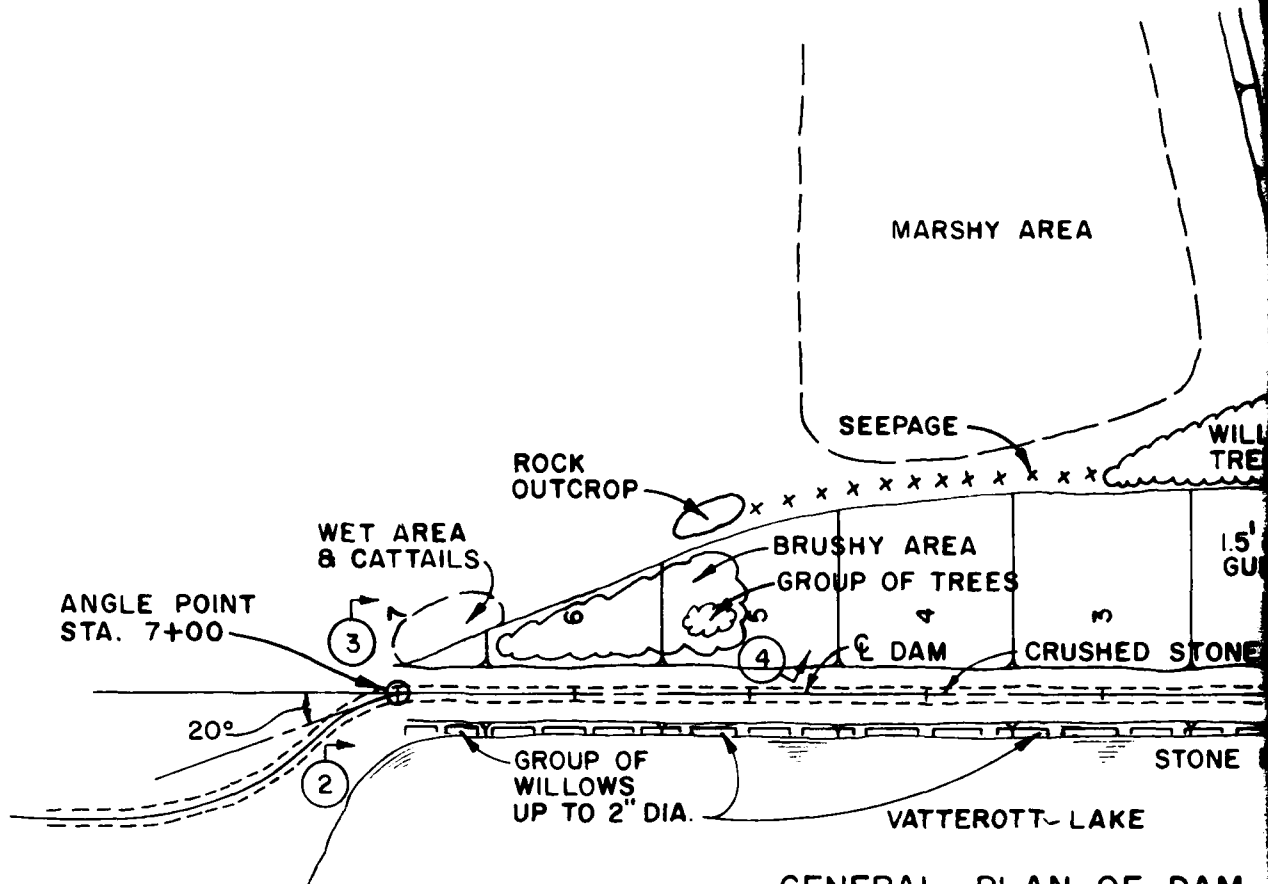

GENERAL PLAN OF DAM



SCALE: 1"=100'

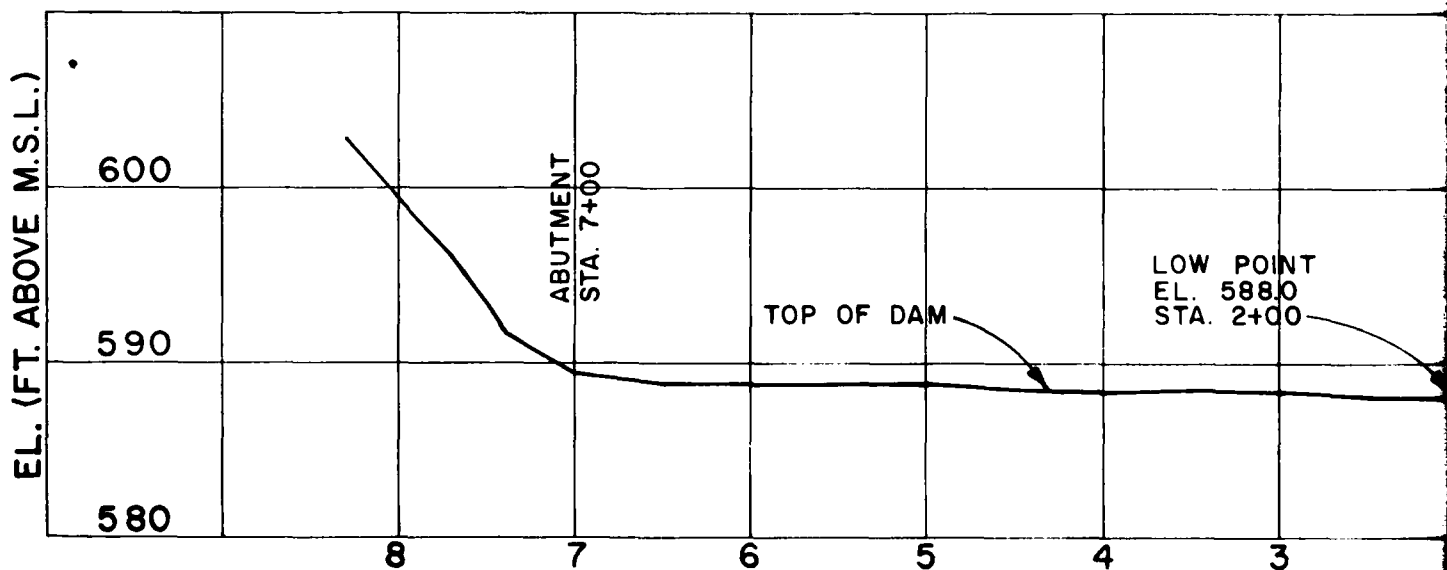

PROFILE DAM CREST

SCALE: 1"=10' V., 1"=100' H.

(6)
 PHOTO LOCATION & KEY
 (SEE APPENDIX A)

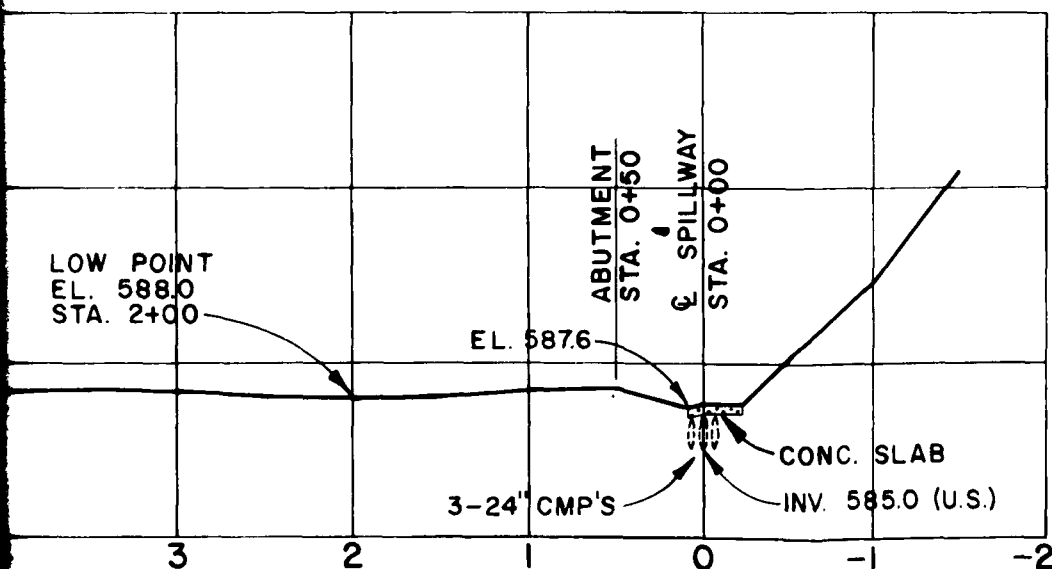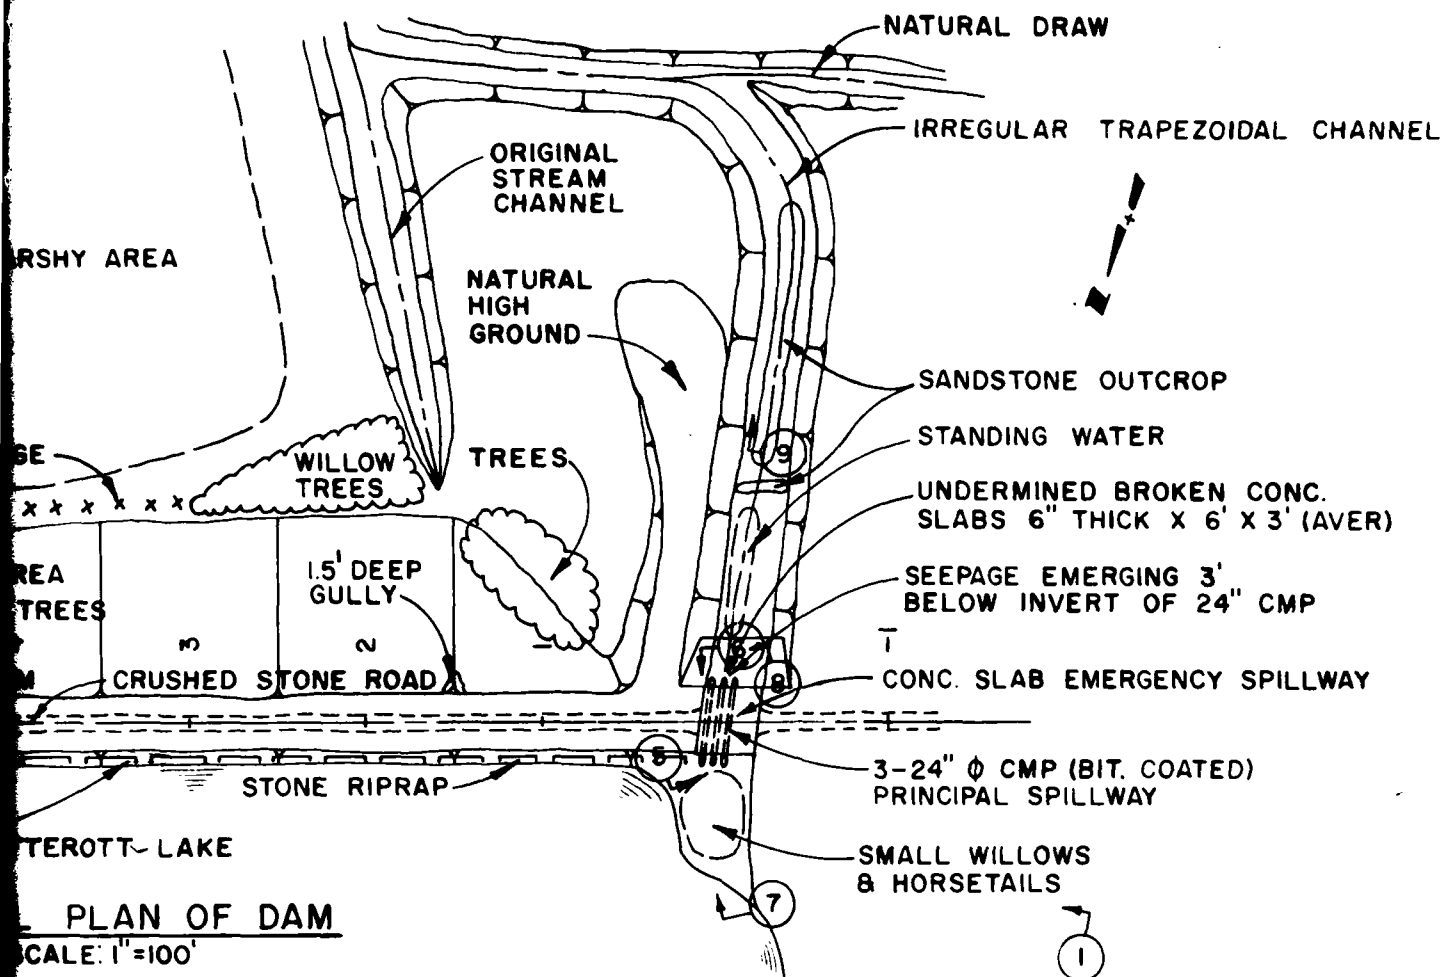


DAM CREST

1"=10' V., 1"=100' H.

**VATTEROTT LAKE
DAM PLAN & PROFILE**


Horner & Shifrin, Inc.

Dec. 1980

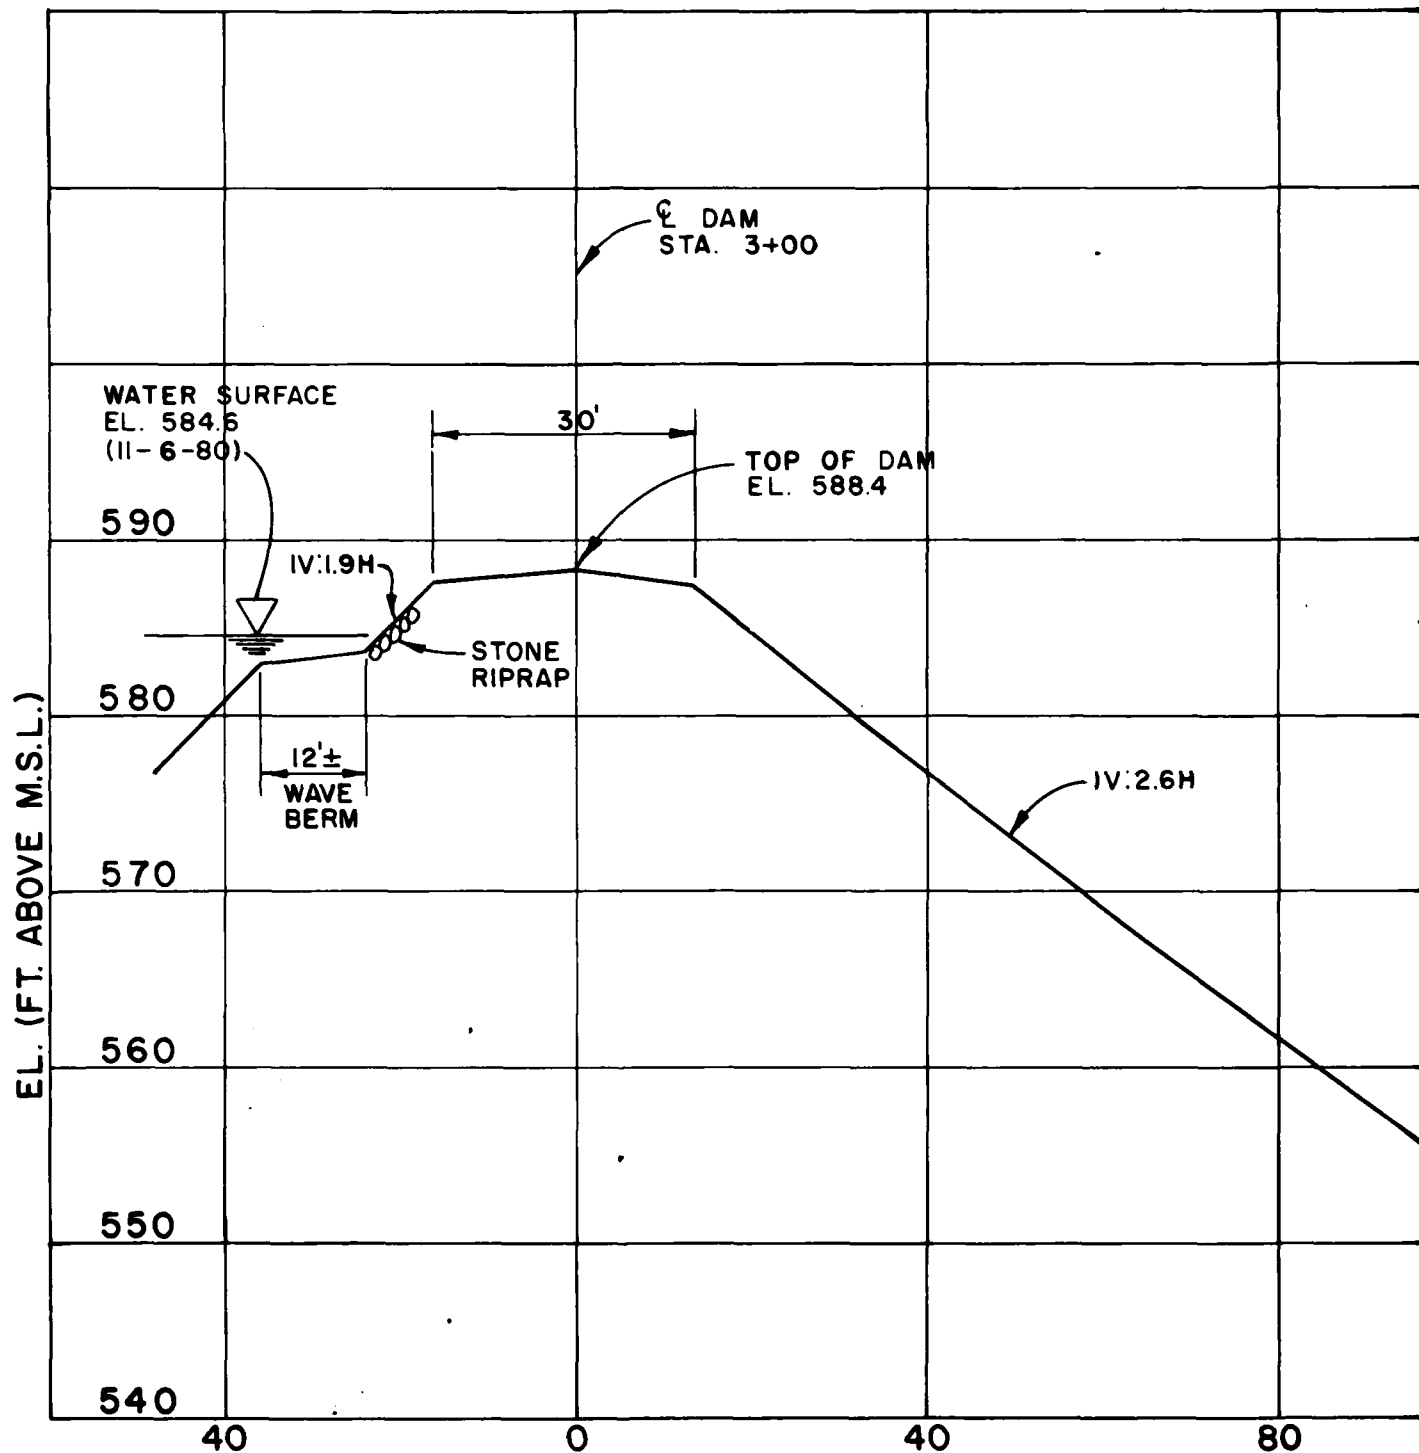


DAM CROSS-SECTION STA. 3+00

SCALE: 1"=10' V., 1"=20' H.

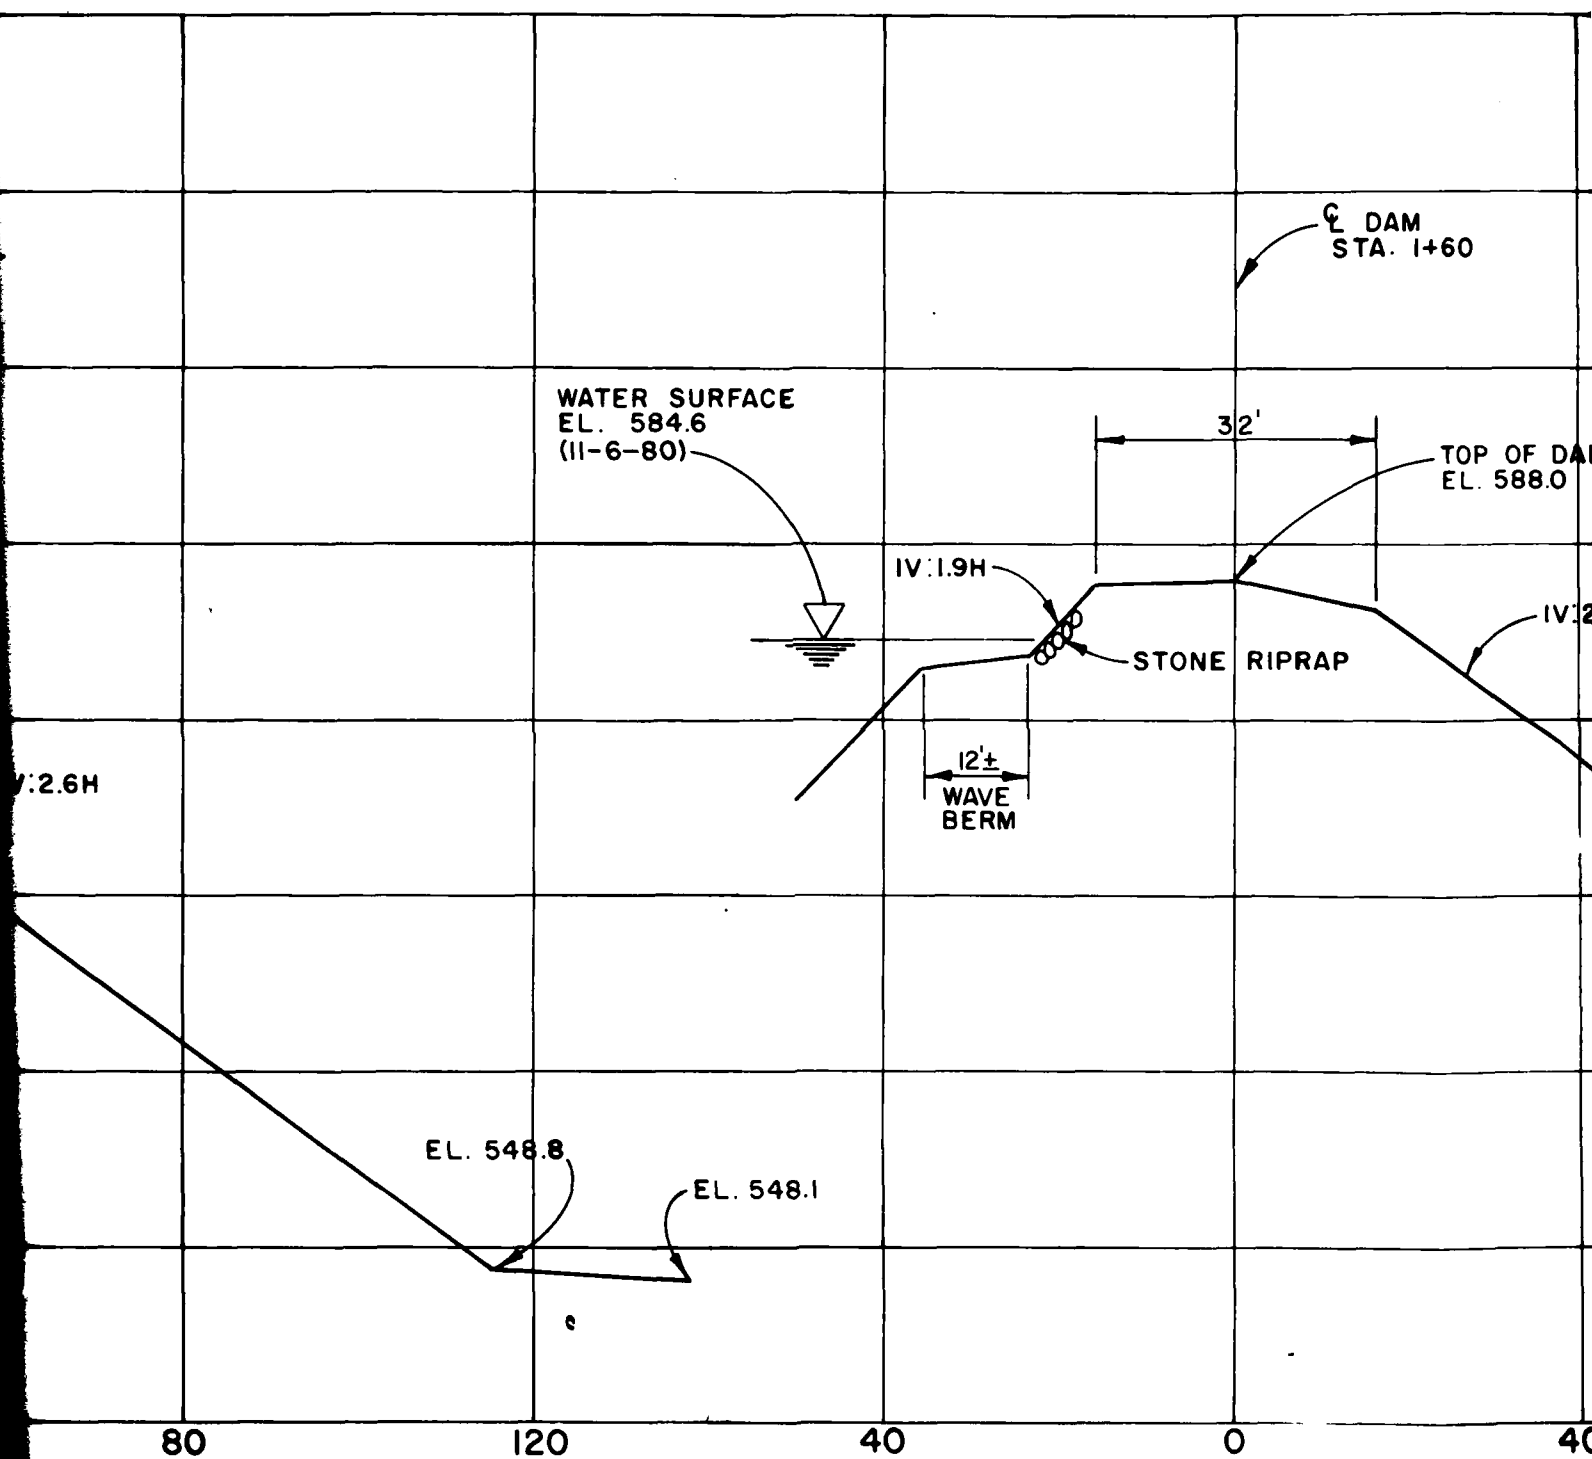


3+00


DAM CROSS-SECTION
SCALE: 1" = 10'

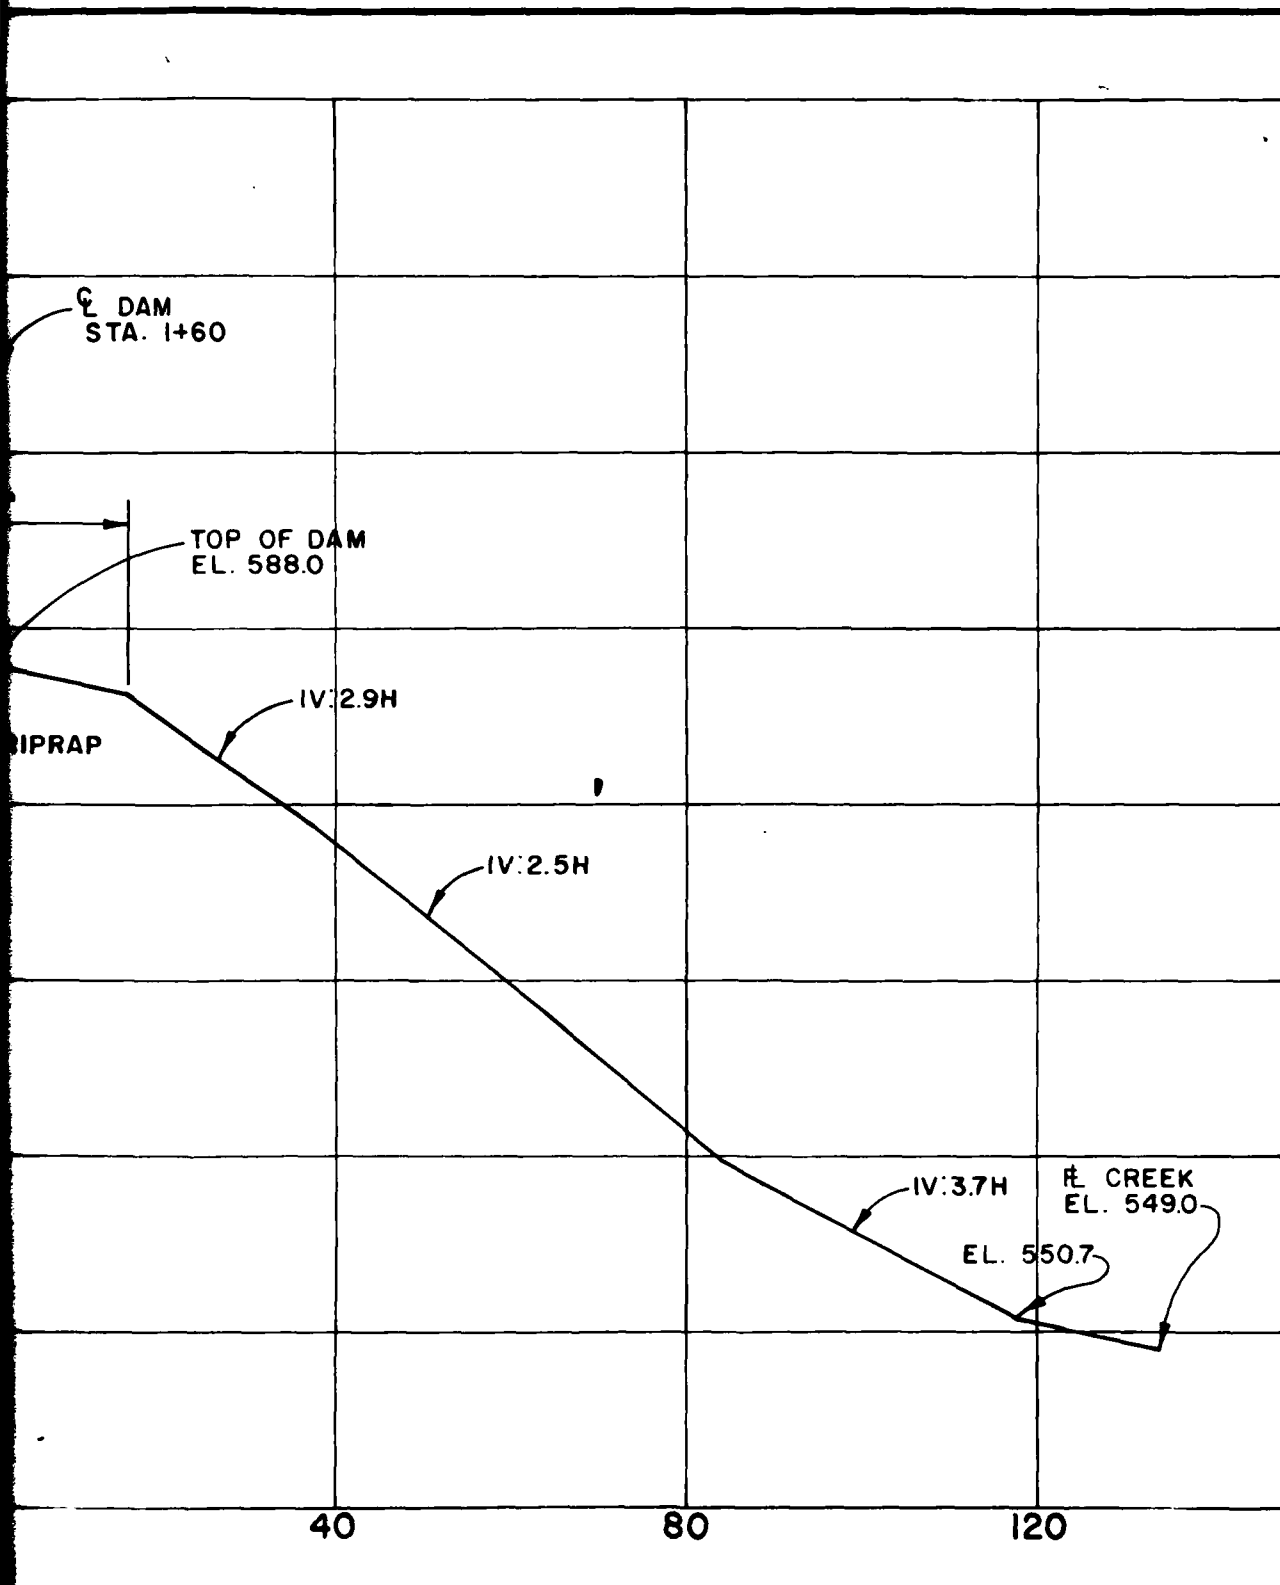

3


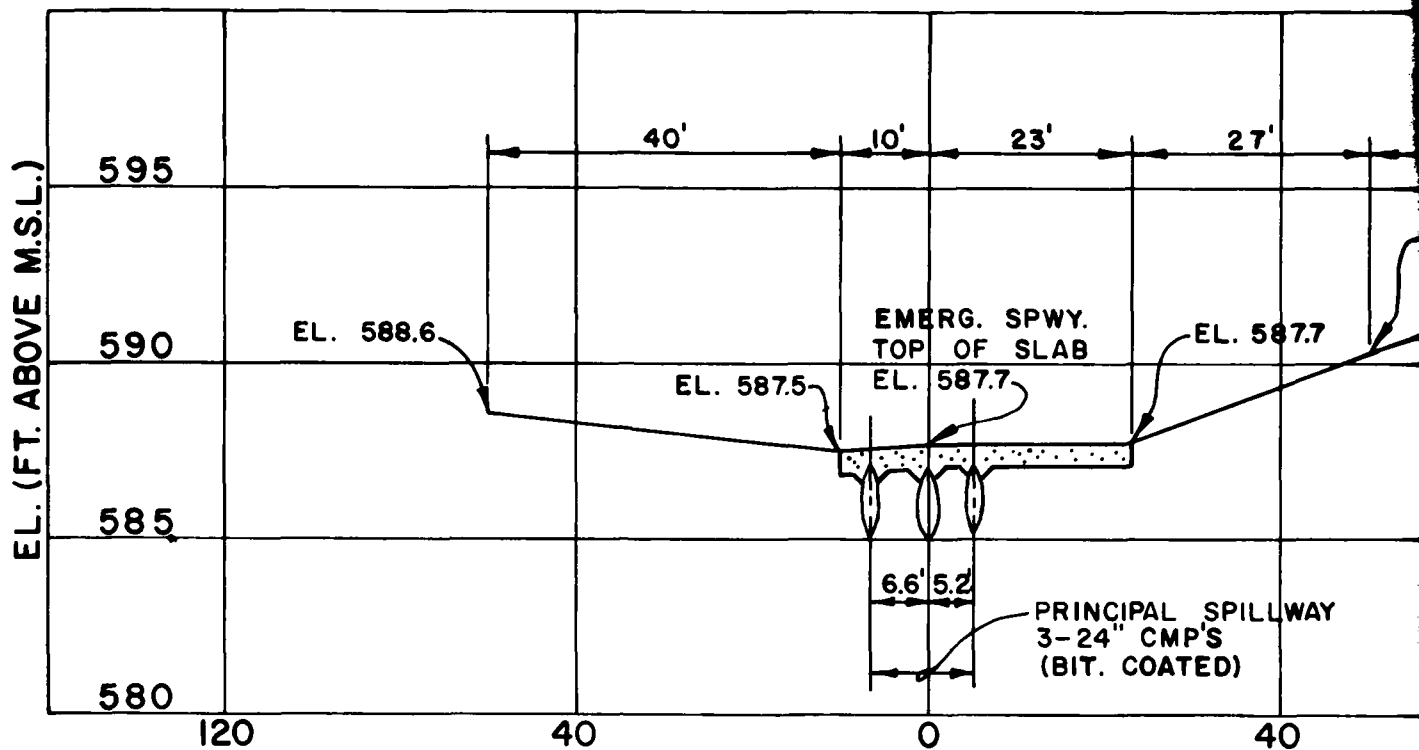


SPILLWAY CROSS-SECTION
 SCALES: 1" = 5' V., 1" = 20' H.

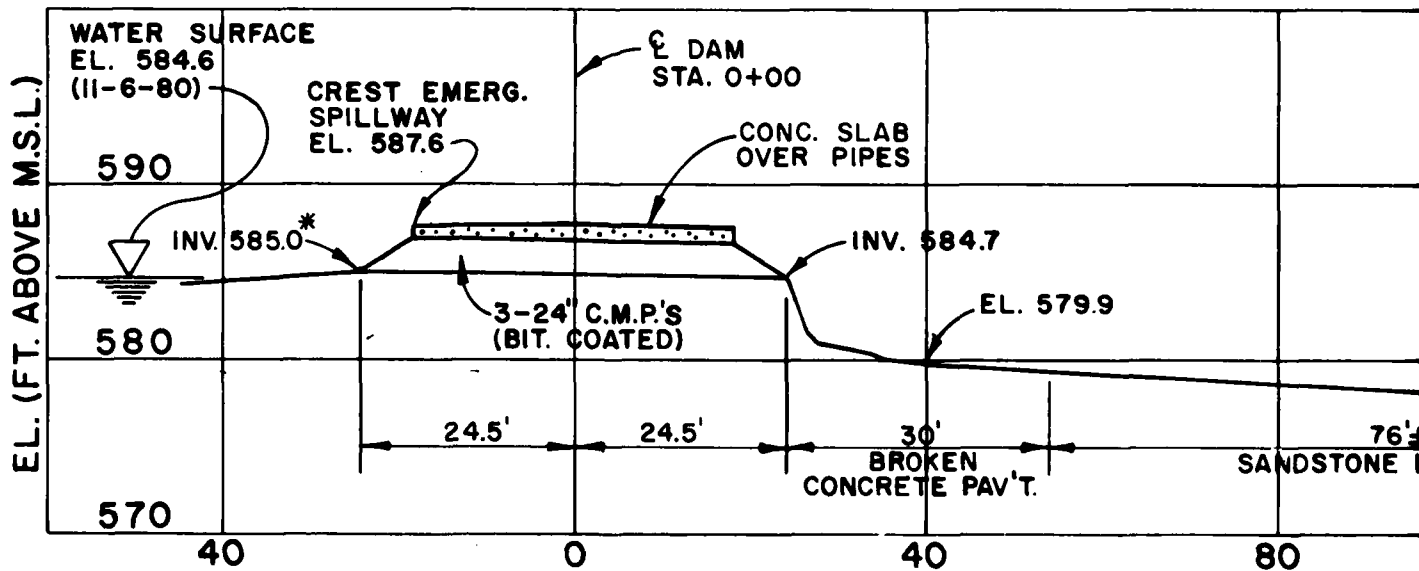

*NORMAL POOL =
 SPILLWAY CREST
 EL. 585.0

SPILLWAY PROFILE
 SCALES: 1" = 10' V., 1" = 20' H.

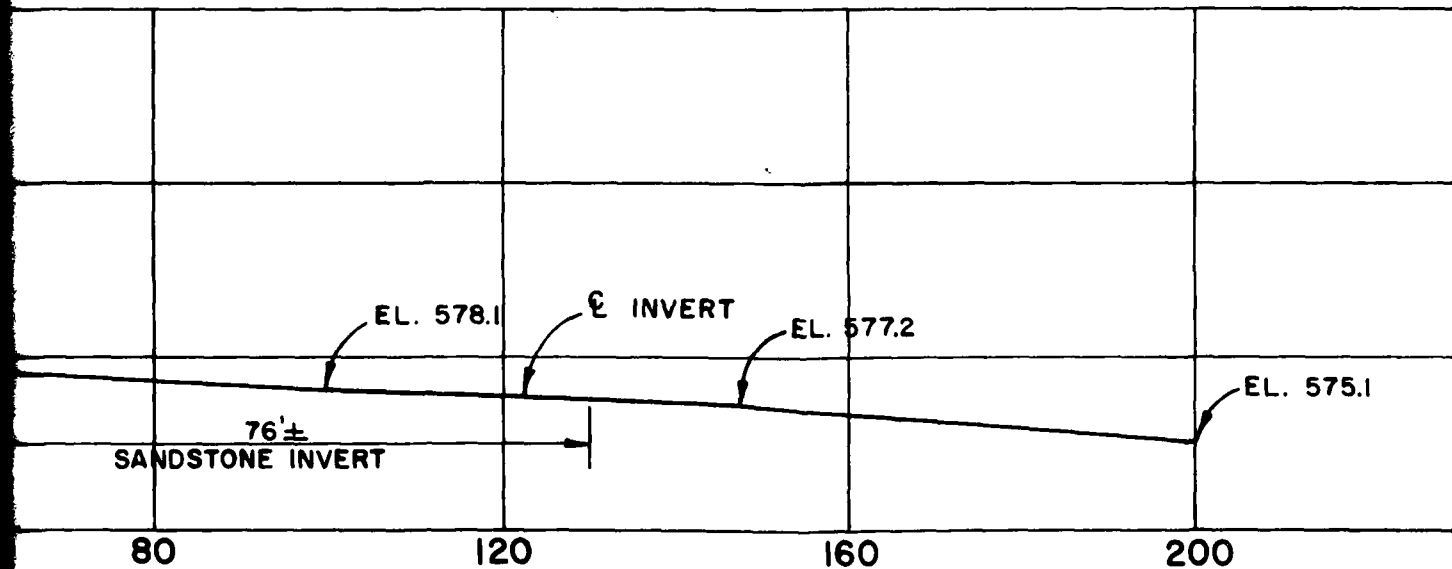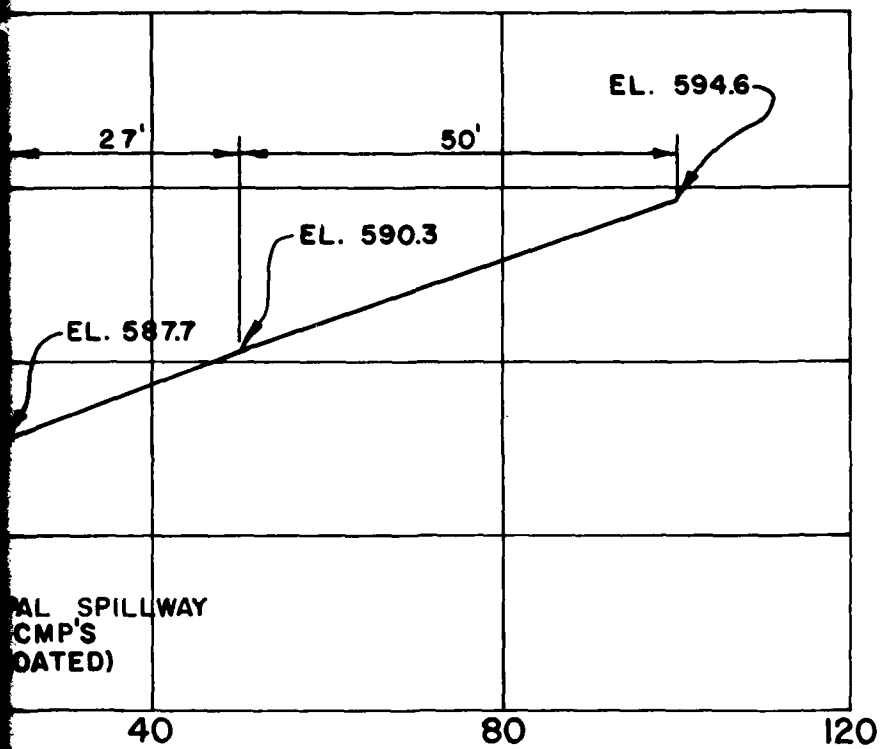

PROFILE
V., 1"=20' H.

VATTEROTT LAKE
SPILLWAY PROFILE &
CROSS-SECTION
Horner & Shifrin, Inc. Dec. 1980

APPENDIX A
INSPECTION PHOTOGRAPHS



1	2
3	

PHOTO KEY

NO.

DESCRIPTION

1 DAM OVERVIEW

2 UPSTREAM FACE OF DAM

3 DOWNSTREAM FACE OF DAM (NOTE CATTAILS AT TOE OF SLOPE)

A-1





4	5
6	

PHOTO KEY

<u>NO.</u>	<u>DESCRIPTION</u>
4	MARSHY AREA DOWNSTREAM OF DAM
5	UPSTREAM END 24" SPILLWAY PIPES
6	DOWNSTREAM END 24" SPILLWAY PIPES



PHOTO KEY

7	8
9	X

- | <u>NO.</u> | <u>DESCRIPTION</u> |
|------------|---|
| 7 | UNDERGROWTH UPSTREAM OF SPILLWAY |
| 8 | BROKEN PAVEMENT WITHIN SPILLWAY CHANNEL |
| 9 | SEEPAGE WITHIN SPILLWAY OUTLET CHANNEL |

APPENDIX B

HYDROLOGIC AND HYDRAULIC ANALYSES

HYDROLOGIC AND HYDRAULIC COMPUTATIONS

1. The HEC-1 Dam Safety Version (July 1978, Modified 26 February 1979) program was used to develop inflow and outflow hydrographs and dam overtopping analyses, with hydrologic inputs as follows:

- a. Probable maximum precipitation (200 sq. mile, 24-hour value equals 25.5 inches) from Hydrometeorological Report No. 33. The precipitation data used in the analysis of the 1 percent (100-year frequency) and 10 percent chance (10-year frequency) flood was provided by the St. Louis District, Corps of Engineers.
- b. Drainage area = 0.361 square miles = 231 acres.
- c. SCS parameters:

$$\text{Time of Concentration } (T_c) = \frac{(11.9L)^{0.385}}{H} = 0.162 \text{ hours}$$

Where: T_c = Travel time of water from hydraulically most distant point to point of interest, hours
L = Length of longest watercourse = 0.597 miles
H = Elevation difference = 286 feet

The time of concentration (T_c) was obtained using Method C as described in Figure 30, "Design of Small Dams", by the United States Department of the Interior, Bureau of Reclamation, and was verified using average channel velocity estimates and watercourse lengths.

Lag Time = 0.097 hours (0.60 T_c)

Hydrologic soil group = 100% D (Gasconade series, mostly wooded, per Mo. General Soil Map and field investigation)

Soil type CN = 77 (AMC II, 100-yr and 10-yr flood conditions)
= 89 (AMC III, PMF condition)

2. Determination of spillway capacity:

- a. Flow through the three 24-inch diameter corrugated metal spillway pipes was computed using Bernoulli's equation for pressure flow in pipes. A pipe friction factor (n) of 0.021 was used. Losses, including entrance, pipe and exit losses totaled 4.1 velocity heads. Reference "Handbook of Hydraulics", Fifth Edition, by King and Brater, pages 8-5 and 8-6.
- b. The trapezoidal concrete emergency spillway section consists of a broad-crested section, for which conventional weir formulas do not apply.

Spillway release rates were determined as follows:

- (1) Spillway crest section properties (areas, "a", and top width, "t") were computed for various depths, "d".
- (2) It was assumed that flow over the spillway crest would occur at critical depth. Flow at critical depth Q_c was computed as
$$Q_c = \left(\frac{a^3}{t} \right)^{0.5}$$
for the various depths, "d". Corresponding velocities (v_c) and velocity heads (H_{vc}) were determined using conventional formulas.* Reference "Handbook of Hydraulics", Fifth Edition, by King & Brater, page 8-7.
- (3) Static lake levels corresponding to the various flow values passing the spillway were computed as critical depths plus critical velocity heads ($d_c + H_{vc}$), and the relationship between lake level and spillway discharge was thus obtained. The procedure neglects the minor insignificant friction losses across the length of the spillway.

*
$$v_c = \frac{Q_c}{a} \quad ; \quad H_{vc} = \frac{v_c^2}{2g}$$

- c. Discharge quantities for equal elevations determined as described herein were summated for the principal and emergency spillways for entry on the Y4 and Y5 cards.

3. The profile of the dam crest is irregular and flow over the dam cannot be determined by application of conventional weir formulas. Crest length and elevation data for the dam crest proper were entered into the HEC-1 Program on the \$L and the \$V cards. The program assumes that flow over the dam crest section occurs at critical depth and computes internally the flow over the dam crest and adds this flow to the flow over the spillway as entered on the Y4 and Y5 cards.

A1	ANALYSIS OF DAM OVERTOPPING USING RATIOS OF PMF									
A2	HYDROLOGIC-HYDRAULIC ANALYSIS OF SAFETY OF VATTEROTT LAKE DAM									
A3	RATIOS OF PMF ROUTED THROUGH RESERVOIR									
B	288	0	5	0	0	0	0	0	0	0
B1	5									
J	1	4	1							
J1	0.11	0.12	0.50	1.00						
K	0	INFLOW								
K1	INFLOW HYDROGRAPH									
M	1	2	0.361		1.0					1
P	0	25.5	102	123	130					
T						-1	-89			
W2		0.067								
X	-1.0	-1.10	2.0							
K	1	DAM								
1	RESERVOIR ROUTING BY MODIFIED ILLS									
1	1					15.20	-1			
Y4	585.0	586.3	587.6	588.13	588.54	589.07	589.86	590.35	591.25	592.08
Y4592.71	593.39	594.05	594.72	595.38	596.04	596.70	597.06			
Y5	0	26	45	83	121	169	222	261	1738	2403
Y5	3094	3856	4624	5412	6208	7053	8836	9570		
1A	0	14.7	15.2	17.7	20.7					
1E	552	505	590	600	613					
11	585.0									
1U	588.0									
1L	0	100	225	375	412	408	650	690	720	750
1V	588.0	588.1	588.4	588.5	588.6	588.6	589.4	591.6	594.0	595.3
R										

4

—

1 PERCENT CHANCE FLOOD (Cont'd)

RESERVOIR ROUTING BY MODIFIED PULS									
		1		1		1		1	
Y1	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y2	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y3	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y4	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y5	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y6	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y7	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y8	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y9	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y10	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y11	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y12	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y13	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y14	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y15	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y16	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y17	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y18	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y19	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y20	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y21	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y22	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y23	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y24	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y25	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y26	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y27	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y28	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y29	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y30	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y31	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y32	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y33	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y34	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y35	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y36	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y37	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y38	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y39	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y40	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y41	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y42	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y43	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y44	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y45	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y46	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y47	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y48	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y49	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y50	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y51	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y52	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y53	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y54	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y55	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y56	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y57	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y58	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y59	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y60	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y61	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y62	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y63	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y64	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y65	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y66	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y67	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y68	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y69	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y70	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y71	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y72	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y73	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y74	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y75	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y76	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y77	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y78	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y79	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y80	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y81	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y82	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y83	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y84	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y85	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y86	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y87	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y88	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y89	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y90	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y91	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y92	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y93	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y94	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y95	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y96	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y97	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y98	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y99	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35
Y100	585.0	586.3	587.6	588.13	588.54	588.93	589.30	590.65	591.35

1A1 ANALYSIS OF DAM OVERTOPPING USING 10 PERCENT CHANCE FLOOD
 A2 HYDROLOGIC-HYDRAULIC ANALYSIS OF SAFETY OF VATTEROTT LAKE DAM
 A3 10 PERCENT CHANCE FLOOD ROUTED THROUGH RESERVOIR

E	5				4			
	0	1	2	3	0	1	2	3
01	1.00							
02								
03								
04								
05								
06								
07								
08								
09								
10								
11								
12								
13								
14								
15								
16								
17								
18								
19								
20								
21								
22								
23								
24								
25								
26								
27								
28								
29								
30								
31								
32								
33								
34								
35								
36								
37								
38								
39								
40								
41								
42								
43								
44								
45								
46								
47								
48								
49								
50								
51								
52								
53								
54								
55								
56								
57								
58								
59								
60								
61								
62								
63								
64								
65								
66								
67								
68								
69								
70								
71								
72								
73								
74								
75								
76								
77								
78								
79								
80								
81								
82								
83								
84								
85								
86								
87								
88								
89								
90								
91								
92								
93								
94								
95								
96								
97								
98								
99								
100								

10 PERCENT CHANCE FLOOD (Cont'd)

[illegible]

ANALYSIS OF DAM OVERTOPPING USING RATIOS OF PM
 HYDROLOGIC-HYDRAULIC ANALYSIS OF SAFETY OF WATERGATE LAKE DAM
 RATIOS OF PMF ROUTED THROUGH RESERVOIR

JOB SPECIFICATION									
NO	NHR	NMIN	IDAY	IHR	IMIN	METRO	IPLT	IPRT	INSTAN
288	0	5	0	0	0	0	0	0	0
JOEPR				NWT	LROPT	TRACE			
5				0	0	0			

MULTI-PLAN ANALYSES TO BE PERFORMED

NPLAN= 1 NRTIO= 4 LRTIO= 1

RTIOS= .11 .12 .50 1.00

SUB-AREA RUNOFF COMPUTATION

INFLOW HYDROGRAPH

ISTAO	ICOMP	IELON	ITAVE	IPLT	IPRT	INAME	ISTAGE	IAUTO
INFLOW	0	0	0	0	0	1	0	0

HYDROGRAPH DATA

IHYDG	IUNG	TAREA	SNAP	TRSDA	TRSPC	RATIO	ISNOW	ISAME	LOCAL
1	2	.36	0.00	.36	1.00	0.000	0	1	0

PRECIP DATA

SPFC	PMG	RA	R12	R24	R48	R72	R96
0.00	25.50	102.00	120.00	130.00	0.00	0.00	0.00

LOSS DATA

LROPT	STKR	ULTR	RTGL	ERAIN	STKRS	RTIOV	STRTL	CNSTL	ALSMX	RTIMP
0	0.00	0.00	1.00	1.00	0.00	1.00	-1.00	-89.00	0.00	0.00

CURVE NO = -89.00 WETNESS = -1.00 EFFECT CN = 89.00

UNIT HYDROGRAPH DATA

TC= 0.00 LAG= .10

RECESSION DATA

STRTQ= -1.00 ORCSN= -1.0 RTIOV= 2.00

TIME INCREMENT TOO LARGE--(NHQ IS GT LAG/2)

UNIT HYDROGRAPH @ END OF PERIOD ORDINATES, T1= 0.00 HOURS, LAG= .10 VOL= 1.00

836. 1174. 421. 105. 69. 26. 11. 2.

THIS PAGE IS BEST QUALITY PRACTICABLE
 FROM COPY FURNISHED TO DDC

0		END OF PERIOD FLOW											
MO. DA	HR. MN	PERIOD	RAIN	EXCS	LOSS	COMP 0	MO. DA	HR. MN	PERIOD	RAIN	EXCS	LOSS	COMP 0
1.01	.05	1	.01	0.00	.01	0.	1.01	12.05	145	.22	.21	.01	295.
1.01	.10	2	.01	0.00	.01	0.	1.01	12.10	146	.22	.21	.01	469.
1.01	.15	3	.01	0.00	.01	0.	1.01	12.15	147	.22	.21	.01	547.
1.01	.20	4	.01	0.00	.01	0.	1.01	12.20	148	.22	.21	.01	571.
1.01	.25	5	.01	0.00	.01	0.	1.01	12.25	149	.22	.21	.01	583.
1.01	.30	6	.01	0.00	.01	0.	1.01	12.30	150	.22	.21	.01	587.
1.01	.35	7	.01	0.00	.01	0.	1.01	12.35	151	.22	.21	.01	590.
1.01	.40	8	.01	0.00	.01	0.	1.01	12.40	152	.22	.21	.00	591.
1.01	.45	9	.01	0.00	.01	0.	1.01	12.45	153	.22	.21	.00	592.
1.01	.50	10	.01	0.00	.01	0.	1.01	12.50	154	.22	.21	.00	593.
1.01	.55	11	.01	0.00	.01	0.	1.01	12.55	155	.22	.21	.00	594.
1.01	1.00	12	.01	0.00	.01	0.	1.01	13.00	156	.22	.21	.00	594.
1.01	1.05	13	.01	0.00	.01	0.	1.01	13.05	157	.26	.26	.00	630.
1.01	1.10	14	.01	0.00	.01	0.	1.01	13.10	158	.26	.26	.00	681.
1.01	1.15	15	.01	0.00	.01	0.	1.01	13.15	159	.26	.26	.00	702.
1.01	1.20	16	.01	0.00	.01	0.	1.01	13.20	160	.26	.26	.00	711.
1.01	1.25	17	.01	0.00	.01	0.	1.01	13.25	161	.26	.26	.00	714.
1.01	1.30	18	.01	.00	.01	0.	1.01	13.30	162	.26	.26	.00	716.
1.01	1.35	19	.01	.00	.01	0.	1.01	13.35	163	.26	.26	.00	717.
1.01	1.40	20	.01	.00	.01	1.	1.01	13.40	164	.26	.26	.00	717.
1.01	1.45	21	.01	.00	.01	2.	1.01	13.45	165	.26	.26	.00	718.
1.01	1.50	22	.01	.00	.01	3.	1.01	13.50	166	.26	.26	.00	718.
1.01	1.55	23	.01	.00	.01	3.	1.01	13.55	167	.26	.26	.00	719.
1.01	2.00	24	.01	.00	.01	4.	1.01	14.00	168	.26	.26	.00	719.
1.01	2.05	25	.01	.00	.01	5.	1.01	14.05	169	.33	.32	.00	773.
1.01	2.10	26	.01	.00	.01	6.	1.01	14.10	170	.33	.32	.00	849.
1.01	2.15	27	.01	.00	.01	6.	1.01	14.15	171	.33	.32	.00	881.
1.01	2.20	28	.01	.00	.01	7.	1.01	14.20	172	.33	.32	.00	893.
1.01	2.25	29	.01	.00	.01	8.	1.01	14.25	173	.33	.32	.00	898.
1.01	2.30	30	.01	.00	.01	8.	1.01	14.30	174	.33	.32	.00	900.
1.01	2.35	31	.01	.00	.01	9.	1.01	14.35	175	.33	.32	.00	901.
1.01	2.40	32	.01	.00	.01	10.	1.01	14.40	176	.33	.32	.00	902.
1.01	2.45	33	.01	.00	.01	10.	1.01	14.45	177	.33	.32	.00	902.
1.01	2.50	34	.01	.00	.01	11.	1.01	14.50	178	.33	.32	.00	902.
1.01	2.55	35	.01	.00	.01	11.	1.01	14.55	179	.33	.32	.00	903.
1.01	3.00	36	.01	.00	.01	12.	1.01	15.00	180	.33	.32	.00	903.
1.01	3.05	37	.01	.00	.01	12.	1.01	15.05	181	.20	.20	.00	797.
1.01	3.10	38	.01	.00	.01	13.	1.01	15.10	182	.40	.39	.00	813.
1.01	3.15	39	.01	.00	.01	13.	1.01	15.15	183	.40	.39	.00	937.
1.01	3.20	40	.01	.01	.01	14.	1.01	15.20	184	.59	.59	.00	1219.
1.01	3.25	41	.01	.01	.01	14.	1.01	15.25	185	.69	.69	.00	1580.
1.01	3.30	42	.01	.01	.01	15.	1.01	15.30	186	1.68	1.67	.01	2606.
1.01	3.35	43	.01	.01	.01	15.	1.01	15.35	187	2.77	2.76	.01	4758.
1.01	3.40	44	.01	.01	.01	16.	1.01	15.40	188	1.09	1.03	.00	5149.
1.01	3.45	45	.01	.01	.01	16.	1.01	15.45	189	.69	.69	.00	3581.
1.01	3.50	46	.01	.01	.01	16.	1.01	15.50	190	.59	.59	.00	2480.
1.01	3.55	47	.01	.01	.01	17.	1.01	15.55	191	.40	.39	.00	1807.
1.01	4.00	48	.01	.01	.01	17.	1.01	16.00	192	.40	.39	.00	1378.
1.01	4.05	49	.01	.01	.01	18.	1.01	16.05	193	.30	.30	.00	1129.
1.01	4.10	50	.01	.01	.01	18.	1.01	16.10	194	.30	.30	.00	952.

END-OF-PERIOD FLOW (Cont'd)

1.01	4.15	51	.01	.01	.01	18.	1.01	16.15	195	.30	.30	.00	883.
1.01	4.20	52	.01	.01	.01	19.	1.01	16.20	198	.30	.30	.00	859.
1.01	4.25	53	.01	.01	.01	19.	1.01	16.25	197	.30	.30	.00	850.
1.01	4.30	54	.01	.01	.01	19.	1.01	16.30	198	.30	.30	.00	847.
1.01	4.35	55	.01	.01	.01	20.	1.01	16.35	199	.30	.30	.00	846.
1.01	4.40	56	.01	.01	.01	20.	1.01	16.40	200	.30	.30	.00	846.
1.01	4.45	57	.01	.01	.01	20.	1.01	16.45	201	.30	.30	.00	846.
1.01	4.50	58	.01	.01	.01	21.	1.01	16.50	202	.30	.30	.00	846.
1.01	4.55	59	.01	.01	.01	21.	1.01	16.55	203	.30	.30	.00	846.
1.01	5.00	60	.01	.01	.01	21.	1.01	17.00	204	.30	.30	.00	846.
1.01	5.05	61	.01	.01	.01	22.	1.01	17.05	205	.24	.24	.00	792.
1.01	5.10	62	.01	.01	.01	22.	1.01	17.10	206	.24	.24	.00	716.
1.01	5.15	63	.01	.01	.01	22.	1.01	17.15	207	.24	.24	.00	684.
1.01	5.20	64	.01	.01	.01	22.	1.01	17.20	208	.24	.24	.00	672.
1.01	5.25	65	.01	.01	.01	23.	1.01	17.25	209	.24	.24	.00	663.
1.01	5.30	66	.01	.01	.01	23.	1.01	17.30	210	.24	.24	.00	666.
1.01	5.35	67	.01	.01	.01	23.	1.01	17.35	211	.24	.24	.00	665.
1.01	5.40	68	.01	.01	.01	23.	1.01	17.40	212	.24	.24	.00	665.
1.01	5.45	69	.01	.01	.01	24.	1.01	17.45	213	.24	.24	.00	665.
1.01	5.50	70	.01	.01	.01	24.	1.01	17.50	214	.24	.24	.00	665.
1.01	5.55	71	.01	.01	.01	24.	1.01	17.55	215	.24	.24	.00	665.
1.01	6.00	72	.01	.01	.01	24.	1.01	18.00	216	.24	.24	.00	665.
1.01	6.05	73	.06	.04	.02	51.	1.01	18.05	217	.02	.02	.00	509.
1.01	6.10	74	.06	.04	.02	89.	1.01	18.10	218	.02	.02	.00	475.
1.01	6.15	75	.06	.04	.02	107.	1.01	18.15	217	.02	.02	.00	443.
1.01	6.20	76	.06	.04	.02	116.	1.01	18.20	220	.02	.02	.00	413.
1.01	6.25	77	.06	.05	.02	122.	1.01	18.25	221	.02	.02	.00	396.
1.01	6.30	78	.06	.05	.02	126.	1.01	18.30	222	.02	.02	.00	360.
1.01	6.35	79	.06	.05	.02	129.	1.01	18.35	223	.02	.02	.00	336.
1.01	6.40	80	.06	.05	.02	131.	1.01	18.40	224	.02	.02	.00	313.
1.01	6.45	81	.06	.05	.01	134.	1.01	18.45	225	.02	.02	.00	292.
1.01	6.50	82	.06	.05	.01	136.	1.01	18.50	226	.02	.02	.00	273.
1.01	6.55	83	.06	.05	.01	136.	1.01	18.55	227	.02	.02	.00	254.
1.01	7.00	84	.06	.05	.01	140.	1.01	19.00	229	.02	.02	.00	237.
1.01	7.05	85	.06	.05	.01	142.	1.01	19.05	229	.02	.02	.00	222.
1.01	7.10	86	.06	.05	.01	143.	1.01	19.10	230	.02	.02	.00	207.
1.01	7.15	87	.06	.05	.01	145.	1.01	19.15	231	.02	.02	.00	193.
1.01	7.20	88	.06	.05	.01	146.	1.01	19.20	232	.02	.02	.00	180.
1.01	7.25	89	.06	.05	.01	148.	1.01	19.25	233	.02	.02	.00	168.
1.01	7.30	90	.06	.05	.01	149.	1.01	19.30	234	.02	.02	.00	157.
1.01	7.35	91	.06	.05	.01	150.	1.01	19.35	235	.02	.02	.00	146.
1.01	7.40	92	.06	.05	.01	151.	1.01	19.40	236	.02	.02	.00	136.
1.01	7.45	93	.06	.05	.01	152.	1.01	19.45	237	.02	.02	.00	127.
1.01	7.50	94	.06	.06	.01	153.	1.01	19.50	238	.02	.02	.00	119.
1.01	7.55	95	.06	.06	.01	154.	1.01	19.55	239	.02	.02	.00	111.
1.01	8.00	96	.06	.06	.01	155.	1.01	20.00	240	.02	.02	.00	103.
1.01	8.05	97	.06	.06	.01	156.	1.01	20.05	241	.02	.02	.00	96.
1.01	8.10	98	.06	.06	.01	157.	1.01	20.10	242	.02	.02	.00	90.
1.01	8.15	99	.06	.06	.01	157.	1.01	20.15	243	.02	.02	.00	84.
1.01	8.20	100	.06	.06	.01	158.	1.01	20.20	244	.02	.02	.00	78.
1.01	8.25	101	.06	.06	.01	159.	1.01	20.25	245	.02	.02	.00	73.
1.01	8.30	102	.06	.06	.01	159.	1.01	20.30	246	.02	.02	.00	68.
1.01	8.35	103	.06	.06	.01	160.	1.01	20.35	247	.02	.02	.00	64.

END-OF-PERIOD FLOW (Cont'd)

1.01	8.40	104	.06	.06	.01	161.	1.01	20.40	248	.02	.02	.00	59.
1.01	8.45	105	.06	.06	.01	161.	1.01	20.45	249	.02	.02	.00	59.
1.01	8.50	106	.06	.06	.01	162.	1.01	20.50	250	.02	.02	.00	59.
1.01	8.55	107	.06	.06	.01	162.	1.01	20.55	251	.02	.02	.00	59.
1.01	9.00	108	.06	.06	.01	163.	1.01	21.00	252	.02	.02	.00	59.
1.01	9.05	109	.06	.06	.01	163.	1.01	21.05	253	.02	.02	.00	59.
1.01	9.10	110	.06	.06	.01	164.	1.01	21.10	254	.02	.02	.00	59.
1.01	9.15	111	.06	.06	.00	164.	1.01	21.15	255	.02	.02	.00	59.
1.01	9.20	112	.06	.06	.00	164.	1.01	21.20	256	.02	.02	.00	59.
1.01	9.25	113	.06	.06	.00	165.	1.01	21.25	257	.02	.02	.00	59.
1.01	9.30	114	.06	.06	.00	165.	1.01	21.30	258	.02	.02	.00	59.
1.01	9.35	115	.06	.06	.00	166.	1.01	21.35	259	.02	.02	.00	59.
1.01	9.40	116	.06	.06	.00	166.	1.01	21.40	260	.02	.02	.00	59.
1.01	9.45	117	.06	.06	.00	166.	1.01	21.45	261	.02	.02	.00	59.
1.01	9.50	118	.06	.06	.00	166.	1.01	21.50	262	.02	.02	.00	59.
1.01	9.55	119	.06	.06	.00	167.	1.01	21.55	263	.02	.02	.00	59.
1.01	10.00	120	.06	.06	.00	167.	1.01	22.00	264	.02	.02	.00	59.
1.01	10.05	121	.06	.06	.00	167.	1.01	22.05	265	.02	.02	.00	59.
1.01	10.10	122	.06	.06	.00	168.	1.01	22.10	266	.02	.02	.00	59.
1.01	10.15	123	.06	.06	.00	168.	1.01	22.15	267	.02	.02	.00	59.
1.01	10.20	124	.06	.06	.00	168.	1.01	22.20	268	.02	.02	.00	59.
1.01	10.25	125	.06	.06	.00	168.	1.01	22.25	269	.02	.02	.00	59.
1.01	10.30	126	.06	.06	.00	169.	1.01	22.30	270	.02	.02	.00	59.
1.01	10.35	127	.06	.06	.00	169.	1.01	22.35	271	.02	.02	.00	59.
1.01	10.40	128	.06	.06	.00	169.	1.01	22.40	272	.02	.02	.00	59.
1.01	10.45	129	.06	.06	.00	169.	1.01	22.45	273	.02	.02	.00	59.
1.01	10.50	130	.06	.06	.00	169.	1.01	22.50	274	.02	.02	.00	59.
1.01	10.55	131	.06	.06	.00	170.	1.01	22.55	275	.02	.02	.00	59.
1.01	11.00	132	.06	.06	.00	170.	1.01	23.00	276	.02	.02	.00	59.
1.01	11.05	133	.06	.06	.00	170.	1.01	23.05	277	.02	.02	.00	59.
1.01	11.10	134	.06	.06	.00	170.	1.01	23.10	278	.02	.02	.00	59.
1.01	11.15	135	.06	.06	.00	170.	1.01	23.15	279	.02	.02	.00	59.
1.01	11.20	136	.06	.06	.00	171.	1.01	23.20	280	.02	.02	.00	59.
1.01	11.25	137	.06	.06	.00	171.	1.01	23.25	281	.02	.02	.00	59.
1.01	11.30	138	.06	.06	.00	171.	1.01	23.30	282	.02	.02	.00	59.
1.01	11.35	139	.06	.06	.00	171.	1.01	23.35	283	.02	.02	.00	59.
1.01	11.40	140	.06	.06	.00	171.	1.01	23.40	284	.02	.02	.00	59.
1.01	11.45	141	.06	.06	.00	171.	1.01	23.45	285	.02	.02	.00	59.
1.01	11.50	142	.06	.06	.00	171.	1.01	23.50	286	.02	.02	.00	59.
1.01	11.55	143	.06	.06	.00	172.	1.01	23.55	287	.02	.02	.00	59.
1.01	12.00	144	.06	.06	.00	172.	1.02	0.00	288	.02	.02	.00	59.

SUM 33.15 31.71 1.44 92708.
(142.1) (805.1) (37.1) (2815.20)

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	5149.	997.	872.	322.	92694.
CMS	146.	28.	9.	9.	2825.
INCHES		25.70	33.18	33.18	33.18
MM		652.77	842.65	842.65	842.65
AC FT		495.	638.	638.	638.
THOUS CU M		610.	787.	787.	787.

SURFACE AREA=	0.	14.	15.	18.	26.
CAPACITY=	0.	154.	230.	395.	612.
ELEVATION=	582.	585.	590.	600.	610.

SUMMARY OF DAM SAFETY ANALYSIS

PMF

RATIO OF PMF	MAXIMUM RESERVOIR W.S. ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC FT	MAXIMUM OUTFLOW CFS	DURATION ROUTE TOP HOURS	TIME OF REACHING DOWN STREAM	TIME OF FAILURE HOURS
.....			INITIAL VALUE	OUTLINEY EFFECT		TOP OF DAM	
	ELEVATION		585.00	535.00		580.00	
	STORAGE		158.	150.		24.	
	OUTFLOW		0.	0.		61.	
.10	587.00	1.00	100.	72.	9.00	18.	0.00
.12	588.00	1.05	200.	87.	1.75	17.17	0.00
.50	593.30	1.30	234.	2315.	7.50	10.17	0.00
1.00	599.00	2.00	251.	4000.	11.25	15.00	0.00

SUMMARY OF DAM SAFETY ANALYSIS

1 PERCENT CHANCE FLOOD

.....	INITIAL VALUE	SPILLWAY CREST	TOP OF DAM
ELEVATION	585.00	585.00	588.00
STORAGE	156.	156.	200.
OUTFLOW	0.	0.	81.

RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
1.00	588.27	.27	204.	156.	4.00	12.20	0.00

SUMMARY OF DAM SAFETY ANALYSIS

10 PERCENT CHANCE FLOOD

.....	INITIAL VALUE	SPILLWAY CREST	TOP OF DAM
ELEVATION	585.00	585.00	588.00
STORAGE	156.	156.	200.
OUTFLOW	0.	0.	81.

RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
1.00	587.07	0.00	186.	37.	0.00	14.08	0.00

5000

VATTEROTT LAKE
PMF & 1% CHANCE FLOOD
INFLOW & OUTFLOW
HYDROGRAPHS


4000


Q (CFS)

3000

2000

1000

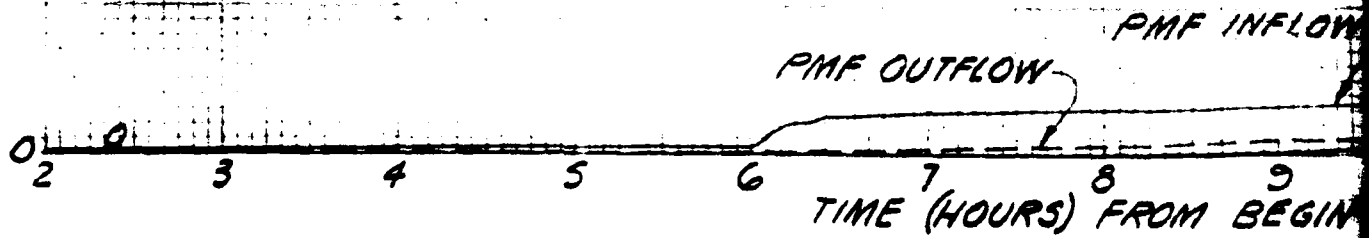

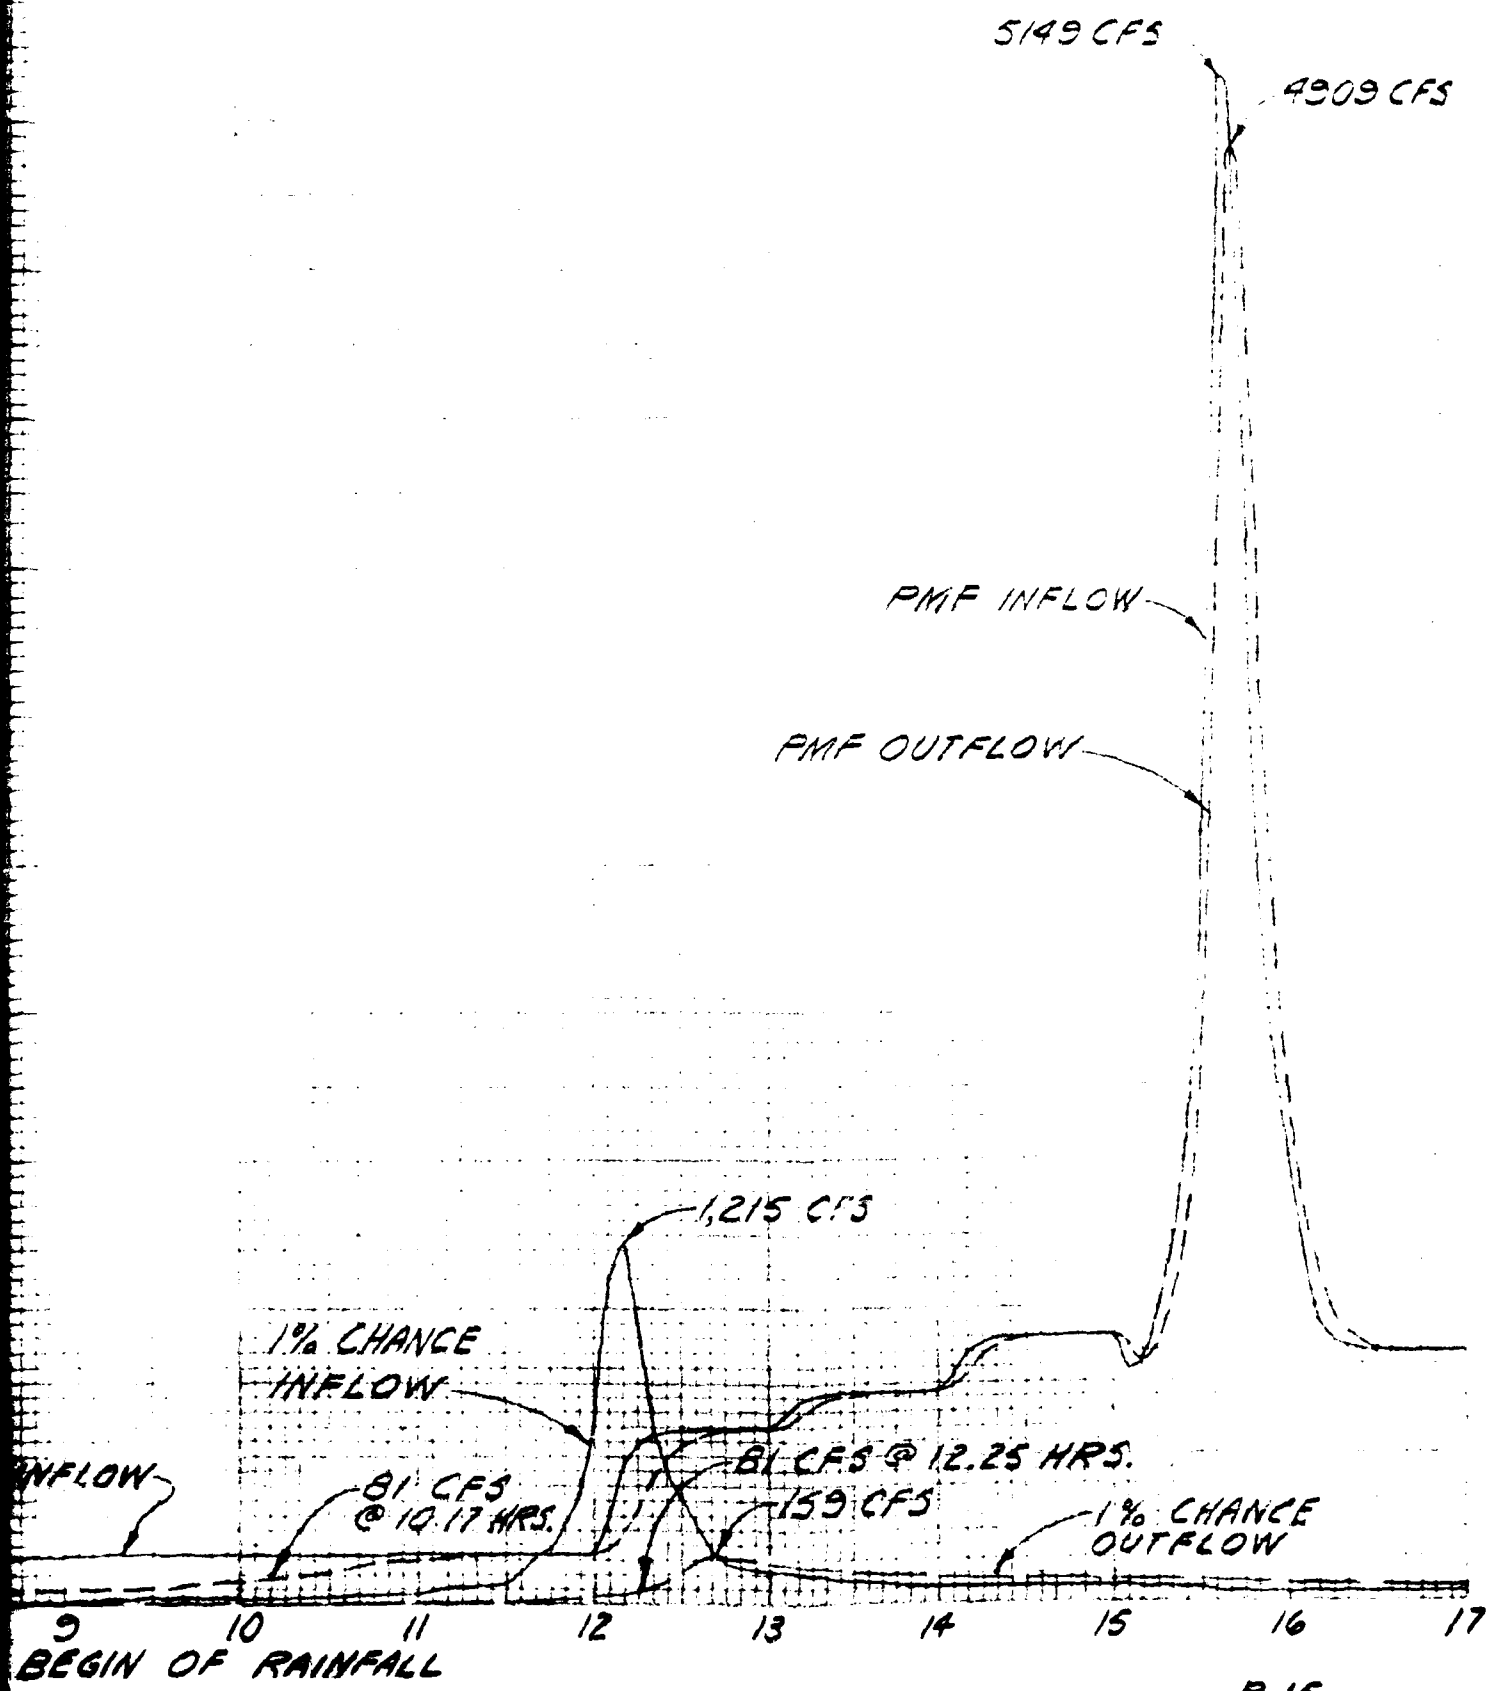

DATE
ILME