AD-A137 458 DSP1 A DIFFRACTOMETER SUBROUTINE PACKAGE FOR PDP-8 COMPUTERS(U) ARMY MATERIALS AND MECHANICS RESEARCH CENTER WATERTOWN MA C B WALKER NOV 83 AMMRC-TR-83-59 1/1

UNCLASSIFIED F/G 9/2 NL

END
DATE FILMED
2-84
DTIC

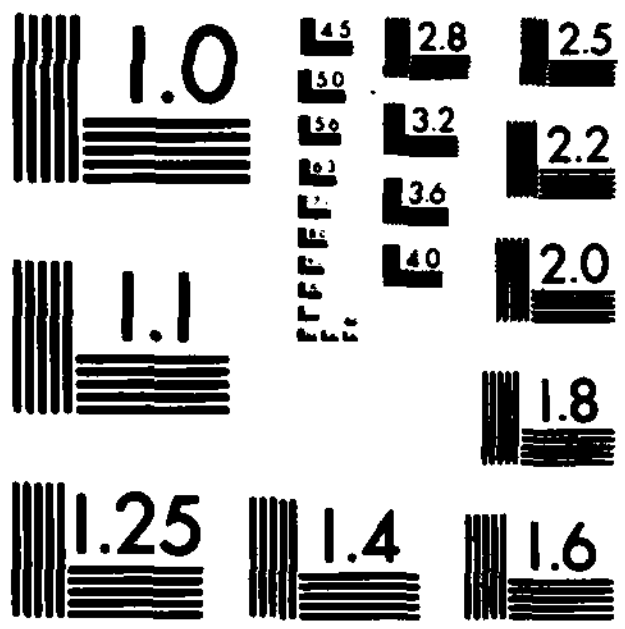

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD A137458

(7)

AMMRC TR 83-59

AD

DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE FOR PDP-8 COMPUTERS

CHRISTOPHER B. WALKER
METALS RESEARCH DIVISION

November 1983

Approved for public release; distribution unlimited.

ARMY MATERIALS AND MECHANICS RESEARCH CENTER
Watertown, Massachusetts 02172

84 02 03 038

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE

READ INSTRUCTIONS BEFORE COMPLETING FORM

1. REPORT NUMBER AMMRC TR 83-59	2. GOVT ACCESSION NO. AD-A137 458	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE FOR PDP-8 COMPUTERS		5. TYPE OF REPORT & PERIOD COVERED Final Report 6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s) Christopher B. Walker		8. CONTRACT OR GRANT NUMBER(s)
9. PERFORMING ORGANIZATION NAME AND ADDRESS Army Materials and Mechanics Research Center Watertown, Massachusetts 02172 DRXMR-MM		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS D/A Project: 1L161102AH42
11. CONTROLLING OFFICE NAME AND ADDRESS U. S. Army Materiel Development and Readiness Command, Alexandria, Virginia 22333		12. REPORT DATE November 1983 13. NUMBER OF PAGES 33
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. SECURITY CLASS. (of this report) Unclassified 15a. DECLASSIFICATION/DOWNGRADING SCHEDULE

16. DISTRIBUTION STATEMENT (of this Report)

Approved for public release; distribution unlimited.

17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)

18. SUPPLEMENTARY NOTES

19. KEY WORDS (Continue on reverse side if necessary and identify by block number)

X-ray diffraction	Computer program documentation
Diffractometers	Subroutines
Automation	DEC PDP-8

20. ABSTRACT (Continue on reverse side if necessary and identify by block number)

(SEE REVERSE SIDE)

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

Block No. 20

ABSTRACT

This report describes a package of subroutines and short programs which, when used in conjunction with the floating point package, FPP1, can control a single crystal X-ray diffractometer in a variety of easily modified experiments.

CONTENTS

INTRODUCTION

The AMMRC diffractometer subroutine package, DSP1, was developed to allow a PDP-8 computer with a 4K memory to control a 4-axis X-ray diffractometer in a variety of step scan and integrated intensity measurements in the AMMRC program of materials research. It is used in conjunction with the AMMRC floating point package, FPP1, described in detail in AMMRC TR 83-47, which it uses for all calculations, input, and output. The general functions of DSP1 include storage and retrieval of scan parameters, conversion of reciprocal space coordinates (for cubic systems) into shaft angle settings, anti-backlash shaft positioning, and fixed time/fixed count X-ray counting (with dead time correction), plus bookkeeping and manipulation to repeat measurements for scans with either one (1-D) or two (2-D) sets of increments. It is composed of 40 subroutines ranging from simple wait loops to complex operations, with the addresses of 31 of these listed on page 0 for easy access, plus a minimal interrupt routine. It also includes a few examples of programs for standard types of measurements. The DSP1 package occupies 978 words of memory, thus, DSP1 and FPP1 together occupy 2079 words, leaving approximately half the 4K memory available for data storage and other programming. As with FPP1, linkages for multiple field operations are left to users with more experience in extended memory systems.

We shall first summarize the particular diffractometer and computer interface characteristics and instructions that are reflected in this package. Next, we describe the function and use of each subroutine, taken roughly in order of increasing complexity. We then consider the examples of standard programs, outlining their use in some detail. Finally, after a few other comments, we include a complete PAL III pass 3 listing of the assembled package.

HARDWARE AND IOT SPECIFICS

The diffractometer axes are driven by Slo-Syn stepping motors which have step intervals of $.005^\circ$ for the 2θ, Ω, and χ rotations and $.01^\circ$ for the ϕ rotation. These intervals are reflected in the conversion constants stored at 4745 ff.

The output pulses from the single channel pulse height analyzer of the X-ray detection electronics are counted in the computer through a data break arrangement that increments memory location 0037. There are no hardware provisions to clear 0037 or to detect its overflow. The time constant for count-rate dead time corrections, DDTAU (3672), has been approximated as 4.0 μ sec; it should be measured accurately for the particular system. The counting circuit and the internal clock are both gated by the same 'Enable' flip-flop.

The internal clock is based on a crystal-controlled clock operating at a frequency of 9.600 kHz. When its gate is enabled, that clock output is scaled by a 5-bit binary scaler to yield 300 pulses per second to set the clock flag. If the Interrupt is on, setting the clock flag causes a program interrupt, and control branches to the interrupt routine to identify the set flag and carry out the operations planned for that situation.

1. **WALKER, C. B.** ***FPP1, A Floating Point Package for PDP-8 Computers.*** **Army Materials and Mechanics Research Center, AMMRC TR 83-47, August 1983.**

The external counter/timer unit is started and stopped by the same 'Enable' flip-flop that controls the internal clock and counting gates. It is reset by a separate signal.

The teletype (TTY) motor can be turned off and on by a program-controlled relay to avoid overheating during long runs.

The program commands, called IOT instructions, that are provided to use this hardware are as follows:

6311 - Skip the next instruction if the clock flag is not set.
6312 - Clear the clock scaler and clock flag, and turn ON the clock/count 'Enable' flip-flop.
6314 - Turn OFF the clock/count 'Enable' flip-flop.
6316 - Clear the clock scaler and clock flag, and turn OFF the clock/count 'Enable' flip-flop.
6321 - Increase the 2θ setting one step.
6322 - Decrease the 2θ setting one step.
6324 - Increase the Ω setting one step.
6331 - Decrease the Ω setting one step.
6332 - Increase the χ setting one step.
6334 - Decrease the χ setting one step.
6341 - Increase the φ setting one step.
6342 - Decrease the φ setting one step.
6344 - Reset the external counter/timer unit.
6351 - Turn OFF the teletype motor.
6352 - Turn ON the teletype motor.
6354 - Unused.

Turning on the computer power establishes the following initial states: the clock/count 'Enable' flip-flop is turned OFF; the clock scaler and clock flag are cleared; the teletype motor is turned ON; and the Interrupt is turned OFF.

SUBROUTINES

The description of each DSP1 subroutine includes its name, a parenthesized Z if its address is listed on page 0, its address, and a brief discussion of its function and usage, as follows:

WAIT	(5345)	- Do nothing for 2311 machine cycles, ~ .0035 sec. Used, for example, to establish the pulse rate to the stepping motors.
PAWS	(5354)	- Pause for N wait loops, where -N is in the AC on entry.
TTYOF(Z)	(5171)	- Turn off TTY motor; pause ~ 1 sec before exit.
TTYON(Z)	(5362)	- Turn on TTY motor; pause ~1 sec before exit.
SFRMT(Z)	(5062)	- Set the standard output format: F8.3, with no automatic following carriage return/line feed.
FCMIN	(4714)	- Set FAC to $\sim 2^{-128}$; used to avoid division problems when FAC = 0.
ARCSIN	(4721)	- Calculate $\sin^{-1}$ (FAC), and leave the result (limited to the range, $\pm\frac{\pi}{2}$) in FAC. If FAC > 1 on entry, set FAC to $\sim 2^{+565}$ so the angle will be ignored as exceeding diffractometer limits.

TRICR(Z) (5000) - Tricrement (i.e., add three to) locations V1 and V2; used in manipulating a series of sequentially stored 3-word floating point numbers.

DO3A(Z) (5114)
DO3B(Z) (5122) - Do the program between JMS DO3A and JMS DO3B three times, tricrementing V1 and V2 after each pass. V2 must be preset before entry; V1 may be either preset (then AC = 0) or carried in AC on entry to DO3A. These delimit a 3-cycle DO loop for operations on 3 sequentially stored variables, e.g., vector components.

READA(Z) (5011) - Input an angle (in deg) which is converted to motor steps with the multiplier at the address in V2 and stored at the address in V1; V1 and V2 are tricremented before exit.

TYPEA(Z) (5025) - Output the angle (in deg) stored at the address in V1, after conversion from motor steps using the multiplier at the address in V2; V1 and V2 are tricremented before exit.

RSTAS(Z) (4210) - Input (in deg) a set of angles - 2θ, χ, φ - which are converted to motor steps and stored in consecutive (floating point word) locations, with the address of the first either preset in V1 (so AC = 0) or carried in AC on entry.

READV(Z) (5130) - Input vector components (3), which are stored consecutively, with the address of the first (the vector address) either preset in V1 (so AC = 0) or carried in AC on entry.

SHFTV(Z) (5140) - Get the vector (3 components) with the vector address in V2 and store it at the vector address in V1.

TYPEV(Z) (5150) - Output the components of the vector with the vector address in V1.

ADDV(Z) (5160) - Add the vector with the vector address in V1 to the vector with the vector address in V2 and store the resultant vector at the vector address in V1.

MPYV (4671) - Form the scalar product of the vectors with the vector addresses in V1 and V2, and leave the result in FAC.

MPYVH (4707) - Form the scalar product of the vector with the vector address in V1 and the diffraction vector **H** (vector address: 4532), and leave the result in FAC.

TYPEX(Z) (4000) - If the vector address of the diffraction vector **H** is in AC on entry, output the components of **H**; if the address of 2θ is in AC on entry, output (in deg) the set of angles: 2θ, χ, φ. Any unwanted angle output may be suppressed by changing the appropriate "4526" instruction to "4521."

TYCPS(Z) (5073) - Output the corrected count rate, CPS (3700), in counts/sec.

TYCNT(Z) (5102) - Output the measured counts stored in HICNT, LOCNT (3676, 3677) in integer format I8; then reset for standard format.

RCOMI(Z) (4200) - Input an integer <4096 and exit with its complement in AC.

CTLMT(Z) (4173) - Input a preset count limit (in units of 4096), an integer not to exceed 2047. This limit will apply to all the scans in a programmed series of measurements.

TMLMT(Z) (3707) - Input a preset time limit (in sec) which is converted to scaled clock pulses and stored at the address in V1. Each scan in a programmed series has its own preset time limit.

DFLMT(Z) (5036) - Input (in deg) the set of diffractometer angle limits - $2\theta_{upper}$, $2\theta_{lower}$, χ_{upper}, χ_{lower} - which are converted and stored as TTHU (5232), etc.

XTAL(Z) (4400) - First, input the Miller indices specifying the direction in the single crystal of the vector **N** parallel to the φ axis of rotation (**N**||**H** when $\chi = 0$); next, input the Miller indices specifying the direction of the vector **P** perpendicular up from the diffraction plane when $\chi = \varphi = 0$. These are normalized and stored, along with the derived components of the 3rd orthogonal vector, $\mathbf{T} = \mathbf{P} \times \mathbf{N}$. Input, finally, the value of $\lambda/2a_o$, where λ is the X-ray wavelength and a_o is the unit cell edge. This routine, and the routine ANGLE discussed next, are used to calculate the 2θ, χ, and φ settings for a given position of the diffraction vector **H** in reciprocal space. They apply only to crystals with cubic symmetry.

ANGLE(Z) (4600) - Calculate, convert to motor steps, and store the set of angles - 2θ, χ, φ - for a given diffraction vector **H** and the crystal specifics entered with XTAL using the algorithms:

$$2\theta = 2 \sin^{-1}(|H|\lambda/2a_o) \qquad \varphi = -\tan^{-1}(H_t/H_p)$$

$$\chi = \mathrm{sgn}(H_p) \tan^{-1}[(H_t{}^2 + H_p{}^2)^{\frac{1}{2}}/H_n].$$

H and its components along **N**, **T**, and P are all in units of $a_o{}^{-1}$.

LIMIT(Z) (5200) - Test whether 2θ and χ are within the specified diffractometer angle limits. If either angle is outside its limits, exit the subroutine normally; if both are within their limits, exit to the second instruction after the subroutine call.

MOVE (5272) - Change a specified angle by N motor steps, where the integer N is in HORD, LORD (0045, 0046) on entry. If $N < 0$, a 40-step overrun and runback is added so that the final motion is towards increasing angle, as an anti-backlash provision. The address of the IOT instruction to decrease that angle one step is in LIMIT (5200) on entry. Rotation is at a constant rate, ~280 steps/sec, without initial or final ramping.

RUNOVR (5332) - Add -40 to the integer in HORD, LORD; used in MOVE above.

STEP(Z) (5246) - Move (anti-backlash) the three diffractometer angles from their current settings, stored in TTHO ff, to their new settings, stored in TTH ff. The angles changed are those whose IOT step instructions are the first three pairs of entries in the table beginning at 5370.

CNTADD (3727) - Update the count stored in HICNT, LOCNT by transferring the contents of the data break counter, DBCNTR (0037), to LOCNT and incrementing HICNT if the new LOCNT number is smaller than the previous one (i.e., DBCNTR has overflowed). When updating is done at each clock interrupt, missed overflows should occur only for count rates $\sim 10^6$ counts/sec, and at such rates dead time losses are already prohibitively large.

COUNT(Z) (3600) - Count X-ray pulses (using CNTADD) up to the preset time or preset count limit, whichever is first, and calculate and store in CPS the X-ray count rate corrected for dead time losses. This uses the interrupt routine, changing the response address to select the actions appropriate to the begin, run, and stop phases as needed. This is the only use of the interrupt facility in this package.

CLEAR(Z) (3717) - Clear various flags and registers identified in the PAL III listing. This is a first step in most programs.

BASIC(Z) (4163) - This block routine incorporates the following routines needed at the start of most measurements: clear flags and registers; input diffractometer angle limits; input the current diffractometer angle settings; input the preset count limit; and set the standard output format.

INDTS(Z) (4222) - This block routine handles input and storage of the data defining the various 1-D or 2-D scans in a desired series of measurements. Input, first, the number of scans in the series. For each scan in turn, input its preset time limit, the three initial settings (angles or components of **H**, depending on the type of scan), the increments for each variable in a scan step, and the number of such steps. For 2-D scans, input also the second increments for each variable, and the number of these second steps. A switch address, SWADD (4257), is preset to treat the data as angles or as components of **H**; all the scans in a series must be of that same type. If 2-D scans are involved, for which AC = 7777 on entry, the data for all scans must have the 2-D format; in this case, a real 1-D scan is achieved by having 1 as the second step number. These data are stored sequentially in two series; namely, the floating point numbers in locations 1600 thru 3477 and the integers in 3500 thru 3577 (see STOREZ, ISTORZ, and COUNT). That storage is sufficient for a series of 32 2-D scans or 45 1-D scans.

GTNDS(Z) (4262) - Bring the data defining the next scan to be run in the series from storage to the appropriate active program locations. Retrieves data stored by INDTS.

SCNET(Z) (4321) - This block routine carries out the complete programmed series of step scan measurements. The data defining a scan are retrieved, and for each point on that scan, the diffractometer angles are calculated and positioned, the X-ray intensity is measured for the preset time (or preset count), and the results are typed out. This is repeated for each of the programmed scans. The output at each point consists of the three variables (angles or components of **H**, as per scan type), the measured count, and the count rate (counts/sec) corrected for dead time. In angle scans, any unwanted angle typout may be suppressed by a program change as discussed in TYPEX, but note that this suppression applies to all of the scans in the series.

SCINT(Z) (4020) - This block routine carries out a complete programmed series of integrated intensity scan measurements. These are 2-D angle-type scans similar to those of SCNET, but, for each second increment step, the measured count rate (corrected for dead time) is summed over all points in the set of first increment steps, and the single line of output for that pass consists of its three initial angle settings (unwanted typouts suppressed as discussed above) and its integrated corrected count rate, I. By presetting ANGX (4153) and PPRX (4154) to refer to an angle A given a significant second increment, an average value of A is also calculated at the end of the scan; a final line of output gives, first, a sum of the products, (I-B)*A, over all second increment steps, then a sum of I-B over all such steps, and finally, from their quotient, the average value of A. B is a preset integrated background cutoff; the quantities (I-B) for any second step are included in the calculations only if (I-B)>0.

STANDARD PROGRAMS

Complete programs of four different types have been included in this package for both their usefulness for standard measurements and calculations and as examples of how to program using DSP1.

Program I, with Start Address (SA) = 0312, calculates the angles, 2θ, χ, and φ, that correspond to a given diffraction vector **H** for a cubic crystal of specified orientation and $\lambda/2a_o$. It is used, for example, to calculate the angles at various checkpoints to verify the accuracy of diffractometer angle settings during a series of measurements. One enters first the crystal specifications: the components of **N** and **P** and the constant, $\lambda/2a_o$ (see XTAL). Then input of any set of components of **H** (in units of a_o^{-1}) gives rise to output of the corresponding values for 2θ, χ, and φ (in deg), in that order, and the program jumps back to await the next vector **H**. As an illustration, we consider a crystal with [111] parallel to the φ axis, $[\bar{2}11]$ up vertical to the diffraction plane when $\chi = \varphi = 0$, and with $\lambda/2a_o = 0.23858$, and we want the angles corresponding to the vector, (H1, H2, H3) = (2.25, 2.25, 1.25). The TTY printout could look as follows:

```
1 1 1   -2 1 1   0.23858↵

2.25  2.25  1.25    109.300   -13.818    60.000
```

where ↵ indicates input of the non-printing character, carriage return.

The three programs involving intensity measurements all begin with the same initialization, JMS I BASICZ, in which one first enters the set of diffractometer angle limits ($2\theta_u$, $2\theta_\ell$, χ_u, χ_ℓ), then the current diffractometer angle settings ($2\theta_o$, χ_o, φ_o), and finally, the preset count limit. The angles are in degrees, and the preset count is in units of 4096 counts. A typical TTY printout of this initialization, with carriage returns to improve appearance, might look as follows:

```
160.  5.  16.  -55.↵

120.  0.  0.↵

100↵
```

Program II carries out step scan measurements with three angles as variables. These may be either 1-D scans (e.g., scans with a given $\Delta 2\theta$), for which SA = 0330, or 2-D scans (e.g., scans with a given $\Delta 2\theta$, repeated with χ incremented by $\Delta\chi$), for which SA = 0323; the different Start Addresses allow registers and switches to be preset without manual intervention. After initialization, INDTS is used to enter the scan data - the number of scans in the series, and for each scan, the preset time, the initial angle settings, the first angle increments, the number of such steps, and for 2-D scans, the second angle increments, and the number of these second steps; preset times are in seconds, and angles are in degrees. The routine SCNET carries out the programmed series of measurements, outputting for each point the three diffractometer angles (in deg) (see TYPEX for the suppression of unwanted angle typouts), the measured count, and the count rate (counts/sec) corrected for dead time. The program then halts at 0340. The three angles controlled by this program are those whose negative and positive IOT step instructions are stored as pairs in locations 5370 thru 5375, given here as the standard set, 2Δ, X, and φ. If program control of Ω is needed, its pair of IOT instructions (now in 5376, 5377) must be substituted manually for one of the other pairs (if Ω replaces φ, one must also change the number in 4753 from 0015 to 0016), and one must remember afterwards to reestablish the standard set expected in other programs. As an illustration, a TTY printout of the data input after initialization for a 2θ step scan from 97° to 103° in .05° intervals, with 10-second counts at each point, bracketed by 100-second background counts at the start and finish, could look as follows:

```
3↵

100.   97.  0  0    0  0  0  1↵

 10.   97.  0  0  .05  0  0  121↵

100.  103.  0  0    0  0  0  1↵
```

The present data storage (see INDTS) will allow a series of up to 15 such background/scan/background sets. A double space separates the output of each separate scan. A single space would separate the output for each second increment step in a 2-D scan.

Program III is similar to program II, except that the variables are the components of **H** (in units of a_0^{-1}) rather than the three angles. One can run a series of 1-D scans (linear scans in reciprocal space), for which SA = 0351, or a series of 2-D scans (points on planar nets), for which SA = 0343. After initialization, one first enters the crystal specifications (see program I above); next, INDTS is used to enter the scan data - the number of scans in the series, and for each scan, the preset time, the initial vector components (H1, H2, H3), the component increments in step 1, the number of such steps, and for 2-D scans, the component increments for step 2, and the number of those second steps. The routine SCNET then carries out the series of measurements, outputting for each point the vector components (H1, H2, H3), the measured count, and the count rate (counts/sec) corrected for dead time. The program then halts at 0362. As an illustration, the TTY printout of the data input after initialization for a 2-D rectangular net scan in the ($1\bar{1}0$) plane containing the (222) reciprocal lattice point for the crystal specified in program I, with 30-second counts at each point, could look as follows:

```
1 1 1   -2 1 1   0.23858↵

1↵

30.   2.05  1.90  1.90    .01  .01  .01  11   -.02  01  .01  11↵
```

The net intervals here are .01[111] and .01[$\bar{2}$11].

Program IV carries out integrated intensity scans with three angles as variables. These are 2-D type scans as in program II, but for each second increment step the corrected count rate is summed over all points in the set of first increment steps. This is used, for example, to determine lattice parameters from single crystal reflections. After initialization, INDTS is used to enter the scan data - the number of scans in the series, and for each scan in turn, the preset time, the initial angle settings, the angle increments for step 1, the number of such steps, the angle increments for step 2, and the number of these second steps. Finally, an estimate of an integrated background rate, B, is entered. The routine SCINT then carries out the series of measurements, outputting for each step 2 in a scan its three initial angle settings (see TYPEX for the suppression of unwanted angle typouts) and its integrated count rate, I, with a final line after each scan giving first a sum of products, (I-B)*A, over all step 2, next a sum of (I-B), over all step 2, and then, from their quotient, an average value for A, where A is a preselected angle given a significant second increment (see SCINT). After all scans are completed the program halts at 0376. The integrated background, B, is a cutoff value [the quantities (I-B) are included in the calculations only if (I-B)>0] that applies to all scans in the series, thus, the actual backgrounds for all the scans in a series should be similar if this is to be useful. The TTY printout of the data input after initialization differs from a 2-D program II printout only by one final entry, B, so an illustration is unnecessary.

DISCUSSION

DSP1 was developed to control a 4-axis X-ray diffractometer in a variety of diffuse-scattering and integrated-intensity measurements on single crystal samples where only three axes are actually under program control at any one time. Control of the usual three axes - 2θ, χ, and φ - was sufficient for most of this work, and the changes to include Ω in the controlled set in place of one of the others could easily be made by hand; consequently, we have not tried to extend the routines further. DSP1 can also control a variety of experiments on an X-ray powder diffractometer (e.g., line profiles), though for such cases one surely can produce a significantly smaller control package of comparable effectiveness by eliminating the several routines and quantities appropriate just to single crystal work.

The stepping of each axis from one position to the next is done at a constant rate, ~280 steps/sec (i.e., 1.4 deg/sec for 2θ, χ, or Ω, and 2.8 deg/sec for φ), with no gradual acceleration at the start or deceleration at the finish (i.e., ramping). Spot checks of angle positions during and after runs over several days in our experiments showed that the Slo-Syn motors were able to respond at that rate without errors. The loading of the various axes here was not large, so if heavy loads (e.g., cryostats) are to be driven, one should recheck this point.

The DSP1 programming is all on a single level, with no attempt to exploit the computer interrupt feature to carry out two tasks "simultaneously," such as calculations and pulse counting. As the package is now arranged, almost all of the time during pulse counting periods is spent idling (jumping in place), waiting for the next clock flag interrupt. That time could be used for other tasks by more sophisticated programming, with a possible increase in the effective dead time as the only anticipated drawback. In our uses, the non-counting time has been such a small fraction of the total run time that there has been no incentive to try that approach, but in experiments involving shorter measurements or longer calculations, it could offer a significant improvement.

The present package has reserved locations 1600 thru 3577 for storage of scan data. This leaves more than 700 locations in a 4K memory that are not used or reserved by DSP1 and FPP1 and that are available for further data storage or for program additions and improvements. The user is urged to regard this package as a flexible tool, to which additions and modifications should be made freely to fit changing needs and as a rewarding educational exercise.

```
                 /DIFFRACTOMETER SUBROUTINE PACKAGE  -  AMMRC DSP1
                 /
                 /                  12 JULY 1983
                 /
                 /THIS IS A COLLECTION OF SUBROUTINES TO SIMPLIFY
                 /WRITING PROGRAMS TO CONTROL A THREE-AXIS X-RAY
                 /DIFFRACTOMETER.  IT USES THE AMMRC FPP1 FLOATING
                 /POINT PACKAGE.  THE INTERRUPT ROUTINE INCLUDED IS
                 /JUST A BARE MINIMUM.  A FEW EXAMPLES OF PROGRAMS
                 /FOR STANDARD OPERATIONS ARE INCLUDED.
                 /
                 /
                 *0001
0001   3032                DCA ACSAVE
0002   5433                JMP I INIPT
0003   6312      OUT2,     6312              /CLEAR CLOCK FLAG
0004   1032      OUT1,     TAD ACSAVE
0005   6001                ION
0006   5400                JMP I 0
0007   7000                7000
                 *0015
0015   0000      AUT1,     0
                 *0032
0032   0000      ACSAVE,   0
0033   0200      INIPT,    INITI
0034   0003      CLOCK,    OUT2
0035   0000      V1,       0
0036   0000      V2,       0
0037   0000      DBCNTR,   0                 /DATA BREAK COUNTER
0040   0000      EX1,      0                 /AMMRC FPP1 USES 0007, 0015,
0041   0000      AC1H,     0                 /AND 0040 THROUGH 0064.
0042   0000      AC1L,     0
0043   0000      OVER1,    0
0044   0000      EXP,      0
0045   0000      HORD,     0
0046   0000      LORD,     0
0047   0000      OVER2,    0
0050   0000      QUOL,     0
0051   0000      LOC1,     0
0052   0000      LOC2,     0
0053   0000      LOC3,     0
0054   0003      NDEC,     0003
0055   0010      NDIG,     0010
0056   0027      NBRX,     0027
0057   0000      NBRHI,    0
0060   0000      NBRLO,    0
0061   7777      SWIT1,    7777
0062   7370      READ,     7370
0063   7172      TYPE,     7172
0064   5724      CRLF,     5724
0065   4532      HIZ,      HI                /KEY WORD, STORAGE ADDRESSES
0066   3500      ISTORZ,   3500
0067   1600      STOREZ,   1600
```

```
0070   5370   TTHNPZ,    TTHNP
0071   4756   TTHZ,      TTH
0072   4767   TTH0Z,     TTH0
0073   5160   ADDVZ,     ADDV              /SUBROUTINE ADDRESSES
0074   4600   ANGLEZ,    ANGLE
0075   4163   BASICZ,    BASIC
0076   3717   CLEARZ,    CLEAR
0077   3600   COUNTZ,    COUNT
0100   4173   CILMIZ,    CILMI
0101   5036   DFLMIZ,    DFLMI
0102   5114   DO3AZ,     DO3A
0103   5122   DO3BZ,     DO3B
0104   4262   GINDSZ,    GINDS
0105   4222   INDISZ,    INDIS
0106   5200   LIMIIZ,    LIMII
0107   4200   RCOMIZ,    RCOMI
0110   5011   READAZ,    READA
0111   5130   READVZ,    READV
0112   4210   RSTASZ,    RSTAS
0113   4020   SCINTZ,    SCINT
0114   4321   SCNEIZ,    SCNEI
0115   5062   SFRMIZ,    SFRMI
0116   5140   SHFTVZ,    SHFTV
0117   5246   STEPZ,     STEP
0120   3707   TMLMIZ,    TMLMI
0121   5000   TRICKZ,    TRICK
0122   5171   TTYOFZ,    TTYOF
0123   5362   TTYONZ,    TTYON
0124   5102   TYCNIZ,    TYCNI
0125   5073   TYCPSZ,    TYCPS
0126   5025   TYPEAZ,    TYPEA
0127   5150   TYPEVZ,    TYPEV
0130   4000   TYPEXZ,    TYPEX
0131   4400   XTALZ,     XTAL

              *0200
0200   6311   INIRI,     6311              /SKIP IF NO CLOCK FLAG
0201   5434              JMP I CLOCK
0202   6031              KSF               /SKIP IF READER FLAG SET
0203   7410              SKP
0204   4462              JMS I READ
0205   6042              TCF
0206   5004              JMP OUII

              /
              /PROGRAM EXAMPLES
              /
              *0312
              /CALCULATE 3-AXIS ANGLES
0312   4476              JMS I CLEARZ
0313   4531              JMS I XTALZ
0314   1065              TAD HIZ
0315   4511              JMS I READVZ
0316   4474   SCNTTH,    JMS I ANGLEZ
0317   1071              TAD TTHZ
```

```
0320  4530            JMS I TYPEXZ
0321  4464            JMS I CRLF
0322  5314            JMP SCNT1H-2
              /
              /SCAN BY ANGLE INCREMENTS
0323  4475            JMS I BASICZ     /2-D SCAN START
0324  1112            TAD RSTASZ
0325  3741            DCA I SWADD1
0326  7040            CMA
0327  5333            JMP .+4
0330  4475            JMS I BASICZ     /1-D SCAN START
0331  1112            TAD RSTASZ
0332  3741            DCA I SWADD1
0333  4505            JMS I INDTSZ
0334  1007            TAD 0007
0335  3742            DCA I SWADD2
0336  1071            TAD T1HZ
0337  4514            JMS I SCNETZ
0340  7402            HLT
0341  4257    SWADD1,  SWADD
0342  4334    SWADD2,  SCNT1
              /
              /SCAN BY RECIPROCAL SPACE VECTOR INCREMENTS
0343  4475            JMS I BASICZ     /2-D SCAN START
0344  4531            JMS I XTALZ
0345  1111            TAD READVZ
0346  3741            DCA I SWADD1
0347  7040            CMA
0350  5355            JMP .+5
0351  4475            JMS I BASICZ     /1-D SCAN START
0352  4531            JMS I XTALZ
0353  1111            TAD READVZ
0354  3741            DCA I SWADD1
0355  4505            JMS I INDTSZ
0356  1316            TAD SCNT1H
0357  3742            DCA I SWADD2
0360  1065            TAD HTZ
0361  4514            JMS I SCNETZ
0362  7402            HLT
              /
              /INTEGRATING SCAN
0363  4475            JMS I BASICZ
0364  1112            TAD RSTASZ
0365  3741            DCA I SWADD1     / PRESET "TYPEX" TO ELIMINATE
0366  7040            CMA              / USELESS PRINTOUTS
0367  4505            JMS I INDTSZ
0370  4407            JMS I 0007       / PRESET "ANGX" AND "PPRX" TO
0371  0010            0010             / REFER TO SECOND INCREMENT ANGLE
0372  6777            FPUT I BKGND1
0373  0000            FEXT
0374  1071            TAD T1HZ
0375  4513            JMS I SCINTZ
0376  7402            HLT
0377  4474    BKGND1,  BKGND
              /
```

```
                *3600
3600  0000  COUNT,   0
3601  4317           JMS CLEAR
3602  4407           JMS I 0007
3603  5302           FGET LOCLK      /SET REGISTERS FOR PRESET TIME
3604  0012           NEGATE
3605  6300           FPUT CPS
3606  0000           FEXT
3607  1217           TAD CLKC0
3610  3034           DCA CLOCK
3611  2302           ISZ LOCLK
3612  7000           NOP
3613  3037           DCA DBCNTR      /CLEAR DATA BREAK COUNTER
3614  6312  RIN2,    6312            /START CLOCK AND COUNT
3615  6001  RIN1,    ION
3616  5216           JMP .           /IDLING
3617  3620  CLKC0,   CLKC1
3620  4327  CLKC1,   JMS CNTADD
3621  2302           ISZ LOCLK
3622  5231           JMP CNTCK
3623  2301           ISZ HICLK
3624  5231           JMP CNTCK
3625  1230  CLKSW,   TAD CLKCT
3626  3034           DCA CLOCK
3627  5214           JMP RIN2
3630  3636  CLKCT,   CNTSTP
3631  1276  CNTCK,   TAD HICNT
3632  1305           TAD MAXCT
3633  7710           SPA CLA
3634  5214           JMP RIN2
3635  5225           JMP CLKSW
3636  6316  CNTSTP,  6316            /STOP CLOCK AND COUNT
3637  4327           JMS CNTADD
3640  1302           TAD LOCLK
3641  1304           TAD LOTIM
3642  3060           DCA 0060
3643  7004           RAL
3644  1301           TAD HICLK
3645  1303           TAD HITIM
3646  3057           DCA 0057
3647  4407           JMS I 0007
3650  0013           FLOAT
3651  6300           FPUT CPS
3652  5275           FGET XCNT
3653  7000           FNOR
3654  3267           FMPY CLKRAT
3655  4300           FDIV CPS
3656  6300           FPUT CPS        /COUNT RATE (C.P.S.)
3657  3272           FMPY DDTAU
3660  0012           NEGATE
3661  1706           FADD I ENO
3662  0014           INVERT
3663  3300           FMPY CPS
3664  6300           FPUT CPS        /COUNT RATE CORRECTED FOR DEADTIME
3665  0000           FEXT
3666  5600           JMP I COUNT
```

```
3667  0011  CLKRAT,   0011           /300 CLOCK SIGNALS PER SECOND
3670  2260            2260
3671  0000            0000
3672  7757  DDTAU,    7757           /SYSTEM DEAD TIME, PRESET HERE
3673  2061            2061           /AS 4.00 MICROSECONDS
3674  5736            5736
3675  0027  XCNT,     0027
3676  0000  HICNT,    0
3677  0000  LOCNT,    0
3700  0000  CPS,      0
3701  0000  HICLK,    0
3702  0000  LOCLK,    0
3703  0000  HITIM,    0
3704  0000  LOTIM,    0
3705  0000  MAXCT,    0
3706  5666  ENO,      5666
3707  0000  TMLMT,    0              /INPUT PRESET TIME (SEC.)
3710  4407            JMS I 0007
3711  0010            0010
3712  3267            FMPY CLKRAT
3713  0015            FIX
3714  6435            FPUT I VT
3715  0000            FEXT
3716  5707            JMP I TMLMT
3717  0000  CLEAR,    0              /CLEARS THE FOLLOWING:
3720  6032            KCC            /   AC AND KEYBOARD FLAG
3721  6042            TCF            /   TELEPRINTER FLAG
3722  6344            6344           /   EXTERNAL EQUIPMENT
3723  3276            DCA HICNT      /   COUNT HI-REGISTER
3724  3277            DCA LOCNT      /   COUNT LO-REGISTER
3725  6316            6316           /   CLOCK FLAG AND SCALER
3726  5717            JMP I CLEAR
3727  0000  CNTADD,   0              /UPDATE COUNT REGISTERS
3730  1037            TAD DBCNTR
3731  3307            DCA TMLMT
3732  1277            TAD LOCNT
3733  7450            SNA            /WAS LAST READING ZERO?
3734  5343            JMP .+7        /YES, OVERFLOW NOT POSSIBLE
3735  7141            CLL CMA IAC
3736  1307            TAD TMLMT
3737  7430            SZL            /NEW READING > OLD?
3740  5343            JMP .+3        /YES, NO OVERFLOW
3741  2276            ISZ HICNT      /NO, CORRECT FOR OVERFLOW
3742  7000            NOP
3743  7300            CLA CLL
3744  1307            TAD TMLMT
3745  3277            DCA LOCNT      /STORE NEW READING
3746  5727            JMP I CNTADD
```

```
                *4000
4000  0000  TYPEX,    0               /OUTPUT DIFFRACTOMETER SETTINGS
4001  3035            DCA V1
4002  1035            TAD V1          /ENTER WITH H1 IN AC TO OUTPUT
4003  7041            CMA IAC         /RECIPROCAL SPACE COORDINATES
4004  1065            TAD H1Z
4005  7640            SZA CLA
4006  5211            JMP .+3
4007  4527            JMS I TYPEVZ
4010  5600            JMP I TYPEX
4011  1217            TAD PPRIT2      /ENTER WITH TTH IN AC TO OUTPUT
4012  3036            DCA V2          /ANGLES TWO-THETA, CHI, PHI
4013  4526            JMS I TYPEAZ    /"JMS I TRICRZ" = 4521  IN ANY
4014  4526            JMS I TYPEAZ    /OF THESE TO ELIMINATE THAT
4015  4526            JMS I TYPEAZ    /PRINTOUT (TTH, CHI, PHI)
4016  5600            JMP I TYPEX
4017  4745  PPRIT2,   PPRIT
4020  0000  SCINT,    0               /INTEGRATING SCAN ROUTINE
4021  4504            JMS I GINDSZ
4022  4464            JMS I CRLF      /SUMS COUNT AS ANGLES STEP BY
4023  3337            DCA SUM3        /INCR. #1, OUTPUTS INTEGRAL
4024  3340            DCA SUM3+1
4025  3341            DCA SUM3+2      /REPEATS WITH INITIAL ANGLES
4026  3342            DCA SUM2        /SHIFTED BY INCR. #2
4027  3343            DCA SUM2+1
4030  3344            DCA SUM2+2
4031  4515  SCIN2,    JMS I SFRMTZ    /FINAL OUTPUT: SUM OF PRODUCTS
4032  1071            TAD TTHZ        /(INTEGRAL ABOVE BACKGND TIMES
4033  4200            JMS TYPEX       /VALUE OF ANGLE GIVEN INCR. #2);
4034  1055            TAD NDIG        /SUM OF INTEGRAL ABOVE BACKGND;
4035  1335            TAD EXTRA       /RATIO = AVERAGE VALUE FOR ANGLE
4036  3055            DCA NDIG        /GIVEN INCR. #2
4037  4522            JMS I TTYOFZ
4040  3345            DCA SUM
4041  3346            DCA SUM+1
4042  3347            DCA SUM+2
4043  1750            TAD I NINCR2
4044  3200            DCA TYPEX
4045  4517  SCIN1,    JMS I STEPZ
4046  4477            JMS I COUNTZ
4047  4407            JMS I 0007
4050  1345            FADD SUM
4051  6345            FPUT SUM
4052  6751            FPUT I CPS2
4053  0000            FEXT
4054  1352            TAD DTHTU
4055  3036            DCA V2
4056  1071            TAD TTHZ
4057  4473            JMS I ADDVZ
4060  2200            ISZ TYPEX
4061  5245            JMP SCIN1
4062  4407            JMS I 0007
4063  5751            FGET I CPS2
4064  2736            FSUB I BKGND2
4065  6345            FPUT SUM
4066  0000            FEXT
```

```
4067  1045           TAD HORD
4070  7710           SPA CLA
4071  5304           JMP SCIN0
4072  4407           JMS I 0007
4073  1342           FADD SUM2
4074  6342           FPUT SUM2
4075  5753           FGET I ANGX
4076  4754           FDIV I PPRX
4077  4755           FDIV I RDPDG1
4100  3345           FMPY SUM
4101  1337           FADD SUM3
4102  6337           FPUT SUM3
4103  0000           FEXT
4104  4523  SCIN0,   JMS I TYONZ
4105  4525           JMS I TYCPSZ
4106  4464           JMS I CRLF
4107  1356           TAD D2H1U
4110  3036           DCA V2
4111  1357           TAD H01U
4112  4473           JMS I ADDVZ
4113  1357           TAD H01U
4114  3036           DCA V2
4115  1071           TAD I1HZ
4116  4516           JMS I SHFTVZ
4117  2760           ISZ I N2NCR2
4120  5231           JMP SCIN2
4121  4407           JMS I 0007
4122  5337           FGET SUM3
4123  4342           FDIV SUM2
4124  6345           FPUT SUM
4125  0000           FEXT
4126  1361           TAD SUM3P
4127  4527           JMS I TYPEVZ
4130  4515           JMS I SFRMTZ
4131  4464           JMS I CRLF
4132  2762           ISZ I RNCNT1
4133  5221           JMP SCIN1+1
4134  5620           JMP I SCIN1
4135  0010  EXTRA,   0010
4136  4474  BKGND2,  BKGND
4137  0000  SUM3,    0
4140  0000           0
4141  0000           0
4142  0000  SUM2,    0
4143  0000           0
4144  0000           0
4145  0000  SUM,     0
4146  0000           0
4147  0000           0
4150  4554  N1NCR2,  N1NCR
4151  3700  CPS2,    CPS
4152  4543  D1H1U,   D1H1
4153  4767  ANGX,    TTH0             /(CHI0), (PHI0)
4154  4745  PPRX,    PPR11            /(PPRCH), (PPRPH)
4155  5022  RDPDG1,  RDPDEG
```

```
4156  4566  D2HI0,    D2HI
4157  4555  H010,     H01
4160  4577  N2NCR2,   N2NCR
4161  4137  SUM3P,    SUM3
4162  4261  RNCNT1,   RNCNT
4163  0000  BASIC,    0                  /BASIC STARTUP ROUTINE
4164  4476            JMS I CLEARZ
4165  4501            JMS I DFLMTZ       /TTHU, TTHL, CHIU, CHIL (DEG.)
4166  1072            TAD TTH0Z
4167  4512            JMS I RSTASZ       /TTH0, CHI0, PHI0 (DEG.)
4170  4373            JMS CTLMT          /PRESET COUNT
4171  4515            JMS I SFRMTZ
4172  5763            JMP I BASIC
4173  0000  CTLMT,    0                  /INPUT PRESET COUNT (UNIT: 4096)
4174  4507            JMS I RCOMIZ       /NUMBER SHOULD BE < 2048
4175  3777            DCA I MAXCTT
4176  5773            JMP I CTLMT
4177  3705  MAXCTT,   MAXCT

            *4200
4200  0000  RCOMI,    0                  /READ, COMPLEMENT INTEGER (<4096)
4201  4407            JMS I 0007         /EXIT WITH COMPLEMENT IN AC
4202  0010            0010
4203  0015            FIX
4204  0000            FEXT
4205  1046            TAD LORD
4206  7041            CMA IAC
4207  5600            JMP I RCOMI
4210  0000  RSTAS,    0                  /READ, STORE ANGLE SET
4211  7440            SZA
4212  3035            DCA V1
4213  1221            TAD PPRT13
4214  3036            DCA V2
4215  4510            JMS I READAZ
4216  4510            JMS I READAZ
4217  4510            JMS I READAZ
4220  5610            JMP I RSTAS
4221  4745  PPRIT3,   PPRIT
4222  0000  INDTS,    0                  /INPUT DATA SETS
4223  3260            DCA DIMSW          /AC = 7777 FOR 2-D CASES
4224  4200            JMS RCOMI          /NO. OF DATA SETS
4225  3262            DCA GTNDS
4226  1262            TAD GTNDS
4227  3261            DCA RNCNT
4230  1067            TAD STOREZ
4231  3035            DCA V1
4232  1066            TAD ISTORZ
4233  3321            DCA SCNET
4234  4520  INDT1,    JMS I TMLMTZ       /PRESET TIME (SEC.)
4235  4521            JMS I TRICRZ
4236  4657            JMS I SWADD        /STARTING VALUES
4237  4657  INDT2,    JMS I SWADD        /INCREMENTS
4240  4200            JMS RCOMI          /NO. OF STEPS
4241  3721            DCA I SCNET
4242  2321            ISZ SCNET
4243  2260            ISZ DIMSW          /SECOND INCREMENTS?
```

```
4244  5250             JMP .+4           /NO
4245  7344             CLA CLL CMA RAL   /YES
4246  3260             DCA DIMSW
4247  5237             JMP INDT2
4250  2262             ISZ GINDS         /MORE DATA SETS?
4251  5234             JMP INDT1         /YES
4252  1066             TAD ISTORZ        /NO, FINISHED
4253  3200             DCA RCOMI         /SET POINTERS
4254  1067             TAD STOREZ
4255  3210             DCA RSTAS
4256  5622             JMP I INDTS
4257  0000   SWADD,    0                 /SWITCH ADDRESS
4260  0000   DIMSW,    0
4261  0000   RNCNT,    0
4262  0000   GINDS,    0                 /GET NEXT DATA SET
4263  7440             SZA
4264  3257             DCA SWADD
4265  1210             TAD RSTAS
4266  3036             DCA V2
4267  4407             JMS I 0007
4270  5436             FGET I V2
4271  6720             FPUT I LOCLK1
4272  0000             FEXT
4273  4521             JMS I TRICRZ
4274  1257             TAD SWADD
4275  4516             JMS I SHFTVZ
4276  1374             TAD DTHIT
4277  4516   GTND1,    JMS I SHFTVZ
4300  1600             TAD I RCOMI
4301  3435             DCA I V1
4302  2200             ISZ RCOMI
4303  2035             ISZ V1
4304  1036             TAD V2
4305  3210             DCA RSTAS
4306  2260             ISZ DIMSW         /SECOND INCREMENTS?
4307  5662             JMP I GTNDS       /NO
4310  1257             TAD SWADD         /YES
4311  3036             DCA V2
4312  4516             JMS I SHFTVZ
4313  7344             CLA CLL CMA RAL
4314  3260             DCA DIMSW
4315  1210             TAD RSTAS
4316  3036             DCA V2
4317  5277             JMP GTND1
4320  3702   LOCLK1,   LOCLK
4321  0000   SCNET,    0                 /SCAN ON 1-D OR 2-D NET
4322  4262             JMS GINDS
4323  4464             JMS I CRLF
4324  5331             JMP .+5
4325  1373   SCNT2,    TAD H011
4326  3036             DCA V2
4327  1257             TAD SWADD
4330  4516             JMS I SHFTVZ
4331  4464             JMS I CRLF
4332  1775             TAD I NINCR1
4333  3222             DCA INDTS
```

```
4334   4474   SCNT1,    JMS I ANGLEZ       /"NOP" FOR ANGLE NET
4335   4506             JMS I LIMITZ
4336   5356             JMP SCNT0
4337   4517             JMS I STEPZ
4340   4522             JMS I TTYOFZ
4341   4477             JMS I COUNTZ
4342   4523             JMS I TTYONZ
4343   1257             TAD SWADD
4344   4530             JMS I TYPEXZ
4345   4524             JMS I TYCNTZ
4346   4525             JMS I TYCPSZ
4347   4464             JMS I CRLF
4350   1374             TAD D1HIT
4351   3036             DCA V2
4352   1257             TAD SWADD
4353   4473             JMS I ADDVZ
4354   2222             ISZ INDTS
4355   5334             JMP SCNT1
4356   2260   SCNT0,    ISZ DIMSW
4357   5370             JMP GONX1
4360   7040             CMA
4361   3260             DCA DIMSW
4362   1376             TAD D2HIT
4363   3036             DCA V2
4364   1373             TAD H01T
4365   4473             JMS I ADDVZ
4366   2777             ISZ I N2NCRI
4367   5325             JMP SCNT2
4370   2261   GONX1,    ISZ RNCNT          /ALL DATA SETS DONE?
4371   5322             JMP SCNET+1        /NO
4372   5721             JMP I SCNET        /YES
4373   4555   H01T,     H01
4374   4543   D1HIT,    D1H1
4375   4554   N1NCRI,   N1NCR
4376   4566   D2HIT,    D2H1
4377   4577   N2NCRI,   N2NCR

              *4400
4400   0000   XTAL,     0                  /INPUT CRYSTAL DATA
4401   1272             TAD N1T
4402   3321             DCA T1
4403   7144             CLL CMA RAL
4404   3322             DCA T1+1
4405   1321             TAD T1             /INPUT AND NORMALIZE N1, N2, N3
4406   5212             JMP .+4
4407   0000   LO2A,     0                  /LAMBDA/24 STORAGE, FOR EASY
4410   0000             0                  /ADDRESS
4411   0000             0
4412   4511             JMS I READVZ
4413   1321             TAD T1
4414   3035             DCA V1
4415   1035             TAD V1
4416   3036             DCA V2
4417   4673             JMS I MPYV1
4420   4407             JMS I 0007
```

```
4421  0002              SQROOT
4422  6324              FPUT T2
4423  0000              FEXT
4424  1321              TAD T1
4425  4502              JMS I DO3AZ
4426  4407              JMS I 0007
4427  5435              FGET I V1
4430  4324              FDIV T2
4431  6435              FPUT I V1
4432  0000              FEXT
4433  4503              JMS I DO3BZ
4434  1035              TAD V1            /INPUT AND NORMALIZE P1, P2, P3
4435  3321              DCA T1
4436  2322              ISZ T1+1
4437  5205              JMP XTAL+5
4440  4407              JMS I 0007        /CALCULATE T1, T2, T3
4441  5302              FGET N2
4442  3316              FMPY P3
4443  6321              FPUT T1
4444  5305              FGET N3
4445  3313              FMPY P2
4446  2321              FSUB T1
4447  6321              FPUT T1
4450  5305              FGET N3
4451  3310              FMPY P1
4452  6324              FPUT T2
4453  5277              FGET N1
4454  3316              FMPY P3
4455  2324              FSUB T2
4456  6324              FPUT T2
4457  5277              FGET N1
4460  3313              FMPY P2
4461  6327              FPUT T3
4462  5302              FGET N2
4463  3310              FMPY P1
4464  2327              FSUB T3
4465  6327              FPUT T3
4466  0010              0010              /INPUT LAMBDA/2A
4467  6207              FPUT LO2A
4470  0000              FEXT
4471  5600              JMP I XTAL
4472  4477  N1T,        N1
4473  4671  MPYV1,      MPYV
4474  0000  BKGND,      0
4475  0000              0
4476  0000              0
4477  0000  N1,         0
4500  0000              0
4501  0000              0
4502  0000  N2,         0
4503  0000              0
4504  0000              0
4505  0000  N3,         0
4506  0000              0
4507  0000              0
```

```
4510  0000  P1,      0
4511  0000           0
4512  0000           0
4513  0000  P2,      0
4514  0000           0
4515  0000           0
4516  0000  P3,      0
4517  0000           0
4520  0000           0
4521  0000  T1,      0
4522  0000           0
4523  0000           0
4524  0000  T2,      0
4525  0000           0
4526  0000           0
4527  0000  T3,      0
4530  0000           0
4531  0000           0
4532  0000  H1,      0
4533  0000           0
4534  0000           0
4535  0000  H2,      0
4536  0000           0
4537  0000           0
4540  0000  H3,      0
4541  0000           0
4542  0000           0
4543  0000  D1H1,    0
4544  0000           0
4545  0000           0
4546  0000  D1H2,    0
4547  0000           0
4550  0000           0
4551  0000  D1H3,    0
4552  0000           0
4553  0000           0
4554  0000  N1NCK,   0
4555  0000  H01,     0
4556  0000           0
4557  0000           0
4560  0000  H02,     0
4561  0000           0
4562  0000           0
4563  0000  H03,     0
4564  0000           0
4565  0000           0
4566  0000  D2H1,    0
4567  0000           0
4570  0000           0
4571  0000  D2H2,    0
4572  0000           0
4573  0000           0
4574  0000  D2H3,    0
4575  0000           0
4576  0000           0
4577  0000  N2NCK,   0
```

```
                *4600
4600  0000  ANGLE,  0               /CALCULATE SHAFT ANGLES FOR
4601  1264          TAD NIP         /A GIVEN VECTOR H
4602  3035          DCA V1
4603  4307          JMS MPYVH
4604  4665          JMS I AMNI7
4605  4314          JMS FCMIN
4606  4407          JMS I 0007
4607  6361          FPUT CHI
4610  0000          FEXT
4611  4307          JMS MPYVH
4612  4665          JMS I AMNI7
4613  4314          JMS FCMIN
4614  4407          JMS I 0007
4615  6356          FPUT TTH
4616  0001          SQUARE
4617  6364          FPUT PHI
4620  0000          FEXT
4621  4307          JMS MPYVH
4622  4407          JMS I 0007
4623  6266          FPUT Y
4624  0001          SQUARE
4625  1364          FADD PHI
4626  0002          SQROOT
4627  4361          FDIV CHI
4630  0005          ARCTAN
4631  3350          FMPY PPRCH
4632  0000          FEXT
4633  1357          TAD TTH+1
4634  7710          SPA CLA
4635  4663          JMS I ACNEG7
4636  4407          JMS I 0007
4637  6361          FPUT CHI        /CHI (MOTOR STEPS)
4640  5266          FGET Y
4641  4356          FDIV TTH
4642  0005          ARCTAN
4643  3353          FMPY PPRPH
4644  0012          NEGATE
4645  6364          FPUT PHI        /PHI (MOTOR STEPS)
4646  0000          FEXT
4647  4307          JMS MPYVH
4650  4407  LO2A1,  JMS I 0007
4651  0002          SQROOT
4652  3650          FMPY I LO2A1
4653  0000          FEXT
4654  4321          JMS ARCSIN
4655  2044          ISZ EXP
4656  7001  SMALL,  7001            /AN ADDRESS, NO EFFECT ON CALC
4657  4407          JMS I 0007
4660  3345          FMPY PPRTT
4661  6356          FPUT TTH        /TWO-THETA (MOTOR STEPS)
4662  0000          FEXT
4663  5600  ACNEG7, JMP I ANGLE
4664  4477  NIP,    N1
4665  6655  AMNI7,  6655
```

```
4666  0000  Y,        0
4667  0000            0
4670  0000            0
4671  0000  MPYV,     0                  /MAKES SCALAR PRODUCT OF VECTORS
4672  3044            DCA EXP            /WITH ADDRESSES IN V1 AND V2
4673  3045            DCA HORD
4674  3046            DCA LORD
4675  4502            JMS I DO3AZ
4676  4407            JMS I 0007
4677  6706            FPUT I X1
4700  5435            FGET I V1
4701  3436            FMPY I V2
4702  1706            FADD I X1
4703  0000            FEXT
4704  4503            JMS I DO3BZ
4705  5671            JMP I MPYV
4706  5734  X1,       5734
4707  0000  MPYVH,    0
4710  1065  LARGE,    TAD H1Z
4711  3036            DCA V2
4712  4271            JMS MPYV
4713  5707            JMP I MPYVH
4714  0000  FCMIN,    0                  /SET FAC = 2**-128
4715  4407            JMS I 0007
4716  5656            FGET I SMALL
4717  0000            FEXT
4720  5714            JMP I FCMIN
4721  0000  ARCSIN,   0                  /ARCSINE
4722  1044            TAD EXP
4723  7740            SMA SZA CLA        /IF FAC > 1, SET FAC = 2**565
4724  5340            JMP UNREAL
4725  4407            JMS I 0007
4726  6266            FPUT Y
4727  3266            FMPY Y
4730  0012            NEGATE
4731  1744            FADD I EIN
4732  0002            SQROOT
4733  0014            INVERT
4734  3266            FMPY Y
4735  0005            ARCTAN
4736  0000            FEXT
4737  5721            JMP I ARCSIN
4740  4407  UNREAL,   JMS I 0007
4741  5310            FGET LARGE
4742  0000            FEXT
4743  5721            JMP I ARCSIN
4744  5666  EIN,      5666
4745  0016  PPRIT,    0016               /(200*180/PI)
4746  2630            2630
4747  3117            3117
4750  0016  PPRCH,    0016               /(200*180/PI)
4751  2630            2630
4752  3117            3117
4753  0015  PPRPH,    0015               /(100*180/PI)
4754  2630            2630
4755  3117            3117
```

```
4756  0000  ITH,      0
4757  0000            0
4760  0000            0
4761  0000  CHI,      0
4762  0000            0
4763  0000            0
4764  0000  PHI,      0
4765  0000            0
4766  0000            0
4767  0000  ITH0,     0
4770  0000            0
4771  0000            0
4772  0000  CHI0,     0
4773  0000            0
4774  0000            0
4775  0000  PHI0,     0
4776  0000            0
4777  0000            0

            *5000
5000  0000  TRICR,    0               /TRICREMENTS V1 AND V2
5001  1035            TAD V1
5002  1210            TAD C3
5003  3035            DCA V1
5004  1036            TAD V2
5005  1210            TAD C3
5006  3036            DCA V2
5007  5600            JMP I TRICR
5010  0003  C3,       0003
5011  0000  READA,    0               /INPUT ANGLE (DEG.), CONVERT TO
5012  4407            JMS I 0007      /MOTOR STEPS, AND STORE
5013  0010            0010
5014  3436            FMPY I V2
5015  3222            FMPY RDPDEG
5016  6435            FPUT I V1
5017  0000            FEXT
5020  4200            JMS TRICR
5021  5611            JMP I READA
5022  7773  RDPDEG,   7773            /(PI/180)
5023  2167            2167
5024  6432            6432
5025  0000  TYPEA,    0               /CONVERT ANGLE FROM MOTOR STEPS TO
5026  4407            JMS I 0007      /DEGREES AND OUTPUT IT.
5027  5435            FGET I V1
5030  4436            FDIV I V2
5031  4222            FDIV RDPDEG
5032  0011            0011
5033  0000            FEXT
5034  4200            JMS TRICR
5035  5625            JMP I TYPEA
5036  0000  DFLMT,    0               /INPUT DIFFRACTOMETER LIMITS:
5037  1254            TAD PPRIT1      /ITHU, ITHL, CHIU, CHIL (DEG.)
5040  3036            DCA V2
5041  1255            TAD ITHU1
5042  3035            DCA V1
5043  4211            JMS READA
```

```
5044  1254               TAD PPRIII
5045  3036               DCA V2
5046  4211               JMS READA
5047  4211               JMS READA
5050  1256               TAD PPRCHI
5051  3036               DCA V2
5052  4211               JMS READA
5053  5636               JMP I DFLMI
5054  4745   PPRIII,     PPRII
5055  5232   ITHUI,      ITHU
5056  4750   PPRCHI,     PPRCH
5057  0000               0                   /UNUSED
5060  0000               0
5061  0000               0
5062  0000   SFRMI,      0                   /SET STANDARD OUTPUT FORMAT:
5063  1271               TAD ND              /F8.3, NO FOLLOWING CR-LF
5064  3054               DCA 0054
5065  1272               TAD NI
5066  3055               DCA 0055
5067  3061               DCA 0061
5070  5662               JMP I SFRMI
5071  0003   ND,         0003
5072  0010   NI,         0010
5073  0000   TYCPS,      0                   /OUTPUT COUNT RATE
5074  4407               JMS I 0007
5075  5701               FGET I CPSI
5076  0011               0011
5077  0000               FEXT
5100  5673               JMP I TYCPS
5101  3700   CPSI,       CPS
5102  0000   TYCNT,      0                   /OUTPUT COUNT (FORMAT I8)
5103  3054               DCA 0054
5104  4407               JMS I 0007
5105  5713               FGET I XCNTI
5106  7000               FNOR
5107  0011               0011
5110  0000               FEXT
5111  4262               JMS SFRMI           /RESET TO STANDARD FORMAT
5112  5702               JMP I TYCNT
5113  3675   XCNTI,      XCNT
5114  0000   DO3A,       0                   /THREE CYCLE DO-LOOP
5115  7440               SZA
5116  3035               DCA V1
5117  7146               CLL CMA RTL
5120  3327               DCA DOCNT
5121  5714               JMP I DO3A
5122  0000   DO3B,       0
5123  4200               JMS TRICK
5124  2327               ISZ DOCNT
5125  5714               JMP I DO3A
5126  5722               JMP I DO3B
5127  0000   DOCNT,      0
5130  0000   READV,      0                   /INPUT VECTOR (3 COMPONENTS)
5131  4314               JMS DO3A
5132  4407               JMS I 0007
5133  0010               0010
```

```
5134  6435              FPUT I V1
5135  0000              FEXT
5136  4322              JMS DO3B
5137  5733              JMP I READV
5140  0000  SHFTV,      0                   /SHIFT VECTOR
5141  4314              JMS DO3A
5142  4407              JMS I 0007
5143  5436              FGET I V2
5144  6435              FPUT I V1
5145  0000              FEXT
5146  4322              JMS DO3B
5147  5740              JMP I SHFTV
5150  0000  TYPEV,      0                   /OUTPUT VECTOR
5151  4314              JMS DO3A
5152  4407              JMS I 0007
5153  5435              FGET I V1
5154  0011              0011
5155  0000              FEXT
5156  4322              JMS DO3B
5157  5750              JMP I TYPEV
5160  0000  ADDV,       0                   /ADD TWO VECTORS
5161  4314              JMS DO3A
5162  4407              JMS I 0007
5163  5435              FGET I V1
5164  1436              FADD I V2
5165  6435              FPUT I V1
5166  0000              FEXT
5167  4322              JMS DO3B
5170  5760              JMP I ADDV
5171  0000  TTYOF,      0                   /TURN TTY OFF
5172  6351              6351
5173  1376              TAD TMLAG2
5174  4777              JMS I PAWS1         /WAIT ONE SECOND
5175  5771              JMP I TTYOF
5176  7400  TMLAG2,     7400
5177  5354  PAWS1,      PAWS

            *5200
5200  0000  LIMIT,      0                   /TEST IF TTH AND CHI ARE WITHIN
5201  4407              JMS I 0007          /SPECIFIED LIMITS.  IF NO, EXIT
5202  5232              FGET TTHU           /NORMALLY.  IF YES, EXIT TO
5203  2471              FSUB I TTHZ         /SECOND INSTRUCTION.
5204  6630              FPUT I TMP3
5205  5471              FGET I TTHZ
5206  2235              FSUB TTHL
5207  3630              FMPY I TMP3
5210  0000              FEXT
5211  1045              TAD HORD
5212  7710              SPA CLA
5213  5600              JMP I LIMIT
5214  4407              JMS I 0007
5215  5240              FGET CHIU
5216  2631              FSUB I CHIL
5217  6630              FPUT I TMP3
5220  5631              FGET I CHIL
```

```
5221  2243          FSUB CHIL
5222  3630          FMPY I TMP3
5223  0000          FEXT
5224  1045          TAD HORD
5225  7700          SMA CLA
5226  2200          ISZ LIMIT
5227  5600  ACNEG6, JMP I LIMIT
5230  5745  TMP3,   5745
5231  4761  CHI1,   CHI
5232  0000  TTHU,   0
5233  0000          0
5234  0000          0
5235  0000  TTHL,   0
5236  0000          0
5237  0000          0
5240  0000  CHIU,   0
5241  0000          0
5242  0000          0
5243  0000  CHIL,   0
5244  0000          0
5245  0000          0
5246  0000  STEP,   0                  /MOVES (ANTIBACKLASH) THREE AXES
5247  1070          TAD TTHNPZ         /TO NEW POSITIONS
5250  3200          DCA LIMIT
5251  1072          TAD TTH0Z
5252  3036          DCA V2
5253  1071          TAD TTHZ
5254  4502          JMS I DO3AZ
5255  4407          JMS I 0007
5256  5435          FGET I V1
5257  2436          FSUB I V2
5260  0015          FIX
5261  6630          FPUT I TMP3
5262  7000          FNOR
5263  1436          FADD I V2
5264  6436          FPUT I V2
5265  5630          FGET I TMP3
5266  0000          FEXT
5267  4272          JMS MOVE
5270  4503          JMS I DO3BZ
5271  5646          JMP I STEP
5272  0000  MOVE,   0                  /AB-MOVE AXIS (HORD,LORD) STEPS
5273  4731          JMS I AMN16        /IS FAC = 0?
5274  5326          JMP NOGO           /YES, NO MOTION
5275  1045          TAD HORD
5276  7700          SMA CLA
5277  5303          JMP .+4
5300  4332          JMS RUNOVR         /FAC < 0; OVERRUN AND RUNBACK
5301  7040          CMA
5302  5305          JMP .+3
5303  2200          ISZ LIMIT          /FAC > 0
5304  4627          JMS I ACNEG6
5305  3044          DCA EXP            /AB RUNBACK SWITCH
5306  1600          TAD I LIMIT
5307  3312          DCA PULSE
```

```
5310  7410             SKP
5311  4345             JMS WAIT
5312  0000  PULSE,     0                 /MOTOR PULSE
5313  2046             ISZ LORD
5314  5311             JMP PULSE-1
5315  2045             ISZ HORD
5316  5311             JMP PULSE-1
5317  2200             ISZ LIMIT
5320  2044             ISZ EXP           /RUNBACK NEEDED?
5321  5672             JMP I MOVE        /NO, DONE
5322  1276             TAD MOVE+4
5323  4354             JMS PAWS          /WAIT A FRACTION OF A SECOND
5324  4332             JMS RUNOVR
5325  5306             JMP PULSE-4
5326  2200  NOGO,      ISZ LIMIT
5327  2200             ISZ LIMIT
5330  5672             JMP I MOVE
5331  6655  AMNT6,     6655
5332  0000  RUNOVR,    0                 /ADDS -40 TO HORD,LORD
5333  7300             CLA CLL
5334  1344             TAD M40
5335  1046             TAD LORD
5336  3046             DCA LORD
5337  7420             SNL
5340  7040             CMA
5341  1045             TAD HORD
5342  3045             DCA HORD
5343  5732             JMP I RUNOVR
5344  7730  M40,       7730
5345  0000  WAIT,      0                 /WAIT 2311 CYCLES = .0035 SEC.
5346  1353             TAD NWAIT
5347  3047             DCA OVER2
5350  2047             ISZ OVER2
5351  5350             JMP .-1
5352  5745             JMP I WAIT
5353  6400  NWAIT,     6400
5354  0000  PAWS,      0                 /PAUSE N WAIT LOOPS, WHERE -N IN AC
5355  3332             DCA RUNOVR        /ON ENTRY
5356  4345             JMS WAIT
5357  2332             ISZ RUNOVR
5360  5356             JMP .-2
5361  5754             JMP I PAWS
5362  0000  TTYON,     0                 /TURN TTY ON
5363  6352             6352
5364  1367             TAD TMLAG
5365  4354             JMS PAWS          /WAIT ONE SECOND
5366  5762             JMP I TTYON
5367  7400  TMLAG,     7400
5370  6322  TTHNP,     6322              /TTH NEG. MOTOR PULSE
5371  6321             6321              /TTH POS.   "      "
5372  6334  CHINP,     6334              /CHI NEG.   "      "
5373  6332             6332              /CHI POS.   "      "
5374  6342  PHINP,     6342              /PHI NEG.   "      "
5375  6341             6341              /PHI POS.   "      "
5376  6331  OMGNP,     6331              /OMG NEG.   "      "
5377  6324             6324              /OMG POS.   "      "
```

ACNEG6	5227
ACNEG7	4663
ACSAVE	0032
ACIH	0041
ACIL	0042
ADDV	5160
ADDVZ	0073
AMNT6	5331
AMNT7	4665
ANGLE	4600
ANGLEZ	0074
ANGX	4153
ARCSIN	4721
AJII	0015
BASIC	4163
BASICZ	0075
BKGND	4474
BKGND1	0377
BKGND2	4136
CHI	4761
CHIL	5243
CHINP	5372
CHIU	5240
CHI0	4772
CHI1	5231
CLEAR	3717
CLEARZ	0076
CLKCI	3620
CLKC0	3617
CLKC1	3630
CLKRAT	3667
CLKSW	3625
CLOCK	0034
CNTADD	3727
CNTCK	3631
CNTSTP	3636
COUNT	3600
COUNTZ	0077
CPS	3700
CPS1	5101
CPS2	4151
CRLF	0064
CTLMT	4173
CTLMTZ	0100
C3	5010
DBCNTR	0037
DDTAU	3672
DFLMT	5036
DFLMTZ	0101
DIMSW	4260
DOCNT	5127
DO3A	5114
DO3AZ	0102
DO3B	5122
DO3BZ	0103
D1H1	4543
D1H1I	4374
D1H1U	4152
D1H2	4546
D1H3	4551
D2H1	4566
D2H1I	4376
D2H1U	4156
D2H2	4571
D2H3	4574
EIN	4744
ENO	3706
EXP	0044
EXTRA	4135
EX1	0040
FCMIN	4714
GONXT	4370
GINDS	4262
GINDSZ	0104
GIND1	4277
HICLK	3701
HICNT	3676
HITIM	3703
HORD	0045
H01	4555
H01I	4373
H01U	4157
H02	4560
H03	4563
H1	4532
H1Z	0065
H2	4535
H3	4540
INDTS	4222
INDTSZ	0105
INDT1	4234
INDT2	4237
INIPT	0033
INTRT	0200
ISTORZ	0066
LARGE	4710
LIMIT	5200
LIMITZ	0106
LOCLK	3702
LOCLKI	4320
LOCNT	3677
LOC1	0051
LOC2	0052
LOC3	0053
LORD	0046
LOTIM	3704
LO2A	4407
LO2AI	4650
MAXCT	3705
MAXCTI	4177
MOVE	5272
MPYV	4671
MPYVH	4707
MPYVI	4473
M40	5344
NBRHI	0057
NBRLO	0050
NBRX	0056
ND	5071
NDEC	0054
NDIG	0055
NOGO	5326
NT	5072
NWAIT	5353
N1	4477
N1NCR	4554
N1NCR1	4375
N1NCR2	4150
N1P	4664
N1T	4472
N2	4502
N2NCR	4577
N2NCR1	4377
N2NCR2	4160
N3	4505
OMGNP	5376
OUT1	0004
OUT2	0003
OVER1	0043
OVER2	0047
PAWS	5354
PAWS1	5177
PHI	4764
PHINP	5374
PHI0	4775
PPRCH	4750
PPRCHI	5056

PPRPH	4753
PPRTT	4745
PPRTT1	5054
PPRTT2	4017
PPRTT3	4221
PPRX	4154
PULSE	5312
P1	4510
P2	4513
P3	4516
QUOL	0050
RCOMI	4200
RCOMIZ	0107
RDPDEG	5022
RDPDG1	4155
READ	0062
READA	5011
READAZ	0110
READV	5130
READVZ	0111
RNCNT	4261
RNCNT1	4162
RSTAS	4210
RSTASZ	0112
RTN1	3615
RTN2	3614
RUNOVR	5332
SCINT	4020
SCINTZ	0113
SCIN0	4104
SCIN1	4045
SCIN2	4031
SCNET	4321
SCNETZ	0114
SCNT0	4356
SCNT1	4334
SCNT1H	0316
SCNT2	4325
SFRMT	5062
SFRMTZ	0115
SHFTV	5140
SHFTVZ	0116
SMALL	4656
STEP	5246
STEPZ	0117
STOREZ	0067
SUM	4145
SUM2	4142
SUM3	4137
SUM3P	4161
SWADD	4257
SWADD1	0341
SWADD2	0342
SWIT1	0061
TMLAG	5367
TMLAG2	5176
TMLMT	3707
TMLMTZ	0120
TMP3	5230
TRICR	5000
TRICRZ	0121
TTH	4756
TTHL	5235
TTHNP	5370
TTHNPZ	0070
TTHU	5232
TTHU1	5055
TTHZ	0071
TTH0	4767
TTH0Z	0072
TTYOF	5171
TTYOFZ	0122
TTYON	5362
TTYONZ	0123
TYCNT	5102
TYCNTZ	0124
TYCPS	5073
TYCPSZ	0125
TYPE	0063
TYPEA	5025
TYPEAZ	0126
TYPEV	5150
TYPEVZ	0127
TYPEX	4000
TYPEXZ	0130
T1	4521
T2	4524
T3	4527
UNREAL	4740
V1	0035
V2	0036
WAIT	5345
XCNT	3675
XCNT1	5113
XTAL	4400
XTALZ	0131
X1	4706
Y	4666

DISTRIBUTION LIST

No. of Copies	To
1	Office of the Under Secretary of Defense for Research and Engineering, The Pentagon, Washington, DC 20301
12	Commander, Defense Technical Information Center, Cameron Station, Building 5, 5010 Duke Street, Alexandria, VA 22314
1	Metals and Ceramics Information Center, Battelle Columbus Laboratories, 505 King Avenue, Columbus, OH 43201
	Deputy Chief of Staff for Research, Development, and Acquisition, Headquarters, Department of the Army, Washington, DC 20301
1	ATTN: DAMA-ARZ
	Commander, Army Research Office, P.O. Box 12211, Research Triangle Park, NC 27709
1	ATTN: Information Processing Office
	Commander, U.S. Army Materiel Development and Readiness Command, 5001 Eisenhower Avenue, Alexandria, VA 22333
1	ATTN: DRCLDC
	Commander, U.S. Army Materiel Systems Analysis Activity, Aberdeen Proving Ground, MD 21005
1	ATTN: DRXSY-MP, H. Cohen
	Commander, U.S. Army Electronics Research and Development Command, Fort Monmouth, NJ 07703
1	ATTN: DELSD-L
1	DELSD-E
	Commander, U.S. Army Missile Command, Redstone Arsenal, AL 35898
1	ATTN: DRSMI-RKP, J. Wright, Bldg. 7574
4	DRSMI-TB, Redstone Scientific Information Center
1	DRSMI-RLM
1	Technical Library
	Commander, U.S. Army Armament Research and Development Command, Dover, NJ 07801
2	ATTN: Technical Library
1	DRDAR-SCM, J. D. Corrie
1	DRDAR-QAC-E
1	DRDAR-LCA, Mr. Harry E. Pebly, Jr., PLASTEC, Director
	Commander, U.S. Army Natick Research and Development Laboratories Natick, MA 01760
1	ATTN: Technical Library
	Commander, U.S. Army Satellite Communications Agency, Fort Monmouth, NJ 07703
1	ATTN: Technical Document Center
	Commander, U.S. Army Tank-Automotive Command, Warren, MI 48090
1	ATTN: DRSTA-RKA
2	DRSTA-UL, Technical Library
	Commander, White Sands Missile Range, NM 88002
1	ATTN: STEWS-WS-VT
	President, Airborne, Electronics and Special Warfare Board, Fort Bragg, NC 28307
1	ATTN: Library
	Director, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD 21005
1	ATTN: DRDAR-TSB-S (STINFO)
	Commander, Dugway Proving Ground, Dugway, UT 84022
1	ATTN: Technical Library, Technical Information Division
	Commander, Harry Diamond Laboratories, 2800 Powder Mill Road, Adelphi, MD 20783
1	ATTN: Technical Information Office
	Chief, Benet Weapons Laboratory, LCWSL, USA ARRADCOM, Watervliet, NY 12189
1	ATTN: DRSMC-LCB,
1	DRSMC-LCB, Mr. D. P. Kendall
	Commander, U.S. Army Foreign Science and Technology Center, 220 7th Street, N.E., Charlottesville, VA 22901
1	ATTN: Military Tech, Mr. Marley
	Commander, U.S. Army Aeromedical Research Unit, P.O. Box 577, Fort Rucker, AL 36360
1	ATTN: Technical Library

No. of Copies	To
	Director, Eustis Directorate, U.S. Army Air Mobility Research and Development Laboratory, Fort Eustis, VA 23604
1	ATTN: Mr. J. Robinson, DAVDL-E-MOS (AVRADCOM)
	U.S. Army Aviation Training Library, Fort Rucker, AL 36360
1	ATTN: Building 5906-5907
	Commander, U.S. Army Agency for Aviation Safety, Fort Rucker, AL 36362
1	ATTN: Technical Library
	Commander, USACDC Air Defense Agency, Fort Bliss, TX 79916
1	ATTN: Technical Library
	Commander, U.S. Army Engineer School, Fort Belvoir, VA 22060
1	ATTN: Library
	Commander, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS 39180
1	ATTN: Research Center Library
	Commander, U.S. Army Environmental Hygiene Agency, Edgewood Arsenal, MD 21010
1	ATTN: Chief, Library Branch
	Technical Director, Human Engineering Laboratories, Aberdeen Proving Ground, MD 21005
1	ATTN: Technical Reports Office
	Commandant, U.S. Army Quartermaster School, Fort Lee, VA 23801
1	ATTN: Quartermaster School Library
	Commander, U.S. Army Radio Propagation Agency, Fort Bragg, NC 28307
1	ATTN: SCCR-2
	Naval Research Laboratory, Washington, DC 20375
1	ATTN: Dr. C. I. Chang - Code 5830
2	Dr. G. R. Yoder - Code 6384
	Chief of Naval Research, Arlington, VA 22217
1	ATTN: Code 471
	Commander, U.S. Air Force Wright Aeronautical Laboratories, Wright-Patterson Air Force Base, OH 45433
2	ATTN: AFWAL/MLSE, E. Morrissey
1	AFWAL/MLC
1	AFWAL/MLLP, M. Forney Jr.
1	AFWAL/MLBC, Mr. Stanley Schulman
	National Aeronautics and Space Administration, Washington, DC 20546
1	ATTN: Mr. B. G. Achhammer
1	Mr. G. C. Deutsch - Code RW
	National Aeronautics and Space Administration, Marshall Space Flight Center, Huntsville, AL 35812
1	ATTN: R. J. Schwinghammer, EH01, Dir, M&P Lab
1	Mr. W. A. Wilson, EH41, Bldg. 4612
1	Ship Research Committee, Maritime Transportation Research Board, National Research Council, 2101 Constitution Ave., N. W., Washington, DC 20418
1	The Charles Stark Draper Laboratory, 68 Albany Street, Cambridge, MA 02139
	Wyman-Gordon Company, Worcester, MA 01601
1	ATTN: Technical Library
	Lockheed-Georgia Company, 86 South Cobb Drive, Marietta, GA 30063
1	ATTN: Materials and Processes Engineering Dept. 71-11, Zone 54
	General Dynamics, Convair Aerospace Division, P.O. Box 748, Fort Worth, TX 76101
1	ATTN: Mfg. Engineering Technical Library
1	Mechanical Properties Data Center, Belfour Stulen Inc., 13917 W. Bay Shore Drive, Traverse City, MI 49684
1	Mr. R. J. Zentner, EAI Corporation, 198 Thomas Johnson Drive, Suite 16, Frederick, MD 21701
	Director, Army Materials and Mechanics Research Center, Watertown, MA 02172
2	ATTN: DRXMR-PL
1	Author

Army Materials and Mechanics Research Center,
Watertown, Massachusetts 02172
DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE
FOR PDP-8 COMPUTERS -
Christopher B. Walker

Technical Report AMMRC TR 83-59, November 1983, 33 pp -
D/A Project 1L161102AH42

AD______________
UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

X-ray diffraction
Diffractometers
Automation

This report describes a package of subroutines and short programs which, when used in conjunction with the floating point package, FPP1, can control a single crystal X-ray diffractometer in a variety of easily modified experiments.

Army Materials and Mechanics Research Center,
Watertown, Massachusetts 02172
DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE
FOR PDP-8 COMPUTERS -
Christopher B. Walker

Technical Report AMMRC TR 83-59, November 1983, 33 pp -
D/A Project 1L161102AH42

AD______________
UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

X-ray diffraction
Diffractometers
Automation

This report describes a package of subroutines and short programs which, when used in conjunction with the floating point package, FPP1, can control a single crystal X-ray diffractometer in a variety of easily modified experiments.

Army Materials and Mechanics Research Center,
Watertown, Massachusetts 02172
DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE
FOR PDP-8 COMPUTERS -
Christopher B. Walker

Technical Report AMMRC TR 83-59, November 1983, 33 pp -
D/A Project 1L161102AH42

AD______________
UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

X-ray diffraction
Diffractometers
Automation

This report describes a package of subroutines and short programs which, when used in conjunction with the floating point package, FPP1, can control a single crystal X-ray diffractometer in a variety of easily modified experiments.

Army Materials and Mechanics Research Center,
Watertown, Massachusetts 02172
DSP1, A DIFFRACTOMETER SUBROUTINE PACKAGE
FOR PDP-8 COMPUTERS -
Christopher B. Walker

Technical Report AMMRC TR 83-59, November 1983, 33 pp -
D/A Project 1L161102AH42

AD______________
UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

X-ray diffraction
Diffractometers
Automation

This report describes a package of subroutines and short programs which, when used in conjunction with the floating point package, FPP1, can control a single crystal X-ray diffractometer in a variety of easily modified experiments.

MED

- 8