

AD-A091 436

ARMY ENGINEER DISTRICT NORFOLK VA
NATIONAL DAM SAFETY PROGRAM, CRAB ORCHARD CREEK DAM (INVENTORY --ETC(U)
JUL 80 J A WALSH


F/G 13/13

UNCLASSIFIED

NL

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
841
842
843
844
845
846
847
848
849
850
851
852
853
854
855
856
857
858
859
860
861
862
863
864
865
866
867
868
869
870
871
872
873
874
875
876
877
878
879
880
881
882
883
884
885
886
887
888
889
890
891
892
893
894
895
896
897
898
899
900
901
902
903
904
905
906
907
908
909
910
911
912
913
914
915
916
917
918
919
920
921
922
923
924
925
926
927
928
929
930
931
932
933
934
935
936
937
938
939
940
941
942
943
944
945
946
947
948
949
950
951
952
953
954
955
956
957
958
959
960
961
962
963
964
965
966
967
968
969
970
971
972
973
974
975
976
977
978
979
980
981
982
983
984
985
986
987
988
989
990
991
992
993
994
995
996
997
998
999
1000

END
DATE
FILMED
JUL 80
DTIC

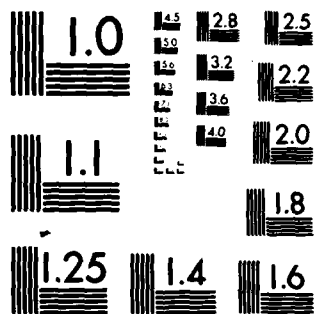

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

NEW RIVER BASIN

①

Name Of Dam: CRAB ORCHARD CREEK


Location: BLAND COUNTY

Inventory Number: VA. 02102

LEVEL II

AD A091436

PHASE I INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM

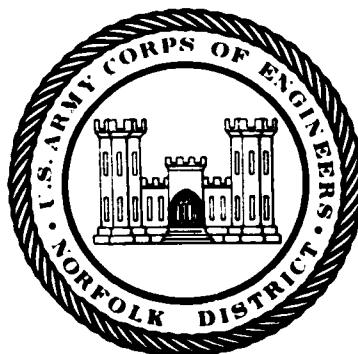

DTIC
ELECTE
NOV 12 1980
S E D

DDC FILE COPY.

PREPARED BY
NORFOLK DISTRICT CORPS OF ENGINEERS
803 FRONT STREET
NORFOLK, VIRGINIA 23510

80 10 30 081

JULY 1980

DISTRIBUTION STATEMENT A

Approved for public release;
Distribution Unlimited

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER VA 02102	2. GOVT ACCESSION NO. AD A091 436	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Phase I Inspection Report National Dam Safety Program. Crab Orchard Creek (Inventory Number VA 42182) Bland County	5. TYPE OF REPORT & PERIOD COVERED Final	
7. AUTHOR(s) Norfolk District Corps of Engineers 803 Front Street Norfolk, Virginia 23510	6. PERFORMING ORG. REPORT NUMBER	
9. PERFORMING ORGANIZATION NAME AND ADDRESS	8. CONTRACT OR GRANT NUMBER(s)	
11. CONTROLLING OFFICE NAME AND ADDRESS U. S. Army Engineering District, Norfolk 803 Front Street Norfolk, Virginia 23510	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	12. REPORT DATE July 1980	
	13. NUMBER OF PAGES	
	15. SECURITY CLASS. (of this report) Unclassified	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Copies are obtainable from National Technical Information Service, Springfield, Virginia 22151		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dams - VA National Dam Safety Program Phase I Dam Safety Dam Inspection		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) (See reverse side)		

20. Abstract

Pursuant to Public Law 92-367, Phase I Inspection Reports are prepared under guidance contained in the recommended guidelines for safety inspection of dams, published by the Office of Chief of Engineers, Washington, D. C. 20314. The purpose of a Phase I investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general conditions of the dam is based upon available data and visual inspections. Detailed investigation and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

Based upon the field conditions at the time of the field inspection and all available engineering data, the Phase I report addresses the hydraulic, hydrologic, geologic, geotechnic, and structural aspects of the dam. The engineering techniques employed give a reasonably accurate assessment of the conditions of the dam. It should be realized that certain engineering aspects cannot be fully analyzed during a Phase I inspection. Assessment and remedial measures in the report include the requirements of additional indepth study when necessary.

Phase I reports include project information of the dam and appurtenances, all existing engineering data, operational procedures, hydraulic/hydrologic data of the watershed, dam stability, visual inspection report and an assessment including required remedial measures.

(6)

National Dam Safety Program.

NAME OF DAM:

CRAB ORCHARD CREEK Dam

LOCATION:

~~BLAND COUNTY, VIRGINIA~~

INVENTORY NUMBER:

VA 02102

New River Basin,

Bland County, Virginia.

PHASE I INSPECTION REPORT.
NATIONAL DAM SAFETY PROGRAM

(1) Final rept.

(2) Jan - A. Walsh

(11) Jul 84

Accession For	
NTIS GRA&I	☒
DDC TAB	
Unannounced Justification	
By _____	
Distribution/ _____	
Availability Codes	
Dist..	Avail and/or special
A	

PREPARED BY
NORFOLK DISTRICT CORPS OF ENGINEERS
803 FRONT STREET
NORFOLK, VIRGINIA 23510

(12) 7/74

411000

B

TABLE OF CONTENTS

Preface i

Brief Assessment of Dam ii

Overview of Dam

Section 1:	PROJECT INFORMATION	1-1
Section 2:	ENGINEERING DATA	2-1
Section 3:	VISUAL INSPECTION	3-1
Section 4:	OPERATIONAL PROCEDURES	4-1
Section 5:	HYDRAULIC/HYDROLOGIC DATA	5-1
Section 6:	DAM STABILITY	6-1
Section 7:	ASSESSMENT/REMEDIAL MEASURES	7-1

Appendix I:	Maps and Drawings
Appendix II:	Photographs
Appendix III:	Field Observations
Appendix IV:	References

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of the Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation and analyses involving topographic mapping, subsurface investigations testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established guidelines, the spillway design flood is based on the estimated "Probable Maximum Flood" for the region (flood discharges that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the design flood should not be interpreted as necessarily posing a highly inadequate condition. The design flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

**PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM**

BRIEF ASSESSMENT OF DAM

Name of Dam: Crab Orchard Creek
State: Virginia
Location: Bland County
USGS Quad Sheet: Big Bend, Virginia
Stream: Crab Orchard Creek
Date of Inspection: 4 June 1980

The Crab Orchard Creek Dam is an earthfill structure 510 feet long and 50.5 feet high. The dam is owned and maintained by Mr. Ronald A. Clyborne of Bluefield, West Virginia. The dam is classified as an intermediate size dam with a significant hazard classification. The principal spillway is a concrete drop-inlet connected to a concrete pipe passing through the dam at low level. The emergency spillway is an open channel cut into natural rock located at the left abutment. The reservoir is used for recreation.

Based on criteria established by the Department of the Army, Office of the Chief of Engineers (OCE), the Spillway Design Flood (SDF) is the 1/2 PMF. The spillways will pass 13 percent of the PMF or 26 percent of the SDF without overtopping the dam. The SDF will overtop the dam by a maximum 2.86 feet, reach an average critical velocity of 8.0 feet per second and flow over the dam for 6.5 hours. Flows overtopping the dam during the SDF are considered detrimental to the embankment. The spillways are adjudged seriously inadequate and the dam is assessed as unsafe non-emergency.

The classification of "unsafe" applied to a dam because of a seriously inadequate spillway is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean, however, that based on an initial screening, and preliminary computations, there appears to be a serious deficiency in spillway capacity so that if a severe storm were to occur, overtopping and failure of the dam would take place, significantly increasing the hazard to loss of life downstream from the dam.

It is recommended that within 2 months from the date of notification to the Governor of the Commonwealth of Virginia, the owner engage the services of a professional consultant to perform the following:

a. Determine by more sophisticated methods and procedures the adequacy of the spillway. The study should include a more detailed study of the Spillway Design Flood appropriate to this dam. Remedial measures to be considered include modification to the dam, spillway, flood plain, and for any other method of eliminating the danger imposed by the project.

b. Perform a stability analysis of the embankment for the long term steady seepage condition. Also, if the emergency gate is ever to be made operable, then a stability check of the upstream slope for a sudden drawdown condition is required.

Within 6 months of the notification to the Governor, the professional consultant's report of appropriate remedial mitigating measures should have been completed and the owner should have an agreement with the Commonwealth of Virginia for a reasonable time in which all remedial measures will be complete. In the interim, a detailed emergency operation plan and warning system should be promptly developed. Also, during periods of unusually heavy precipitation, around-the-clock surveillance should be provided.

The inspection also revealed several other items that require attention. The following items should be scheduled as part of an annual maintenance program:

a. Dress the gully at the right abutment contact with compacted fill and seed the area.

b. Trim the downstream slope of brush. Cut all trees to the ground. Remove the root structures of all trees greater than 3-inches in diameter. Dress all excavations with compacted fill and seed.

c. Seed the whole crest and the sparsely vegetated portion of the embankment right of the principal spillway.

d. Maintain regular inspection of the seep on the right downstream abutment. Should flow suddenly increase and/or become turbid without explanation contact a geotechnical engineering consultant for further evaluation.

e. Remove the debris from around the fence and cage protecting the intake structure, and along the upstream slope.

f. Install a staff gage in the reservoir to extend to the top of the dam to measure pool elevation.

g. Remove the pine tree fallen in the discharge channel by the outlet works.

Submitted By:

Approved:

Original signed by
JAMES A. WALSH

Original signed by:
Douglas L. Haller

JAMES A. WALSH, P. E.
Chief, Design Branch


DOUGLAS L. HALLER
Colonel Corps of Engineers
District Engineer

Recommended By

Date: **SEP 12 1960**

Original signed by
JACK G. STARR

JACK G. STARR
Chief, Engineering Division

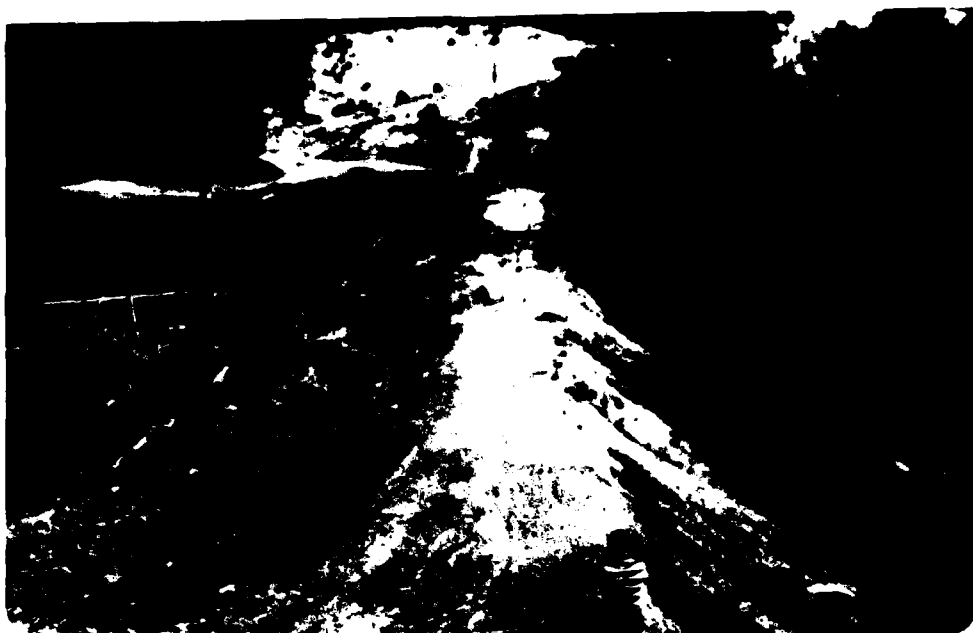

CREST



DOWNSTREAM SLOPE

**CRAB ORCHARD CREEK DAM
OVERALL VIEWS**

SECTION 1

PROJECT INFORMATION

1.1 GENERAL:

1.1.1 Authority: Public Law 92-367, 8 August 1972, authorized the Secretary of the Army, through the Corps of Engineers to initiate a national program of safety inspections of dams throughout the United States. The Norfolk District has been assigned the responsibility of supervising the inspection of dams in the Commonwealth of Virginia.

1.1.2 Purpose of Inspection: The purpose is to conduct a Phase I inspection according to the Recommended Guidelines for Safety Inspection of Dams (Reference 1, Appendix IV). The main responsibility is to expeditiously identify those dams which may be a potential hazard to human life or property.

1.2 Project Description:

1.2.1 Dam and Appurtenances: Crab Orchard Creek Dam is an earthfill embankment dam about 510 feet long and 50.5 feet high. The crest of the dam is 30 feet wide with a crest elevation of 108.0 TBM*. The upstream slope is 1 horizontal to 1 vertical (1:1) with dumped shale riprap protection. The downstream slope is benched at two elevations. The slope between the crest and upper bench (elevation 96.7) is 1.5:1, 1:1 to the lower bench (elevation 82.0) and 1.75:1 to the toe of the dam (elevation 67.7).

There is no foundation drain and it is unknown if the embankment is keyed into the foundation.

The principal spillway is a 24-inch vertical concrete pipe (drop-inlet) connected to a 24-inch horizontal concrete pipe running through the dam at low level. The crest of the drop-inlet is at elevation 100. The pipe outlets into a stilling pond below the dam. The invert elevation of the outlet pipe, which is submerged in the pool, is elevation 58.0. The pool is protected by placed riprap around the perimeter.

The emergency spillway is an open channel cut into natural rock at the left abutment with the crest at elevation 102.8. The spillway will discharge into the downstream channel about 300 feet downstream of the dam.

Wooden piles located about 50 feet upstream of the principal spillway indicate the site of an emergency gate that is in a collapsed condition, as reported by the owner's representative.

*TBM is a temporary bench mark based on principal spillway drop-inlet at elevation 100.0

1.2.2 Location: Crab Orchard Creek Dam is located on Crab Orchard Creek just upstream of Interstate 77 about 0.5 miles west of Bland, Virginia. A location map is provided on Plate 1, Appendix I.

1.2.3 Size Classification: The dam is classified as an intermediate size structure based on the height of the dam (50.5 feet).

1.2.4 Hazard Classification: The dam is located upstream of Bland, Virginia, with several homes and businesses located near the stream. A roadway embankment for Interstate 77 will reduce flows from the dam site and reduce the threat to lives and property in Bland, Virginia. However, large enough flows to create a potential hazard to lives and property can be passed through the roadway culverts. Therefore, a significant hazard classification is given for this structure according to guidelines contained in Section 2.1.2 of Reference 1, Appendix IV. The hazard classification used to categorize dams is a function of location only and has nothing to do with their stability or probability of failure.

1.2.5 Ownership: Mr. Ronald A. Clyborne of Bluefield, West Virginia.

1.2.6 Purpose: Recreation.

1.2.7 Design and Construction History: The dam was originally built in approximately 1953 for J. T. Dunn of Bland, Virginia. The dam failed in about 1955 and was not rebuilt until about 1974, when Interstate 77 was built. It was reported that the dam failed due to overtopping. J. C. Hendricks, then new owner, got some assistance from a local university in designing the new dam. Large boulders excavated for the interstate were used in the dam embankment. It is not known of the dam was rebuilt in entirety or whether the breach was refilled. Mr. Clyborne bought the dam and property in October 1977 and has enlarged the emergency spillway. The downstream flood plain has been improved by allowing better drainage of flows from the dam. The reservoir has been lowered 2 feet by removing the top 2 feet of the principal spillway pipe.

1.2.8 Normal Operational Procedures: Water passes automatically through the principal and emergency spillways as the reservoir rises above the spillways crests.

1.3 Pertinent Data:

1.3.1 Drainage Area: The dam controls a drainage area of 4.98 square miles.

1.3.2 Discharge at Dam Site: Maximum flood - Unknown. The original dam did fail in 1955 but no data is available on the flows incurred. The dam has since been rebuilt and no maximum flows have been noted.

Pool level at top of dam

Emergency Spillway 2579 cfs

1.3.3 Dam and Reservoir Data: Pertinent data on the dam and reservoir are shown in the following table:

TABLE 1.1 DAM AND RESERVOIR DATA

Item	Elevation feet msl	Reservoir			
		Area, acres	Capacity		Length feet
			Acre, feet	Watershed, inches 1/	
Top of Dam	108*	27.5	550	2.1	.49
Emergency Spillway Crest	102.8	23.2	415	1.6	.44
Principal Spillway Crest	100	20.8	355	1.3	.42
Streambed at Down- stream Toe of Dam	57.5	--	--	--	--

*Low point across dam's embankment.

SECTION 2

ENGINEERING DATA

2.1 Design: There is no known design information. The dam is located in the northwest belt of the Ridge and Valley physiographic province. This portion of the Ridge and Valley province is characterized by many high, narrow, linear northeast trending ridges and intervening valleys. Rock outcrops in the general vicinity consist of marine shales, sandstones, and dolomites of Mississippian, Devonian, and Cambrian ages. The Saltville-Bland fault is located within two miles of the dam site and extends in a southwest to northeast direction. The fault is responsible for the Mississippian age rocks coming into contact with the much older rocks of the Cambrian age.

2.2 Construction: There are no known construction records.

2.3 Evaluation: There is insufficient information to evaluate foundation conditions and embankment stability.

SECTION 3

VISUAL INSPECTION

3.1 Findings:

3.1.1 General: The results of the 4 June 1980 inspection are recorded in Appendix III. At the time of the inspection, the weather was sunny and clear. The temperature was 74°F. and the ground conditions were dry. The pool elevation was approximately 100.1 TBM or normal pool elevation. The tailwater elevation was about 60.4 TBM. Flow was passing through the principal spillway. No flow was passing through the emergency spillway. There are no known prior inspection reports.

3.1.2 Embankment: The embankment is in fair condition. Sketches showing a plan view, profile along the crest, and a typical cross section are provided on Plates II and III, Appendix I. Overall views of the crest and downstream slope are provided at the beginning of the report.

There are no signs of cracks, unusual movement, sloughing, misalignment, or riprap failures. However, there are erosion gullies beginning to develop on the portion of the embankment above the upper bench, right of the principal spillway. The slope is sparsely vegetated and runoff is eroding the surface. There is an existing gully at the right abutment contact as shown in Photo 3, Appendix II. The crest elevation slopes from the emergency spillway to the right abutment with a grade drop of about 2 feet. There is a particular dip of about 0.5 feet about 10 feet from the right abutment. The upstream slope is protected by a dumped shale riprap as shown in Photo 2. There is debris all along the upstream slope.

There is one seep located at the base of the dam at the right abutment as shown on Plate II. The origin was not found because of vegetation and boulders inhibiting the inspection in the area. The owner representative said he had checked the spring monthly for the past two years and had noted no changes. Flow is clear. No estimate of the quantity was made. The source and age are unknown.

The crest of the dam is sparsely vegetated (Photo 1) as well as that portion of the downstream slope right of the principal spillway. The downstream slope left of the principal spillway is heavily vegetated with brush and trees. The trees are pine and deciduous.

There are no drains. There are no signs of wet spots at or beyond the downstream toe.

3.1.3 Principal Spillway: A vertical 24-inch concrete pipe, 34 feet upstream of the embankment, is the control section that establishes normal pool. A four-foot high wire fence is placed around the intake pipe to

prevent large debris from entering the pipe (Photo 4). A wire cage is placed over the intake to prevent finer debris from entering the intake pipe. Debris is located around three sides of the wire cage allowing clear flow through only one side. The 24-inch concrete discharge pipe is submerged in the stilling basin (Photo 5). Wooden piles are located about 75 feet upstream of the principal spillway intake. The owner's representative indicates that an emergency gate located beneath the piles is no longer useful. No outlet pipe was observed during the inspection.

3.1.4 Emergency Spillway: The approach channel and control section is in natural rock (Photo 7). The discharge channel is also cut into natural rock. Large boulders and some debris line the sides of the lower portion of the discharge channel (Photo 8).

3.1.5 Instrumentation: There is no instrumentation on the dam.

3.1.6 Reservoir: The reservoir area slopes are mostly mild, and heavily wooded. There are no signs of shoreline erosion or slope failures. There is no information available pertaining to sedimentation.

3.1.7 Downstream Channel: The downstream channel slopes are mild to steep with partial to heavy tree growth in the area (Photo 6). A road embankment is located about 1,100 feet downstream with three 8 by 10 foot culverts passing through the embankment at low level (Photos 9 and 10).

3.2 Evaluation: The inspection revealed no conditions that required immediate remedial measures. However, the inspection revealed certain preventive maintenance items which should be scheduled as part of an annual maintenance program. These are:

- a. Dress the gully at the right abutment contact with compacted fill and seed the area.
- b. Trim the downstream slope of brush. Cut all trees to the ground. Remove the root structures of all trees greater than 3-inches in diameter. Dress all excavations with compacted fill and seed.
- c. Seed the whole crest and the sparsely vegetated portion of the embankment right of the principal spillway.
- d. Maintain regular inspection of the seep on the right downstream abutment. Should flow suddenly increase and/or become turbid without explanation contact a geotechnical engineering consultant for further evaluation.

e. Remove the debris from around the fence and cage protecting the intake structure, and along the upstream slope.

f. Install a staff gage in the reservoir to extend to the top of the dam to measure pool elevation.

g. Remove the pine tree fallen in the discharge channel by the outlet works.

SECTION 4

OPERATIONAL PROCEDURES

4.1 Procedures: The normal storage pool is 100.0 TBM, which is the crest of the principal spillway. The reservoir provides private recreation. Water passes automatically through the principal spillway as the water level rises above the principal spillway crest. Water will also pass automatically through the emergency spillway when the water level in the reservoir rises above elevation 102.8 TBM. An emergency drawdown gate, of unknown size, is in a collapsed state, as noted by the owner's representative.

4.2 Maintenance: A regular maintenance program performed by the owner's representative includes debris removal around reservoir and a visual inspection after storms to remedy any new problems.

4.3 Warning System: At present time, there is no warning system or evacuation plan for Crab Orchard Creek Dam.

4.4 Evaluation: The dam does not require an elaborate operational and maintenance procedure. However, the regular maintenance program should be expanded to include vegetation removal on the embankment and documentation of all work accomplished. An emergency operation and warning plan should be developed. It is recommended that a formal emergency procedure be prepared and furnished to all operating personnel. This should include:

- a. How to operate the dam during an emergency.
- b. Who to notify, including public officials, in case evacuation from the downstream area is necessary.

SECTION 5

HYDRAULIC/HYDROLOGIC DATA

5.1 Design: None were available.

5.2 Hydrologic Records: None were available.

5.3 Flood Experience: The maximum flow at the dam site is not known.

5.4 Flood Potential: The 1/2 PMF and PMF were developed and routed through the reservoir by use of the HEC-1DB computer program (Reference 2, Appendix IV) and appropriate unit hydrograph, precipitation and storage-outflow data. Clark's Tc and R coefficient for the local drainage area were estimated from basin characteristics. The rainfall applied to the developed unit hydrograph was obtained from the U. S. Weather Bureau Publication (Reference 3, Appendix IV).

5.5 Reservoir Regulation: Pertinent dam and reservoir data are shown in Table 1.1.

Water passes automatically through the principal and emergency spillways as the reservoir rises above the spillways crests.

The storage curve was developed based on areas obtained from a U. S. Geological Survey Quadrangle Map. Rating curves for the principal spillway, emergency spillway, and non-overflow section were developed. In routing hydrographs through the reservoir, it was assumed that the initial pool level was at the principal spillway crest (elevation 100.0 TBM).

5.6 Overtopping Potential: The probable rise in the reservoir and other pertinent information on reservoir performance is shown in the following table:

Table 5.1 RESERVOIR PERFORMANCE

Item	Normal Flow	1/2 PMF	PMF 1/
Peak flow c.f.s.			
Inflow	5	11878	23757
Outflow	5	11877	23720
Maximum elevation ft. TBM	100.0	110.86	113.26
Non-overflow section (el 108.0 TBM)			
Depth of flow, ft		2.86	5.26
Duration		6.5	9.5
Velocity, fps 2/		8.0	10.6
Tailwater elevation ft., TBM	60.4		

1/ The PMF is an estimate of flood discharges that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region.

2/ Critical Velocity

5.7 Reservoir Emptying Potential: The owner's representative reported that the emergency drawdown gate is in a collapsed condition and cannot be used.

5.8 Evaluation: Based on the size (intermediate) and hazard classification (significant) the recommended Spillway Design Flood is 1/2 PMF to the PMF. Because of the risk involved, the 1/2 PMF has been selected as the SDF. The spillways will pass 13 percent of the PMF or 26 percent of the SDF without overtopping the dam. The SDF will overtop the dam by a maximum 2.86 feet with an average critical velocity of 8.0 feet per second and remain above the crest of the dam for 6.5 hours. It should be determined if the emergency drawdown outlet is in fact inoperable and, if so, returned to a functional position.

Conclusions pertain to present day conditions. The effect of future development on the hydrology has not been considered.

SECTION 6

DAM STABILITY

6.1 Foundation and Abutments: There is no information available on the foundation conditions. The dam is located in the Ridge and Valley physiographic province. It is unknown if the dam is keyed into the foundation. There is no foundation drainage system. The predominate foundation material is a shale bedrock. Outcrops on the right abutment show massively bedded shale with a blocky structure and open weathered joints. The strike was about N20°W with a gentle dip to the west. The dam is aligned N66°W. The area terrain is non-compressible. The stratigraphy at the dam site does not encourage sliding or continuous seepage paths. Based on the visual observations, the foundation appears stable.

6.2 Embankments:

6.2.1 Materials: There is no information available on the nature of the embankment materials. The area soils consist of residual silty sand weathered from the area shale.

6.2.2 Stability: There are no stability analysis calculations available for this dam, which is 50.5 feet high and 30 feet wide. The upstream slope is 1H:1V with riprap. The downstream slope is double benched. From the crest to the upper bench the slope is 1.5H:1V, to the lower bench it is 1H:1V, and to the toe 1.75H:1V. A plan view, profile of the crest and a typical cross-section are provided on Plates II and III, Appendix I.

For this dam, normal pool exists when the reservoir level is at the elevation of the principal spillway, as it was at the time of the inspection. This is also the maximum control storage pool. The dam experiences this pool level with no apparent adverse effects. The dam is not subjected to a drawdown because the emergency drawdown gate is in a collapsed condition and reported to be inoperable.

6.2.3 Seismic Stability: The dam is located in Seismic Zone 2. Therefore, according to the Recommended Guidelines for Safety Inspection of Dams, the dam is considered to have no hazard from an earthquake provided that static stability conditions are satisfactory and conventional safety margins exist.

6.3 Evaluation: There is insufficient information to adequately evaluate the stability of the dam. A stability check is required for the long-term steady seepage condition. If the emergency gate is ever to be made operable, then a stability check of the upstream slope for a sudden drawdown condition is required.

The SDF will overtop the dam by a maximum 2.85 feet with an average critical velocity of 8.0 feet per second and remain above the crest of the dam for 6.5 hours. The overtopping is considered detrimental, because the velocity at SDF is greater than 6 fps, the effective eroding velocity for a vegetated earth embankment.

SECTION 7

ASSESSMENT/REMEDIAL MEASURES

7.1 Dam Assessment: The available engineering data is inadequate. The visual inspection revealed no problems that require immediate attention. There is a limited regular maintenance program, but no emergency operation and warning plan. Corps guidelines indicate the appropriate Spillway Design Flood (SDF) for an intermediate size significant hazard dam is the 1/2 PMF. The spillways will pass 13 percent of the PMF or 26 percent of SDF without overtopping the dam. Flows overtopping the dam during the SDF are considered detrimental to the embankment. Therefore, the spillways are adjudged seriously inadequate and the dam is assessed as unsafe non-emergency.

The classification of "unsafe" applied to a dam because of a seriously inadequate spillway is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean, however, that based on an initial screening, and preliminary computations, there appears to be a serious deficiency in spillway capacity so that if a severe storm were to occur, overtopping and failure of the dam would take place, significantly increasing the hazard to loss of life downstream from the dam.

7.2 Recommended Remedial Measures: It is recommended that within 2 months from the date of notification to the Governor of the Commonwealth of Virginia, the owner engage the services of a professional consultant to perform the following:

a. Determine by more sophisticated methods and procedures the adequacy of the spillway. The study should include a more detailed study of the Spillway Design Flood appropriate to this dam. Remedial measures to be considered include modification to the dam, spillway, flood plain, and any other method of eliminating the danger imposed by the project.

b. Perform a stability analysis of the embankment for the long term steady seepage condition. Also, if the emergency gate is ever to be made operable, then a stability check of the upstream slope for a sudden drawdown condition is required.


Within 6 months of the notification to the Governor, the professional consultant's report of appropriate remedial mitigating measures should have been completed and the owner should have an


agreement with the Commonwealth of Virginia for a reasonable time in which all remedial measures will be complete. In the interim, a detailed emergency operation plan and warning system should be promptly developed. Also, during periods of unusually heavy precipitation, around-the-clock surveillance should be provided.

The inspection also revealed several other items that require attention. The following items should be scheduled as part of an annual maintenance program:


- a. Dress the gully at the right abutment contact with compacted fill and seed the area.
- b. Trim the downstream slope of brush. Cut all trees to the ground. Remove the root structures of all trees greater than 3-inches in diameter. Dress all excavations with compacted fill and seed.
- c. Seed the whole crest and the sparsely vegetated portion of the embankment right of the principal spillway.
- d. Maintain regular inspection of the seep on the right downstream abutment. Should flow suddenly increase and/or become turbid without explanation contact a geotechnical engineering consultant for further evaluation.
- e. Remove the debris from around the fence and cage protecting the intake structure, and along the upstream slope.
- f. Install a staff gage in the reservoir to extend to the top of the dam to measure pool elevation.
- g. Remove the pine tree fallen in the discharge channel by the outlet works.

APPENDIX I
MAPS AND DRAWINGS

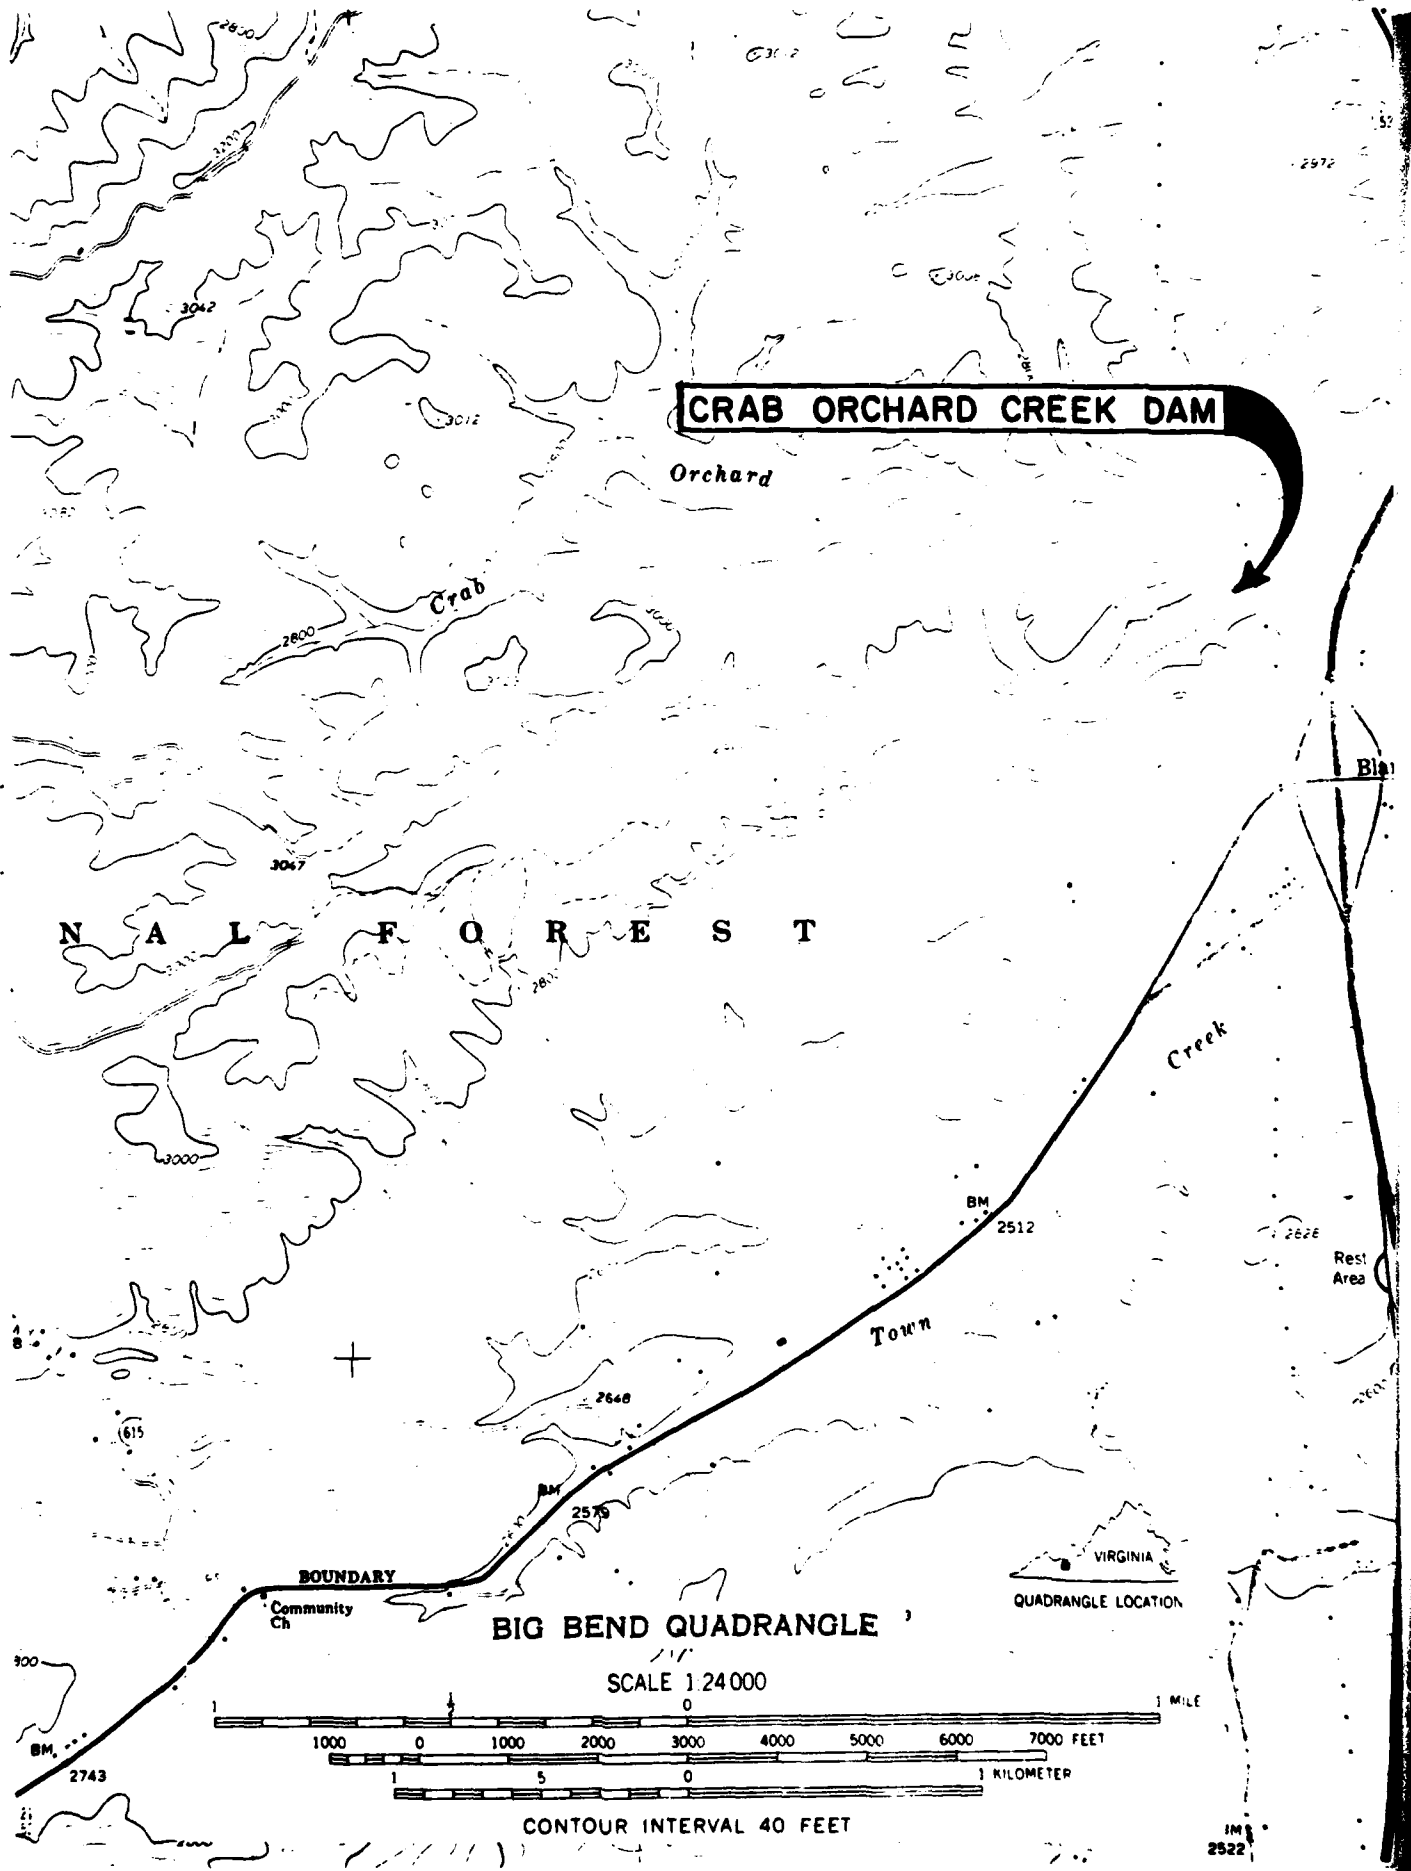

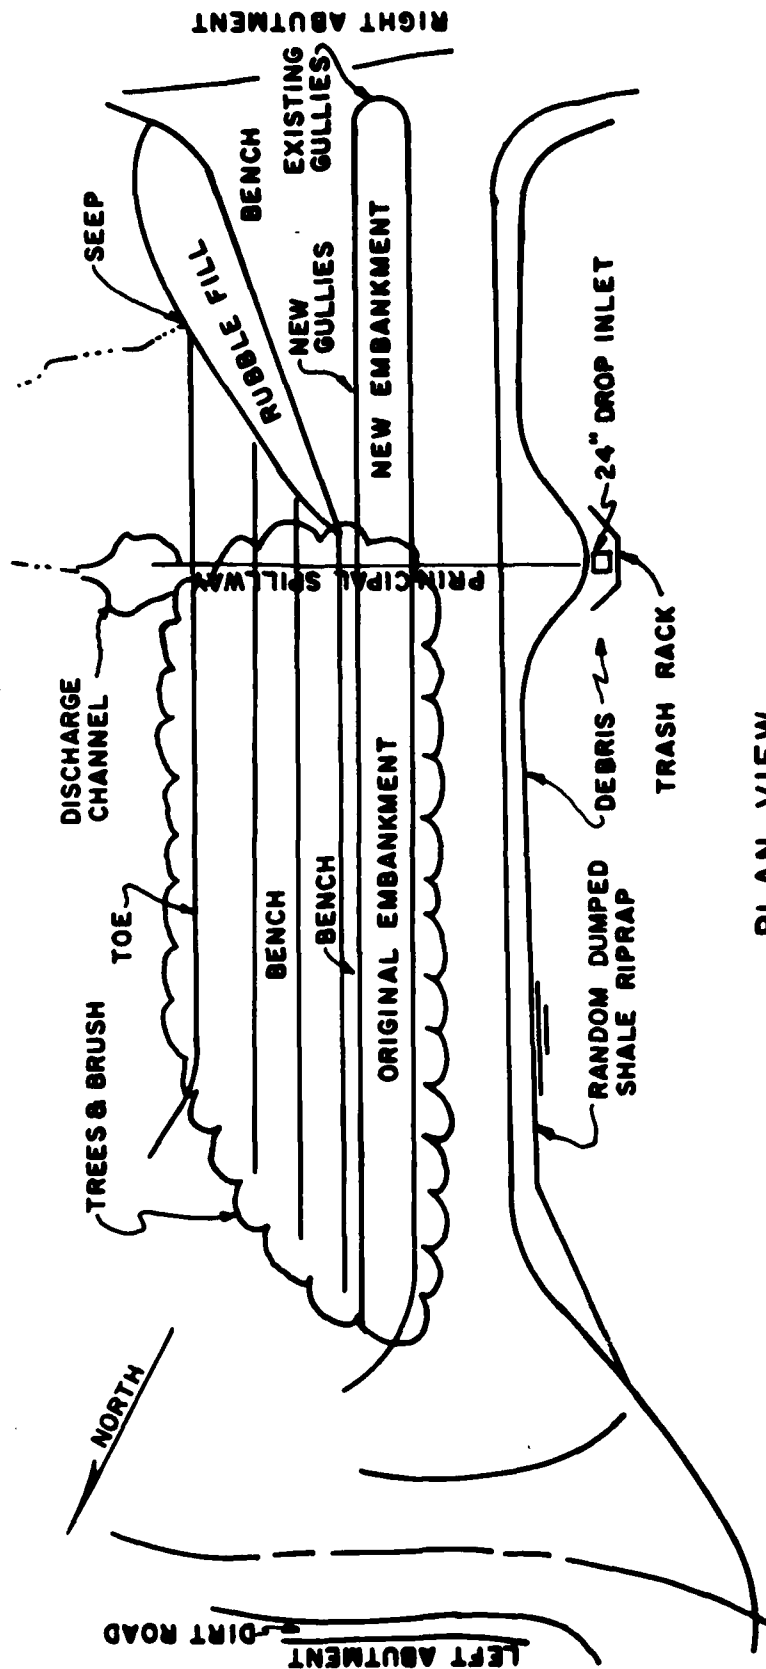


PLAN VIEW

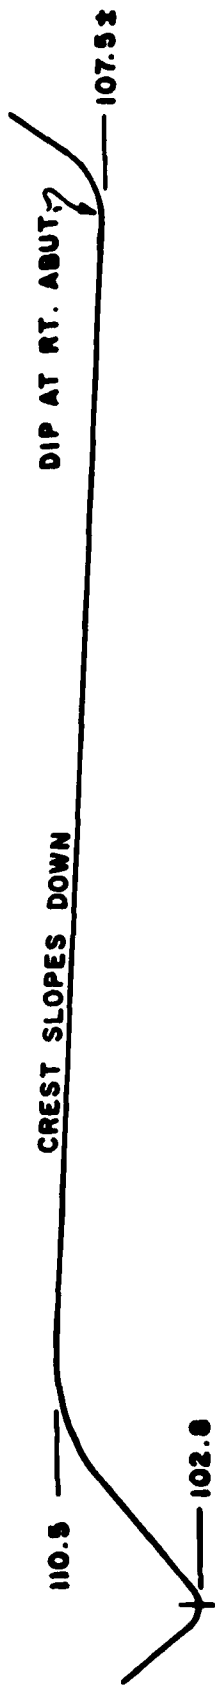

CREST PROFILE

CRAB ORCHARD CREEK
N.T.S.
PLATE 2

NOTE: TOP OF DROP INLET USED
AS TBM = 100.0

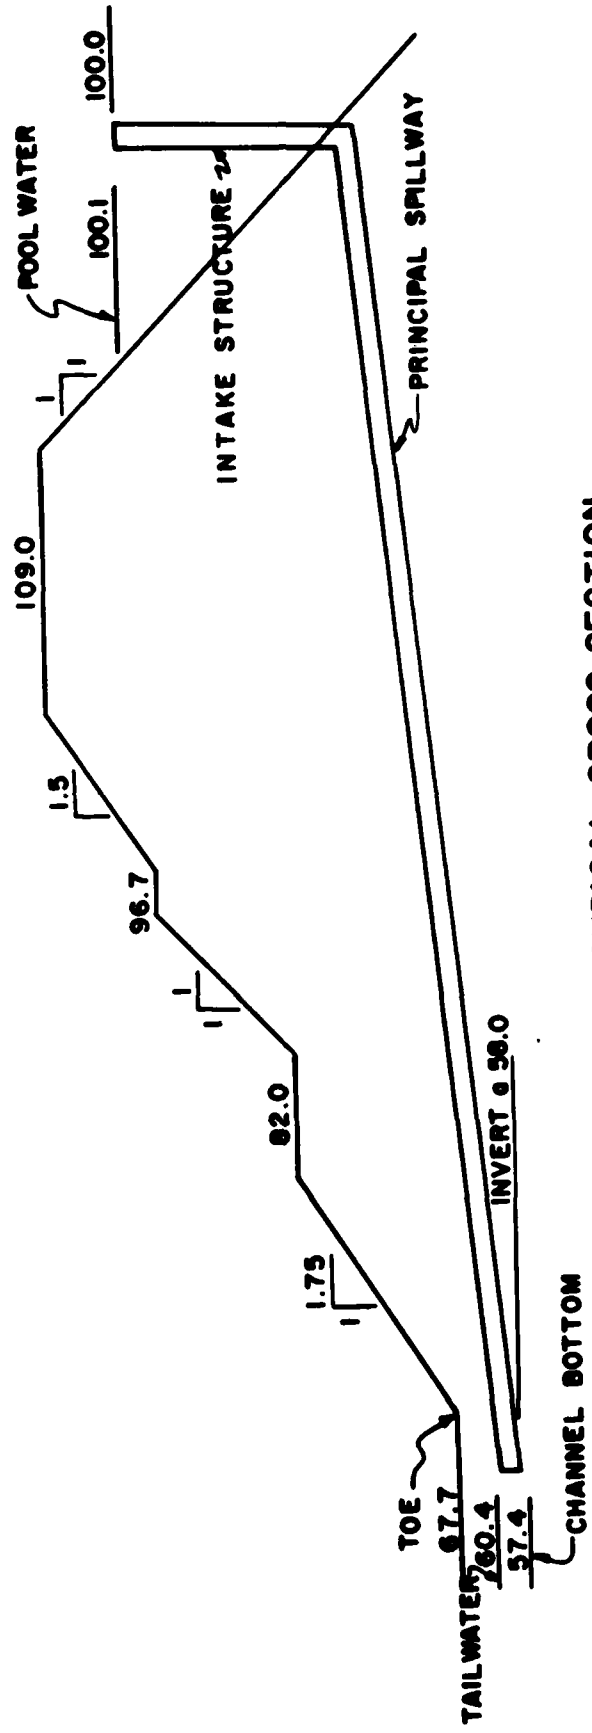

TYPICAL CROSS SECTION

- NOTE :
- 1) TOP OF DROP INLET USED AS TBM = 100.0
 - 2) CREST ELEVATION RANGES FROM 110 TO 108.

APPENDIX II

PHOTOGRAPHS



PHOTO #1 CREST OF DAM



PHOTO #2 UPSTREAM SLOPE



PHOTO #3 DOWNSTREAM SLOPE
AND RT. ABUTMENT



PHOTO #4 PRINCIPAL SPILLWAY
INTAKE STRUCTURE



PHOTO *5 PRINCIPAL SPILLWAY DISCHARGE

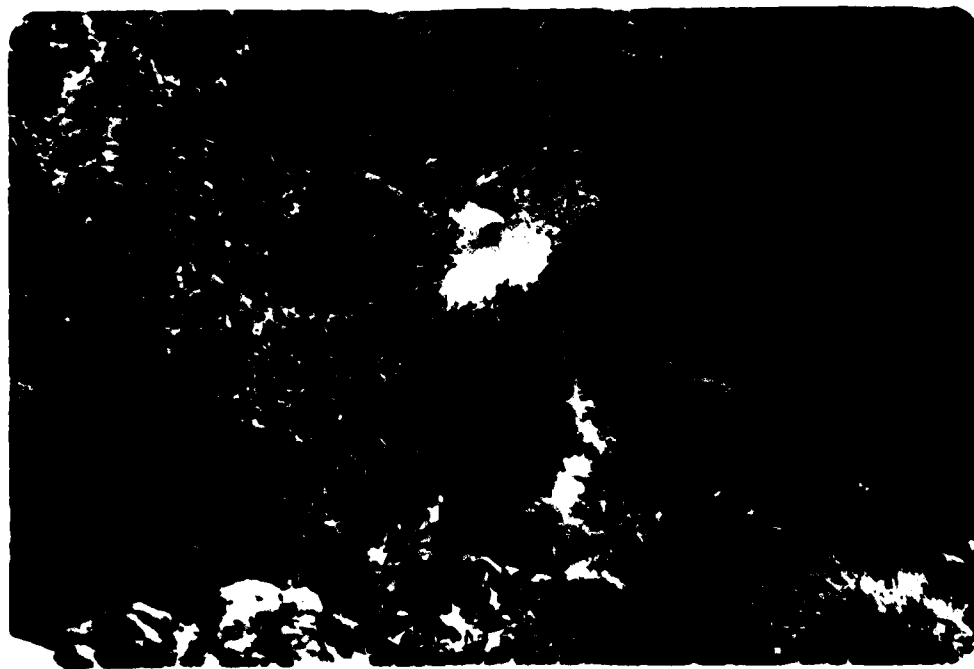


PHOTO *6 DOWNSTREAM CHANNEL



PHOTO #7 EMS APPROACH CHANNEL

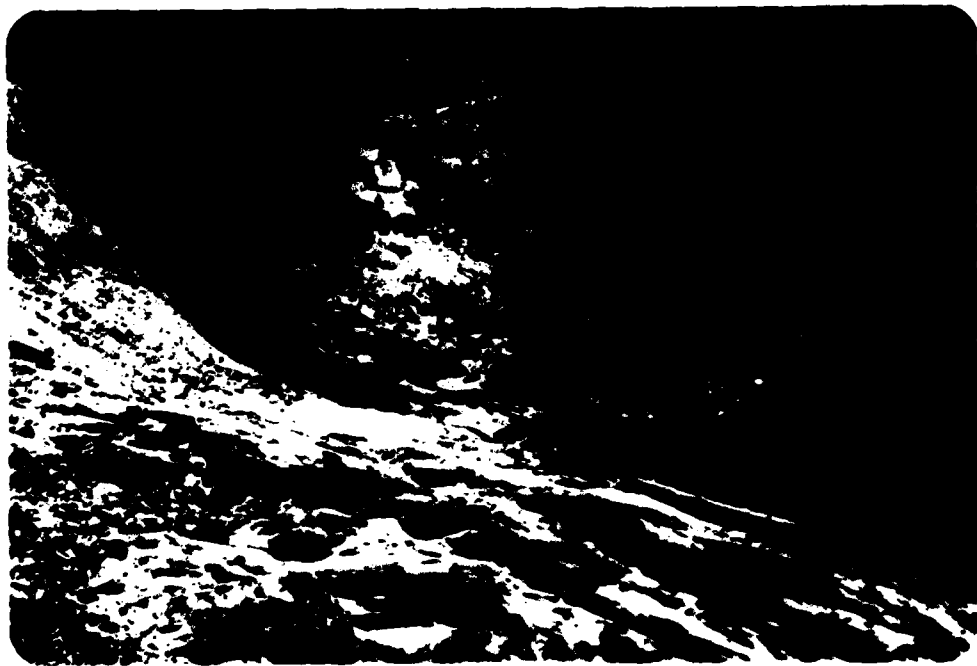


PHOTO #8 EMERGENCY SPILLWAY (EMS)



**PHOTO # 9 VIEW FROM CREST OF DAM
LOOKING DOWNSTREAM
(NOTE I-77 HIGHWAY EMBANKMENT)**



**PHOTO # 10 TRIPLE BARREL BOX CULVERT
THRU I-77 EMBANKMENT**

APPENDIX III
FIELD OBSERVATIONS

Check list
Visual Inspection
Phase I

Name Dam: Crab Orchard Creek County: Bland State: VA Coordinates: Lat 3706.4
Long 8108.0

Date of Inspection: 4 June 80 Weather: Sunny & Partly Cloudy Temperature: 74°F

Pool Elevation at Time of Inspection: 100.1 TBM Tailwater at Time of Inspection: 60.4 TBM

Inspection Personnel:

B. Taran, COE
J. Robinson, COE
D. Pezza, COE
D. Bushman, SWCB

L. Musselwhite, SWCB
Bobby Nunn, Owner Rep.

Pezza & Robinson

Recorders

EMBANKMENT

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SURFACE CRACKS	There are no cracks in the dam. The general ground conditions are dry. The embankment right of the principal spillway was rebuilt in 1974 after 1955 failure. Original emergency spillway at right abutment. Embankment below bench consists of massive, buttressing, rubble fill on slope.	None.
UNUSUAL MOVEMENT OR CRACKING AT OR BEYOND THE TOE	No unusual movement or cracking at or beyond toe.	None.
SLOUGHING OR EROSION OF EMBANKMENT AND ABUTMENT SLOPES	There are no signs of sloughing. Erosion gullies are beginning to develop on the portion of the embankment above the first bench, right of the principal spillway. The slope is sparsely vegetated and runoff is eroding the surface. There is an existing gully at the right abutment contact. The downstream slope right of the principal spillway is sparsely vegetated.	Dress the gully at the abutment contact with compacted fill. Seed the slope.
VERTICAL AND HORIZONTAL ALIGNMENT OF THE CREST	There are no drawings with which to compare the existing alignment. The alignments do not show any signs of movement or settlement. The crest elevation slopes from the emergency spillway to the right abutment with a grade drop of about 2 feet. There is a particular dip of about 0.5 feet about 10 feet from the right abutment.	None.
RIPRAP FAILURES	The upstream slope is protected by a dumped shale riprap. There are no signs of failure. There is debris all along the upstream slope.	Clean up the debris collected on the embankment.

EMBANKMENT

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
<u>FOUNDATION</u>	The foundation appears stable. There is no evidence of sliding or settlement noted. The area bedrock is shale. Rock outcrops on the right abutment and spillway show massively bedded shale with a blocky structure and open weathered joints. The strike is about N20W. It dips gently to the west.	None.
<u>VEGETATION</u>	The crest of the dam is sparsely vegetated with grass. The downstream slope left of the principal spillway is heavily vegetated with brush and trees. The trees are both pine and deciduous. The downstream slope right of the spillway is sparsely vegetated.	Seed the crest. Trim the downstream slope of brush. Cut all trees to the ground. Remove the root structure of all trees 3-inches in diameter. Dress all excavations with compacted fill and seed.
<u>ANY NOTICEABLE SEEPAGE</u>	There is one seep located at the base of the dam at the right abutment as shown on Plate II. The specific location was not noted because of vegetation and boulders in the area. The owner's representative says he has checked the spring monthly for the past two years and has noted no changes. Flow is clear. There is no estimate of the quantity. Source and age of seep unknown.	Maintain regular inspection of seep particularly during high flows. Should flow suddenly increase and/or become cloudy without explanation, contact a geotechnical engineering firm to evaluate the condition.
<u>MATERIALS</u>	The area materials consist of residual silty sand weathered from the shale.	None.
<u>DRAINS</u>	There are no drains. There are no signs of wet spots at or beyond the downstream toe.	None.

PRINCIPAL SPILLWAY

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATION
CONTROL SECTIONS	A vertical 24-inch concrete pipe 34 feet upstream of the embankment crest is the control section that establishes normal pool. Water is flowing (about 2") over the crest of the spillway.	The owner lowered the normal pool elevation about 2 feet by removing two feet of vertical pipe in the reservoir within the last 3 years.
APPROACH CHANNEL	A 4 foot high wire fence is placed around the intake pipe to prevent large debris from entering the pipe. A wire cage is placed over the intake to prevent finer debris from entering the intake pipe. Debris is located around 3 sides of the wire cage allowing clear flow through only one side.	The debris should be removed.
DISCHARGE CHANNEL	The 24-inch concrete discharge pipe is submerged in the stilling basin.	The flow from the principal spillway would be more efficient if the water was allowed to fall freely from the pipe. (i.e., lower the stilling basin elevation).
EMERGENCY GATE	Wooden piles are located about 75 feet upstream of the principal spillway intake. The owner's representative indicates that an emergency gate located beneath the piles is no longer useful. No outlet pipe was observed during the inspection.	The status of the pipe should be determined in case a drawdown becomes necessary.

EMERGENCY SPILLWAY

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATION
CONTROL SECTION	The control section is natural rock which appears in good condition. The spillway crest was lowered within the past 3 years.	None.
APPROACH CHANNEL	The area between the reservoir and the control section is natural rock. The slightly sloping area is free of debris.	None.
DISCHARGE CHANNEL	The discharge channel is cut into natural rock. Large boulders and some debris line the sides of the lower portion of the discharge channel.	None.
MISCELLANEOUS	The immediate flood plain area is in the process of being relandscaped by the owner.	None.

INSTRUMENTATION

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATION
MONTUMENTATION/SURVEYS	There are no survey monuments.	None.
OBSERVATION WELLS	There are no wells.	None.
WEIRS	There are no weirs.	None.
PIEZOMETERS	There are no piezometers.	None.
STAFFGAGES	There are no staffgages.	A staffgage should be installed in the reservoir and extend to top of dam elevation.
OTHER	There is no instrumentation on the dam.	None.

RESERVOIR

VISUAL EXAMINATION	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SLOPES	The reservoir area slopes are mostly mild with only a small portion being steep. The entire area is heavily wooded. The trees in the reservoir area were harvested in the early 70's. The debris seen at the embankment area is a result of the harvesting. The new growth of trees is preventing more debris from entering the reservoir. There are no signs of shoreline erosion or slope failures.	None.
SEDIMENTATION	There is no information available.	None.

DOWNSTREAM CHANNEL

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
CONDITION (OBSTRUCTIONS, DEBRIS, ETC.)	The downstream channel appears to be in good condition. The stilling basin is adequate for the present dam condition. The submerged outlet pipe would function better if it were allowed to flow freely. A pine tree has fallen into the channel by the outlet works.	The recent fallen pine tree in the channel should be removed.
SLOPES	The area slopes are mild to steep with partial to thick tree growth in the area.	None.
APPROXIMATE NO. OF HOMES AND POPULATION	A road embankment is located about 1100 feet downstream with three 8 by 10 feet culverts passing through the embankment at low level. There are several homes and businesses along the stream's path after flow passes through the roadway embankment in Bland, Virginia.	None.

APPENDIX VI

REFERENCES

1. Recommended Guidelines for Safety Inspection of Dams, Office of the Chief of Engineers, Department of the Army, Washington, D. C.
2. HEC-1DB Flood Hydrograph Package, (Hydrologic Engineering Center, U. S. Army Corps of Engineers, September 1978.)
3. "Probable Maximum Precipitation Estimates, United States East of the 105th Meridian," Hydrometeorological Report No. 51, (U. S. Weather Bureau, June 1978).
4. "Rainfall Frequency Atlas of the United States", Technical Paper No. 40, (U.S. Weather Bureau, May 1961).

