

AD-A105 543

HOSKINS-WESTERN-SONDEREGGER INC LINCOLN NE

F/B 13/13


NATIONAL DAM SAFETY PROGRAM. PURINA LAKE DAM (NO 31497), MISSOURI--ETC(U)

OCT 80 R S DECKER, G JAMISON, G ULMER

DACW43-80-C-0071

NL

UNCLASSIFIED

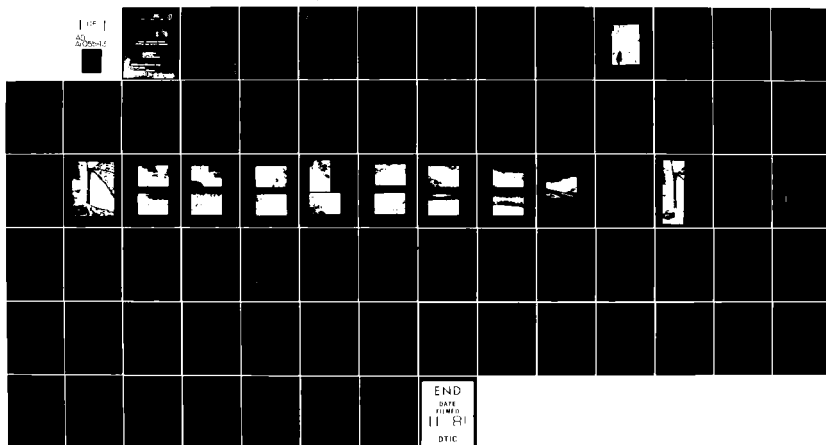

AD A105543

LEVEL II

①

MISSOURI - KANSAS CITY BANK

MINNA LAKE DAM
JEFFERSON COUNTY, MO.
1950

ETIC
1950

MISSOURI - KANSAS CITY BANK
JEFFERSON COUNTY, MO.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM	
1. REPORT NUMBER		2. GOVT ACCESSION NO.	
		AD-A105543	
3. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Purina Lake Dam (MO 31497) Franklin County, Missouri		3. RECIPIENT'S CATALOG NUMBER	
7. AUTHOR(s) Hoskins-Western-Sonderegger, Inc. Rey S. /Decker Gordon /Jamison Garold /Ulmer Harold P. /Hoskins		5. TYPE OF REPORT & PERIOD COVERED Final Report.	
9. PERFORMING ORG. REPORT NUMBER		6. CONTRACT OR GRANT NUMBER(s) DACW43-80-C-0071	
10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS		11. REPORT DATE October 1980	
12. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		13. NUMBER OF PAGES Approximately 65	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) National Dam Safety Program. Purina Lake Dam (MO 31497), Missouri - Kansas City Basin, Franklin County, Missouri. Phase I Inspection Report.		15. SECURITY CLASS. (of this report) UNCLASSIFIED	
16. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) Approved for release; distribution unlimited.		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
18. SUPPLEMENTARY NOTES			
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams			
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.			

394131

JLG

PURINA LAKE DAM
FRANKLIN COUNTY MISSOURI
MISSOURI IDENTIFICATION NO. MO 31497

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

PREPARED BY
HOSKINS-WESTERN-SONDEREGGER, INC.
CONSULTING ENGINEERS
LINCOLN, NEBRASKA

UNDER DIRECTION OF
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
FOR
GOVERNOR OF MISSOURI

OCTOBER, 1980

Accession For	
NTIS GRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A	



REPLY TO
ATTENTION OF

DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 TUCKER BOULEVARD, NORTH
ST. LOUIS, MISSOURI 63101

SUBJECT: Purina Lake Dam Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Purina Lake Dam (MO 31497).

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria.

- a. Spillway will not pass 50 percent of the Probable Maximum Flood without overtopping the dam.
- b. Overtopping of the dam could result in failure of the dam.
- c. Dam failure significantly increases the hazard to loss of life downstream.

	SIGNED	5 JUN 1981
SUBMITTED BY:	_____ Chief, Engineering Division	_____ Date
	SIGNED	8 JUN 1981
APPROVED BY:	_____ Colonel, CE, District Engineer	_____ Date

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

TABLE OF CONTENTS

<u>PARAGRAPH NO.</u>	<u>TITLE</u>	<u>PAGE NO.</u>
	Assessment Summary	
	Overview Photograph	
	SECTION 1 - PROJECT INFORMATION	
1.1	General	1
1.2	Description of Project	1
1.3	Pertinent Data	3
	SECTION 2 - ENGINEERING DATA	
2.1	Design	6
2.2	Construction	6
2.3	Operation	6
2.4	Evaluation	6
	SECTION 3 - VISUAL INSPECTION	
3.1	Findings	7
3.2	Evaluation	9
	SECTION 4 - OPERATIONAL PROCEDURES	
4.1	Procedures	10
4.2	Maintenance of Dam	10
4.3	Maintenance of Operating Facilities	10
4.4	Description of Any Warning System in Effect	10
4.5	Evaluation	10
	SECTION 5 - HYDRAULIC/HYDROLOGIC	
5.1	Evaluation of Features	11
	SECTION 6 - STRUCTURAL STABILITY	
6.1	Evaluation of Structural Stability	12
	SECTION 7 - ASSESSMENT/REMEDIAL MEASURES	
7.1	Dam Assessment	13
7.2	Remedial Measures	14

APPENDIX A - MAPS

Plate A-1	Vicinity Topography
Plate A-2	Location Map

APPENDIX B - PHOTOGRAPHS

Plate B-1		Photo Index
Plate B-2	Photo No. 2	Crest Taken from Left Abutment
	Photo No. 3	Upstream Slope taken from Left Side
Plate B-3	Photo No. 4	Downstream Slope taken from Left Side
	Photo No. 5	Downstream Slope taken from Right Side
Plate B-4	Photo No. 6	Downstream Slope taken from Crest at about Sta. 3+50
	Photo No. 7	Seepage in old Channel Along the Toe of Dam at about Sta. 3+50
Plate B-5	Photo No. 8	Toe of Dam at Sta. 3+50
	Photo No. 9	Rodent Burrow Approximately 5 to 6 Feet above the Toe
Plate B-6	Photo No. 10	Inlet of Spillway, Consists of a Concrete Headwall and Two (2) 18-inch Corrugated Metal Pipe Culverts
	Photo No. 11	Outlet of Spillway
Plate B-7	Photo No. 12	Downstream of Spillway Outlet
	Photo No. 13	Overview from the Right Side
Plate B-8	Photo No. 14	Overview from the Left Side
	Photo No. 15	View Looking Upstream into the Reservoir taken from the Crest at about Sta. 3+50
Plate B-9	Photo No. 16	House Located near Creek Approximately 1.5 Miles Downstream of Dam

APPENDIX C - PROJECT PLATES

Plate C-1	Phase I - Plan and Centerline Profile of Dam
Plate C-2	Phase I - Maximum Cross Section at Station 4+25
Plate C-3	Phase I - Centerline Profile of Spillway, Spillway Cross Section along Centerline of Road

APPENDIX D - HYDRAULIC AND HYDROLOGIC DATA

Plates D-1 and D-2	Hydrologic Computations
Plate D-3	Principal Spillway Rating Curve
Plate D-4	Emergency Spillway Rating Curve
Plate D-5	Elevation-Capacity and Elevation-Area Curves
Plates D-6 through D-34	Computer Input and Output for Ratios of PMF

PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM
ASSESSMENT SUMMARY

Name of Dam	Purina Lake Dam
State Located	Missouri
County Located	Franklin County
Stream	Tributary to Labadie Creek
Date of Inspection	October 7, 1980

Purina Lake Dam was inspected by an interdisciplinary team of engineers from Hoskins-Western-Sonderegger, Inc. The purpose of the inspection was to make an assessment of the general conditions of the dam with respect to safety, based upon available data and visual inspection, in order to determine if the dam poses hazards to human life or property.

The guidelines used in the assessment were furnished by the Department of the Army, Office of the Chief of Engineers and developed with the help of several Federal and State agencies, professional engineering organizations, and private engineers.

Purina Lake Dam has a height of about thirty-eight (38) feet and a storage capacity at the minimum top elevation of the dam of seventy (70) acre-feet. In accordance with the guidelines, a small size dam has a height greater than or equal to twenty-five (25) feet but less than forty (40) feet and a storage capacity greater than or equal to fifty (50) acre-feet but less than one thousand (1,000) acre-feet. The size classification is determined by either the storage capacity or height, whichever gives the larger size category. Purina Lake Dam is classified as a small size dam.

In accordance with the guidelines and based on visual observation, the dam is classified as having a high hazard potential. Failure would threaten life and property. The estimated damage zone extends approximately three (3) miles downstream of the dam. Within the damage zone are Highway MM, three or more dwellings, three stores, a service station and a fire station.

the
Our inspection and evaluation indicates that the spillways do not meet criteria set forth in the recommended guidelines for a small dam having a high hazard potential. Considering the small volume of water impounded and the downstream channel from the dam, one half of the Probable Maximum Flood is the appropriate spillway design flood. The spillways will pass the 100-year flood (1% probability flood - a flood having a one percent chance of being exceeded in any one year) without overtopping the dam. The spillways will pass 24% of the Probable Maximum Flood without overtopping the dam. The Probable Maximum Flood (PMF) is defined as the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region.

The upstream slope, crest and spillways of this dam are in very good condition and are very well maintained. The downstream slope has had very little, if any, maintenance and is in poor condition due to dense tree and brush growth. Rodent holes were also observed on the downstream slope.

Design data were not available for this dam. Based on the observations made during the field inspection of the dam, the following remedial measures should be performed under the guidance of a professional engineer experienced in the design and construction of dams:

a. Alternatives.

- (1) The height of the dam and/or the size of the spillways should be increased to prevent overtopping by 50 percent of the Probable Maximum Flood. In either case, the spillways should be protected to prevent erosion.

b. Operation and Maintenance Procedures.

- (1) Seepage and stability analyses comparable to the requirements of the recommended guidelines should be performed by an engineer experienced in the design and construction of dams. These analyses should include the appropriate seismic Zone 2 earthquake loadings.
- (2) Trees and brush should be removed from the downstream slope. Tree removal should be done under the guidance of an engineer experienced in the design and construction of dams.
- (3) The downstream slope should be inspected and reevaluated after removal of the trees and brush.
- (4) Rodent holes on the downstream slope should be repaired.
- (5) The amount and nature (color, sediment, etc.) of the seepage effluent should be monitored on a regular basis, particularly under maximum reservoir levels.
- (6) A program of regular inspection and maintenance should be initiated with inspection reports made a part of this project file. Inspection and maintenance operations should include observations on seepage, prevention of tree growth and curtailment of rodent activity.




Ray S. Decker
E-3703



Gordon Jamison



Garold Ulmer
E-19246



Harold P. Hoskins, Chairman of the Board
Hoskins-Western-Sonderegger, Inc.
E-8696

FORM 1

BINDING EDGE

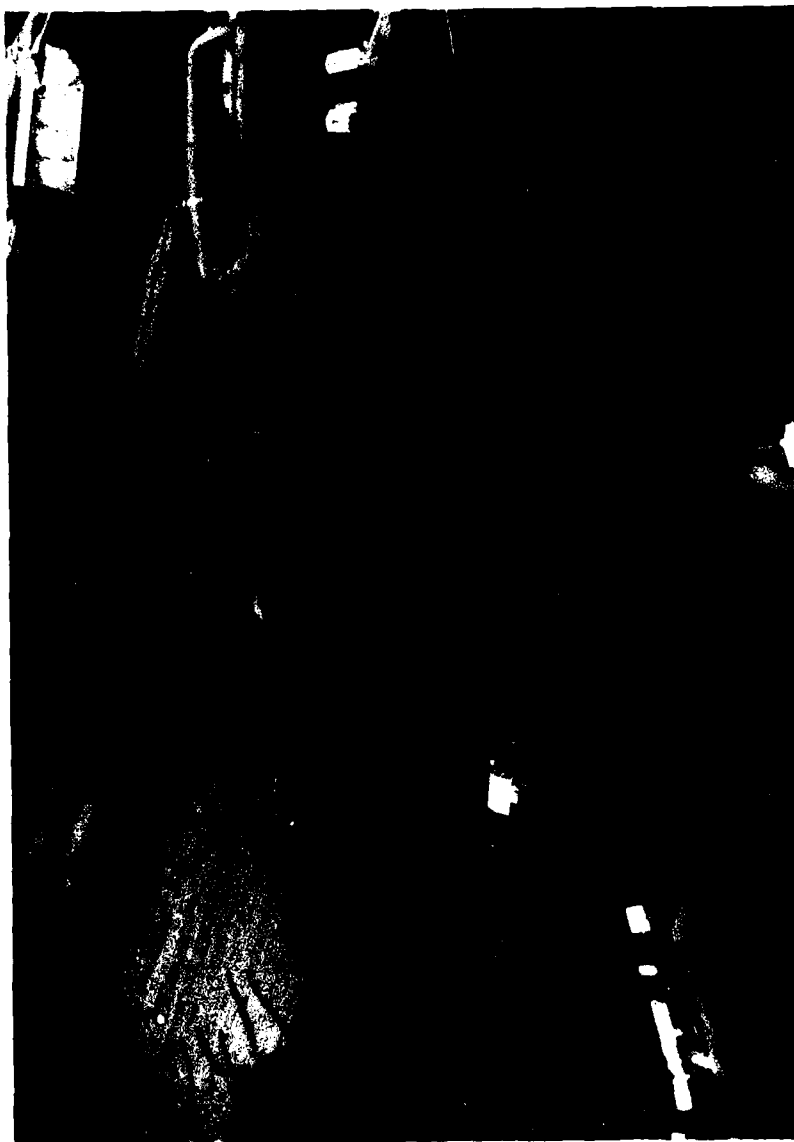


PHOTO NO. 1 - OVERVIEW

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
PURINA LAKE DAM - MO 31497
FRANKLIN COUNTY, MISSOURI

SECTION 1 - PROJECT INFORMATION

1.1 GENERAL

- a. Authority. The National Dam Inspection Act, Public Law 92-367, authorized the Secretary of the Army through the Corps of Engineers, to initiate a program of safety inspection of dams throughout the United States. Pursuant to the above, the St. Louis District, Corps of Engineers, District Engineer directed that a safety inspection of Purina Lake Dam be made.
- b. Purpose of Inspection. The purpose of the inspection was to make an assessment of the general condition of the dam with respect to safety, based upon available data and visual inspection, in order to determine if the dam poses hazards to human life or property.
- c. Evaluation Criteria. Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in "Recommended Guidelines for Safety Inspection of Dams", Appendix D to "Report of the Chief of Engineers on the National Program of Inspection of Dams", dated May, 1975, and published by the Department of the Army, Office of the Chief of Engineers.

1.2 DESCRIPTION OF PROJECT

- a. Description of Dam and Appurtenances.
 - (1) Embankment. The embankment is an earthfill structure approximately 650 feet in length and 38 feet in height with a maximum storage capacity of approximately 70 acre-feet at minimum top of dam elevation.
 - (2) Principal Spillway. The principal spillway is uncontrolled and consists of twin 18-inch diameter corrugated metal pipe culverts with a concrete headwall on the inlet end. The culverts are located approximately 50 feet east of the north abutment of the dam and are cut into and through the ridge line that defines the boundary of the drainage area of the dam.
 - (3) Emergency Spillway. The emergency spillway is an uncontrolled asphalt surfaced road constructed over the twin 18-inch diameter corrugated metal pipe principal spillway. The road is constructed on the ridge line that defines the boundary of the drainage area of the dam as shown in Photo No. 1 and on Plate A-1.
 - (4) Low-Level Outlet. There is no low level outlet.

(5) Pertinent physical data are given in paragraph 1.3.

- b. Location. The dam is located approximately one and one-quarter miles northwest of Gray Summit in the northeast corner of Franklin County, Missouri, as shown on Plate A-2. The dam is shown on Plate A-1 in the NE $\frac{1}{4}$ of Section 6, T43N, R2E.
- c. Size Classification. Criteria for determining the size classification of dams and impoundments are presented in the guidelines referenced in paragraph 1.1c above. Purina Lake Dam has a height of 38 feet and a storage capacity of 70 acre-feet. This dam is classified as a small size dam. A small size dam has a height greater than or equal to 25 feet but less than 40 feet and a storage capacity greater than or equal to 50 acre-feet but less than 1,000 acre-feet. The size classification is determined by either the storage or height, whichever gives the larger size category.
- d. Hazard Classification. Guidelines for determining hazard classification of dams and impoundments are presented in the guidelines as referenced in paragraph 1.1c above.

Aerial photographs of the downstream damage zone of this dam were taken in October, 1980. These photographs were used as reference in the field observations of the damage zone which were made during the inspection. Based on the field observations and on the referenced guidelines this dam is in the High Hazard Potential Classification. The estimated damage zone extends approximately three miles downstream of the dam. Within the damage zone are Highway MM, three or more dwellings, three stores, a service station and a fire station.

- e. Ownership. The dam is owned by the Ralston-Purina Research Corporation, Route 2, Box 423, Gray Summit, Missouri 63039 Attention: Mr. Don Brown, Farm Manager.
- f. Purpose of Dam. The dam impounds a recreational lake covering about 5.6 acres and containing about 54 acre-feet of water at normal pool.
- g. Design and Construction History. Mr. Brown stated that an abandoned railroad fill at the site was converted to a dam in 1957. The culvert through the fill was evidently removed (no evidence of culvert observed during the inspection), and the excavation was backfilled. The crest was widened approximately 10 feet, and a new upstream slope was constructed at a flatter slope than the slope of the original railroad embankment. The spillways were also constructed at this time. No work was done on the downstream slope.
- h. Normal Operating Procedure. There are no operating facilities for this dam. The pool level is controlled by rainfall, infiltration, evaporation, and the capacity of the uncontrolled spillways.

1.3 PERTINENT DATA

a. Drainage Area. 44 acres (0.069 square miles).

b. Discharge at Damsite.

- (1) All discharges at the dams site are through an uncontrolled principal spillway (twin 18-inch corrugated metal pipe culverts with a concrete headwall) and an uncontrolled emergency spillway (low road section constructed over the 18-inch corrugated metal pipe culverts).
- (2) Estimated maximum flood at dams site -- unknown.
- (3) The principal spillway capacity varies from 0 c.f.s. at elevation 571.0 feet to 19 c.f.s. at the crest of the emergency spillway (elevation 573.2 feet) to 21 c.f.s. at the minimum top of dam (elevation 573.7 feet).
- (4) The emergency spillway capacity varies from 0 c.f.s. at its crest (elevation 573.2 feet) to 34 c.f.s. at the minimum top of dam (elevation 573.7 feet).
- (5) Total spillway capacity at the minimum top of dam is 55 c.f.s. ±.

c. Elevations (feet above M.S.L.).

- (1) Observed pool - 567.0±
- (2) Normal pool - 571.0±
- (3) Spillway crests
Principal - 571.0±
Emergency - 573.2±
- (4) Maximum experienced pool - unknown
- (5) Top of dam (minimum) - 573.7
- (6) Streambed - 536±
- (7) Maximum Tailwater - unknown

d. Reservoir. Length (feet) of pool

- (1) At principal spillway crest - 750±
- (2) At emergency spillway crest - 820±

(3) At top of dam (minimum) - 850±

e. Storage (Acre-feet).

(1) Observed pool - 35±

(2) Normal pool - 54±

(3) Spillway crests

Principal - 54±

Emergency - 66±

(4) Maximum experienced pool - unknown

(5) Top of dam (minimum) - 70±

f. Reservoir Surface (Acres).

(1) Observed pool - 4.6±

(2) Normal pool - 5.6±

(3) Spillway crests

Principal - 5.6±

Emergency - 6.2±

(4) Maximum experienced pool - unknown

(5) Top of dam (minimum) - 6.3±

g. Dam.

(1) Type - Earth fill

(2) Length - 650 Feet ±

(3) Height - 38 Feet ±

(4) Top Width - 23 Feet ±

(5) Side slopes.

(a) Downstream - 1V on 1.5H (measured)

(b) Upstream - 1V on 2.3H (measured on exposed slope)

(6) Zoning - unknown

- (7) Impervious core - unknown
- (8) Cutoff - unknown
- (9) Grout curtain - unknown
- (10) Wave protection - Riprap
- (11) Drains - None
- h. Diversion Channel and Regulating Tunnel. None.
- i. Spillways.
 - (1) Principal
 - (a) Type - Uncontrolled, twin 18-inch diameter corrugated metal pipe culverts with a concrete headwall.
 - (b) Crest (invert) elevation - 571.0 (left and right culvert)
Outlet (invert) elevation - 570.0 (left and right culvert)
 - (c) Length - 38 feet (left and right culvert)
 - (2) Emergency
 - (a) Type - An uncontrolled asphalt surface road constructed over the twin culvert principal spillway.
 - (b) Control Section - The 23-foot width asphalt surfaced road acts as a broad crested weir. The centerline profile of the road is parabolic in shape with the low point being located approximately 25 feet east of the twin culvert principal spillway. The approach to the upstream edge of the asphalt as well as the runoff section downstream from the asphalt slopes at approximately 1V on 6H.
 - (c) Crest elevation - 573.2 (minimum)
 - (d) Upstream Channel - Open and stable with a 12.5% grade from the headwall to the waterline.
 - (e) Downstream Channel - Open and well vegetated with a 6.9% grade for approximately 100 feet. It then drains into a heavily wooded channel which exits into another small creek approximately 500 feet north of the spillways.
- j. Regulating Outlets. None

SECTION 2 - ENGINEERING DATA

2.1 DESIGN

No design data were available for this dam.

2.2 CONSTRUCTION

No construction data were available. It was reported by Mr. Don Brown that the original embankment was an old railroad fill. In 1957, the culvert through the fill was removed, a new upstream section was added to the railroad fill and the spillways were constructed.

2.3 OPERATION

No data were available on spillway operation. Mr. Brown reported that the principal spillway has operated at maximum capacity.

2.4 EVALUATION

- a. Availability. No data were available.
- b. Adequacy. The field surveys and visual observation presented herein are considered adequate to support the conclusions of this report. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.
- c. Validity. Not applicable.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS

- a. General. A visual inspection of the Purina Lake Dam was made on October 7, 1980. Engineers from Hoskins-Western-Sonderegger, Inc., Lincoln, Nebraska, making the inspection were:

Rey S. Decker - Geotechnical
Garold G. Ulmer - Hydraulics and Hydrology
Gordon Jamison - Hydraulics and Hydrology

The representative of the owner, Mr. Don Brown, was not present during the inspection, but was interviewed by telephone.

- b. Dam.

- (1) Geology and Soils (abutment and embankment). This upland embankment consists of and rests on the silts and clayey silts of the Menfro soil and underlying loess. Ten to twenty feet of loess mantle the Cotter formation; a light gray to light brown, medium to finely crystalline, cherty dolomite. The significant structural features within a 10 mile radial distance are the Moselle Fault and the Eureka-House Springs anticline.

Groundwater movement at the dam is controlled by the loess and Menfro soil. Seepage from the impoundment and local precipitation infiltrates to the relatively tight Cotter formation on which it perches and moves down valley. Local potentiometric surfaces of groundwater in the Jefferson City Formation and Roubideaux formation are at 130 ft depth indicative of the confinement beneath the Cotter formation aquiclude.

The Moselle Fault (Frank, 1945) located approximately 9 miles west of the site is the site of a deep-seated earthquake in May 1945. The embankment occurs in Seismic Zone 2 with a moderate probability of earthquake damage. Earthquakes with a Modified Mercalli intensity at or greater than IV within 50 radial miles are as follows: 1902 (VI), 1911 (IV), 1930 (IV), 1933 (IV), and 1945 (IV).

The Eureka-House Springs anticline crests approximately 10 miles to the east.

Bedrock porosity is low with a low potential for sinkhole collapse in the upper portion of the Cotter formation.

Samples of the embankment materials taken by hand auger were field classified as clay silts and silty clays (ML and CL).

The embankment materials were borrowed from the loess mantle of the surrounding ridges. Materials in the valley section are CL-ML alluvium derived from the loess covered slopes. No bedrock formations were observed at the site.

- (2) Upstream Slope. The upstream slope is well covered with durable limestone riprap to within about 2 feet of the crest. The riprap has a maximum size of about 8 inches and nominal size of about 1 inch. No erosion was observed on the slope. No slumps, cracks, rodent activity or tree growth was observed. Photos 3 and 14 show the upstream slope. The reservoir elevation appeared to be 2 to 3 feet below normal pool level.
- (3) Crest. The crest of the dam serves as a roadway and is paved with asphalt. The profile of the crest is quite uniform at about elevation 574 except for a section about 80 feet long on the right end which serves as the emergency spillway. No cracks, deformations, trees or rodent activity were observed on the crest. Photo 2 shows the crest. There was no evidence to indicate that the dam has ever been overtopped.
- (4) Downstream Slope. The downstream slope consists of the old railroad fill. It is quite steep (1V on 1.5H) and almost completely covered with brush and trees up to 15 inches in diameter. The dense vegetative cover made it almost impossible to observe surface conditions on the slope (slumps, slides, etc.); however, surface erosion of the slope did not appear to be excessive. Photos 4, 5 and 6 show the downstream slope. A few rodent holes, up to 15 inches in diameter, were observed on the lower part of the slope (5 to 10 feet up from the toe). Photo 9 shows a rodent hole. No seepage was observed along the toe of the embankment. However, seepage was out cropping in the bottom and banks of the old channel which flows approximately parallel with the toe of the dam between stations 2+50 and 4+50. Total seepage discharge in the old stream channel was estimated at 1 to 2 gpm. All seepage was clear and no piping or boils were observed. Photos 7 and 8 show the seepage in the old channel. Borings on the slope indicated CL-ML materials to a depth of 2 feet.

c. Appurtenant Structures.

- (1) Principal Spillway. The principal spillway, located in the right abutment, consists of two 18-inch corrugated metal pipe culverts with a concrete headwall. The headwall and pipes appeared to be in good condition. There was no evidence of any recent flows through the spillway. No erosion was observed at the outlet of the spillway. Photos 10 and 11 show the principal spillway.

- (2) Emergency Spillway. The asphalt surfaced road is in good condition with no visible signs of distress. The approach area from the reservoir is open with no obstructions and is well vegetated. The runoff section from the downstream edge of the asphalt is well vegetated. There was no evidence of recent flow through the spillway, and there was no evidence of erosion in the spillway exit channel. Photo 10 shows the roadway over the culverts.
- (3) Low-Level Outlet. There is no low level outlet for this structure.
- d. Reservoir Area. The area bordering the reservoir is well vegetated with grass, and no significant erosion was observed around the reservoir. Photos 1 and 15 show the reservoir. The nonvegetated (bare) strip around the perimeter of the reservoir reflects the abnormally low pool level. There was no evidence of heavy siltation.
- e. Downstream Channel. The channel downstream from the spillways is open and well vegetated with adapted grasses for 100 feet or more below the spillway outlets where it enters a side drainageway for an adjacent watershed. No erosion was observed in the exit channel. The side drainage outlet is overgrown with trees and brush, but this should not affect spillway operations.

3.2 EVALUATION

The upstream slope and the central portion (crest) of the dam appear to be in good condition. The downstream slope is in poor condition. The integrity of the dam is threatened by the dense growth of trees and brush and large rodent holes on the downstream slope. The abnormally steep downstream slope (1H on 1.5H) and the nature of the surface materials (CL-ML) would indicate that overtopping of the dam could result in significant damage and possible breaching. Seepage through the foundation of the dam does not appear to adversely affect the stability of the structure. The spillways are in good condition, and spillway discharges will not affect the dam in anyway.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 PROCEDURES

There are no controlled outlet works for this dam. The pool level is controlled by rainfall, infiltration, evaporation, and the capacity of the uncontrolled spillways.

4.2 MAINTENANCE OF DAM

Maintenance on the crest and upstream slope of the dam appears to be very good. There has been no apparent maintenance of the downstream slope, which was undoubtedly covered with trees and brush when the old railroad fill was converted to an impounding structure.

4.3 MAINTENANCE OF OPERATING FACILITIES

No operating facilities exist at this dam.

4.4 DESCRIPTION OF ANY WARNING SYSTEM IN EFFECT

There is no warning system in effect for this dam.

4.5 EVALUATION

The lack of maintenance of the downstream slope, as evidenced by the heavy growth of trees and brush and the existence of large rodent holes, could ultimately lead to failure of this dam.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 EVALUATION OF FEATURES

- a. Design Data. No design data were found for this dam.
- b. Experience Data. The drainage area, reservoir surface area, and elevation-storage data were developed from the USGS Labadie, Missouri 7½ minute topographic quadrangle map. The hydraulic computations for the spillway and dam overtopping discharge ratings were based on data collected in the field at the time of the field inspection. Hydraulic/hydrologic computations are included as Appendix D of this report.
- c. Visual Observations.
 - (1) The spillways are located almost due east of the right (north) abutment of the dam on the ridge line that defines the drainage area boundary of the dam. Spillway discharges will flow across the ridge line into a drainageway lying to the north of the dam and reservoir. The spillways appear to be in good condition. Spillway discharges will not endanger the dam.
 - (2) There are no drawdown facilities to evacuate the pool.
- d. Overtopping Potential. The spillways are too small to pass 50% of the probable maximum flood without overtopping the dam. The spillways will pass the 1% probability flood as well as 24% of the probable maximum flood without overtopping. Overtopping is dangerous because the flow of water over the crest could erode the face of the dam and, if continued long enough, could breach the dam with sudden release of all of the impounded water into the downstream flood plain. The results of the routings through the dam are tabulated in regards to the following conditions:

Frequency	Inflow Discharge c.f.s.	Outflow Discharge c.f.s.	Maximum Pool Elevation	* Maximum Depth Over Dam Feet	Duration Over Top Hours
1%	225	15	572.7	0	0
1/2 PMF	490	420	574.3	0.6	4-
PMF	980	930	574.6	0.9	6-
0.24 PMF	235	50	573.7	0	0

*Minimum top of dam elevation - 573.7

According to the recommended guidelines from the Department of the Army, Office of the Chief of Engineers, this dam is classified as having a high hazard potential rating and a small size. Therefore, the 1/2 PMF to PMF is the test for the adequacy of the dam and its spillway.

The estimated damage zone is described in Paragraph 1.2d in this report.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

- a. Visual Observation. Based on visual observation this dam appears to be structurally stable; however, it was not possible to adequately observe much of the downstream slope for cracks, slides, deformations or seeps because of the dense cover of trees and shrubs. The downstream slope is abnormally steep for a dam of this height and observable composition. The nature of materials placed in the old railroad fill is not known. It could consist of quite granular material brought in from other required excavation along the railroad right-of-way. This could account for the lack of observable seepage on the downstream slope of the dam (control of the phreatic line) and would improve the safety factors for slope stability with respect to shear strength and seepage. Trees and shrubs should be removed from the slope, and measures should be taken to prevent their recurrence. Slope conditions should be re-evaluated after it has been cleared.
- b. Design and Construction Data. No design or construction data were available for this dam. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.
- c. Operating Records. There are no controlled operating facilities for this dam. Mr. Brown reported that the principal spillway has operated at maximum capacity.
- d. Post Construction Changes. The inspection team is not aware of any post construction changes to this dam after the railroad fill was converted to an impounding structure.
- e. Seismic Stability. This dam is located in Seismic Zone 2. An earthquake of the magnitude predicted in this area could be expected to cause significant damage to this dam with the present steep downstream slope and apparent ML-CL composition.

SECTION 7 - ASSESSMENT/REMEDIAL MEASURES

7.1 DAM ASSESSMENT

- a. Safety. Based on visual observation this dam appears to be structurally stable. The upstream slope and the wide paved crest are in very good condition and are very well maintained. No signs of distress were observed on either the upstream slope or the crest which are the areas constructed in 1957 when the old railroad fill was changed into a dam. The downstream slope evidently was not altered during the conversion of the railroad fill to a dam as evidenced by the steep slope (1V on 1.5H) and the heavy growth of trees and brush. Although no evidence of slides, cracks, deformations, seepage or significant erosion were observed in the limited areas of the slope where observations could be made, these conditions could exist and could be masked by the heavy tree and brush growth. The spillway system of the dam is in good condition but does not have sufficient capacity to pass 50 percent of the probable maximum flood without overtopping the dam. Based on the abnormally steep downstream slope of the dam and on the surface materials (CL-ML) it would appear that overtopping could result in significant damage and possible breaching. The downstream slope should be cleared of all trees and brush. Continued growth could ultimately impair the structural stability of the dam and lead to failure. All rodent holes in the downstream slope should be repaired. Future maintenance should include the downstream slope with particular attention being given to prevention of tree and brush growth and curtailment of rodent activity. The seepage observed in the old stream channel paralleling the toe of the dam does not appear to have an adverse affect on the stability of the dam. However, after clearing the slope of trees and brush, it is recommended that the volume and nature of the seepage be monitored on a regular basis with particular attention being given to change in color and sediment content. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.
- b. Adequacy of Information. Due to the lack of engineering data, the conclusions in this report are based upon performance history and visual observations. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.
- c. Urgency. A program should be developed as soon as possible to monitor at regular intervals the deficiencies described in this report. The remedial measures recommended in paragraph 7.2b should be accomplished in the near future. The item recommended in paragraph 7.2a should be pursued on a high priority basis.

- d. Necessity for Further Investigations. The additional studies and analyses recommended in paragraph 7.2b should be accomplished by the owner in the near future.
- e. Seismic Stability. This dam is located in Seismic Zone 2. An earthquake of this magnitude could cause significant damage to the steep downstream slope of this dam. Stability analyses performed for this dam should include the appropriate Seismic Zone 2 earthquake loadings.

7.2 REMEDIAL MEASURES

The following remedial measures and maintenance procedures are recommended. All remedial measures should be performed under the guidance of a registered professional engineer experienced in the design and construction of earth dams.


a. Alternatives.

- (1) The height of the dam and/or the size of the spillways should be increased to prevent overtopping by 50% of the Probable Maximum Flood. In either case, the spillways should be protected to prevent erosion.

b. Operation and Maintenance Procedures.

- (1) Seepage and stability analyses comparable to the requirements of the recommended guidelines should be performed by an engineer experienced in the design and construction of dams. These analyses should include the appropriate Seismic Zone 2 earthquake loadings.
- (2) Trees and brush should be removed from the downstream slope. Tree removal should be done under the guidance of an engineer experienced in the design and construction of dams.
- (3) The downstream slope should be inspected and reevaluated after removal of the trees and brush.
- (4) Rodent holes on the downstream slope should be repaired.
- (5) The amount and nature (color, sediment, etc.) of the seepage effluent should be monitored on a regular basis, particularly under maximum reservoir levels.
- (6) A program of regular inspection and maintenance should be initiated with inspection reports made a part of this project file. Inspection and maintenance operations should include observations on seepage, prevention of tree growth and curtailment of rodent activity.

APPENDIX A
MAPS

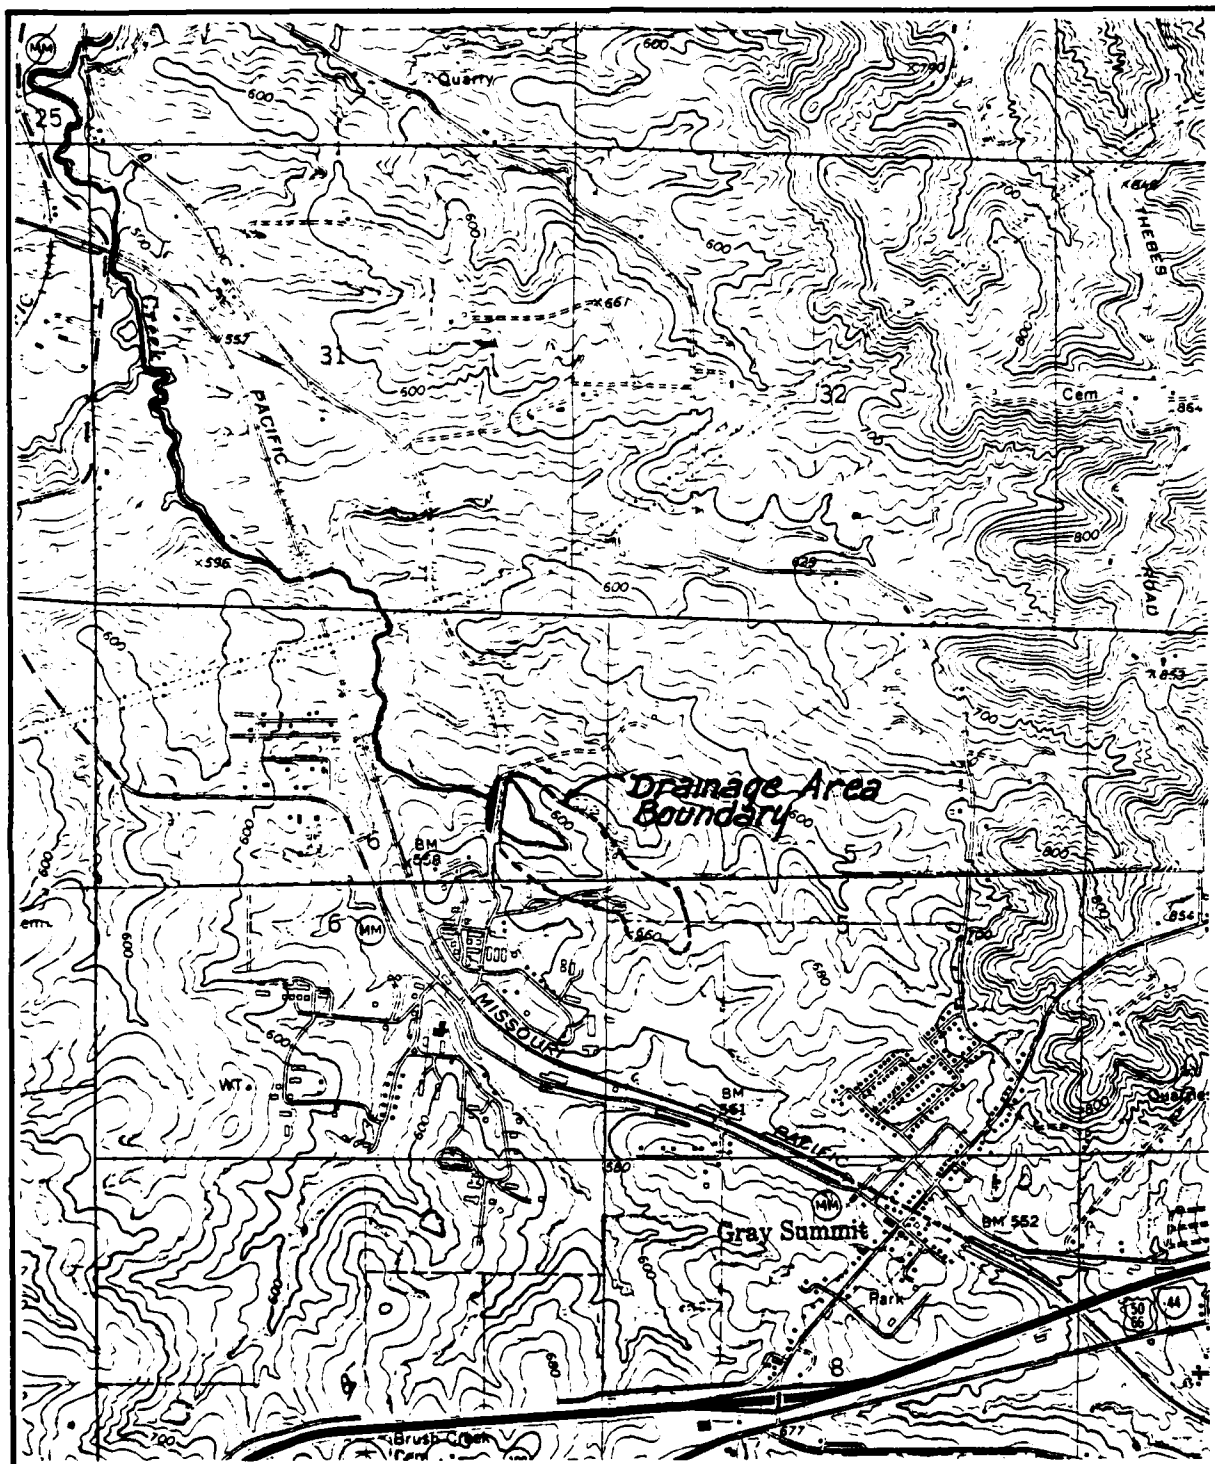

Scale in feet
2000 1000 0 2000 4000

Contour Interval - 20'




VICINITY TOPOGRAPHY

PURINA LAKE DAM

FRANKLIN COUNTY, MO.

MO 31497 PLATE A-1

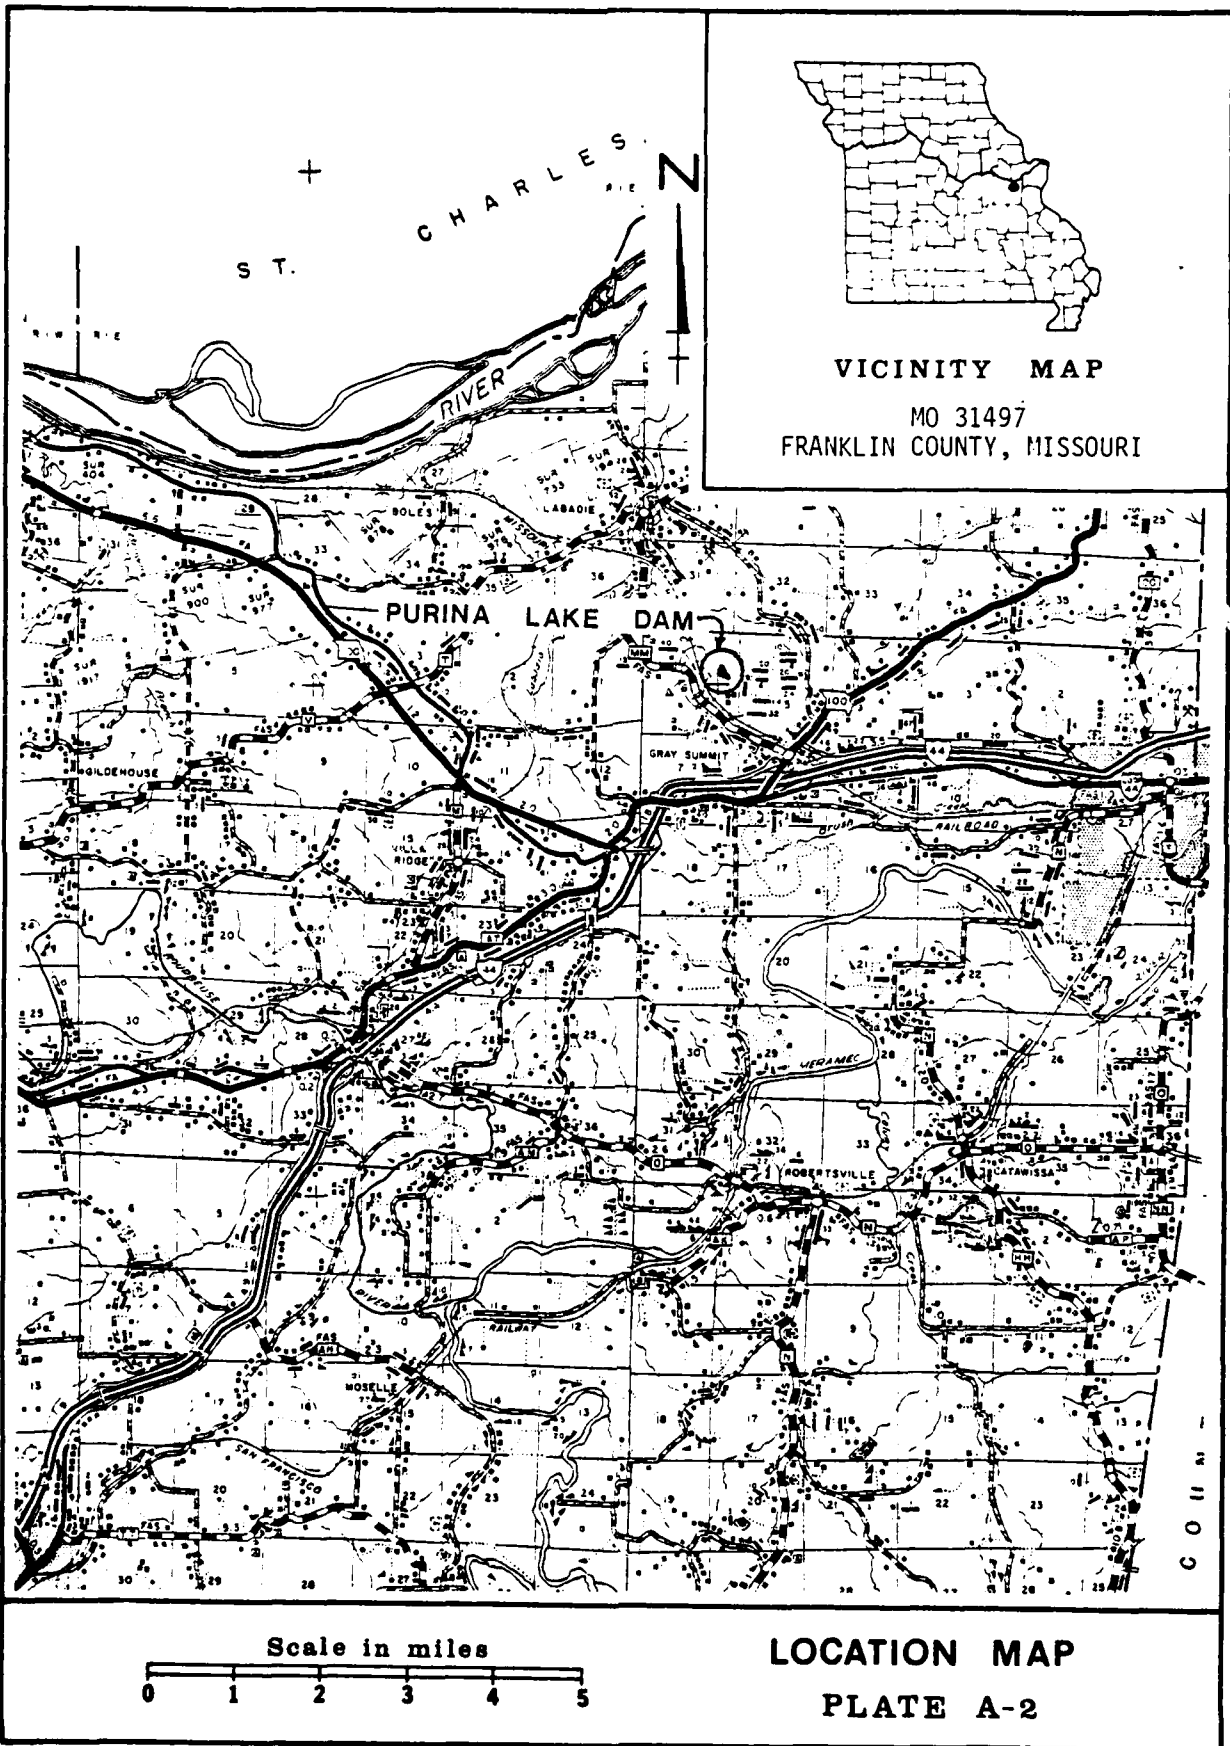

APPENDIX B
PHOTOGRAPHS



PURINA LAKE DAM
FRANKLIN COUNTY, MISSOURI
MO 31497

PHOTO INDEX

PLATE B-1

31299

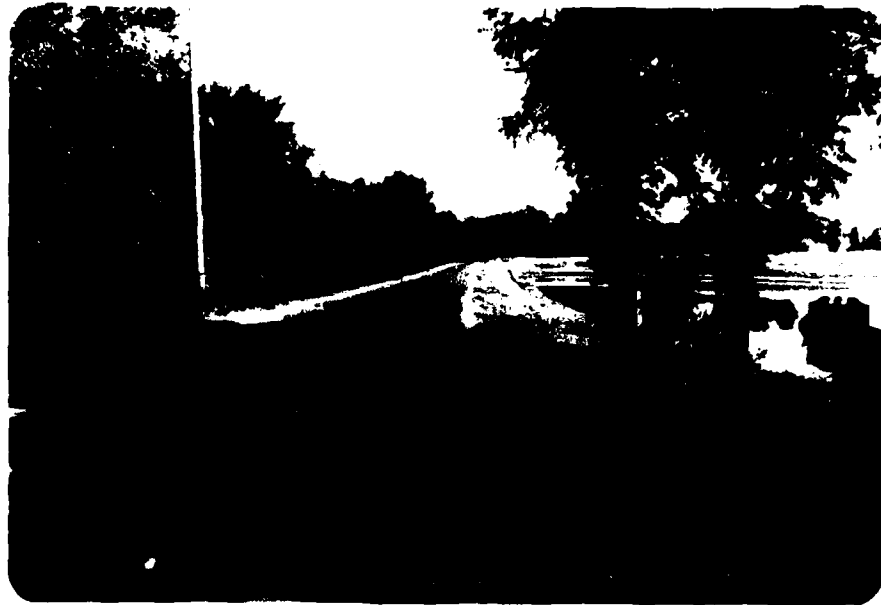


PHOTO NO. 2 - CREST TAKEN FROM LEFT ABUTMENT



PHOTO NO. 3 - UPSTREAM SLOPE TAKEN FROM LEFT SIDE



PHOTO NO. 4 - DOWNSTREAM SLOPE TAKEN FROM LEFT SIDE



PHOTO NO. 5 - DOWNSTREAM SLOPE TAKEN FROM RIGHT SIDE



PHOTO NO. 6 - DOWNSTREAM SLOPE TAKEN FROM CREST AT ABOUT
STA. 3+50



PHOTO NO. 7 - SEEPAGE IN OLD CHANNEL ALONG THE TOE OF DAM
AT ABOUT STA. 3+50



PHOTO NO. 8 - TOE OF DAM
AT STA.
3+50



PHOTO NO. 9 - RODENT BURROW APPROXIMATELY 5 TO 6 FEET ABOVE
THE TOE

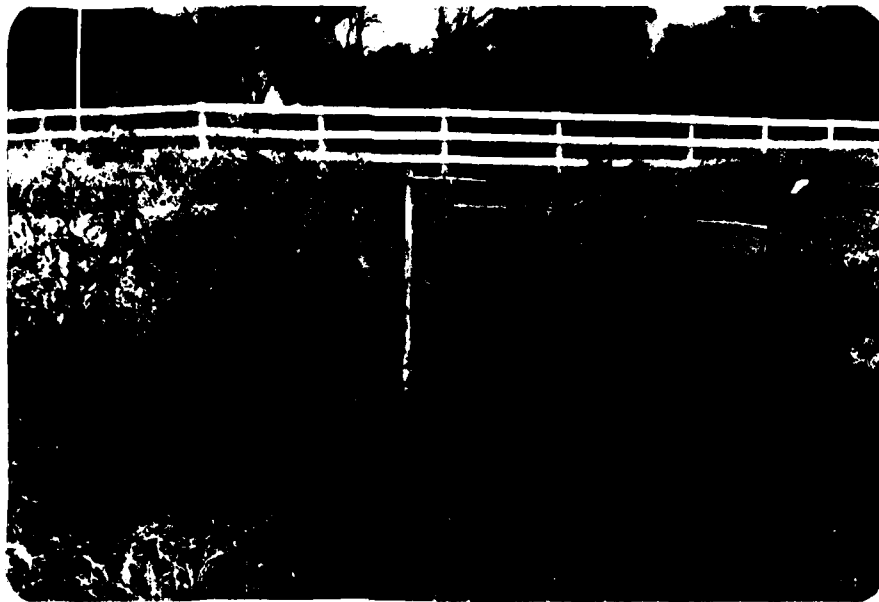


PHOTO NO. 10 - INLET END OF PRINCIPAL SPILLWAY CONSISTING OF TWO 18-INCH CORRUGATED METAL PIPE CULVERTS AND CONCRETE HEADWALL. PAVED ROAD CROSSING CULVERTS IS THE EMERGENCY SPILLWAY



PHOTO NO. 11 - OUTLET OF SPILLWAY



PHOTO NO. 12 - DOWNSTREAM OF SPILLWAY OUTLET

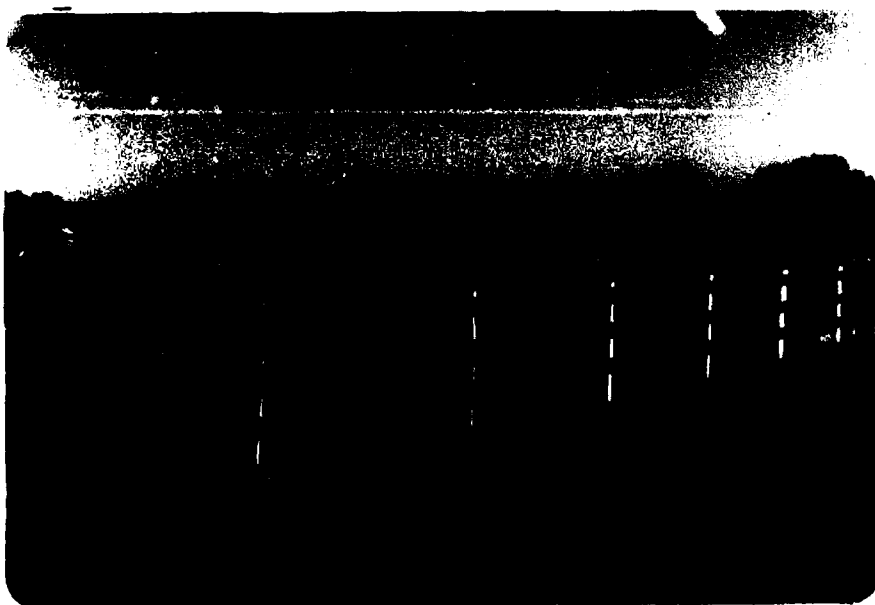


PHOTO NO. 13 - OVERVIEW FROM THE RIGHT SIDE



PHOTO NO. 14 - OVERVIEW FROM THE LEFT SIDE



PHOTO NO. 15 - VIEW LOOKING UPSTREAM INTO THE RESERVOIR
TAKEN FROM THE CREST AT ABOUT STA. 3+50



PHOTO NO. 16 - HOUSE LOCATED NEAR CREEK APPROXIMATELY 1.5
MILES DOWNSTREAM OF DAM


C

APPENDIX C
PROJECT PLATES




PLAN OF DAM

Scale: 1"=100'

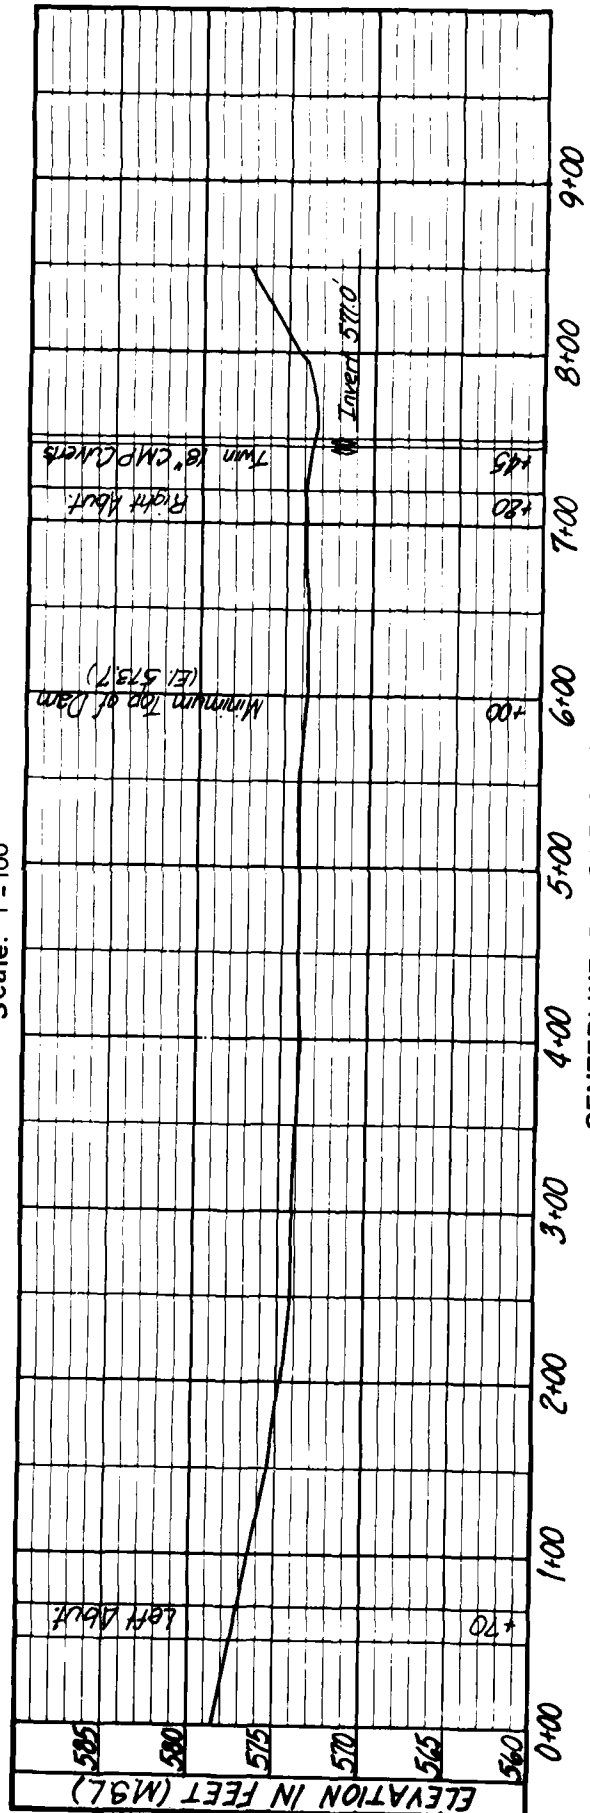



CENTERLINE PROFILE OF DAM

Scale As Shown

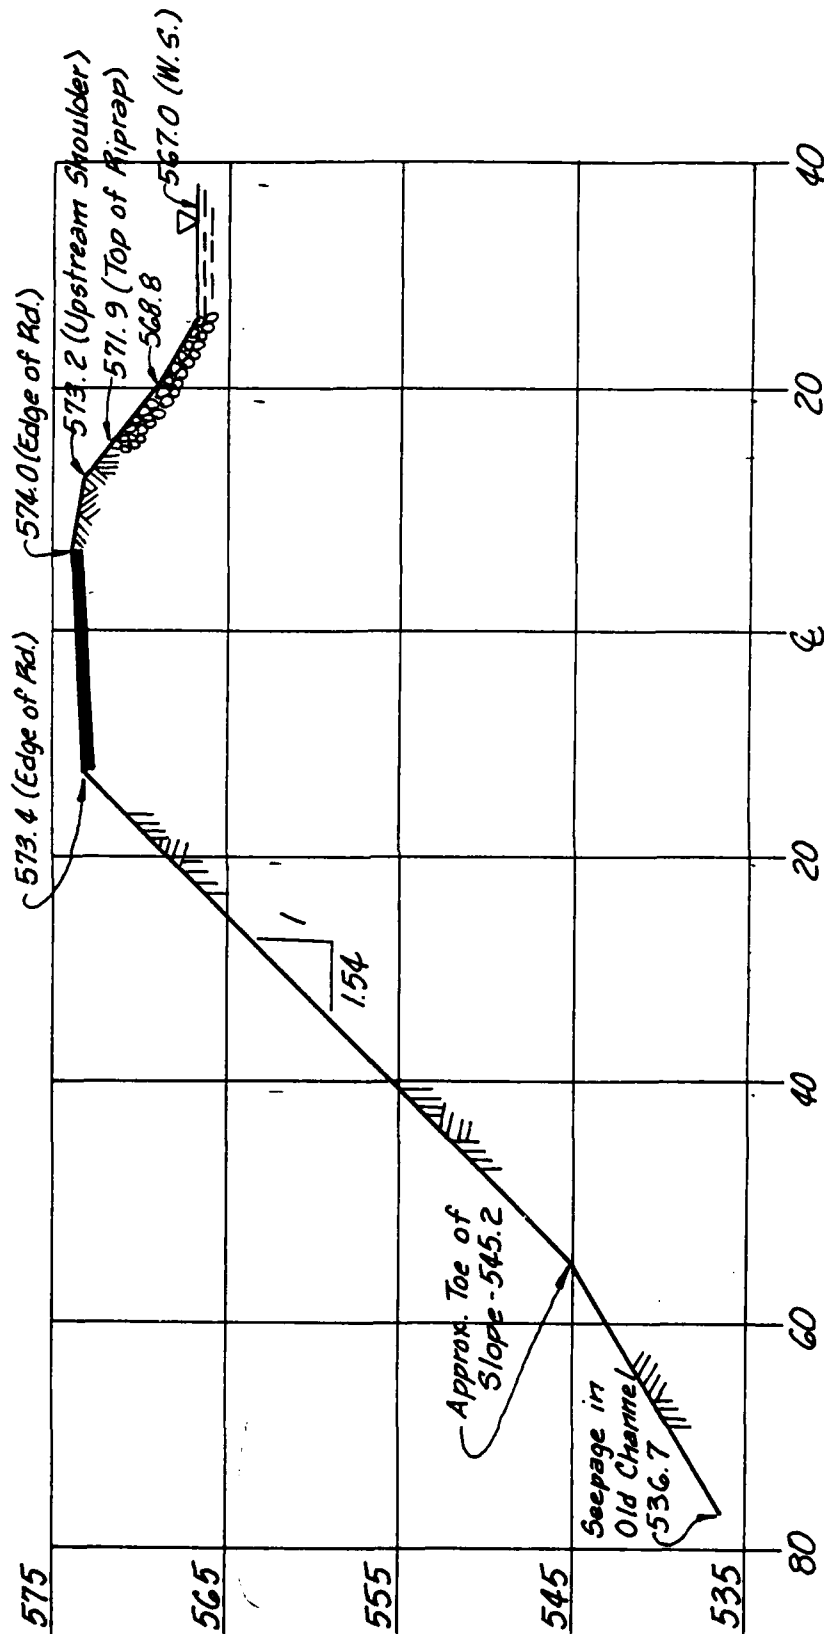

MAXIMUM CROSS-SECTION AT STA. 4+25

Scale: 1" = 15'H
1" = 10'V

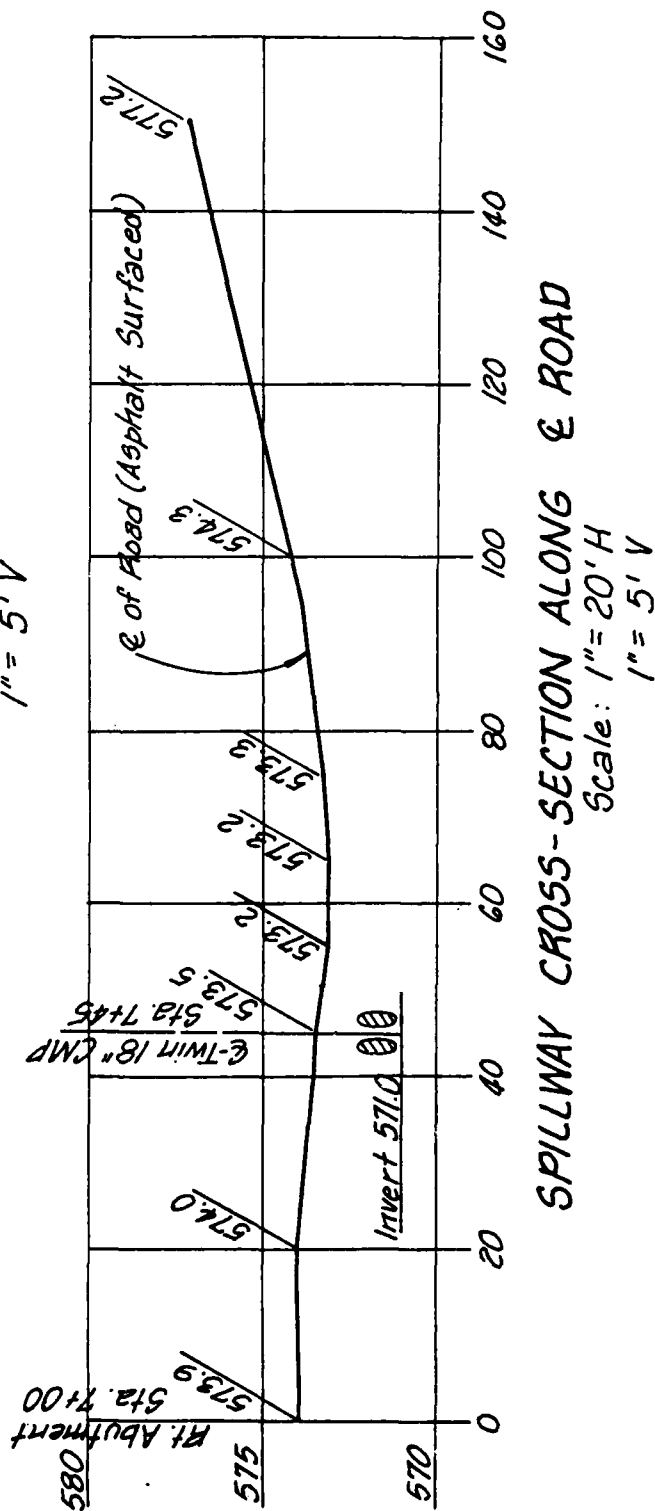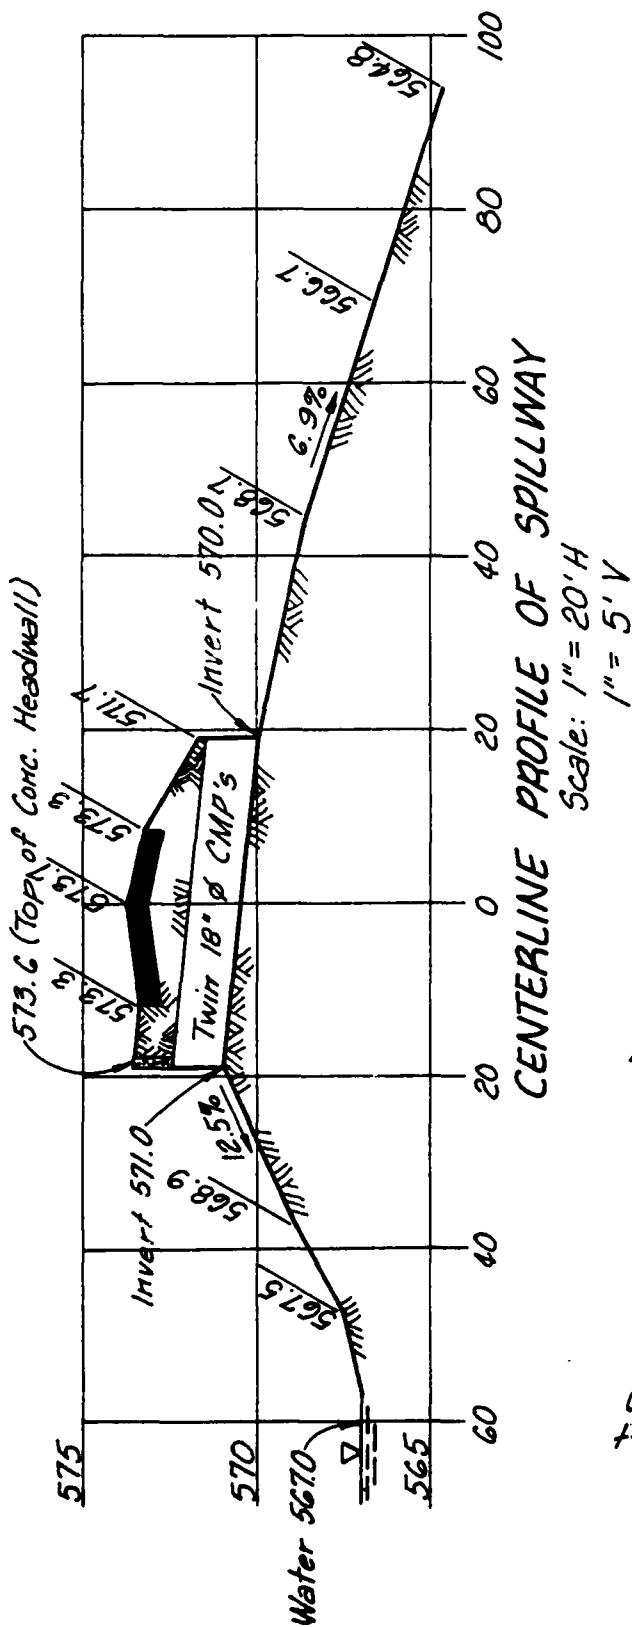

APPENDIX D
HYDRAULIC AND HYDROLOGIC DATA

HYDROLOGIC COMPUTATIONS

1. The SCS dimensionless unit hydrograph and the systemized computer program HEC-1 (Dam Safety Version), July 1978, prepared by the Hydrologic Engineering Center, U.S. Army Corps of Engineers, Davis, California, were used to develop the inflow hydrographs (See this Section).
 - a. Twenty-four hour, one percent probabilistic rainfall for the dam location was taken from the data for the rainfall station at Sullivan, Missouri as supplied by the St. Louis District, Corps of Engineers per their letter dated 6 March 1979. The twenty-four hour probable maximum precipitation was taken from the curves of Hydrometeorological Report No. 33 and current Corps of Engineers and St. Louis policy and guidance for hydraulics and hydrology.
 - b. Drainage area = 0.069 square miles (44 acres).
 - c. Time of concentration of runoff = 12 minutes (computed from the "Kirpich" formula and verified using the equation from California Culverts Practice, California Highways and Public Works, September 1942).
 - d. The antecedent storm conditions for the probable maximum precipitation were heavy rainfall and low temperatures which occurred on the previous 5 days (SCS AMC III). The antecedent storm conditions for the one percent probabilistic precipitation were an average of the conditions which have preceded the occurrence of the maximum annual flood on numerous watersheds (SCS AMC II). Using the antecedent flood conditions, the initial pool elevation was assumed at the invert of the principal spillway (twin 18" CMP culverts).
 - e. The total twenty-four hour storm duration losses for the one percent probabilistic storm were 2.88 inches. The total losses for the PMF storm were 1.58 inches. These data are based on SCS runoff curve No. 75 and No. 88 for antecedent moisture conditions SCS AMC II and AMC III respectively. The watershed is composed of primarily SCS soil groups B and C (Menfro and Winfield soils respectively). The drainage area is primarily in pasture with a few acres covered with hard surface roads.
 - f. Average soil loss rates = 0.06 inch per hour approximately (For PMF storm, AMC III).
2. The combined discharge rating consisted of three components: the flow through the principal spillway, the flow through the emergency spillway and the flow going over the top of the dam.
 - a. The principal spillway rating was developed by using culvert flow tables for CMP culverts with inlet control and outlet control as found in FHA-BRP HEC Circ. No. 5. It was assumed that no appreciable debris would develop to hinder flow through the principal spillway.

- b. The emergency spillway rating was developed by computing flow over highway embankments with methods and coefficients found in USGS TWRI, Bk. 3, Ch. A5 "Measurement of Peak Discharge at Dams by Indirect Methods". Weir coefficients varied with head and ranged from 2.97 to 3.06.
 - c. The flows over the dam were determined by using the dam overtopping analyses (irregular top of dam) within the HEC-1 (Dam Safety Version) program.
3. Floods were routed through the reservoir using the HEC-1 (Dam Safety Version) program to determine the capabilities of the spillway and dam embankment crest. The input, output and plotted hydrographs are attached in this Section.

583

PURINA LAKE DAM
NO. 10 NO. 31497
PRINCIPAL SPILLWAY
RATING CURVE

ELEVATION IN FEET, MSL.

582

581

580

579

578

577

576

575

574

573

572

571

0

0

Outlet Control

Inlet Control

Minimum Top of Dam - El. 579.7
Minimum Top of Road Over
Culverts - El. 573.2

DISCHARGE IN CFS (ONE - 18" ϕ CMP)
DISCHARGE IN CFS (TWIN - 18" ϕ CMP)

21

24

27

30

33

36


39

42

45

PLATE D-3

PURINA LAKE DAM
NO. 10 NO. 31497
EMERGENCY
SPILLWAY RATING
CURVE

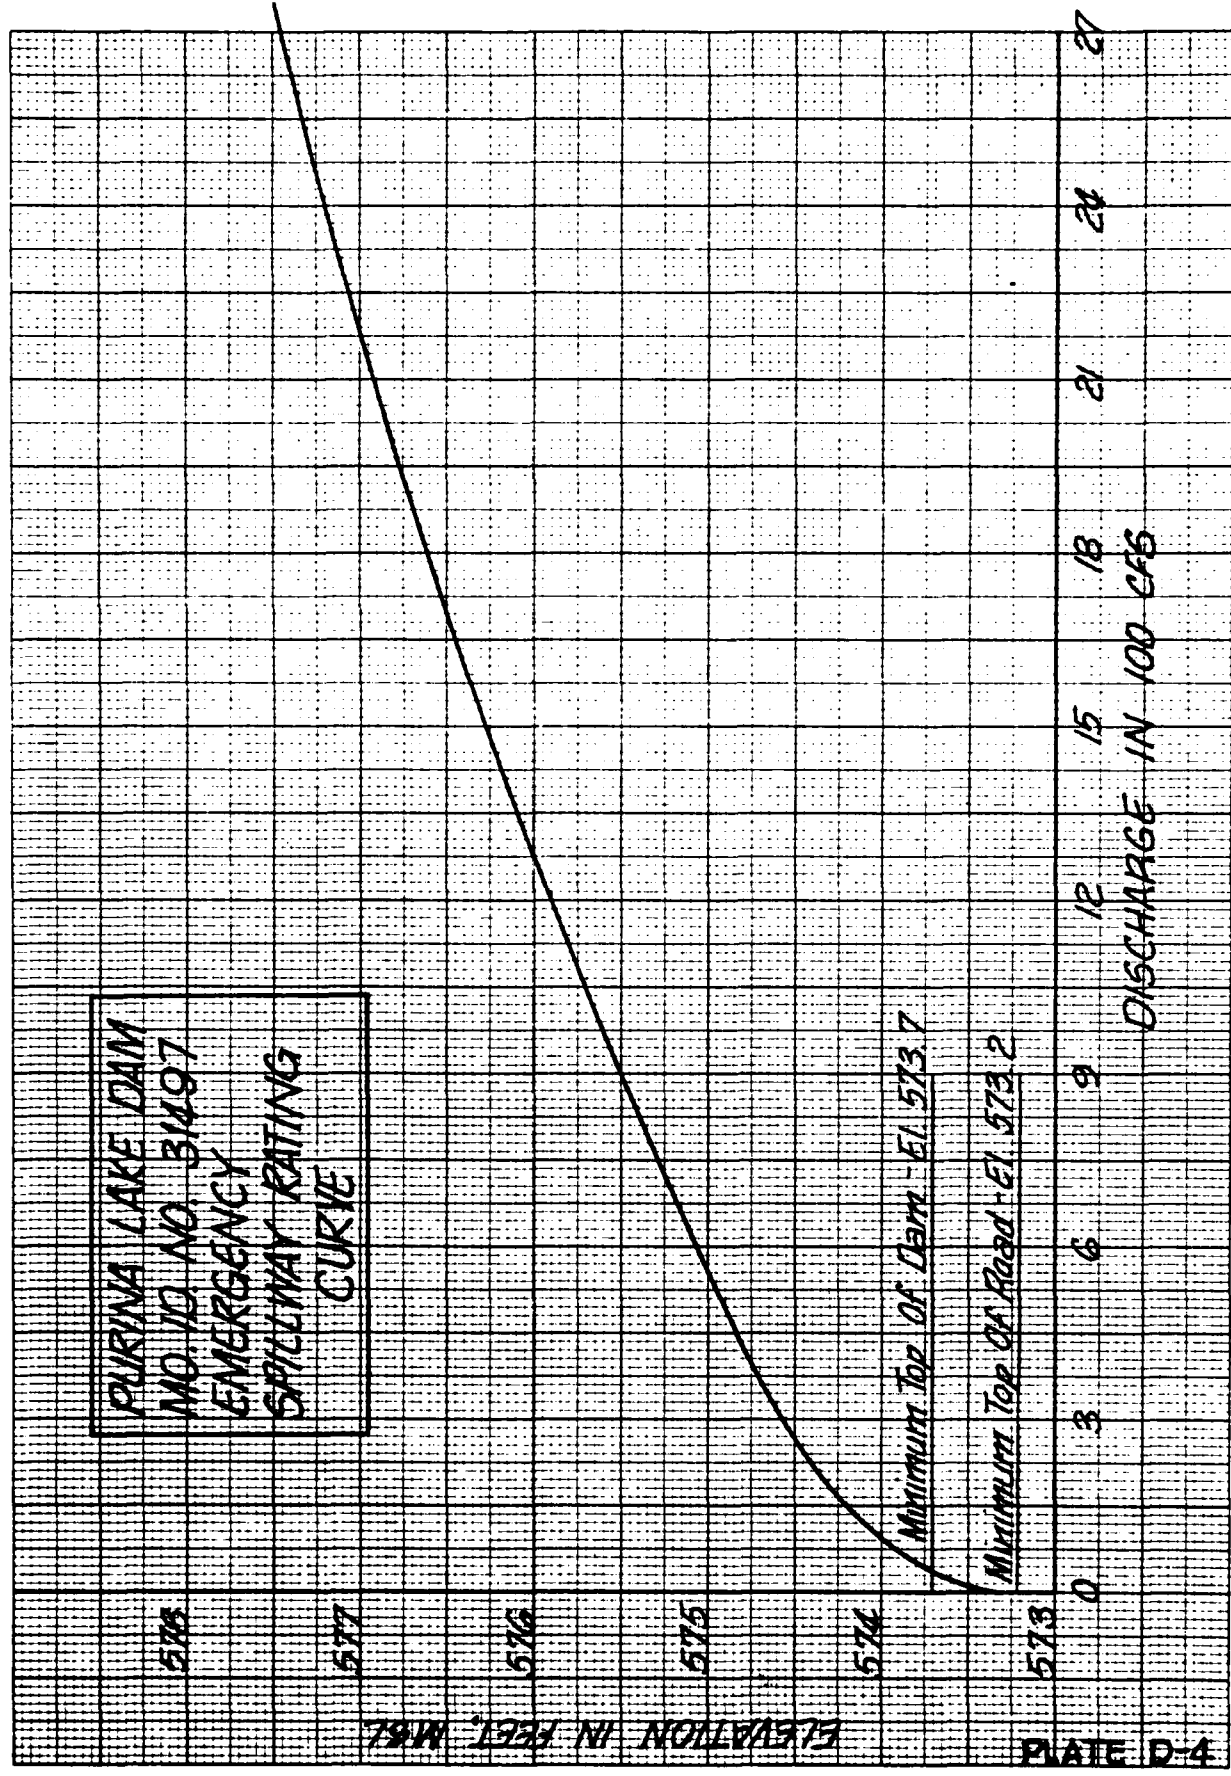


Minimum Top of Dam - El. 573.7

Minimum Top of Road - El. 573.2

ELEVATION IN FEET, MSL

DISCHARGE IN 100 CFS

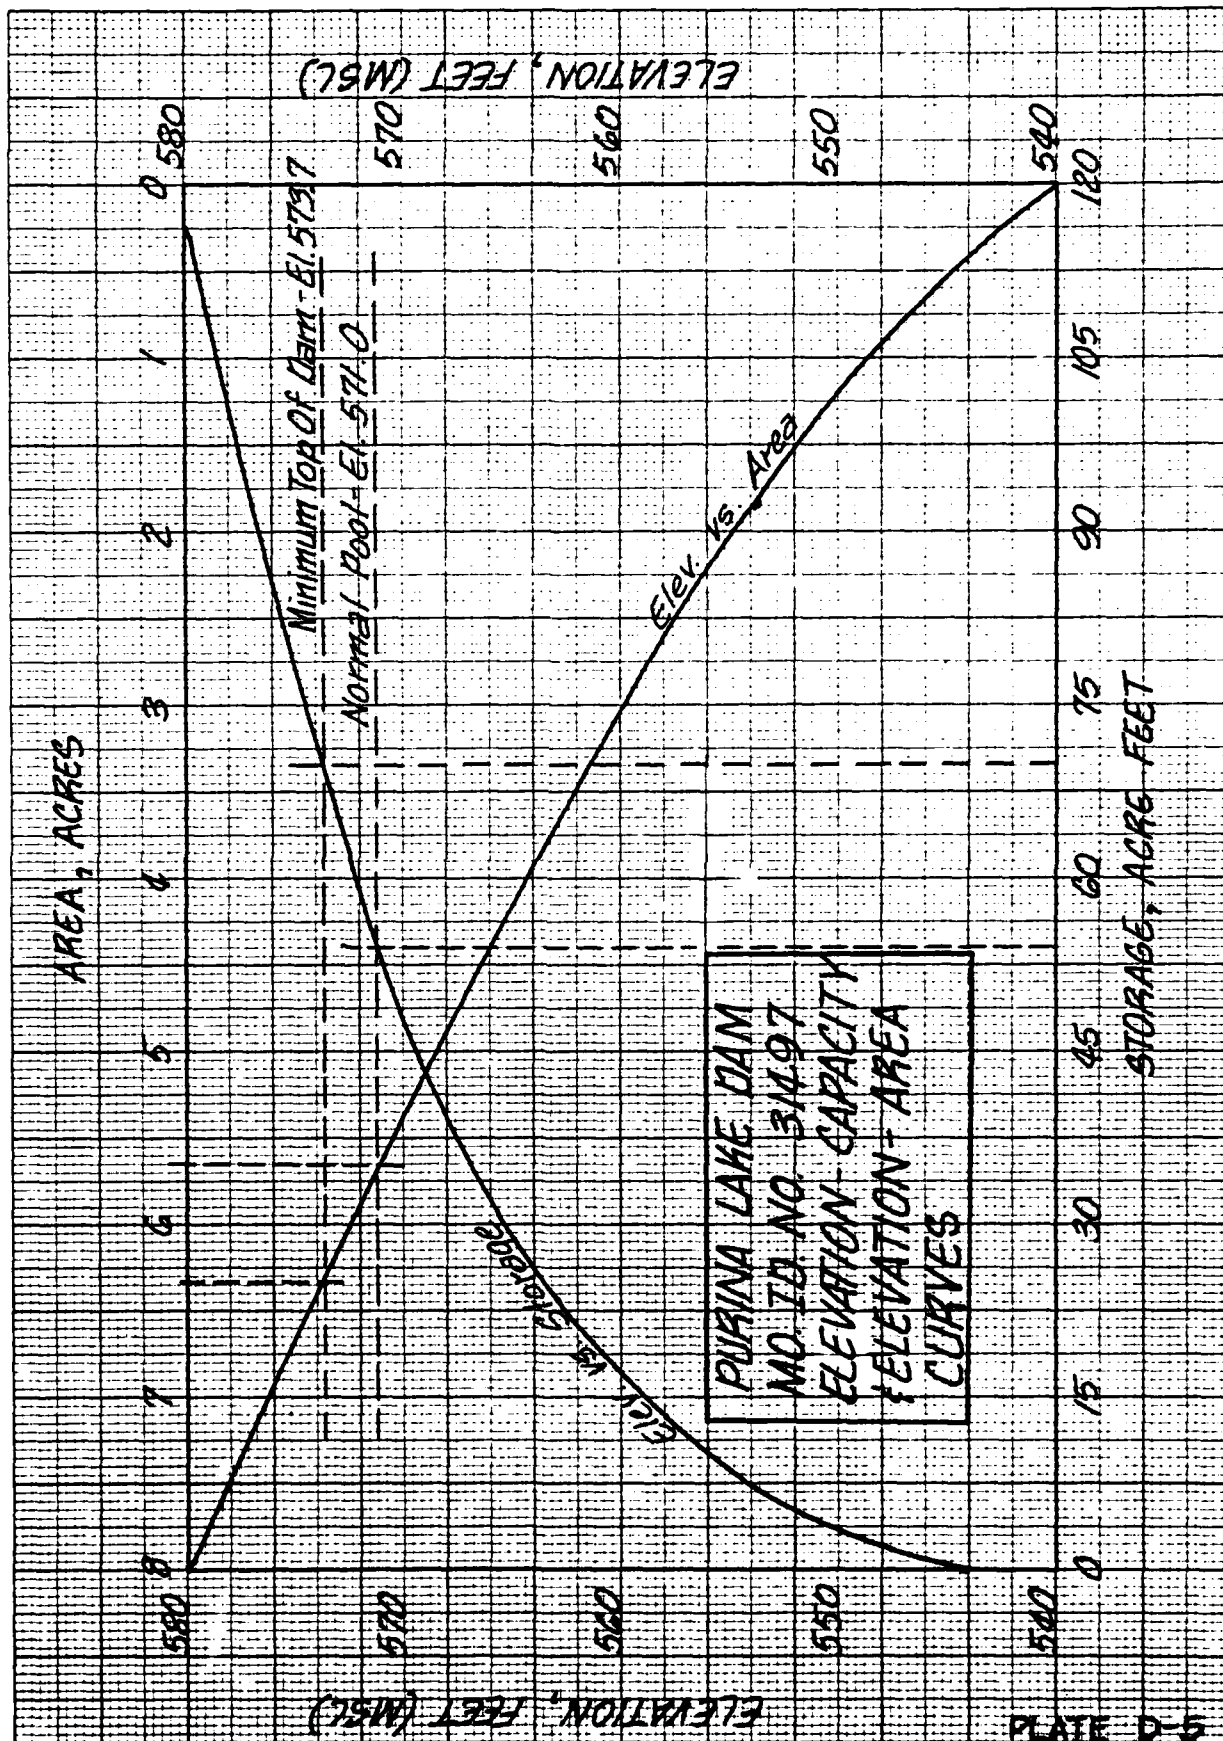

 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79

RUN DATE# 80/10/22.
 TIME# 13.35.12.

ANALYSIS OF DAM OVERTOPPING USING RATIOS OF PMF
 H & H ANALYSIS OF SAFETY OF PURINA LAKE 31497
 RATIOS OF PMF ROUTED THROUGH THE RESERVOIR

JOB SPECIFICATION									
NQ	NHR	NMIN	IDAY	IHR	IMIN	METRC	IPLI	IPRT	NSTAN
266	0	5	0	0	0	0	0	3	0
		JOPER	NWT	LROPT	TRACE				
		5	0	0	0				

MULTI-PLAN ANALYSES TO BE PERFORMED

RTIOS= .20 .21 .22 .23 .24 .25 .50 1.00
 NPLAN= 1 NRTIO= 8 LRTIO= 1

SUB-AREA RUNOFF COMPUTATION

CALCULATION OF INFLOW HYDROGRAPH TO RESERVOIR 31497

ISTAQ	ICOMP	IECON	ITAPE	JPLT	JPRT	INAME	ISTAGE	IAUTO
000001	0	0	0	0	0	1	0	0

HYDROGRAPH DATA

IHYOG	IUNG	TAREA	SNAP	TRSDA	TRSPC	RATIO	ISNOW	ISAME	LOCAL
1	2	.07	0.00	.07	1.00	0.000	0	1	0

PRECIP DATA

SPEE	PMS	R6	R12	R24	R48	R72	R96
0.00	25.50	102.00	121.00	130.00	0.00	0.00	0.00

LOSS DATA

LROPT	STRKR	DLTKR	RTIOL	ERAIN	STRKS	RTIOK	STRTL	CNSTL	ALSMX	RTIMP
0	0.00	0.00	1.00	0.00	0.00	1.00	-1.00	-88.00	0.00	0.00

CURVE NO = -88.00 WEINSS = -1.00 EFFECT CN = 88.00

UNIT HYDROGRAPH DATA

TC= .17 LAG= .10

RECESSION DATA
 SRTIO= 0.00 GRCSN= -.01 RTIOR= 1.00

TIME INCREMENT TOO LARGE--(NMQ IS GT LAG/2)

UNIT HYDROGRAPH 8 END OF PERIOD ORDINATES. TC= .17 HOURS, LAG= .10 VOL= 1.00
 145. 223. 101. 40. 15. 6. 2. 1.

MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	END-OF-PERIOD FLOW COMP Q	MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	COMP Q
1.01	.05	1	.01	0.00	.01	0.	1.01	12.05	145	.22	.21	.01	55.
1.01	.10	2	.01	0.00	.01	0.	1.01	12.10	146	.22	.21	.01	88.
1.01	.15	3	.01	0.00	.01	0.	1.01	12.15	147	.22	.21	.01	102.
1.01	.20	4	.01	0.00	.01	0.	1.01	12.20	148	.22	.21	.01	108.
1.01	.25	5	.01	0.00	.01	0.	1.01	12.25	149	.22	.21	.01	111.
1.01	.30	6	.01	0.00	.01	0.	1.01	12.30	150	.22	.21	.01	112.
1.01	.35	7	.01	0.00	.01	0.	1.01	12.35	151	.22	.21	.01	112.
1.01	.40	8	.01	0.00	.01	0.	1.01	12.40	152	.22	.21	.01	113.
1.01	.45	9	.01	0.00	.01	0.	1.01	12.45	153	.22	.21	.01	113.
1.01	.50	10	.01	0.00	.01	0.	1.01	12.50	154	.22	.21	.01	113.
1.01	.55	11	.01	0.00	.01	0.	1.01	12.55	155	.22	.21	.01	113.
1.01	1.00	12	.01	0.00	.01	0.	1.01	13.00	156	.22	.21	.01	113.
1.01	1.05	13	.01	0.00	.01	0.	1.01	13.05	157	.26	.25	.01	119.
1.01	1.10	14	.01	0.00	.01	0.	1.01	13.10	158	.26	.26	.00	129.
1.01	1.15	15	.01	0.00	.01	0.	1.01	13.15	159	.26	.26	.00	133.
1.01	1.20	16	.01	0.00	.01	0.	1.01	13.20	160	.26	.26	.00	135.
1.01	1.25	17	.01	0.00	.01	0.	1.01	13.25	161	.26	.26	.00	136.
1.01	1.30	18	.01	0.00	.01	0.	1.01	13.30	162	.26	.26	.00	136.
1.01	1.35	19	.01	0.00	.01	0.	1.01	13.35	163	.26	.26	.00	137.
1.01	1.40	20	.01	0.00	.01	0.	1.01	13.40	164	.26	.26	.00	137.
1.01	1.45	21	.01	0.00	.01	0.	1.01	13.45	165	.26	.26	.00	137.
1.01	1.50	22	.01	0.00	.01	0.	1.01	13.50	166	.26	.26	.00	137.
1.01	1.55	23	.01	0.00	.01	0.	1.01	13.55	167	.26	.26	.00	137.
1.01	2.00	24	.01	0.00	.01	0.	1.01	14.00	168	.26	.26	.00	137.
1.01	2.05	25	.01	0.00	.01	0.	1.01	14.05	169	.33	.32	.00	147.
1.01	2.10	26	.01	0.00	.01	0.	1.01	14.10	170	.33	.32	.00	161.
1.01	2.15	27	.01	0.00	.01	0.	1.01	14.15	171	.33	.32	.00	168.
1.01	2.20	28	.01	0.00	.01	1.	1.01	14.20	172	.33	.32	.00	170.
1.01	2.25	29	.01	0.00	.01	1.	1.01	14.25	173	.33	.32	.00	171.
1.01	2.30	30	.01	0.00	.01	1.	1.01	14.30	174	.33	.32	.00	172.
1.01	2.35	31	.01	0.00	.01	1.	1.01	14.35	175	.33	.32	.00	172.
1.01	2.40	32	.01	0.00	.01	1.	1.01	14.40	176	.33	.32	.00	172.
1.01	2.45	33	.01	0.00	.01	1.	1.01	14.45	177	.33	.32	.00	172.
1.01	2.50	34	.01	0.00	.01	1.	1.01	14.50	178	.33	.32	.00	172.
1.01	2.55	35	.01	0.00	.01	1.	1.01	14.55	179	.33	.32	.00	172.
1.01	3.00	36	.01	0.00	.01	1.	1.01	15.00	180	.33	.32	.00	172.
1.01	3.05	37	.01	0.00	.01	1.	1.01	15.05	181	.20	.20	.00	154.
1.01	3.10	38	.01	0.00	.01	2.	1.01	15.10	182	.40	.39	.00	154.
1.01	3.15	39	.01	0.00	.01	2.	1.01	15.15	183	.40	.39	.00	185.
1.01	3.20	40	.01	0.00	.01	2.	1.01	15.20	184	.59	.59	.00	229.
1.01	3.25	41	.01	0.00	.01	2.	1.01	15.25	185	.69	.69	.00	293.
1.01	3.30	42	.01	0.00	.01	2.	1.01	15.30	186	1.68	1.67	.01	480.
1.01	3.35	43	.01	0.00	.01	2.	1.01	15.35	187	2.77	2.76	.01	876.
1.01	3.40	44	.01	0.00	.01	2.	1.01	15.40	188	1.09	1.08	.00	981.
1.01	3.45	45	.01	0.00	.01	2.	1.01	15.45	189	.69	.69	.00	703.
1.01	3.50	46	.01	0.00	.01	2.	1.01	15.50	190	.59	.59	.00	491.
1.01	3.55	47	.01	0.00	.01	2.	1.01	15.55	191	.40	.39	.00	357.
1.01	4.00	48	.01	0.00	.01	2.	1.01	16.00	192	.40	.39	.00	270.
1.01	4.05	49	.01	0.00	.01	2.	1.01	16.05	193	.30	.30	.00	221.
1.01	4.10	50	.01	0.00	.01	2.	1.01	16.10	194	.30	.30	.00	185.
1.01	4.15	51	.01	0.00	.01	3.	1.01	16.15	195	.30	.30	.00	170.
1.01	4.20	52	.01	0.00	.01	3.	1.01	16.20	196	.30	.30	.00	165.
1.01	4.25	53	.01	0.01	.01	3.	1.01	16.25	197	.30	.30	.00	163.
1.01	4.30	54	.01	0.01	.01	3.	1.01	16.30	198	.30	.30	.00	162.
1.01	4.35	55	.01	0.01	.01	3.	1.01	16.35	199	.30	.30	.00	162.
1.01	4.40	56	.01	0.01	.01	3.	1.01	16.40	200	.30	.30	.00	162.
1.01	4.45	57	.01	0.01	.01	3.	1.01	16.45	201	.30	.30	.00	162.
1.01	4.50	58	.01	0.01	.01	3.	1.01	16.50	202	.30	.30	.00	162.
1.01	4.55	59	.01	0.01	.01	3.	1.01	16.55	203	.30	.30	.00	162.

1.01	5.00	60	.01	.01	.01	.01	3.	1.01	17.00	204	.50	.30	.00	162.
1.01	5.05	61	.01	.01	.01	.01	3.	1.01	17.05	205	.24	.24	.00	152.
1.01	5.10	62	.01	.01	.01	.01	3.	1.01	17.10	206	.24	.24	.00	138.
1.01	5.15	63	.01	.01	.01	.01	3.	1.01	17.15	207	.24	.24	.00	131.
1.01	5.20	64	.01	.01	.01	.01	3.	1.01	17.20	208	.24	.24	.00	129.
1.01	5.25	65	.01	.01	.01	.01	3.	1.01	17.25	209	.24	.24	.00	128.
1.01	5.30	66	.01	.01	.01	.01	3.	1.01	17.30	210	.24	.24	.00	127.
1.01	5.35	67	.01	.01	.01	.01	3.	1.01	17.35	211	.24	.24	.00	127.
1.01	5.40	68	.01	.01	.01	.01	3.	1.01	17.40	212	.24	.24	.00	127.
1.01	5.45	69	.01	.01	.01	.01	3.	1.01	17.45	213	.24	.24	.00	127.
1.01	5.50	70	.01	.01	.01	.01	4.	1.01	17.50	214	.24	.24	.00	127.
1.01	5.55	71	.01	.01	.01	.01	4.	1.01	17.55	215	.24	.24	.00	127.
1.01	6.00	72	.01	.01	.01	.01	4.	1.01	18.00	216	.24	.24	.00	127.
1.01	6.05	73	.07	.04	.03	.03	8.	1.01	18.05	217	.02	.02	.00	95.
1.01	6.10	74	.07	.04	.03	.03	15.	1.01	18.10	218	.02	.02	.00	46.
1.01	6.15	75	.07	.04	.03	.03	19.	1.01	18.15	219	.02	.02	.00	24.
1.01	6.20	76	.07	.04	.02	.02	21.	1.01	18.20	220	.02	.02	.00	16.
1.01	6.25	77	.07	.04	.02	.02	22.	1.01	18.25	221	.02	.02	.00	12.
1.01	6.30	78	.07	.05	.02	.02	23.	1.01	18.30	222	.02	.02	.00	11.
1.01	6.35	79	.07	.05	.02	.02	24.	1.01	18.35	223	.02	.02	.00	10.
1.01	6.40	80	.07	.05	.02	.02	25.	1.01	18.40	224	.02	.02	.00	10.
1.01	6.45	81	.07	.05	.02	.02	25.	1.01	18.45	225	.02	.02	.00	10.
1.01	6.50	82	.07	.05	.02	.02	26.	1.01	18.50	226	.02	.02	.00	10.
1.01	6.55	83	.07	.05	.02	.02	26.	1.01	18.55	227	.02	.02	.00	10.
1.01	7.00	84	.07	.05	.02	.02	27.	1.01	19.00	228	.02	.02	.00	10.
1.01	7.05	85	.07	.05	.02	.02	27.	1.01	19.05	229	.02	.02	.00	10.
1.01	7.10	86	.07	.05	.01	.01	28.	1.01	19.10	230	.02	.02	.00	10.
1.01	7.15	87	.07	.05	.01	.01	28.	1.01	19.15	231	.02	.02	.00	10.
1.01	7.20	88	.07	.05	.01	.01	28.	1.01	19.20	232	.02	.02	.00	10.
1.01	7.25	89	.07	.05	.01	.01	29.	1.01	19.25	233	.02	.02	.00	10.
1.01	7.30	90	.07	.05	.01	.01	29.	1.01	19.30	234	.02	.02	.00	10.
1.01	7.35	91	.07	.06	.01	.01	29.	1.01	19.35	235	.02	.02	.00	10.
1.01	7.40	92	.07	.06	.01	.01	30.	1.01	19.40	236	.02	.02	.00	10.
1.01	7.45	93	.07	.06	.01	.01	30.	1.01	19.45	237	.02	.02	.00	10.
1.01	7.50	94	.07	.06	.01	.01	30.	1.01	19.50	238	.02	.02	.00	10.
1.01	7.55	95	.07	.06	.01	.01	30.	1.01	19.55	239	.02	.02	.00	10.
1.01	8.00	96	.07	.06	.01	.01	30.	1.01	20.00	240	.02	.02	.00	10.
1.01	8.05	97	.07	.06	.01	.01	31.	1.01	20.05	241	.02	.02	.00	10.
1.01	8.10	98	.07	.06	.01	.01	31.	1.01	20.10	242	.02	.02	.00	10.
1.01	8.15	99	.07	.06	.01	.01	31.	1.01	20.15	243	.02	.02	.00	10.
1.01	8.20	100	.07	.06	.01	.01	31.	1.01	20.20	244	.02	.02	.00	10.
1.01	8.25	101	.07	.06	.01	.01	31.	1.01	20.25	245	.02	.02	.00	10.
1.01	8.30	102	.07	.06	.01	.01	32.	1.01	20.30	246	.02	.02	.00	10.
1.01	8.35	103	.07	.06	.01	.01	32.	1.01	20.35	247	.02	.02	.00	10.
1.01	8.40	104	.07	.06	.01	.01	32.	1.01	20.40	248	.02	.02	.00	10.
1.01	8.45	105	.07	.06	.01	.01	32.	1.01	20.45	249	.02	.02	.00	10.
1.01	8.50	106	.07	.06	.01	.01	32.	1.01	20.50	250	.02	.02	.00	10.
1.01	8.55	107	.07	.06	.01	.01	32.	1.01	20.55	251	.02	.02	.00	10.
1.01	9.00	108	.07	.06	.01	.01	32.	1.01	21.00	252	.02	.02	.00	10.
1.01	9.05	109	.07	.06	.01	.01	32.	1.01	21.05	253	.02	.02	.00	10.
1.01	9.10	110	.07	.06	.01	.01	33.	1.01	21.10	254	.02	.02	.00	10.
1.01	9.15	111	.07	.06	.01	.01	33.	1.01	21.15	255	.02	.02	.00	10.
1.01	9.20	112	.07	.06	.01	.01	33.	1.01	21.20	256	.02	.02	.00	10.
1.01	9.25	113	.07	.06	.01	.01	33.	1.01	21.25	257	.02	.02	.00	10.
1.01	9.30	114	.07	.06	.01	.01	33.	1.01	21.30	258	.02	.02	.00	10.
1.01	9.35	115	.07	.06	.01	.01	33.	1.01	21.35	259	.02	.02	.00	10.
1.01	9.40	116	.07	.06	.01	.01	33.	1.01	21.40	260	.02	.02	.00	10.
1.01	9.45	117	.07	.06	.00	.00	33.	1.01	21.45	261	.02	.02	.00	10.
1.01	9.50	118	.07	.06	.00	.00	33.	1.01	21.50	262	.02	.02	.00	10.
1.01	9.55	119	.07	.06	.00	.00	33.	1.01	21.55	263	.02	.02	.00	10.
1.01	10.00	120	.07	.06	.00	.00	33.	1.01	22.00	264	.02	.02	.00	10.
1.01	10.05	121	.07	.06	.00	.00	33.	1.01	22.05	265	.02	.02	.00	10.

1.01	10.10	122	.07	.06	.00	34.	1.01	22.10	266	.02	.02	.00	10.
1.01	10.15	123	.07	.06	.00	34.	1.01	22.15	267	.02	.02	.00	10.
1.01	10.20	124	.07	.06	.00	34.	1.01	22.20	268	.02	.02	.00	10.
1.01	10.25	125	.07	.06	.00	34.	1.01	22.25	269	.02	.02	.00	10.
1.01	10.30	126	.07	.06	.00	34.	1.01	22.30	270	.02	.02	.00	10.
1.01	10.35	127	.07	.06	.00	34.	1.01	22.35	271	.02	.02	.00	10.
1.01	10.40	128	.07	.06	.00	34.	1.01	22.40	272	.02	.02	.00	10.
1.01	10.45	129	.07	.06	.00	34.	1.01	22.45	273	.02	.02	.00	10.
1.01	10.50	130	.07	.06	.00	34.	1.01	22.50	274	.02	.02	.00	10.
1.01	10.55	131	.07	.06	.00	34.	1.01	22.55	275	.02	.02	.00	10.
1.01	11.00	132	.07	.06	.00	34.	1.01	23.00	276	.02	.02	.00	10.
1.01	11.05	133	.07	.06	.00	34.	1.01	23.05	277	.02	.02	.00	10.
1.01	11.10	134	.07	.06	.00	34.	1.01	23.10	278	.02	.02	.00	10.
1.01	11.15	135	.07	.06	.00	34.	1.01	23.15	279	.02	.02	.00	10.
1.01	11.20	136	.07	.06	.00	34.	1.01	23.20	280	.02	.02	.00	10.
1.01	11.25	137	.07	.06	.00	34.	1.01	23.25	281	.02	.02	.00	10.
1.01	11.30	138	.07	.06	.00	34.	1.01	23.30	282	.02	.02	.00	10.
1.01	11.35	139	.07	.06	.00	34.	1.01	23.35	283	.02	.02	.00	10.
1.01	11.40	140	.07	.06	.00	34.	1.01	23.40	284	.02	.02	.00	10.
1.01	11.45	141	.07	.06	.00	34.	1.01	23.45	285	.02	.02	.00	10.
1.01	11.50	142	.07	.06	.00	34.	1.01	23.50	286	.02	.02	.00	10.
1.01	11.55	143	.07	.06	.00	34.	1.01	23.55	287	.02	.02	.00	10.
1.01	12.00	144	.07	.06	.00	34.	1.02	0.00	288	.02	.02	.00	10.

SUM 33.15 31.57 1.58 16829.
(842.)(802.)(40.)(476.54)

		PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	981.	190.	58.	58.	58.	16842.
CMS	28.	5.	2.	2.	2.	477.
INCHES		25.62	31.53	31.53	31.53	31.53
MM		650.73	800.99	800.99	800.99	800.99
AC-FT		94.	116.	116.	116.	116.
THOUS CU M		116.	143.	143.	143.	143.

HYDROGRAPH AT STA000001 FOR PLAN 1, RTIO 1

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	196.	38.	12.	12.	3568.
CMS	6.	1.	0.	0.	95.
INCHES		5.12	6.31	6.31	6.31
MM		130.15	160.20	160.20	160.20
AC-FT		19.	23.	23.	23.
THOUS CU M		23.	29.	29.	29.

HYDROGRAPH AT STA000001 FOR PLAN 1, RTIO 2

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	206.	40.	12.	12.	3537.
CMS	6.	1.	0.	0.	100.
INCHES		5.38	6.62	6.62	6.62
MM		136.65	168.21	168.21	168.21
AC-FT		20.	24.	24.	24.
THOUS CU M		24.	30.	30.	30.

HYDROGRAPH AT STA000001 FOR PLAN 1, RTIO 3

16842.
477.
51.53
800.99
116.
143.

HYDROGRAPH ROUTING

ROUTED FLOWS THROUGH RESERVOIR 31497

IAUTO
0

576.00
1311.00

12.
214.
590.

EXP 0.0

**DAMWID
650.**

577.5

STATION 000002, PLAN 1, RATIO 1

END-OF-PERIOD HYDROGRAPH ORDINATES

00000000

STATION 000002, PLAN 1, RATIO 5 0.24 PMF

0.24 PMF

END-OF-PERIOD HYDROGRAPH ORDINATES

[illegible][illegible]

OVF

STATION000002 [0.24 PMF]

	0.	40.	80.	120.	160.	200.	240.	0.	0.	0.	0.	0.	0.
.05 11	.	.	.	.	.	.	.	.	.	.	.	.	.
.10 21	.	.	.	.	.	.	.	.	.	.	.	.	.
.15 31	.	.	.	.	.	.	.	.	.	.	.	.	.
.20 41	.	.	.	.	.	.	.	.	.	.	.	.	.
.25 51	.	.	.	.	.	.	.	.	.	.	.	.	.
.30 61	.	.	.	.	.	.	.	.	.	.	.	.	.
.35 71	.	.	.	.	.	.	.	.	.	.	.	.	.
.40 81	.	.	.	.	.	.	.	.	.	.	.	.	.
.45 91	.	.	.	.	.	.	.	.	.	.	.	.	.
.50 101	.	.	.	.	.	.	.	.	.	.	.	.	.
.55 111	.	.	.	.	.	.	.	.	.	.	.	.	.
1.00 121	.	.	.	.	.	.	.	.	.	.	.	.	.
1.05 131	.	.	.	.	.	.	.	.	.	.	.	.	.
1.10 141	.	.	.	.	.	.	.	.	.	.	.	.	.
1.15 151	.	.	.	.	.	.	.	.	.	.	.	.	.
1.20 161	.	.	.	.	.	.	.	.	.	.	.	.	.
1.25 171	.	.	.	.	.	.	.	.	.	.	.	.	.
1.30 181	.	.	.	.	.	.	.	.	.	.	.	.	.
1.35 191	.	.	.	.	.	.	.	.	.	.	.	.	.
1.40 201	.	.	.	.	.	.	.	.	.	.	.	.	.
1.45 211	.	.	.	.	.	.	.	.	.	.	.	.	.
1.50 221	.	.	.	.	.	.	.	.	.	.	.	.	.
1.55 231	.	.	.	.	.	.	.	.	.	.	.	.	.
2.00 241	.	.	.	.	.	.	.	.	.	.	.	.	.
2.05 251	.	.	.	.	.	.	.	.	.	.	.	.	.
2.10 261	.	.	.	.	.	.	.	.	.	.	.	.	.
2.15 271	.	.	.	.	.	.	.	.	.	.	.	.	.
2.20 281	.	.	.	.	.	.	.	.	.	.	.	.	.
2.25 291	.	.	.	.	.	.	.	.	.	.	.	.	.
2.30 301	.	.	.	.	.	.	.	.	.	.	.	.	.
2.35 311	.	.	.	.	.	.	.	.	.	.	.	.	.
2.40 321	.	.	.	.	.	.	.	.	.	.	.	.	.
2.45 331	.	.	.	.	.	.	.	.	.	.	.	.	.
2.50 341	.	.	.	.	.	.	.	.	.	.	.	.	.
2.55 351	.	.	.	.	.	.	.	.	.	.	.	.	.
3.00 361	.	.	.	.	.	.	.	.	.	.	.	.	.
3.05 371	.	.	.	.	.	.	.	.	.	.	.	.	.
3.10 381	.	.	.	.	.	.	.	.	.	.	.	.	.
3.15 391	.	.	.	.	.	.	.	.	.	.	.	.	.
3.20 401	.	.	.	.	.	.	.	.	.	.	.	.	.
3.25 411	.	.	.	.	.	.	.	.	.	.	.	.	.
3.30 421	.	.	.	.	.	.	.	.	.	.	.	.	.
3.35 431	.	.	.	.	.	.	.	.	.	.	.	.	.
3.40 441	.	.	.	.	.	.	.	.	.	.	.	.	.
3.45 451	.	.	.	.	.	.	.	.	.	.	.	.	.
3.50 461	.	.	.	.	.	.	.	.	.	.	.	.	.
3.55 471	.	.	.	.	.	.	.	.	.	.	.	.	.
4.00 481	.	.	.	.	.	.	.	.	.	.	.	.	.
4.05 491	.	.	.	.	.	.	.	.	.	.	.	.	.
4.10 501	.	.	.	.	.	.	.	.	.	.	.	.	.
4.15 511	.	.	.	.	.	.	.	.	.	.	.	.	.
4.20 521	.	.	.	.	.	.	.	.	.	.	.	.	.
4.25 531	.	.	.	.	.	.	.	.	.	.	.	.	.
4.30 541	.	.	.	.	.	.	.	.	.	.	.	.	.
4.35 551	.	.	.	.	.	.	.	.	.	.	.	.	.
4.40 561	.	.	.	.	.	.	.	.	.	.	.	.	.

4.45 571
4.50 581
4.55 591
5.00 601
5.05 611
5.10 621
5.15 631
5.20 641
5.25 651
5.30 661
5.35 671
5.40 681
5.45 691
5.50 701
5.55 711
6.00 721
6.05 731
6.10 7401
6.15 7501
6.20 7601
6.25 7701
6.30 7801
6.35 7901
6.40 8001
6.45 8101
6.50 8201
6.55 8301
7.00 8401
7.05 8501
7.10 8601
7.15 8701
7.20 8801
7.25 8901
7.30 9001
7.35 9101
7.40 9201
7.45 9301
7.50 9401
7.55 9501
8.00 9601
8.05 9701
8.10 9801
8.15 9901
8.201000.1
8.2510101
8.3010201
8.3510301
8.4010401
8.4510501
8.5010601
8.5510701
9.0010801
9.0510901
9.101100.1
9.15111.01
9.20112.01
9.25113.01
9.30114.01
9.35115.01
9.40116.01
9.45117.01
9.50118.01

PLATE D-15

9.55119.01
10.00120.01
10.05121.01
10.10122.01
10.15123.01
10.20124.01
10.25125.01
10.30126.01
10.35127.01
10.40128.01
10.45129.01
10.50130.01
10.55131.01
11.00132.01
11.05133.01
11.10134.01
11.15135.01
11.20136.01
11.25137.01
11.30138.01
11.35139.01
11.40140.01
11.45141.01
11.50142.01
11.55143.01
12.00144.01
12.05145.01
12.10146.01
12.15147.01
12.20148.01
12.25149.01
12.30150.01
12.35151.01
12.40152.01
12.45153.01
12.50154.01
12.55155.01
13.00156.01
13.05157.01
13.10158.01
13.15159.01
13.20160.01
13.25161.01
13.30162.01
13.35163.01
13.40164.01
13.45165.01
13.50166.01
13.55167.01
14.00168.01
14.05169.01
14.10170.01
14.15171.01
14.20172.01
14.25173.01
14.30174.01
14.35175.01
14.40176.01
14.45177.01
14.50178.01
14.55179.01
15.00180.01

PLATE D-17

This image shows a full page of dot grid paper. The grid consists of small, evenly spaced black dots arranged in horizontal and vertical rows across the entire page. There are no margins, text, or other markings present.

STATION 000002, PLAN 1, RATIO 7 0.5 PMF

END-OF-PERIOD HYDROGRAPH ORDINATES

[illegible]

•OVF•

STATION000002 0.5 RMF

INFLOW(I), OUTFLOW(O) AND OBSERVED FLOW(I*)

0.	100.	200.	300.	400.	500.	0.	0.	0.	0.	0.	0.
.05 11											
.10 21											
.15 31											
.20 41											
.25 51											
.30 61											
.35 71											
.40 81											
.45 91											
.50 101											
.55 111											
1.00 121											
1.05 131											
1.10 141											
1.15 151											
1.20 161											
1.25 171											
1.30 181											
1.35 191											
1.40 201											
1.45 211											
1.50 221											
1.55 231											
2.00 241											
2.05 251											
2.10 261											
2.15 271											
2.20 281											
2.25 291											
2.30 301											
2.35 311											
2.40 321											
2.45 331											
2.50 341											
2.55 351											
3.00 361											
3.05 371											
3.10 381											
3.15 391											
3.20 401											
3.25 411											
3.30 421											
3.35 431											
3.40 441											
3.45 451											
3.50 461											
3.55 471											
4.00 481											
4.05 491											
4.10 501											
4.15 511											
4.20 521											
4.25 531											
4.30 541											
4.35 551											
4.40 561											

4.45 571
4.50 581
4.55 591
5.00 601
5.05 611
5.10 621
5.15 631
5.20 641
5.25 651
5.30 661
5.35 671
5.40 681
5.45 691
5.50 701
5.55 711
6.00 721
6.05 731
6.10 741
6.15 751
6.20 761
6.25 771
6.30 781
6.35 791
6.40 801
6.45 811
6.50 821
6.55 831
7.00 841
7.05 851
7.10 861
7.15 871
7.20 881
7.25 891
7.30 901
7.35 911
7.40 921
7.45 931
7.50 941
7.55 951
8.00 961
8.05 971
8.10 981
8.15 991
8.20 1001
8.25 1011
8.30 1021
8.35 1031
8.40 1041
8.45 1051
8.50 1061
8.55 1071
8.60 1081
8.65 1091
8.70 1101
8.75 1111
8.80 1121
8.85 1131
8.90 1141
8.95 1151
9.00 1161
9.05 1171
9.10 1181
9.15 1191
9.20 1201
9.25 1211
9.30 1221
9.35 1231
9.40 1241
9.45 1251
9.50 1261
9.55 1271
9.60 1281
9.65 1291
9.70 1301
9.75 1311
9.80 1321
9.85 1331
9.90 1341
9.95 1351
10.00 1361
10.05 1371
10.10 1381
10.15 1391
10.20 1401
10.25 1411
10.30 1421
10.35 1431
10.40 1441
10.45 1451
10.50 1461
10.55 1471
10.60 1481
10.65 1491
10.70 1501
10.75 1511
10.80 1521
10.85 1531
10.90 1541
10.95 1551
11.00 1561
11.05 1571
11.10 1581
11.15 1591
11.20 1601
11.25 1611
11.30 1621
11.35 1631
11.40 1641
11.45 1651
11.50 1661
11.55 1671
11.60 1681
11.65 1691
11.70 1701
11.75 1711
11.80 1721
11.85 1731
11.90 1741
11.95 1751
12.00 1761
12.05 1771
12.10 1781
12.15 1791
12.20 1801
12.25 1811
12.30 1821
12.35 1831
12.40 1841
12.45 1851
12.50 1861
12.55 1871
12.60 1881
12.65 1891
12.70 1901
12.75 1911
12.80 1921
12.85 1931
12.90 1941
12.95 1951
13.00 1961
13.05 1971
13.10 1981
13.15 1991
13.20 2001
13.25 2011
13.30 2021
13.35 2031
13.40 2041
13.45 2051
13.50 2061
13.55 2071
13.60 2081
13.65 2091
13.70 2101
13.75 2111
13.80 2121
13.85 2131
13.90 2141
13.95 2151
14.00 2161
14.05 2171
14.10 2181
14.15 2191
14.20 2201
14.25 2211
14.30 2221
14.35 2231
14.40 2241
14.45 2251
14.50 2261
14.55 2271
14.60 2281
14.65 2291
14.70 2301
14.75 2311
14.80 2321
14.85 2331
14.90 2341
14.95 2351
15.00 2361
15.05 2371
15.10 2381
15.15 2391
15.20 2401
15.25 2411
15.30 2421
15.35 2431
15.40 2441
15.45 2451
15.50 2461
15.55 2471
15.60 2481
15.65 2491
15.70 2501
15.75 2511
15.80 2521
15.85 2531
15.90 2541
15.95 2551
16.00 2561
16.05 2571
16.10 2581
16.15 2591
16.20 2601
16.25 2611
16.30 2621
16.35 2631
16.40 2641
16.45 2651
16.50 2661
16.55 2671
16.60 2681
16.65 2691
16.70 2701
16.75 2711
16.80 2721
16.85 2731
16.90 2741
16.95 2751
17.00 2761
17.05 2771
17.10 2781
17.15 2791
17.20 2801
17.25 2811
17.30 2821
17.35 2831
17.40 2841
17.45 2851
17.50 2861
17.55 2871
17.60 2881
17.65 2891
17.70 2901
17.75 2911
17.80 2921
17.85 2931
17.90 2941
17.95 2951
18.00 2961
18.05 2971
18.10 2981
18.15 2991
18.20 3001
18.25 3011
18.30 3021
18.35 3031
18.40 3041
18.45 3051
18.50 3061
18.55 3071
18.60 3081
18.65 3091
18.70 3101
18.75 3111
18.80 3121
18.85 3131
18.90 3141
18.95 3151
19.00 3161
19.05 3171
19.10 3181
19.15 3191
19.20 3201
19.25 3211
19.30 3221
19.35 3231
19.40 3241
19.45 3251
19.50 3261
19.55 3271
19.60 3281
19.65 3291
19.70 3301
19.75 3311
19.80 3321
19.85 3331
19.90 3341
19.95 3351
20.00 3361
20.05 3371
20.10 3381
20.15 3391
20.20 3401
20.25 3411
20.30 3421
20.35 3431
20.40 3441
20.45 3451
20.50 3461
20.55 3471
20.60 3481
20.65 3491
20.70 3501
20.75 3511
20.80 3521
20.85 3531
20.90 3541
20.95 3551
21.00 3561
21.05 3571
21.10 3581
21.15 3591
21.20 3601
21.25 3611
21.30 3621
21.35 3631
21.40 3641
21.45 3651
21.50 3661
21.55 3671
21.60 3681
21.65 3691
21.70 3701
21.75 3711
21.80 3721
21.85 3731
21.90 3741
21.95 3751
22.00 3761
22.05 3771
22.10 3781
22.15 3791
22.20 3801
22.25 3811
22.30 3821
22.35 3831
22.40 3841
22.45 3851
22.50 3861
22.55 3871
22.60 3881
22.65 3891
22.70 3901
22.75 3911
22.80 3921
22.85 3931
22.90 3941
22.95 3951
23.00 3961
23.05 3971
23.10 3981
23.15 3991
23.20 4001
23.25 4011
23.30 4021
23.35 4031
23.40 4041
23.45 4051
23.50 4061
23.55 4071
23.60 4081
23.65 4091
23.70 4101
23.75 4111
23.80 4121
23.85 4131
23.90 4141
23.95 4151
24.00 4161
24.05 4171
24.10 4181
24.15 4191
24.20 4201
24.25 4211
24.30 4221
24.35 4231
24.40 4241
24.45 4251
24.50 4261
24.55 4271
24.60 4281
24.65 4291
24.70 4301
24.75 4311
24.80 4321
24.85 4331
24.90 4341
24.95 4351
25.00 4361
25.05 4371
25.10 4381
25.15 4391
25.20 4401
25.25 4411
25.30 4421
25.35 4431
25.40 4441
25.45 4451
25.50 4461
25.55 4471
25.60 4481
25.65 4491
25.70 4501
25.75 4511
25.80 4521
25.85 4531
25.90 4541
25.95 4551
26.00 4561
26.05 4571
26.10 4581
26.15 4591
26.20 4601
26.25 4611
26.30 4621
26.35 4631
26.40 4641
26.45 4651
26.50 4661
26.55 4671
26.60 4681
26.65 4691
26.70 4701
26.75 4711
26.80 4721
26.85 4731
26.90 4741
26.95 4751
27.00 4761
27.05 4771
27.10 4781
27.15 4791
27.20 4801
27.25 4811
27.30 4821
27.35 4831
27.40 4841
27.45 4851
27.50 4861
27.55 4871
27.60 4881
27.65 4891
27.70 4901
27.75 4911
27.80 4921
27.85 4931
27.90 4941
27.95 4951
28.00 4961
28.05 4971
28.10 4981
28.15 4991
28.20 5001
28.25 5011
28.30 5021
28.35 5031
28.40 5041
28.45 5051
28.50 5061
28.55 5071
28.60 5081
28.65 5091
28.70 5101
28.75 5111
28.80 5121
28.85 5131
28.90 5141
28.95 5151
29.00 5161
29.05 5171
29.10 5181
29.15 5191
29.20 5201
29.25 5211
29.30 5221
29.35 5231
29.40 5241
29.45 5251
29.50 5261
29.55 5271
29.60 5281
29.65 5291
29.70 5301
29.75 5311
29.80 5321
29.85 5331
29.90 5341
29.95 5351
30.00 5361
30.05 5371
30.10 5381
30.15 5391
30.20 5401
30.25 5411
30.30 5421
30.35 5431
30.40 5441
30.45 5451
30.50 5461
30.55 5471
30.60 5481
30.65 5491
30.70 5501
30.75 5511
30.80 5521
30.85 5531
30.90 5541
30.95 5551
31.00 5561
31.05 5571
31.10 5581
31.15 5591
31.20 5601
31.25 5611
31.30 5621
31.35 5631
31.40 5641
31.45 5651
31.50 5661
31.55 5671
31.60 5681
31.65 5691
31.70 5701
31.75 5711
31.80 5721
31.85 5731
31.90 5741
31.95 5751
32.00 5761
32.05 5771
32.10 5781
32.15 5791
32.20 5801
32.25 5811
32.30 5821
32.35 5831
32.40 5841
32.45 5851
32.50 5861
32.55 5871
32.60 5881
32.65 5891
32.70 5901
32.75 5911
32.80 5921
32.85 5931
32.90 5941
32.95 5951
33.00 5961
33.05 5971
33.10 5981
33.15 5991
33.20 6001
33.25 6011
33.30 6021
33.35 6031
33.40 6041
33.45 6051
33.50 6061
33.55 6071
33.60 6081
33.65 6091
33.70 6101
33.75 6111
33.80 6121
33.85 6131
33.90 6141
33.95 6151
34.00 6161
34.05 6171
34.10 6181
34.15 6191
34.20 6201
34.25 6211
34.30 6221
34.35 6231
34.40 6241
34.45 6251
34.50 6261
34.55 6271
34.60 6281
34.65 6291
34.70 6301
34.75 6311
34.80 6321
34.85 6331
34.90 6341
34.95 6351
35.00 6361
35.05 6371
35.10 6381
35.15 6391
35.20 6401
35.25 6411
35.30 6421
35.35 6431
35.40 6441
35.45 6451
35.50 6461
35.55 6471
35.60 6481
35.65 6491
35.70 6501
35.75 6511
35.80 6521
35.85 6531
35.90 6541
35.95 6551
36.00 6561
36.05 6571
36.10 6581
36.15 6591
36.20 6601
36.25 6611
36.30 6621
36.35 6631
36.40 6641
36.45 6651
36.50 6661
36.55 6671
36.60 6681
36.65 6691
36.70 6701
36.75 6711
36.80 6721
36.85 6731
36.90 6741
36.95 6751
37.00 6761
37.05 6771
37.10 6781
37.15 6791
37.20 6801
37.25 6811
37.30 6821
37.35 6831
37.40 6841
37.45 6851
37.50 6861
37.55 6871
37.60 6881
37.65 6891
37.70 6901
37.75 6911
37.80 6921
37.85 6931
37.90 6941
37.95 6951
38.00 6961
38.05 6971
38.10 6981
38.15 6991
38.20 7001
38.25 7011
38.30 7021
38.35 7031
38.40 7041
38.45 7051
38.50 7061
38.55 7071
38.60 7081
38.65 7091
38.70 7101
38.75 7111
38.80 7121
38.85 7131
38.90 7141
38.95 7151
39.00 7161
39.05 7171
39.10 7181
39.15 7191
39.20 7201
39.25 7211
39.30 7221
39.35 7231
39.40 7241
39.45 7251
39.50 7261
39.55 7271
39.60 7281
39.65 7291
39.70 7301
39.75 7311
39.80 7321
39.85 7331
39.90 7341
39.95 7351
40.00 7361
40.05 7371
40.10 7381
40.15 7391
40.20 7401
40.25 7411
40.30 7421
40.35 7431
40.40 7441
40.45 7451
40.50 7461
40.55 7471
40.60 7481
40.65 7491
40.70 7501
40.75 7511
40.80 7521
40.85 7531
40.90 7541
40.95 7551
41.00 7561
41.05 7571
41.10 7581
41.15 7591
41.20 7601
41.25 7611
41.30 7621
41.35 7631
41.40 7641
41.45 7651
41.50 7661
41.55 7671
41.60 7681
41.65 7691
41.70 7701
41.75 7711
41.80 7721
41.85 7731
41.90 7741
41.95 7751
42.00 7761
42.05 7771
42.10 7781
42.15 7791
42.20 7801
42.25 7811
42.30 7821
42.35 7831
42.40 7841
42.45 7851
42.50 7861
42.55 7871
42.60 7881
42.65 7891
42.70 7901
42.75 7911
42.80 7921
42.85 7931
42.90 7941
42.95 7951
43.00 7961
43.05 7971
43.10 7981
43.15 7991
43.20 8001
43.25 8011
43.30 8021
43.35 8031
43.40 8041
43.45 8051
43.50 8061
43.55 8071
43.60 8081
43.65 8091
43.70 8101
43.75 8111
43.80 8121
43.85 8131
43.90 8141
43.95 8151
44.00 8161
44.05 8171
44.10 8181
44.15 8191
44.20 8201
44.25 8211
44.30 8221
44.35 8231
44.40 8241
44.45 8251
44.50 8261
44.55 8271
44.60 8281
44.65 8291
44.70 8301
44.75 8311
44.80 8321
44.85 8331
44.90 8341
44.95 8351
45.00 8361
45.05 8371
45.10 8381
45.15 8391
45.20 8401
45.25 8411
45.30 8421
45.35 8431
45.40 8441
45.45 8451
45.50 8461
45.55 8471
45.60 8481
45.65 8491
45.70 8501
45.75 8511
45.80 8521
45.85 8531
45.90 8541
45.95 8551
46.00 8561
46.05 8571
46.10 8581
46.15 8591
46.20 8601
46.25 8611
46.30 8621
46.35 8631
46.40 8641
46.45 8651
46.50 8661
46.55 8671
46.60 8681
46.65 8691
46.70 8701
46.75 8711
46.80 8721
46.85 8731
46.90 8741
46.95 8751
47.00 8761
47.05 8771
47.10 8781
47.15 8791
47.20 8801
47.25 8811
47.30 8821
47.35 8831
47.40 8841
47.45 8851
47.50 8861
47.55 8871
47.60 8881
47.65 8891
47.70 8901
47.75 8911
47.80 8921
47.85 8931
47.90 8941
47.95 8951
48.00 8961
48.05 8971
48.10 8981
48.15 8991
48.20 9001
48.25 9011
48.30 9021
48.35 9031
48.40 9041
48.45 9051
48.50 9061
48.55 9071
48.60 9081
48.65 9091
48.70 9101
48.75 9111
48.80 9121
48.85 9131
48.90 9141
48.95 9151
49.00 9161
49.05 9171
49.10 9181
49.15 9191
49.20 9201
49.25 9211
49.30 9221
49.35 9231
49.40 9241
49.45 9251
49.50 9261
49.55 9271
49.60 9281
49.65 9291
49.70 9301
49.75 9311
49.80 9321
49.85 9331
49.90 9341
49.95 9351
50.00 9361
50.05 9371
50.10 9381
50.15 9391
50.20 9401
50.25 9411
50.30 9421
50.35 9431
50.40 9441
50.45 9451
50.50 9461
50.55 9471
50.60 9481
50.65 9491
50.70 9501
50.75 9511
50.80 9521
50.85 9531
50.90 9541
50.95 9551
51.00 9561
51.05 9571
51.10 9581
51.15 9591
51.20 9601
51.25 9611
51.30 9621
51.35 9631
51.40 9641
51.45 9651
51.50 9661
51.55 9671
51.60 9681
51.65 9691
51.70 9701
51.75 9711
51.80 9721
51.85 9731
51.90 9741
51.95 9751
52.00 9761
52.05 9771
52.10 9781
52.15 9791
52.20 9801
52.25 9811
52.30 9821
52.35 9831
52.40 9841
52.45 9851
52.50 9861
52.55 9871
52.60 9881
52.65 9891
52.70 9901
52.75 9911
52.80 9921
52.85 9931
52.90 9941
52.95 9951
53.00 9961
53.05 9971
53.10 9981
53.15 9991
53.20 10001
53.25 10011
53.30 10021
53.35 10031
53.40 10041
53.45 10051
53.50 10061
53.55 10071
53.60 10081
53.65 10091
53.70 10101
53.75 10111
53.80 10121
53.85 10131
53.90 10141
53.95 10151
54.00 10161
54.05 10171
54.10 10181
54.15 10191
54.20 10201
54.25 10211
54.30 10221
54.35 10231
54.40 10241
54.45 10251
54.50 10261
54.55 10271
54.60 10281
54.65 10291
54.70 10301
54.75 10311
54.80 10321
54.85 10331
54.90 10341
54.95 10351
55.00 10361
55.05 10371
55.10 10381
55.15 10391
55.20 10401
55.25 10411
55.30 10421
55.35 10431
55.40 10441
55.45 10451
55.50 10461
55.55 10471
55.60 10481
55.65 10491
55.70 10501
55.75 10511
55.80 10521
55.85 10531
55.90 10541
55.95 10551
56.00 10561
56.05 10571
56.10 10581
56.15 10591
56.20 10601
56.25 10611
56.30 10621
56.35 10631
56.40 10641
56.45 10651
56.50 10661
56.55 10671
56.60 10681
56.65 10691
56.70 10701
56.75 10711
56.80 10721
56.85 10731
56.90 10741
56.95 10751
57.00 10761
57.05 10771
57.10 10781
57.15 10791
57.20 10801
57.25 10811
57.30 10821
57.35 10831
57.40 10841
57.45 10851
57.50 10861
57.55 10871
57.60 10881
57.65

9.551190.1
10.00120.01
10.05121.01
10.10122.01
10.15123.01
10.20124.01
10.25125.01
10.30126.01
10.35127.01
10.40128.01
10.45129.01
10.50130.01
10.55131.01
11.00132.01
11.05133.01
11.10134.01
11.15135.01
11.20136.01
11.25137.01
11.30138.01
11.35139.01
11.40140.01
11.45141.01
11.50142.01
11.55143.01
12.00144.01
12.05145.01
12.10146.01
12.15147.01
12.20148.01
12.25149.01
12.30150.01
12.35151.01
12.40152.01
12.45153.01
12.50154.01
12.55155.01
13.00156.01
13.05157.01
13.10158.01
13.15159.01
13.20160.01
13.25161.01
13.30162.01
13.35163.01
13.40164.01
13.45165.01
13.50166.01
13.55167.01
14.00168.01
14.05169.01
14.10170.01
14.15171.01
14.20172.01
14.25173.01
14.30174.01
14.35175.01
14.40176.01
14.45177.01
14.50178.01
14.55179.01
15.00180.01

PLATE D-23

20.15293.10
20.20294.10
20.25295.10
20.30296.10
20.35297.10
20.40298.10
20.45299.10
20.50290.10
20.55251.10
21.00232.10
21.05253.10
21.10254.10
21.15255.10
21.20256.10
21.25257.10
21.30258.10
21.35259.10
21.40260.10
21.45261.10
21.50262.10
21.55263.10
22.00269.10
22.05265.10
22.10266.10
22.15267.10
22.20268.10
22.25269.10
22.30270.10
22.35271.10
22.40272.10
22.45273.10
22.50274.10
22.55275.10
23.00276.10
23.05277.10
23.10278.10
23.15279.10
23.20280.10
23.25281.1
23.30282.1
23.35283.1
23.40284.1
23.45285.1
23.50286.1
23.55287.1
0.00288.1

STATION 000002, PLAN 1, RATIO 8 PMF

END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW									
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
1.	1.	1.	1.	1.	1.	1.	1.	1.	1.
1.	1.	1.	1.	1.	1.	1.	1.	1.	1.
2.	2.	3.	3.	3.	3.	3.	3.	3.	3.
4.	4.	5.	5.	5.	5.	5.	5.	5.	5.
6.	6.	7.	7.	7.	7.	7.	7.	7.	7.
9.	9.	10.	10.	10.	10.	10.	10.	10.	10.
12.	12.	13.	13.	13.	13.	13.	13.	13.	13.
14.	14.	15.	15.	15.	15.	15.	15.	15.	15.
17.	17.	17.	17.	17.	17.	17.	17.	17.	17.
24.	24.	32.	32.	32.	32.	32.	32.	32.	32.
125.	125.	131.	131.	131.	131.	131.	131.	131.	131.
151.	151.	159.	159.	159.	159.	159.	159.	159.	159.
168.	168.	165.	165.	165.	165.	165.	165.	165.	165.
440.	440.	270.	270.	270.	270.	270.	270.	270.	270.
162.	162.	162.	162.	162.	162.	162.	162.	162.	162.
131.	131.	129.	129.	129.	129.	129.	129.	129.	129.
56.	56.	48.	48.	48.	48.	48.	48.	48.	48.
20.	20.	20.	20.	20.	20.	20.	20.	20.	20.
20.	20.	19.	19.	19.	19.	19.	19.	19.	19.
19.	19.	19.	19.	19.	19.	19.	19.	19.	19.
19.	19.	19.	19.	19.	19.	19.	19.	19.	19.
18.	18.	18.	18.	18.	18.	18.	18.	18.	18.
18.	18.	18.	18.	18.	18.	18.	18.	18.	18.

STORAGE

54.	54.	54.	54.	54.	54.	54.	54.	54.	54.
54.	54.	54.	54.	54.	54.	54.	54.	54.	54.
54.	54.	54.	54.	54.	54.	54.	54.	54.	54.
54.	54.	54.	54.	54.	54.	54.	54.	54.	54.
55.	55.	55.	55.	55.	55.	55.	55.	55.	55.
55.	55.	55.	55.	55.	55.	55.	55.	55.	55.
55.	55.	55.	55.	55.	55.	55.	55.	55.	55.
56.	56.	56.	56.	56.	56.	56.	56.	56.	56.
58.	58.	58.	58.	58.	58.	58.	58.	58.	58.
59.	59.	60.	60.	60.	60.	60.	60.	60.	60.
61.	61.	61.	61.	61.	61.	61.	61.	61.	61.
63.	63.	63.	63.	63.	63.	63.	63.	63.	63.
64.	64.	64.	64.	64.	64.	64.	64.	64.	64.
65.	65.	65.	65.	65.	65.	65.	65.	65.	65.
66.	66.	66.	66.	66.	66.	66.	66.	66.	66.
69.	69.	70.	70.	70.	70.	70.	70.	70.	70.
72.	72.	72.	72.	72.	72.	72.	72.	72.	72.
72.	72.	72.	72.	72.	72.	72.	72.	72.	72.
72.	72.	72.	72.	72.	72.	72.	72.	72.	72.
74.	74.	74.	74.	74.	74.	74.	74.	74.	74.
72.	72.	72.	72.	72.	72.	72.	72.	72.	72.
70.	70.	70.	70.	70.	70.	70.	70.	70.	70.
69.	69.	69.	69.	69.	69.	69.	69.	69.	69.

[illegible]

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	932.	103.	53.	53.	15204.
CMS	26.	5.	1.	1.	431.
INCHES		24.64	28.47	28.47	28.47
MM		625.61	723.08	723.08	723.08
AC-FT		91.	105.	105.	105.
THOUS CU YD		112.	129.	129.	129.

OVF

STATION000002 PMF

	0.	200.	400.	500.	800.	1000.	0.	0.	0.	0.	0.	0.
.05 11	.	.	.	.	.	.	.	.	.	.	.	.
.10 21	.	.	.	.	.	.	.	.	.	.	.	.
.15 31	.	.	.	.	.	.	.	.	.	.	.	.
.20 41	.	.	.	.	.	.	.	.	.	.	.	.
.25 51	.	.	.	.	.	.	.	.	.	.	.	.
.30 61	.	.	.	.	.	.	.	.	.	.	.	.
.35 71	.	.	.	.	.	.	.	.	.	.	.	.
.40 81	.	.	.	.	.	.	.	.	.	.	.	.
.45 91	.	.	.	.	.	.	.	.	.	.	.	.
.50 101	.	.	.	.	.	.	.	.	.	.	.	.
.55 111	.	.	.	.	.	.	.	.	.	.	.	.
1.00 121	.	.	.	.	.	.	.	.	.	.	.	.
1.05 131	.	.	.	.	.	.	.	.	.	.	.	.
1.10 141	.	.	.	.	.	.	.	.	.	.	.	.
1.15 151	.	.	.	.	.	.	.	.	.	.	.	.
1.20 161	.	.	.	.	.	.	.	.	.	.	.	.
1.25 171	.	.	.	.	.	.	.	.	.	.	.	.
1.30 181	.	.	.	.	.	.	.	.	.	.	.	.
1.35 191	.	.	.	.	.	.	.	.	.	.	.	.
1.40 201	.	.	.	.	.	.	.	.	.	.	.	.
1.45 211	.	.	.	.	.	.	.	.	.	.	.	.
1.50 221	.	.	.	.	.	.	.	.	.	.	.	.
1.55 231	.	.	.	.	.	.	.	.	.	.	.	.
2.00 241	.	.	.	.	.	.	.	.	.	.	.	.
2.05 251	.	.	.	.	.	.	.	.	.	.	.	.
2.10 261	.	.	.	.	.	.	.	.	.	.	.	.
2.15 271	.	.	.	.	.	.	.	.	.	.	.	.
2.20 281	.	.	.	.	.	.	.	.	.	.	.	.
2.25 291	.	.	.	.	.	.	.	.	.	.	.	.
2.30 301	.	.	.	.	.	.	.	.	.	.	.	.
2.35 311	.	.	.	.	.	.	.	.	.	.	.	.
2.40 321	.	.	.	.	.	.	.	.	.	.	.	.
2.45 331	.	.	.	.	.	.	.	.	.	.	.	.
2.50 341	.	.	.	.	.	.	.	.	.	.	.	.
2.55 351	.	.	.	.	.	.	.	.	.	.	.	.
3.00 361	.	.	.	.	.	.	.	.	.	.	.	.
3.05 371	.	.	.	.	.	.	.	.	.	.	.	.
3.10 381	.	.	.	.	.	.	.	.	.	.	.	.
3.15 391	.	.	.	.	.	.	.	.	.	.	.	.
3.20 401	.	.	.	.	.	.	.	.	.	.	.	.
3.25 411	.	.	.	.	.	.	.	.	.	.	.	.
3.30 421	.	.	.	.	.	.	.	.	.	.	.	.
3.35 431	.	.	.	.	.	.	.	.	.	.	.	.
3.40 441	.	.	.	.	.	.	.	.	.	.	.	.
3.45 451	.	.	.	.	.	.	.	.	.	.	.	.
3.50 461	.	.	.	.	.	.	.	.	.	.	.	.
3.55 471	.	.	.	.	.	.	.	.	.	.	.	.
4.00 481	.	.	.	.	.	.	.	.	.	.	.	.
4.05 491	.	.	.	.	.	.	.	.	.	.	.	.
4.10 501	.	.	.	.	.	.	.	.	.	.	.	.
4.15 511	.	.	.	.	.	.	.	.	.	.	.	.
4.20 521	.	.	.	.	.	.	.	.	.	.	.	.
4.25 531	.	.	.	.	.	.	.	.	.	.	.	.
4.30 541	.	.	.	.	.	.	.	.	.	.	.	.
4.35 551	.	.	.	.	.	.	.	.	.	.	.	.
4.40 561	.	.	.	.	.	.	.	.	.	.	.	.

4.45 571
4.50 581
4.55 591
5.00 601
5.05 611
5.10 621
5.15 631
5.20 641
5.25 651
5.30 661
5.35 671
5.40 681
5.45 691
5.50 701
5.55 711
6.00 721
6.05 731
6.10 7401
6.15 7501
6.20 7601
6.25 7701
6.30 7801
6.35 7901
6.40 8001
6.45 8101
6.50 8201
6.55 8301
7.00 8401
7.05 8501
7.10 8601
7.15 8701
7.20 8801
7.25 8901
7.30 9001
7.35 9101
7.40 9201
7.45 9301
7.50 9401
7.55 9501
8.00 9601
8.05 9701
8.10 9801
8.15 9901
8.20 10001
8.25 10101
8.30 10201
8.35 10301
8.40 10401
8.45 10501
8.50 10601
8.55 10701
9.00 10801
9.05 10901
9.10 11001
9.15 11101
9.20 11201
9.25 11301
9.30 11401
9.35 11501
9.40 11601
9.45 11701
9.50 11801

PLATE D-29

7.55119.01
10.60120.01
10.65121.01
10.10122.01
10.15123.01
10.20124.01
10.25125.01
10.30126.01
10.35127.01
10.40128.01
10.45129.01
10.50130.01
10.55131.01
11.00132.01
11.05133.01
11.10134.01
11.15135.01
11.20136.01
11.25137.01
11.30138.01
11.35139.01
11.40140.01
11.45141.01
11.50142.01
11.55143.01
12.00144.01
12.05145.01
12.10146.01
12.15147.01
12.20148.01
12.25149.01
12.30150.01
12.35151.01
12.40152.01
12.45153.01
12.50154.01
12.55155.01
13.00156.01
13.05157.01
13.10158.01
13.15159.01
13.20160.01
13.25161.01
13.30162.01
13.35163.01
13.40164.01
13.45165.01
13.50166.01
13.55167.01
14.00168.01
14.05169.01
14.10170.01
14.15171.01
14.20172.01
14.25173.01
14.30174.01
14.35175.01
14.40176.01
14.45177.01
14.50178.01
14.55179.01
15.00180.01

A large grid of dotted lines for graphing. The grid is approximately 20 units wide and 20 units high. Along the left vertical axis, the numbers 1, 0, and 10 are handwritten at regular intervals. Similarly, along the bottom horizontal axis, the numbers 1, 0, and 10 are handwritten at regular intervals. The rest of the grid is empty dotted lines.

20.15293.1
20.20294.1
20.25295.1
20.30296.1
20.35297.1
20.40298.1
20.45299.1
20.50290.1
20.55291.1
21.00292.1
21.05293.1
21.10294.1
21.15295.1
21.20296.1
21.25297.1
21.30298.1
21.35299.1
21.40290.1
21.45291.1
21.50292.1
21.55293.1
22.00294.1
22.05295.1
22.10296.1
22.15297.1
22.20298.1
22.25299.1
22.30290.1
22.35291.1
22.40292.1
22.45293.1
22.50294.1
22.55295.1
23.00296.1
23.05297.1
23.10298.1
23.15299.1
23.20290.1
23.25291.1
23.30292.1
23.35293.1
23.40294.1
23.45295.1
23.50296.1
23.55297.1
0.00298.1

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6	RATIO 7	RATIO 8
				.20	.21	.22	.23	.24	.25	.50	1.00
HYDROGRAPH AT	000001	.07 (.18)	1	196. (5.56)	206. (5.83)	216. (6.11)	226. (6.39)	235. (6.67)	245. (6.95)	491. (13.69)	981. (27.79)
ROUTED TO	000002	.07 (.18)	1	24. (.68)	30. (.85)	34. (.97)	39. (1.11)	49. (1.38)	59. (1.60)	419. (11.67)	932. (26.40)

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1		ELEVATION		INITIAL VALUE		SPILLWAY CREST		TOP OF DAM	
		STORAGE		571.00		571.00		573.70	
		OUTFLOW		5%		54.		70.	
				0.		D.		55.	
RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS		
.20	573.52	0.00	69.	28.	0.00	18.00	0.00		
.21	573.56	0.00	70.	30.	0.00	17.17	0.00		
.22	573.58	0.00	70.	34.	0.00	17.08	0.00		
.23	573.61	0.00	70.	39.	0.00	16.25	0.00		
.24	573.66	0.00	70.	49.	0.00	16.17	0.00		
.25	573.72	.02	71.	59.	.33	16.06	0.00		
.50	574.26	.56	74.	419.	3.58	15.75	0.00		
1.00	574.55	.85	76.	932.	5.67	15.67	0.00		

DATE
FILMED
— 8