



**US Army Corps
of Engineers**

Waterways Experiment
Station

Technical Report CHL-99-15
July 1999

Rubble-Mound Breakwater Stability Tests for Dos Bocas Harbor, Tabasco, Mexico

by Robert D. Carver

Approved For Public Release; Distribution Is Unlimited

DTIC QUALITY INSPECTED 4

Prepared for Preinversion and Desarrollo, S.A. de C.V.
and PEMEX Refinación y Producción

19991015 038

The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official endorsement or approval of the use of such commercial products.


The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.



PRINTED ON RECYCLED PAPER



**US Army Corps
of Engineers**
Waterways Experiment
Station

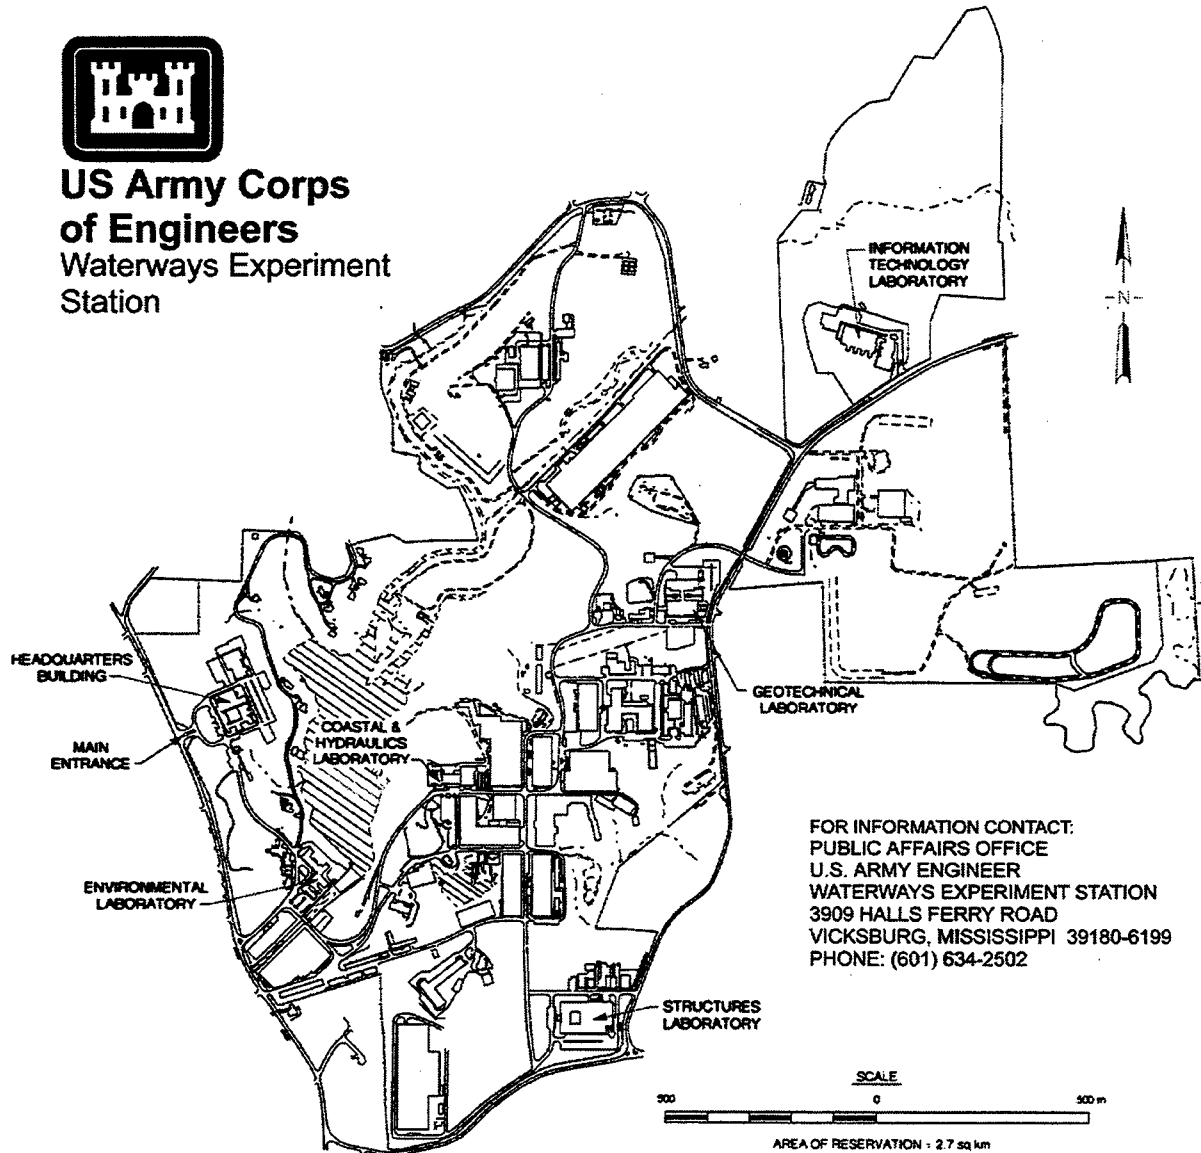

Waterways Experiment Station Cataloging-in-Publication Data

Carver, Robert D.

Rubble-mound breakwater stability tests for Dos Bocas Harbor, Tabasco, Mexico / by Robert D. Carver ; prepared for Preinversion and Desarrollo, S.A. de C.V. and PEMEX Refinacion y Produccion.

121 p. : ill. ; 28 cm. -- (Technical report ; CHL-99-15)

Includes bibliographic references.

1. Rubble mound breakwaters -- Stability. 2. Harbors -- Mexico -- Tabasco (State) 3. Dos Bocas Harbor (Mexico) I. United States. Army. Corps of Engineers. II. U.S. Army Engineer Waterways Experiment Station. III. Coastal and Hydraulics Laboratory (U.S. Army Engineer Waterways Experiment Station) IV. Preinversion and Desarrollo (Mexico) V. Petr oleos Mexicanos. VI. Title. VII. Series: Technical report (U.S. Army Engineer Waterways Experiment Station) ; CHL-99-15.

TA7 W34 no.CHL-99-15

Conversion Factors, SI
To Non-SI Units of Measurement

SI units of measurement used in this report can be converted to
Non-SI (English) units as follows:

<u>Multiply</u>	<u>By</u>	<u>To Obtain</u>
cubic metres	0.02831685	cubic feet
degrees (angle)	0.01745329	radians
metres	0.3048	feet
kilograms	0.4535924	pounds (mass)
kilograms per cubic metre	0.062428	pounds (mass) per cubic foot
square metres	0.09290304	square feet

1 Introduction

The Prototype

The Port of Dos Bocas is located on the Gulf Coast of Mexico within the State of Tabasco, several miles west of the Yucatan Peninsula (Figure 1). This site has been selected for development of an oil, industrial, and commercial port to be developed through the Mexican Oil Company (PEMEX). The port will handle most of the overseas oil exports in order to improve shipping operations.

The Dos Bocas Port Development was initially planned in the late 1970's and begun in 1980. The breakwaters which protect the harbor were only partially completed when falling oil prices required that construction stop. No exportation berths were completed; however, a small terminal to send materials to offshore facilities was completed. Meanwhile, PEMEX has managed its exportation needs through two offshore buoys.

During the past three years, PEMEX has performed several marketing and economic studies which indicate the exportation of oil can no longer be managed through the existing facilities. PEMEX is now interested in completing the breakwaters. The completion includes a reevaluation of the original design.

Purpose of Model Investigation

The initial purposes of the investigation were to determine, by two-dimensional (2-D) flume tests, the stability response of three alternate armorings for the proposed breakwater and to evaluate overall performance relative to wave overtopping. Finally, based on results of the initial tests and economic considerations, the best armoring alternative would be selected and a final recommended section would be developed and tested.

2 The Model

Model-Prototype Scale Relationships

Tests were conducted at geometrically undistorted scales of 1:38 and 1:40, model to prototype. Scale selection was based on the sizes of model armor available compared with the estimated size of prototype armor required for stability, elimination of wave transmission scale effects, preclusion of stability scale effects (Hudson 1975), and capabilities of the available wave tank. Based on Froude's model law (Stevens 1942) and the linear scales of 1:38 and 1:40, the following model-prototype relations were derived. Dimensions are in terms of length (L) and time (T).

<u>Characteristic</u>	<u>Dimension</u>	<u>Model-Prototype Relation</u>	
		<u>1:38 Scale</u>	<u>1:40 Scale</u>
Length	L	$L_r = 1:38$	$L_r = 1:40$
Area	L^2	$A_r = L_r^2 = 1:1444$	$A_r = 1:1600$
Volume	L^3	$V_r = L_r^3 = 1:54872$	$V_r = 1:64000$
Time	T	$T_r = L_r^{1/2} = 1:6.16$	$T_r = 1:6.32$

The specific weight of water used in model tests was assumed to be 62.4 pcf and that of seawater is 64.0 pcf. Also, specific weights of model breakwater construction materials were not the same as their prototype counterparts. These variables were related using the following transference equation:

$$\frac{(W_a)_m}{(W_a)_p} = \frac{(\gamma_a)_m}{(\gamma_a)_p} \left(\frac{L_m}{L_p} \right)^3 \left[\frac{(S_a)_p - 1}{(S_a)_m - 1} \right]^3$$

where

W_a = weight of an individual armor unit, mt

m, p = model and prototype quantities, respectively

γ_a = specific weight of an individual armor unit, mt per cubic meter

L_m/L_p = linear scale of the model

S_a = specific gravity of an individual armor unit relative to the water in which it was placed, i.e., $S_a = \gamma_a/\gamma_w$

In a hydraulic model investigation of this type, gravitational forces predominate (Froudian model law), except when energy transmission through the breakwater is considered (Keulegan 1973). If the core material was geometrically scaled according to Froudian model relationships, internal Reynolds numbers would be too low, and too much energy would be dissipated. Therefore, for all plans tested, the core stone was geometrically oversized according to Keulegan (1973) to aid in reproducing wave energy transmission.

Test Equipment and Facilities

All stability tests were conducted in a 0.9-m-wide segment of a concrete wave flume 3.4 m wide and 75 m long (Figure 2). Irregular waves were generated by a hydraulically actuated piston-type wave machine.

Wave data were collected with electrical capacitance wave gages which were calibrated daily with a computer-controlled procedure incorporating a least square fit of measurements at 11 steps. This averaging technique, using 21 voltage samples per gage, minimizes the effects of slack in the gear drives and hysteresis in the sensors. Typical calibration errors are less than 1 percent of full scale for the capacitance wave gages. Wave signal generation and data acquisition were controlled using a DEC MicroVax I computer. Wave data analyses were accomplished using a DEC VAX 3600.

3 Stability Tests and Results

Method of Constructing Test Sections

All experimental breakwater sections were constructed to reproduce as closely as possible results of the usual methods of constructing full-scale breakwaters. The core material was dampened as it was dumped by bucket or shovel into the flume and was compacted with hand trowels to simulate natural consolidation resulting from wave action during construction of the prototype structure. Once the core material was in place, it was sprayed with a low-velocity water hose to ensure adequate compaction of the material. The underlayer stone was then added by shovel and smoothed to grade by hand or with trowels. Armor units used in the cover layer were placed in a random manner; i.e., they were individually placed but were laid down without special orientation or fitting. After each test, the armor units were removed from the breakwater, all of the underlayer stones were replaced to the grade of the original test section, and the armor was replaced.

Description of Plan 1

Plan 1 (Figure 3 and Photos 1-3) was armored with 21.6 and 12.4 mt Acropods on the sea-side and harbor-side, respectively. Sea-side armor was buttressed against a vertical wall which had a bottom elevation of +2.1 m (top of core) and a top elevation of +8.7 m. Armor slopes of 1V on 1.5H were used both sea-side and harbor-side. Toe protection was provided by 3.6 mt stone which also served as first-underlayer material.

Selection of Test Conditions

Based on siting of the breakwater, tests were conducted with a JONSWAP spectrum using a peak enhancement factor of 3.3. A peak wave period of 12 sec was selected. A wave hindcast study (Lin, in preparation) was in progress at the time stability tests were initiated; however, it was not complete enough to provide the design wave height. Based on experience at similar sites, a proposed design wave height of 6 m was selected. A storm surge of +1.135 m, corresponding to mhhw, was selected. The stability response of the first test section was investigated for several wave heights via the following storm hydrograph (Hydrograph 1):

Step	SWL, m nbm	T_p , sec	H_s , m	Duration, hr
1	+1.135	12.0	3.0	3.0
2	+1.135	12.0	4.0	3.0
3	+1.135	12.0	5.0	6.0
4	+1.135	12.0	6.0	12.0

Test Results of Plan 1

Plan 1 exhibited an excellent stability response. As shown in Photos 4-6, no damage was evident at the conclusion of Hydrograph 1. Initially, it was planned to test only 3 to 6 m waves; however, the stability response of Plan 1 was so favorable that it was decided to extend Hydrograph 1 to include 12 hrs of 7-m waves. Again, a couple of seaward armor units were observed to rock in place; however, no displaced damage was observed either seaward or leeward.

Rationale and Description of Plan 1A

Based on the excellent stability response of Plan 1, it was decided to investigate alternative schemes that might improve stability or reduce the structure's cost without significantly affecting its functional performance. Some of the factors that govern material volumes and costs are elevation and width of the crown, type and weight of armor, and slope on which the armor is placed. It was decided that in this particular study the greatest cost savings with the least probable impact on functionality could probably be achieved by reducing the weight of both the sea-side and harbor-side armor. Appropriate model Acropods were not immediately available; however, 9- and 13-mt Core-Locs were. Therefore, Plan 1A (Figure 3) was constructed identical to Plan 1 except the 21.6- and 12.4-mt Acropods were replaced with 13- and 9-mt Core-Loc armor.

Test Results of Plan 1A

Plan 1A exhibited an excellent stability response for Hydrograph 1. As with Plan 1, a couple of armor units were observed to rock in place during step 4. However, as shown in Photos 7-9, no displaced damage was observed. As with Plan 1, testing was extended with 7-m waves. Again, no displaced damage was observed.

All of the tests described thus far were conducted at a water level of +1.135 m, thus intensifying wave attack on the up-slope armor. For structures of this type that use armor stone as toe protection, lower water levels may leave the toe stone more vulnerable and may prove critical in determine its stability. Thus Hydrograph 2 was devised similar to Hydrograph 1, except mean lower low water, -0.393 m, was substituted as follows:

Step	SWL, m nbm	T _p , sec	H _s , m	Duration, hr
1	-0.393	12.0	3.0	3.0
2	-0.393	12.0	4.0	3.0
3	-0.393	12.0	5.0	6.0
4	-0.393	12.0	6.0	12.0

Without rebuilding, Plan 1A was subjected to Hydrograph 2. No damage was observed during Steps 1 and 2. Step 3 produced some in-place movement of the 3.6 mt toe stone. Toe-stone movement increased during Step 4, with about 3 percent of the material being displaced seaward. No Core-Loc movement was observed for any of the test conditions. Photos 10-12 show the structure at the conclusion of testing.

Rationale and Description of Plan 1B

Based on the excellent stability response of Plan 1A, an additional improvement was investigated. This improvement consisted of reducing the leeward Core-Loc armor weight to 5.5-mt. The new structure, Plan 1B, was tested with Hydrograph 1. Also, prior to testing, all spectral signals were rephased.

Test Results of Plan 1B

Consistent with previously described structures, Plan 1B exhibited an excellent stability response. No movement was observed during steps 1 and 2. Step 3, 5 m waves, produced rocking of two seaward armor units in the vicinity of the swl. Downslope displacement of one armor unit was observed during attack of the 6-m waves. Photos 13-15 show the structure at the conclusion of Hydrograph 1. Again, tests were extended with 7-m waves and one additional seaward armor unit was displaced. As shown in Photos 16-18, the final condition of the structure was excellent with the two displaced armor units representing less than 1 percent of the seaward armor units. No damage was observed on the leeward side of the structure.

Rationale and Description of Plan 1C

In order to identify as many stable options for the prototype breakwater as possible, a final Acropod section was tested. Plan 1C (Photos 19-21) was created by armoring the seaward slope with the 12.4-mt Acropods which were previously used on the harborside of Plan 1. Due to the unavailability of smaller Acropods, the 5.5-mt Core-Loc armor was retained on the leeward slope.

Test Results of Plan 1C

As with previous structures, Plan 1C was initially tested with Hydrograph 1. No armor movement was detected during Steps 1-3. Attack of 6-m waves, Step 4, initiated rocking of two seaward armor units in the vicinity of the swl; however, no displacement was observed. Testing with 7-m waves produced downslope displacement of one seaward armor unit. As shown in Photos 22-24, the structure was still in excellent condition at the conclusion of testing.

Discussion of Plan 1, 1A, 1B and 1C Test Results

In summary, Plans 1, 1A, 1B, and 1C are all stable alternatives for the proposed breakwater. The 21.6- and 12.4-mt Acropods used on Plan 1 are conservatively stable. The 13-mt Core-Locs used on the seaward face of Plan 1A also proved stable and the 9-mt Core-Locs used on the leeward face were again conservative. Plans 1B and 1C showed that the leeward armor can be further reduced to 5.5 mt and 13-mt Acropods or Core-Locs should prove stable on the exposed face.

Description of Plan 2

Plan 2 (Figure 3 and Photos 25-27) was protected by two layers of Tetrapod armor. Armor weights of 16- and 3-mt were used sea-side and harbor-side, respectively.

Test Results of Plan 2

Plan 2 was tested with Hydrograph 1. No damage was observed during steps 1 and 2. Step 3, 5 m waves, produced in-place rocking of about 2 percent of the seaward Tetrapods. Movement increased with the 6 m waves. During the course of step 4, approximately 4 percent of the seaward armor was displaced downslope and onto the toe of the structure. Also, about 3 percent of the upper slope leeward armor was displaced downslope. The final condition of the structure, shown in Photos 28-30, was considered unacceptable for the 6-m waves.

Thus, the initial test of Plan 2 showed that the selected Tetrapods were stable for 5-m waves and unacceptable for 6-m waves. In an effort to refine the design wave height, a repeat test was conducted in which 5.5-m waves were added to the test.

Plan 2 was rebuilt and retested. Again, no displaced damage was observed for the 3-, 4- and 5-m waves. The 5.5-m waves displaced 1.5 percent of the armor downslope; however, the condition of the structure was still considered acceptable after attack of the 5.5-m waves (Photos 31-33). Damage increased as the structure was tested with 6-m waves. As shown in Photos 34-36, the final condition of the structure was not acceptable with about 5 percent of the armor units displaced downslope on both armor slopes.

Based on direct results of the repeat test and inference from the initial test, the 16-mt Tetrapods should be stable for wave heights up to 5.5 m. As opposed to the one layer armor systems (Core-Locs and Acropods) previously reported, the Tetrapods exhibited significantly lower stability.

Description of Plan 3

Plan 3 was armored with two layers of 10- and 5-mt Antifer Cubes on the seaside and harborside, respectively. Photos 37-39 show the test section prior to wave attack.

Test Results of Plan 3

Plan 3 exhibited an excellent stability response. No armor movement was observed during Steps 1-3 of Hydrograph 1. Step 4, 6-m waves, displaced one armor unit. As shown in Photos 40-42, the structure was still in excellent condition at the conclusion of Hydrograph 1. Testing continued with 7-m waves. The 7-m waves displaced two additional sea-side armor units (Photos 43-45).

Description of Plan 3A

As shown in photos of Plan 3, the armor units were placed as close together as possible, without forming a pattern. It was felt that this close placement may have contributed to the excellent stability response. Therefore, it was decided to test another plan that would employ a more random placement of the cubes. Plan 3A, Photos 46-48, was identical to Plan 3, except the armor was placed in a more random manner. This reduced the required number of armor units and increased the porosity of the cover layer from 25% to 42%.

Test Results of Plan 3A

Despite the more random placement of the armor units, Plan 3A also exhibited an excellent stability response. Photos 49-51 show there was no displaced damage at the end of Hydrograph 1. Photos 52-54 show the structure with two armor units displaced seaward and one armor unit displaced leeward at conclusion of testing with 7-m waves.

Description of Plan 3B

Since Plans 3 and 3A produced very similar results, it was decided to try one additional plan in which the armor placement was more randomized. This was accomplished by placing about 5 armor units at a time on the end of a shovel and letting the units fall gently into place. Results of this placement technique, Photos 55-57, show that a significant increase in the randomness of the armor was achieved. As would be expected, porosity also increased from 42% to 52%.

Test Results of Plan 3B

No armor movement was detected during attack of the 3- and 4-m waves. Minor in-place rocking of 2 seaward units was

observed during 5-m wave attack. As shown in Photos 58-60, one armor unit was displaced downslope on both the seaside and harborside faces by the conclusion of Hydrograph 1. Damage became more extensive during attack of the 7-m waves. Four armor units were displaced from the seaward face and 7 armor units were displaced downslope on the back of the structure. Photos 61-63 show the structure at the conclusion of testing.

It was decided to conduct a repeat test of Plan 3B, in order to verify the stability response associated with the higher porosity. As shown in Photos 64-66 the structure was still in acceptable condition at the conclusion of Hydrograph 1 with two armor units displaced from the seaward face and 5 units displaced from the leeward face. A comparison of Photos 64-66 with Photos 58-60 shows similar results at this point in the test. As shown in Photos 67-69, totals of 4 and 9 armor units were displaced seaside and leeside, respectively, by the conclusion of testing. Verifying results of the first test, the structure was considered to be in acceptable condition at the end of testing.

Discussion of Plan 3, 3A, and 3B Test Results

As tests progressed from Plan 3 to 3A and finally 3B, placement of the armor became more random, porosity increased and some increase in displaced damage was noted. However, all plans were acceptable for 7-m waves.

Testing of Recommended Sections

Based on tests and results previously described and a sponsor performed economic analysis of the various alternatives, Core-Locs were chosen as the optimum armor. Plans 3, 3A, and 3B showed that 10- and 5-mt Antifer Cubes would have been acceptable; however, the two-layer cube armor would have required significantly more concrete than the final Core-Loc plans.

The final test sections, Plans 4 and 5, consisted of testing 13 mt Core-Locs in a water depth of 11 m and 15 mt Core-Locs in a water depth of 15 m. As with previous plans, the 1.5-m toe trenching was not represented, thus giving controlling depths of 11 and 15 m at the base of the core. Details of Plan 4 are shown in Figure 4 and Photos 70-72. The structure is very similar to Plans 1A and 1B, except the crown wall is improved and the harbor-side armor now consists of 4.5-mt stone.

Test Results of Plan 4

Plan 4 exhibited an excellent stability response for Hydrograph 1. As shown in Photos 73-75, no damage was evident at the conclusion of Hydrograph 1. Testing was extended with 7-m waves with no displaced damage being observed. Photos 76-78 show the structure after testing with the 7-m waves.

As discussed earlier in this report, for structures of this type that use armor stone as toe protection, lower water levels may leave the toe stone more vulnerable and prove critical in determining its stability. Thus, in an effort to focus more wave energy on the toe, Plan 4 was also tested with Hydrograph 2. Some minor reorientation of the seaward toe stone was observed during attack of the 5 and 6 m waves. No Core-Loc movement was observed for any of the test conditions. Photos 79-81 show Plan 4 to be in excellent condition after testing both hydrographs.

Plan 4 was rebuilt and a repeat test was conducted with Hydrograph 1 plus the 7-m waves. Again, some minor in-place armor reorientation was observed. However, no displaced damage was noted. Photos 82-84 show the structure at the conclusion of testing.

Test Results of Plan 5

Plan 5 represented a section of the breakwater that will be near the head; whereas, all previously discussed plans were assumed to be in a more intermediate water depth. Plan 5 (Figure 5 and Photos 85-87) was similar to Plan 4 except the water depth was increased to 15 m and the primary armor weight was increased to 15 mt. In order to properly simulate the 15 mt Core-Locs, the model scale was reduced from 1:38 to 1:40 and the same model armor from Plan 4 was used.

A major objective in testing Plan 5 was to determine if the deeper water would allow more extreme waves to reach the structure, for a constant significant wave height, and thus increase wave overtopping and this is what did occur. The structure was tested with Hydrograph 1, with only minor reorientation of a few armor units occurring. However, attack of the 7-m waves produced minor overtopping of the seawall. As shown in Photos 88-90, this overtopping displaced a few of the 4.5 mt lee-ward armor stones at the top of the slope. The number displaced was less than 2 percent of the total and no Core-Loc displacement was observed.

Plan 5 was rebuilt and again exposed to Hydrograph 1 plus the 7-m waves with basically the same results as the initial test; i. e., less than 2 percent of 4.5 mt lee-ward armor was displaced and no Core-Loc displacement was observed. Photos 91-93 show the structure after attack of the 7-m waves. It is felt that Plan 5 is adequate for up to 7-m waves at this depth; however, the top elevation of the seawall is only minimally acceptable as opposed to being completely acceptable in a depth of 11 m or less.

Even though Plan 5 showed excellent performance for waves in excess of the proposed design height of 6.5 m, experience has shown that breakwater damage can initiate and progress quite rapidly with only a small increase in wave height. Therefore, it was decided to extend the repeat test of Plan 5 with 8-m waves, in an effort to estimate the structures reserve stability.

Photos 94-96 show that the Core-Loc armor was still in excellent condition at the conclusion of testing with 8-m waves; however, the 4.5-mt, lee-ward armor experienced about 15 percent displaced damage. Damage on the lee-ward side was a direct result of significant wave overtopping, confirming the above mentioned judgement that the top elevation of the seawall would need to be increased for protection from waves in excess of 7-m.

4 Conclusions

Based on tests and results reported herein, it is concluded that:

a. The 21.6- and 12.4-mt Acropods used on Plan 1 proved to be conservatively stable.

b. The 13-mt Core-Locs used on the seaward face of Plan 1A proved to be stable and the 9-mt Core-Locs used on the leeward face were conservatively stable.

c. Plans 1B and 1C showed that the leeward Core-Loc armor can be further reduced to 5.5 mt.

d. Plan 2, armored with 16- and 3- mt Tetrapods, experienced instability for wave heights above 5.5 m. Tetrapod stability was significantly less than that observed for the Core-Loc and Acropod structures.

e. Plans 3, 3A, and 3B, armored with two layers of 10- and 5-mt Antifer Cubes on the seaside and harborside, respectively proved stable for 7-m waves, even though placement became more random and porosity progressively increased from Plan 3 to 3B.

f. Plan 4, armored with 13-mt Core-Locs on the seaside, 4.5-mt stone on the leeside and using a crownwall elevation of +10.3 m, proved to be stable for significant wave heights of 7 m.

g. Plan 5, similar to Plan 4 except the water depth was increased to 15 m and the sea-side, Core-Loc armor weight was increased to 15 mt, also proved stable for significant wave heights of 7 m.

h. Plan 5, when subjected to significant wave heights of 8-m, experienced damage to the lee-ward armor; however, the 15-mt Core-Locs showed acceptable stability.

5 Recommendations

The final test sections, Plans 4 and 5, consisting of 13 mt Core-Locs in a water depth of 11 m and 15 mt Core-Locs in a water depth of 15 m proved to be stable for significant wave heights up to 7 m. These armor weights are recommended for prototype use. Also, the crownwall elevation of +10.3 m should be adequate for significant wave heights up to and including 7 m.

References

Goda, Y. and Suzuki, Y., (1976). "Estimation of incident and reflected waves in random wave experiments," Proceedings, 15th International Conference on Coastal Engineering, Honolulu, Hawaii.

Hudson, R. Y. (1975). "Reliability of rubble-mound breakwater stability models," Miscellaneous Paper H-75-5, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS


Keulegan, G. H. (1973). "Wave transmission through rock structures," Research Report H-73-1, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS

Lin, L. W. (In Preparation). "Evaluation of Wave Climate for Dos Bocas Oil Port," Technical Report CHL-99- , U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS

Stevens, J. C. 1942. "Hydraulic Models," Manuals of Engineering Practice No. 25, American Society of Civil Engineers, New York.

Appendix A: Notation

A	Acceleration due to gravity, ft/sec ²
d	Water depth, ft
d/L	Relative depth, dimensionless
H _{mo}	Zero-moment wave height, ft
L _p	Airy wave length, ft
R _N	Reynolds stability number
T _p	Wave period of peak energy density of spectrum, sec
W	Weight, lb
α	Angle of breakwater slope, measured from horizontal, deg
cota	Reciprocal of breakwater slope
γ	Specific weight, pcf
v _a	Specific weight of armor unit, pcf

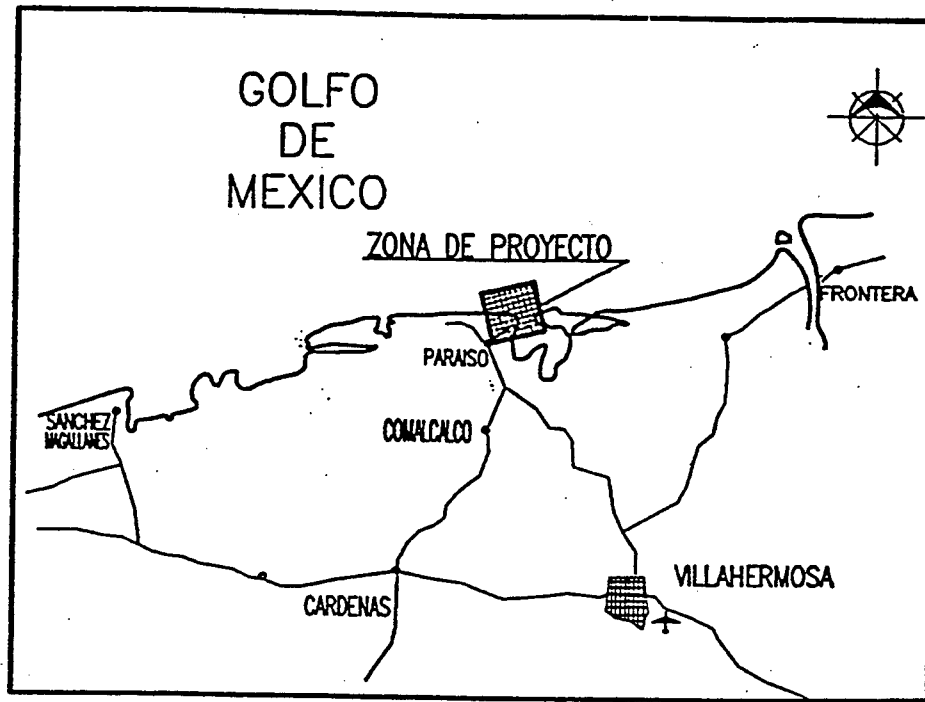

CROQUIS DE LOCALIZACION

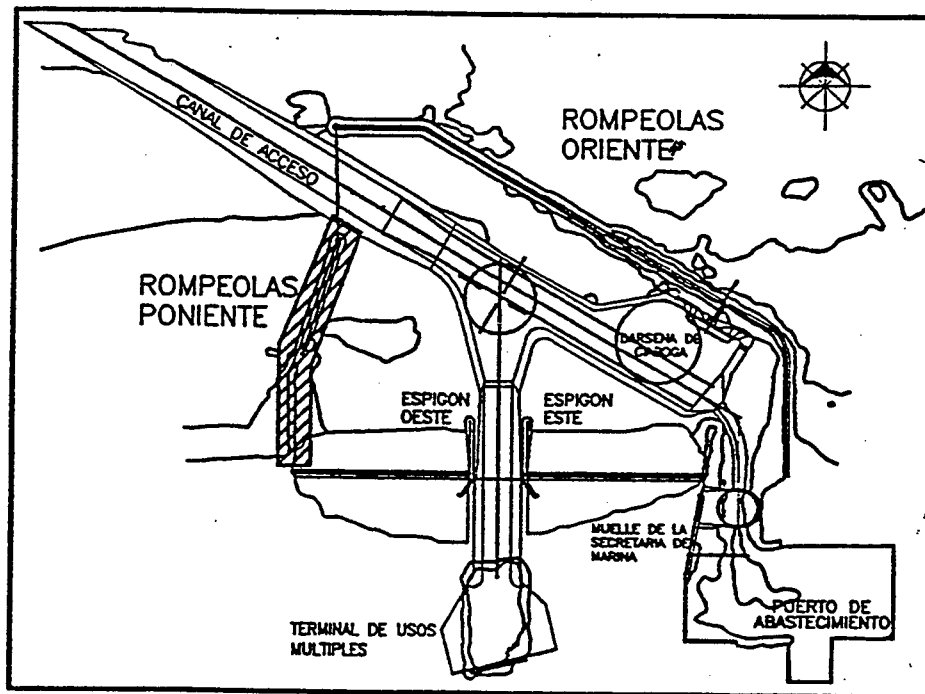


Figure 1. Location map




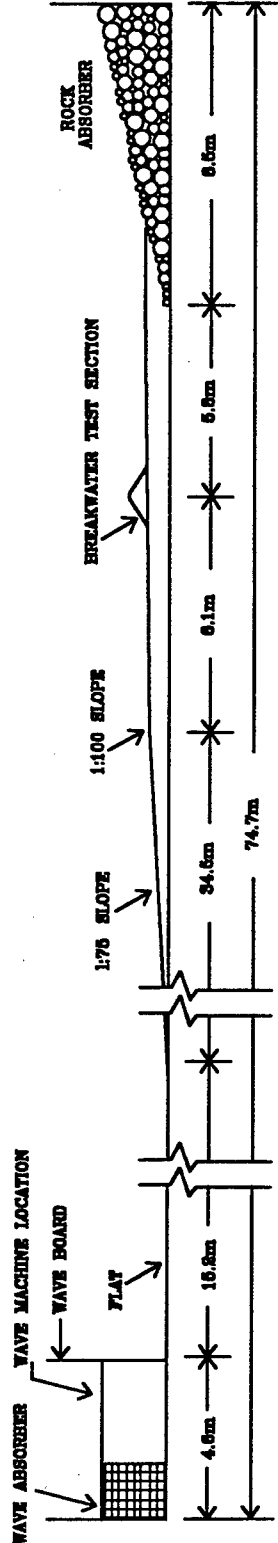


Figure 2. Wave tank cross section

Armor Types and Weights


Plan	Armor Type	Weight, mt	
		Sea Side	Harbor Side
1	Acropods	21.6	12.4
1A	CORE-LOCS	13.0	9.0
1B	CORE-LOCS	13.0	5.5
1C	Acropods	12.4	5.5
2	Tetrapods	16.0	3.0
3	Cubes	10.0	5.0
3A	Cubes	10.0	5.0
3B	Cubes	10.0	5.0

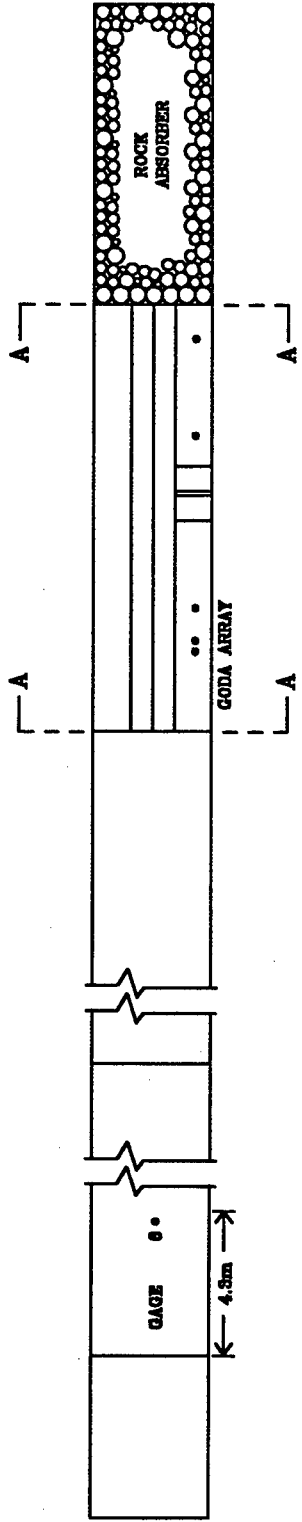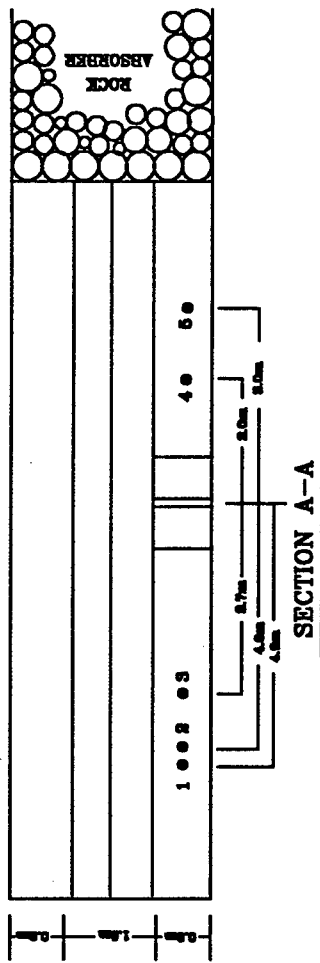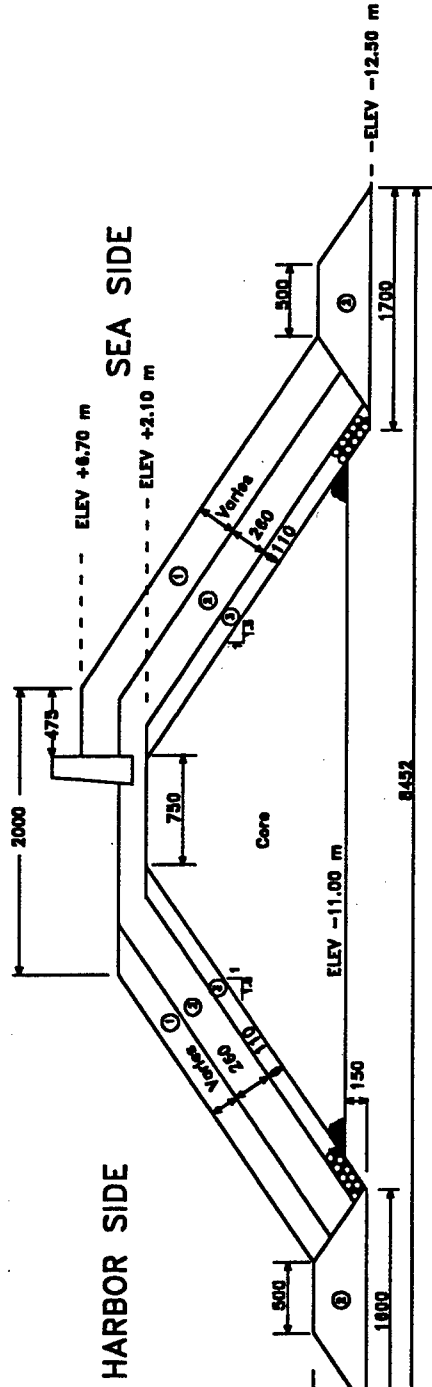

Material Characteristics	
Area	Materials
1	Acropods, Core-Locs, Tetrapods, or Antifer Cubes
2	3.6 mt Stone
3	180 Kg Stone

NOTE: All dimensions are centimeters unless otherwise noted.


Figure 3. Characteristics of Plans 1, 1A, 1B, 1C, 2, 3, 3A, and 3B

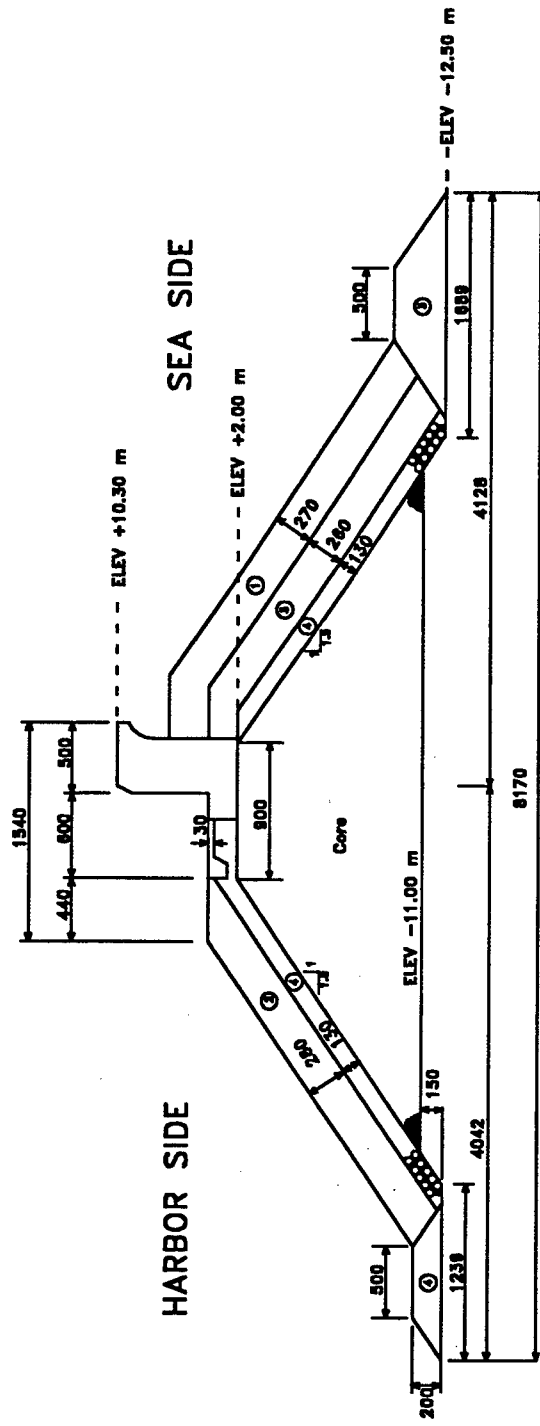

NOTE: All dimensions are in centimeters unless otherwise noted.

Material Characteristics	
Area	Materials
1	13.0 mt Core-Locs
2	4.5 mt Stone
3	3.8 mt Stone
4	450 Kg Stone

Figure 4. Details of Plan 4

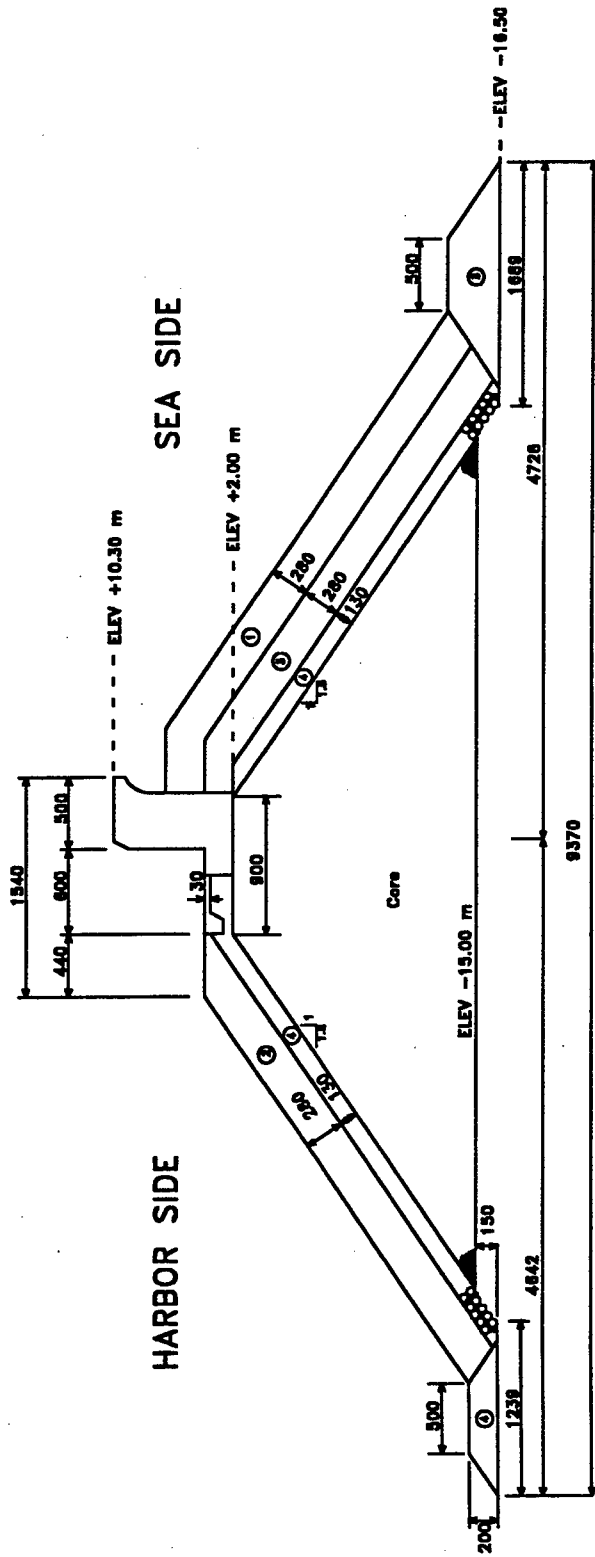

Material Characteristics	
Area	Materials
1	15.0 mt Core-Loss
2	4.5 mt Stone
3	3.6 mt Stone
4	450 Kg Stone

NOTE: All dimensions are centimeters unless otherwise noted.

Figure 5. Details of Plan 5

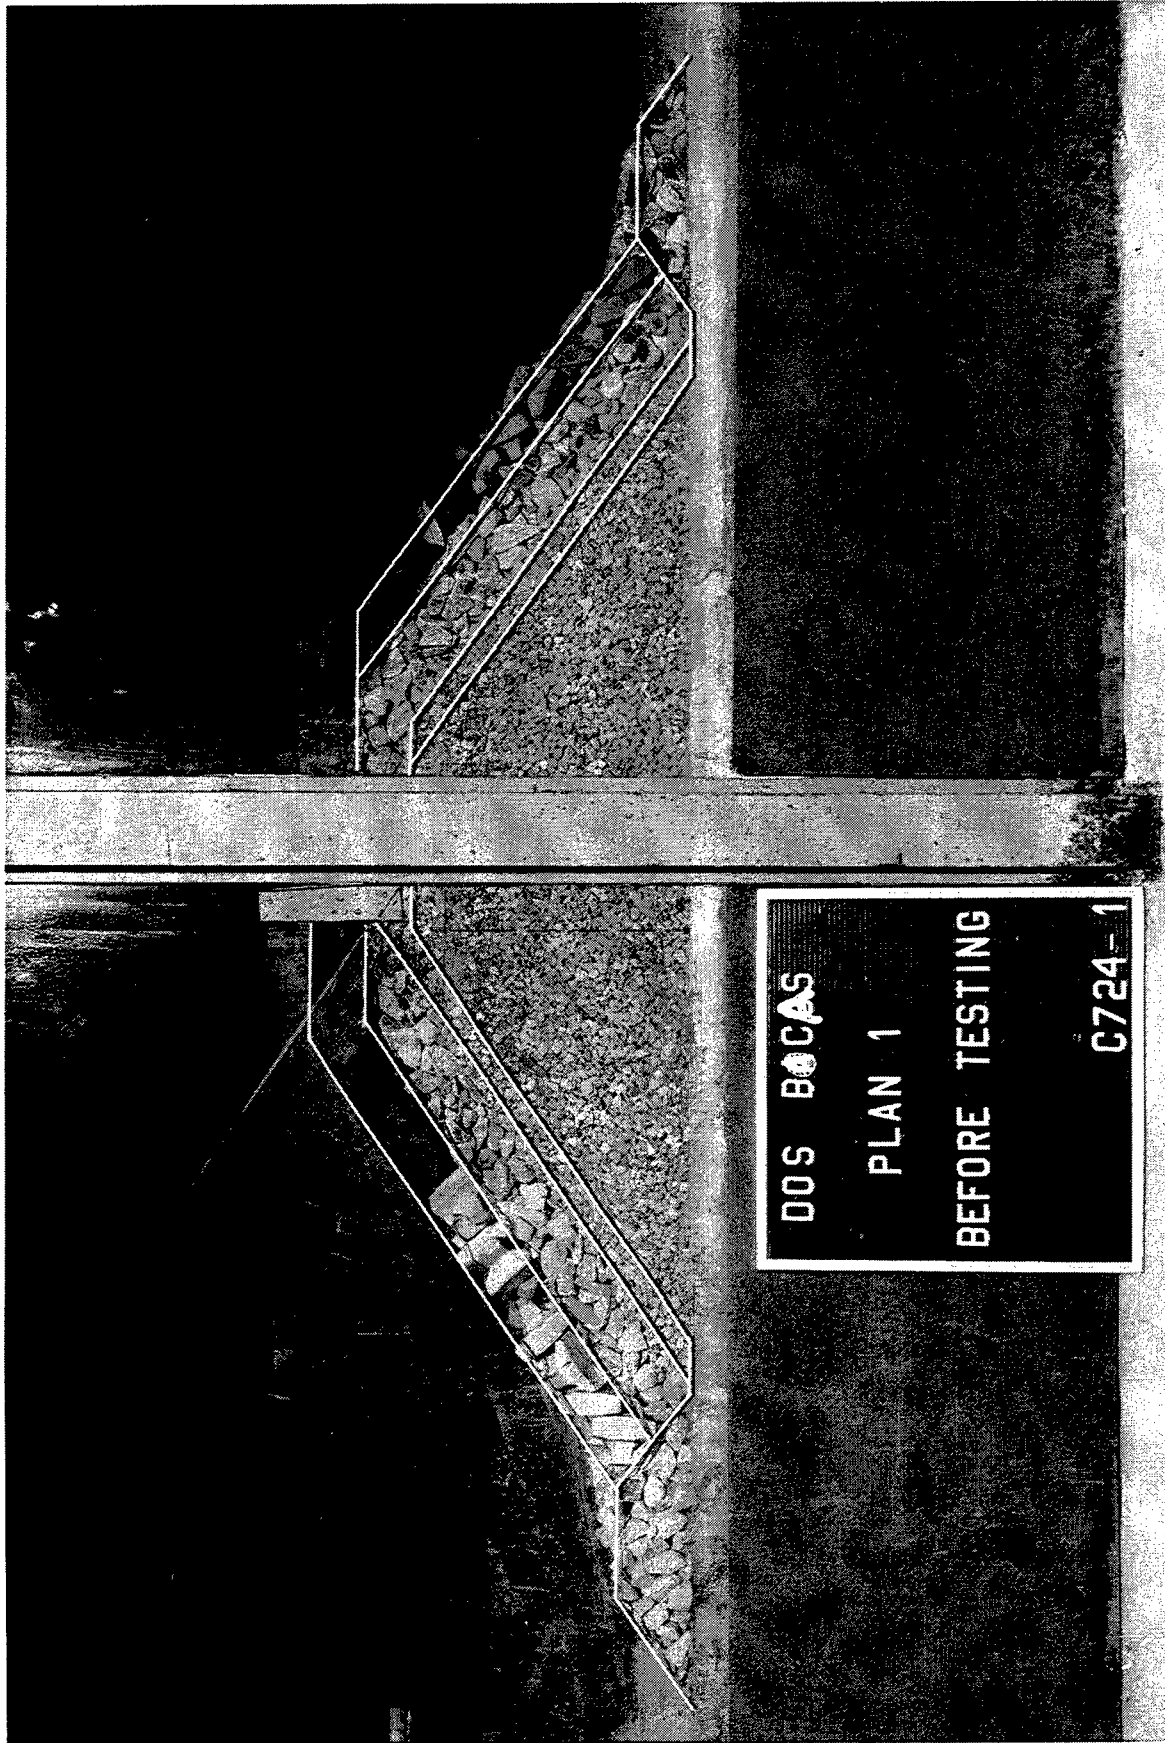


Photo 1. End view of Plan 1 before wave attack

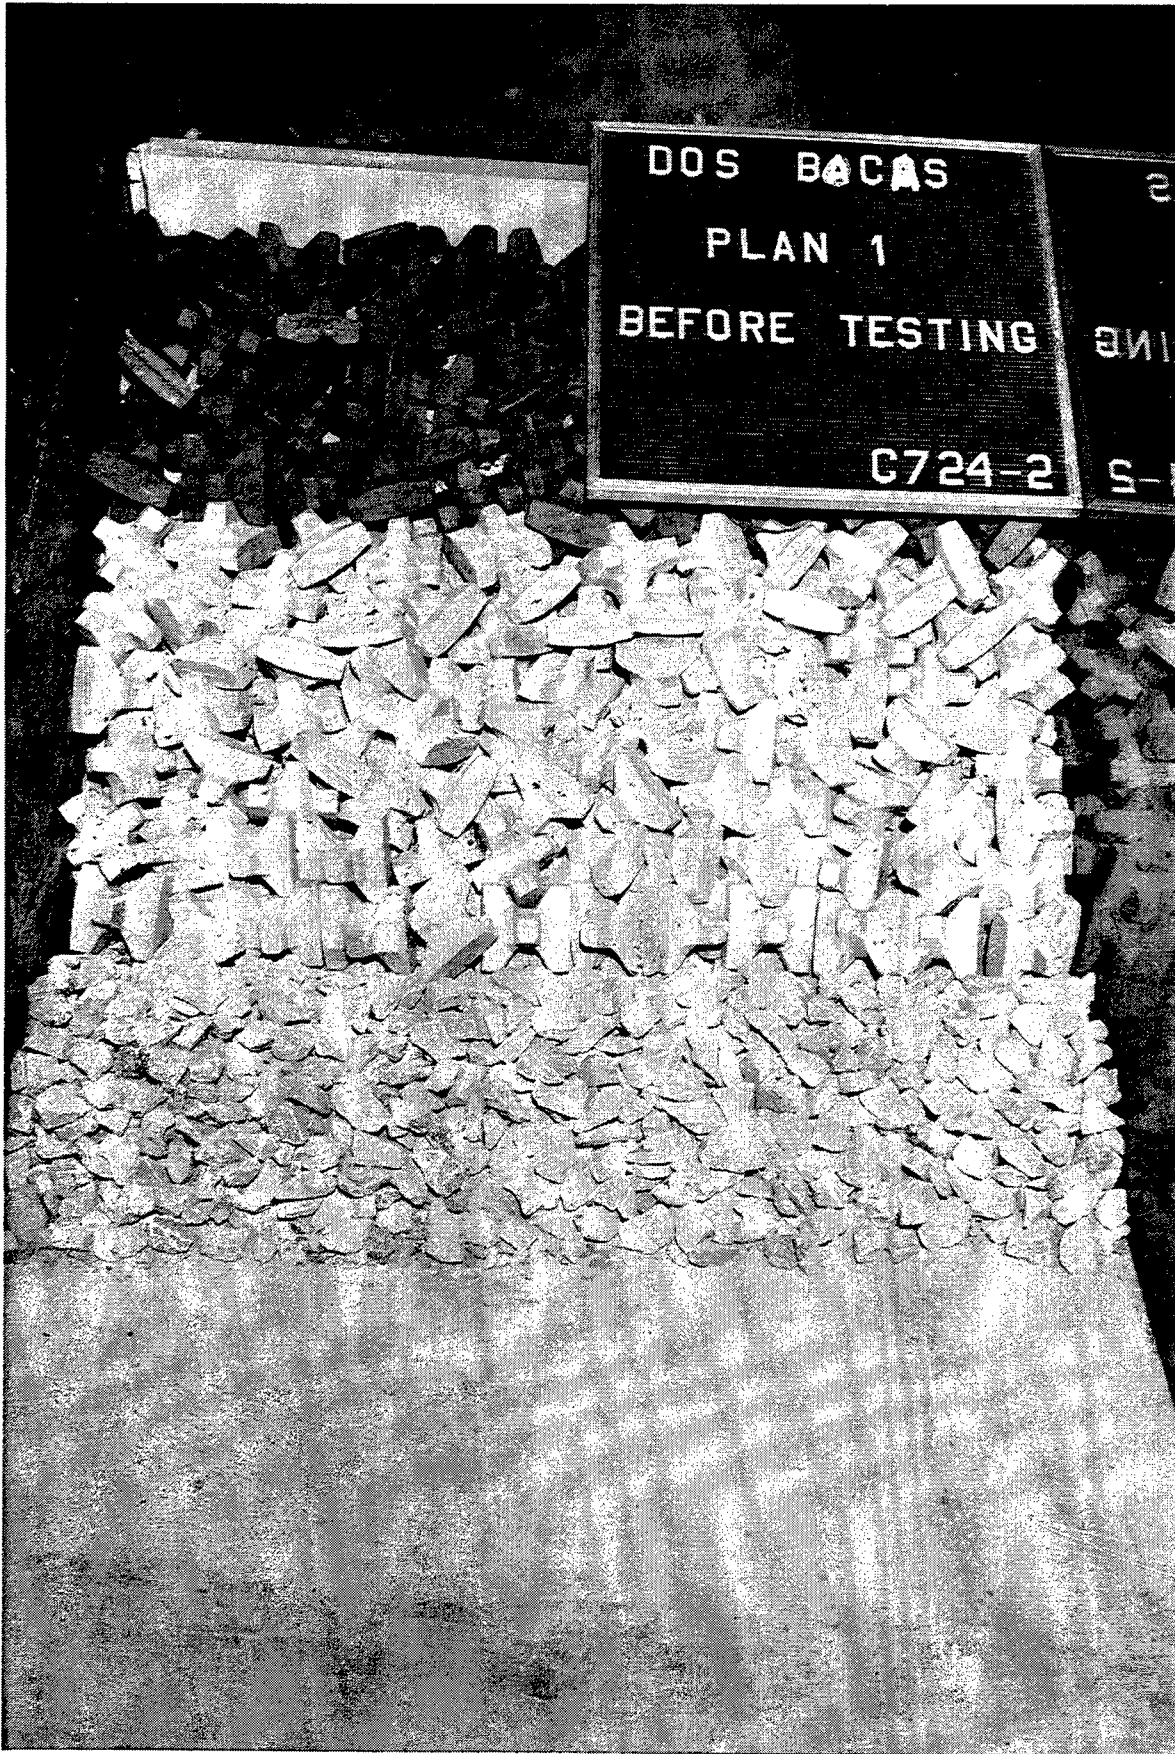


Photo 2. Sea-side view of Plan 1 before wave attack



Photo 3. Harbor-side view of Plan 1 before wave attack

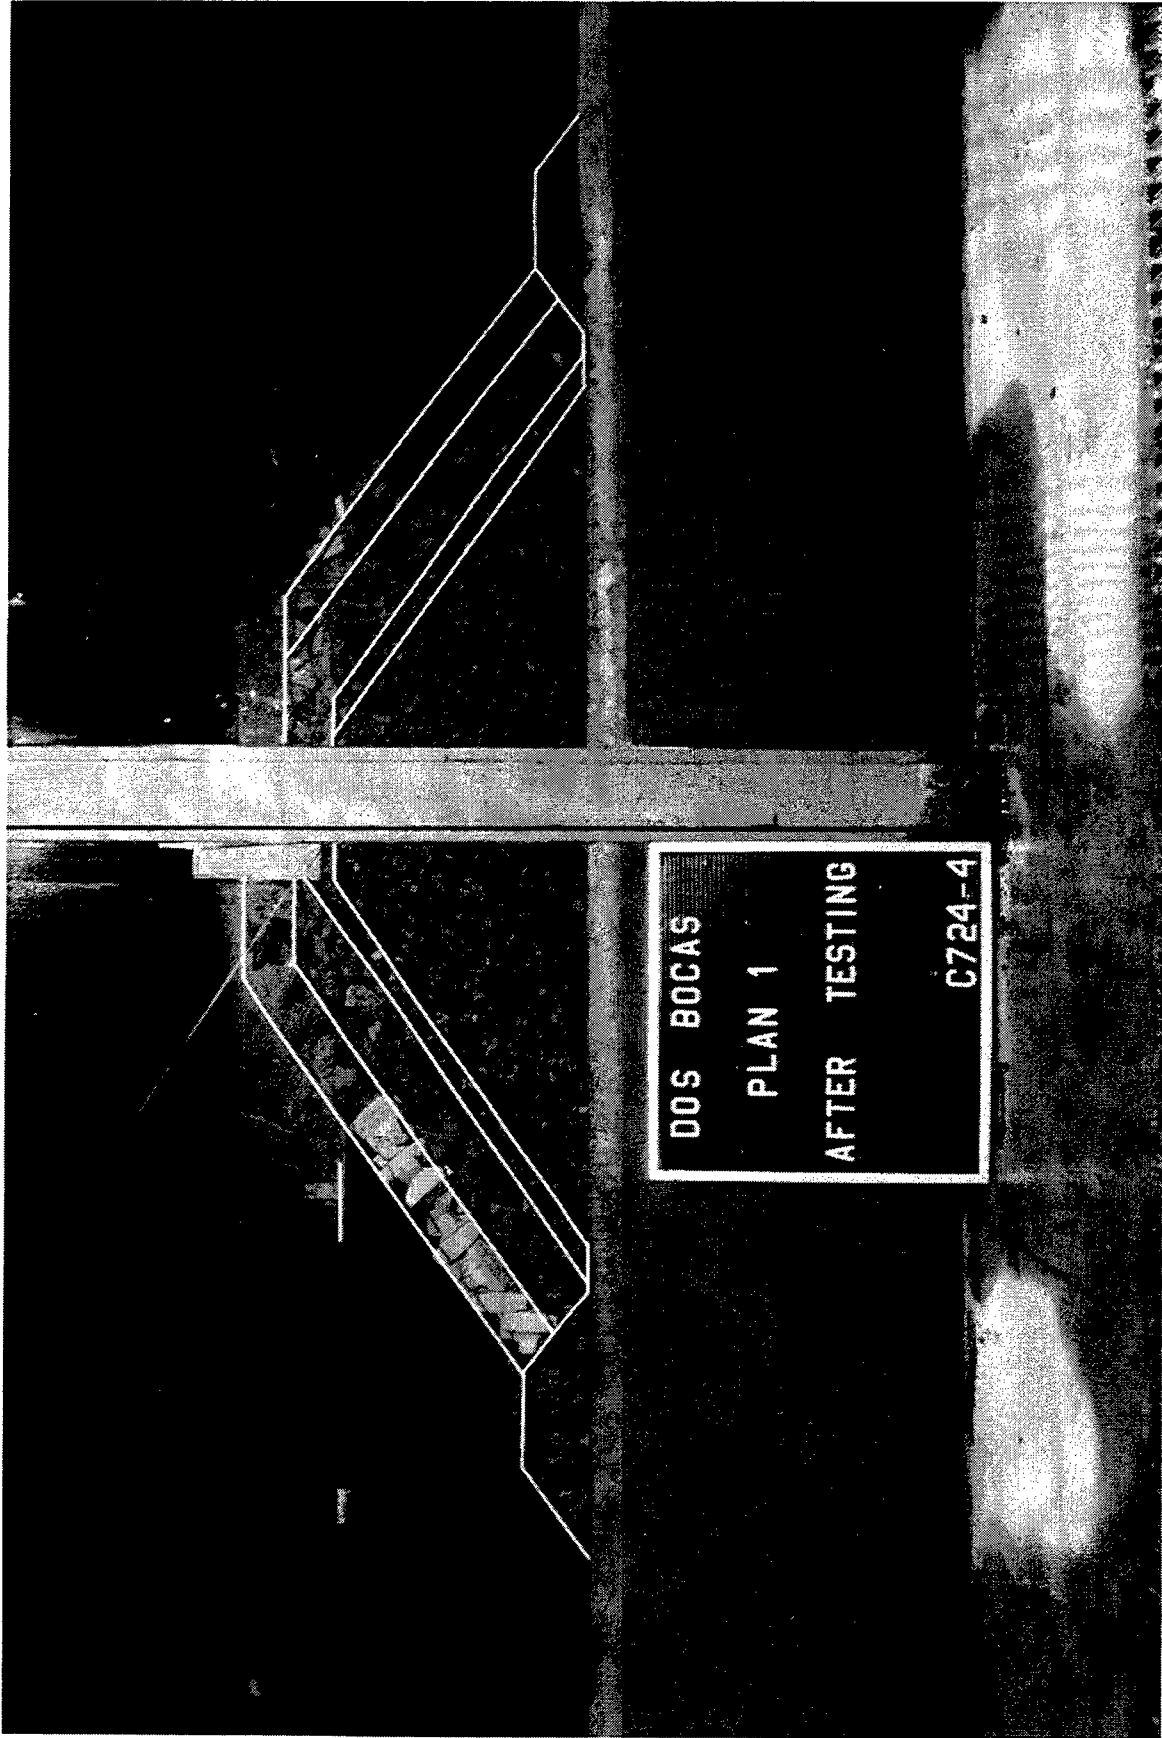


Photo 4. End view of Plan 1 after testing Hydrograph 1



Photo 5. Sea-side view of Plan 1 after testing Hydrograph 1

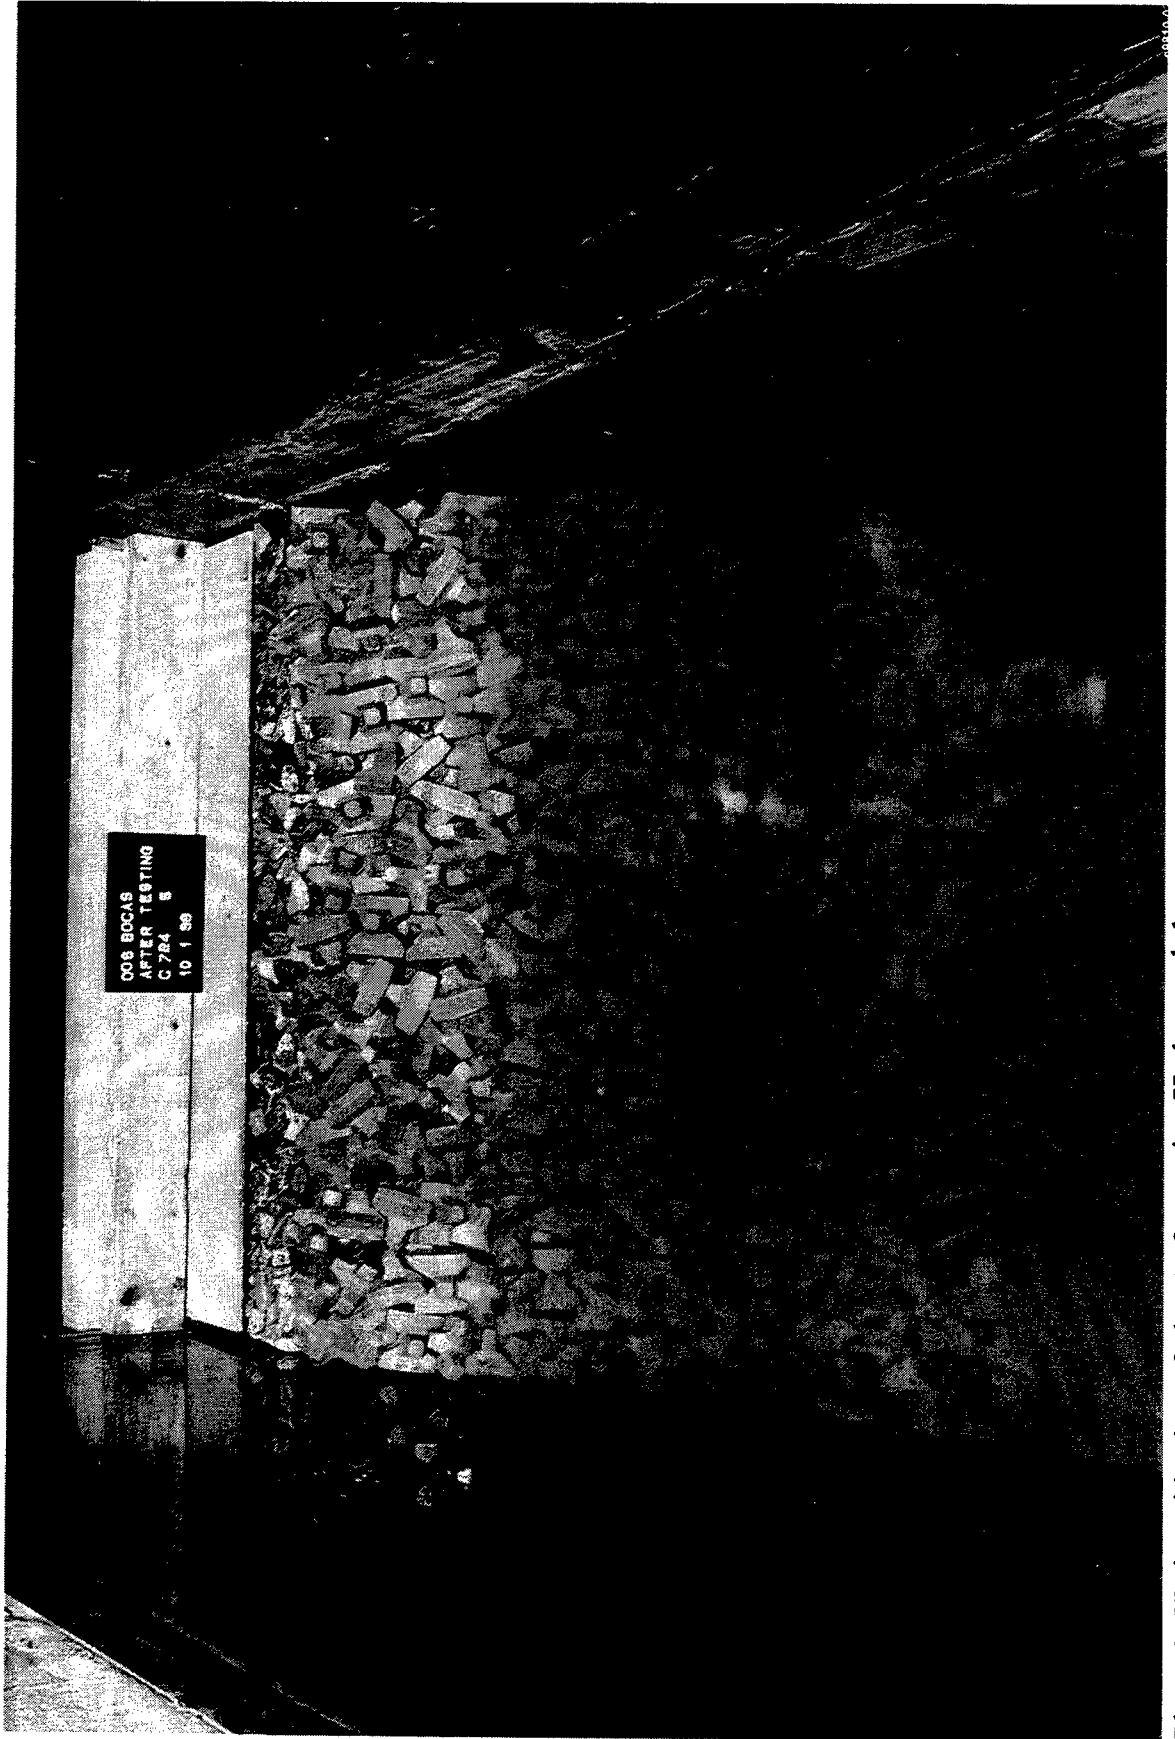


Photo 6. Harbor-side view of Plan 1 after testing Hydrograph 1

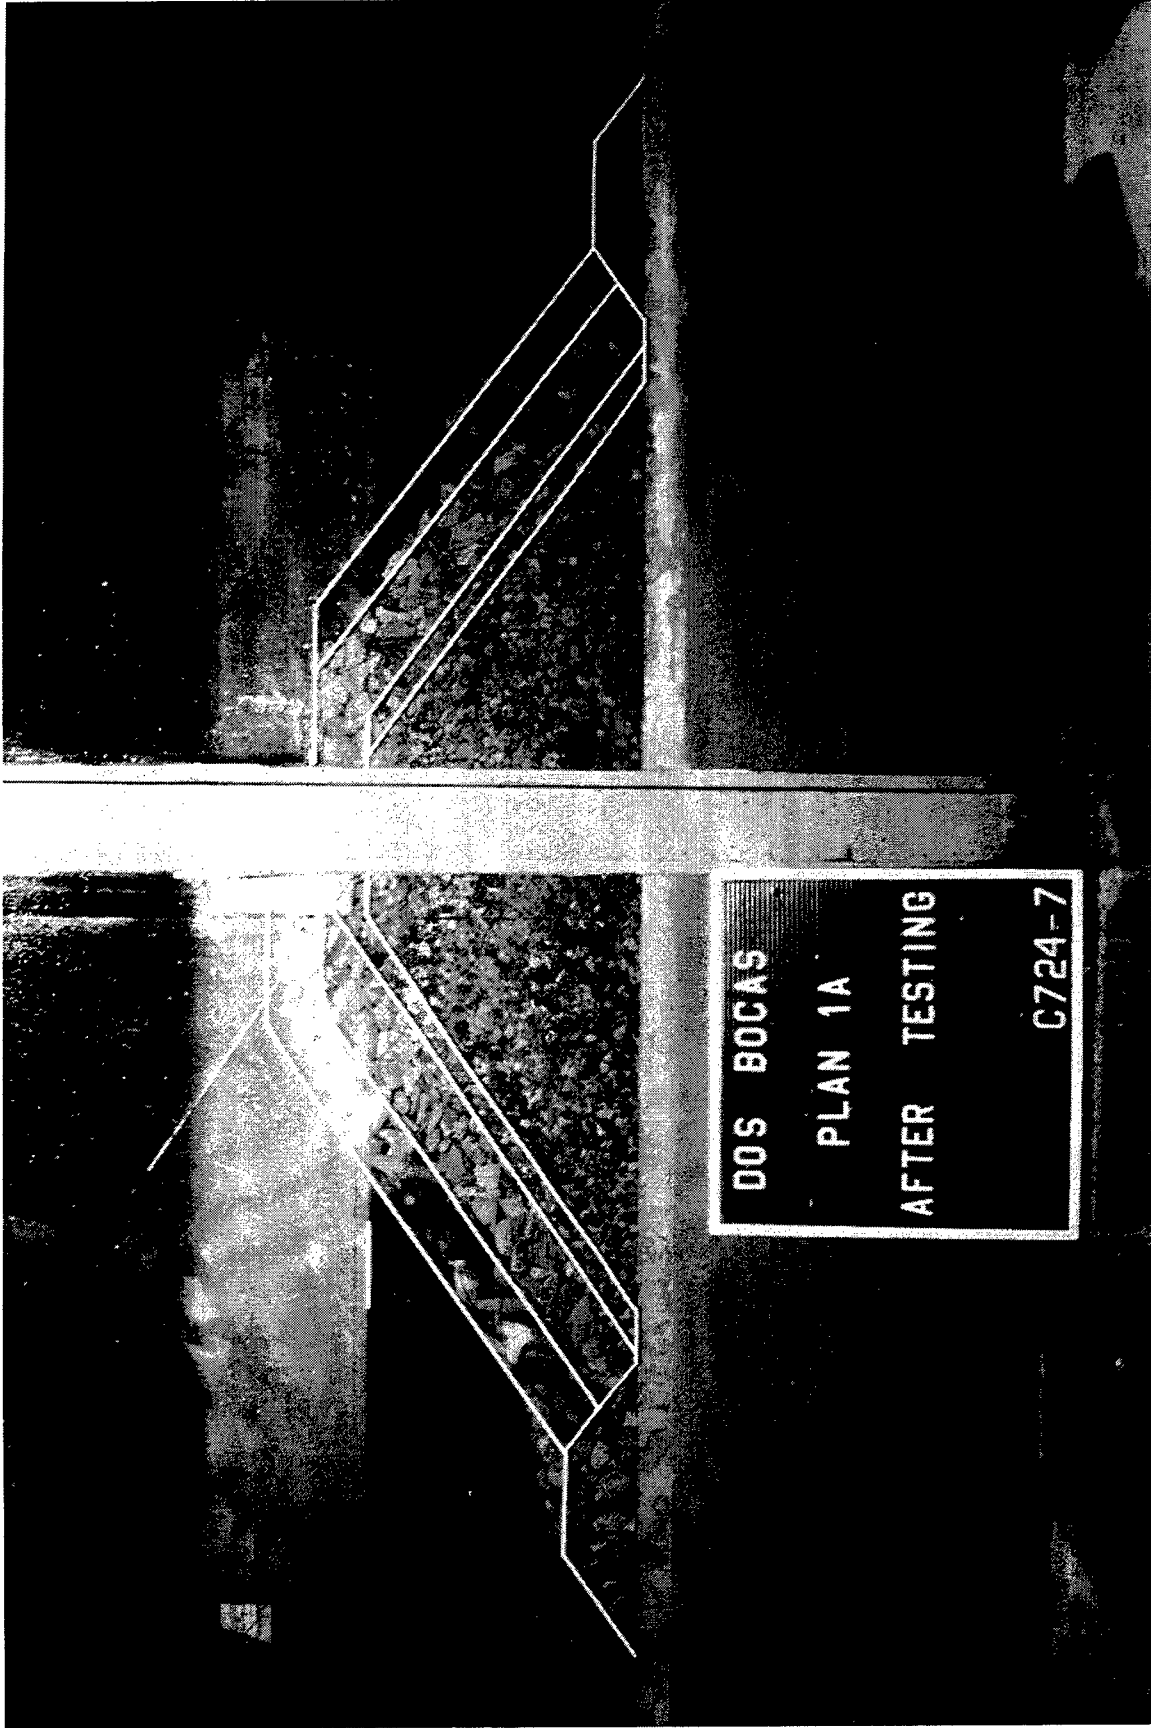


Photo 7. End view of Plan 1A after testing Hydrograph 1



Photo 8. Sea-side view of Plan 1A after testing Hydrograph 1



008 80048
AFTER TESTING
C 744 5
10 1 04

27-200 264
SMITHS BATH
C 383 3
06 1 07

Photo 9. Harbor-side view of Plan 1A after testing Hydrograph 1




0816-17

Photo 10. End view of Plan 1A after testing Hydrographs 1 and 2



Photo 11. Sea-side view of Plan 1A after testing Hydrographs 1 and 2

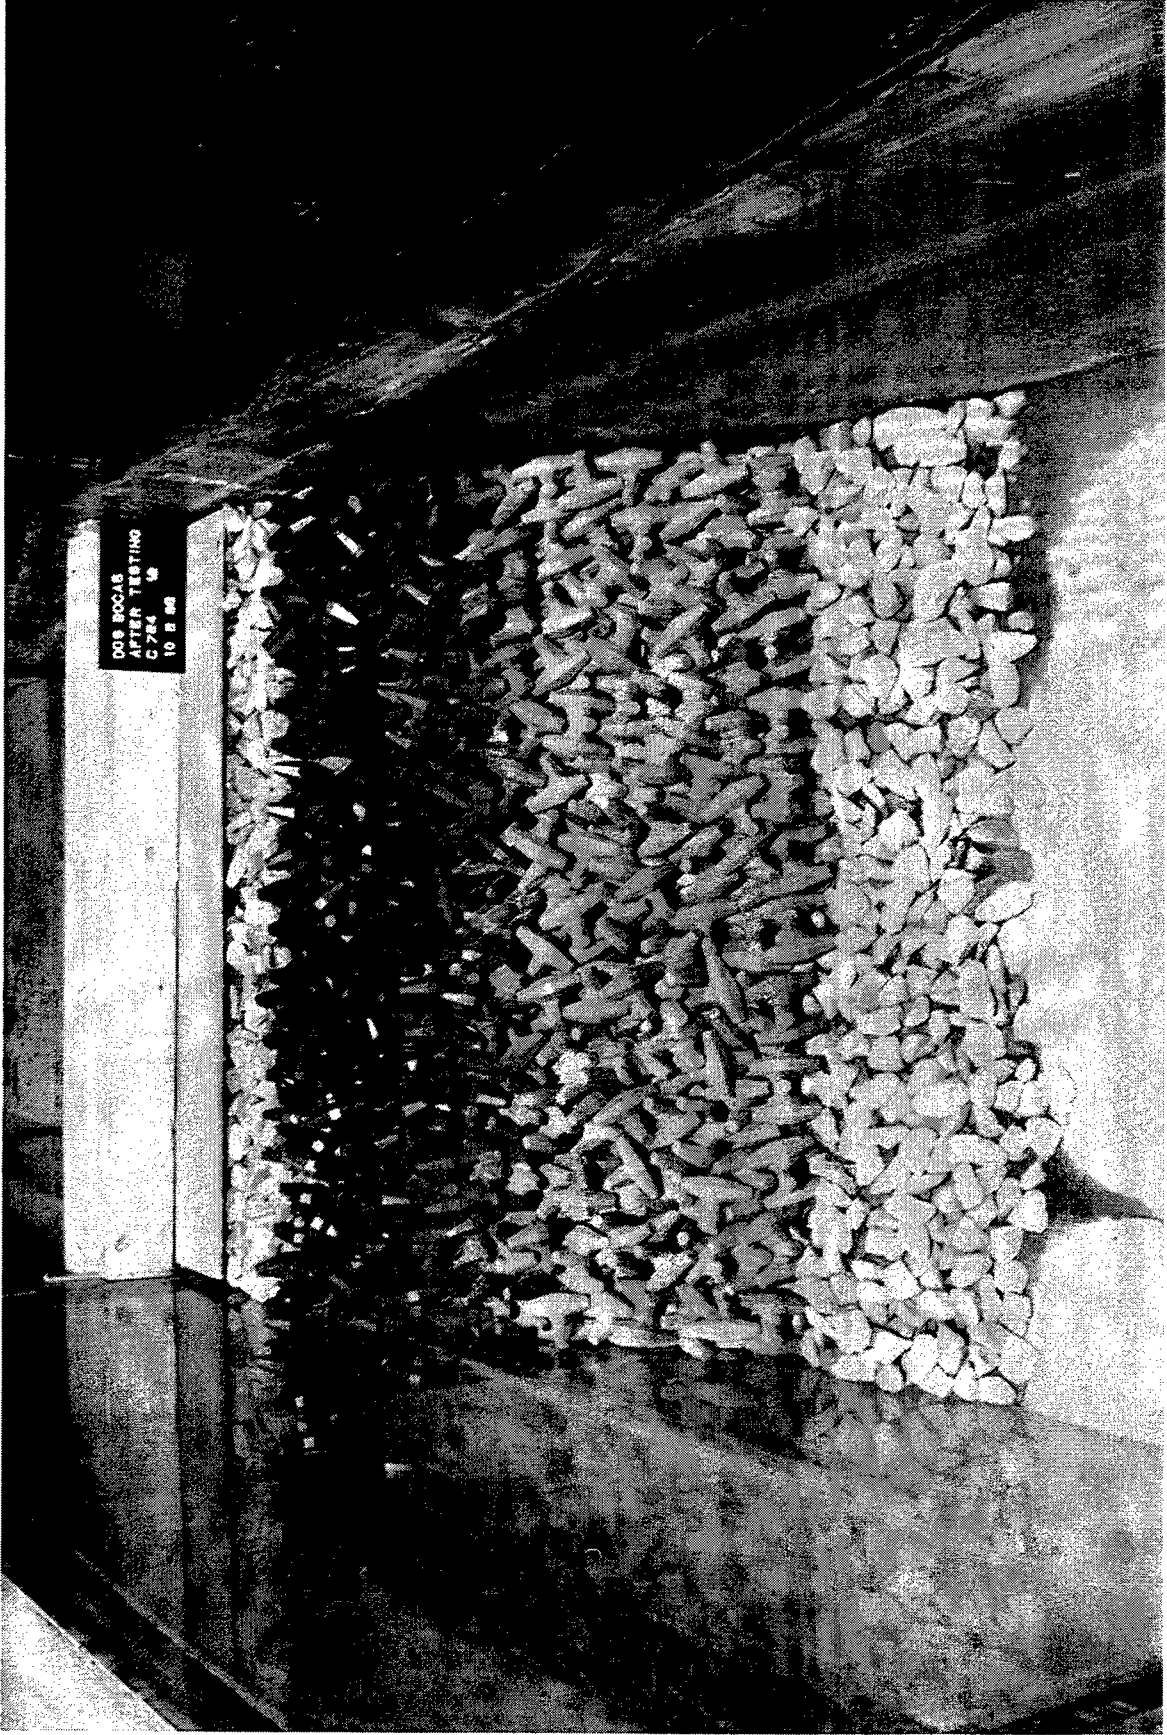

008 BOCAS
AFTER TESTING
C 784 M
10 B 08

Photo 12. Harbor-side view of Plan 1A after testing Hydrographs 1 and 2


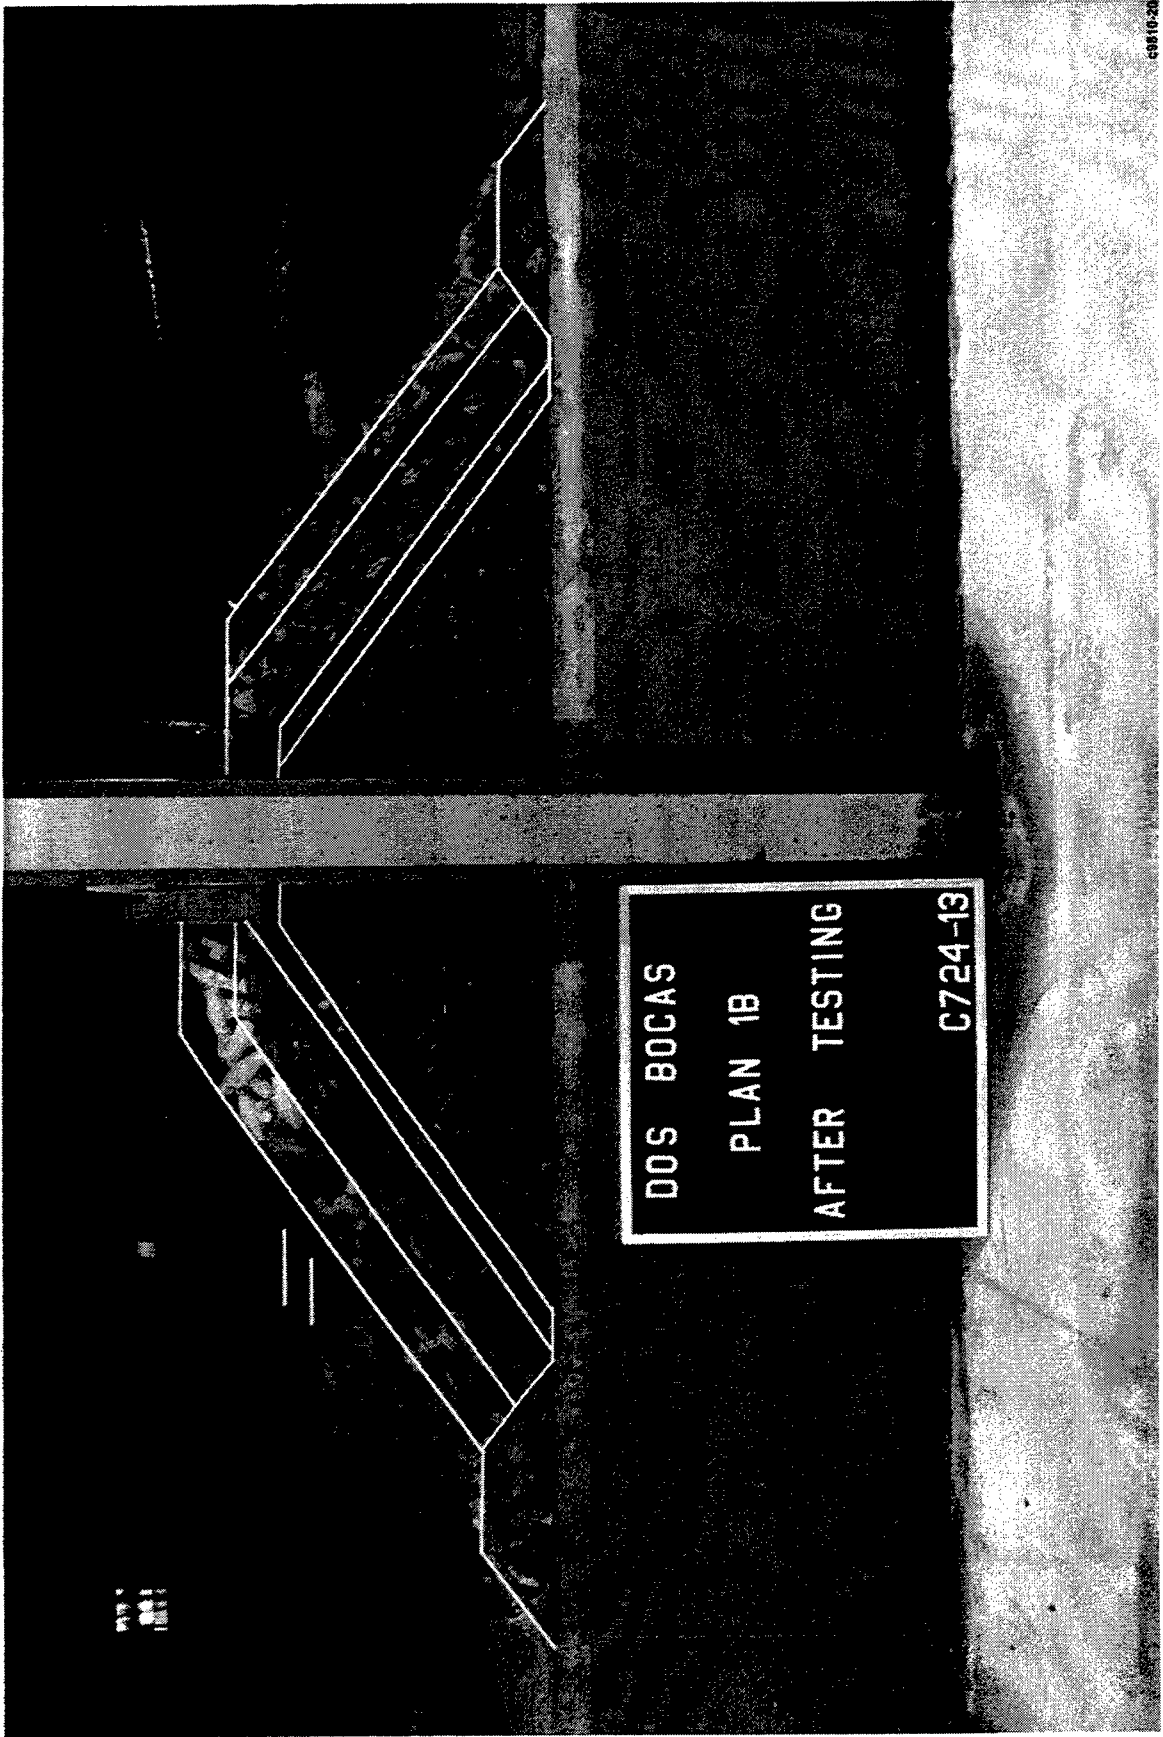


Photo 13. End view of Plan 1B after testing Hydrograph 1

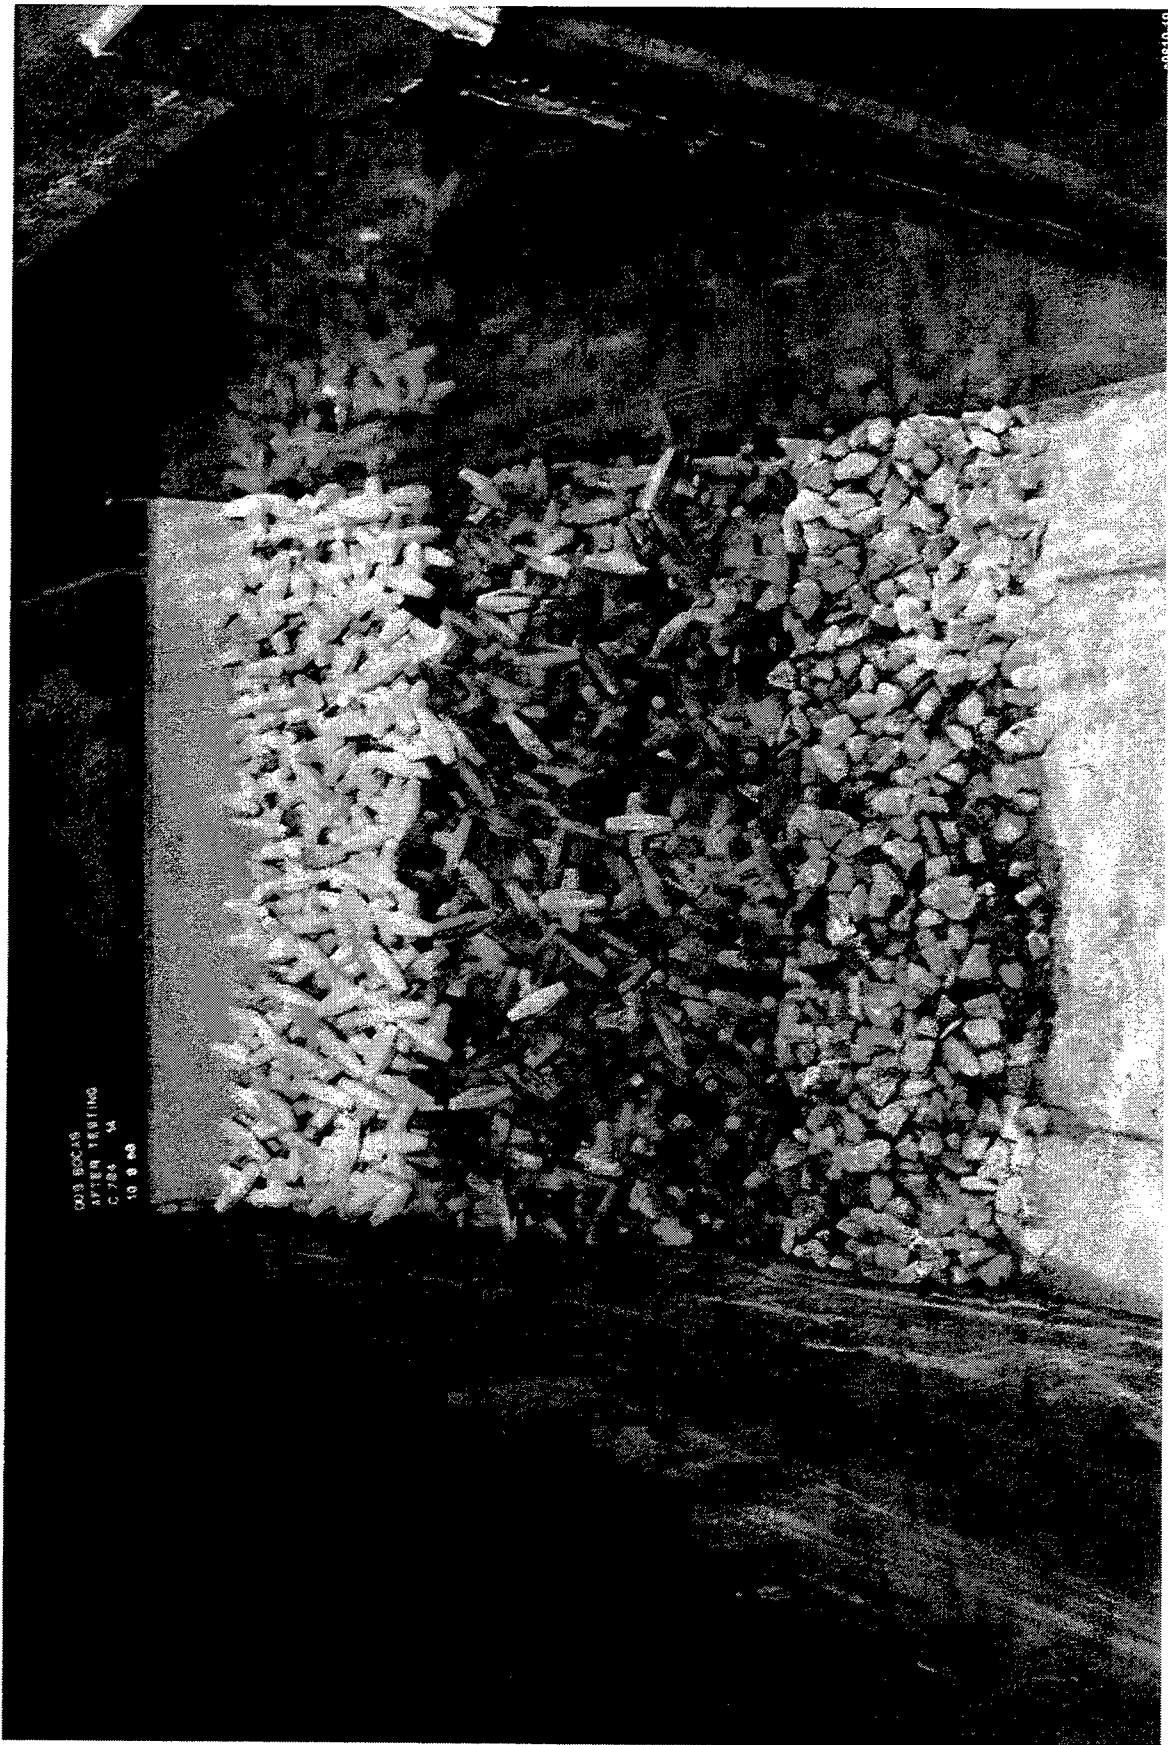

000 80019
AFTER TESTING
C 780 M
10 8 80

Photo 14. Sea-side view of Plan 1B after testing Hydrograph 1

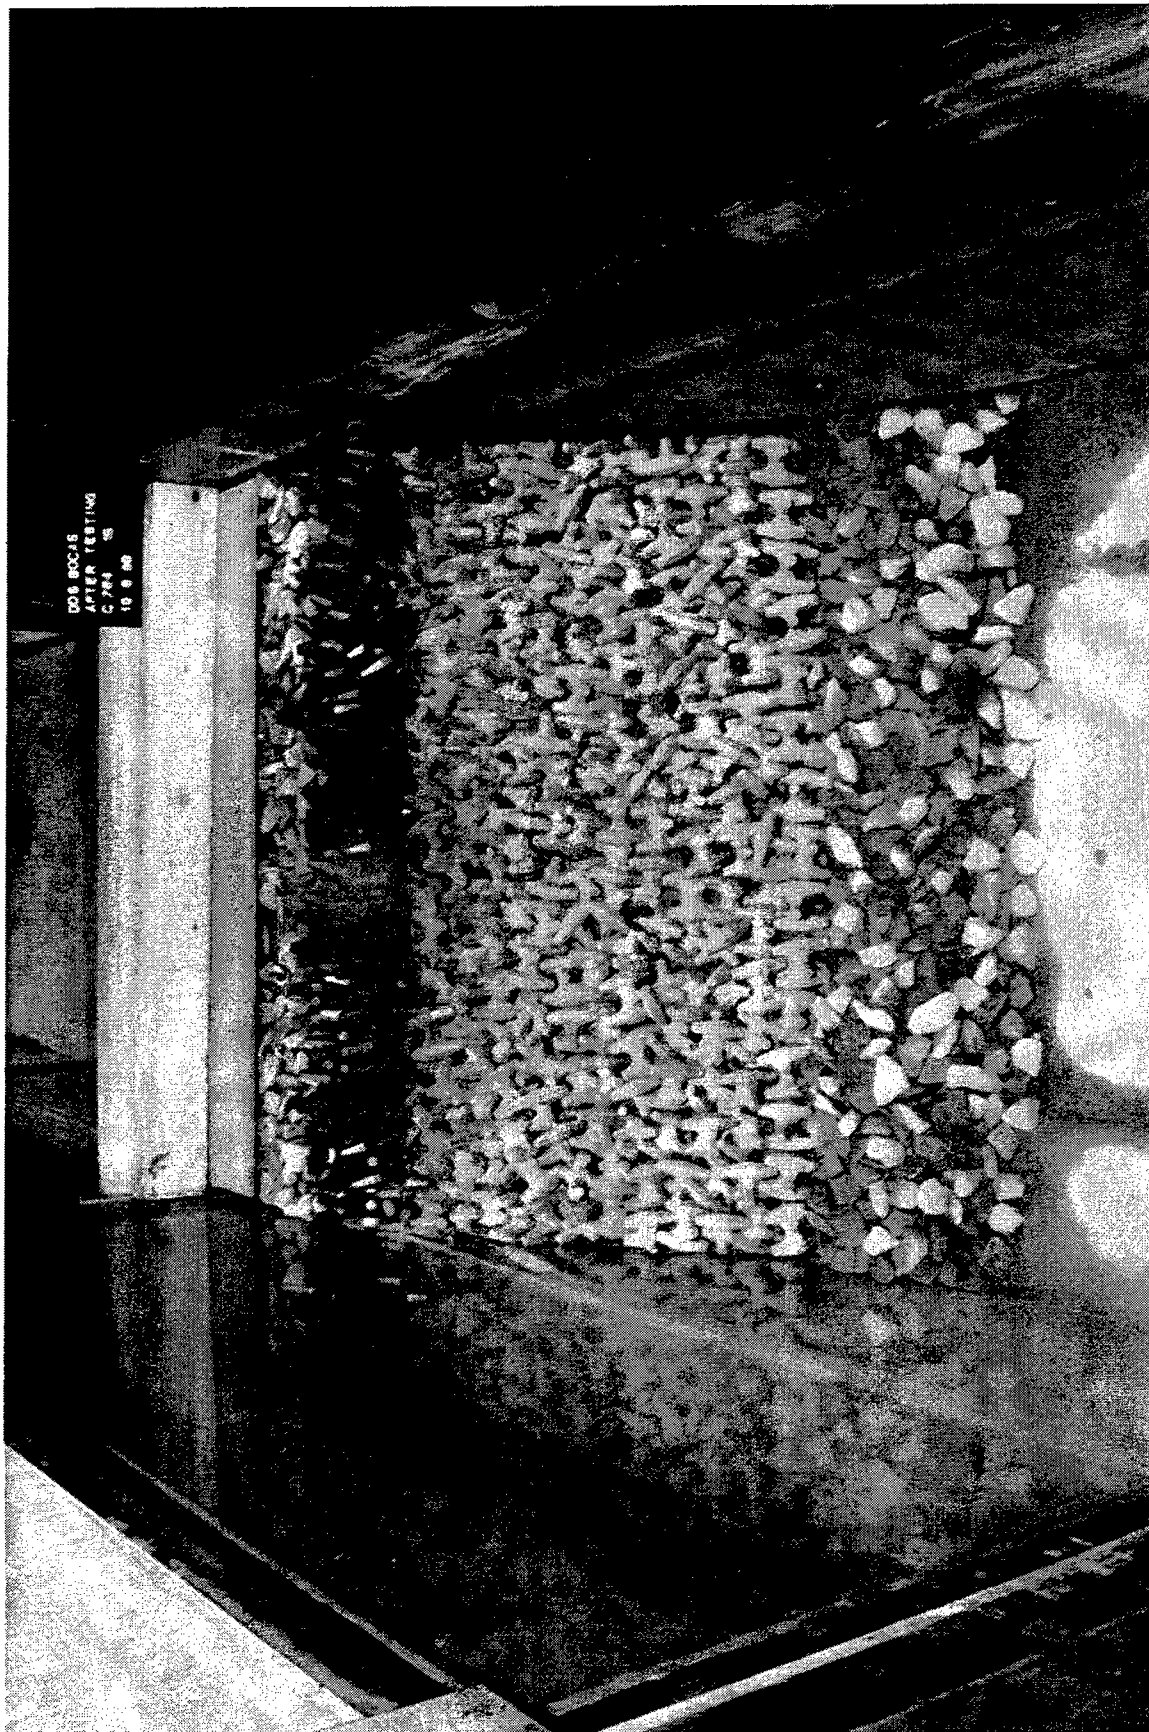


Photo 15. Harbor-side view of Plan 1B after testing Hydrograph 1

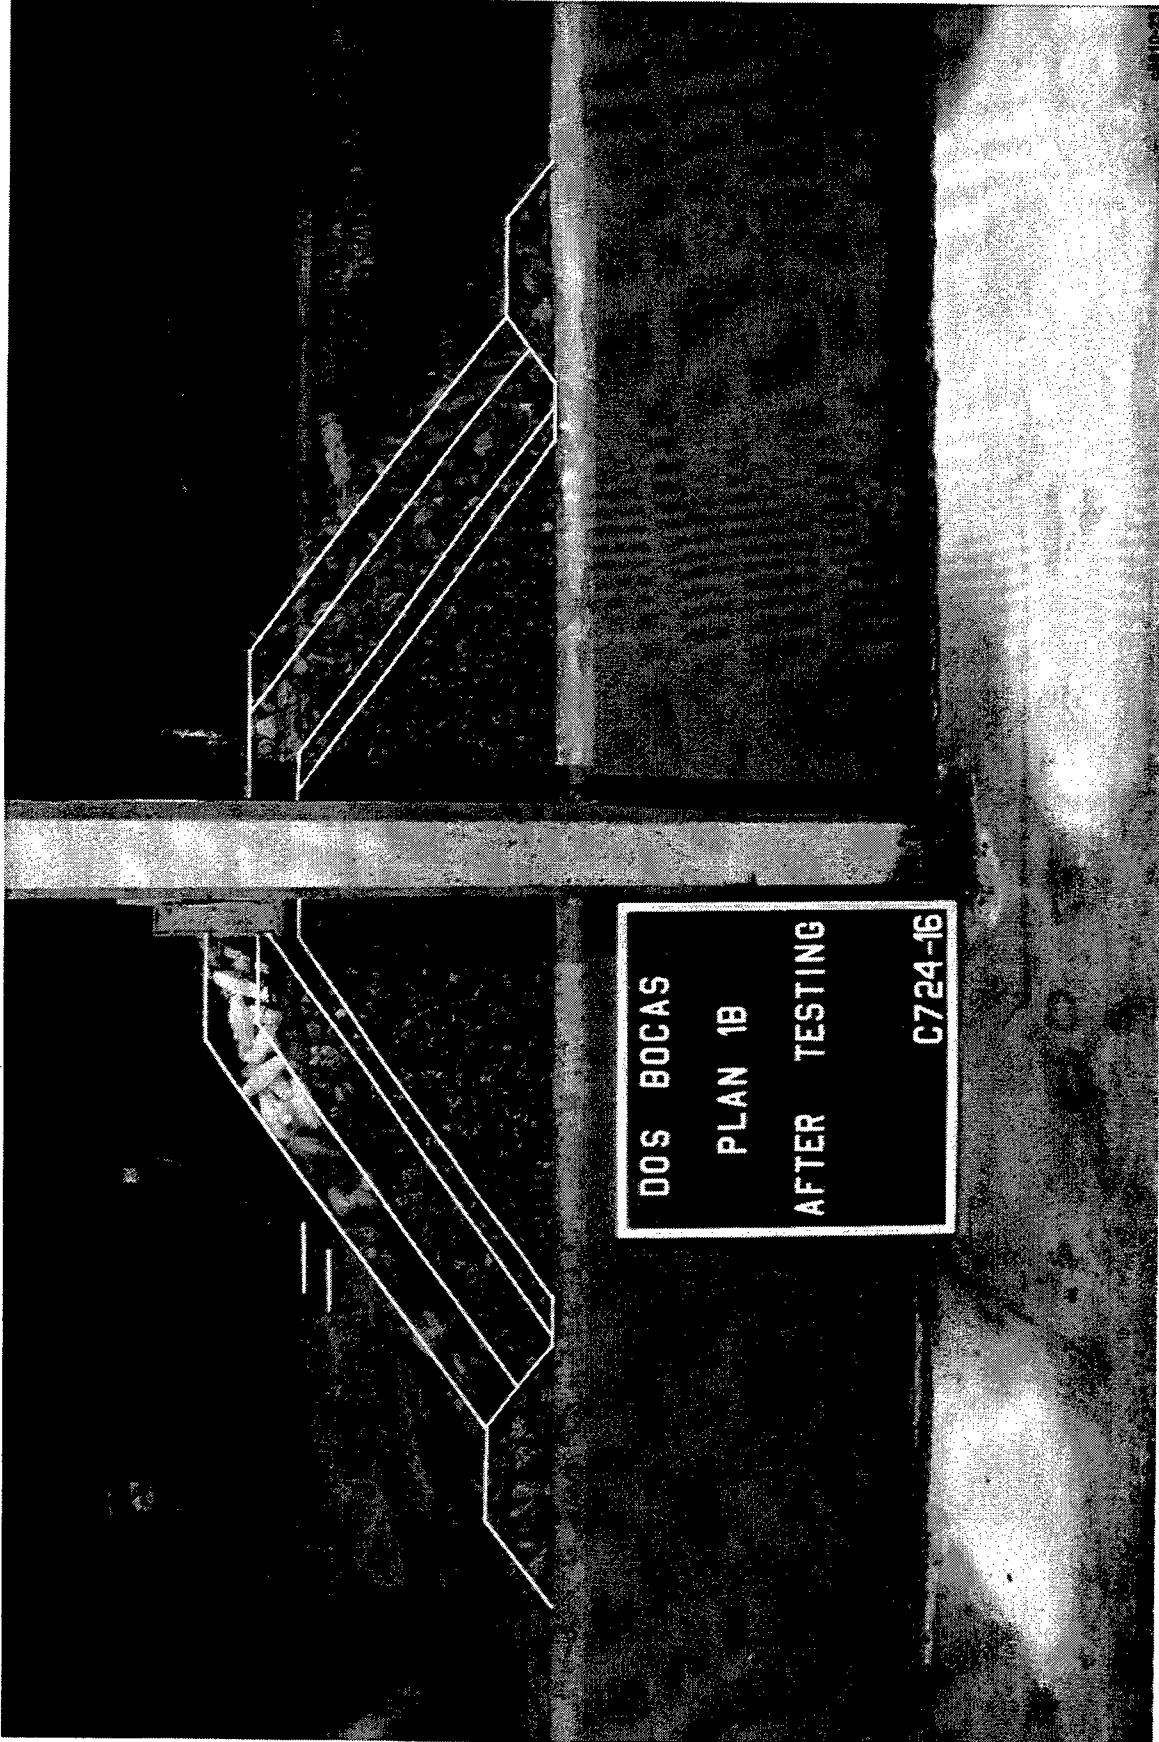


Photo 16. End view of Plan 1B at the conclusion of testing



Photo 17. Sea-side view of Plan 1B at the conclusion of testing


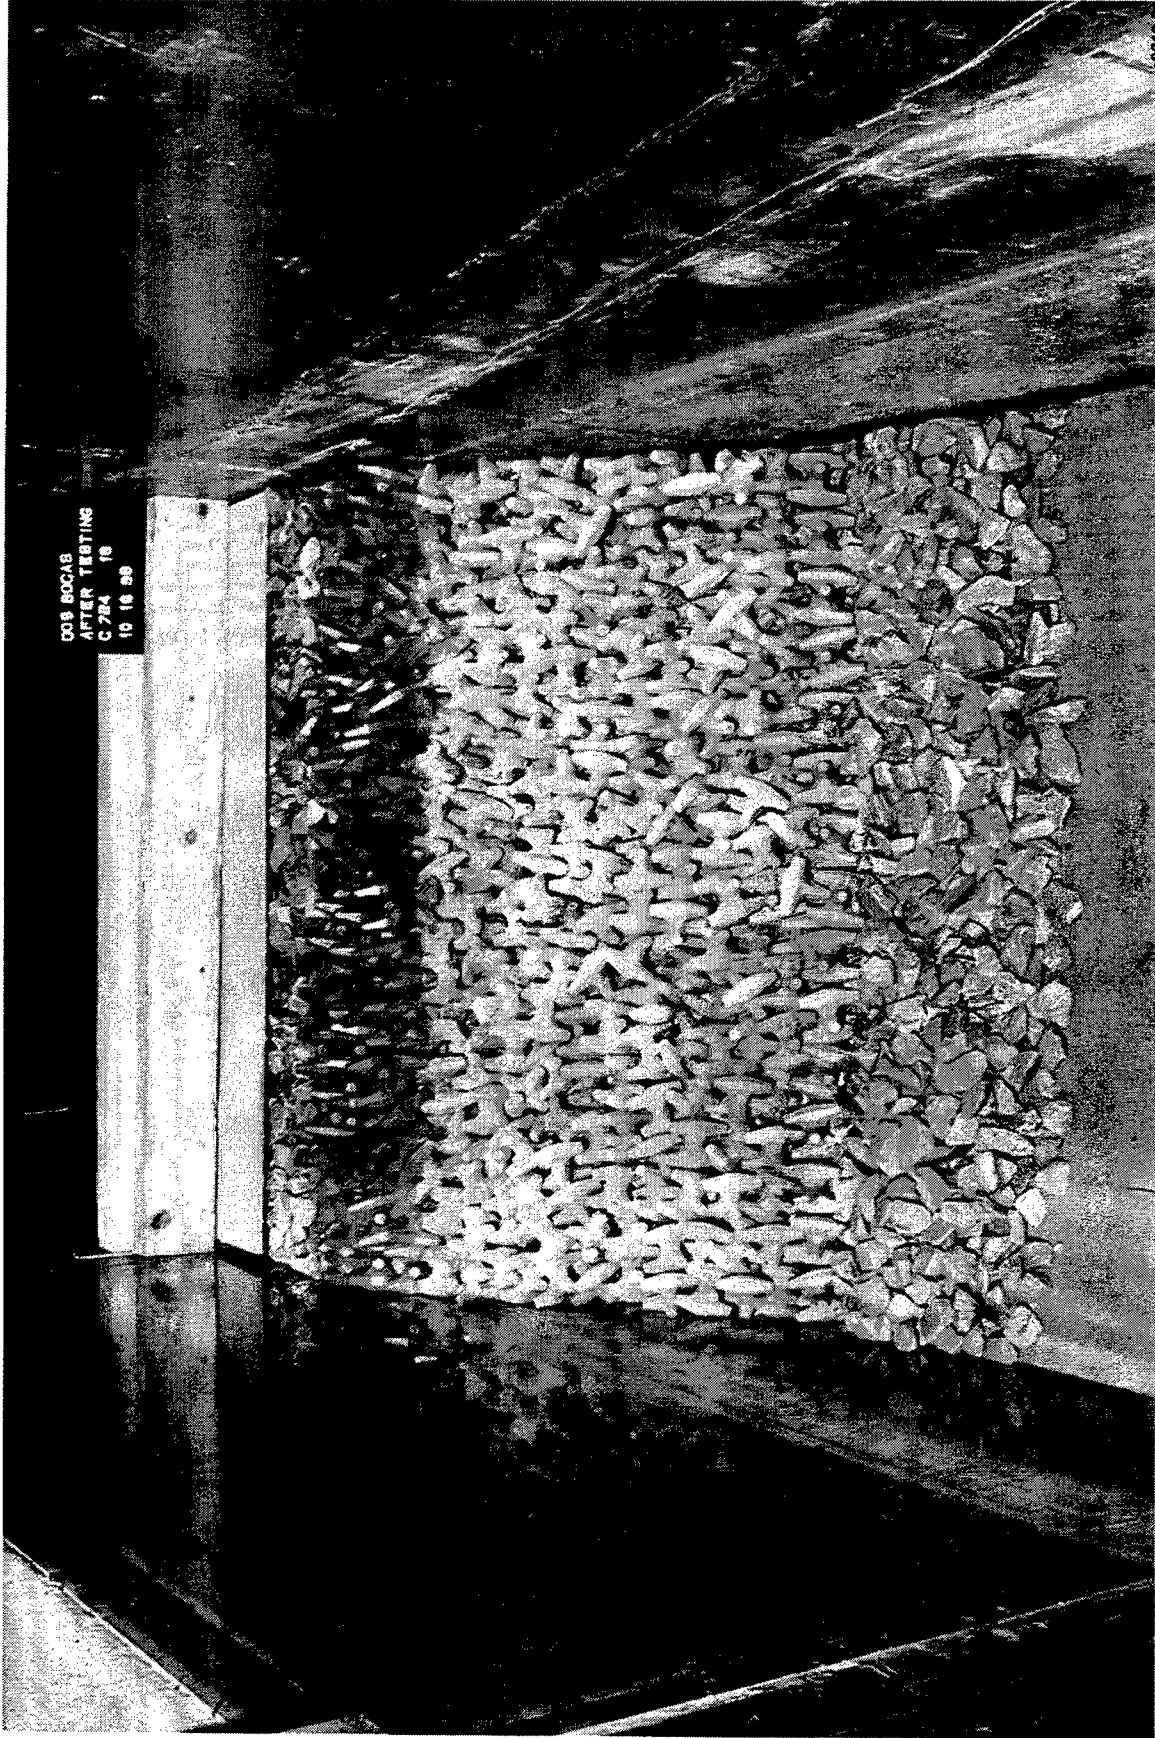


Photo 18. Harbor-side view of Plan 1B at the conclusion of testing

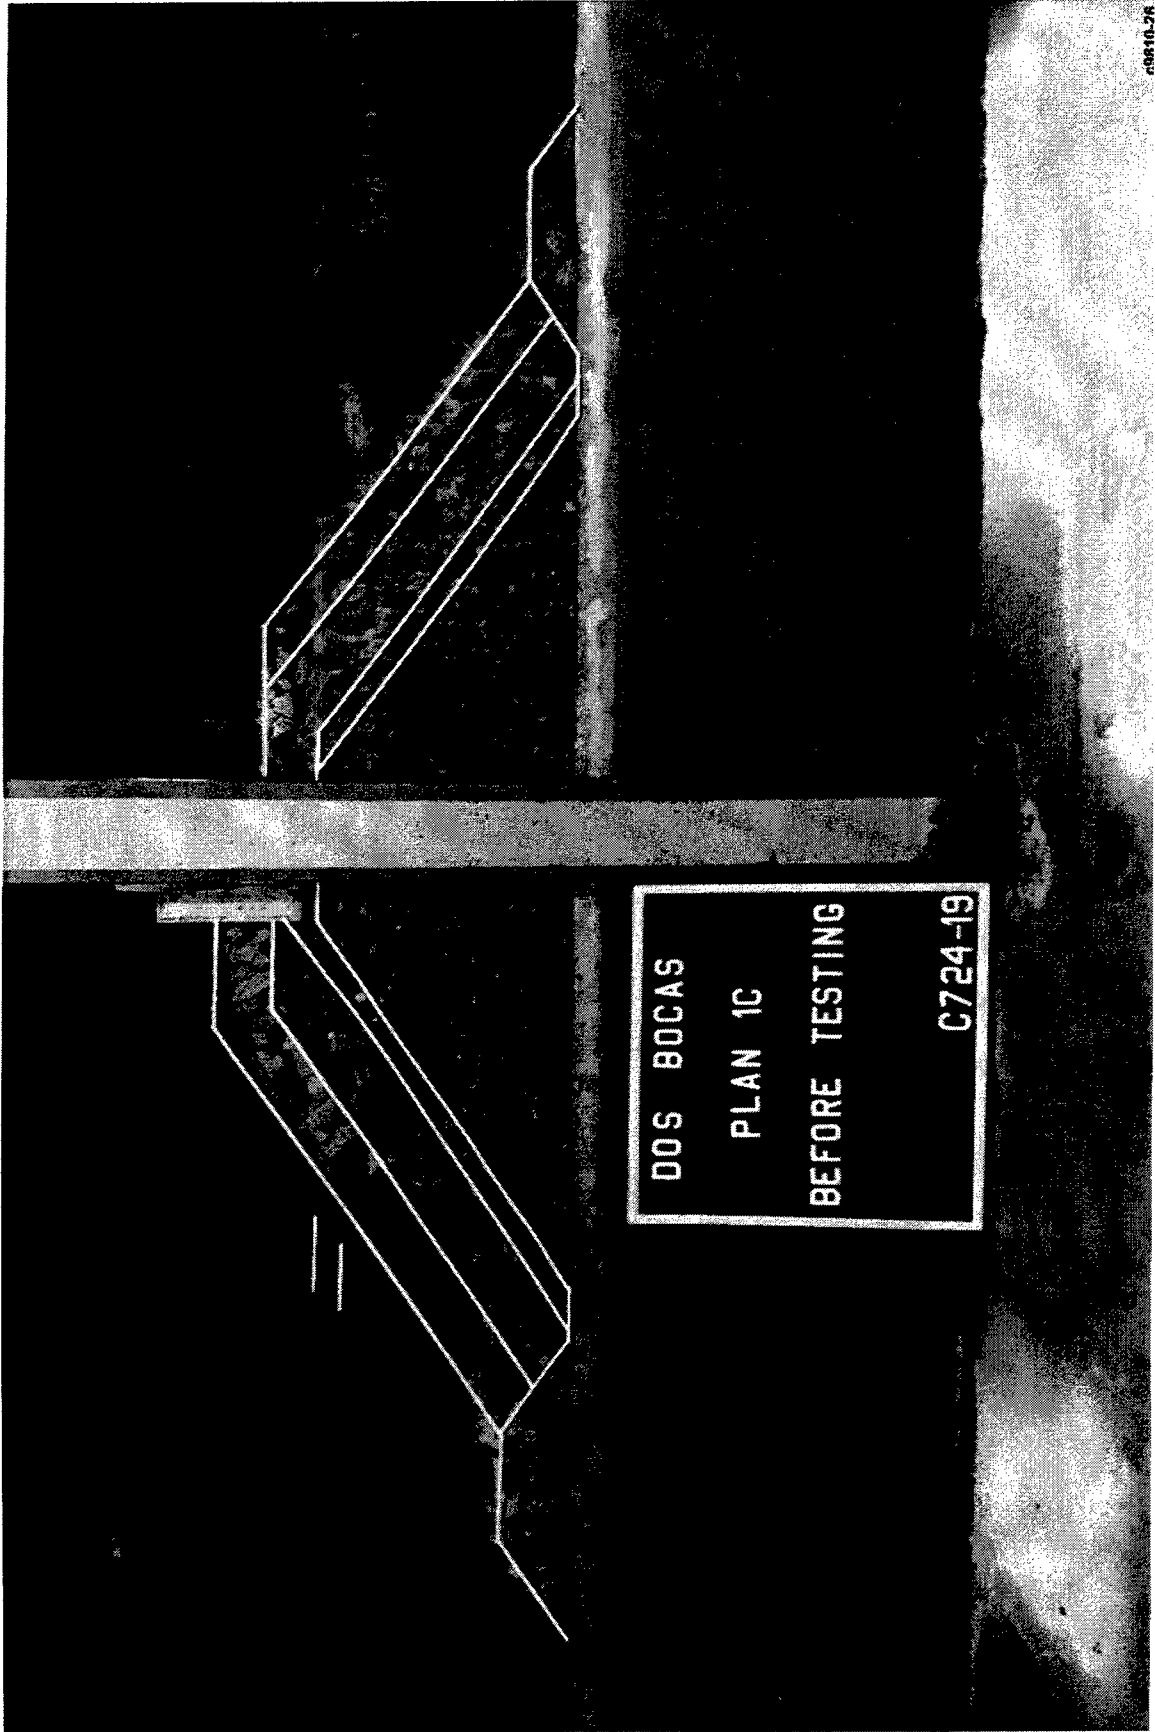

DOS BOCAS
PLAN 1C
BEFORE TESTING
C724-19

Photo 19. End view of Plan 1C before wave attack

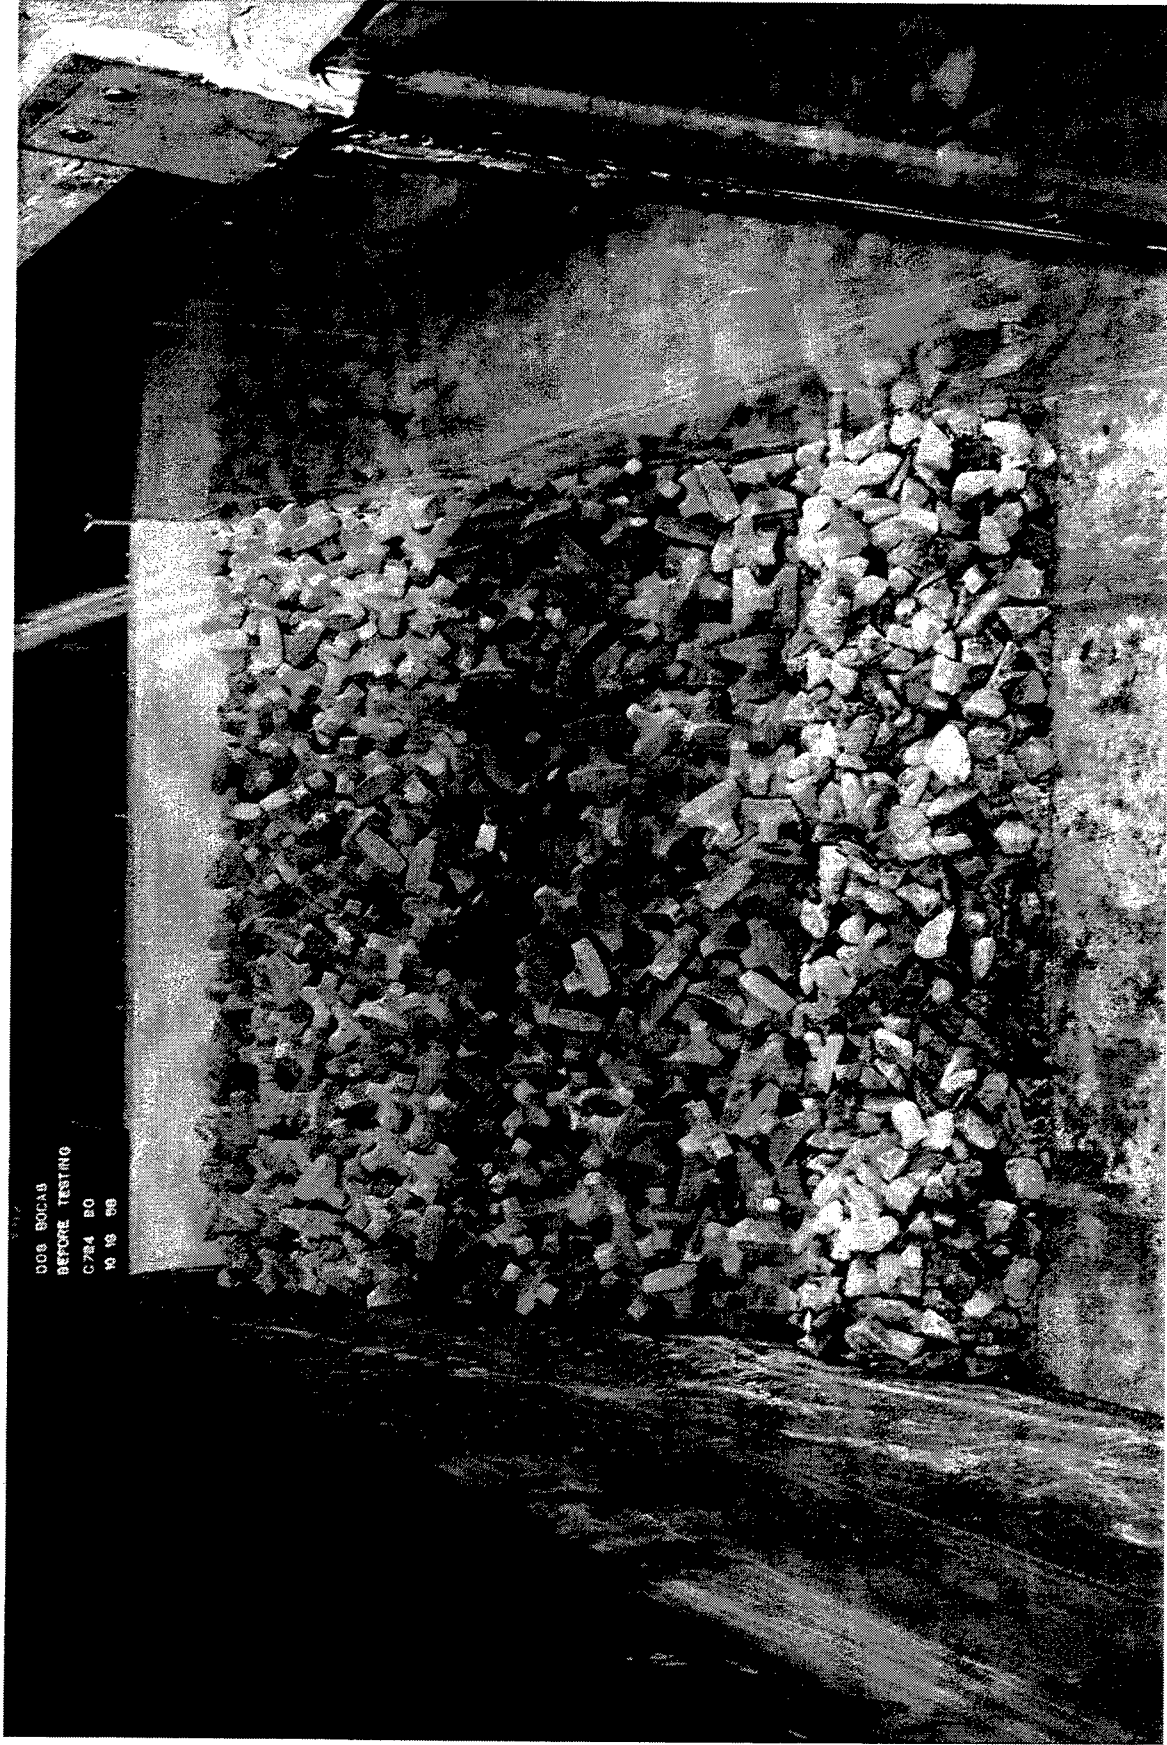


Photo 20. Sea-side view of Plan 1C before wave attack

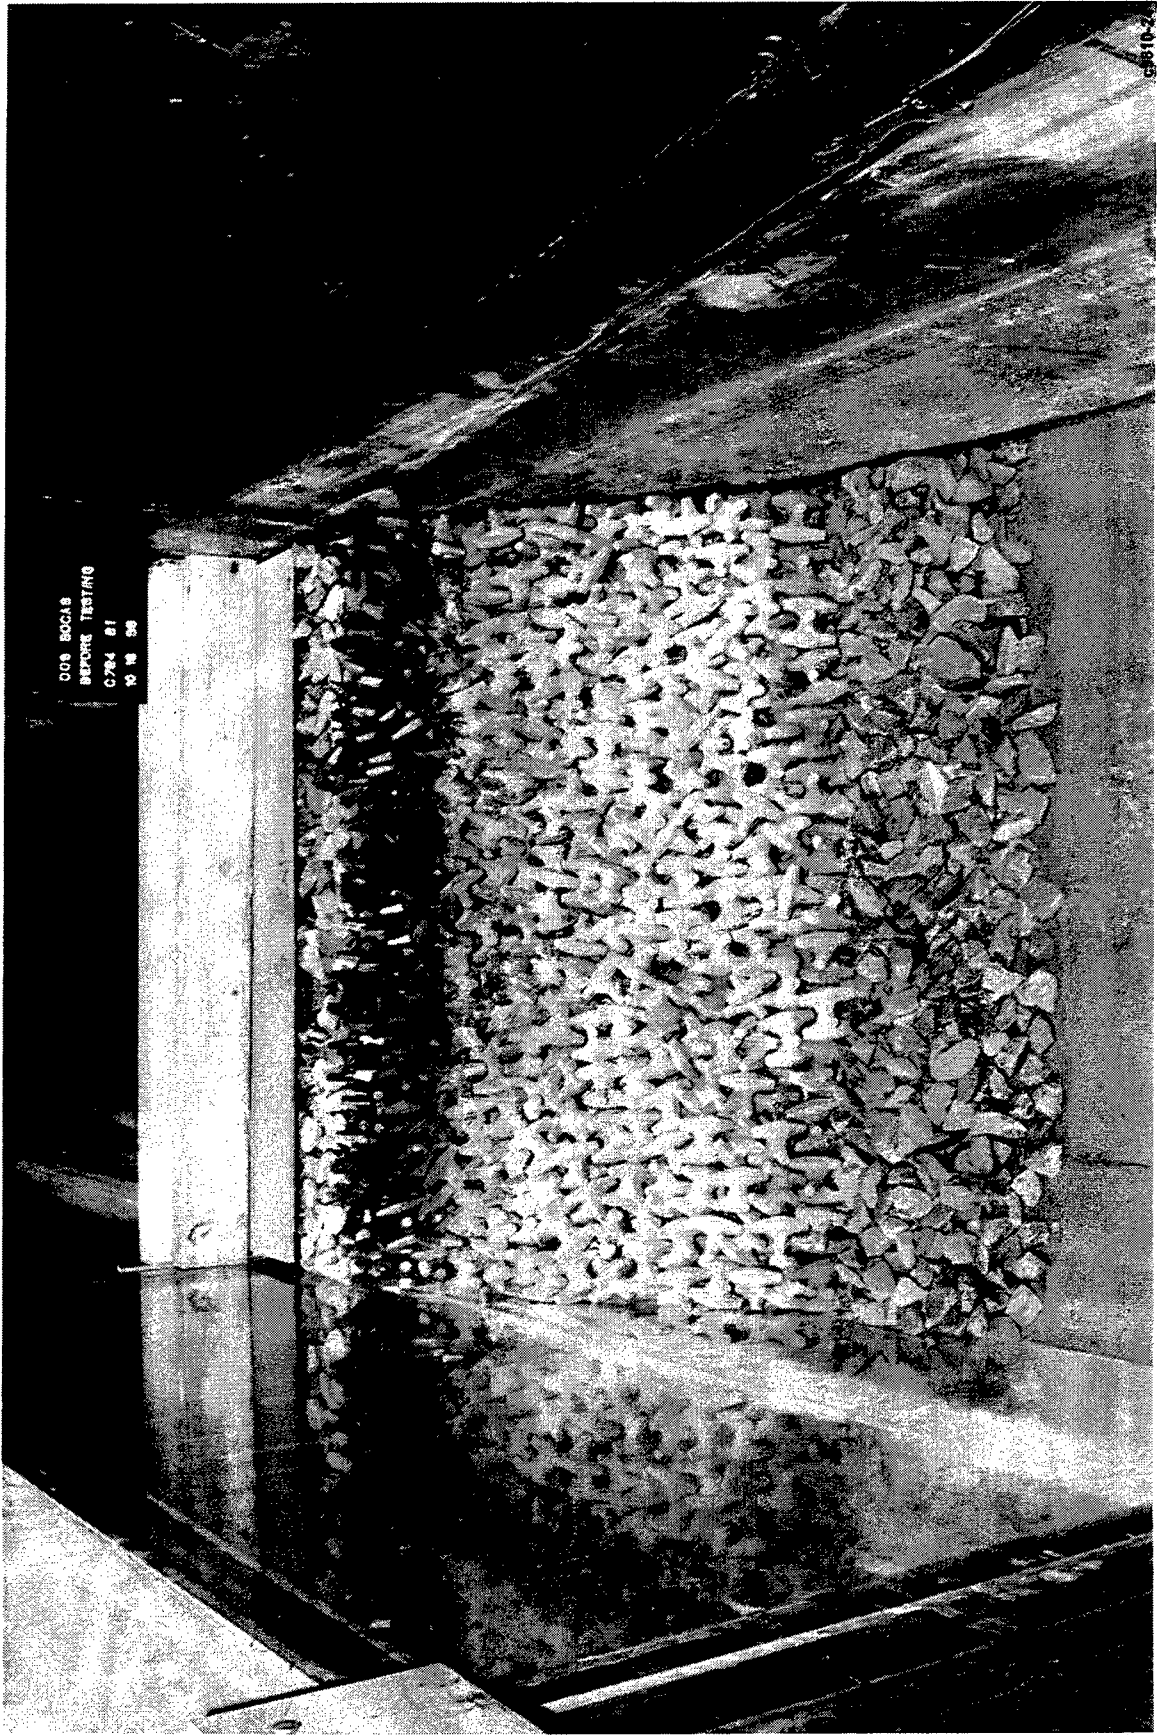


Photo 21. Harbor-side view of Plan 1C before wave attack

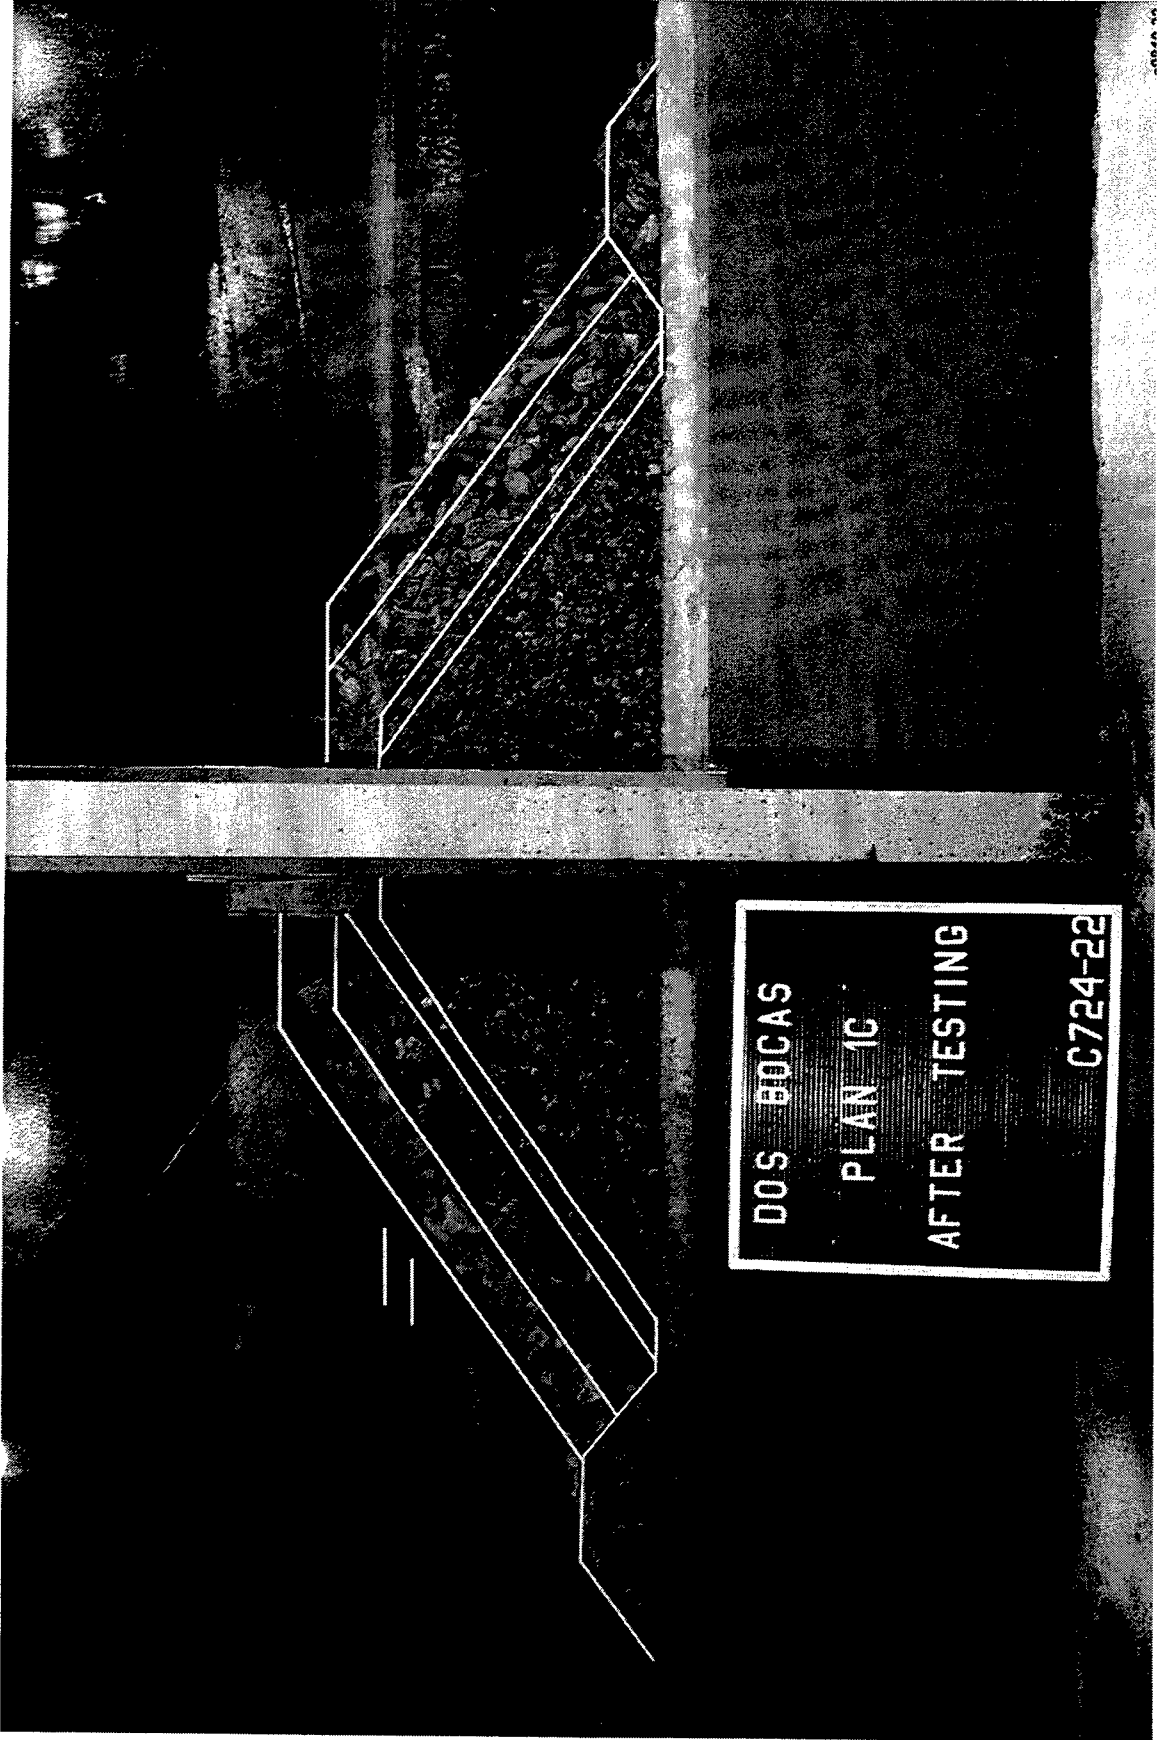


Photo 22. End view of Plan 1C at the conclusion of testing

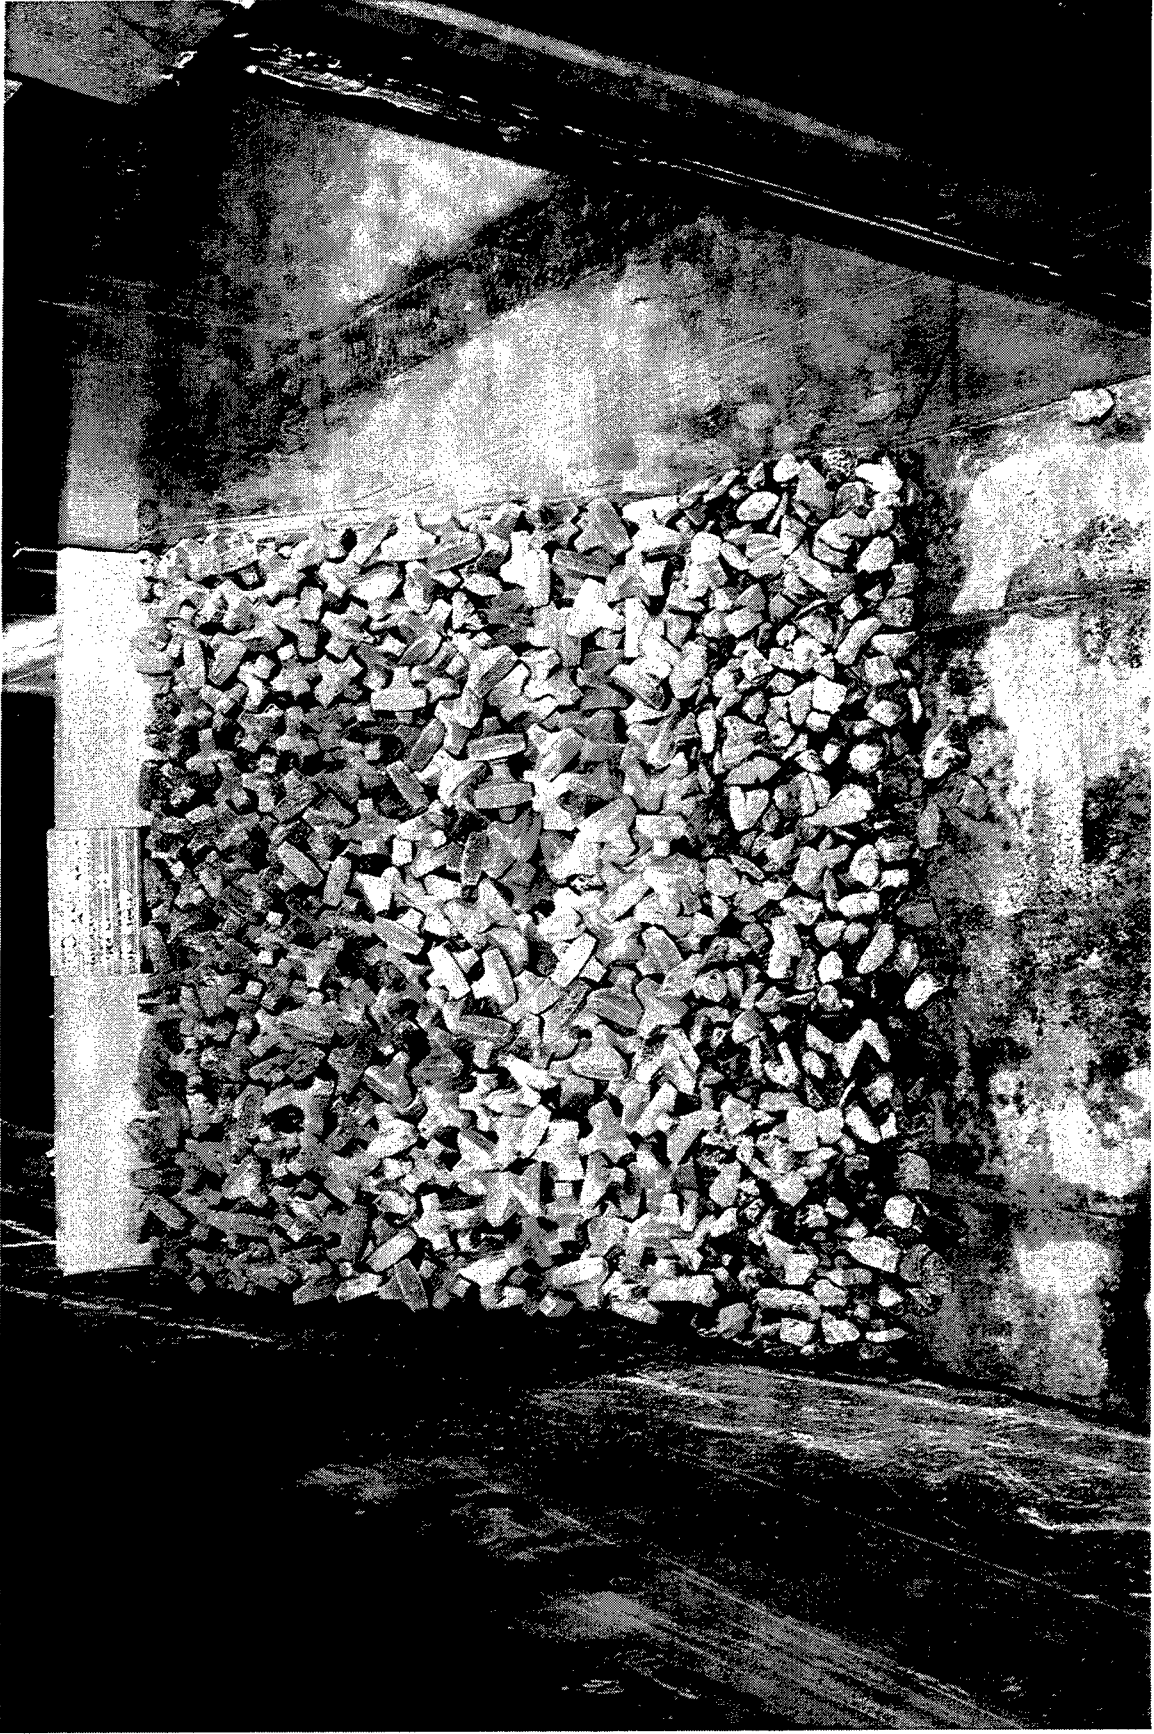


Photo 23. Sea-side view of Plan 1C at the conclusion of testing



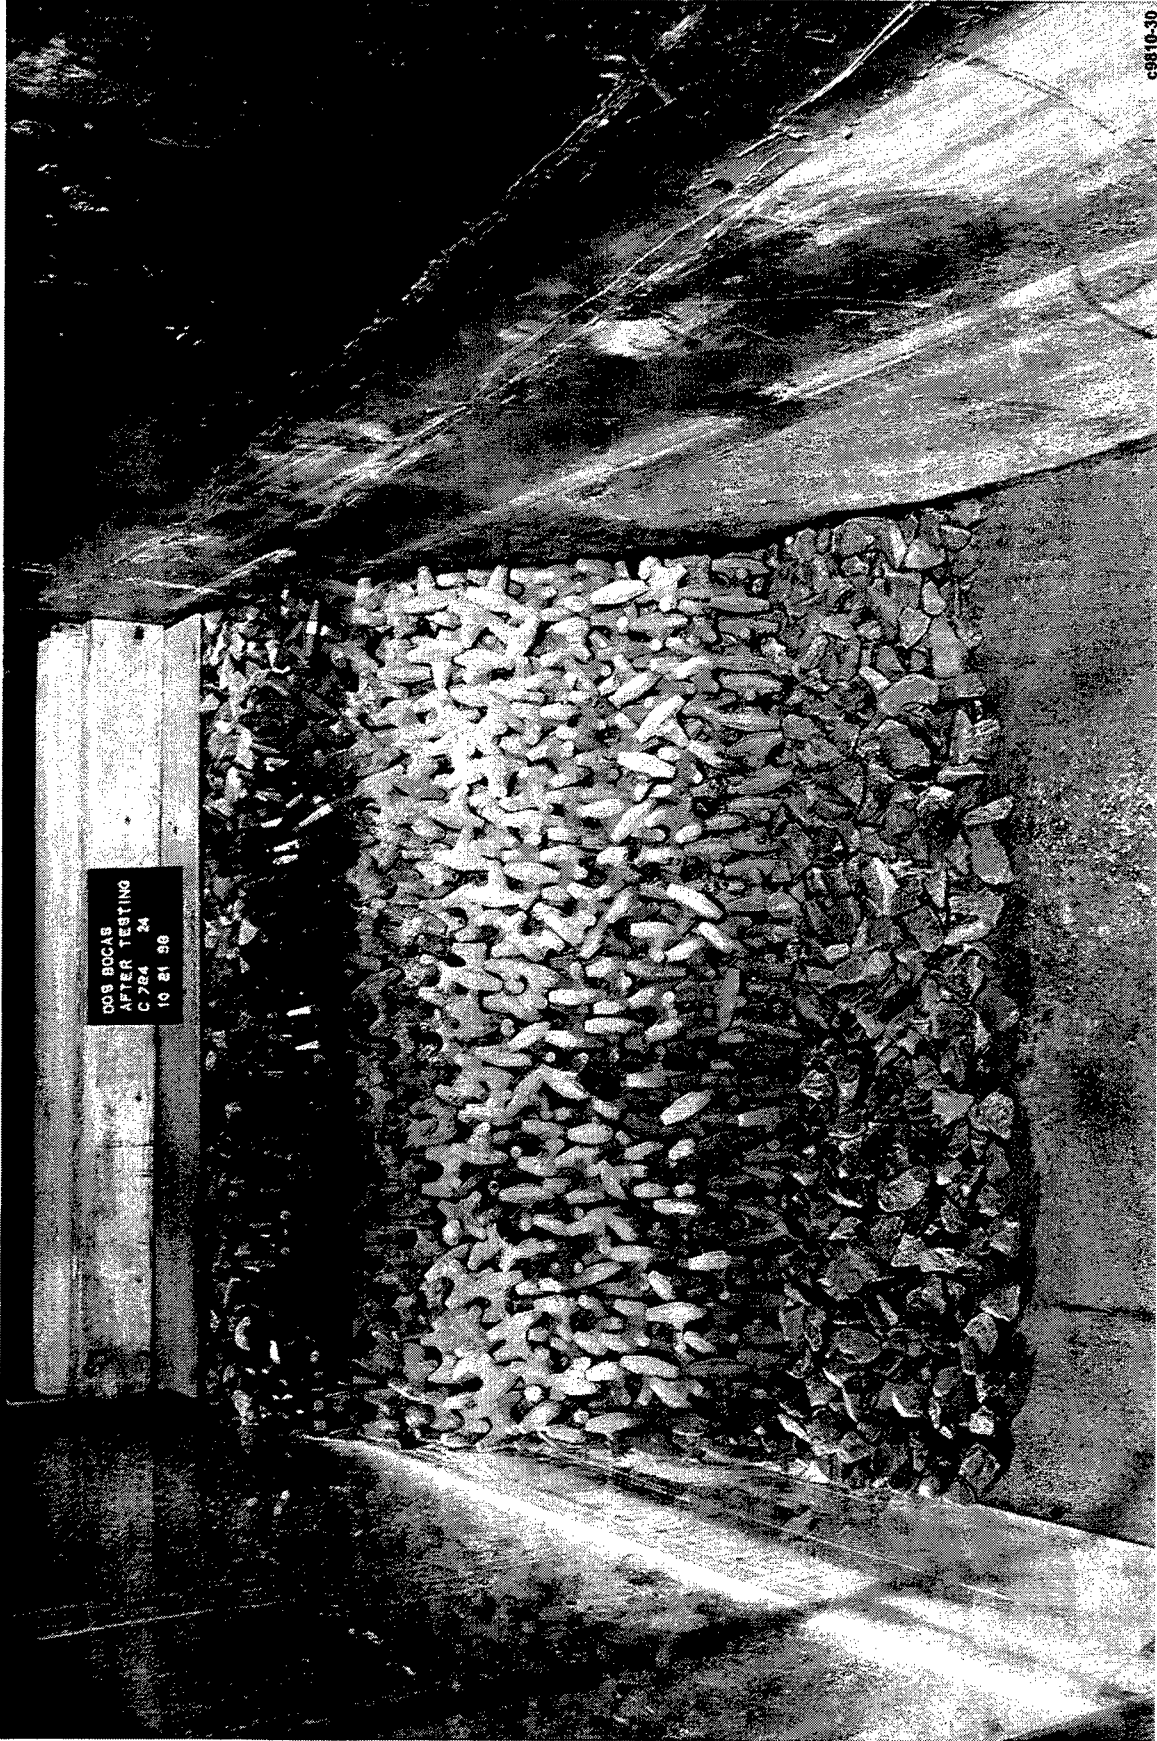


Photo 24. Harbor-side view of Plan 1C at the conclusion of testing

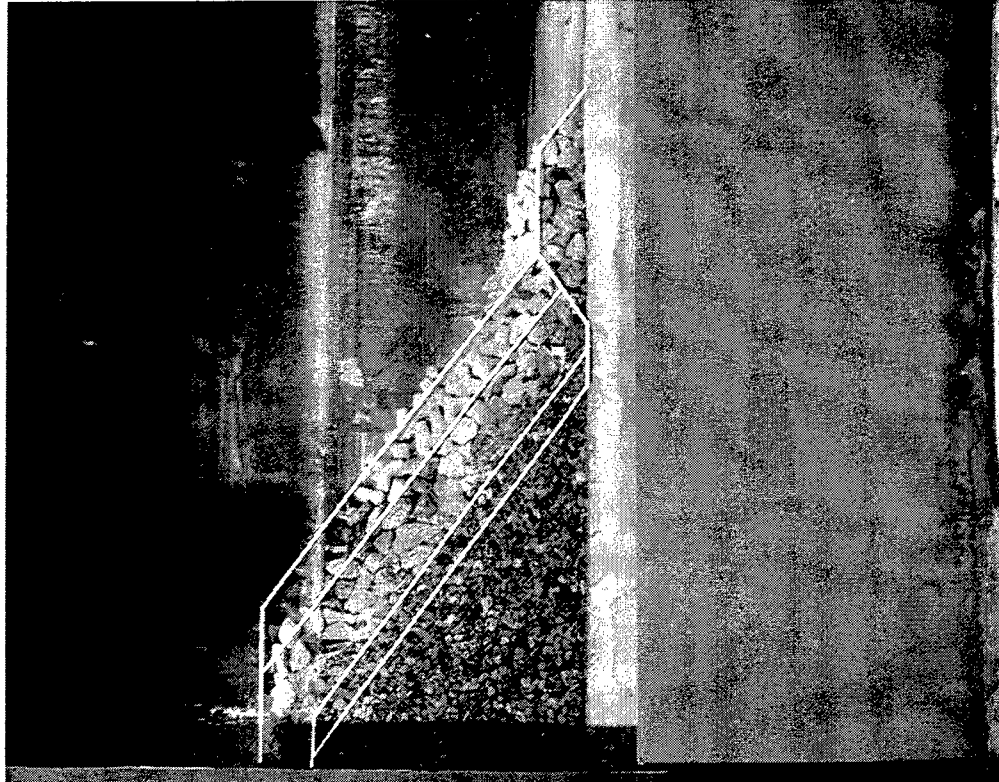

C9810-28

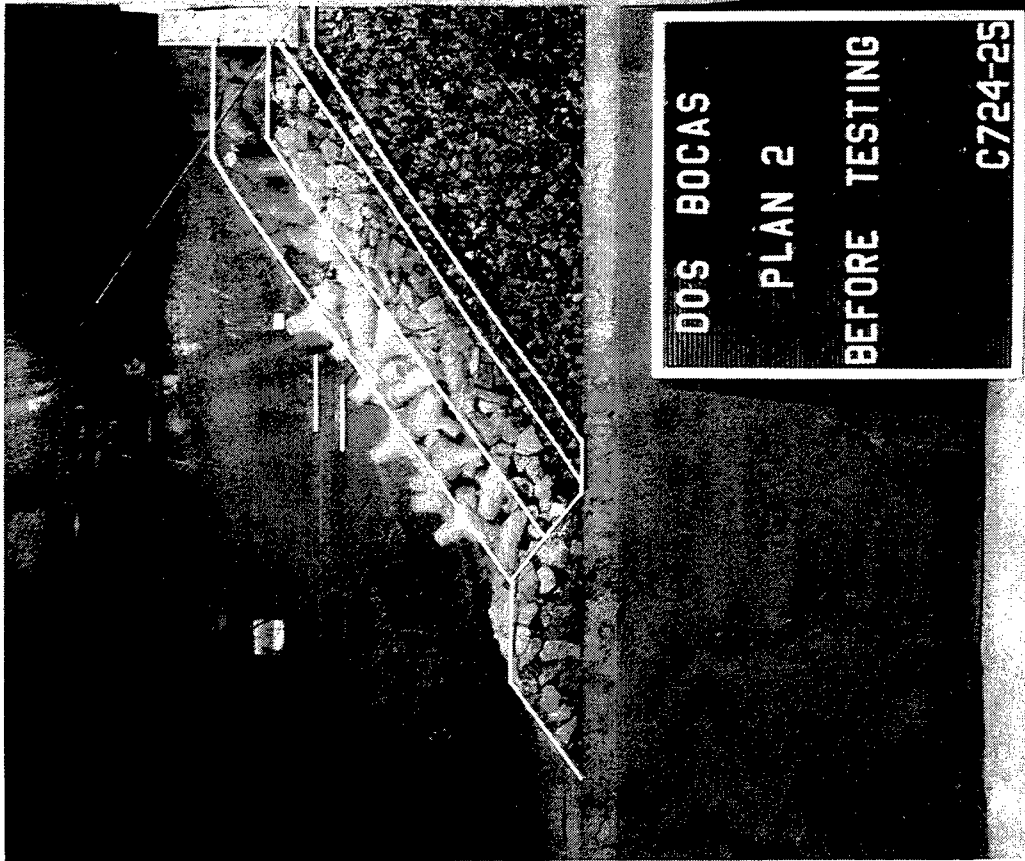

005 BOCAS
PLAN 2
BEFORE TESTING
C724-25

Photo 25. End view of Plan 2 before wave attack



008 80CAG
BEFORE TESTING
C784 28
10 22 '96

Photo 26. Sea-side view of Plan 2 before wave attack

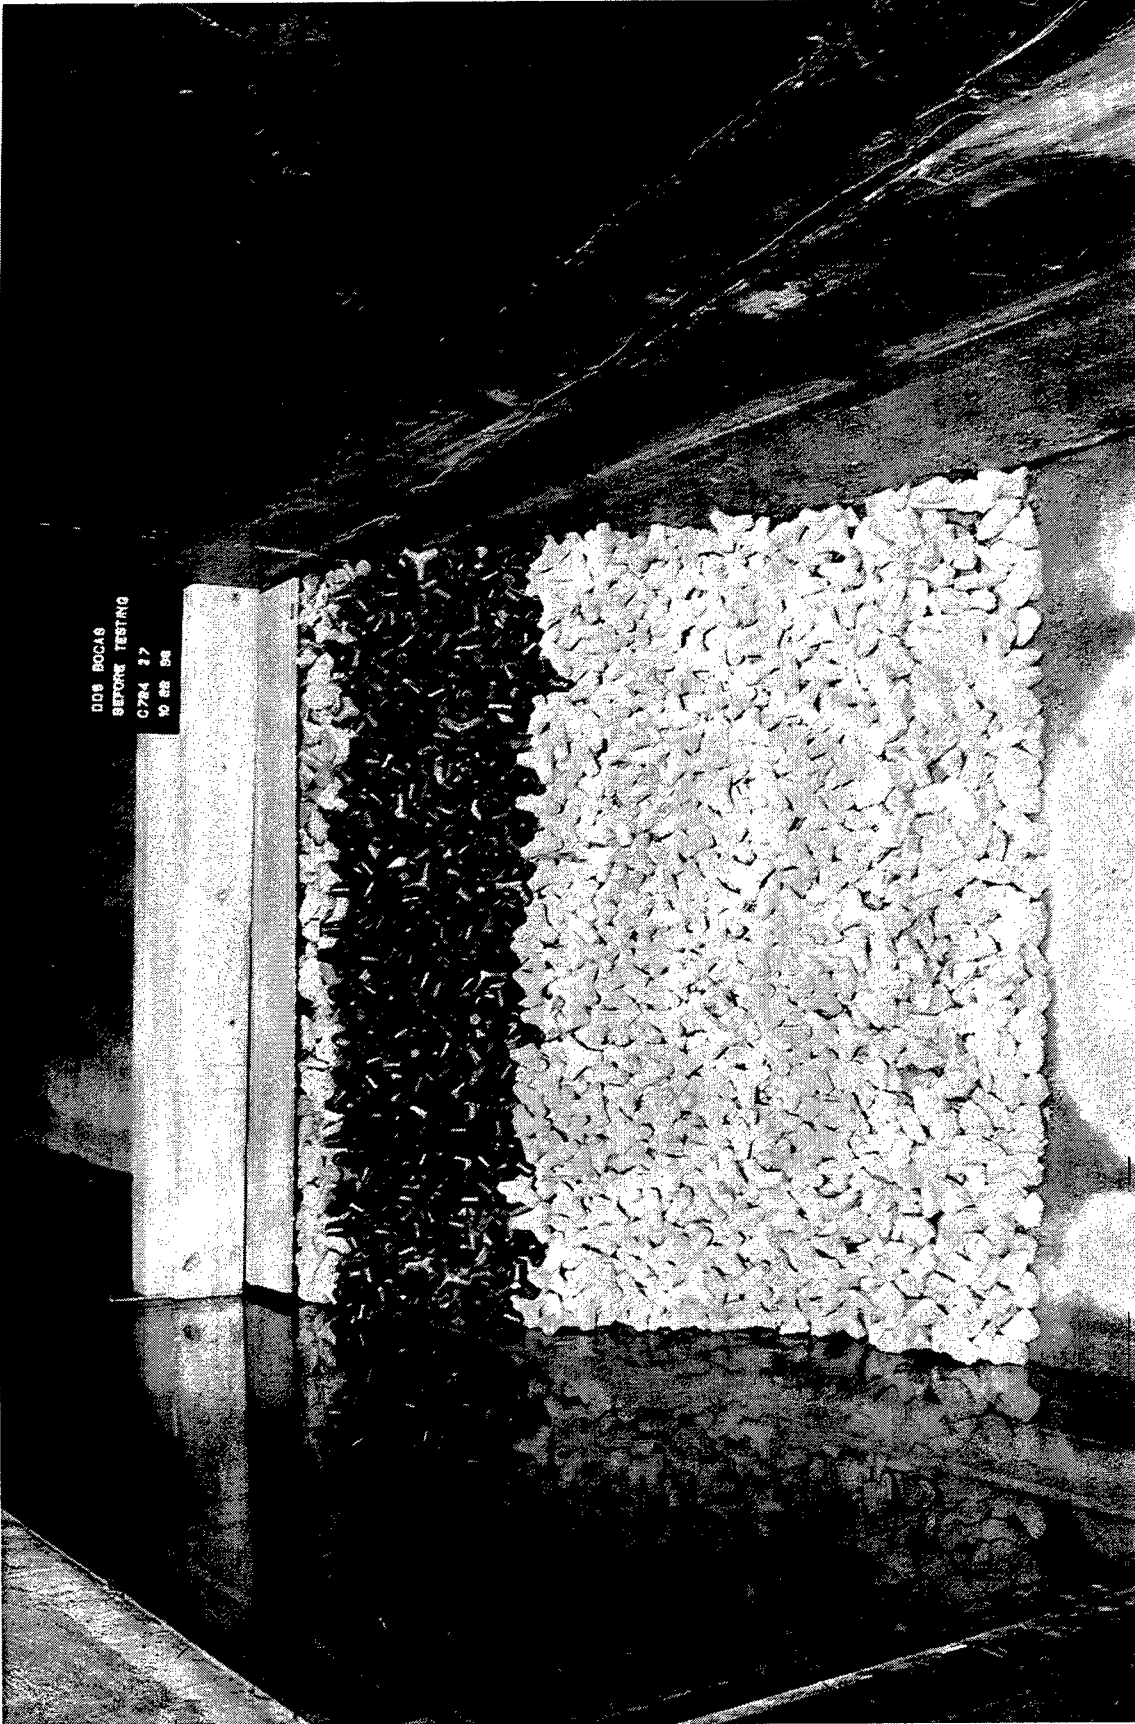


Photo 27. Harbor-side view of Plan 2 before wave attack



c8810-35

Photo 28. End view of Plan 2 at the conclusion of testing



Photo 29. Sea-side view of Plan 2 at the conclusion of testing

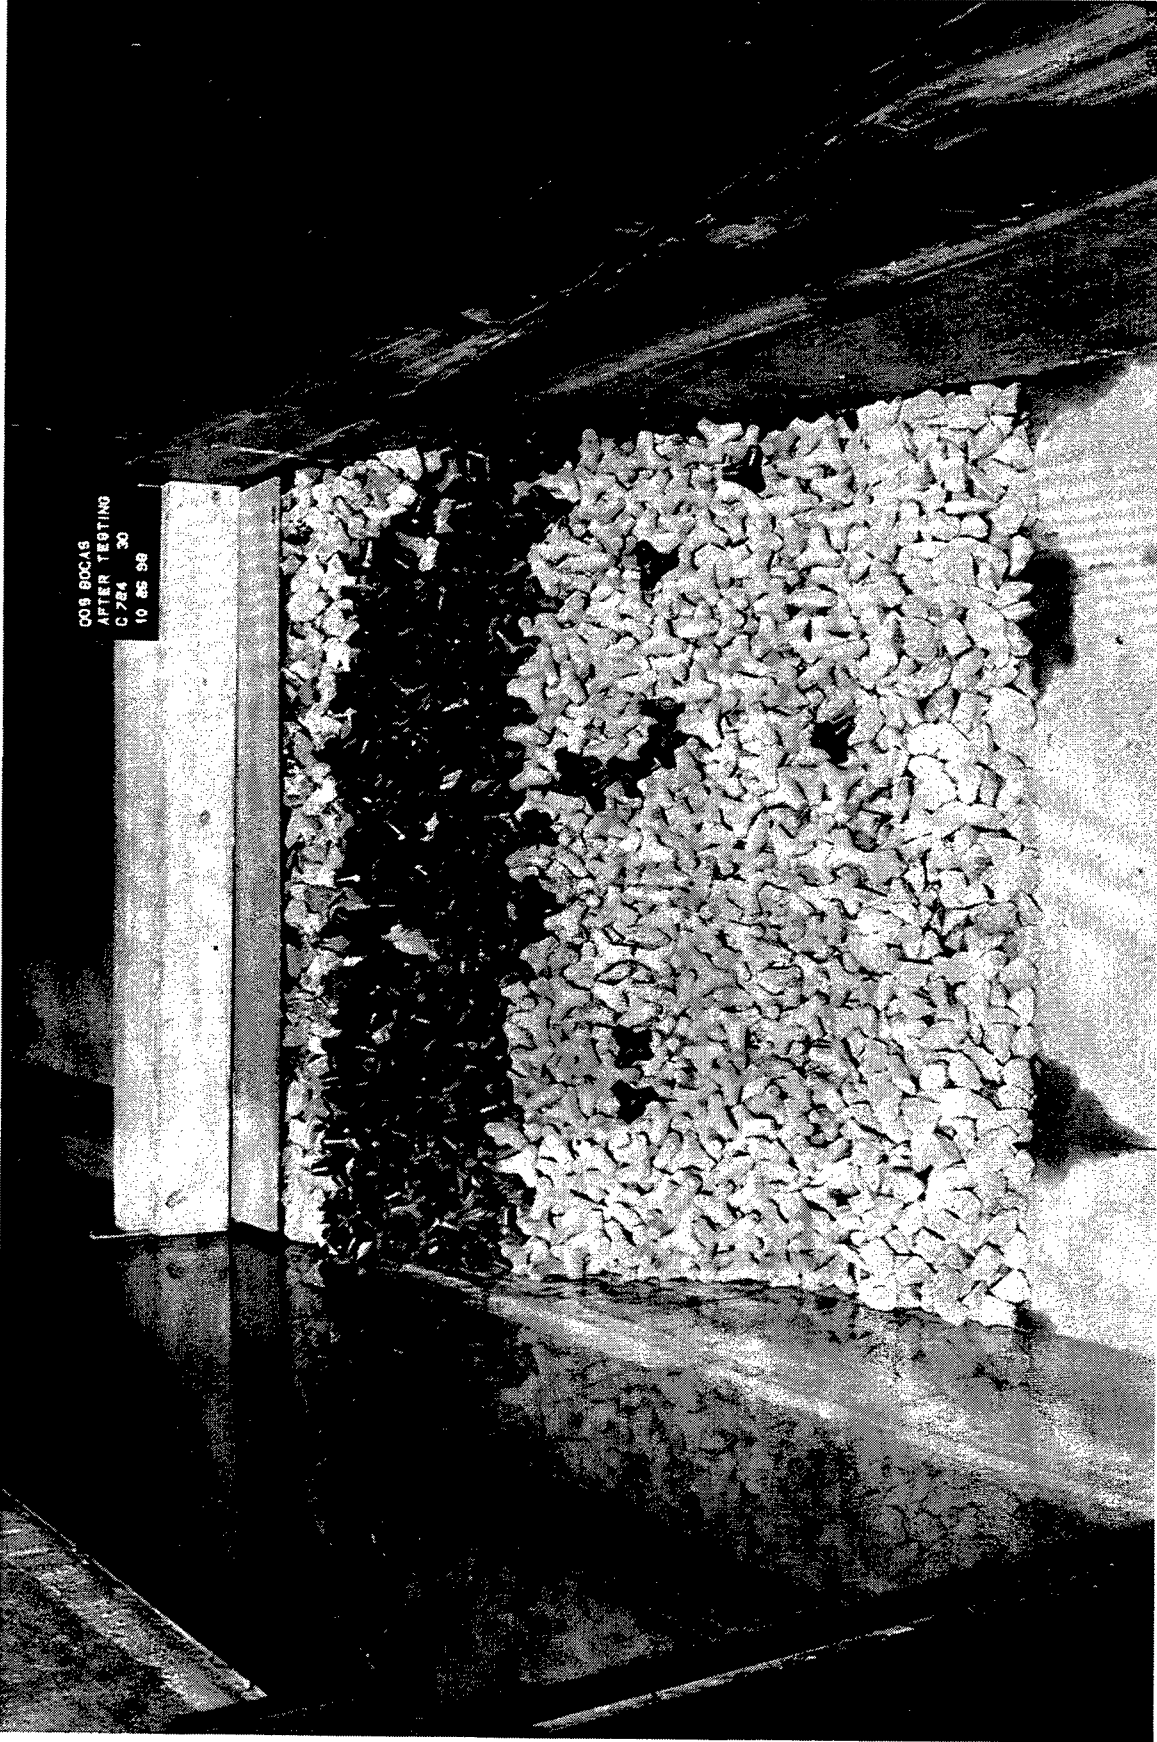


Photo 30. Harbor-side view of Plan 2 at the conclusion of testing

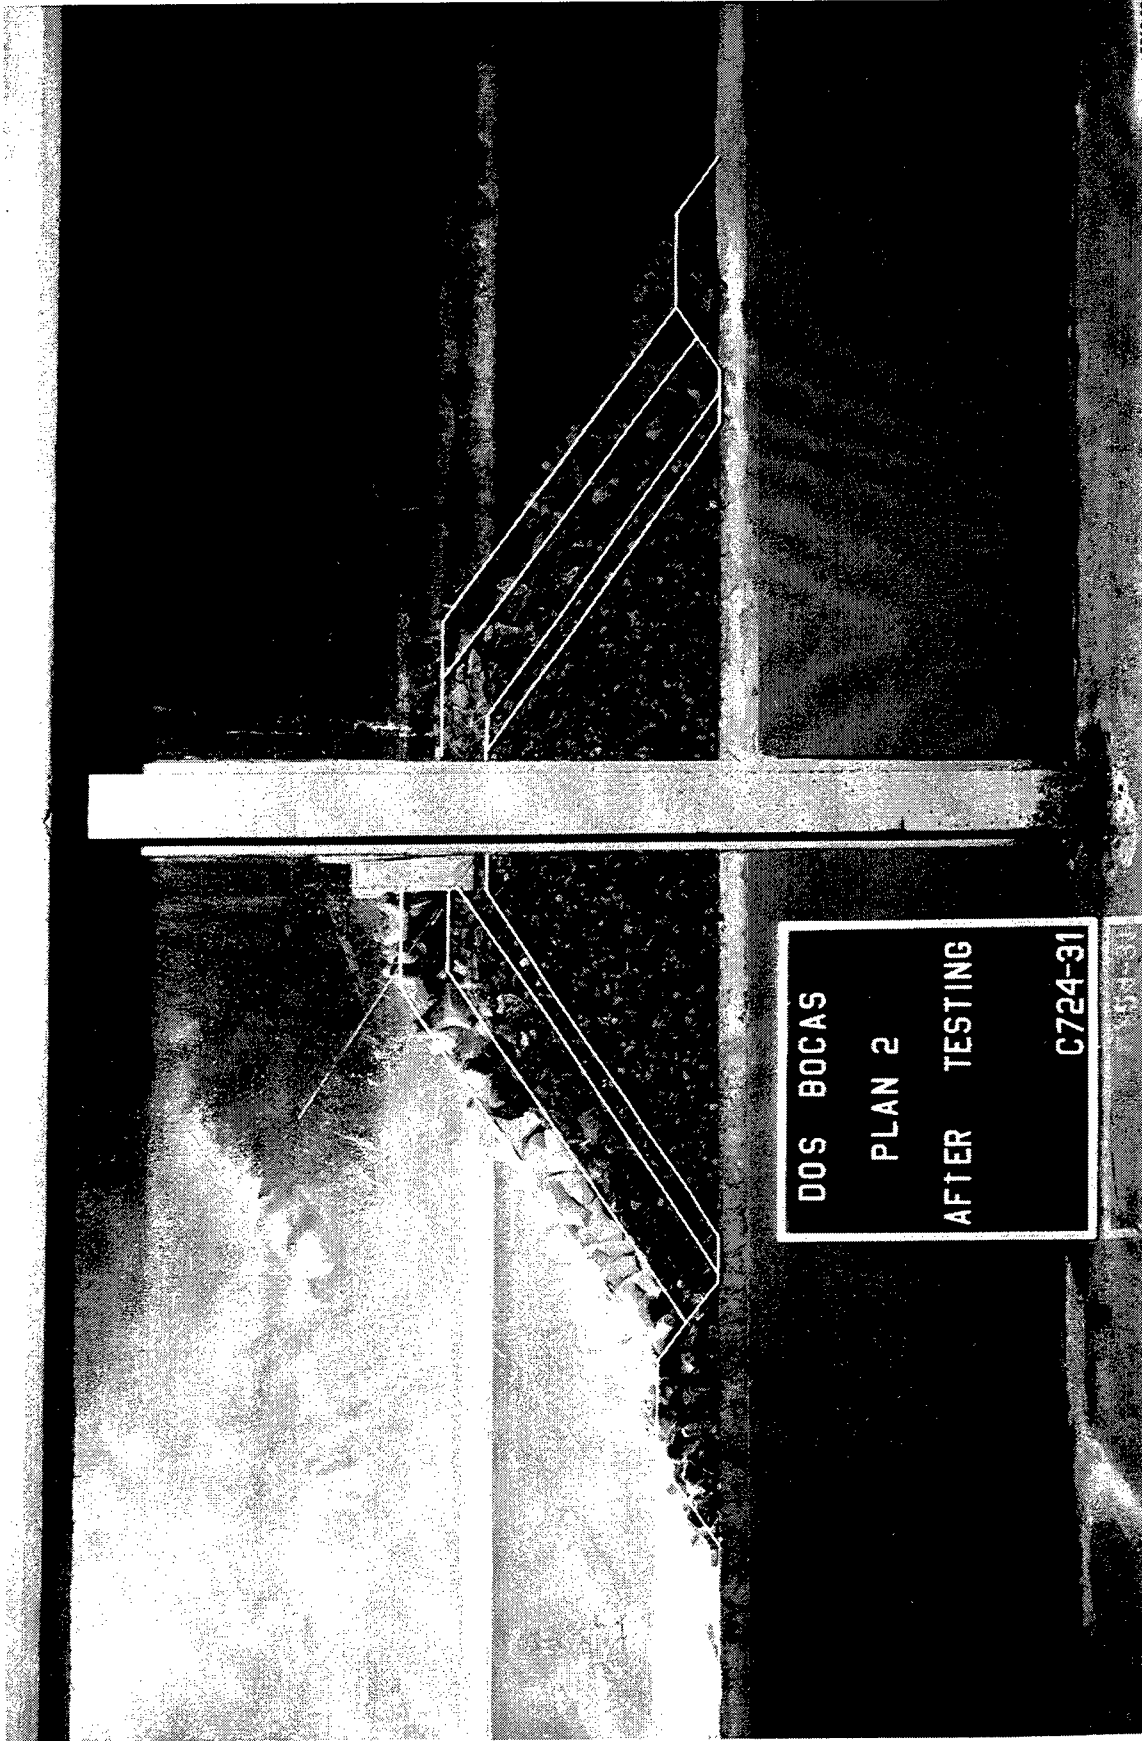


Photo 31. Repeat test of Plan 2. End view after attack of 5.5-meter waves


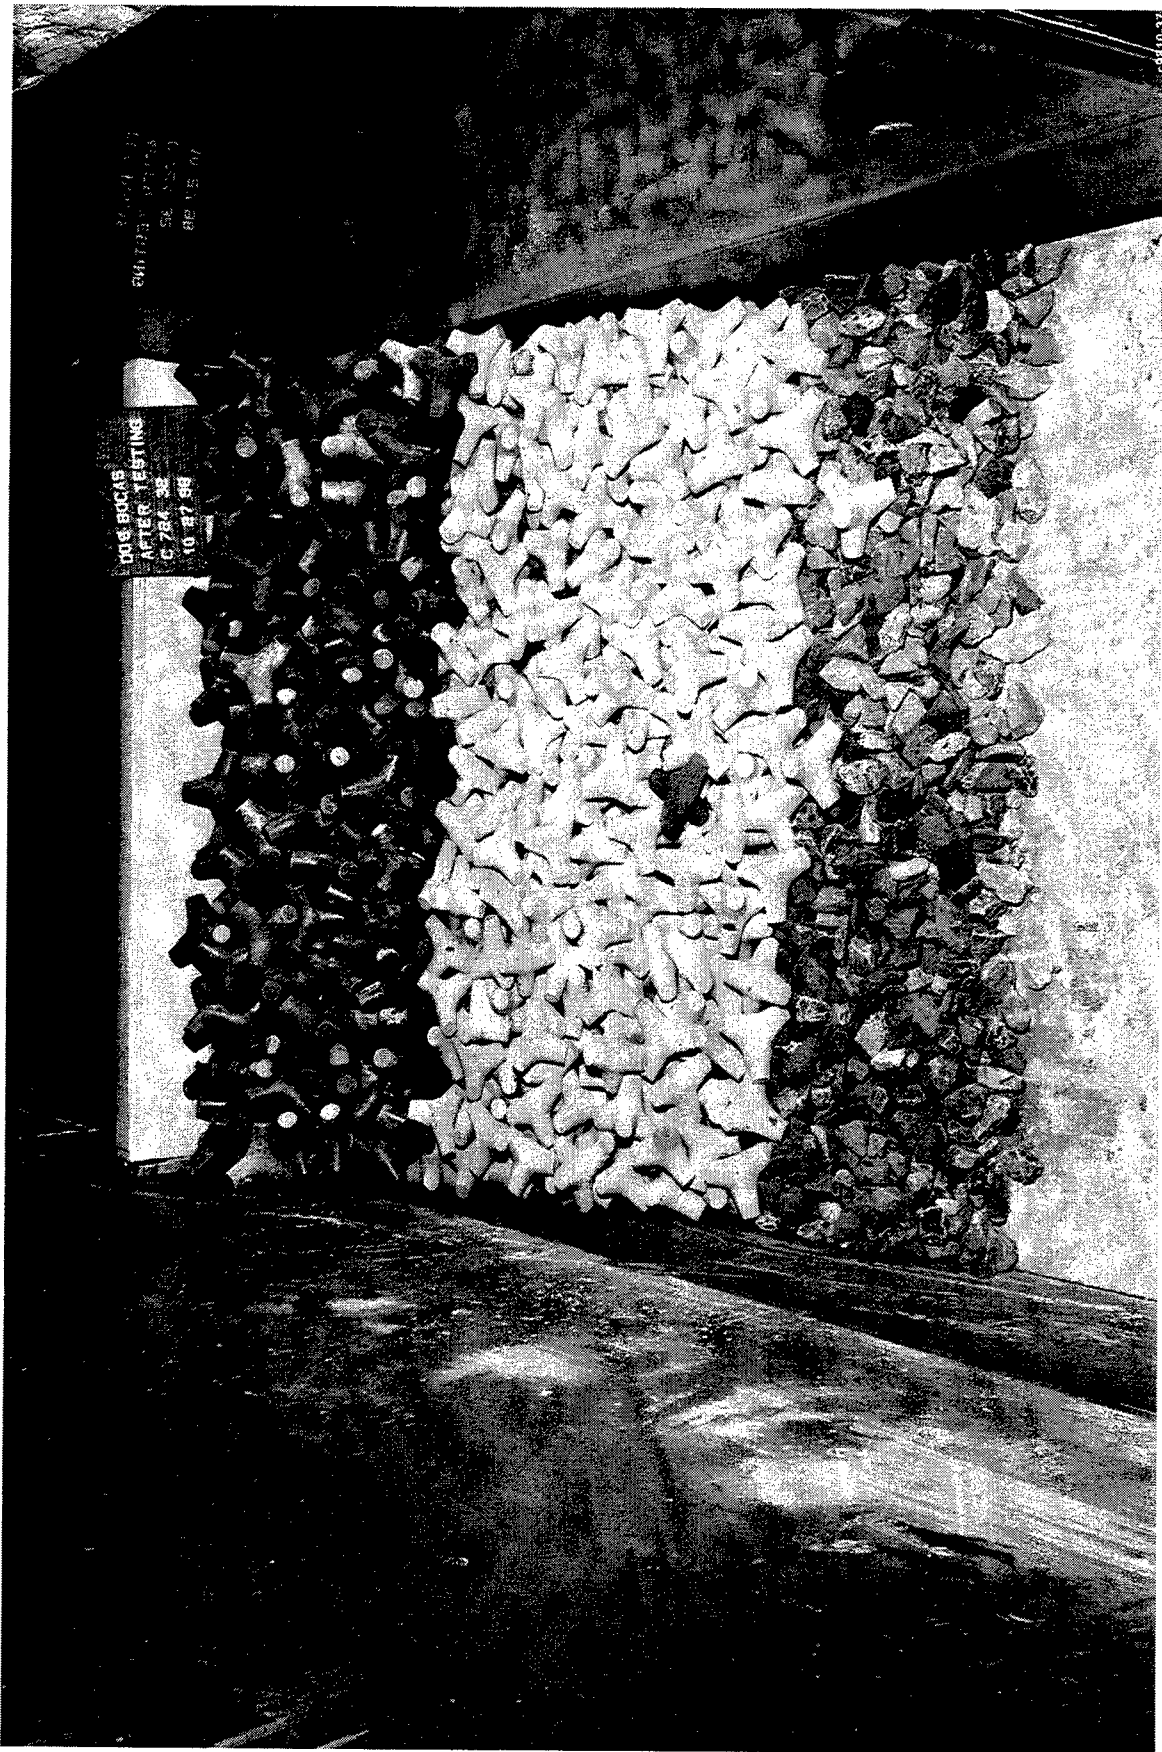


Photo 32. Repeat test of Plan 2. Sea-side view after attack of 5.5-meter waves

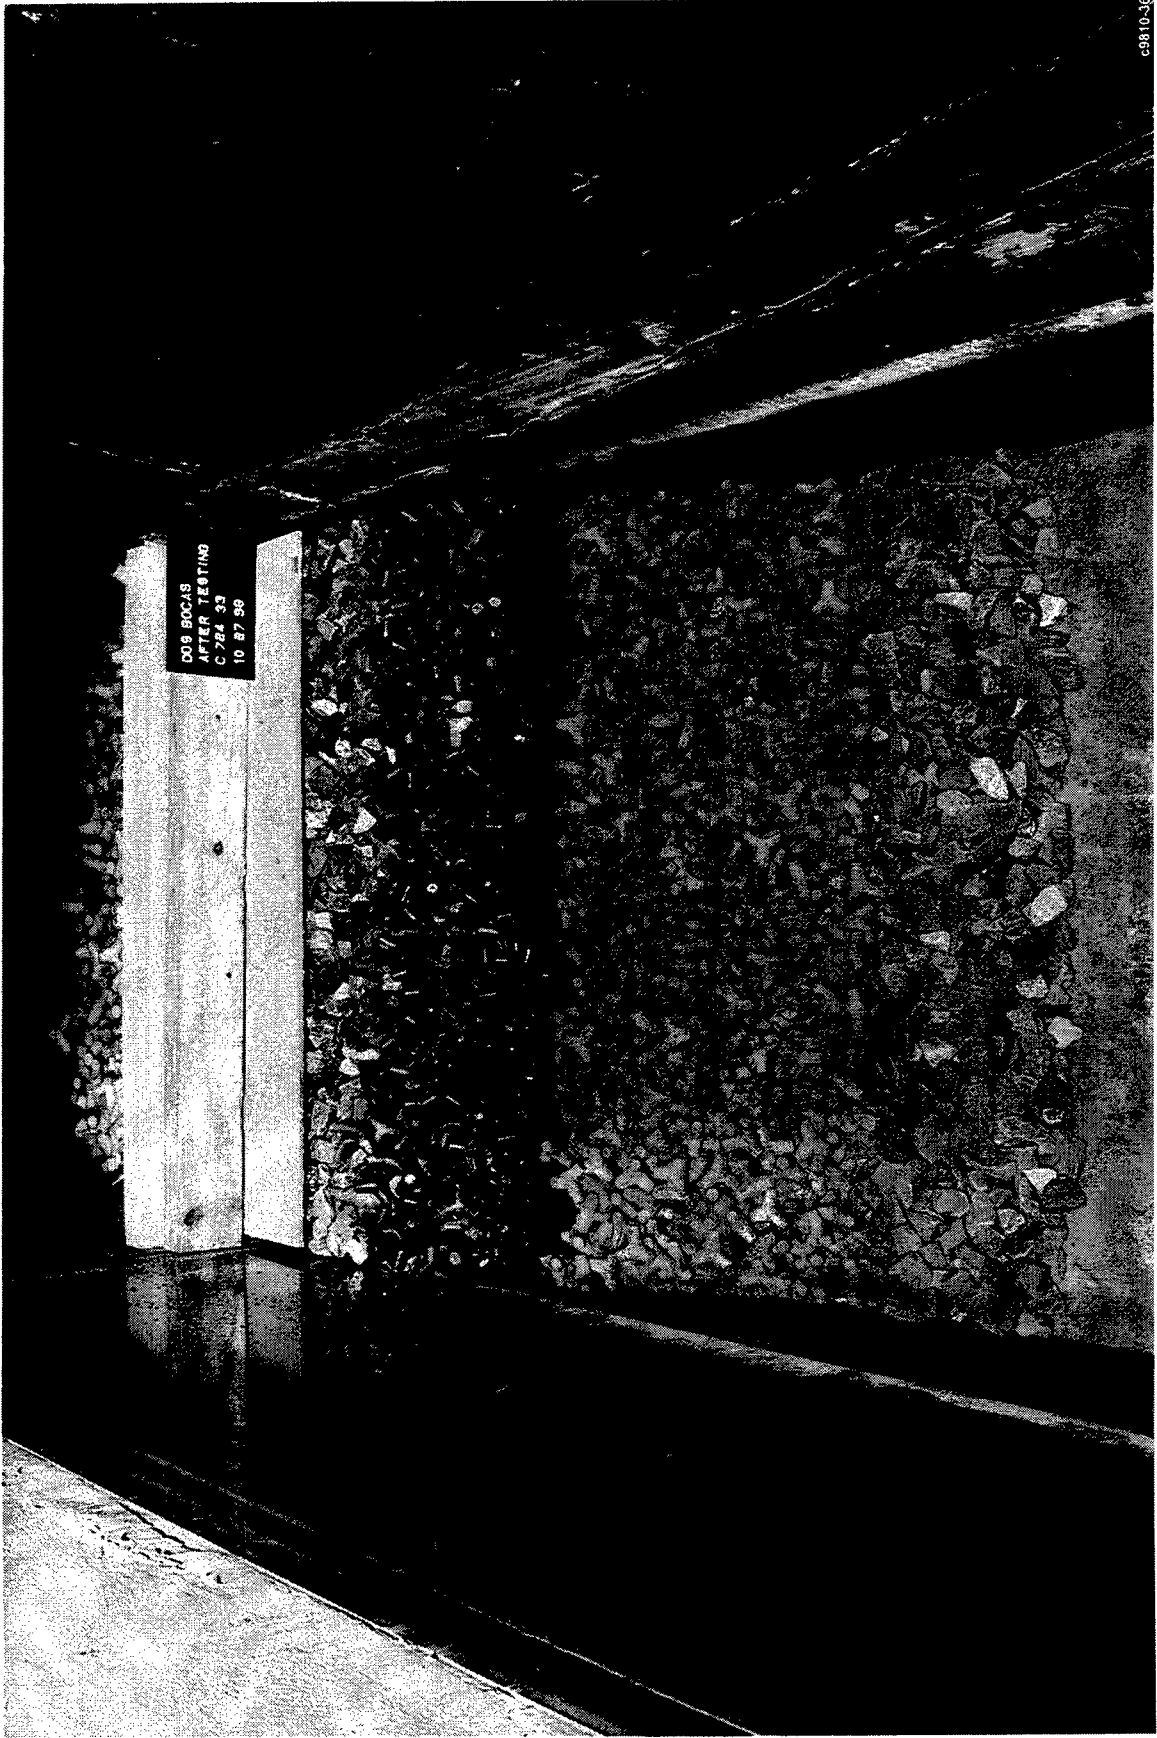

C9810-36

Photo 33. Repeat test of Plan 2. Harbor-side view after attack of 5.5-meter waves



Photo 34. Repeat test of Plan 2. End view of at the conclusion of testing



DBS EOCAS
AFTER TESTING
C.784 38
10.09.88

083041

Photo 35. Repeat test of Plan 2. Sea-side view at the conclusion of testing

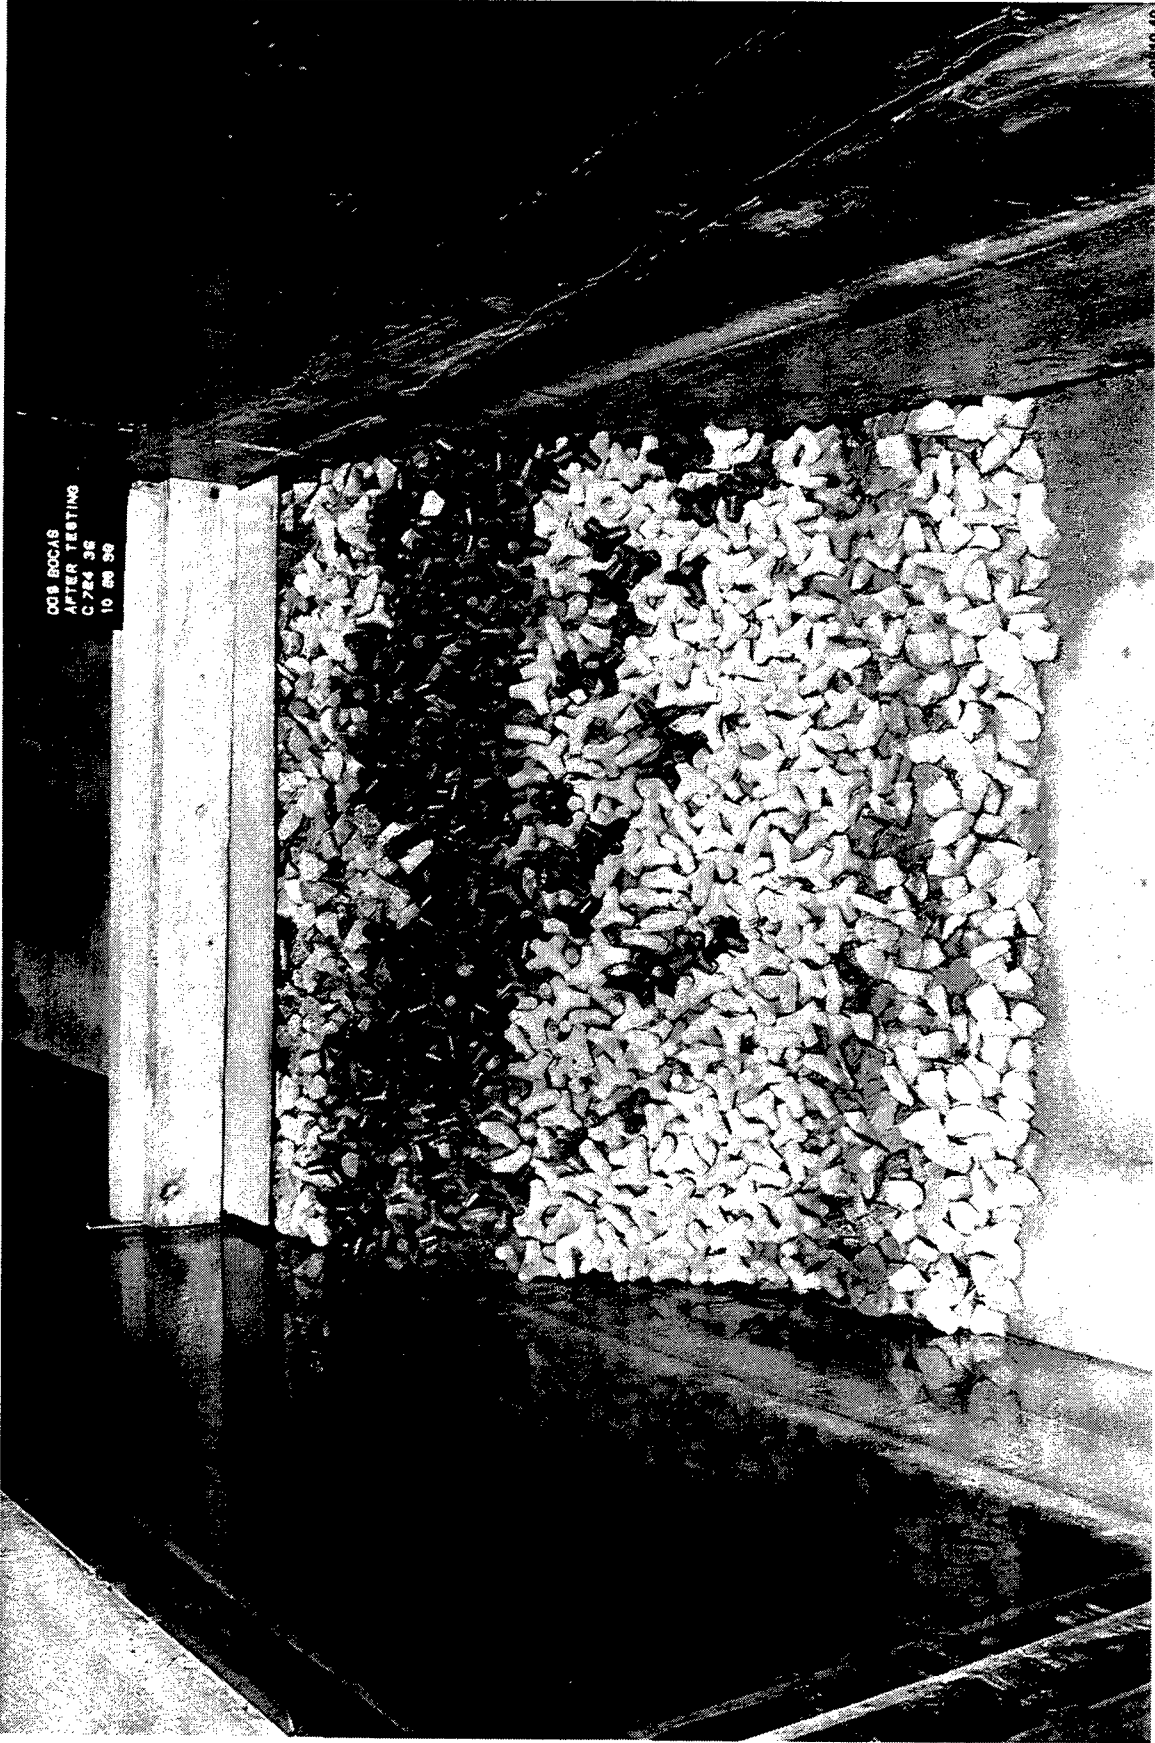


Photo 36. Repeat test of Plan 2. Harbor-side view at the conclusion of testing

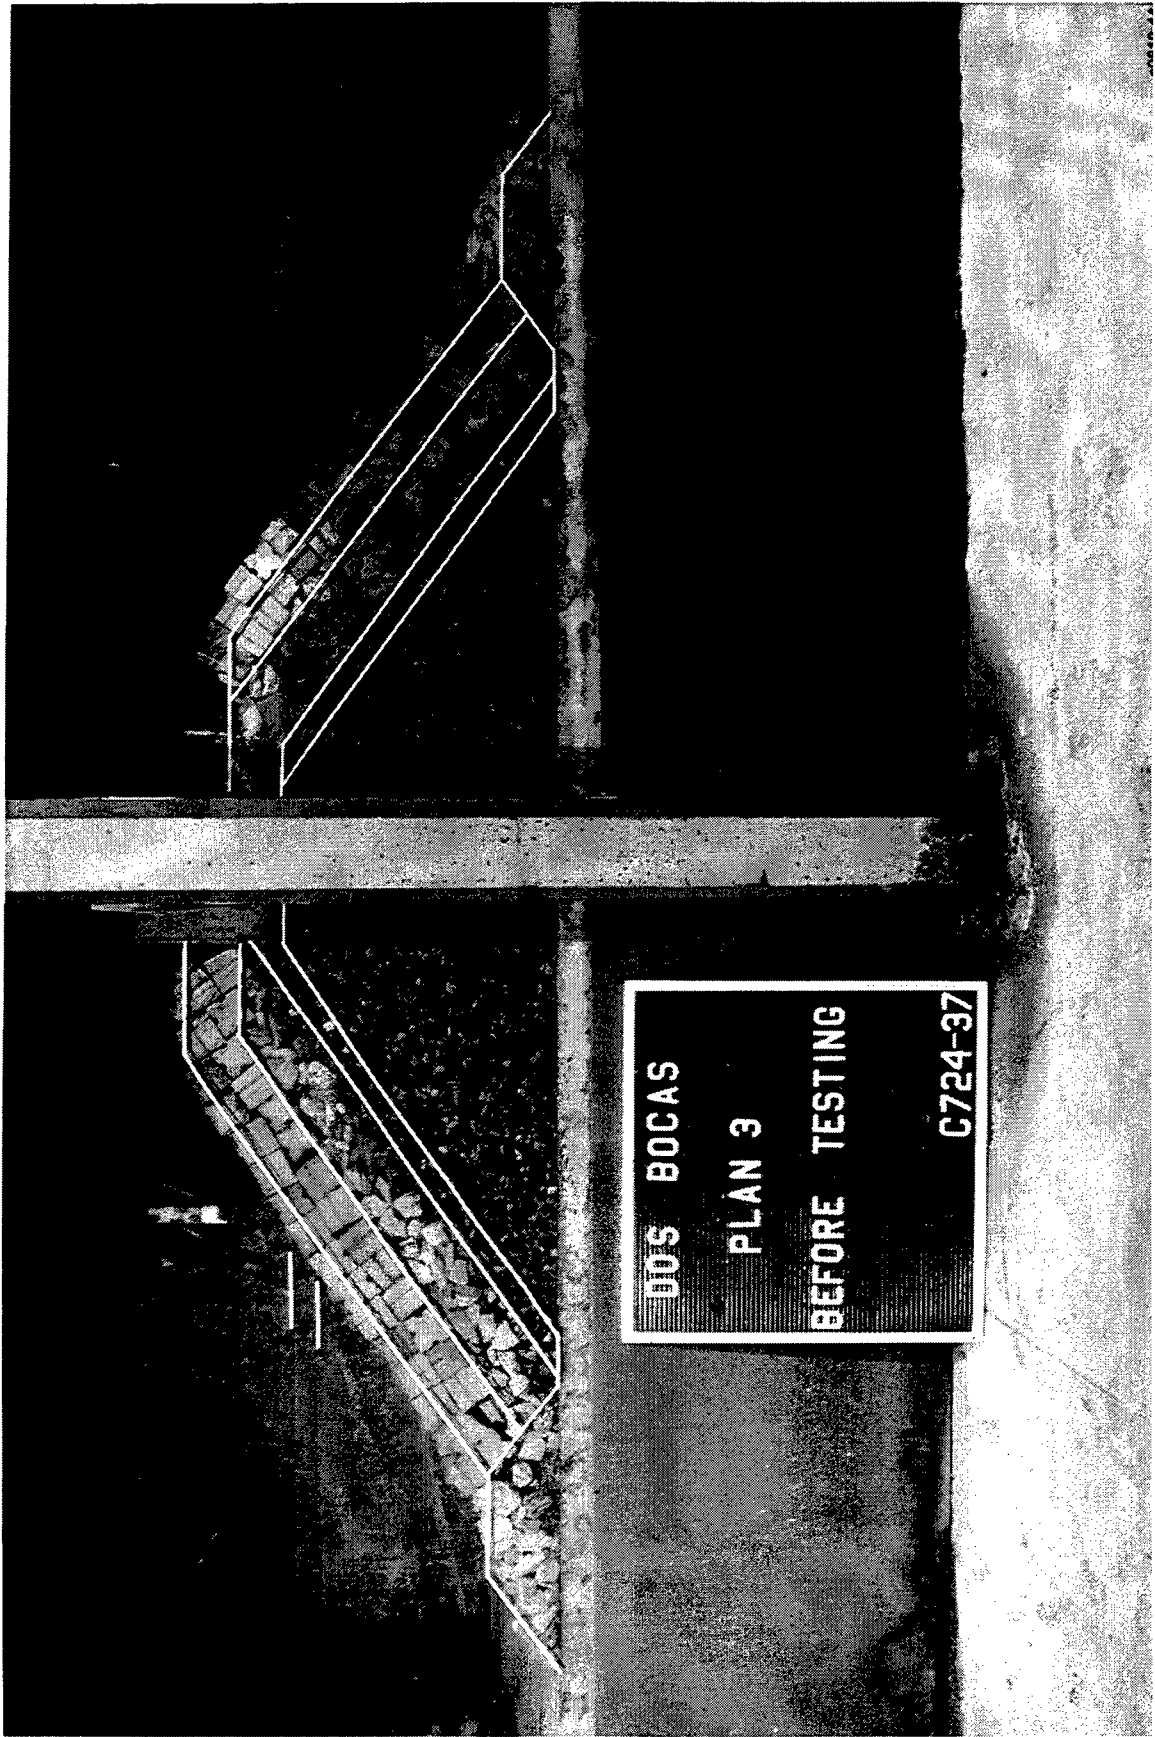


Photo 37. End view of Plan 3 before wave attack

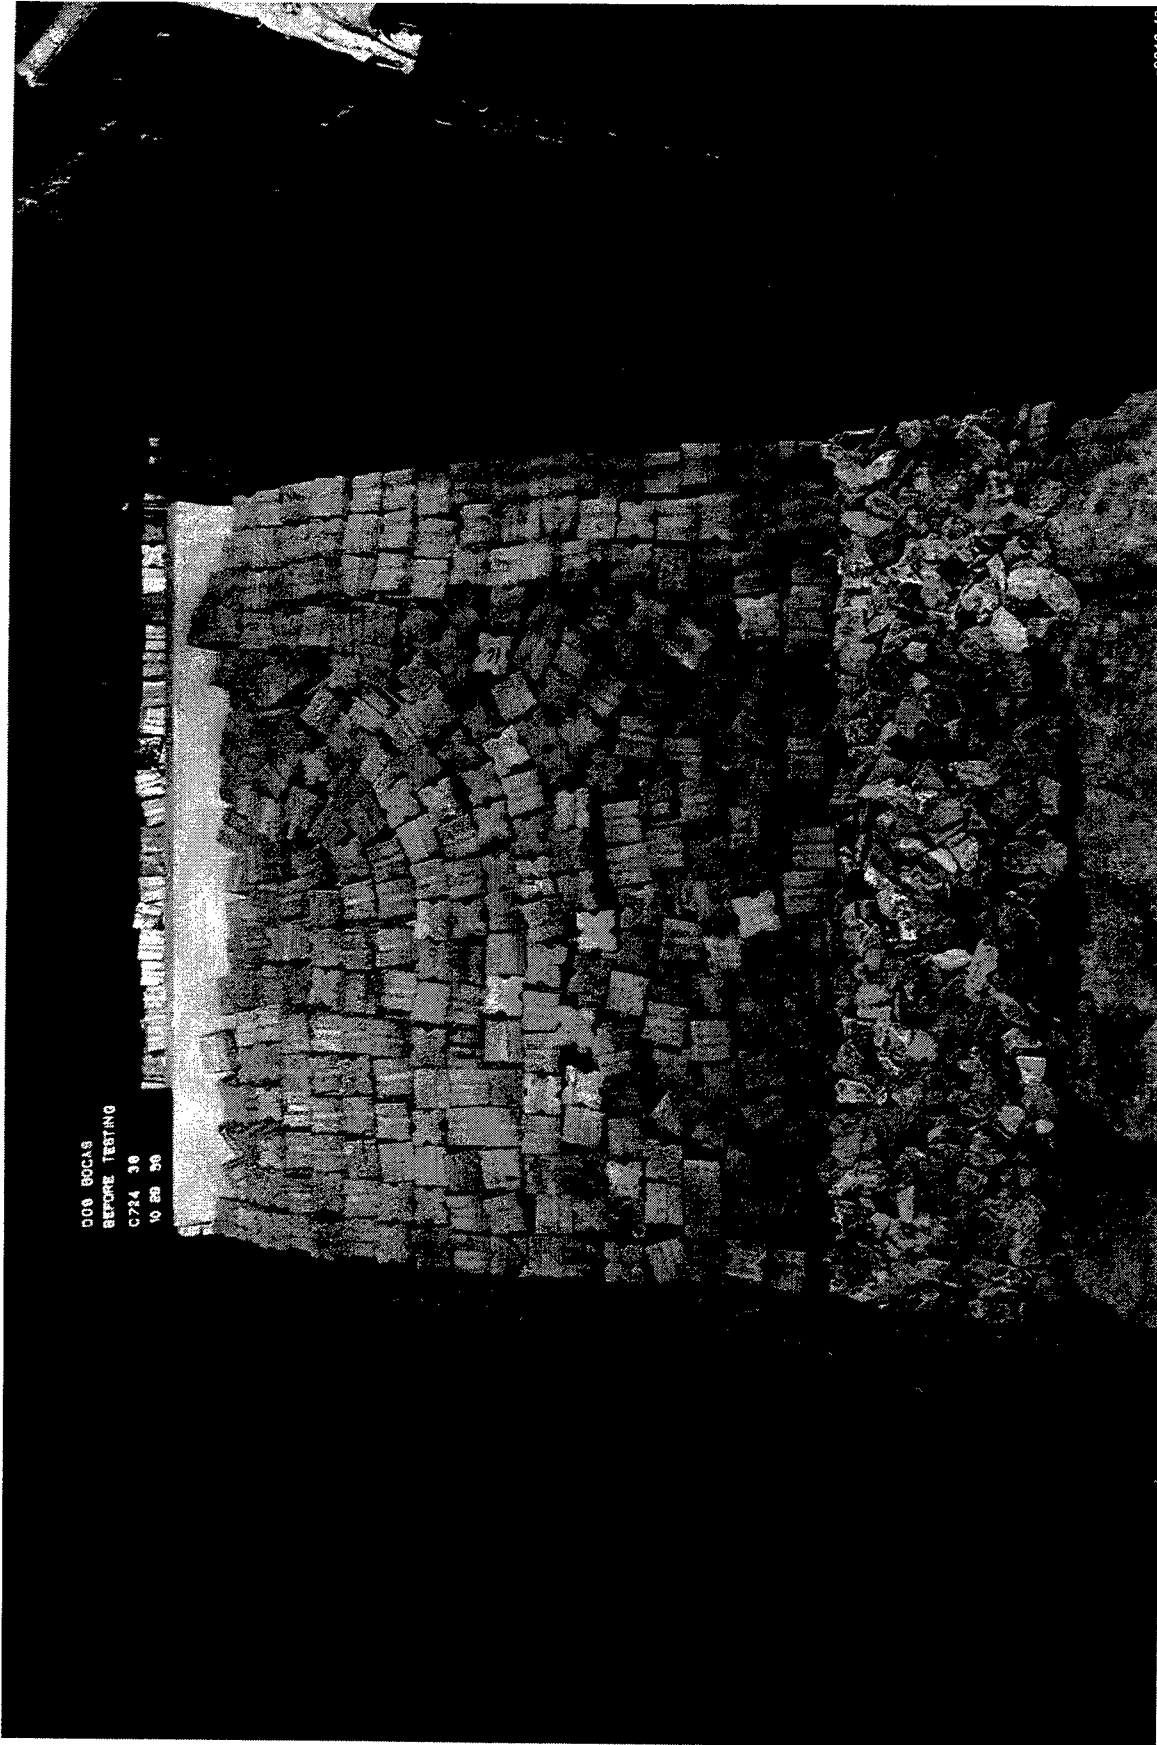


Photo 38. Sea-side view of Plan 3 before wave attack

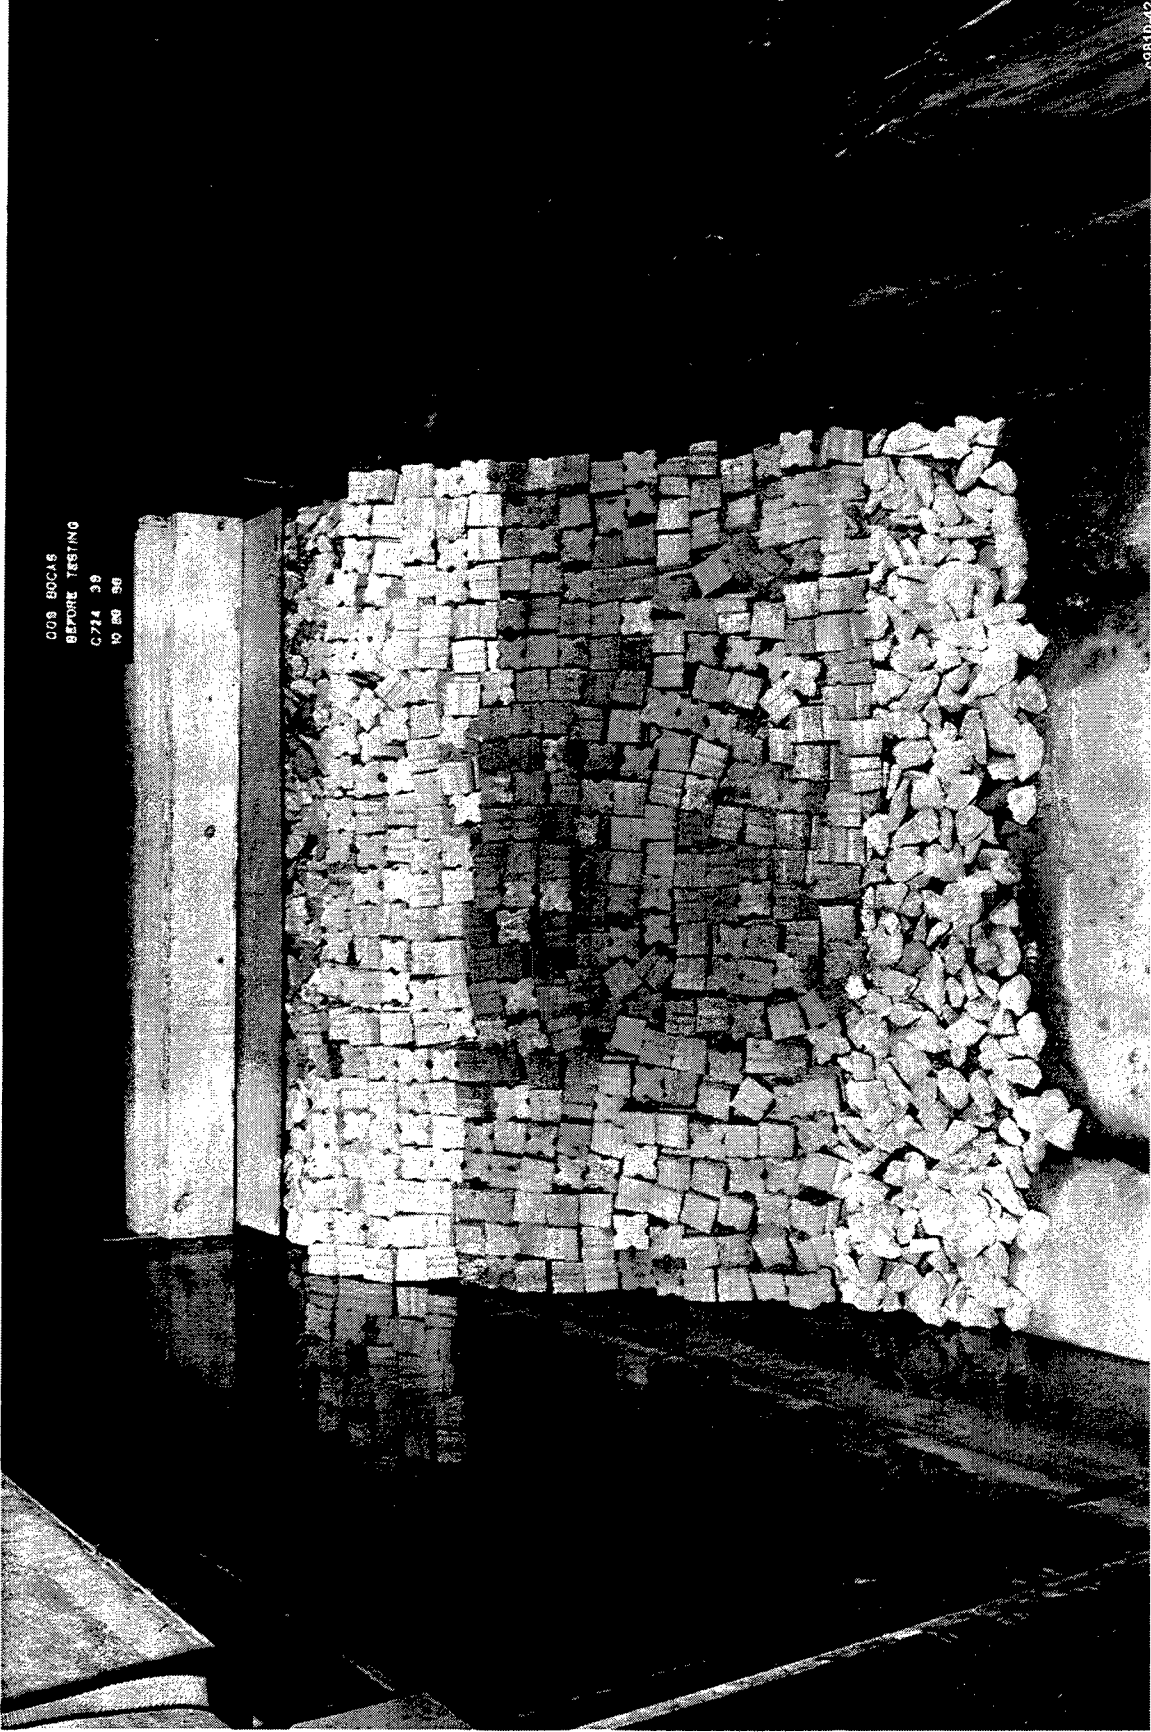


Photo 39. Harbor-side view of Plan 3 before wave attack


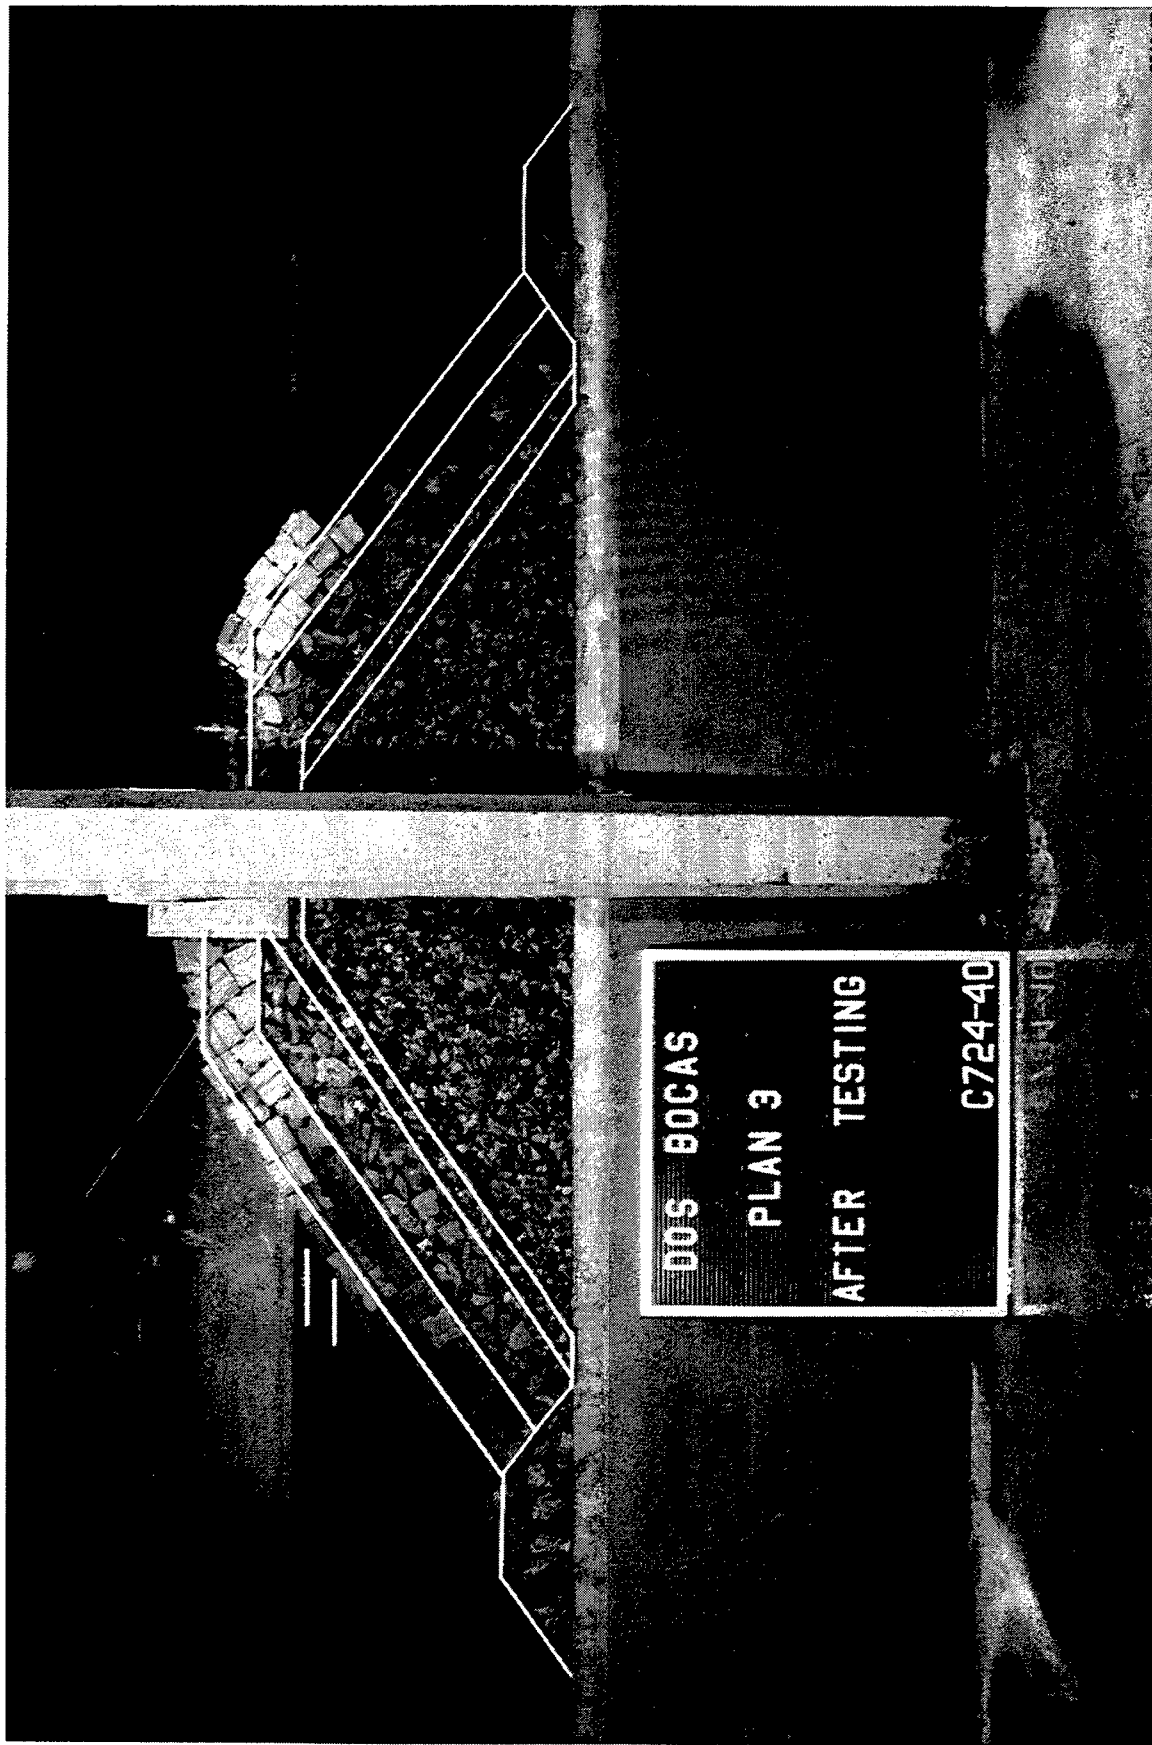


Photo 40. End view of Plan 3 after testing Hydrograph 1



005 BOCAS
AFTER TESTING
C 724 41
10 30 86

Photo 41. Sea-side view of Plan 3 after testing Hydrograph 1

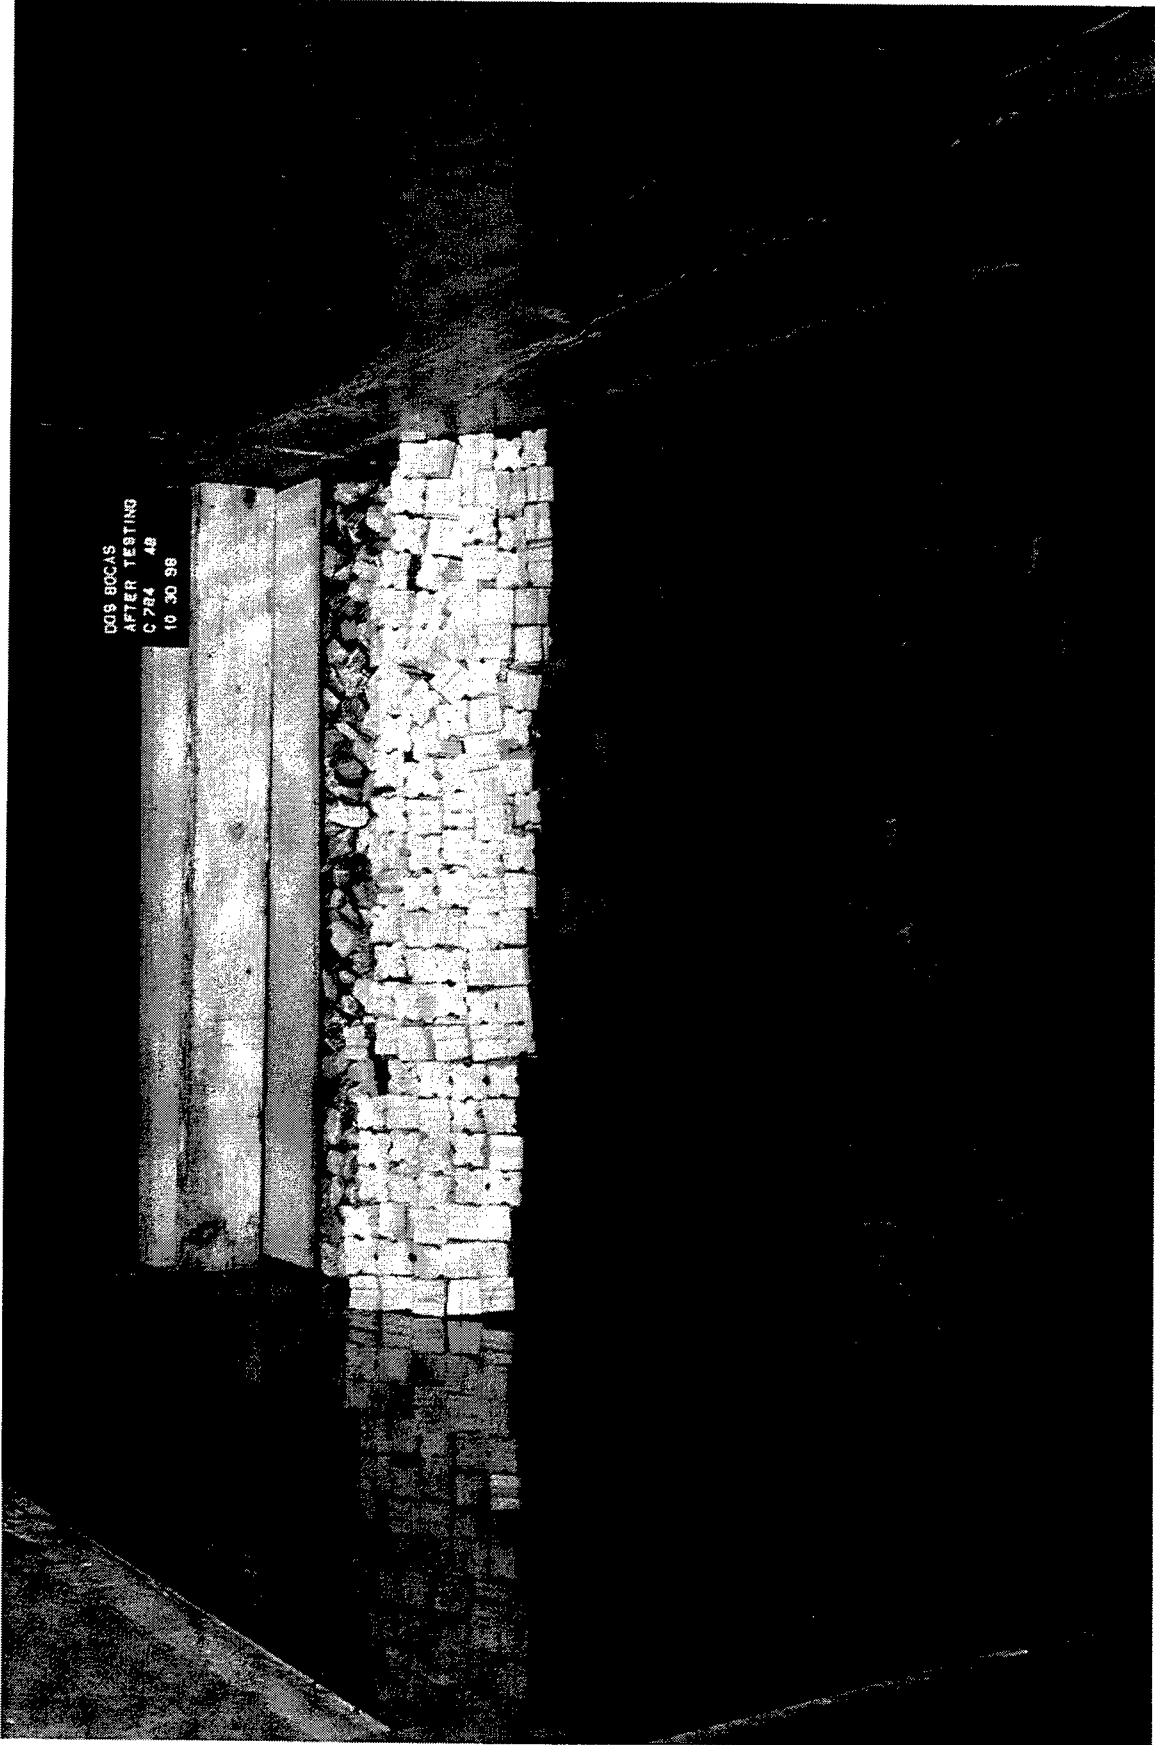

DOS BOCA'S
AFTER TESTING
C 784 48
10 30 98

Photo 42. Harbor-side view of Plan 3 after testing Hydrograph 1

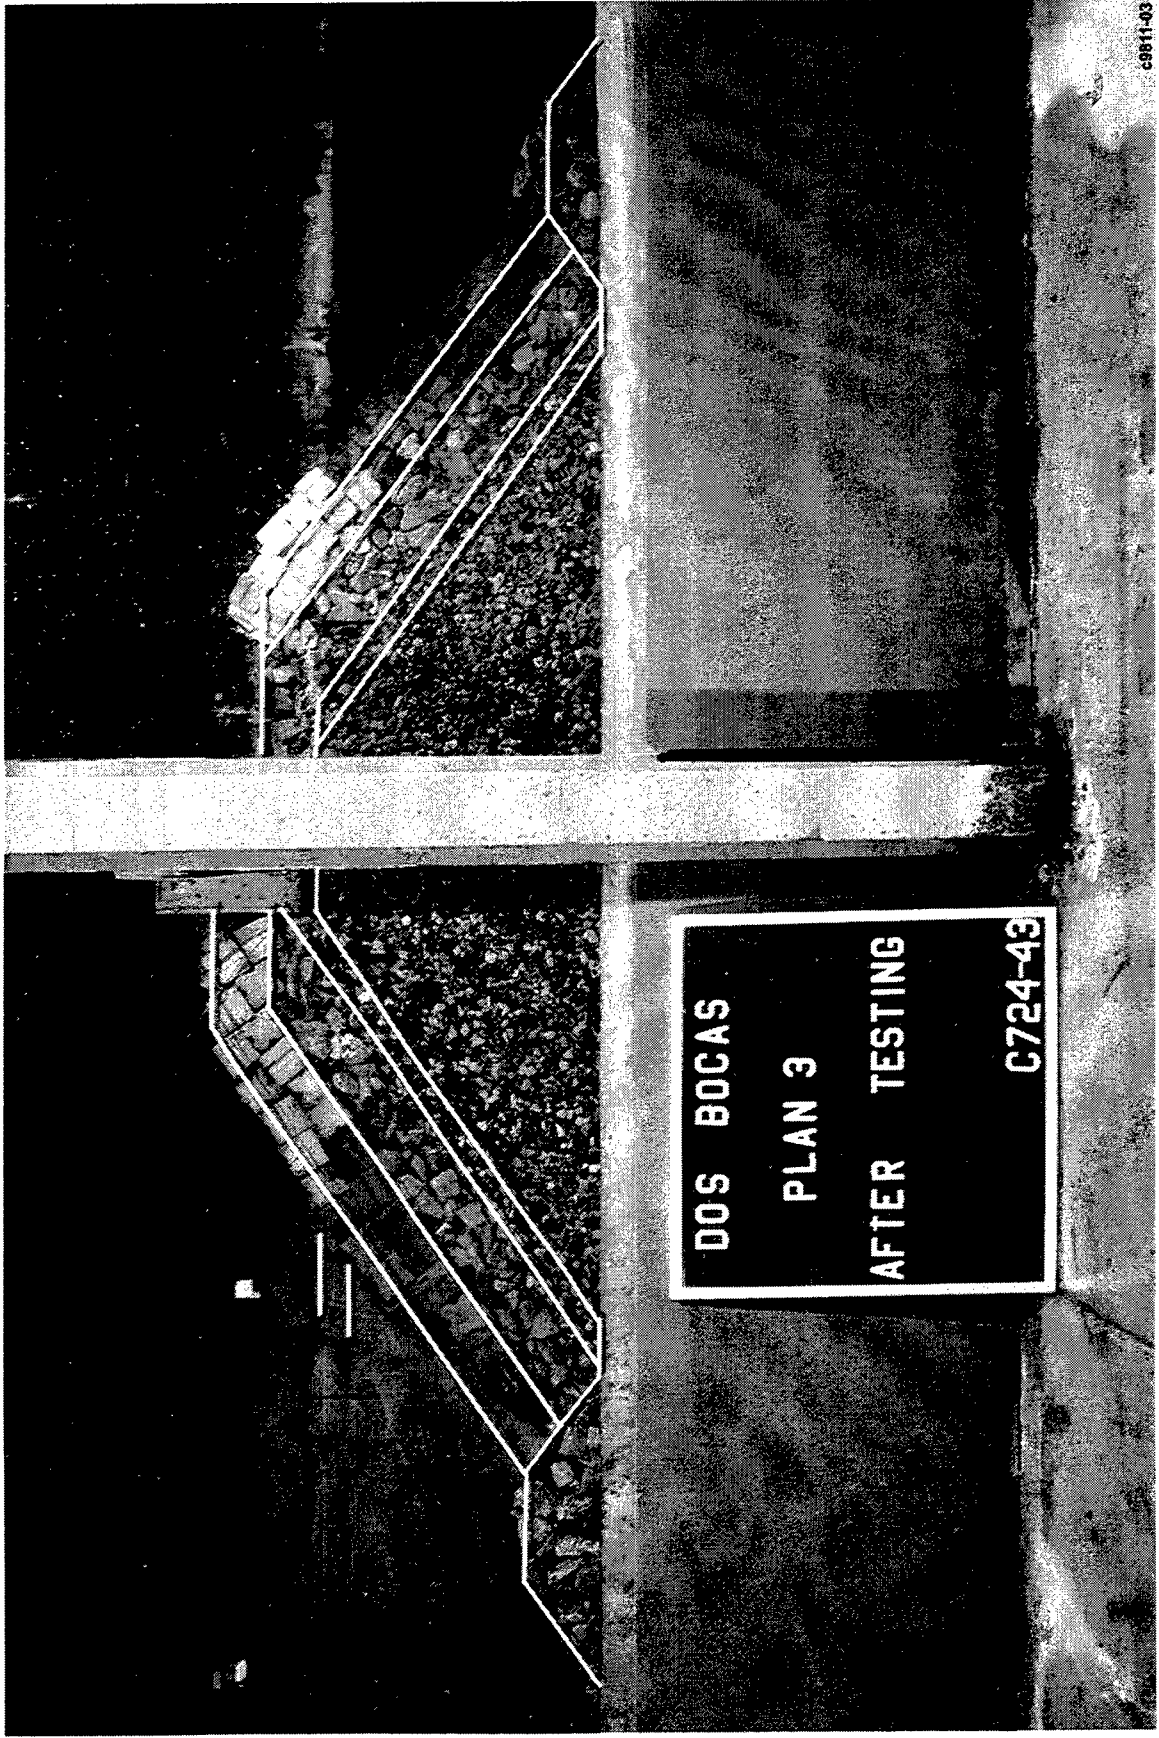


Photo 43. End view of Plan 3 at the conclusion of testing



DOB 800AS
AFTER TESTING
C.784 44
10 30 88


c981102

Photo 44. Sea-side view of Plan 3 at the conclusion of testing



DOG BOCAB
AFTER TESTING
C.284 48
10.30.88

Photo 45. Harbor-side view of Plan 3 at the conclusion of testing

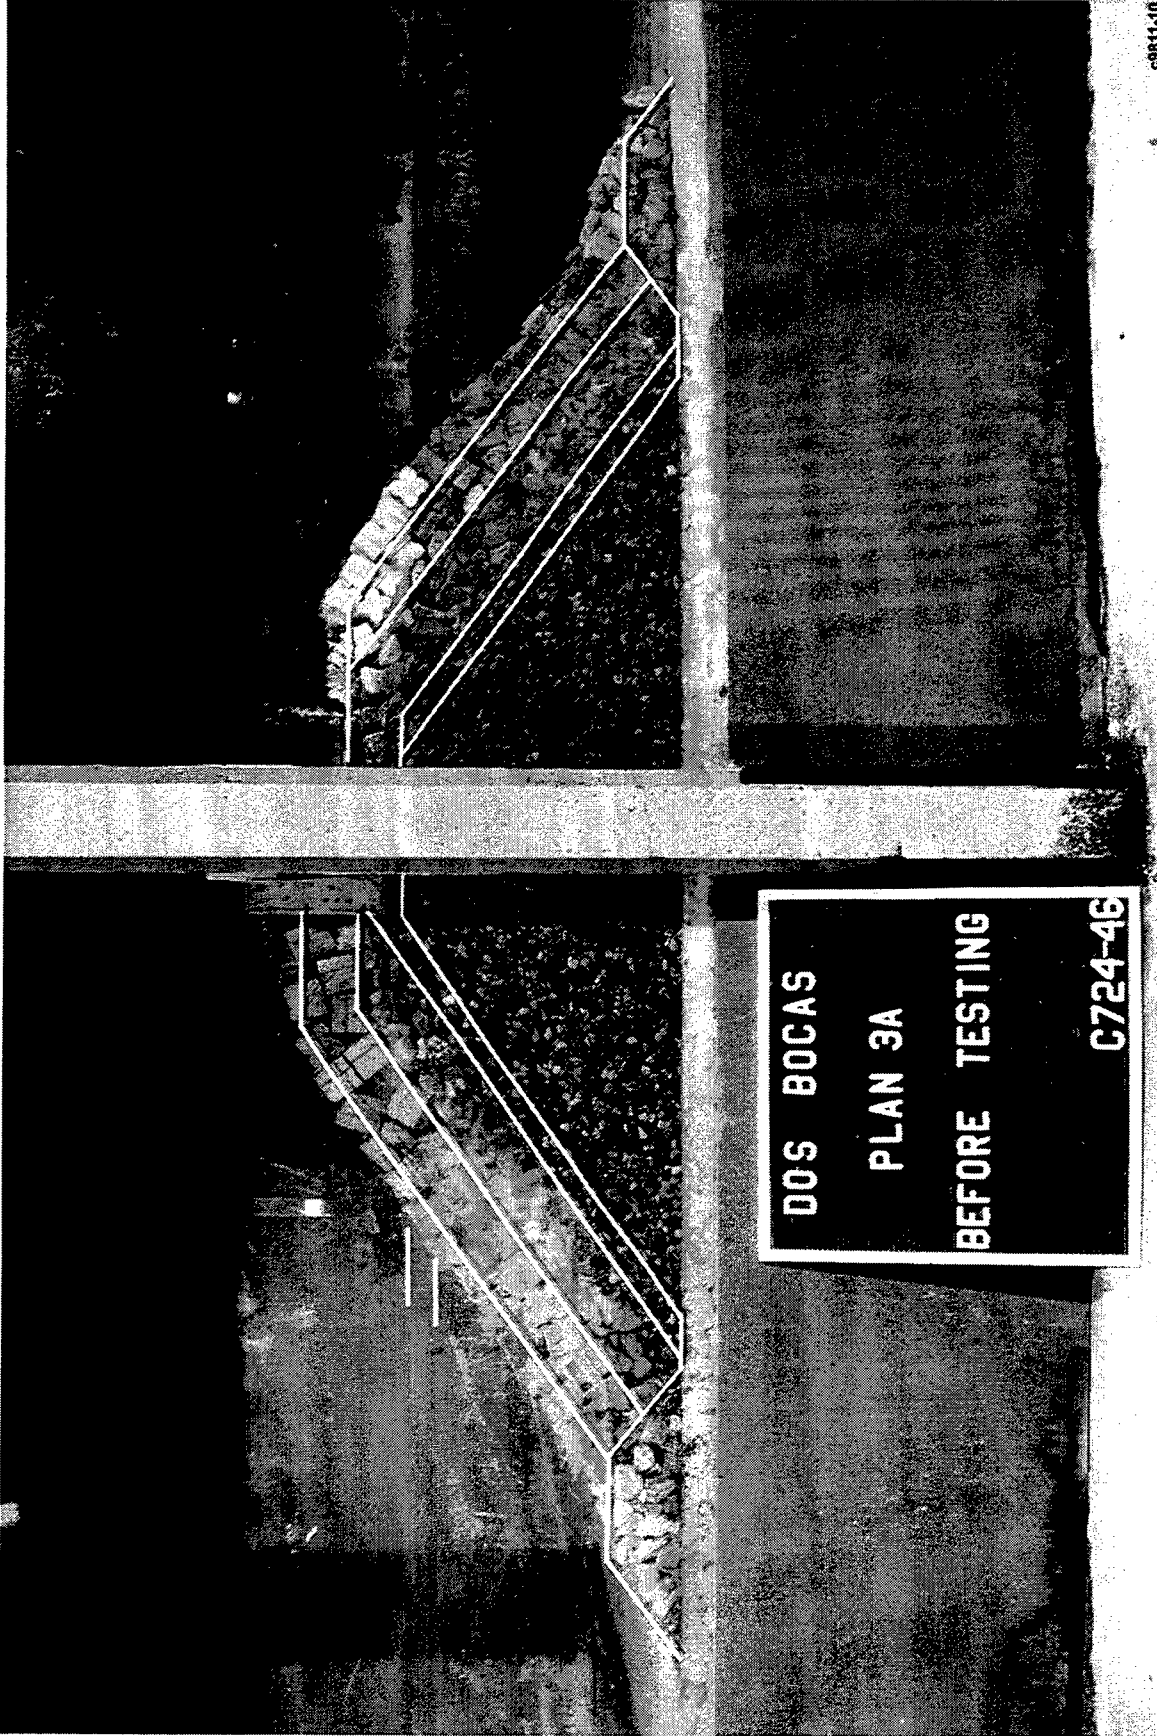

c9811-10

DOS BOCAS
PLAN 3A
BEFORE TESTING
C724-46

Photo 46. End view of Plan 3 A before wave attack



Photo 47. Sea-side view of Plan 3A before wave attack

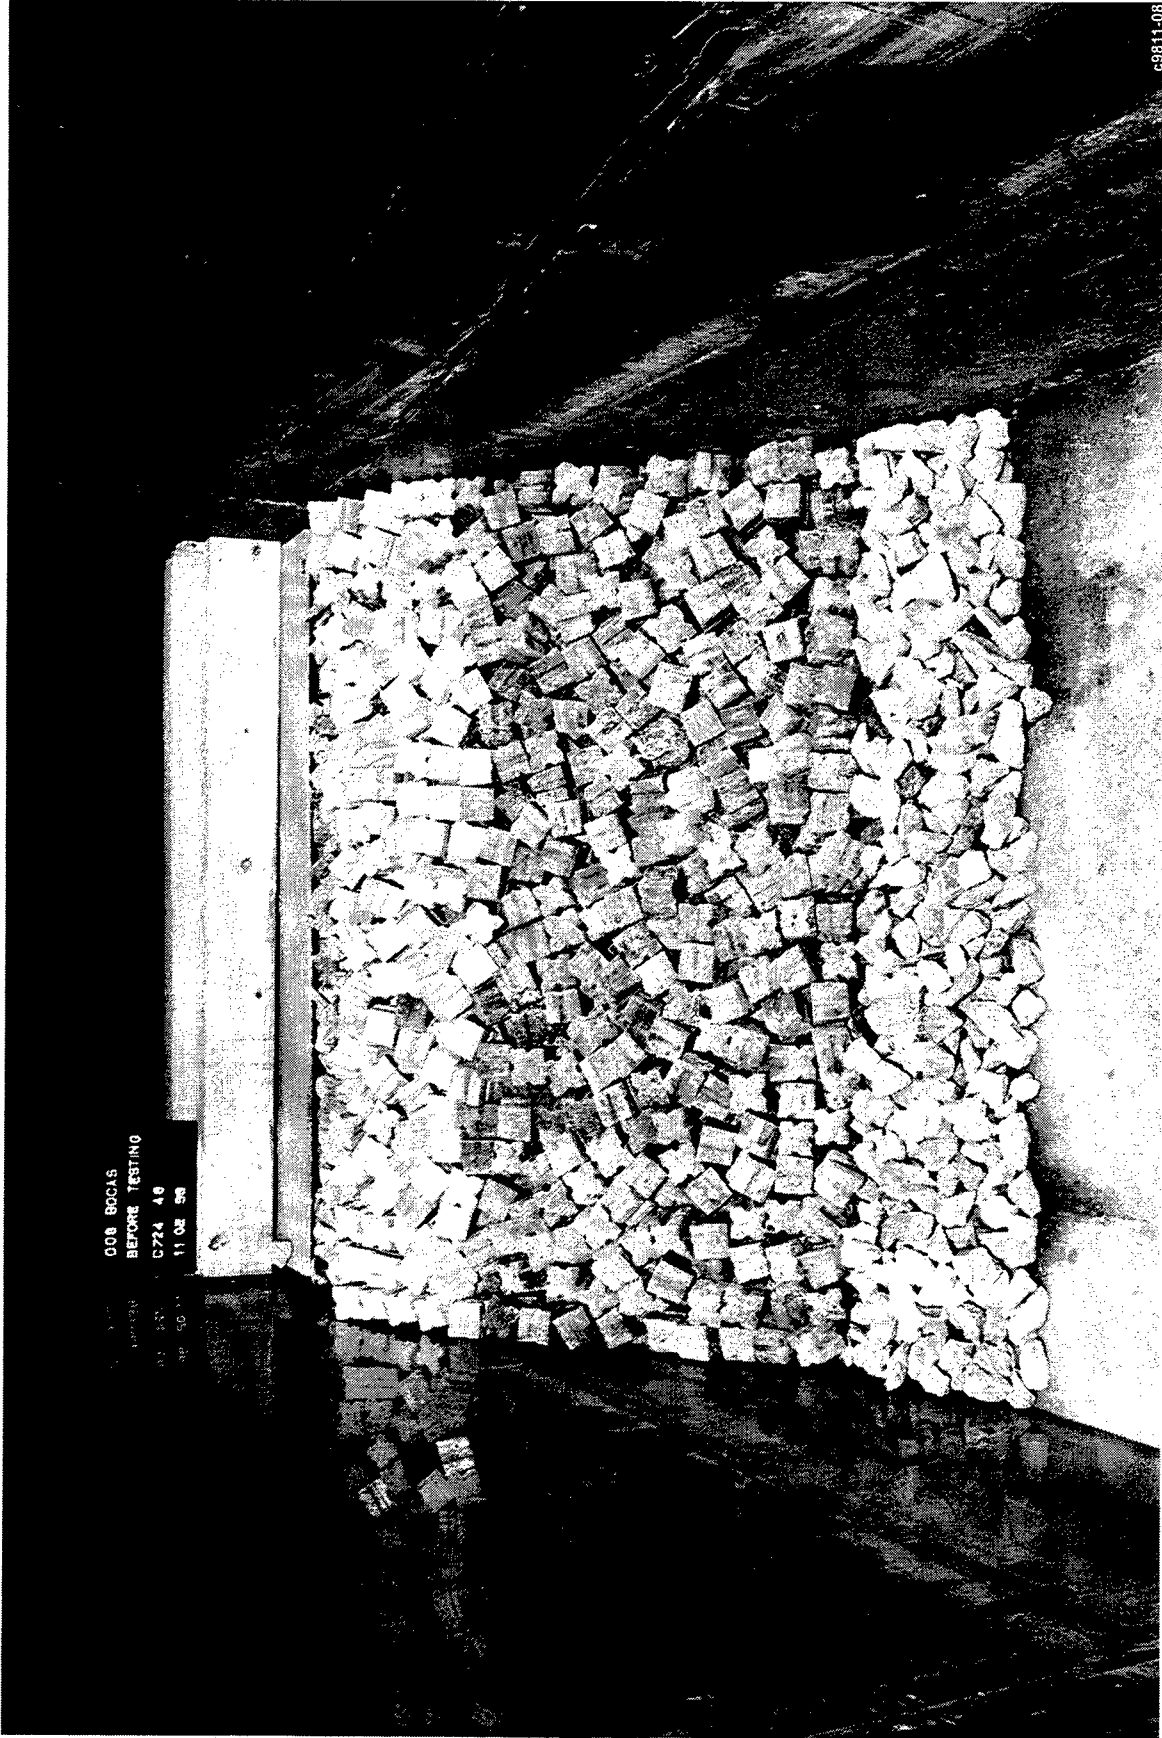


Photo 48. Harbor-side view of Plan 3A before wave attack

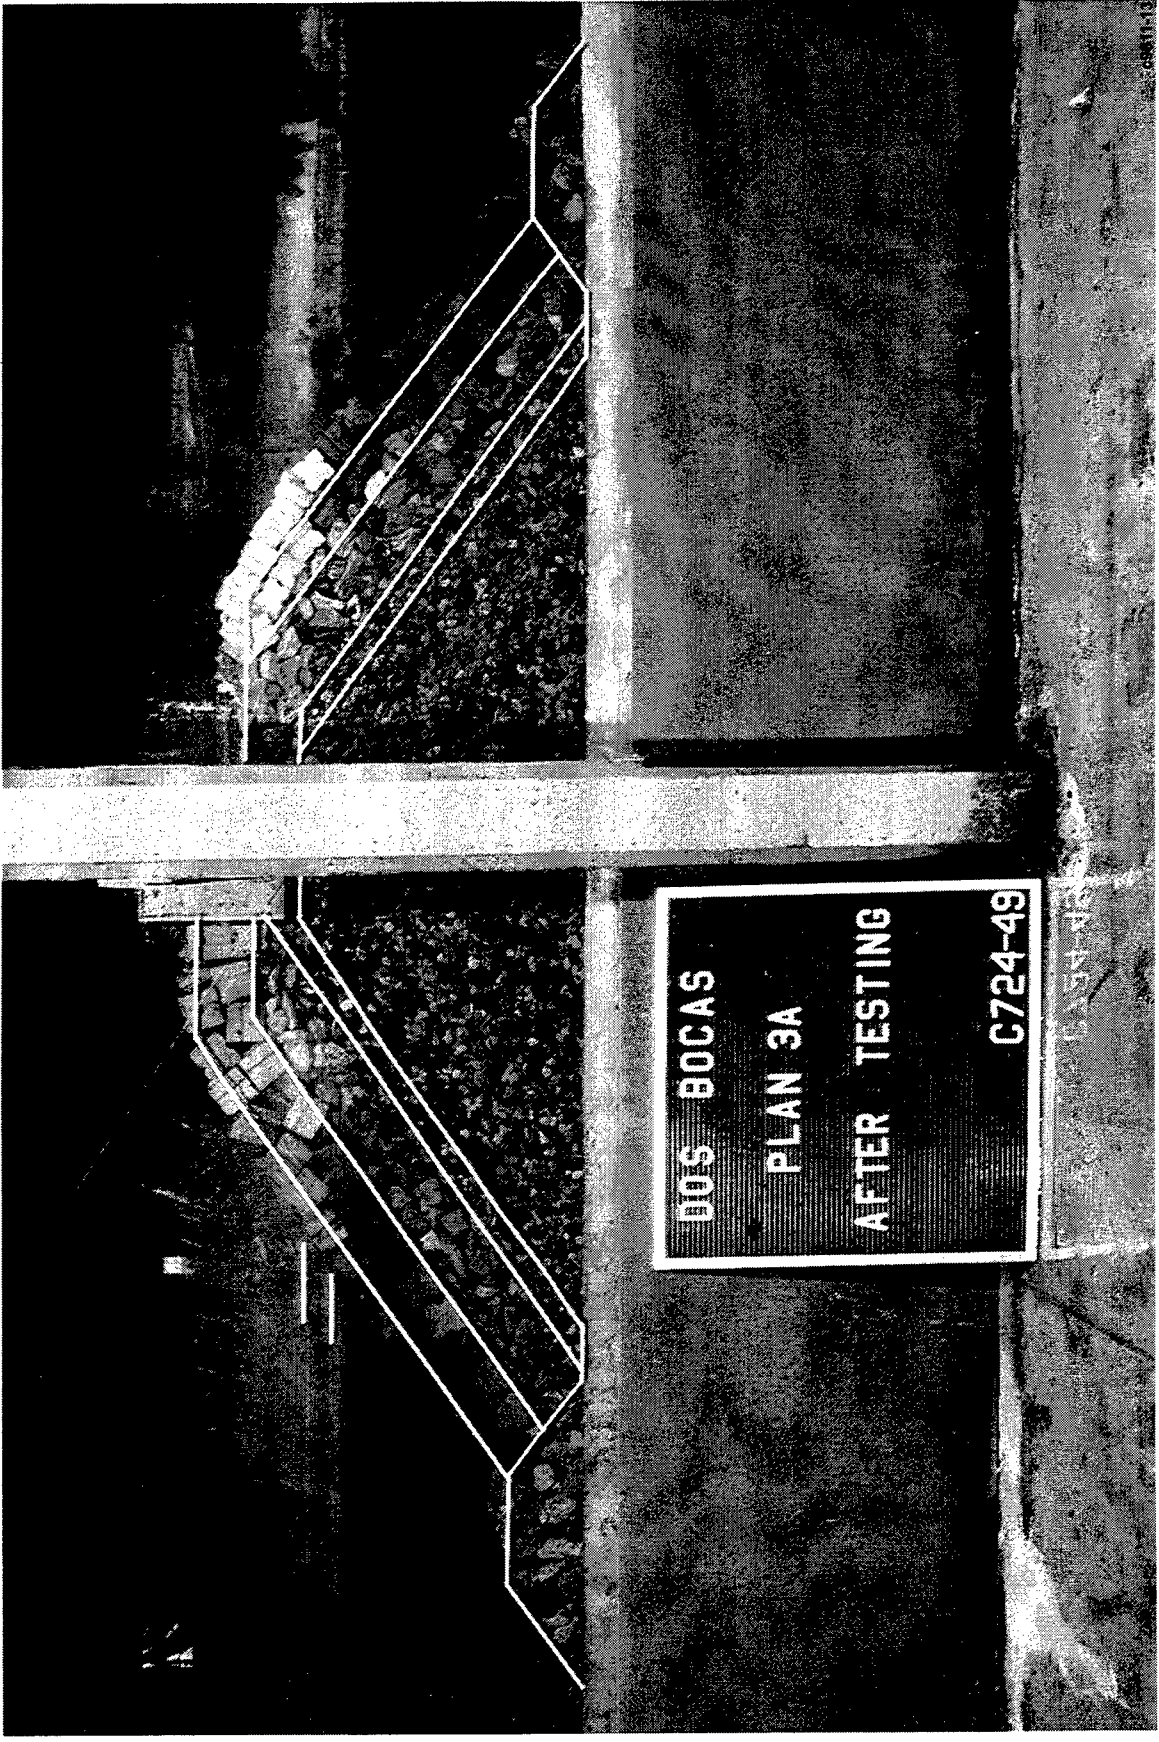


Photo 49. End view of Plan 3A after testing Hydrograph 1

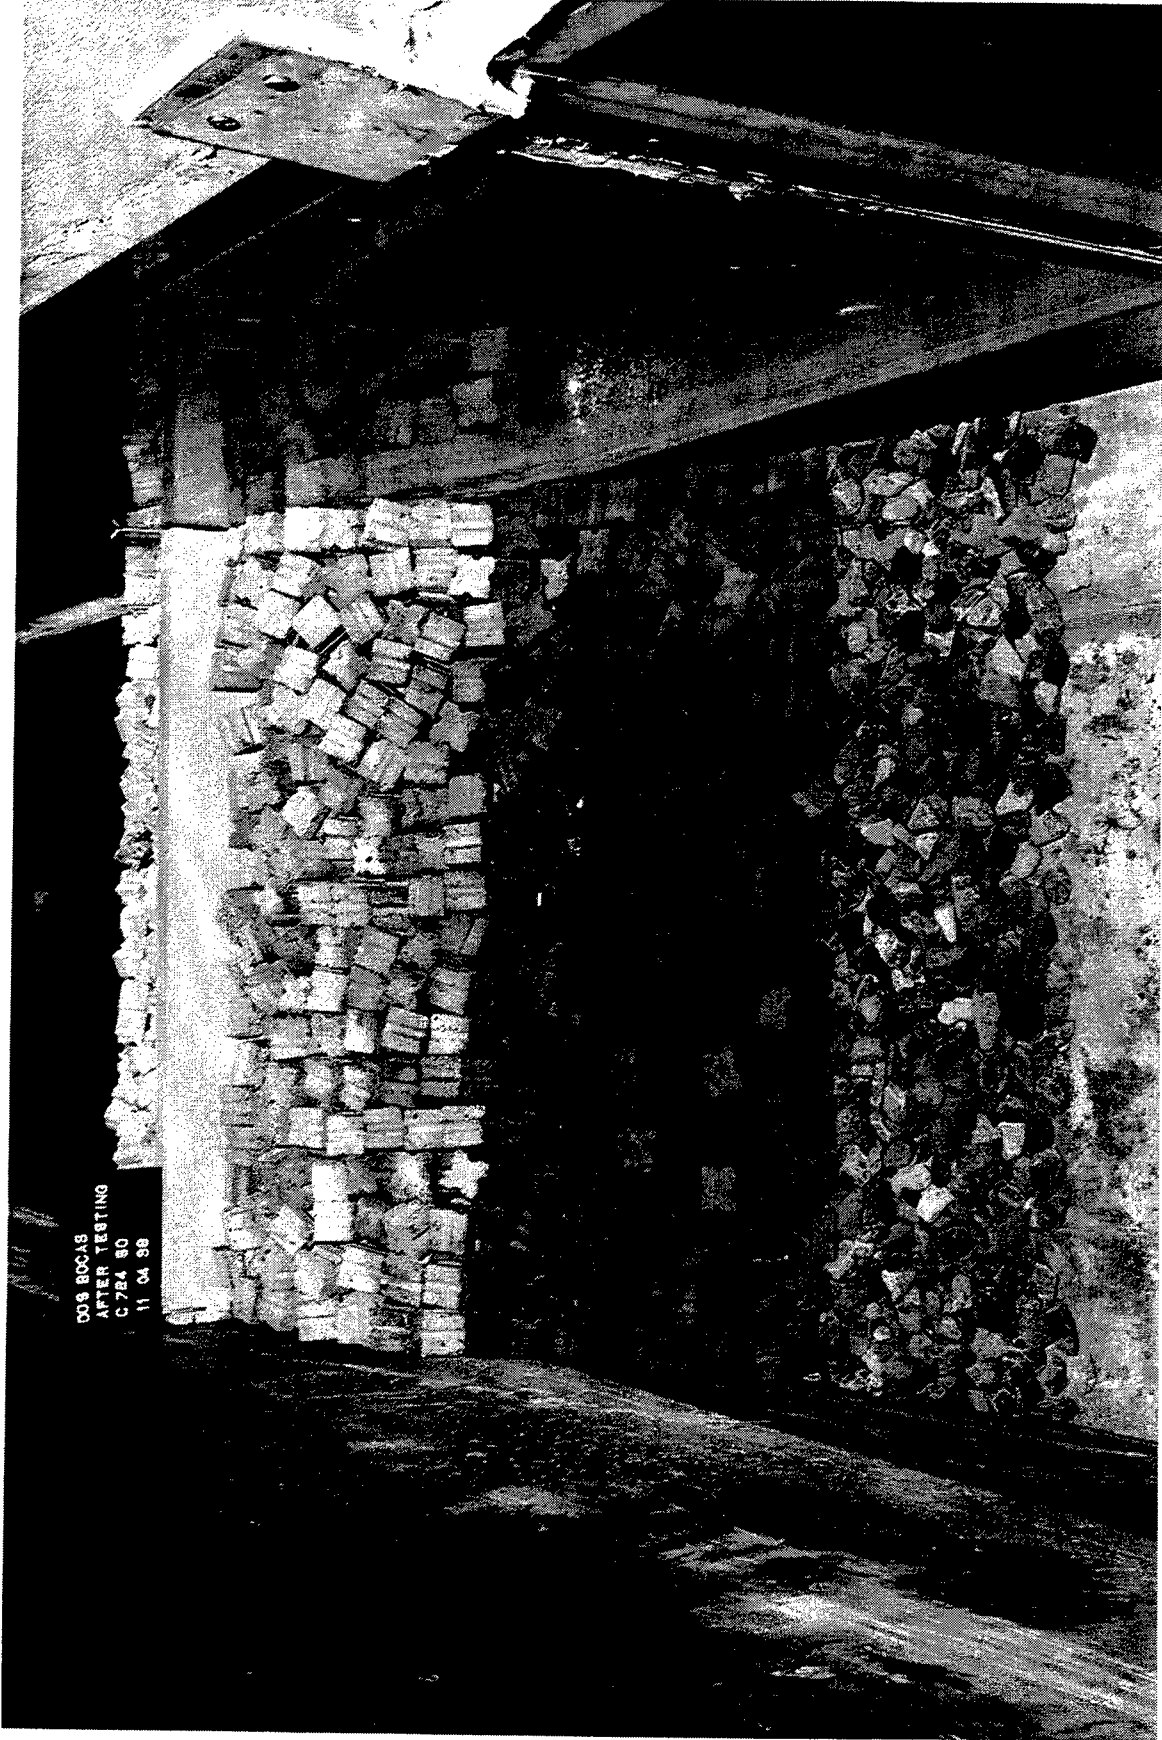


Photo 50. Sea-side view of Plan 3 A after testing Hydrograph 1

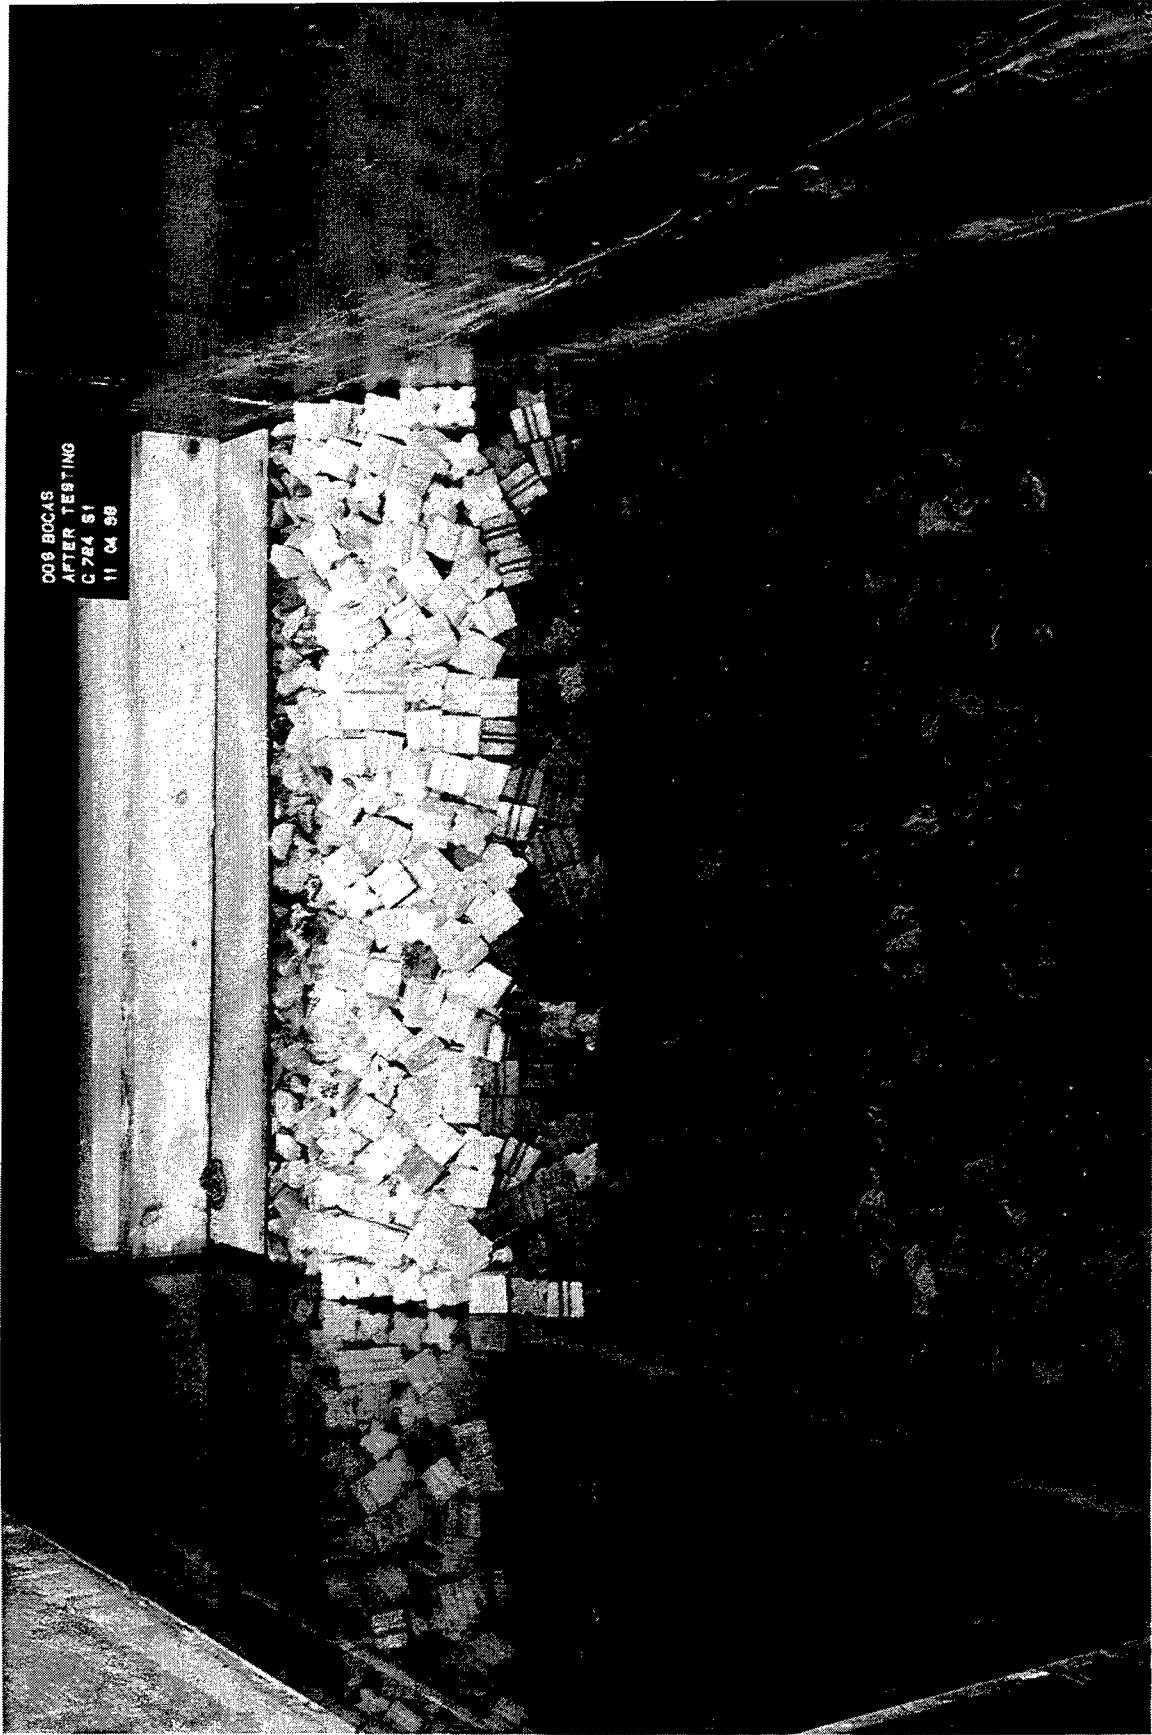


Photo 51. Harbor-side view of Plan 3A after testing Hydrograph 1

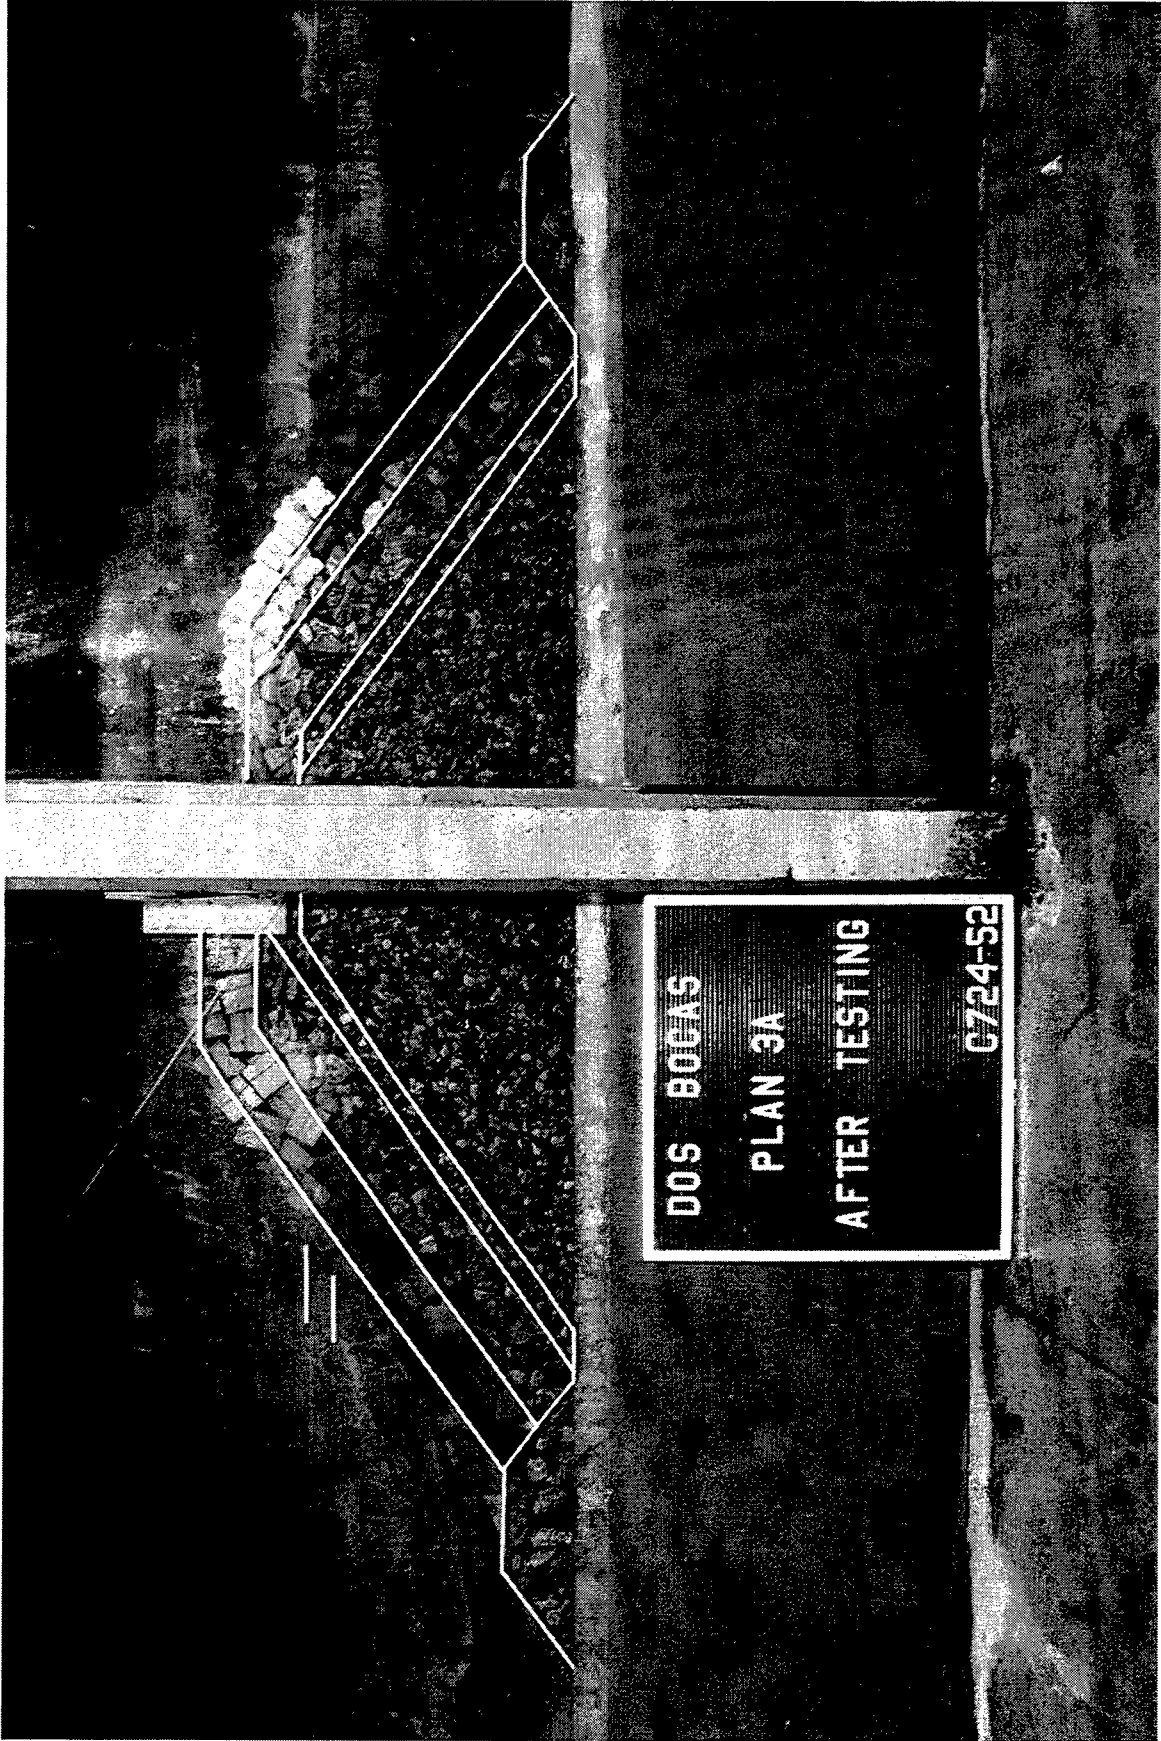


Photo 52. End view of Plan 3A at the conclusion of testing



Photo 53. Sea-side view of Plan 3 A at the conclusion of testing

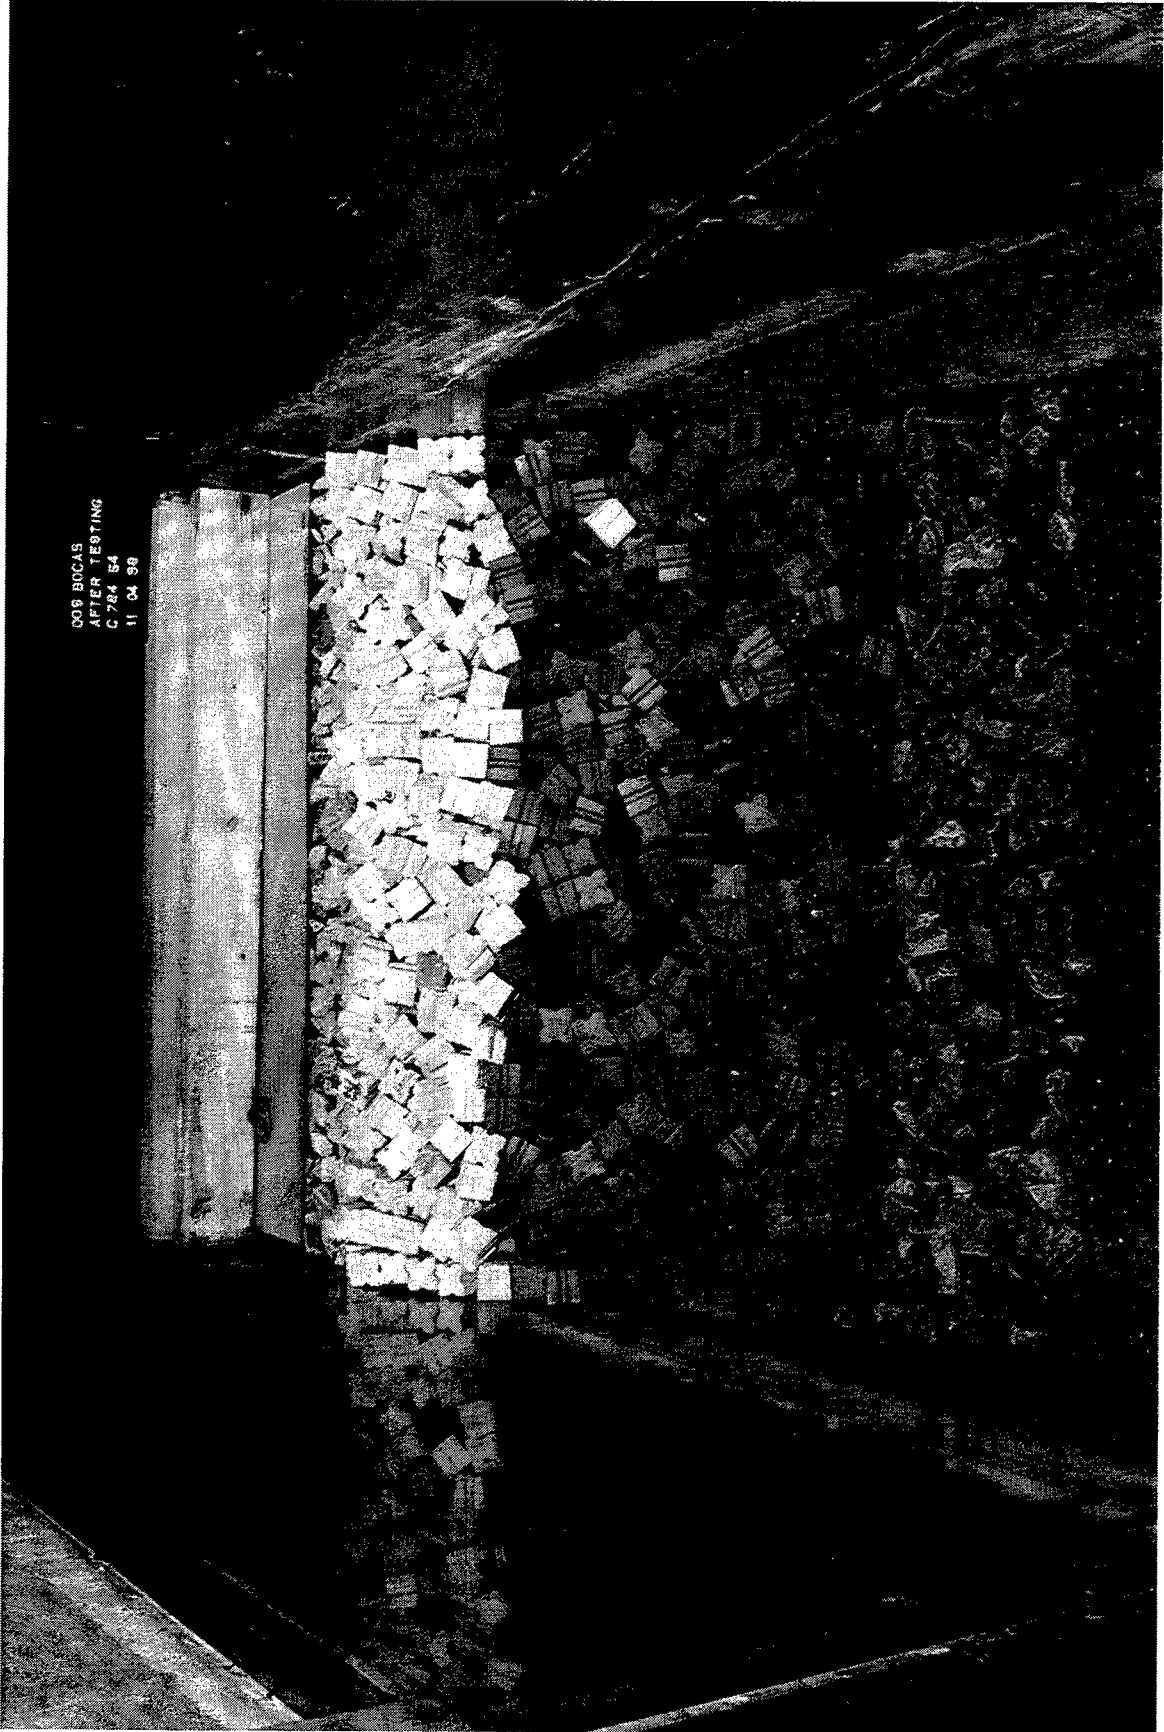


Photo 54. Harbor-side view of Plan 3 A at the conclusion of testing

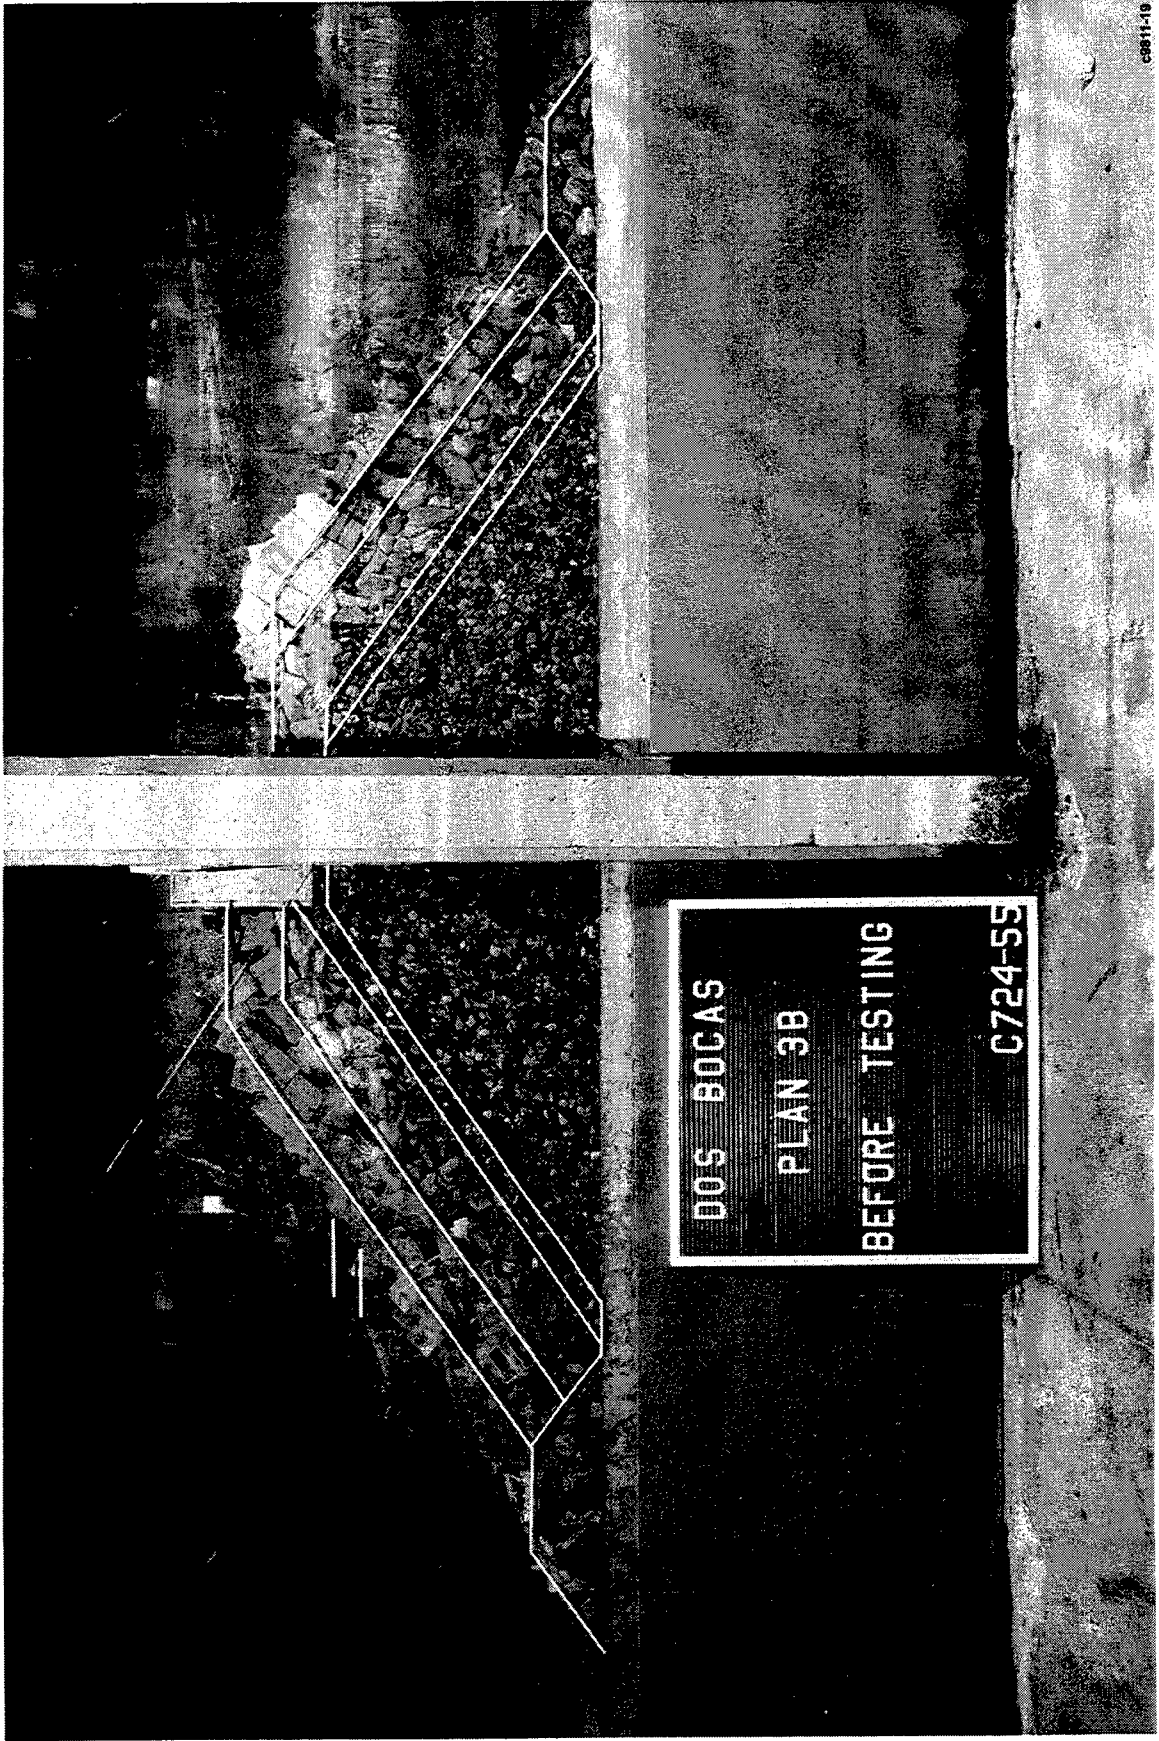


Photo 55. End view of Plan 3B before wave attack

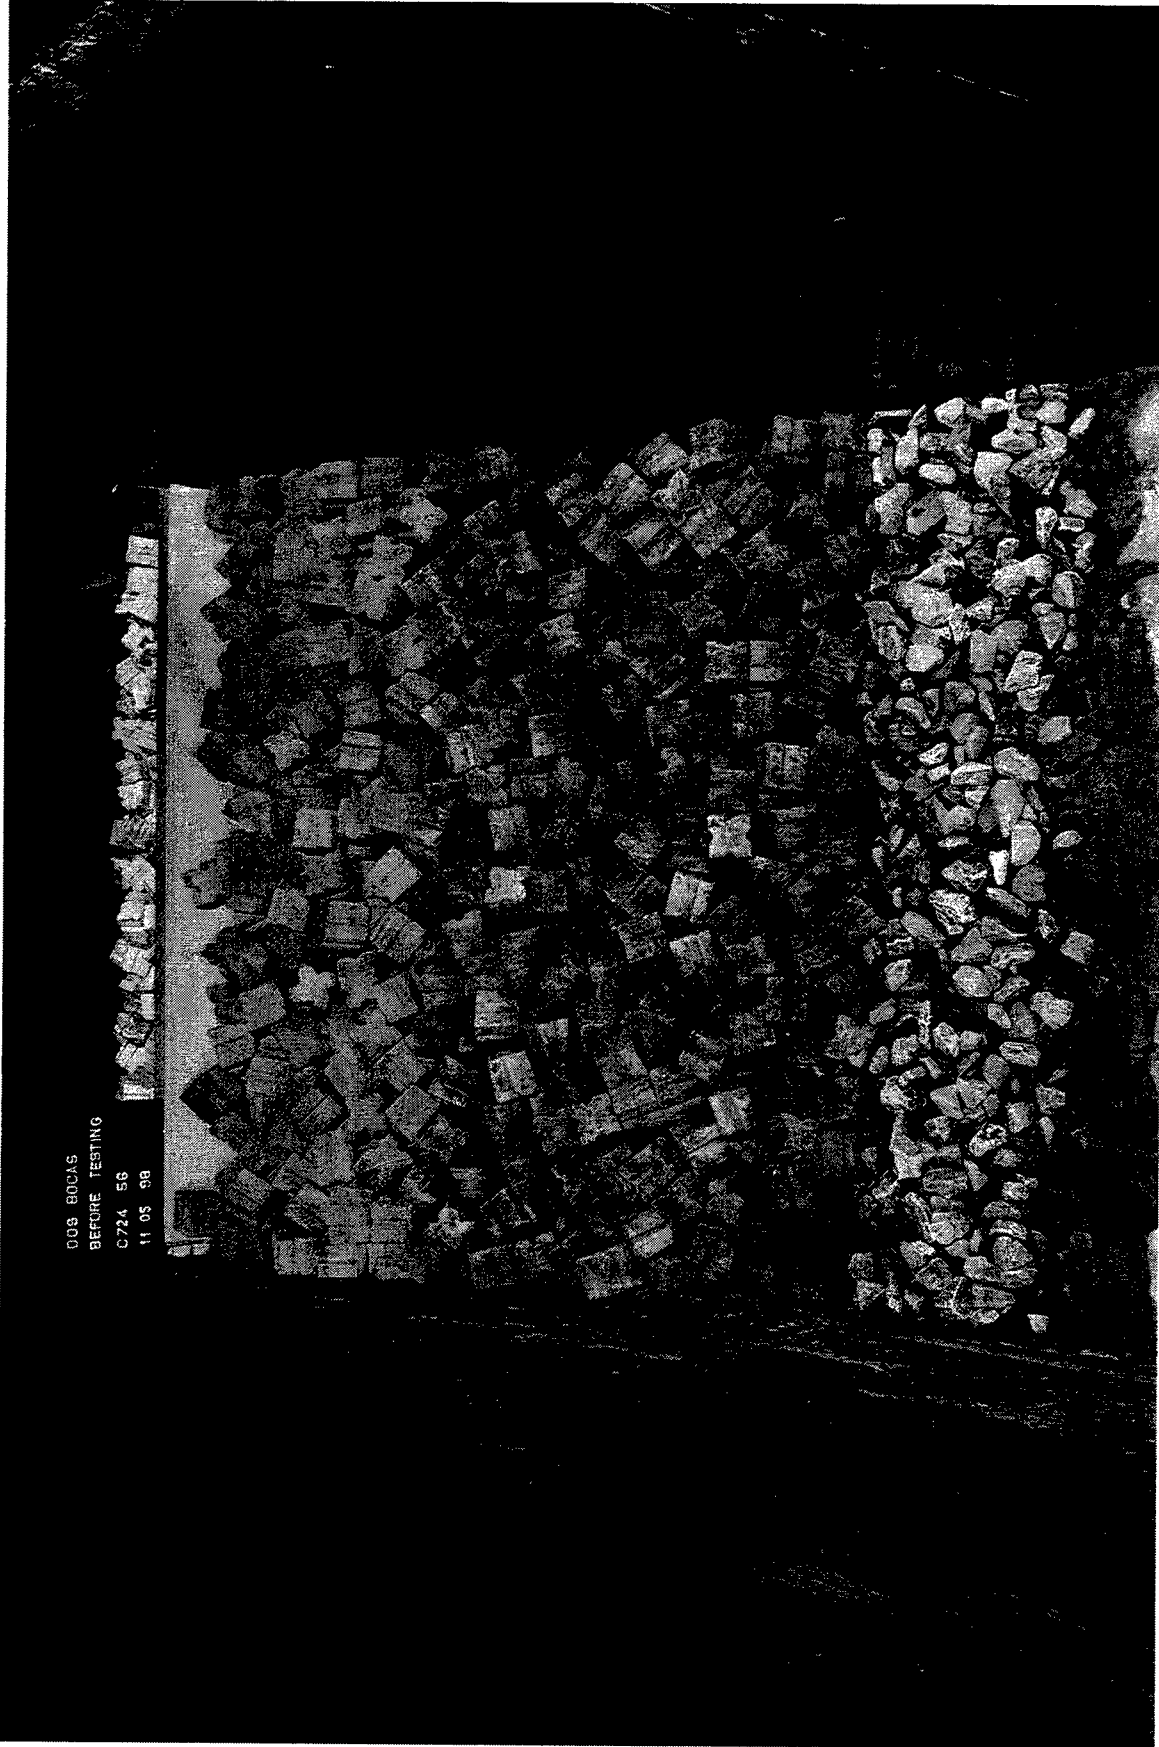


Photo 56. Sea-side view of Plan 3B before wave attack



Photo 57. Harbor-side view of Plan 3B before wave attack

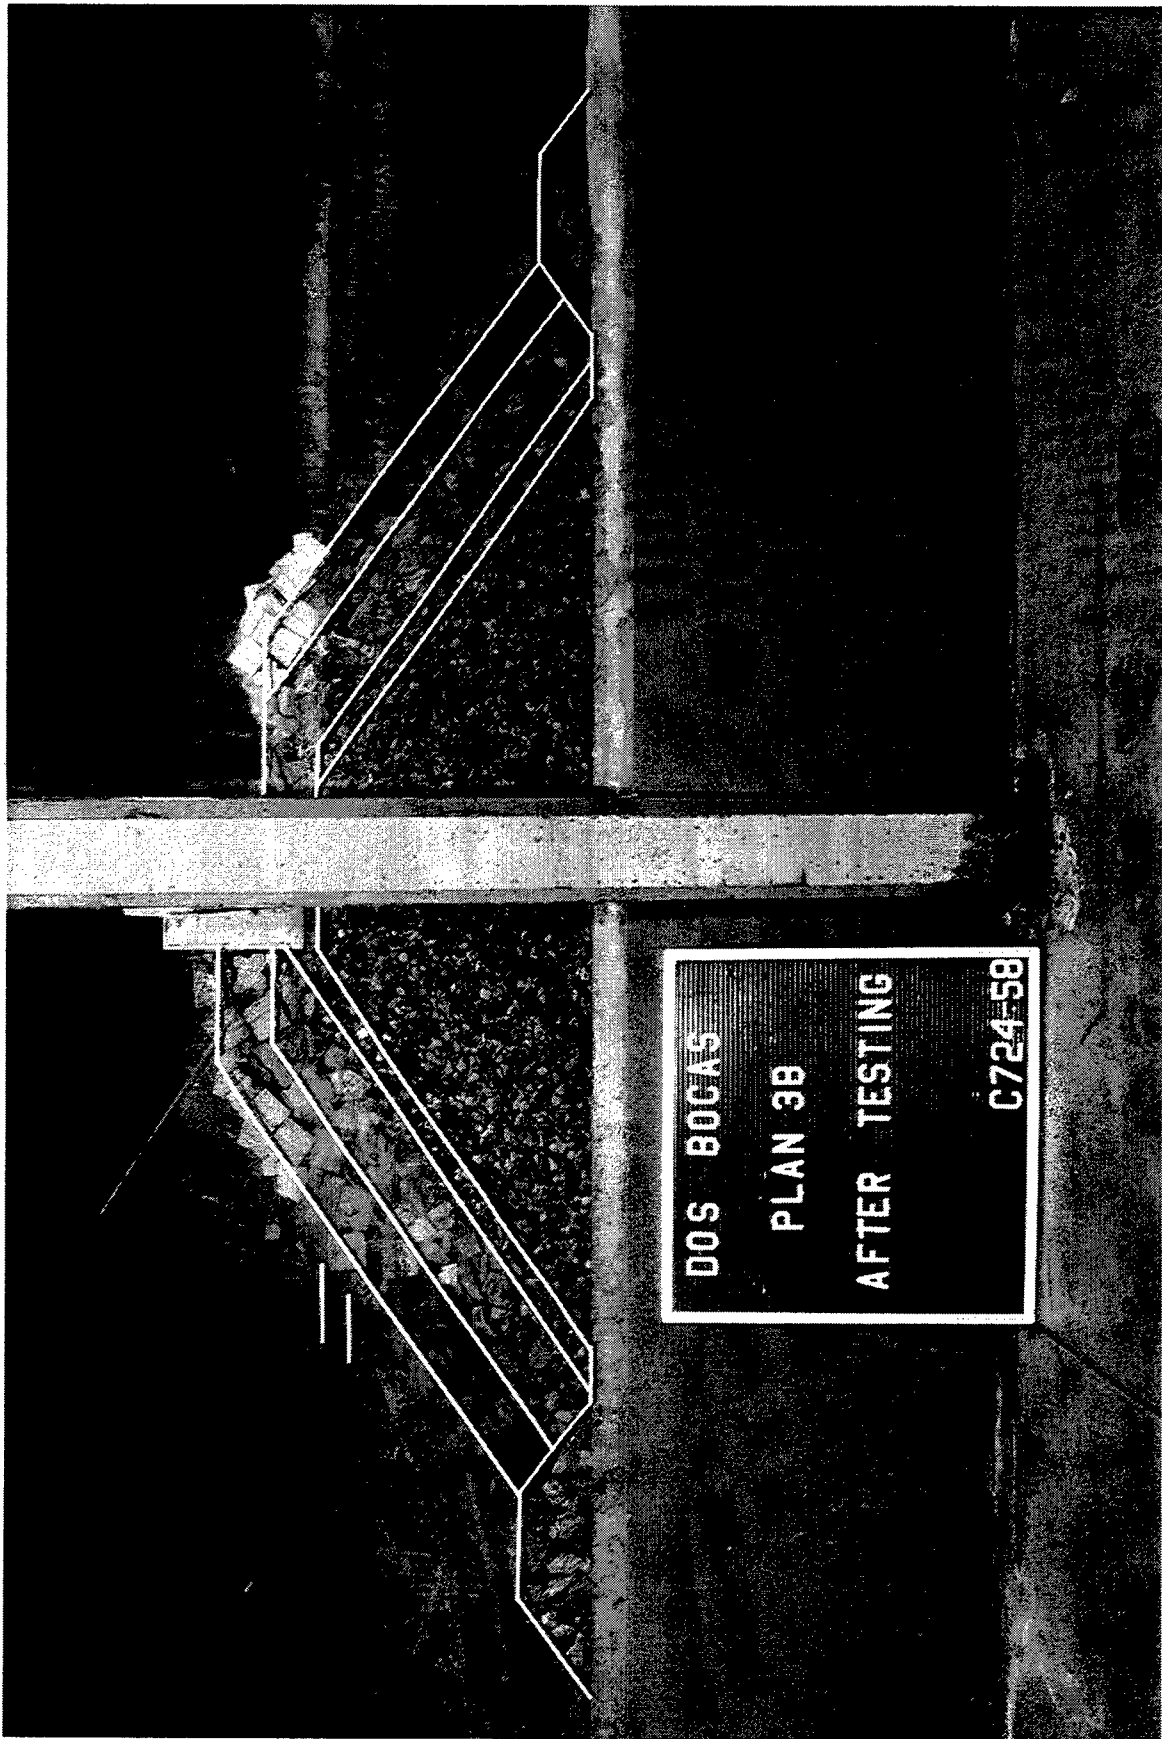


Photo 58. End view of Plan 3B after testing Hydrograph 1



Photo 59. Sea-side view of Plan 3B after testing Hydrograph 1

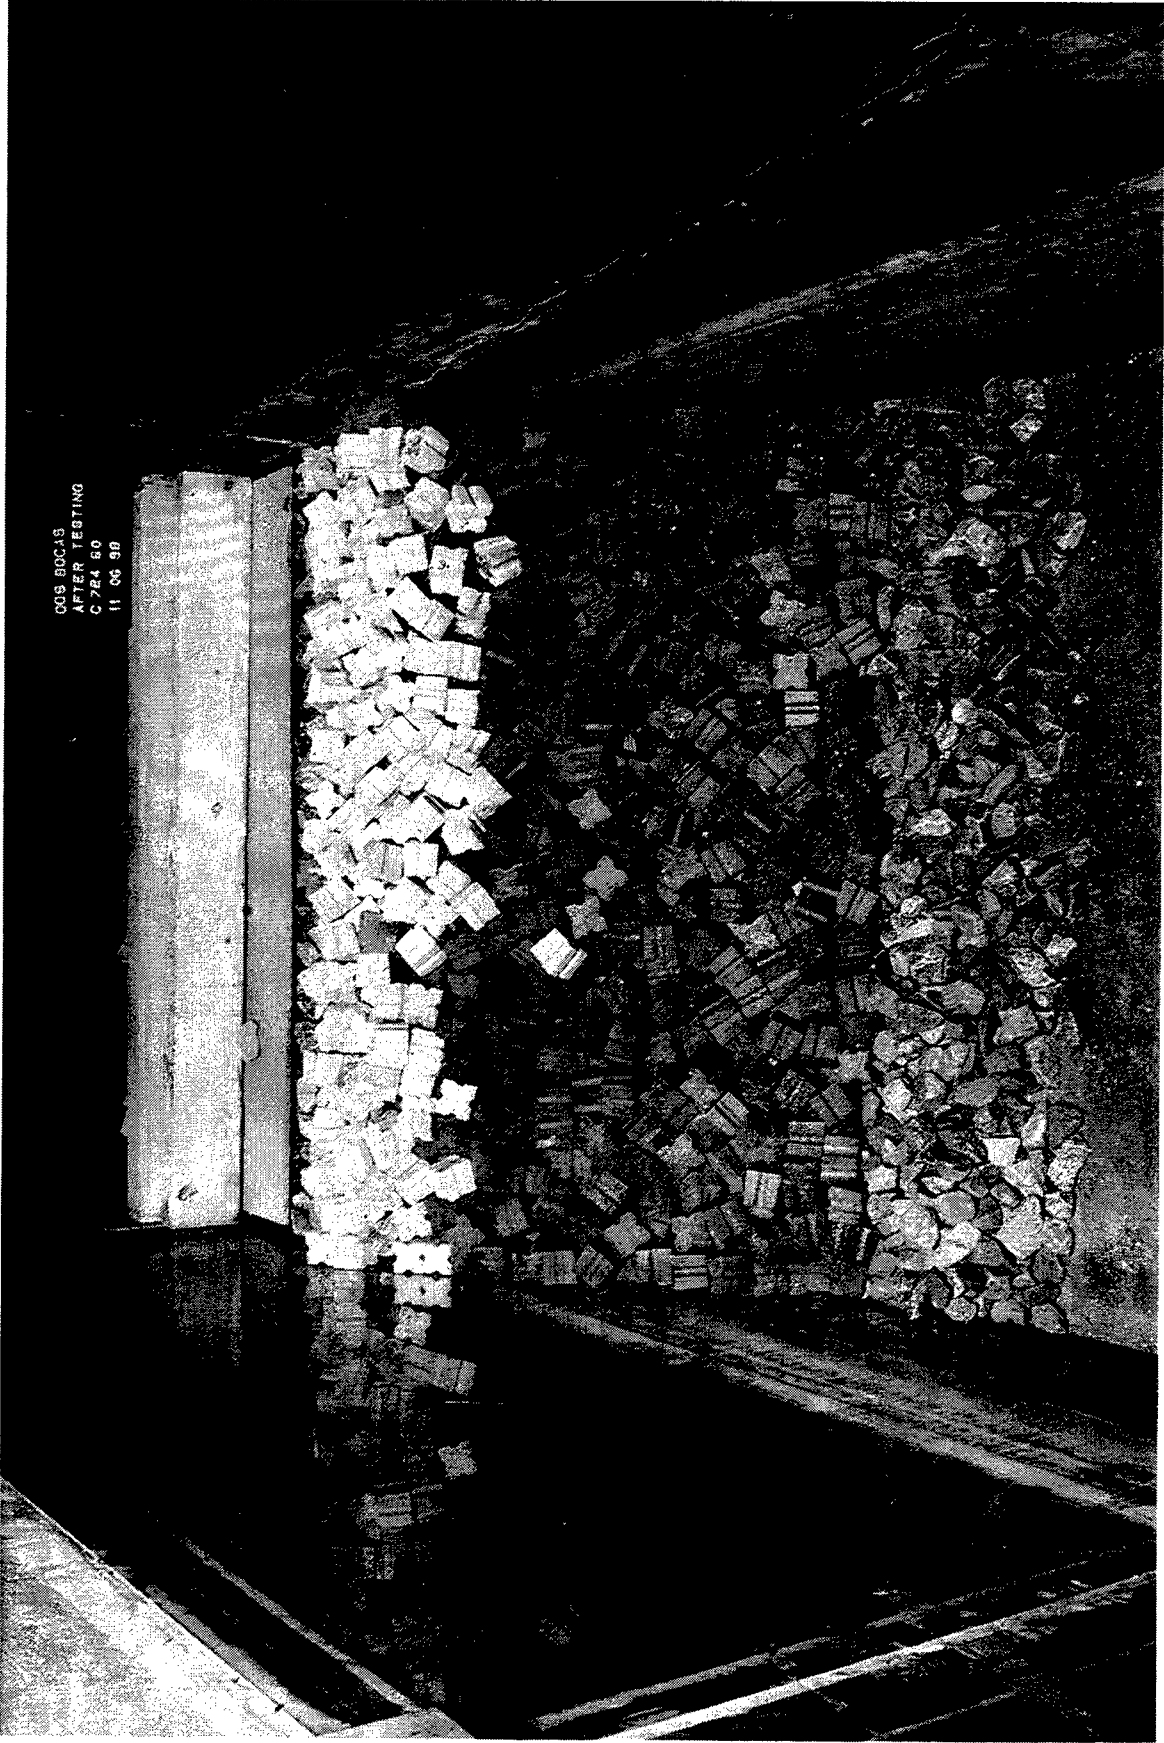


Photo 60. Harbor-side view of Plan 3B after testing Hydrograph 1


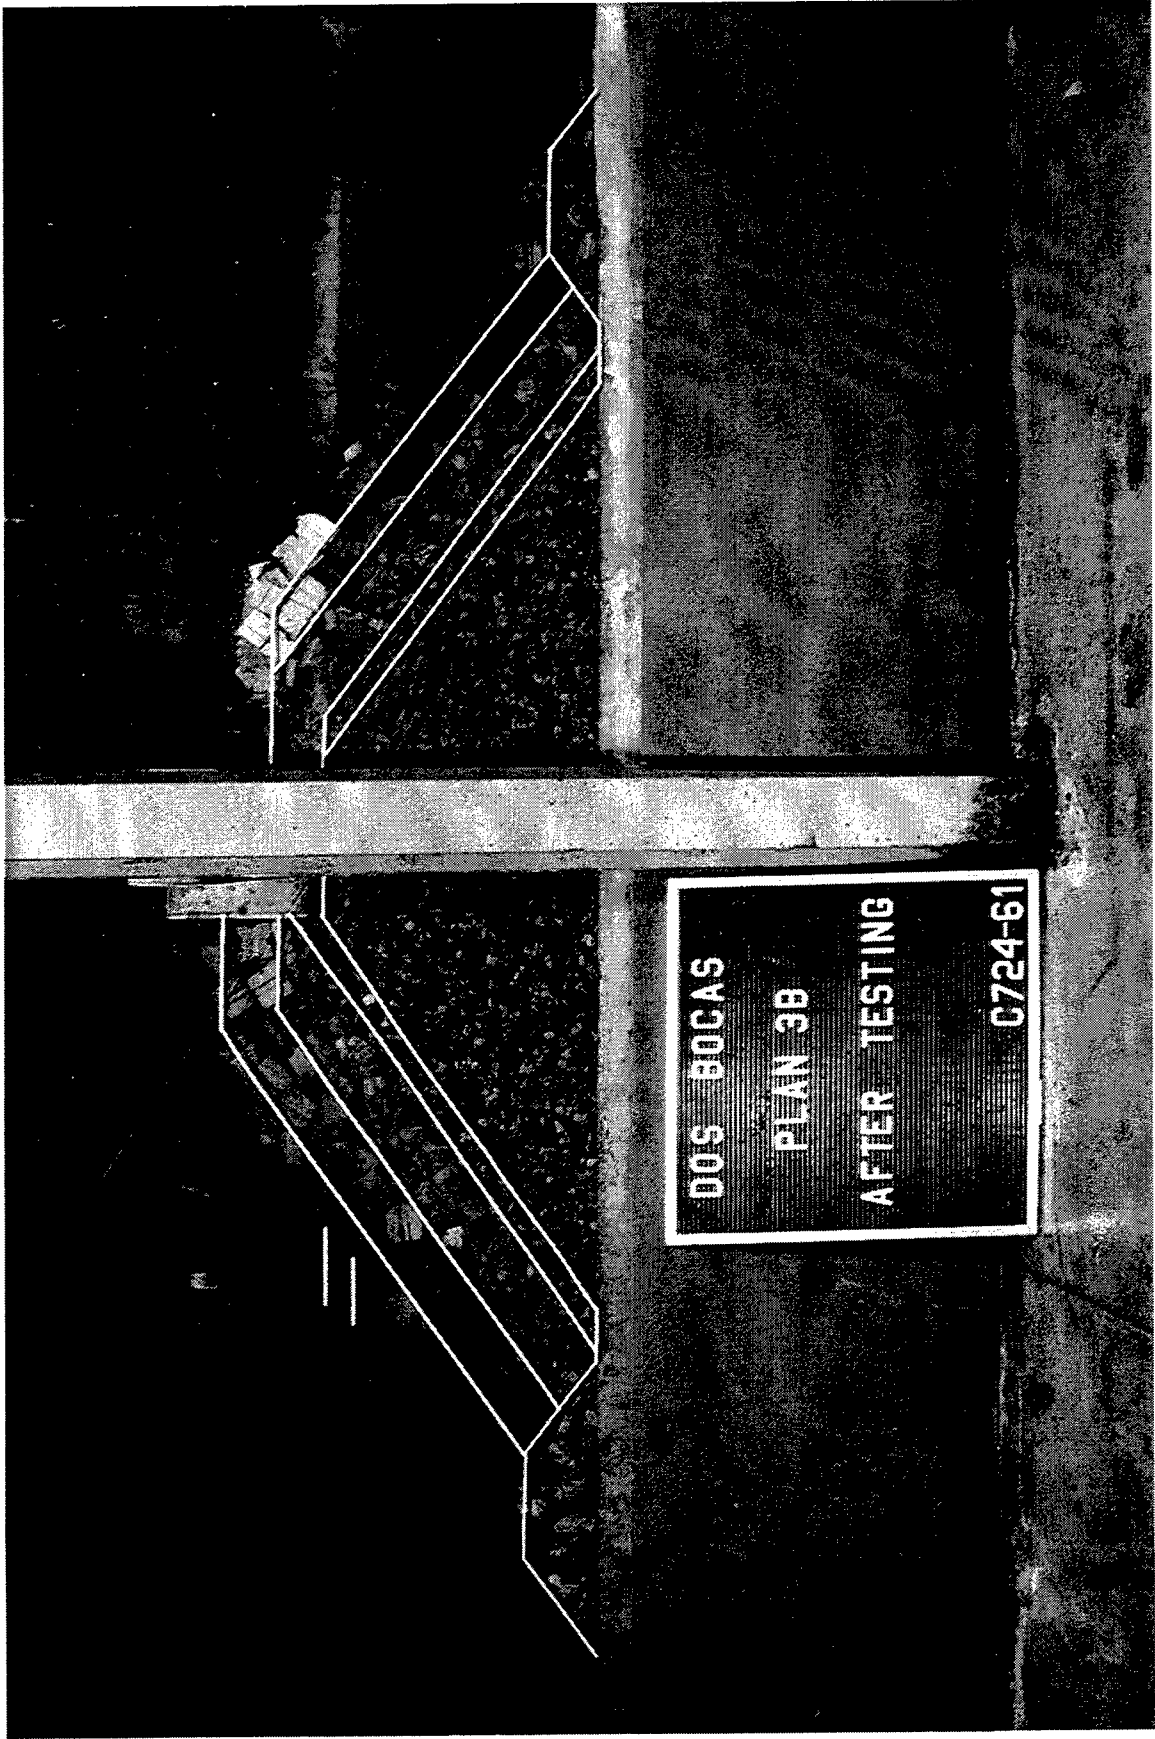


Photo 61. End view of Plan 3B at the conclusion of testing



Photo 62. Sea-side view of Plan 3B at the conclusion of testing

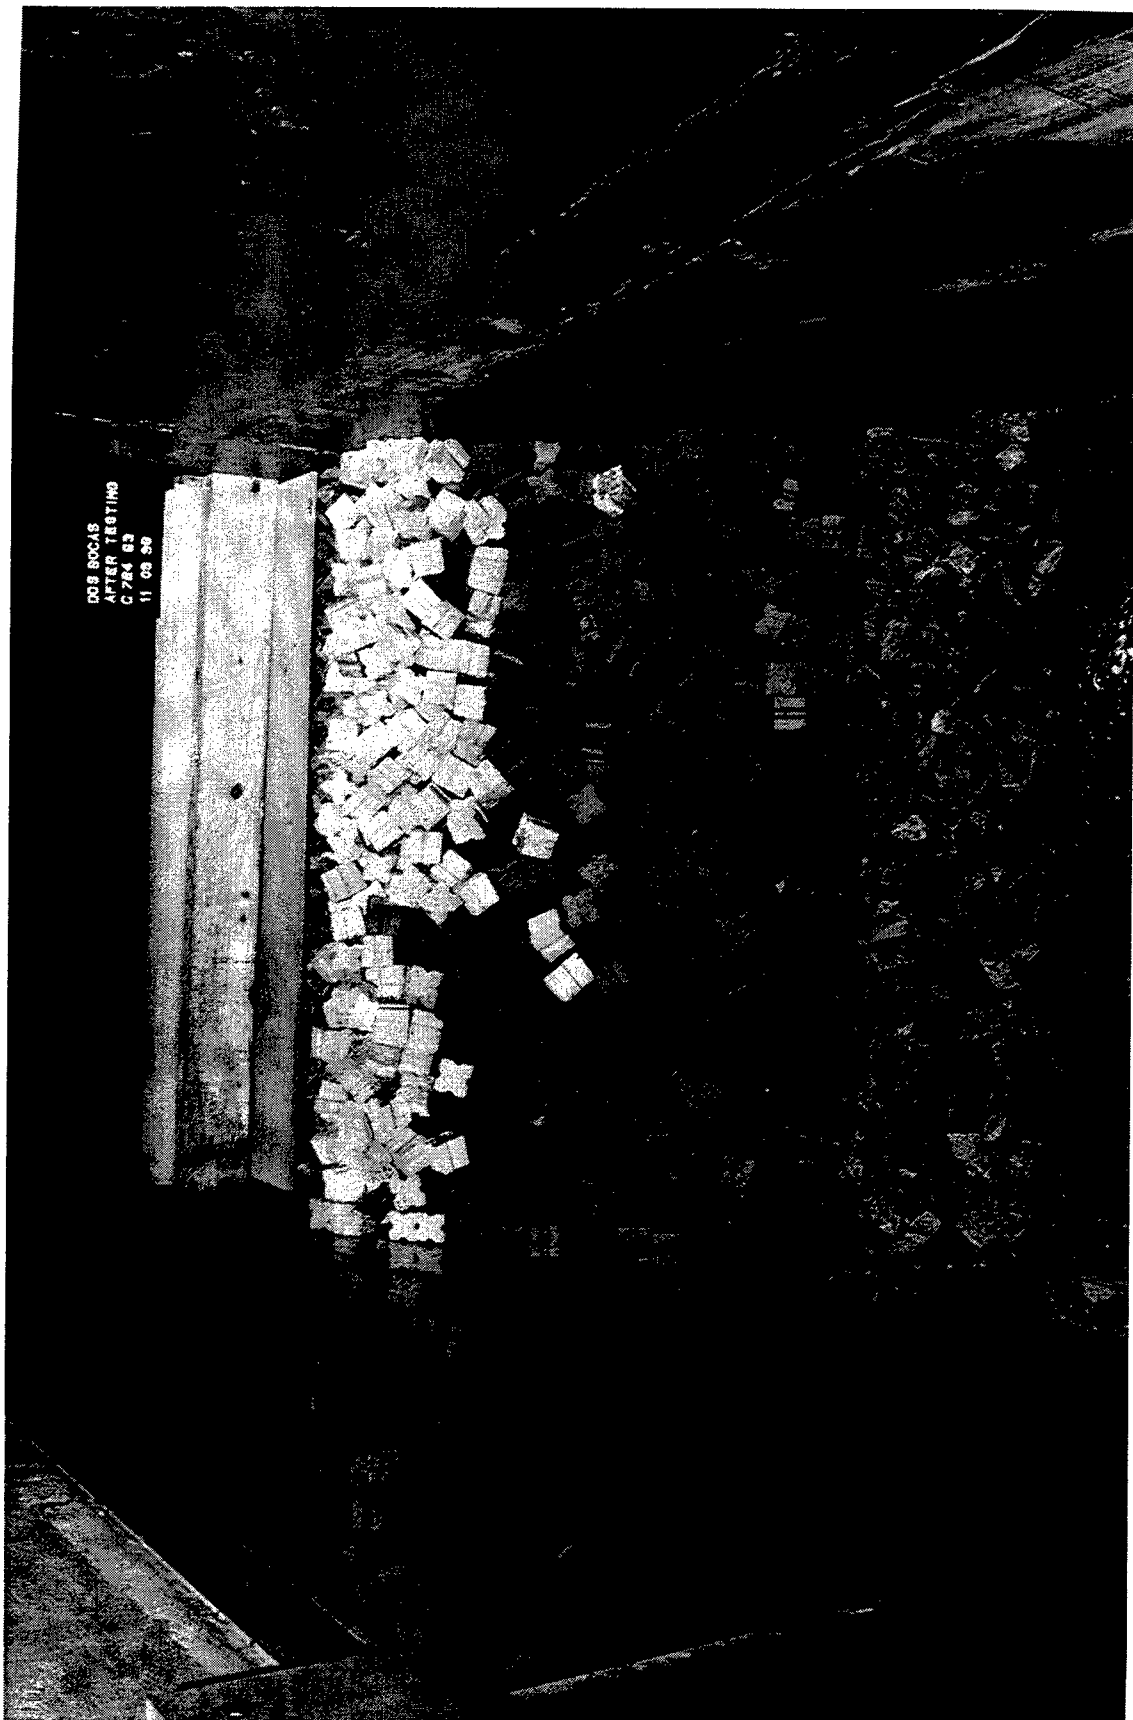

DOE BOCAS
AFTER TESTING
C.784.83
11 09 80

Photo 63. Harbor-side view of Plan 3B at the conclusion of testing

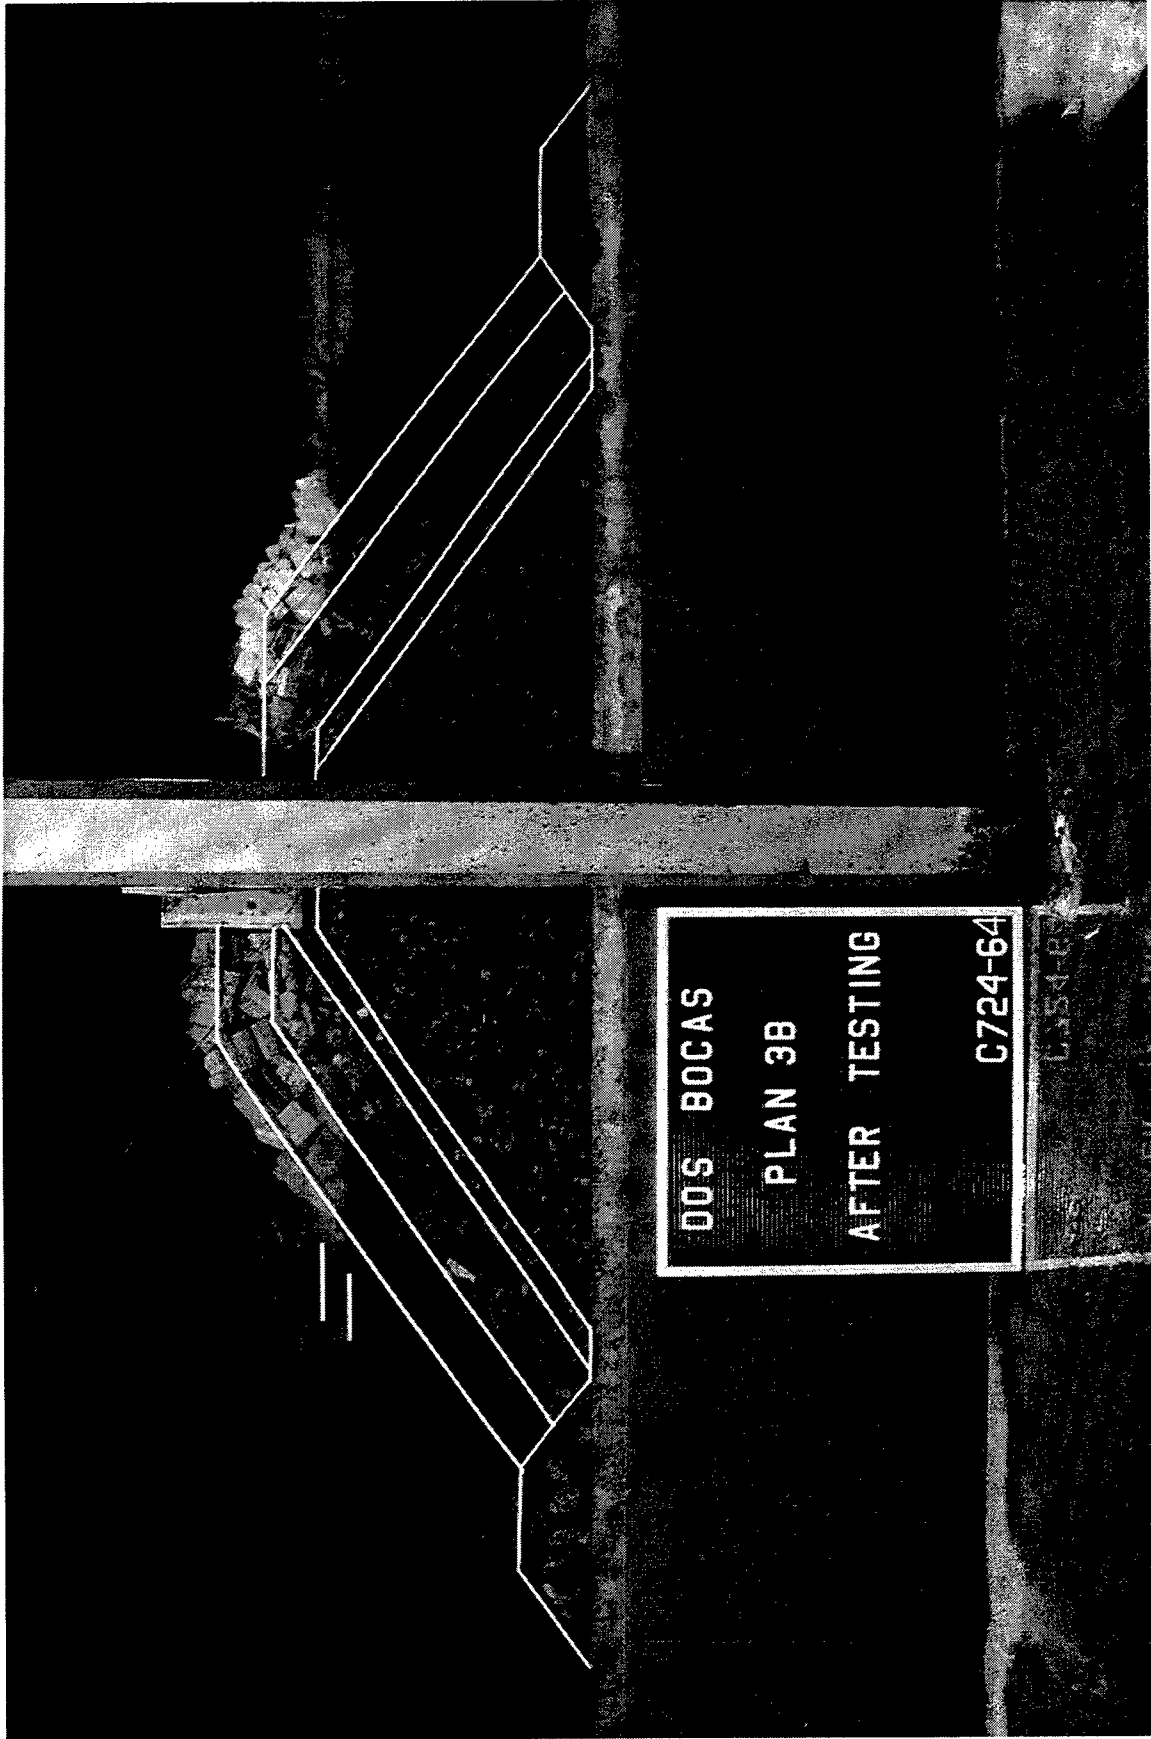


Photo 64. Repeat test of Plan 3B. End view after testing Hydrograph 1



008 BOCAG
AFTER TESTING
C 724 68
11 09 98

00812 00

Photo 65. Repeat test of Plan 3B. Sea-side view after testing Hydrograph 1


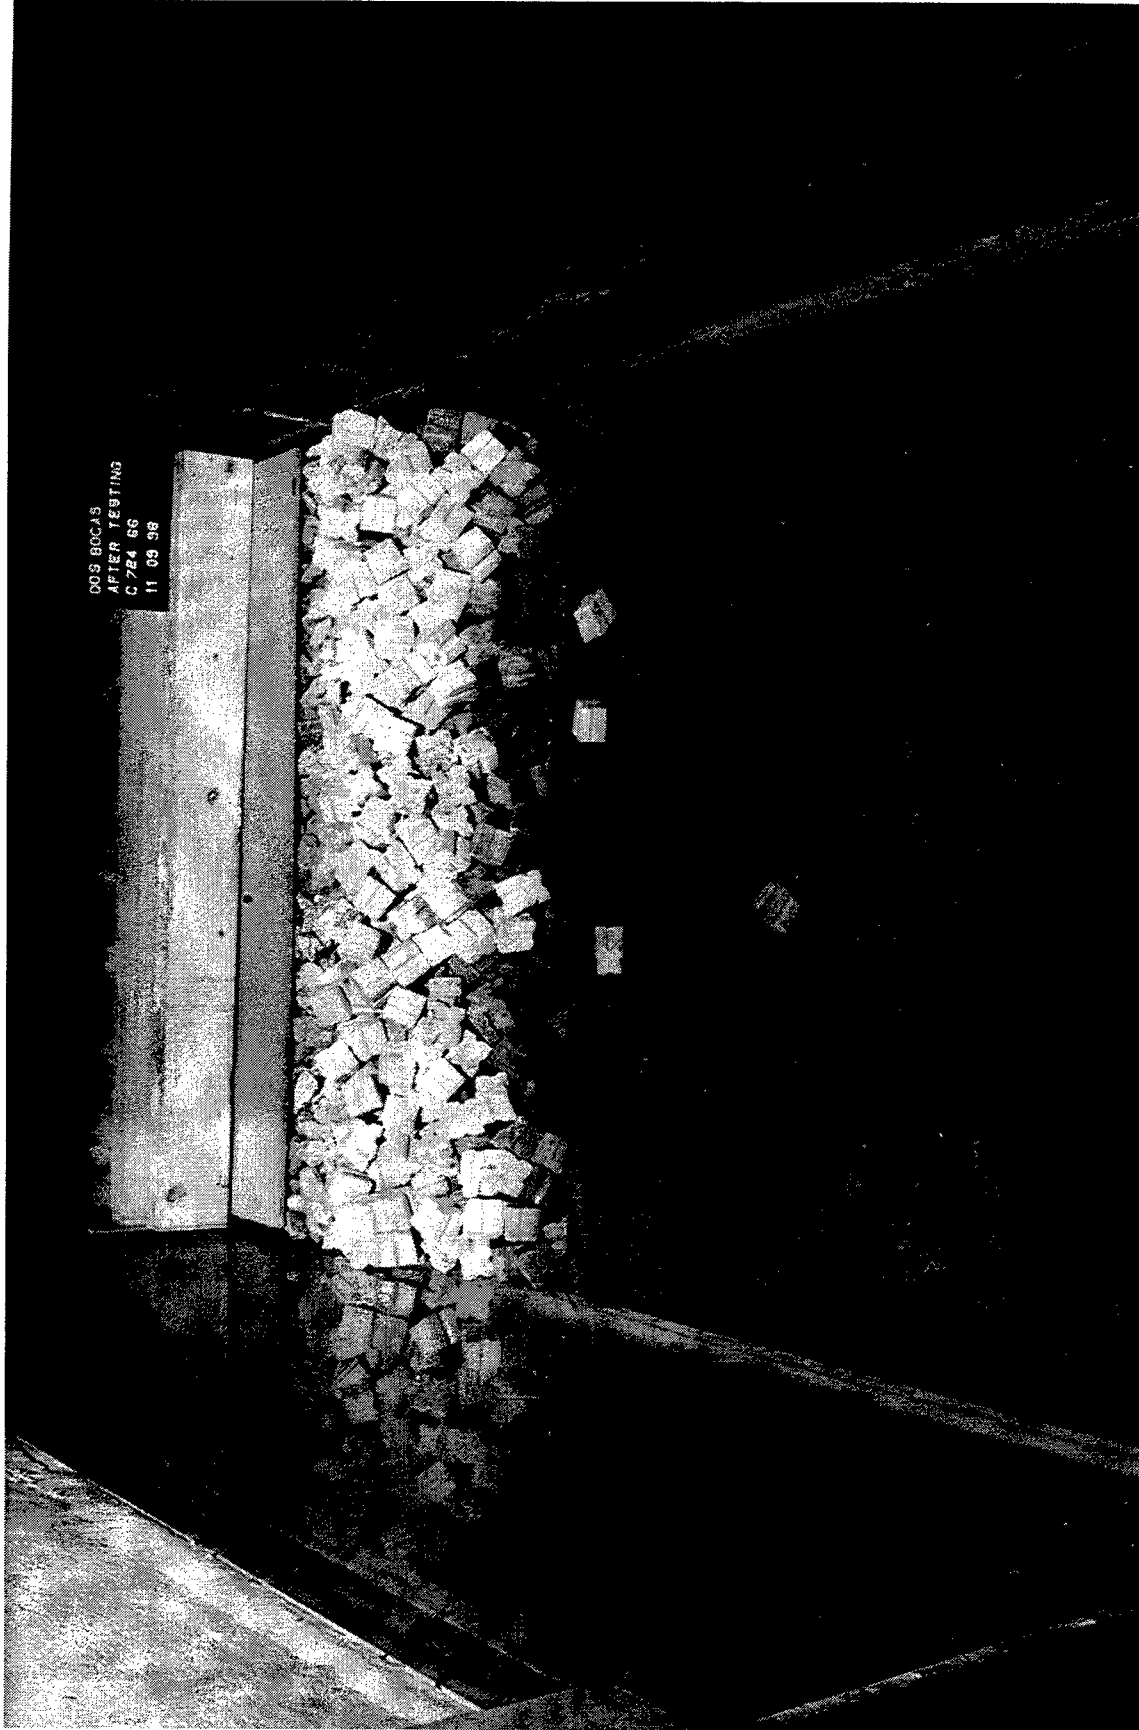


Photo 66. Repeat test of Plan 3B. Harbor-side view after testing Hydrograph 1



69812-06

Photo 67. Repeat test of Plan 3B. End view at the completion of testing

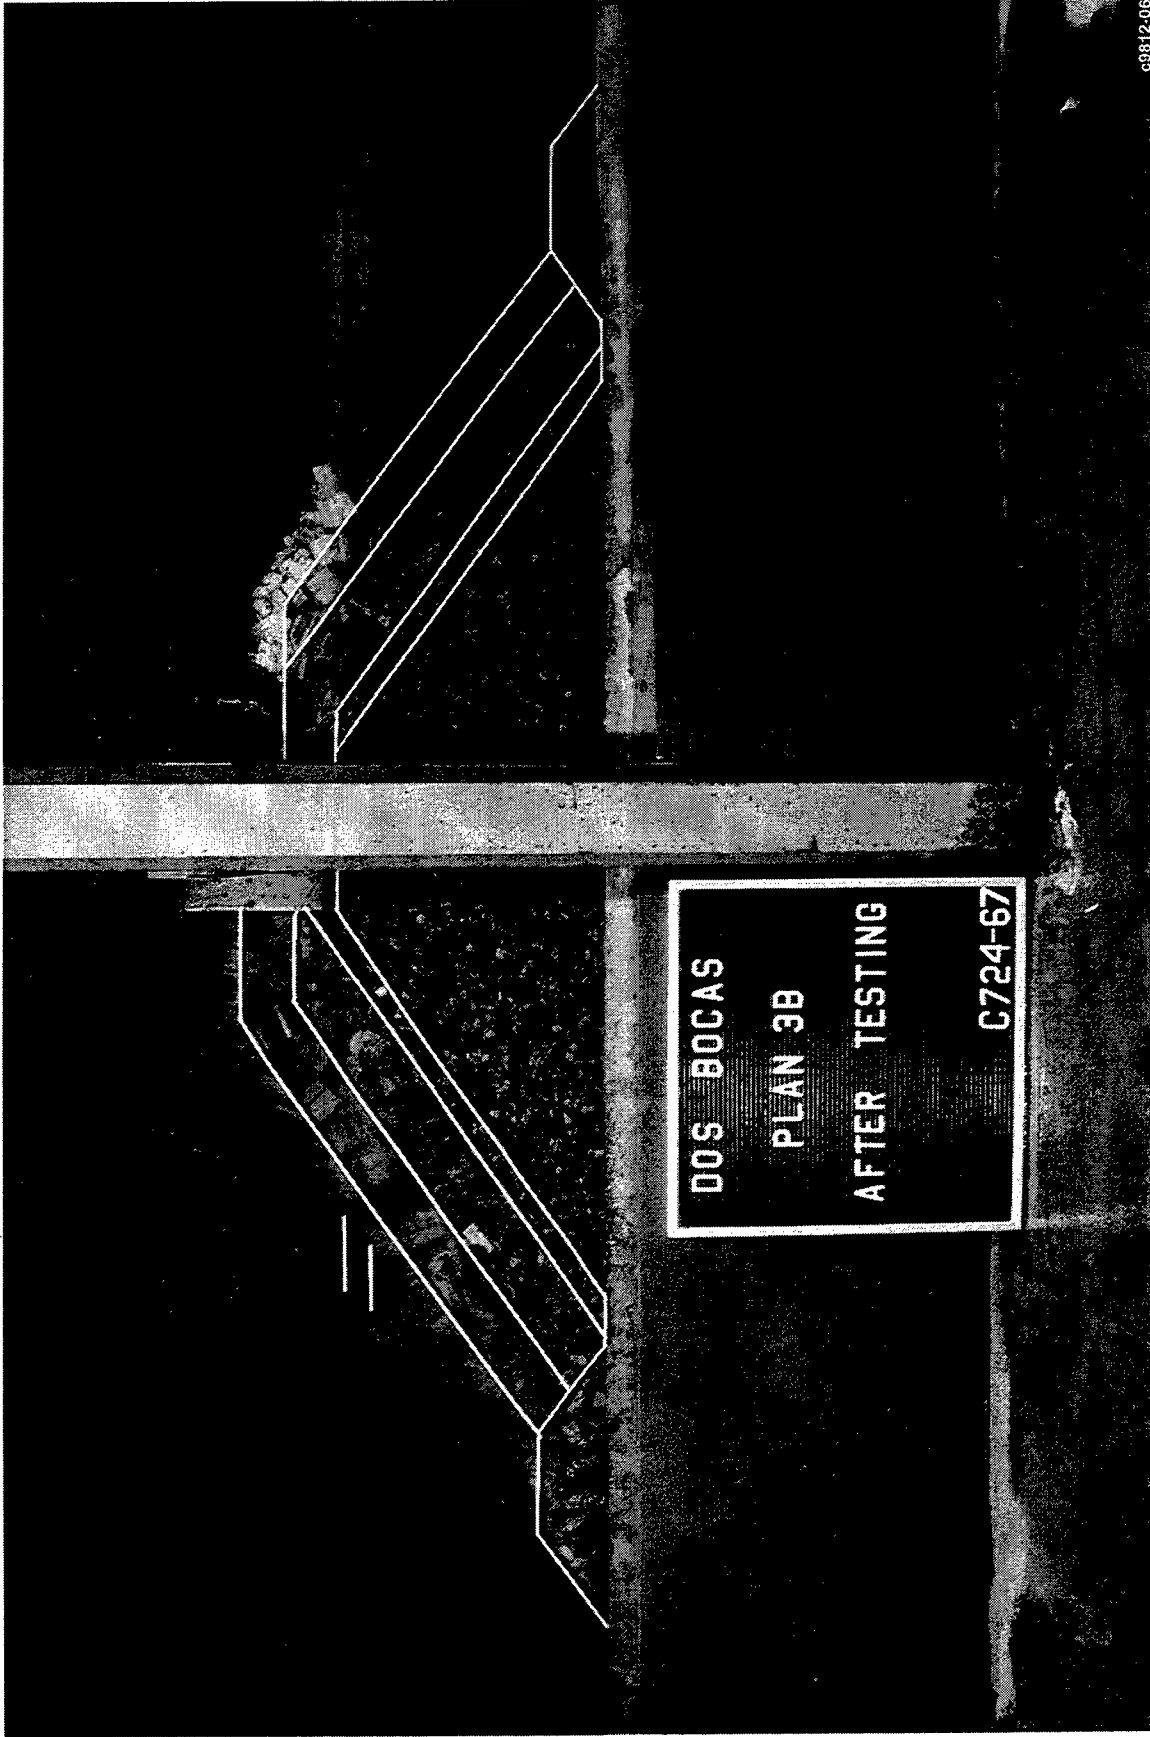

DOR BOOAS
AFTER TESTING
C 724 68
11 09 88

09812-05

Photo 68. Repeat test of Plan 3B. Sea-side view at the completion of testing

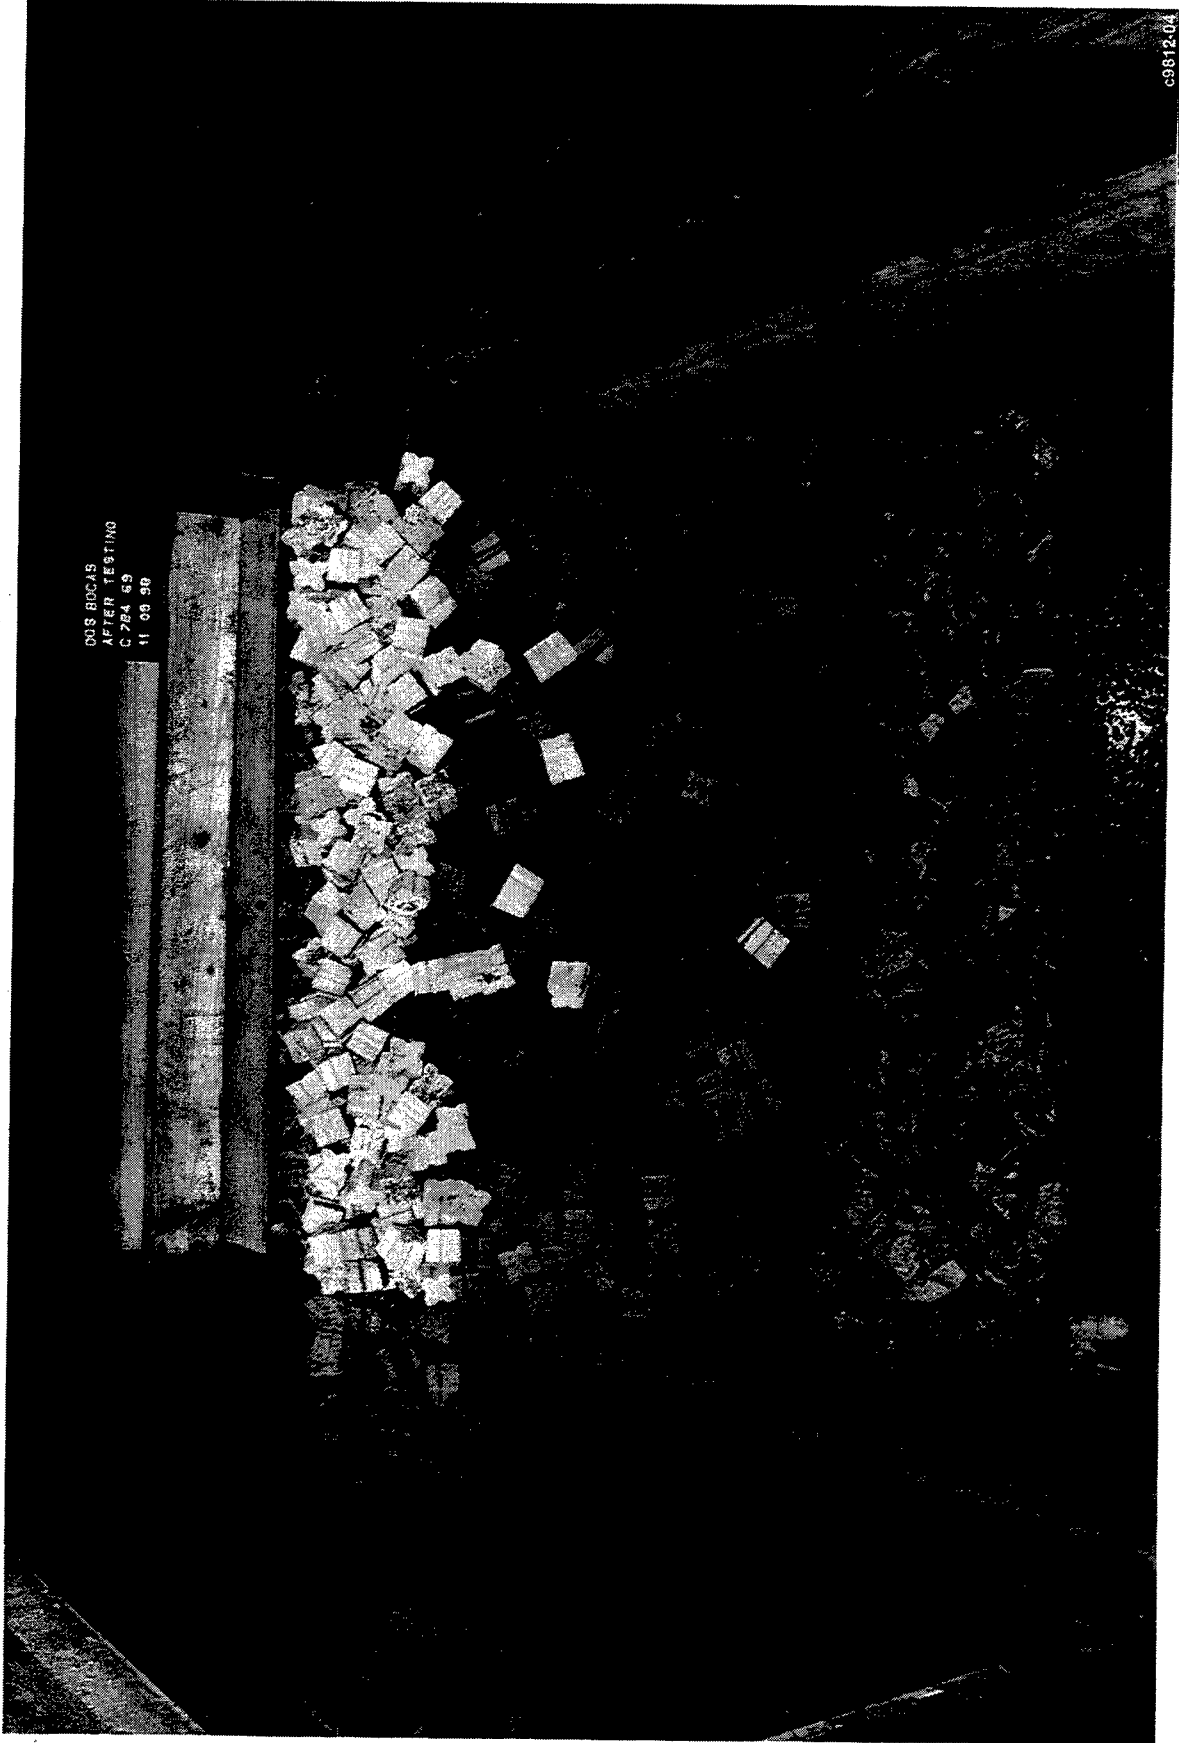


Photo 69. Repeat test of Plan 3B. Harbor-side view at the completion of testing


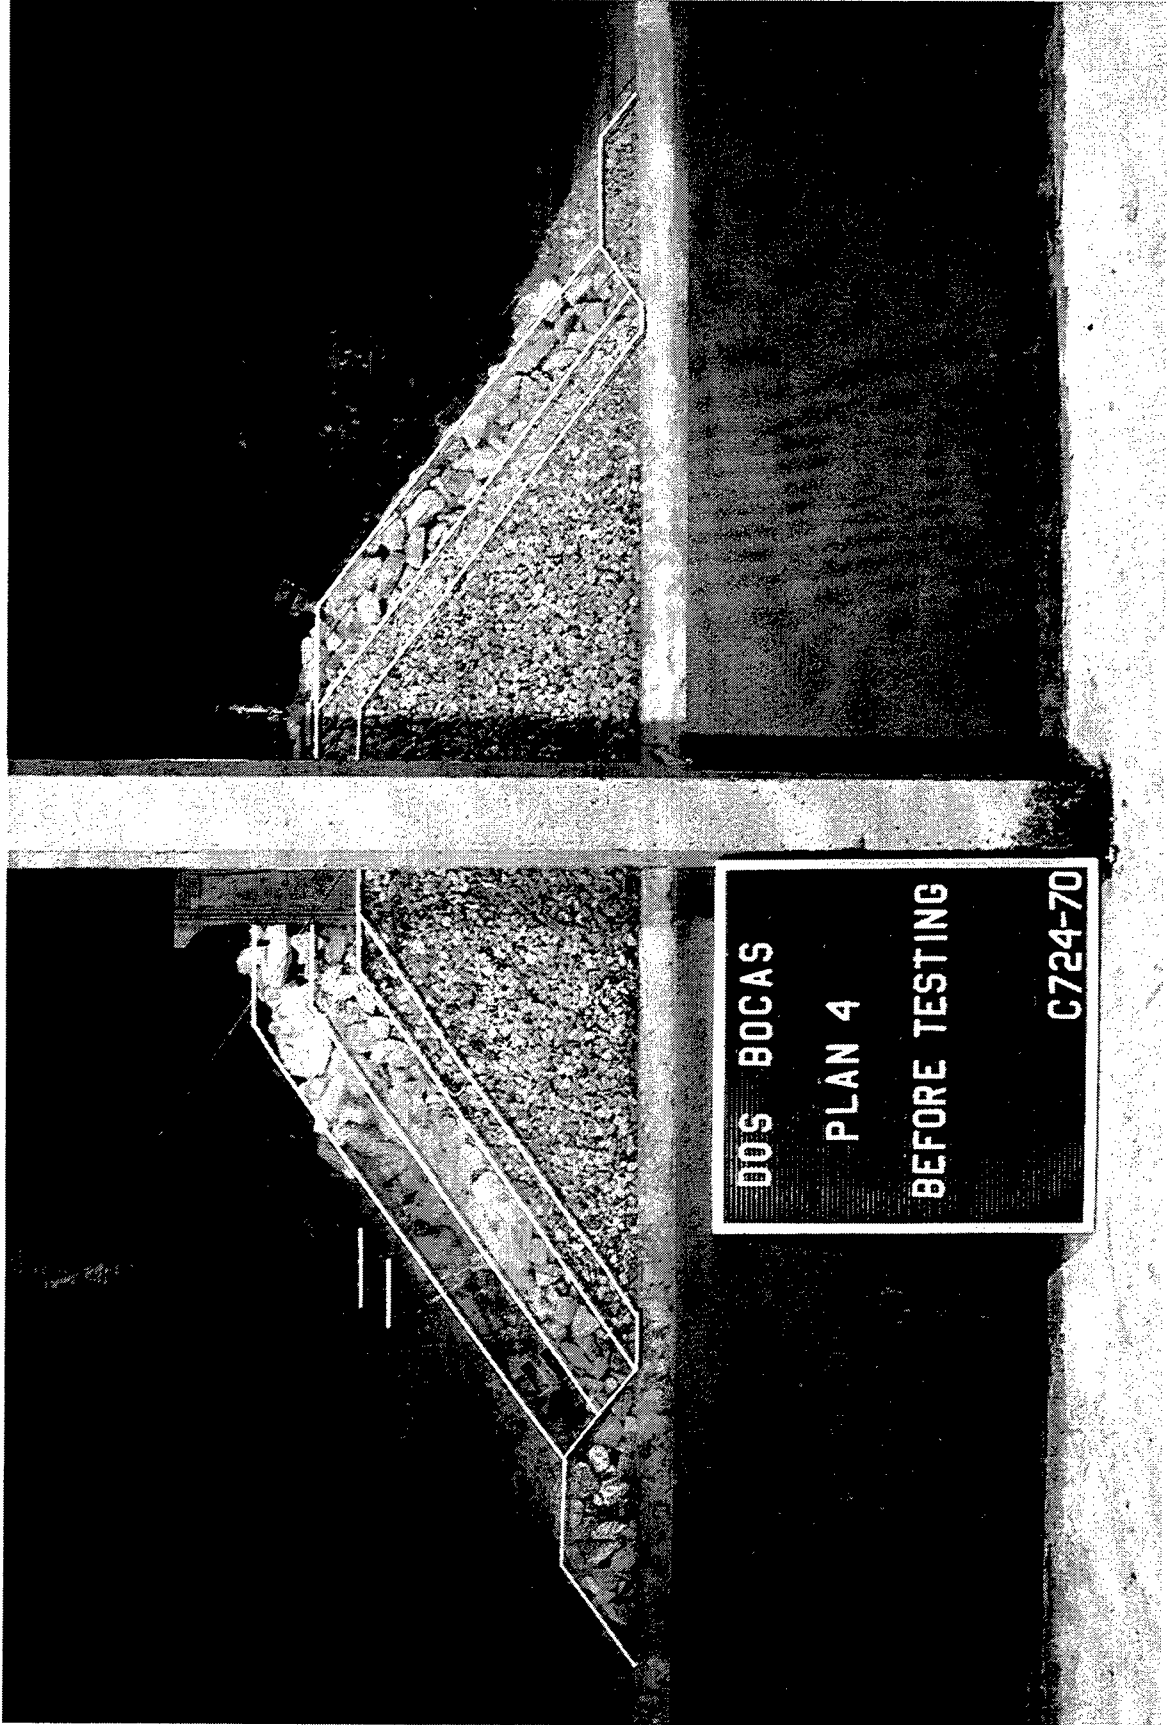


Photo 70. End view of Plan 4 before wave attack

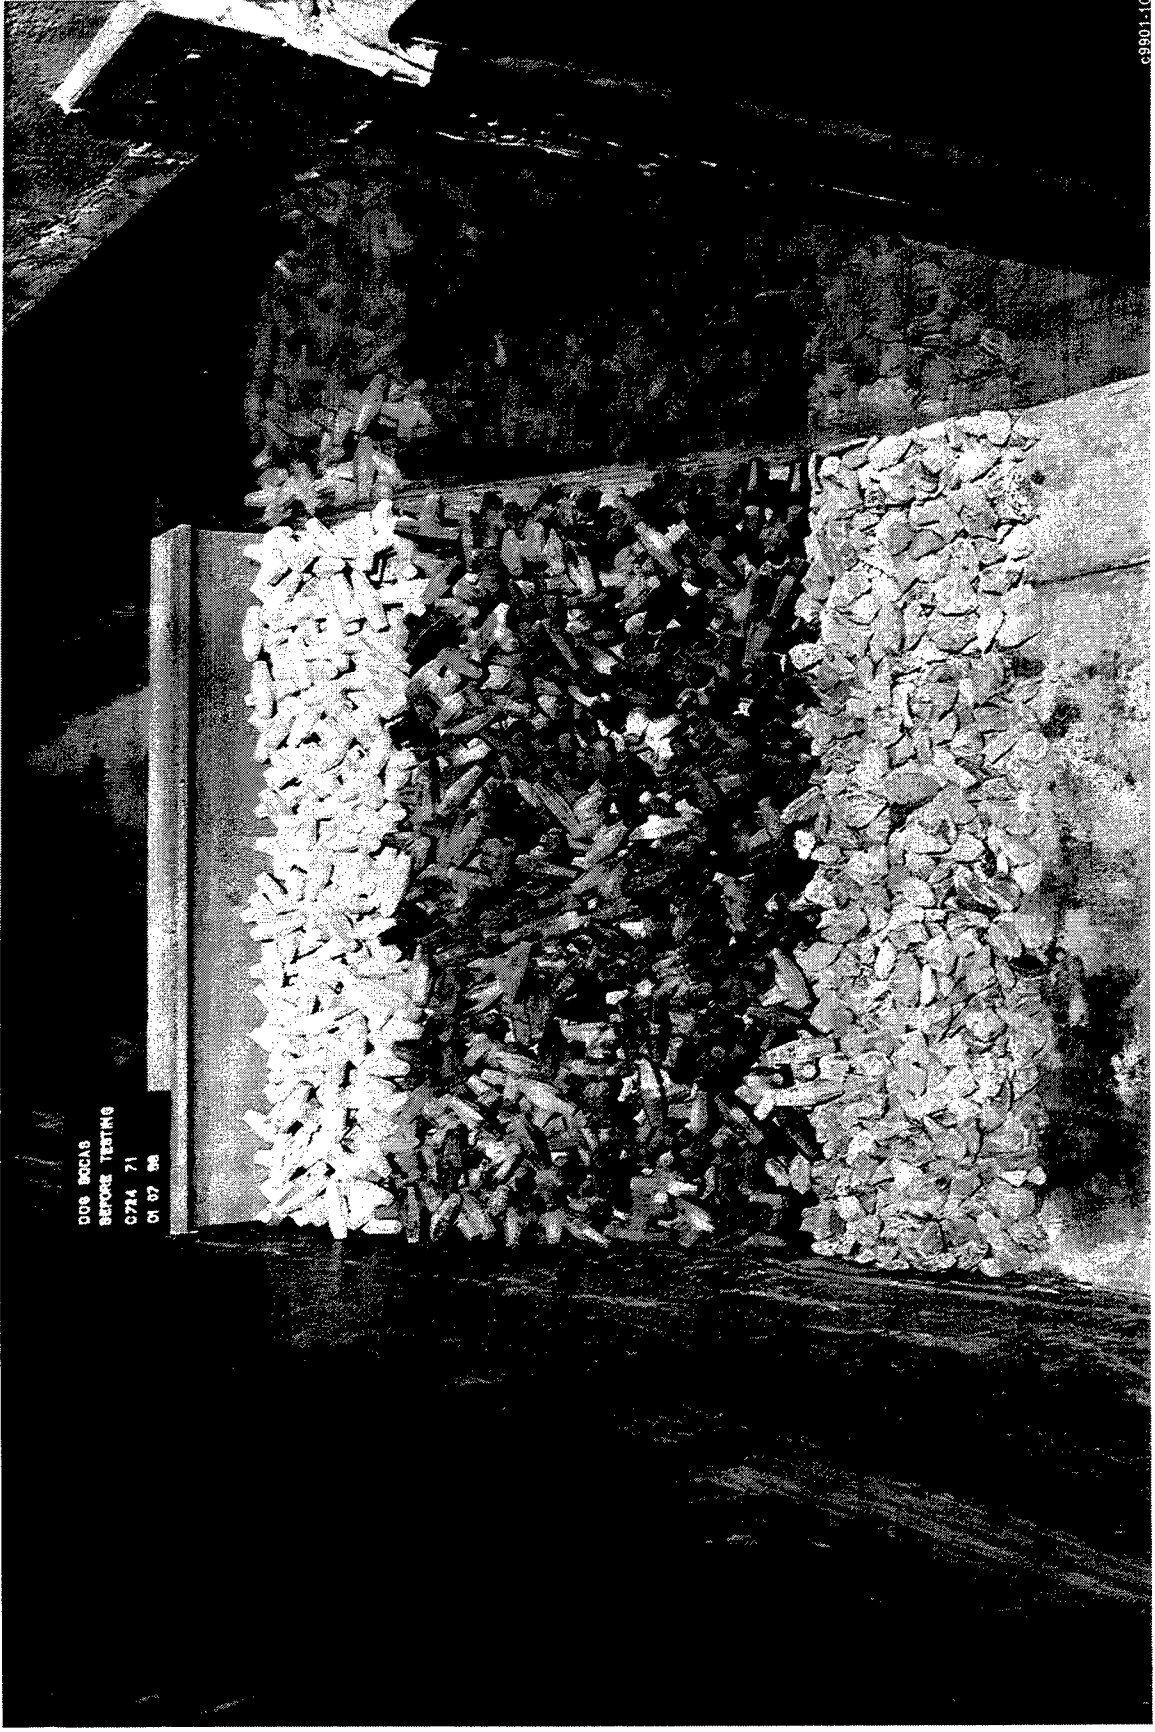

008 800AB
BEFORE TESTING
0724 71
01 07 98

C99801-10

Photo 71. Sea-side view of Plan 4 before wave attack


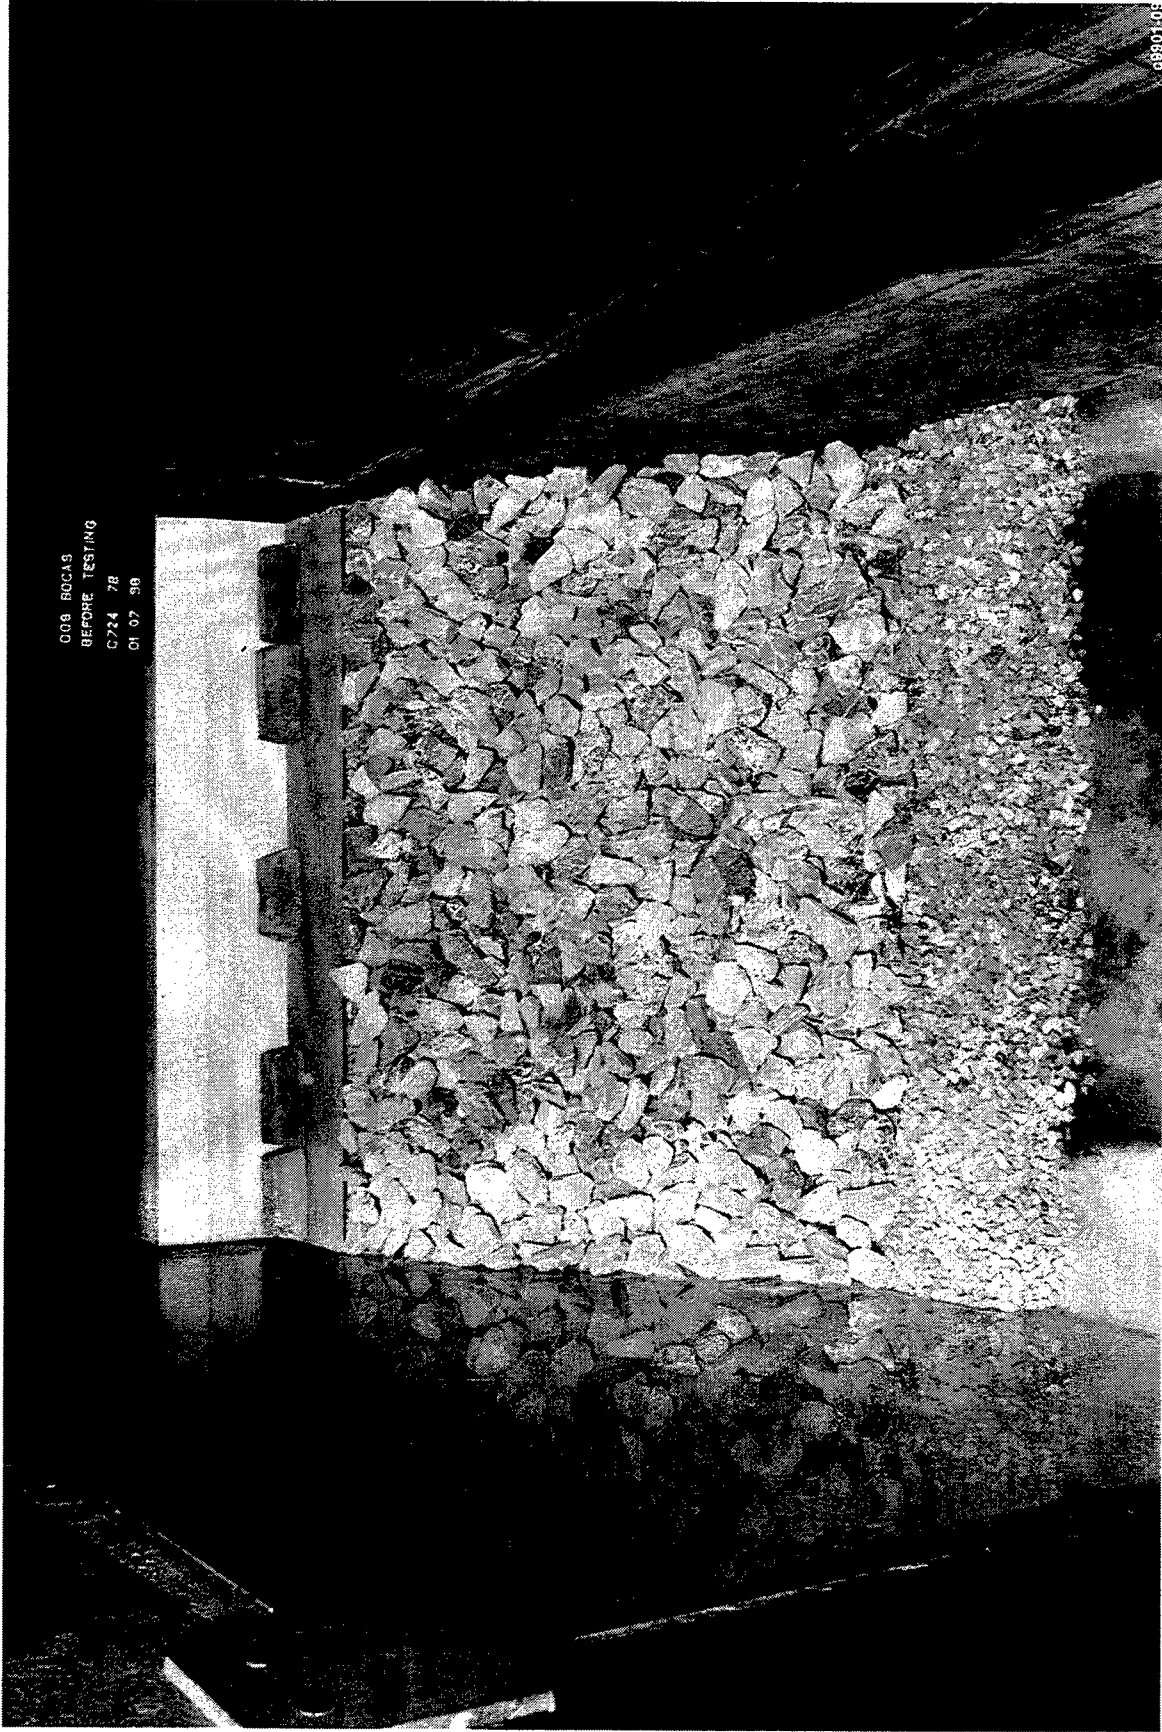


Photo 72. Harbor-side view of Plan 4 before wave attack



C9801-14

Photo 73. End view of Plan 4 after testing Hydrograph 1

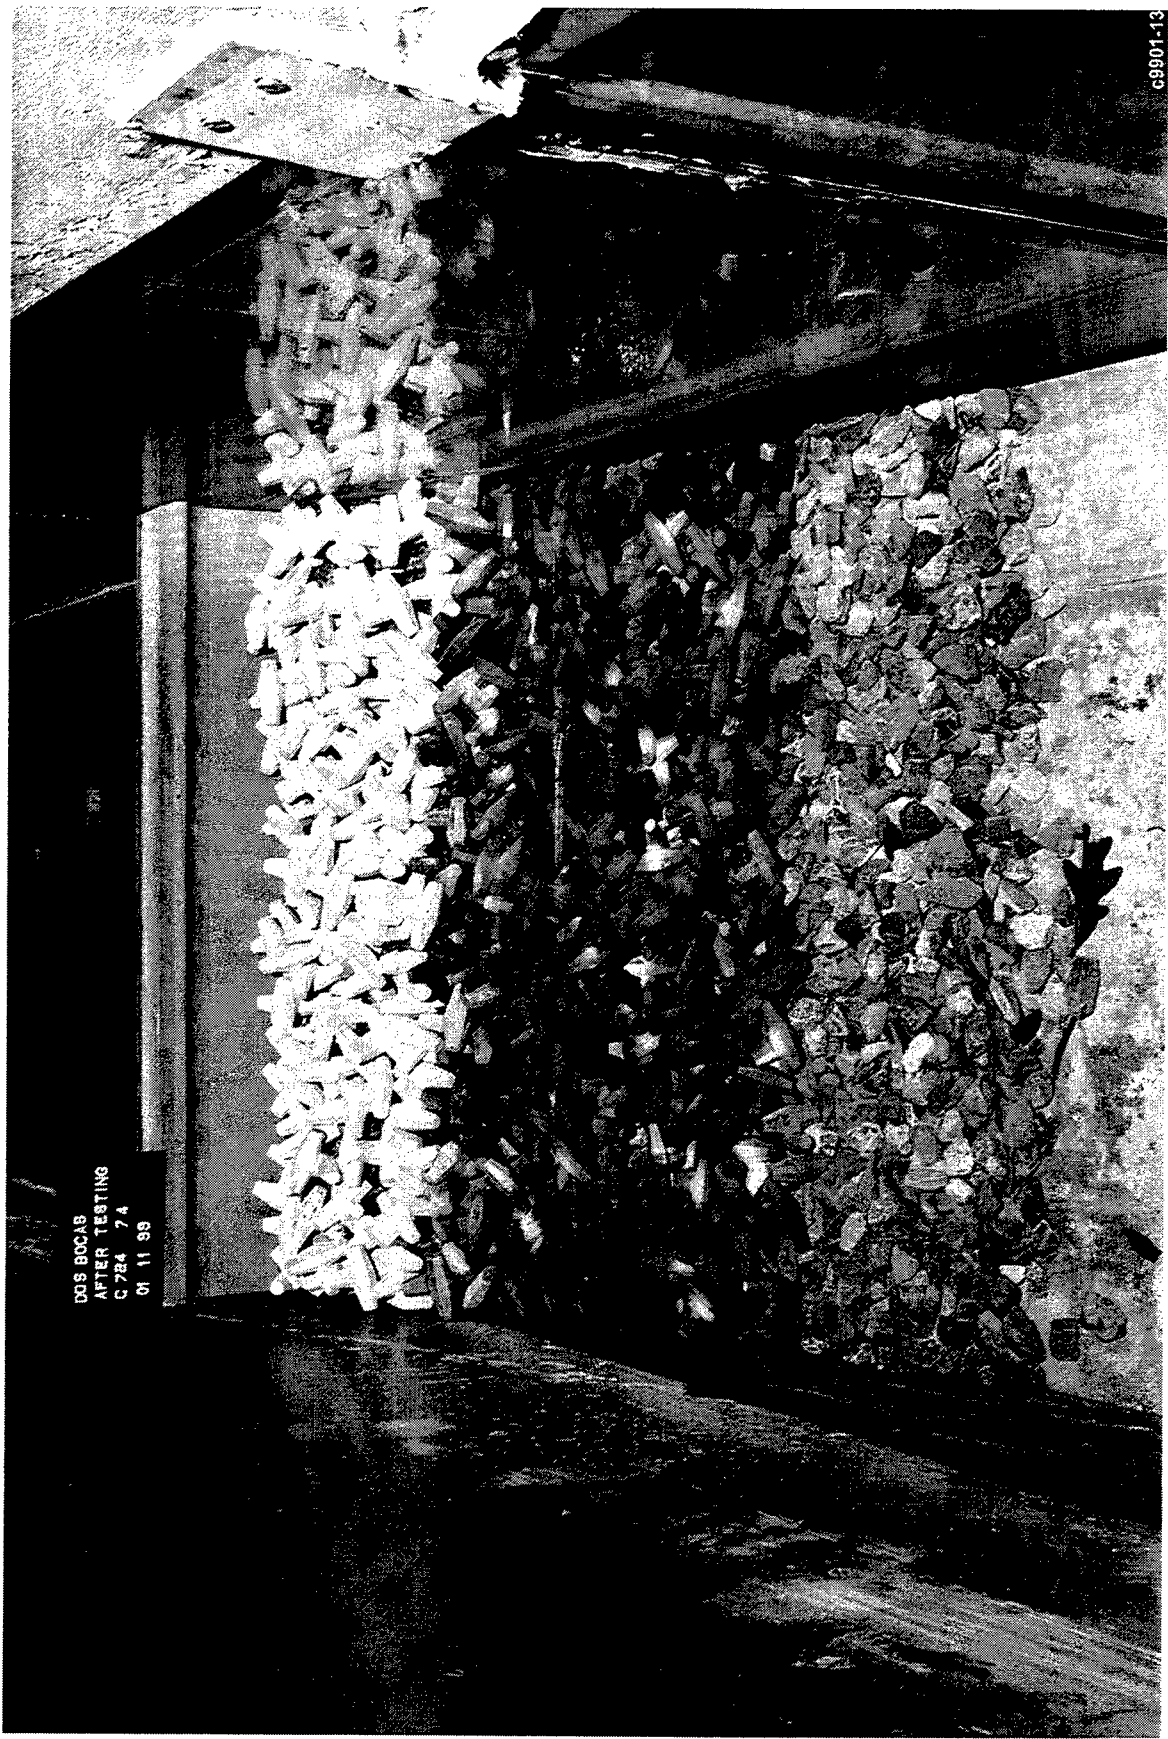

DOS BOCAS
AFTER TESTING
C 784 74
01 11 98

69901-13

Photo 74. Sea-side view of Plan 4 after testing Hydrograph 1



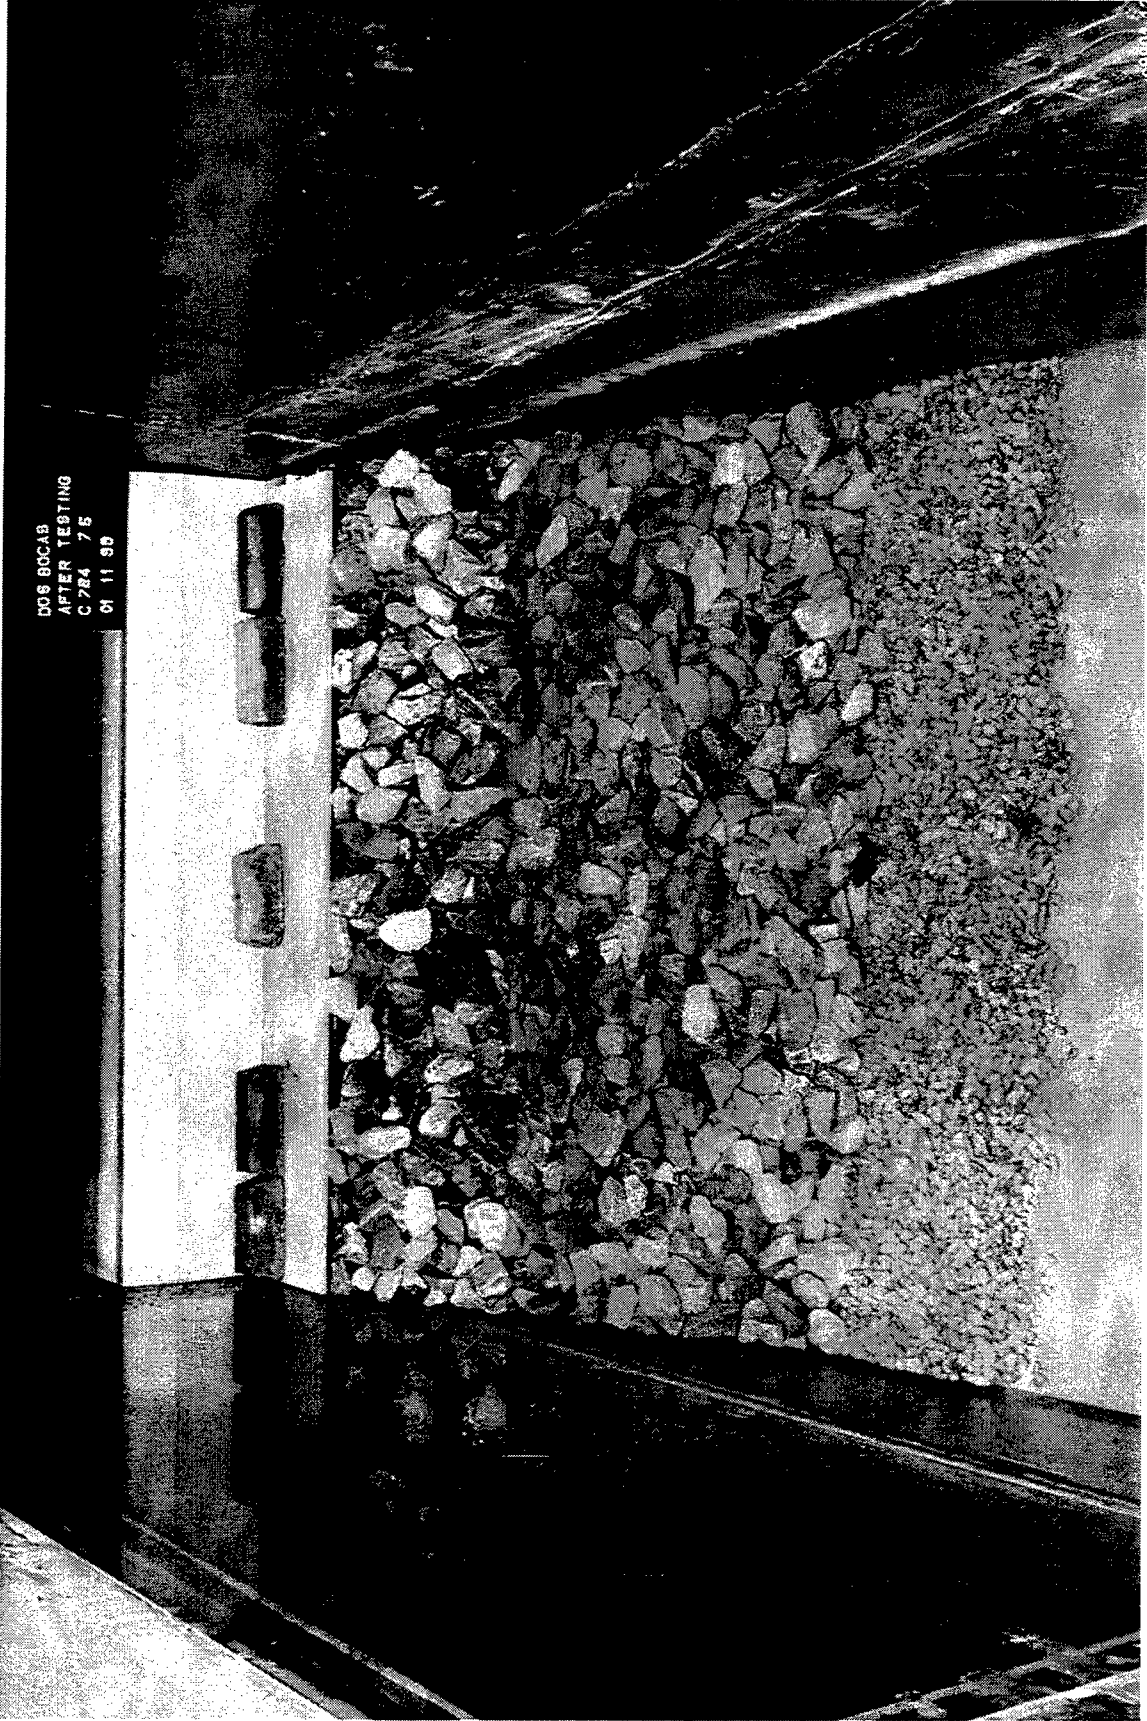


Photo 75. Harbor-side view of Plan 4 after testing Hydrograph 1

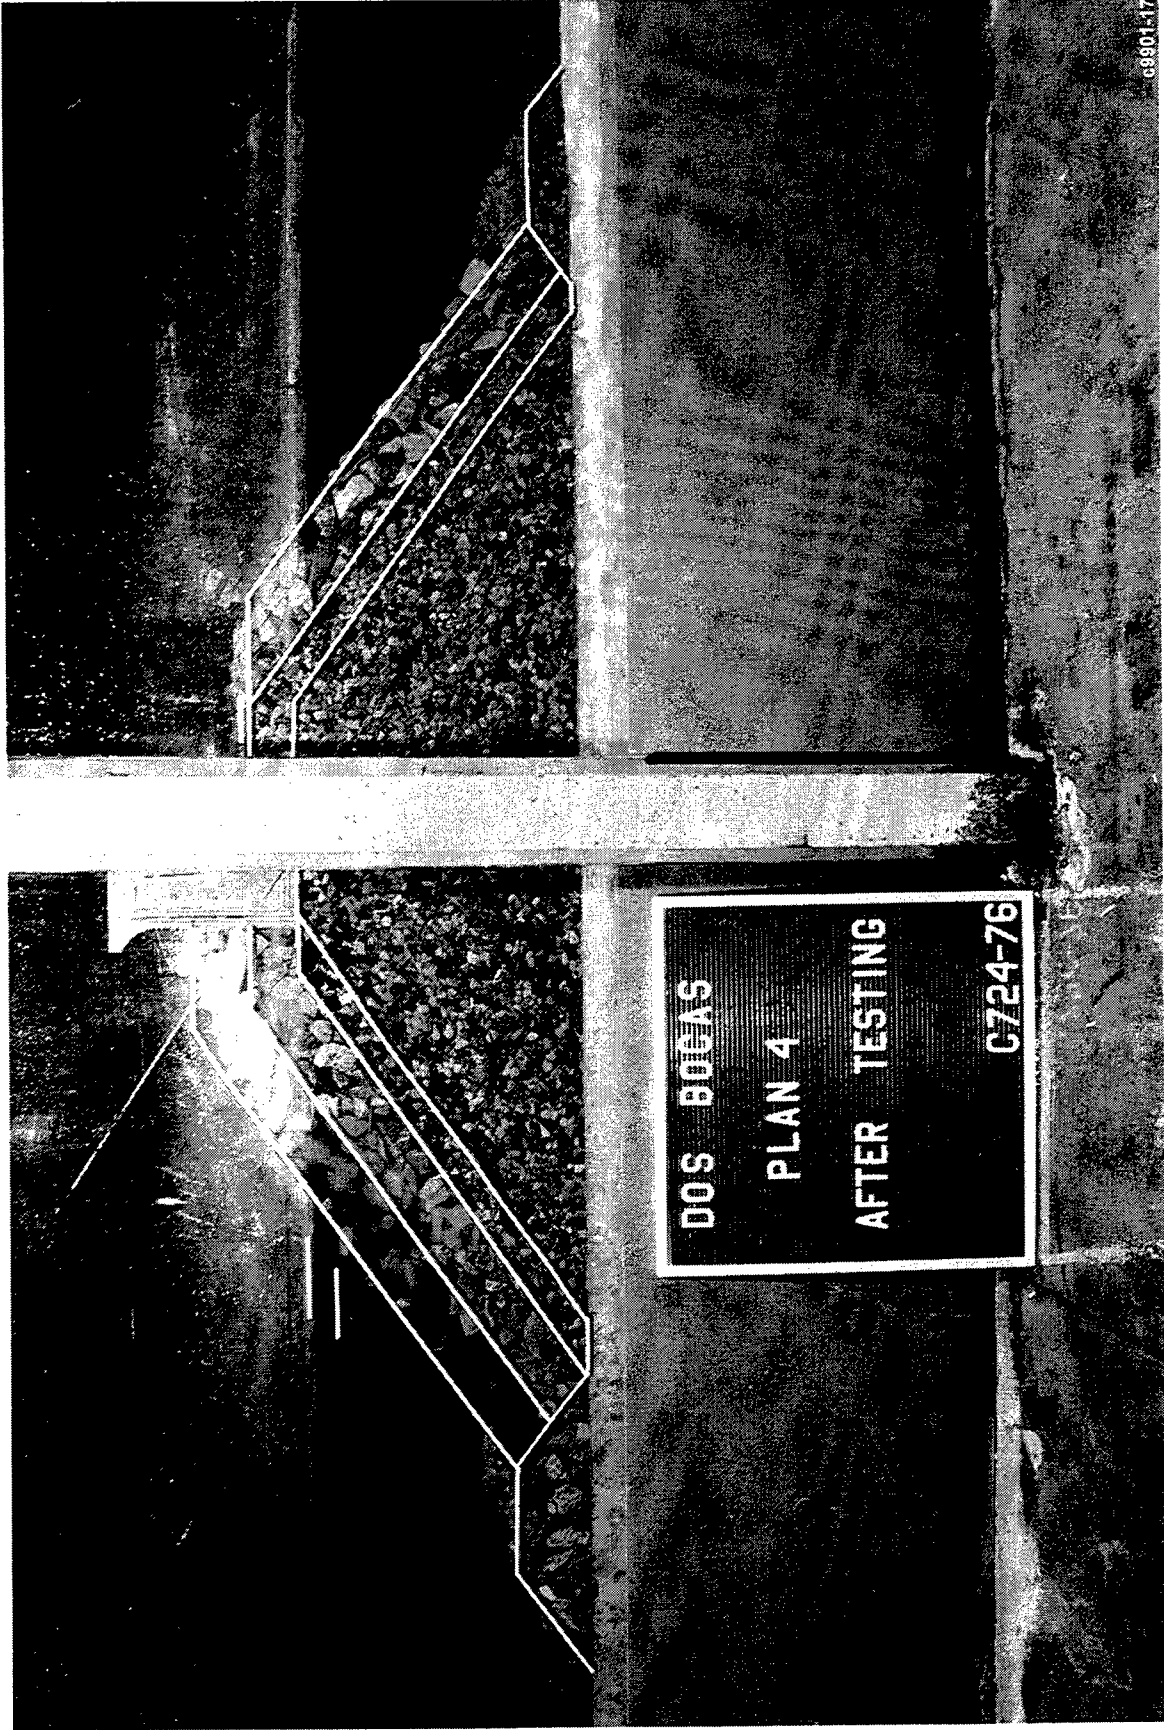

68901-17


Photo 76. End view of Plan 4 after 7-m wave attack

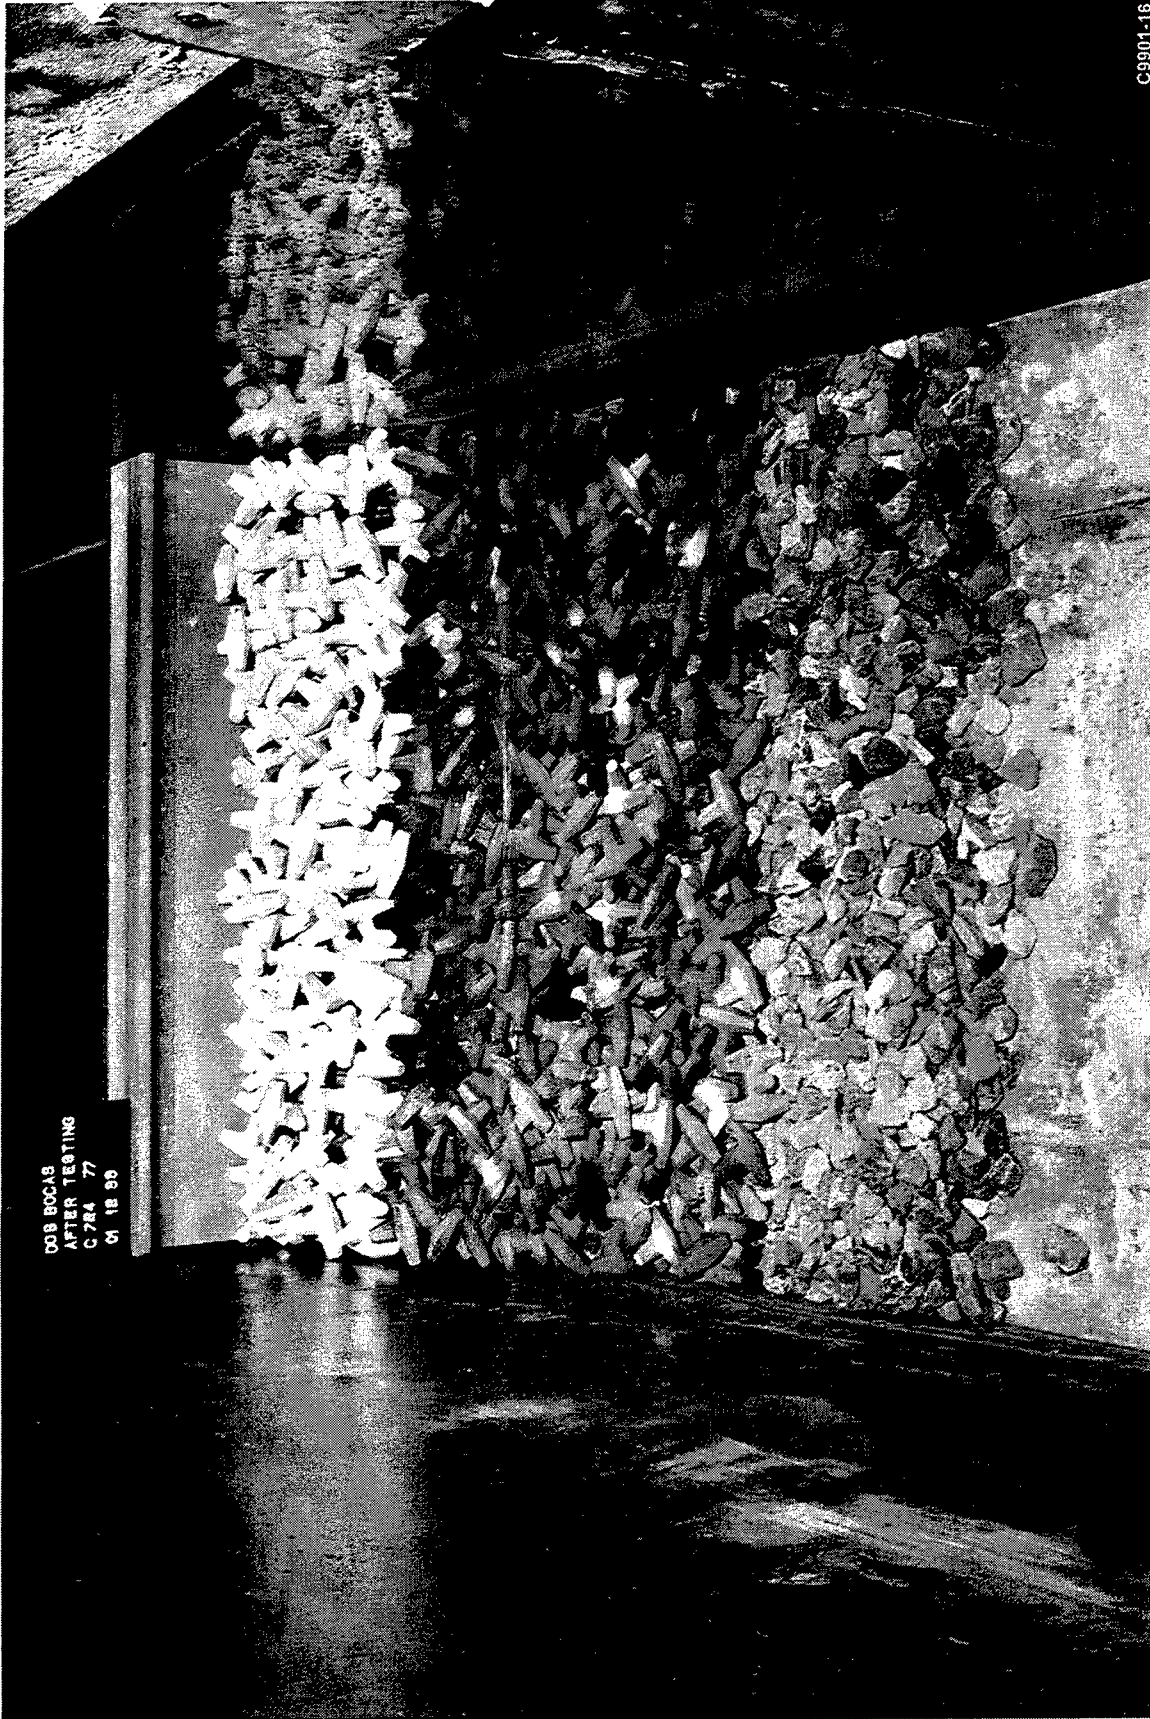

008 80018
AFTER TESTING
C 784 77
01 18 80

C9901-16

Photo 77. Sea-side view of Plan 4 after 7-m wave attack

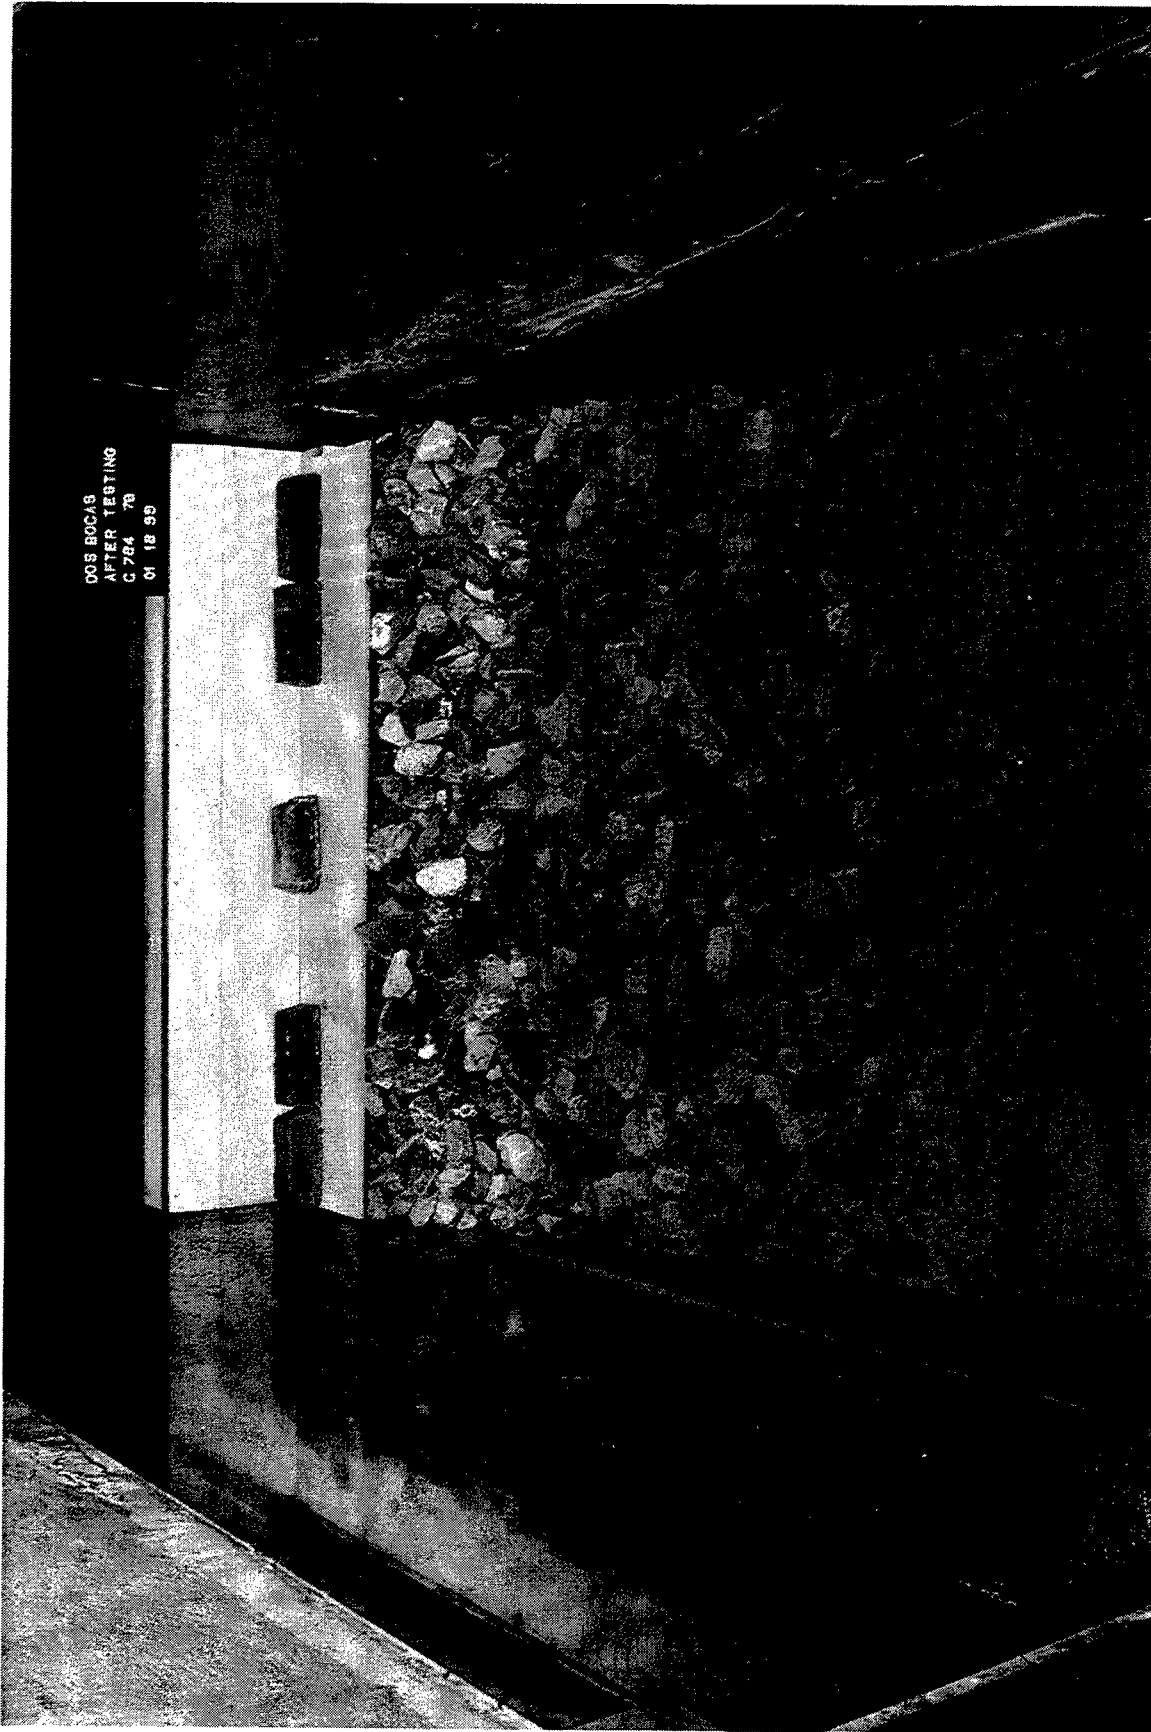

DOS BOCAS
AFTER TESTING
C. 784 '78
01 18 99

Photo 78. Harbor-side view of Plan 4 after 7-m wave attack

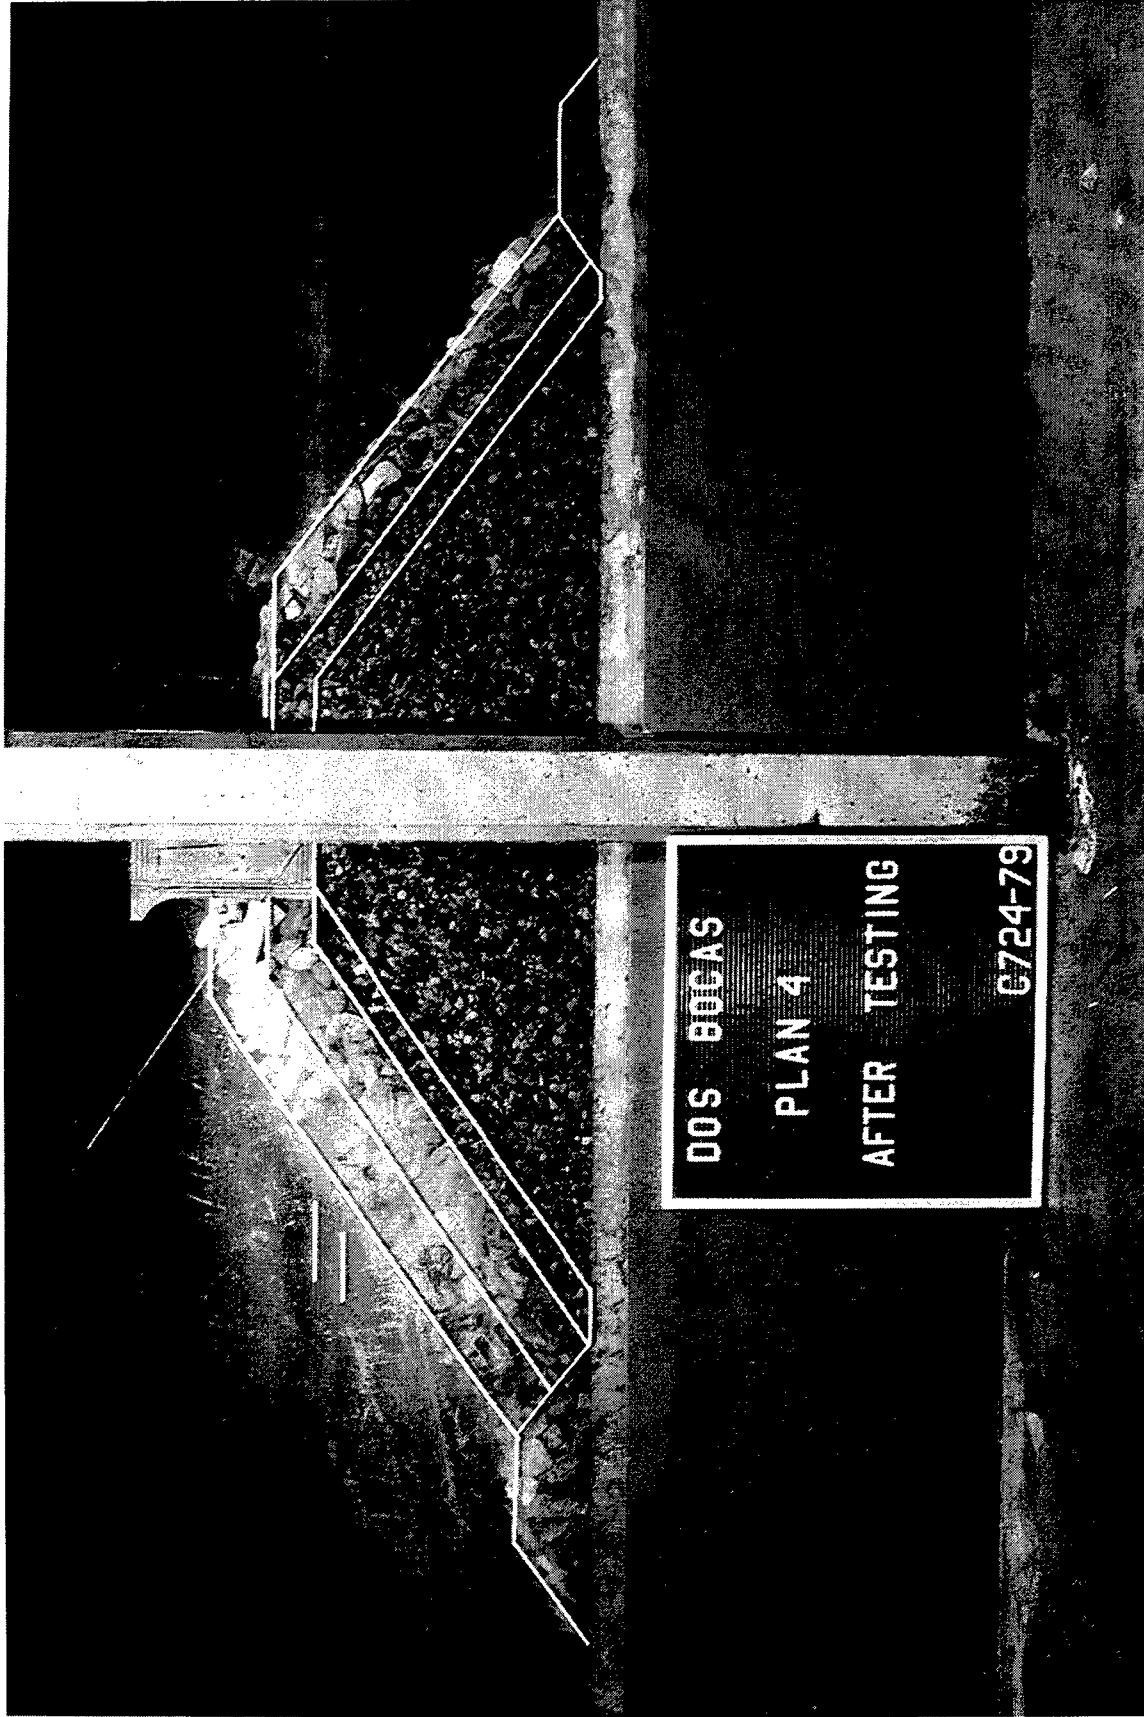


Photo 79. End view of Plan 4 at the conclusion of testing

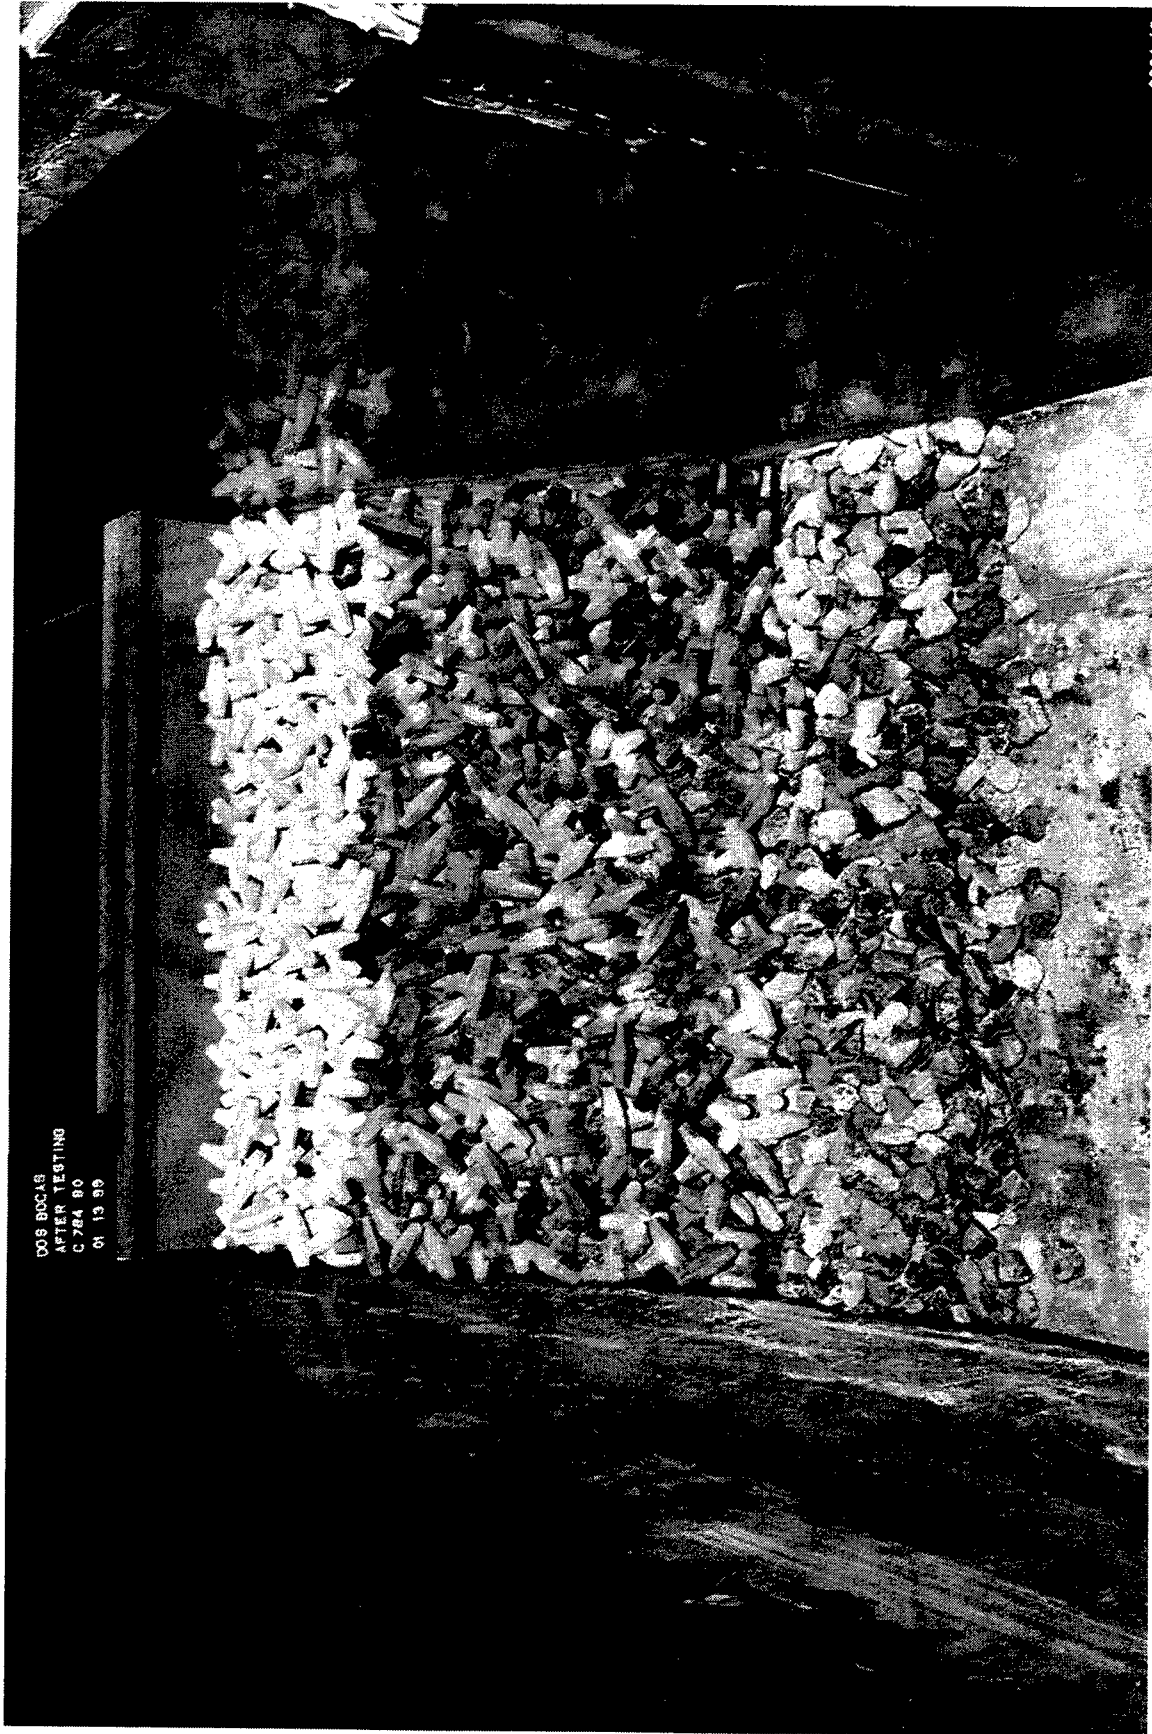


Photo 80. Sea-side view of Plan 4 at the conclusion of testing

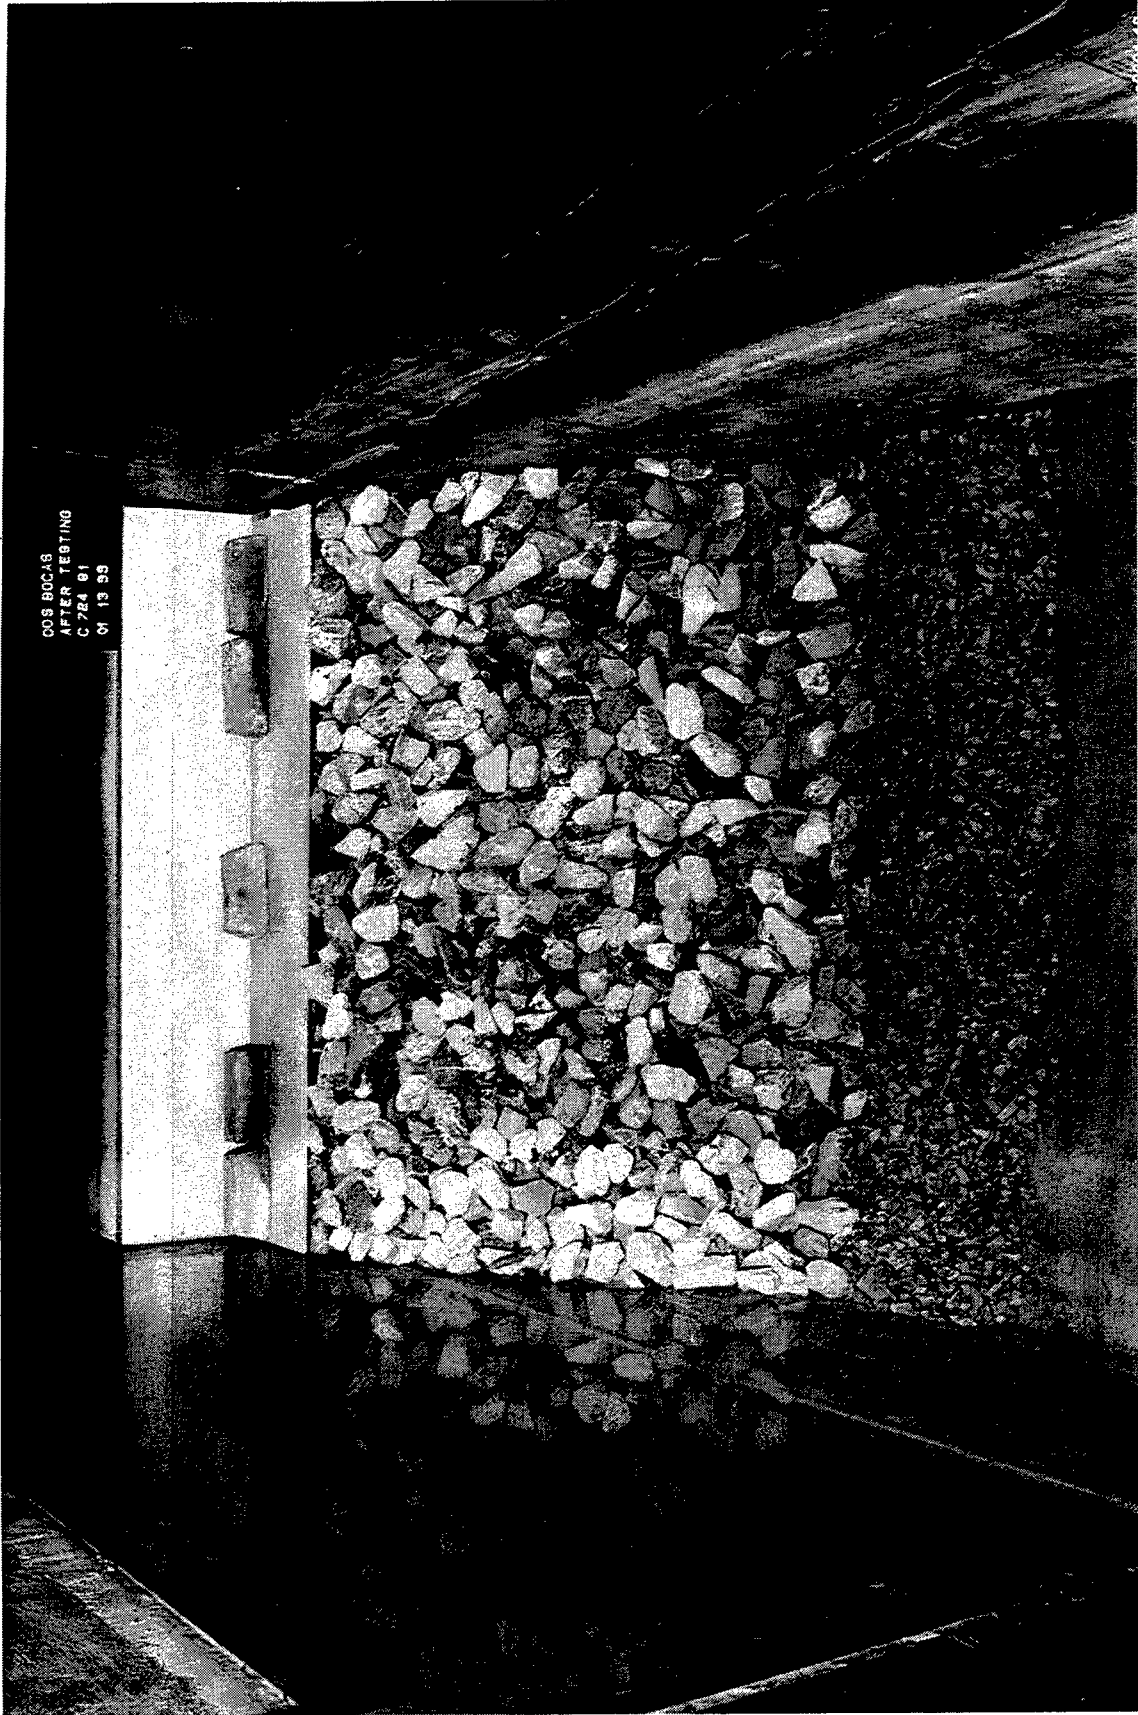


Photo 81. Harbor-side view of Plan 4 at the conclusion of testing


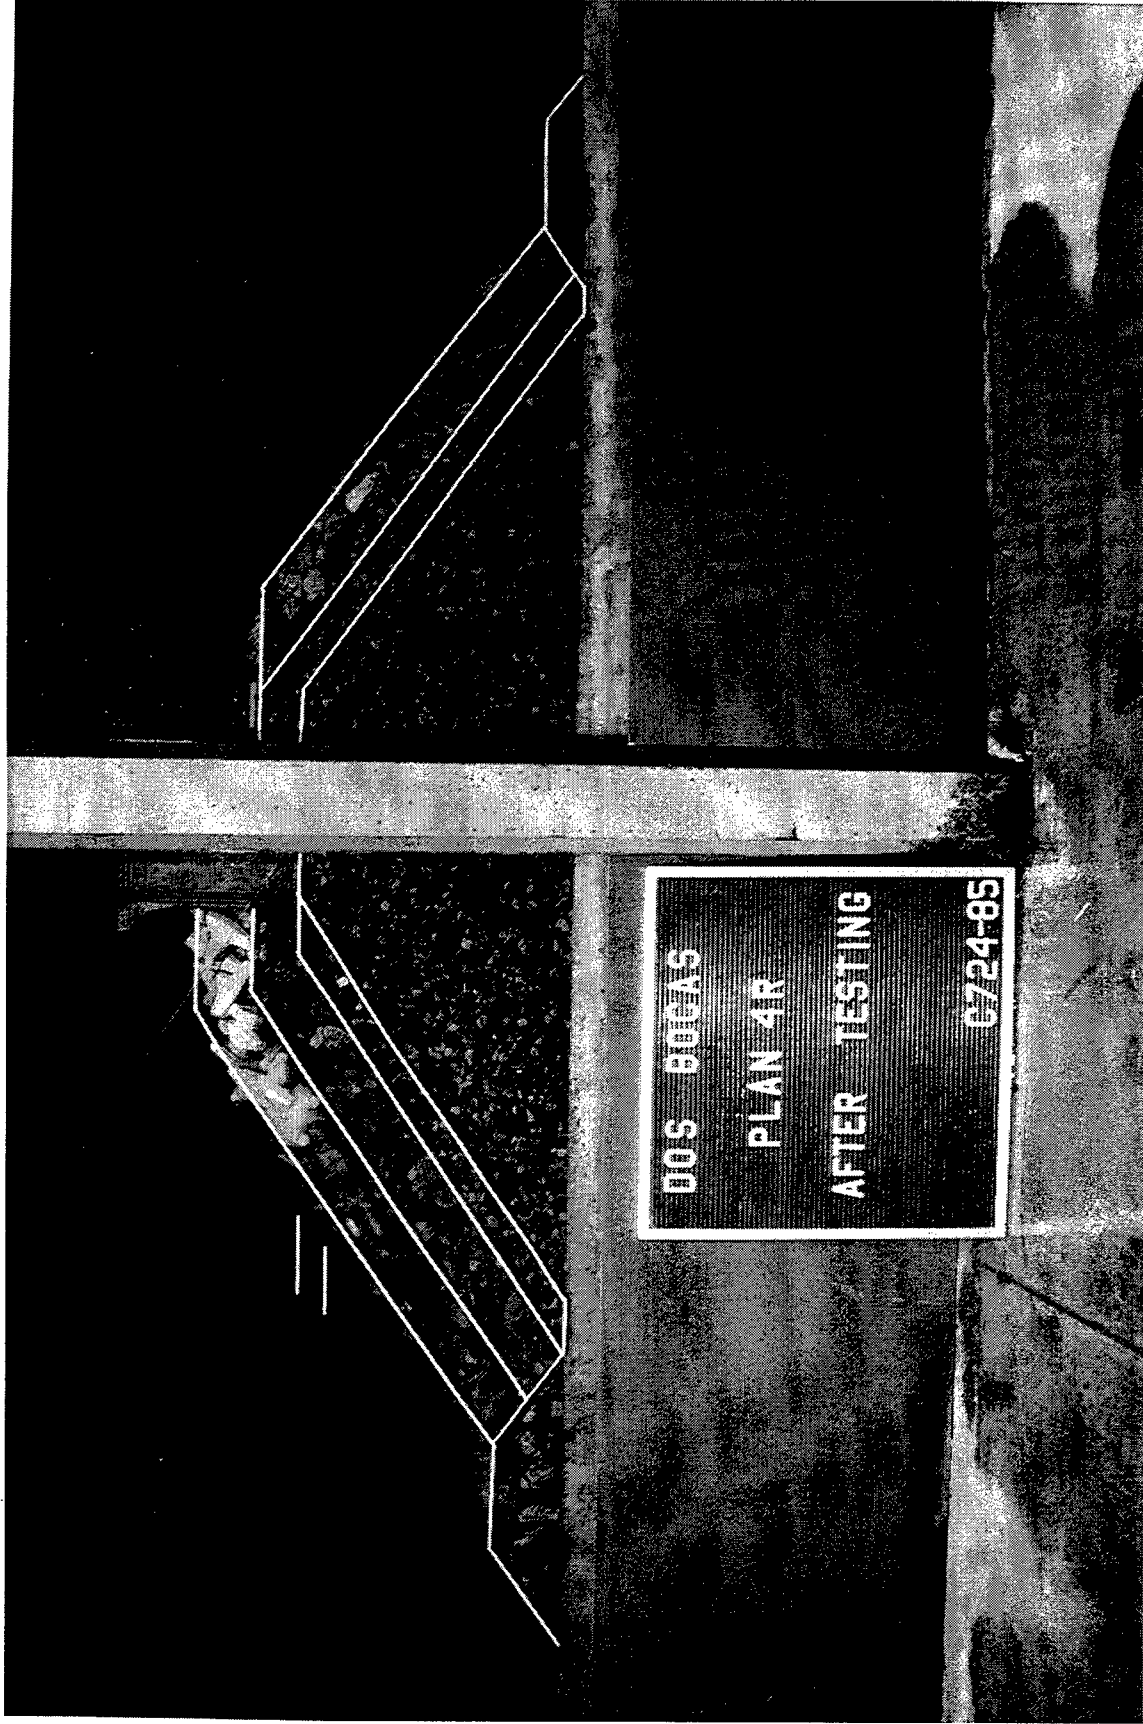


Photo 82. Repeat test of Plan 4. End view at the conclusion of testing

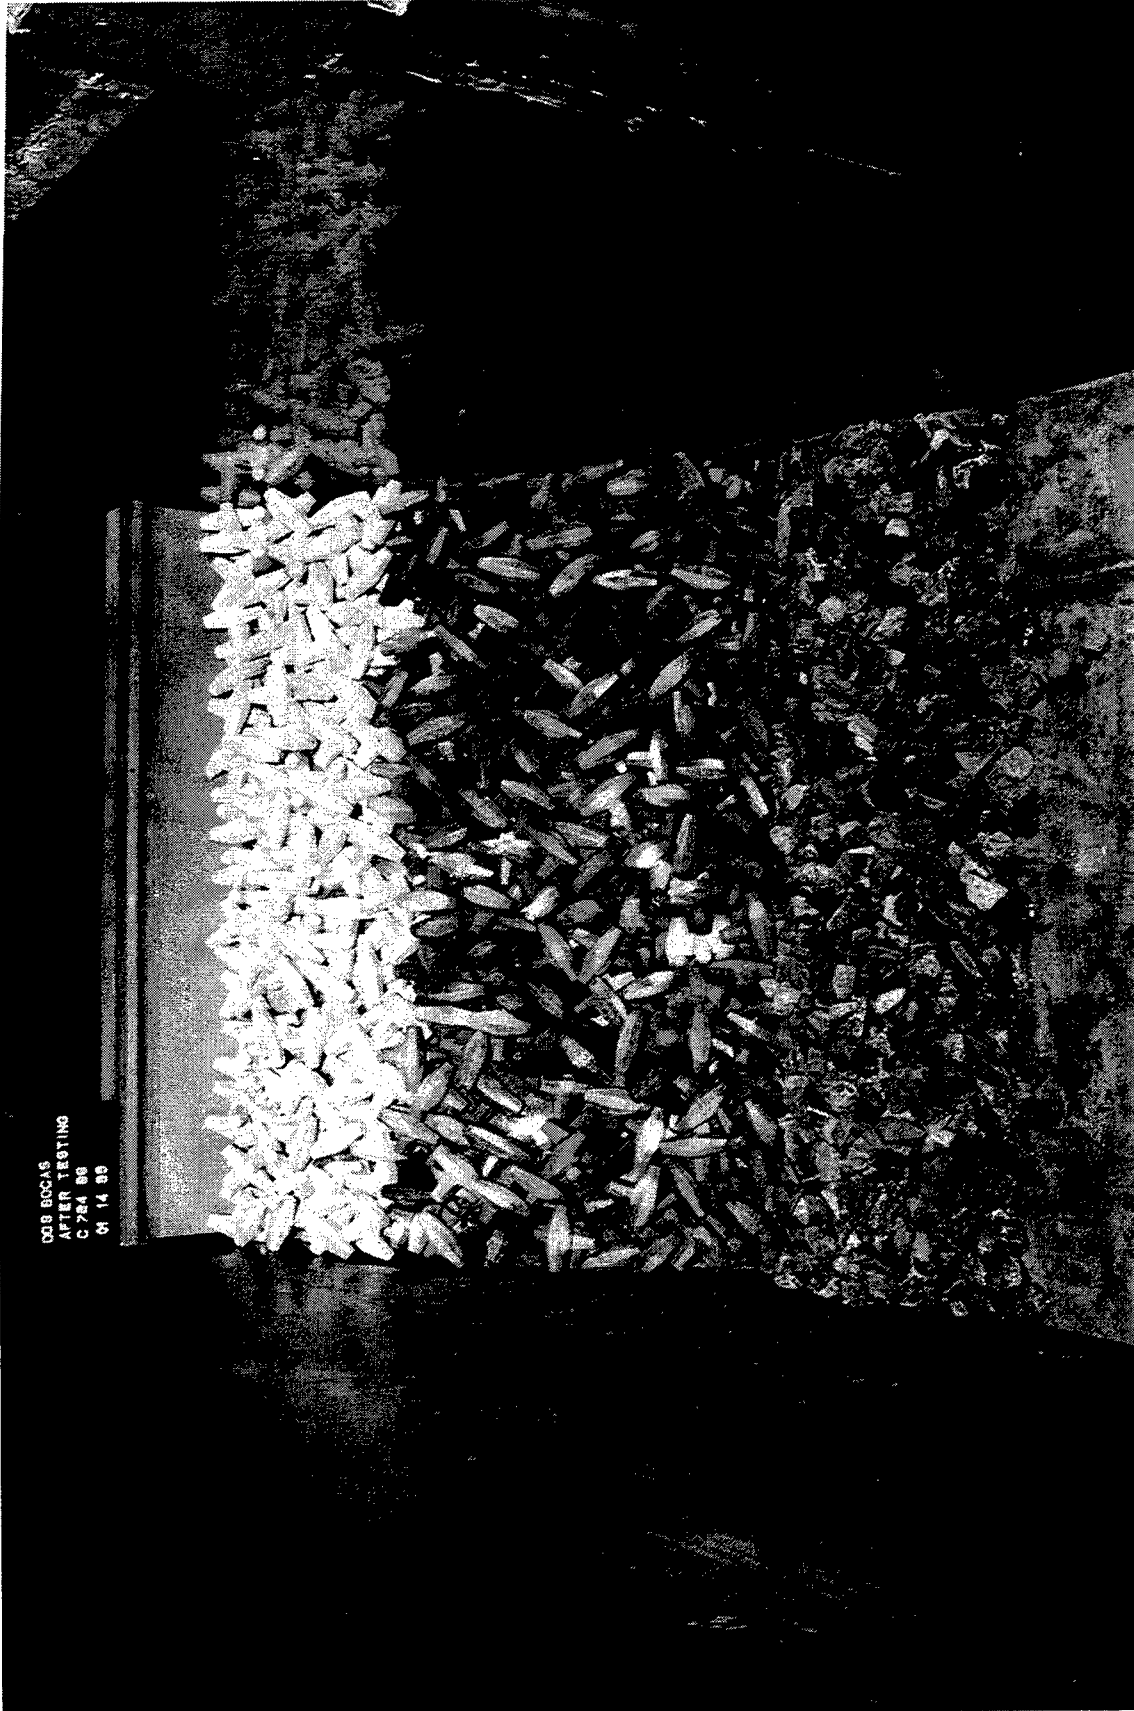

DOB 800AS
AFTER TESTING
C-784 88
01 14 88

Photo 83. Repeat test of Plan 4. Sea-side view at the conclusion of testing



Photo 84. Repeat test of Plan 4. Harbor-side view at the conclusion of testing

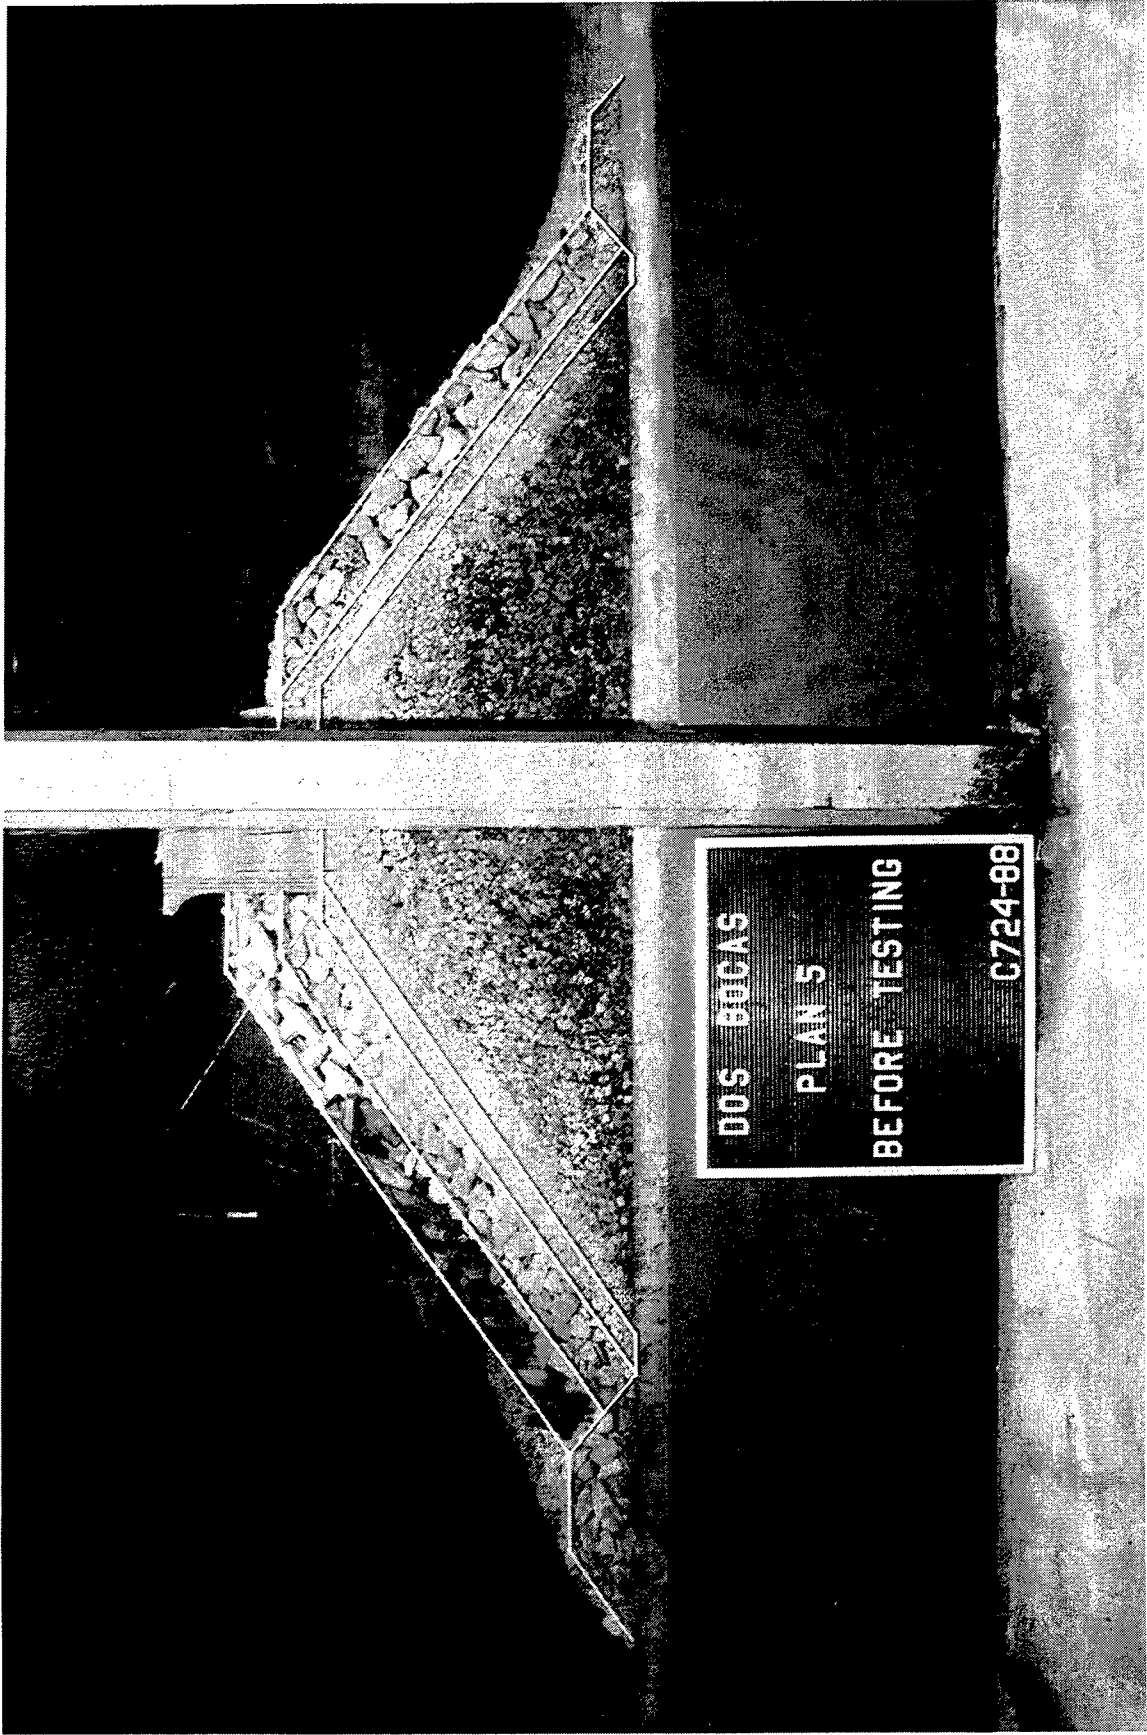


Photo 85. End view of Plan 5 before wave attack



Photo 86. Sea-side view of Plan 5 before wave attack

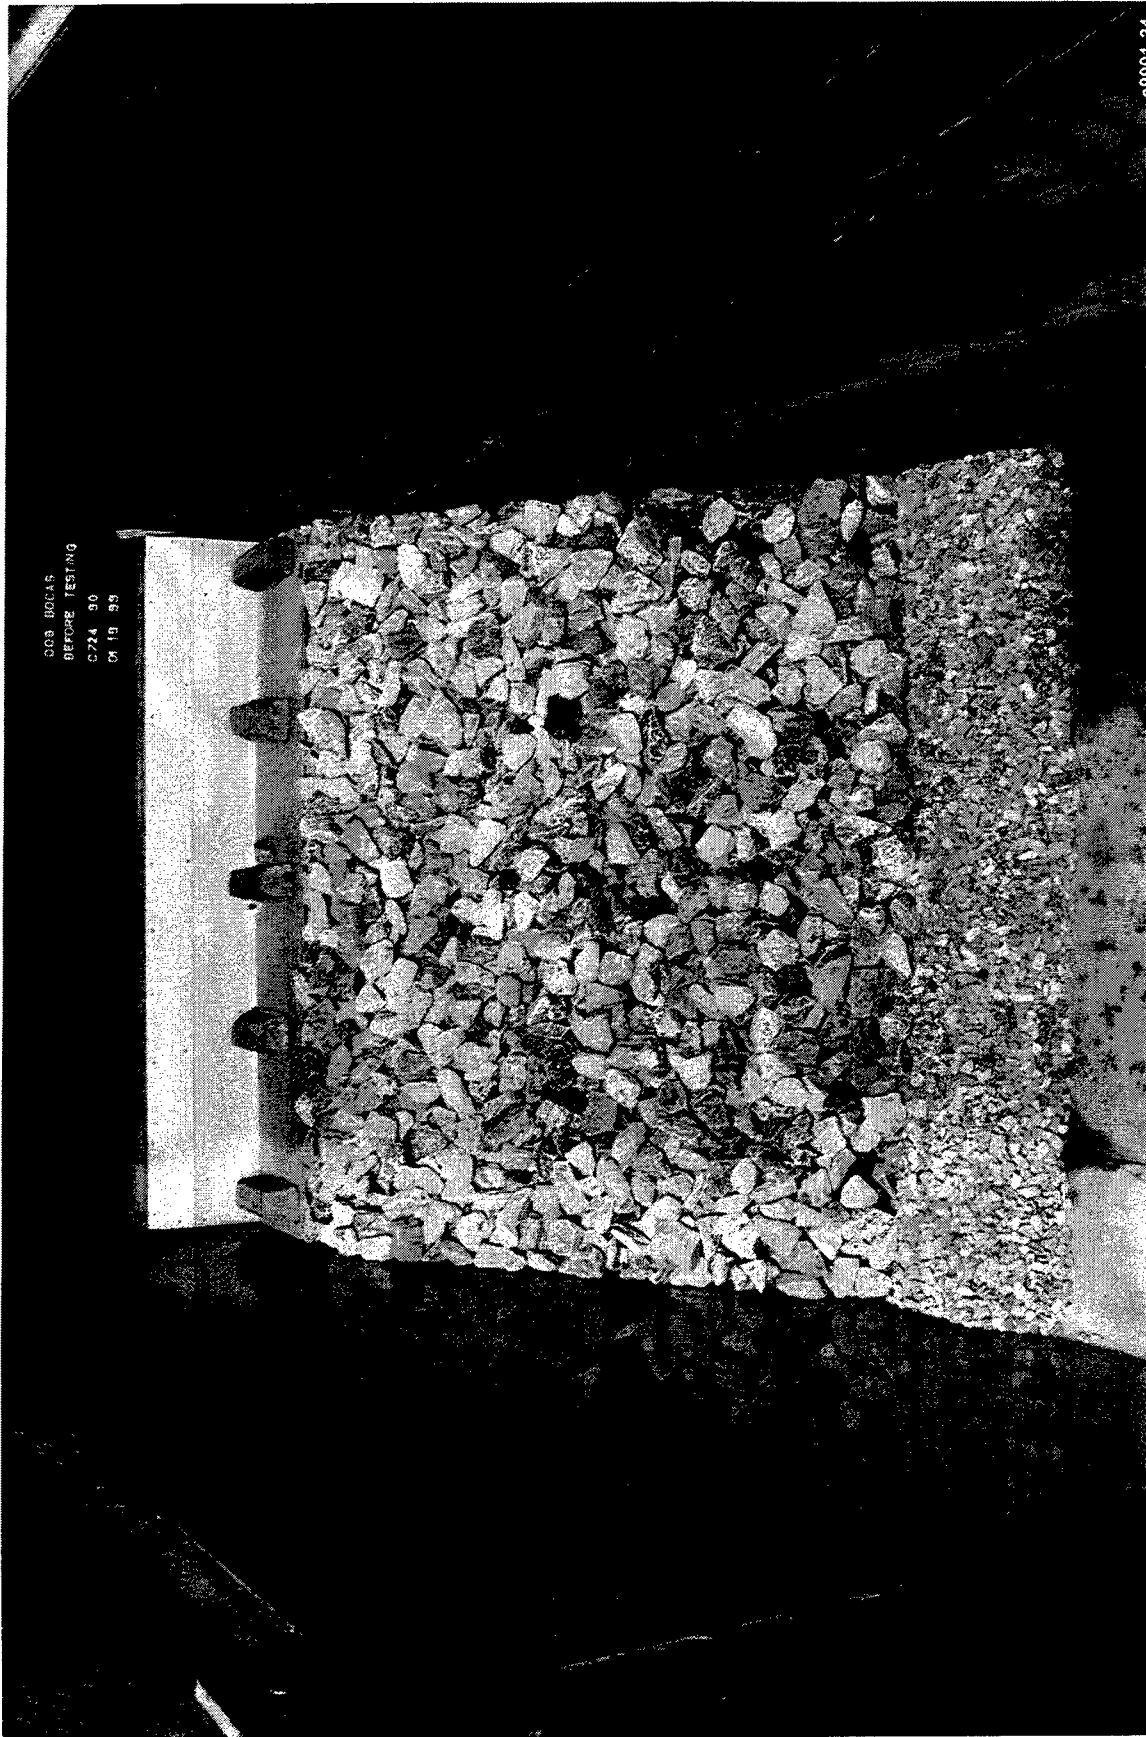


Photo 87. Harbor-side view of Plan 5 before wave attack




Photo 88. End view of Plan 5 after attack of 7-m waves



005 80015
AFTER TESTING
C 724 96
01 81 99

c9901-34

Photo 89. Sea-side view of Plan 5 after attack of 7-m waves

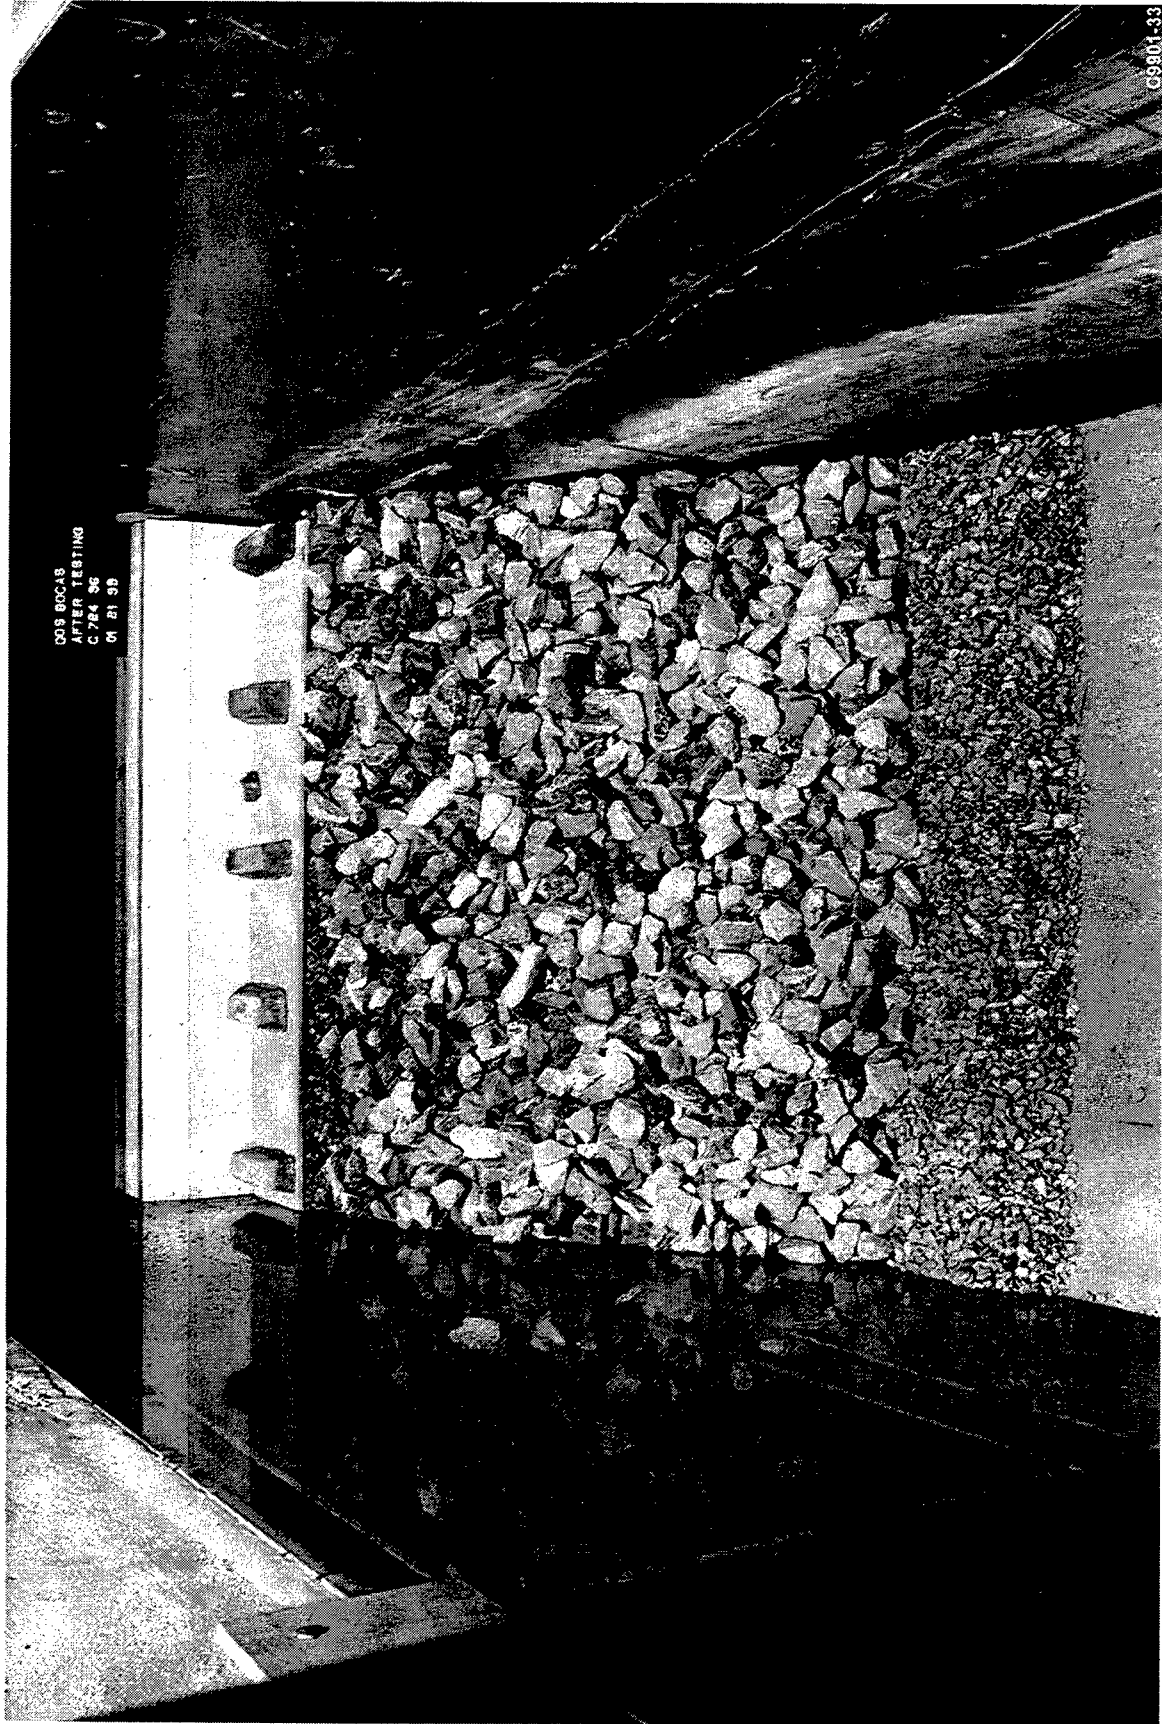

005 BOCIS
AFTER TESTING
C/24 86
01 51 58

09901-33

Photo 90. Harbor-side view of Plan 5 after attack of 7-m waves

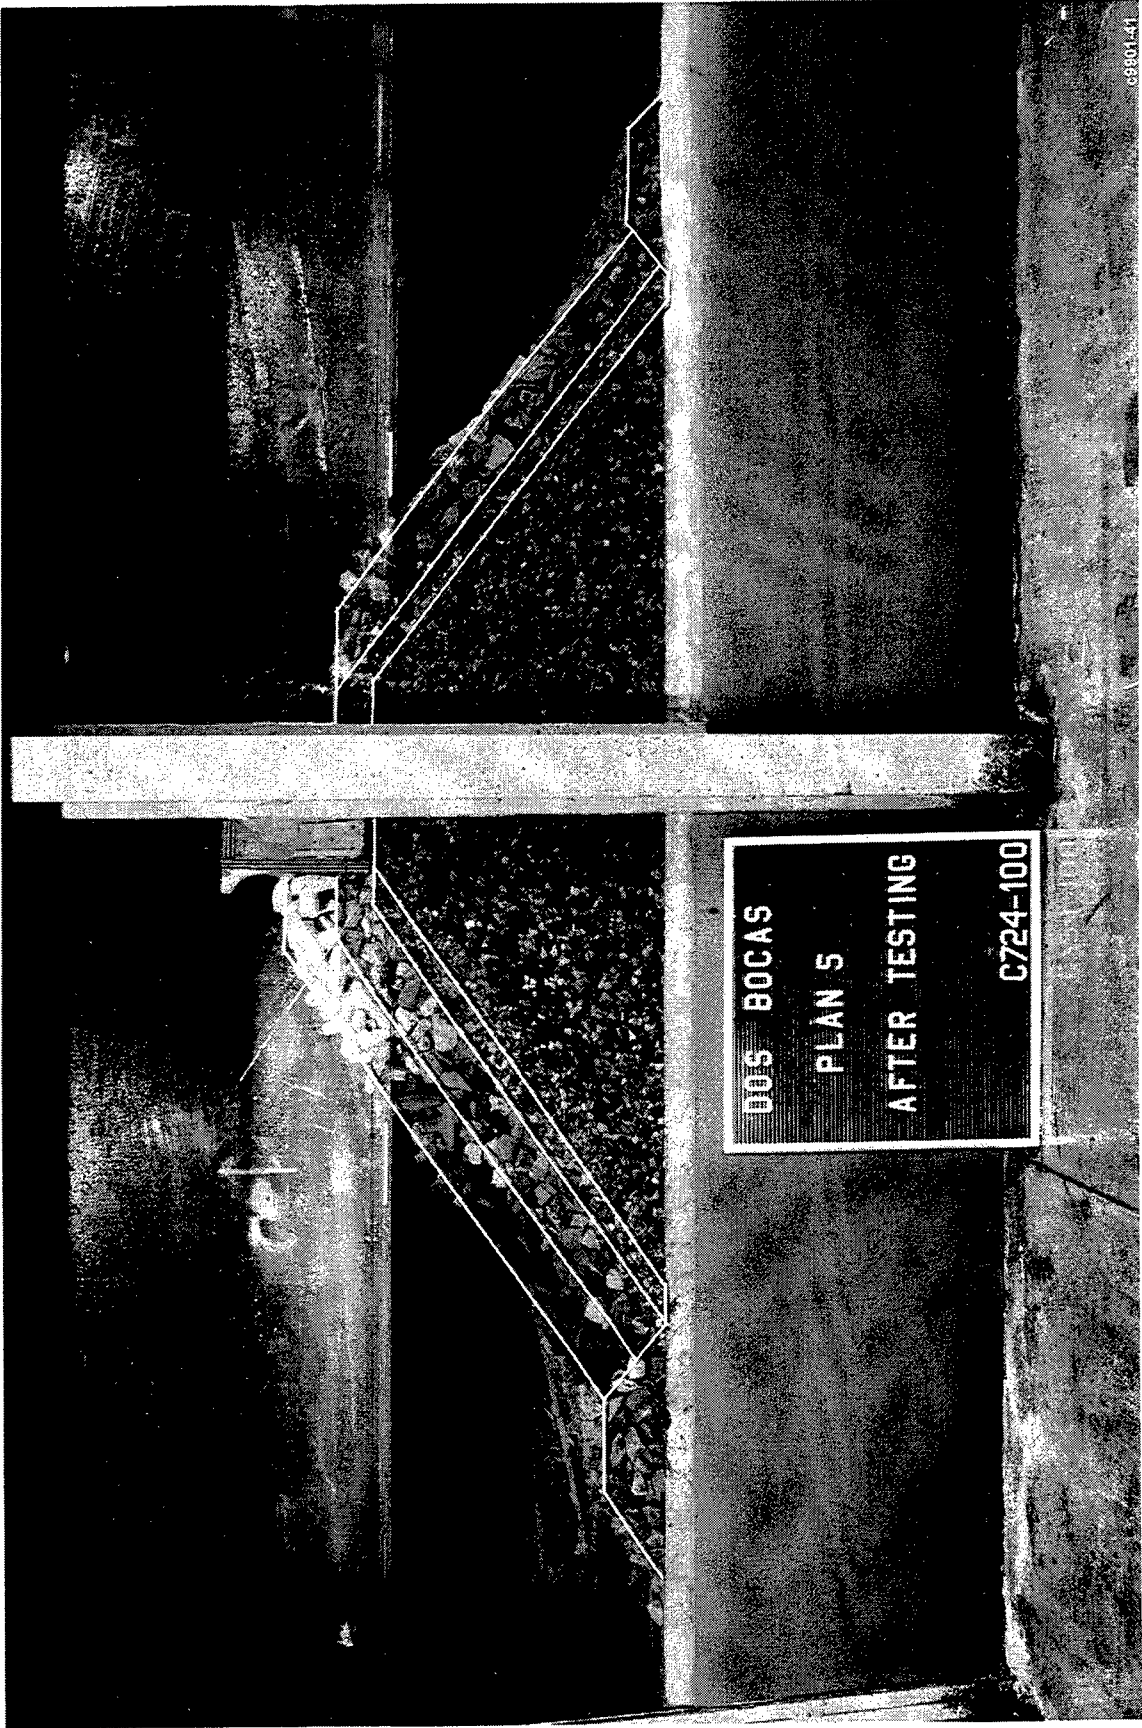


Photo 91. Repeat test of Plan 5. End view after attack of 7-m waves



Photo 92. Repeat test of Plan 5. Sea-side view after attack of 7-m waves

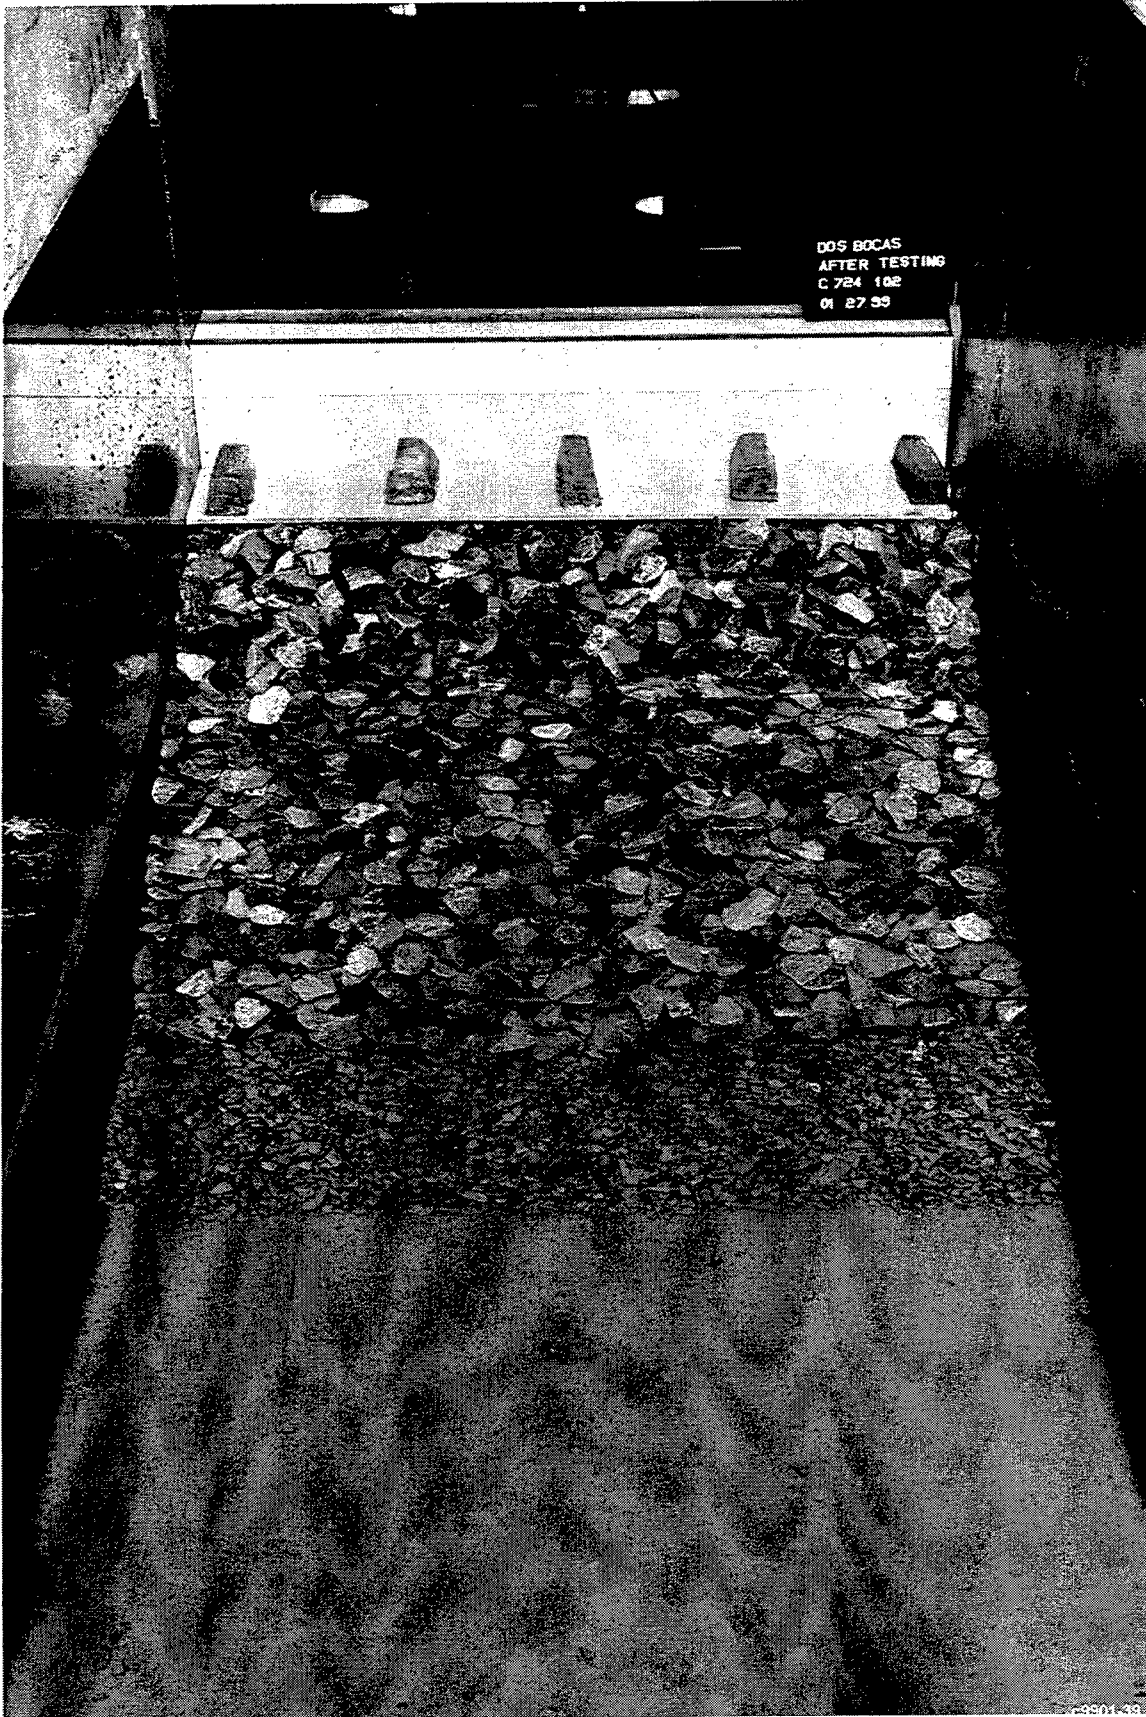


Photo 93. Repeat test of Plan 5. Harbor-side view after attack of 7-m waves

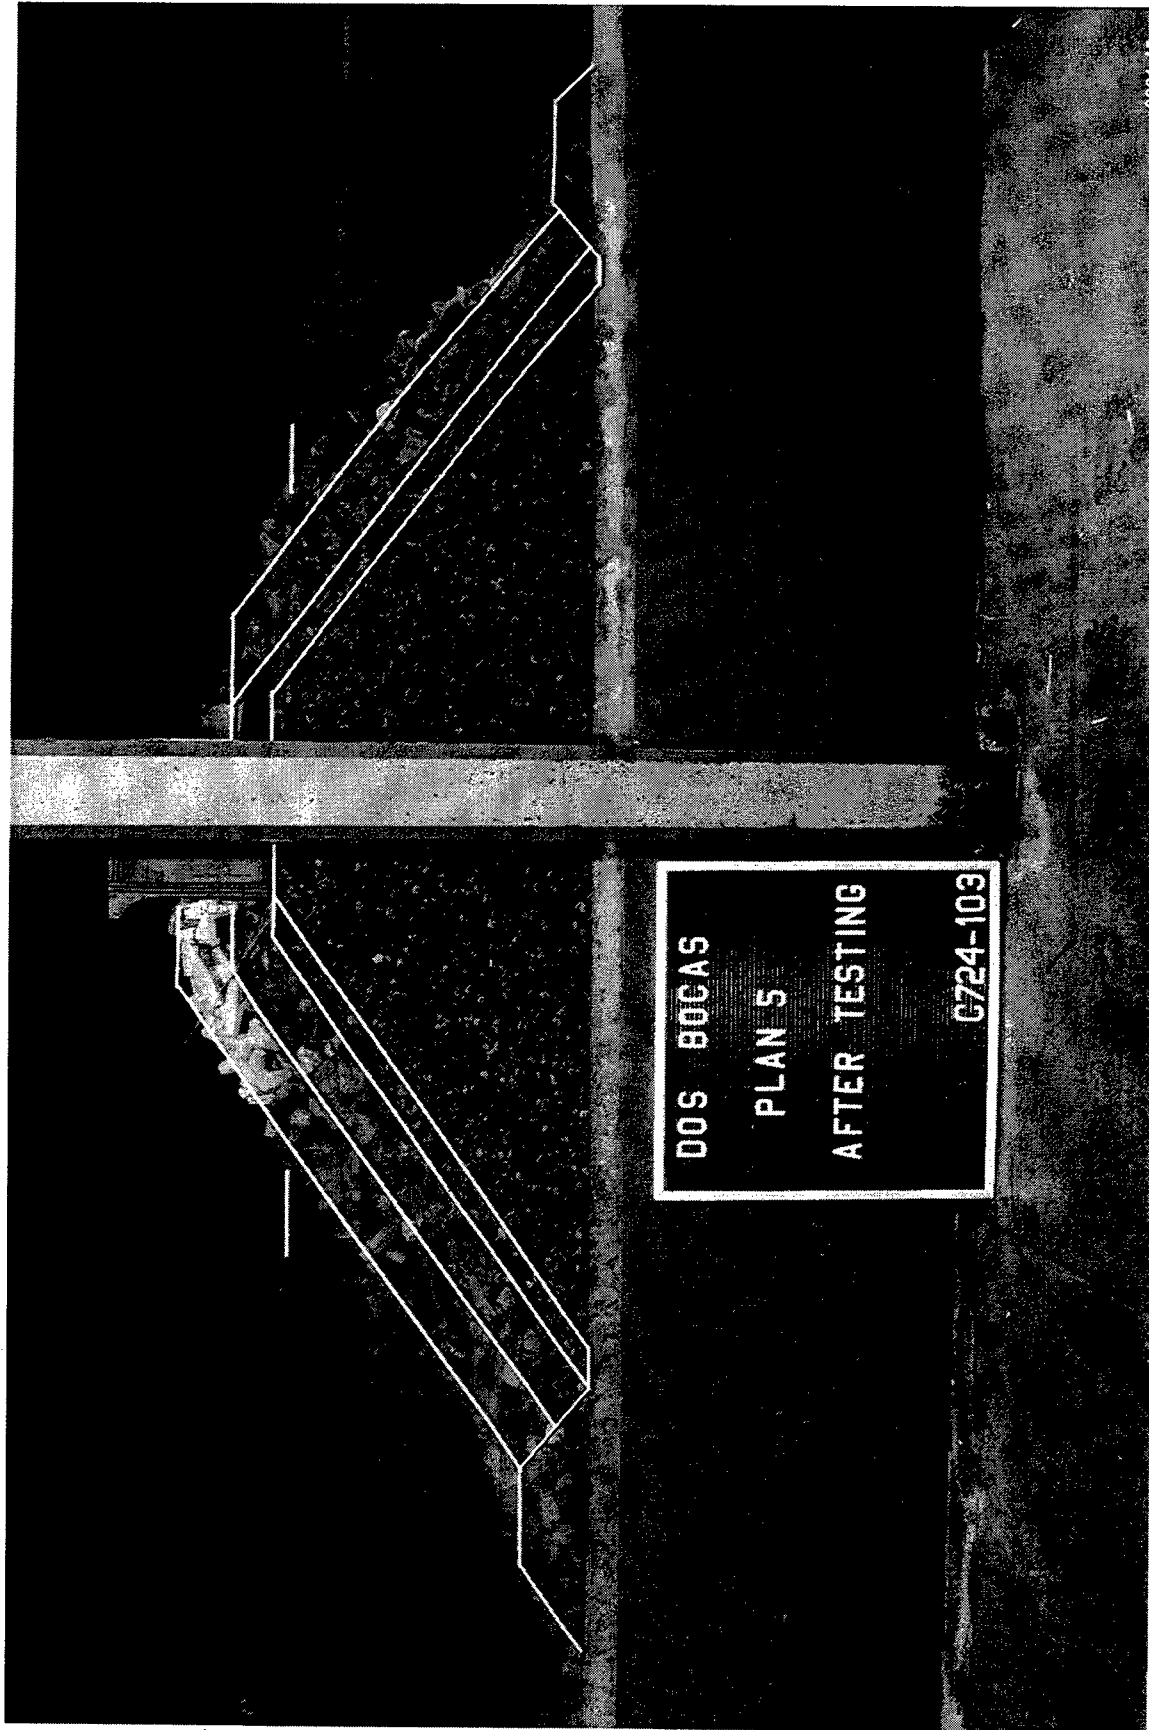


Photo 94. End view of Plan 5 after attack of 8-m waves

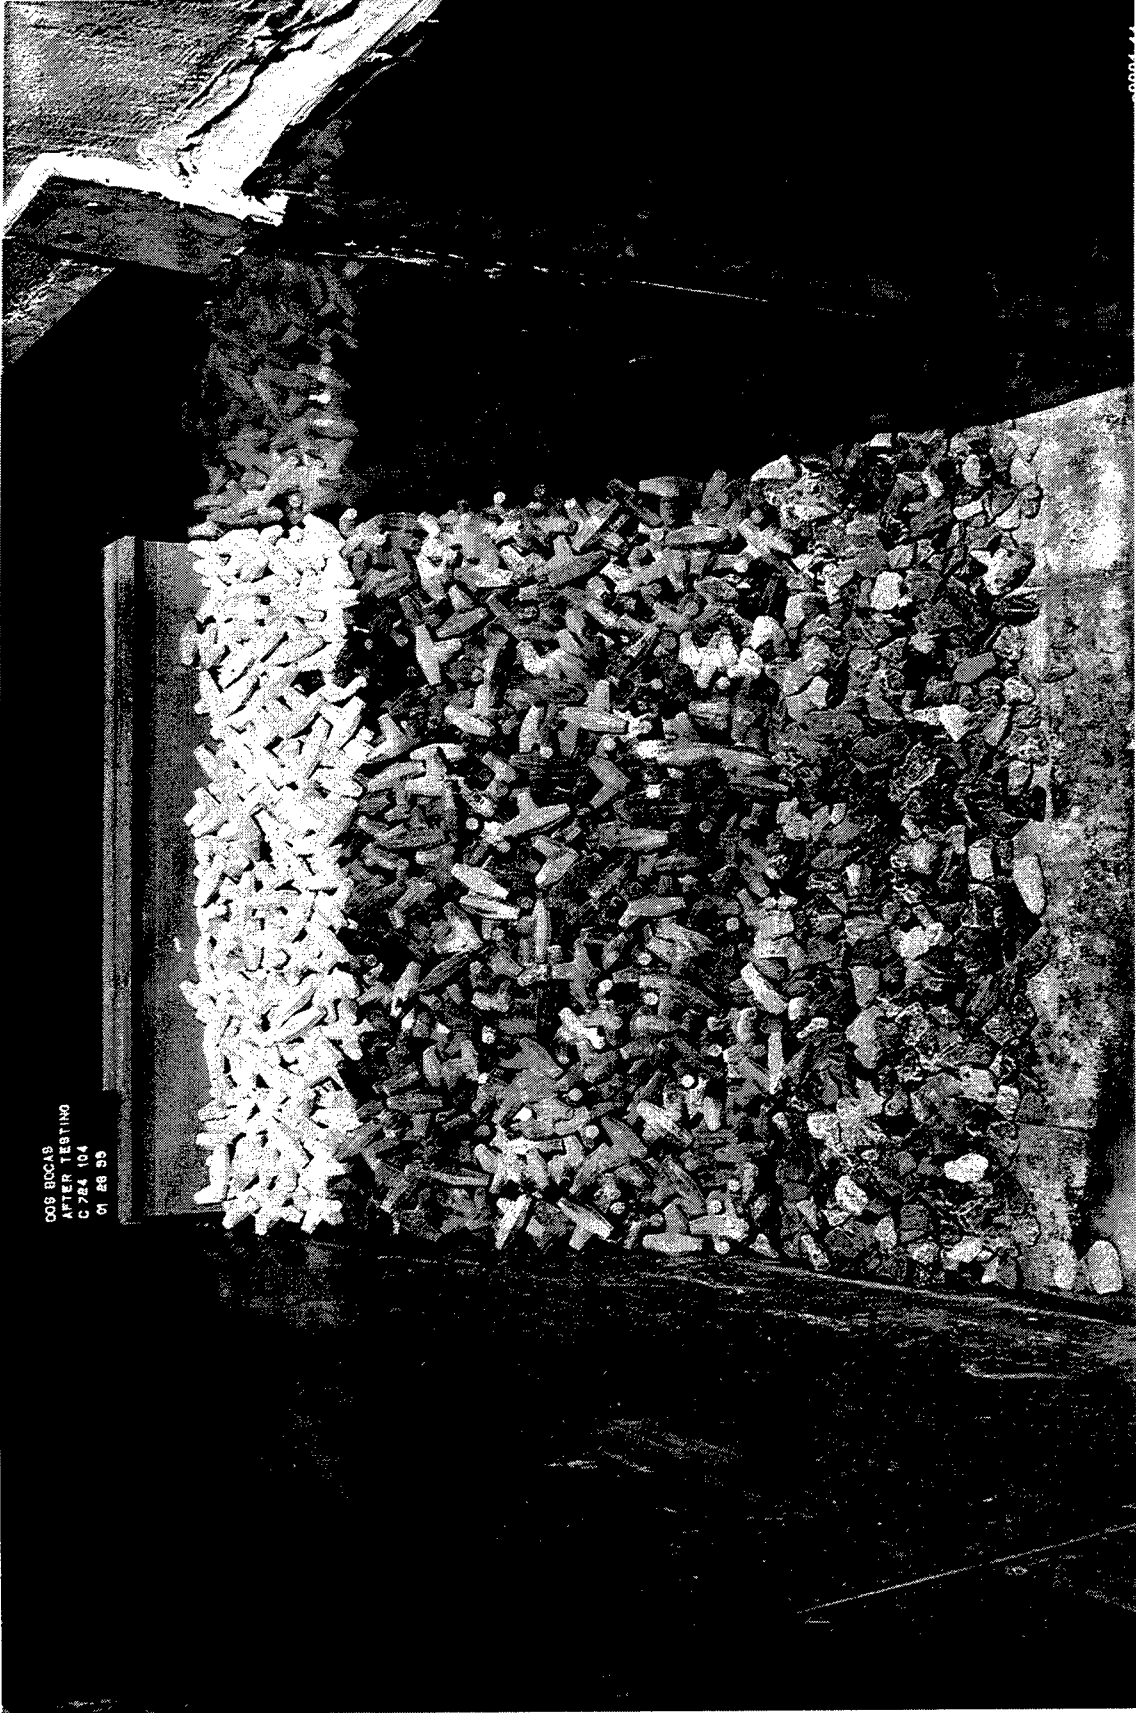


Photo 95. Sea-side view of Plan 5 after attack of 8-m waves

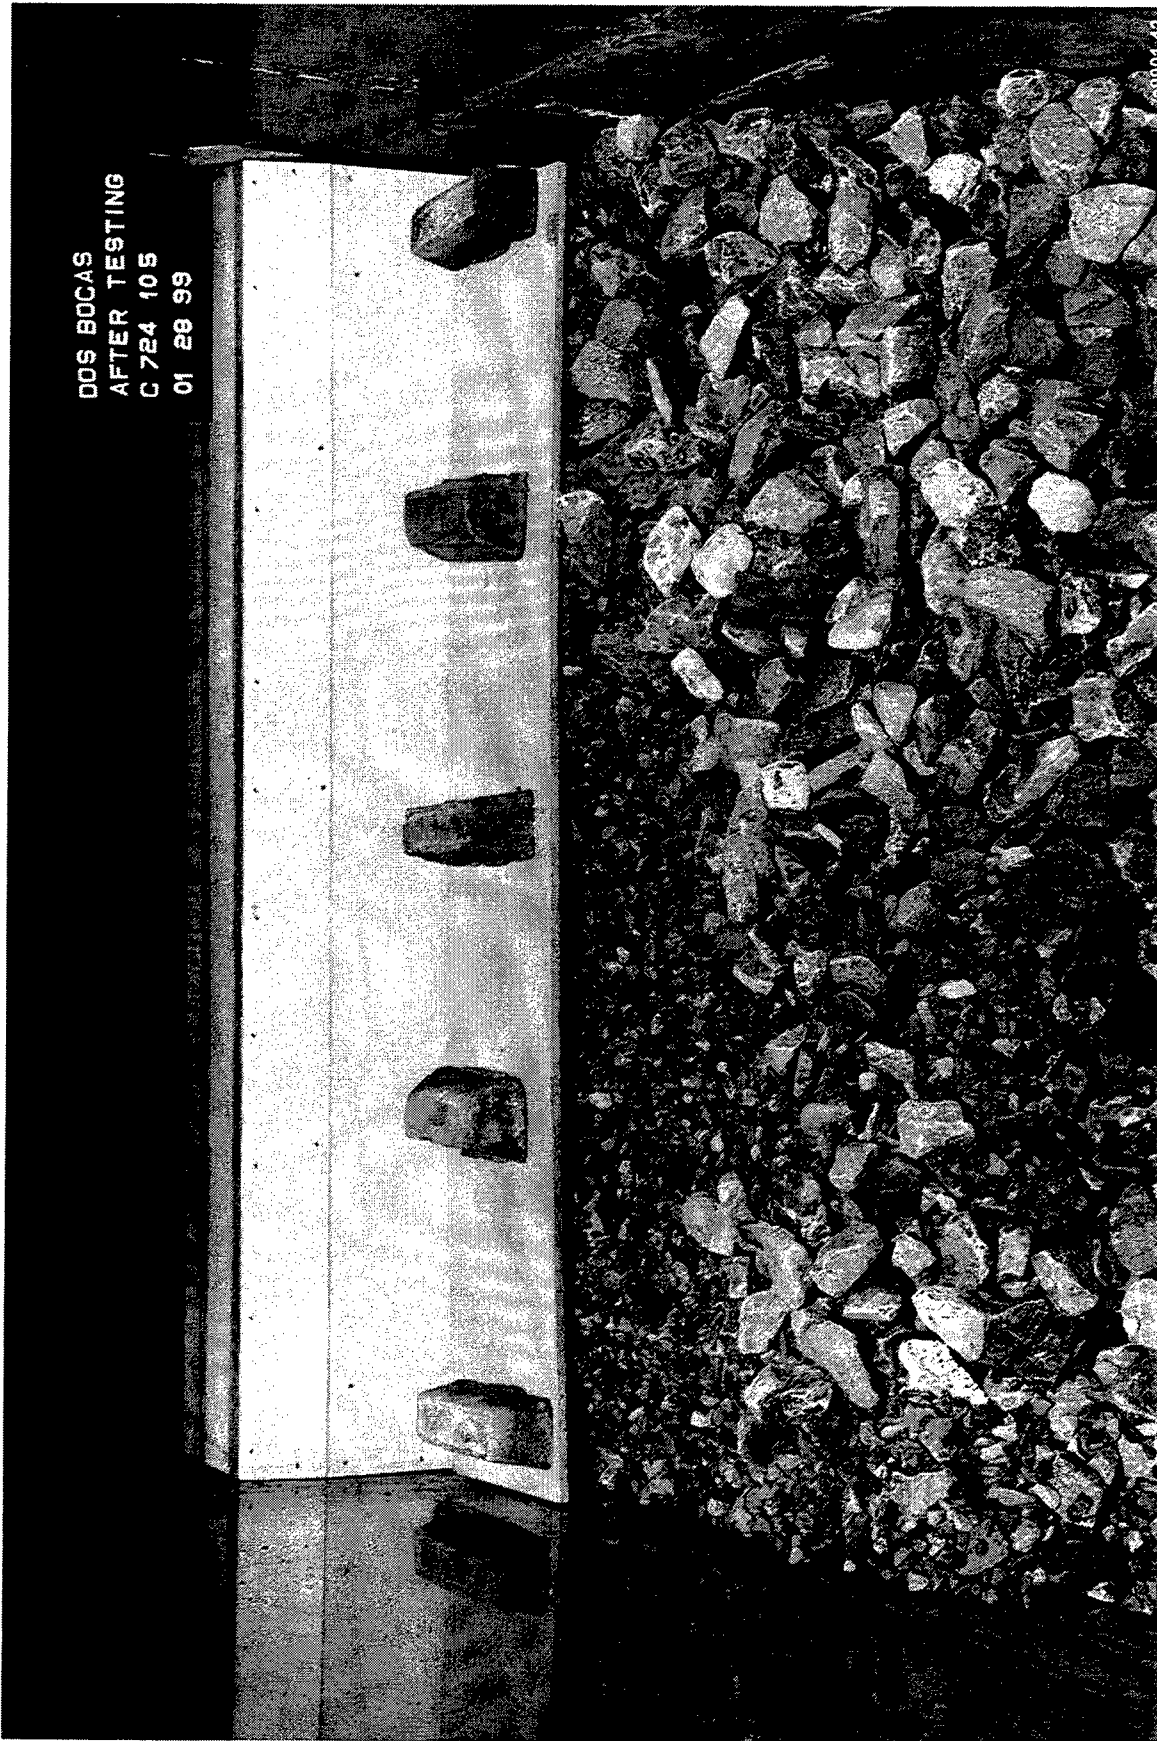


Photo 96. Harbor-side view of Plan 5 after attack of 8-m waves

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

1. AGENCY USE ONLY (Leave blank)	2. REPORT DATE July 1999	3. REPORT TYPE AND DATES COVERED Final report	
4. TITLE AND SUBTITLE Rubble-Mound Breakwater Stability Tests for Dos Bocas Harbor, Tabasco, Mexico		5. FUNDING NUMBERS	
6. AUTHOR(S) Robert D. Carver			
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Engineer Waterways Experiment Station 3909 Halls Ferry Road, Vicksburg, MS 39180-6199		8. PERFORMING ORGANIZATION REPORT NUMBER Technical Report CHL-99-15	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) Preinversion and Desarrollo, S.A. de C.V. Callejon Retama 30, D. F. 04010, Mexico; PEMEX Refinación y Producción Marino Nacional #329, C. P. 11311, Mexico		10. SPONSORING/MONITORING AGENCY REPORT NUMBER	
11. SUPPLEMENTARY NOTES Available from National Technical Information Service, 5285 Port Royal Road, Springfield, VA 22161.			
12a. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.		12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words) <p>The Port of Dos Bocas is located on the Gulf Coast of Mexico within the State of Tabasco, several miles west of the Yucatan Peninsula. This site has been selected for development of an oil, industrial, and commercial port to be developed through the Mexican Oil Company (PEMEX). The initial purposes of the investigation were to determine, by two-dimensional flume tests, the stability response of three alternate armorings for the proposed breakwater and to evaluate overall performance relative to wave overtopping. Finally, based on results of the initial tests and economic considerations, the best armoring alternative would be selected, and a final recommended section would be developed and tested.</p> <p>The first test sections consisting of 13-Mt Core-Locs in a water depth of 11 m and 15-Mt Core-Locs in a water depth of 15 m proved to be stable for significant wave heights up to 7 m. These armor weights are recommended for prototype use. Also, the crownwall elevation of +10.3 m should be adequate for significant wave heights up and including 7 m.</p>			
14. SUBJECT TERMS Breakwater Dos Bocas, Mexico Coastal models Stability modeling Core-Loc Wave overtopping		15. NUMBER OF PAGES 121	
		16. PRICE CODE	
17. SECURITY CLASSIFICATION OF REPORT UNCLASSIFIED	18. SECURITY CLASSIFICATION OF THIS PAGE UNCLASSIFIED	19. SECURITY CLASSIFICATION OF ABSTRACT	20. LIMITATION OF ABSTRACT