UNCLASSIFIED

AD NUMBER

AD479694

LIMITATION CHANGES

TO:

Approved for public release; distribution is unlimited.

FROM:

**Distribution authorized to U.S. Gov't. agencies and their contractors;
Administrative/Operational Use; 1962. Other requests shall be referred to Naval Post Graduate School, Monterey, CA.**

AUTHORITY

NPS ltr 21 Jan 1972

THIS PAGE IS UNCLASSIFIED

AD No. 479694
DDC FILE COPY

(9) Master's thesis (Appendix), P/C

U. S. Naval Postgraduate School

Monterey, California

THESIS (APPENDIX)

(6) A THEORETICAL PERFORMANCE INVESTIGATION OF AN AFTERBURNING TURBOFAN ENGINE. APPENDIX.

by

(10) James F. Bell

(11) 1962,

(12) 176p.

Main Text Separate
AD479693

This document is subject to special export controls and each transmittal to foreign government or foreign nationals may be made only with prior approval of the U.S. Naval Postgraduate School (Code 035).

Best
Available
Copy

APPENDIX

TABLE OF CONTENTS

APPENDIX A

TABLE OF SYMBOLS

ENGINE FIGURE WITH NUMBER DESIGNATIONS USED IN PROGRAM FOR VARIABLE NOMENCLATURE

APPENDIX B

COMPUTER PROGRAM AS CODED IN CDC 1604 FORTRAN LANGUAGE

APPENDIX C

STRAIGHT JET ENGINE, COMPRESSOR PRESSURE RATIO SEA LEVEL VALUES OF 6, 11, AND 16. ALTITUDE VARIATION FRO
SEA LEVEL TO 80,000 FEET

APPENDIX D

(D-1) BP-PASS TURBO-FAN, COMPRESSOR PRESSURE RATIO SEA LEVEL EQUAL TO 6.0, ALTITUDE VARIATION FROM SEA
LEVEL TO 80,000 FEET

(D-2) BY-PASS TURBO-FAN, COMPRESSOR PRESSURE RATIO SEA LEVEL EQUAL TO 11.0, ALTITUDE VARIATION FROM SEA
LEVEL TO 80,000 FEET

(D-3) BY-PASS TURBO-FAN,COMPRESSOR PRESSURE RATIO SEA LEVEL EQUAL TO 16.0, ALTITUDE VARIATION FROM SEA
LEVEL TO 80,000 FEET

APPENDIX E

CONVERGENT AND CONVERGENT-DIVERGENT NOZZLE COMPARISON FOR FRICTIONLESS FLOW AND FLOW WITH FRICTION
WITH VARYING RANGES OF POLYTROPIC EFFICIENCIES

ACCESSION for
CFSTI WHITE SECTION
DDC BUFF SECTION
UNANNOUNCED
JUSTIFICATION
BY
DISTRIBUTION/AVAILABILITY CODES
DIST. AVAIL. and/or SPECIAL
2

DDC
RECEIVED
APR 5 1966
TISIA E

TABLE OF SYMBOLS

AB -- SUBROUTINE DESIGNATION FOR AFTERBURNER SECTION CALCULATIONS
AMAB -- PRESSURE LOSS COEFFICIENT IN THE AFTERBURNER
AMABFAN -- PRESSURE LOSS COEFFICIENT IN THE FAN AFTERBURNER
AMMB -- PRESSURE LOSS COEFFICIENT IN THE MAIN BURNER
B -- BLEED AIR EXPRESSED AS RATIO OF TOTAL AIR MASS FLOW THROUGH MAIN ENGINE
BPR -- BY-PASS RATIO, MASS OF AIR BYPASSED TO MASS FLOW THROUGH MAIN ENGINE
COMP -- SUBROUTINE DESIGNATION FOR COMPRESSOR SECTION CALCULATIONS
CPCO -- AVERAGE SPECIFIC HEAT VALUE IN THE COMPRESSOR (BTU/LB-DEG FAREN)
CPF -- AVERAGE SPECIFIC HEAT VALUE IN THE FAN (BTU/LB-DEG FAREN)
CPFT -- AVERAGE SPECIFIC HEAT VALUE IN THE FAN TURBINE (BTU/LB-DEG FAREN)
CPMT -- AVERAGE SPECIFIC HEAT VALUE IN THE MAIN TURBINE (BTU/LB-DEG FAREN)
CP3 -- SPECIFIC HEAT VALUE AT STATION 3. SPECIFIC HEAT VALUES AT OTHER STATIONS ARE SIMILARLY SUBSCRIPTED
DELTC -- TEMPERATURE DIFFERENCE ACROSS THE COMPRESSOR (DEG RANKINE)
DELTFAN -- TEMPERATURE DIFFERENCE ACROSS THE FAN (DEG RANKINE)
DELTFT -- TEMPERATURE DIFFERENCE ACROSS THE FAN TURBINE (BTU/LB-DEG FAREN)
DELTMT -- TEMPERATURE DIFFERENCE ACROSS THE MAIN TURBINE (BTU/LB-DEG FAREN)
DIFU -- SUBROUTINE DESIGNATION FOR DIFFUSER SECTION CALCULATIONS
ENFN -- POLYTROPIC PROCESS EXPONENT FOR EXPANSION IN THE FAN NOZZLE
ENNM -- POLYTROPIC PROCESS EXPONENT FOR EXPANSION IN THE MAIN NOZZLE
FAAB -- FUEL/AIR RATIO IN THE MAIN ENGINE AFTERBURNER (LB FUEL/LB AIR)
FAFAB -- FUEL AIR RATIO IN THE FAN AFTERBURNER (LB FUEL/LB AIR)
FAMB -- FUEL AIR RATIO IN THE MAIN ENGINE COMBUSTION CHAMBER (LB FUEL/LB AIR)
FAN -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE FAN
FT -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE FAN TURBINE
FMN -- FLIGHT MACH NUMBER
FPRSL -- PRESSURE RATIO AT SEA LEVEL ACROSS THE FAN
GAMA -- SPECIFIC HEAT RATIO FOR AMBIENT AIR
GAMC -- AVERAGE SPECIFIC HEAT RATIO IN THE COMPRESSOR

GAMD -- AVERAGE SPECIFIC HEAT RATIO IN THE DIFFUSER

GAMFAN -- AVERAGE SPECIFIC HEAT RATIO IN THE FAN

GAMFN -- AVERAGE SPECIFIC HEAT RATIO IN THE FAN NOZZLE

GAMFT -- AVERAGE SPECIFIC HEAT RATIO IN THE FAN TURBINE

GAMMT -- AVERAGE SPECIFIC HEAT RATIO IN THE MAIN TURBINE

GAMNM -- AVERAGE SPECIFIC HEAT RATIO IN THE MAIN NOZZLE

H -- ALTITUDE (FEET)

MB -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE MAIN BURNER

MT -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE MAIN TURBINE

NFAN -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE FAN NOZZLE

MN -- SUBROUTINE DESIGNATION FOR CALCULATIONS IN THE MAIN NOZZLE

PA1 -- AMBIENT PRESSURE(LBS/SQ FT ABS)

PR10 -- RATIO OF PRESSURE AT STATION 1 TO THAT AT STATION 2. PRESSURE RATIOS AT DIFFERENT STATIONS ARE SIMILARLY SUBSCRIPTED

PRSL -- COMPRESSOR PRESSURE RATIO AT SEA LEVEL

SF1 -- SPECIFIC FUEL CONSUMPTION IN MAIN ENGINE (LB FUEL/LB AIR/HR)

SF2 -- SPECIFIC FUEL CONSUMPTION IN BY-PASS SECTION (LB FUEL/LB AIR/HR)

SFC -- SPECIFIC FUEL CONSUMPTION OF ENTIRE ENGINE (LB FUEL/LB AIR/HR)

TA1 -- AMBIENT TEMPERATURE (DEG RANKINE)

T1 -- TEMPERATURE AT STATION 1 (DEG RANKINE). TEMPERATURES AT DIFFERENT STATIONS ARE SIMILARLY SUBSCRIPTED

THS -- NON-DIMENSIONALIZED THRUST IN THE MAIN ENGINE


THFS -- NON-DIMENSIONALIZED THRUST IN THE FAN BY-PASS

TS1 -- SPECIFIC THRUST IN THE MAIN ENGINE (LB THRUST/LB AIR/SEC)

TS2 -- SPECIFIC THRUST IN THE FAN BY-PASS (LB THRUST/LB AIR/SEC)

TST -- TOTAL SPECIFIC THRUST FROM ENGINE (LB THRUST/LB AIR/SEC)

ZETAD -- PRESSURE RECOVERY FACTOR IN THE DIFFUSER (DIMENSIONLESS)

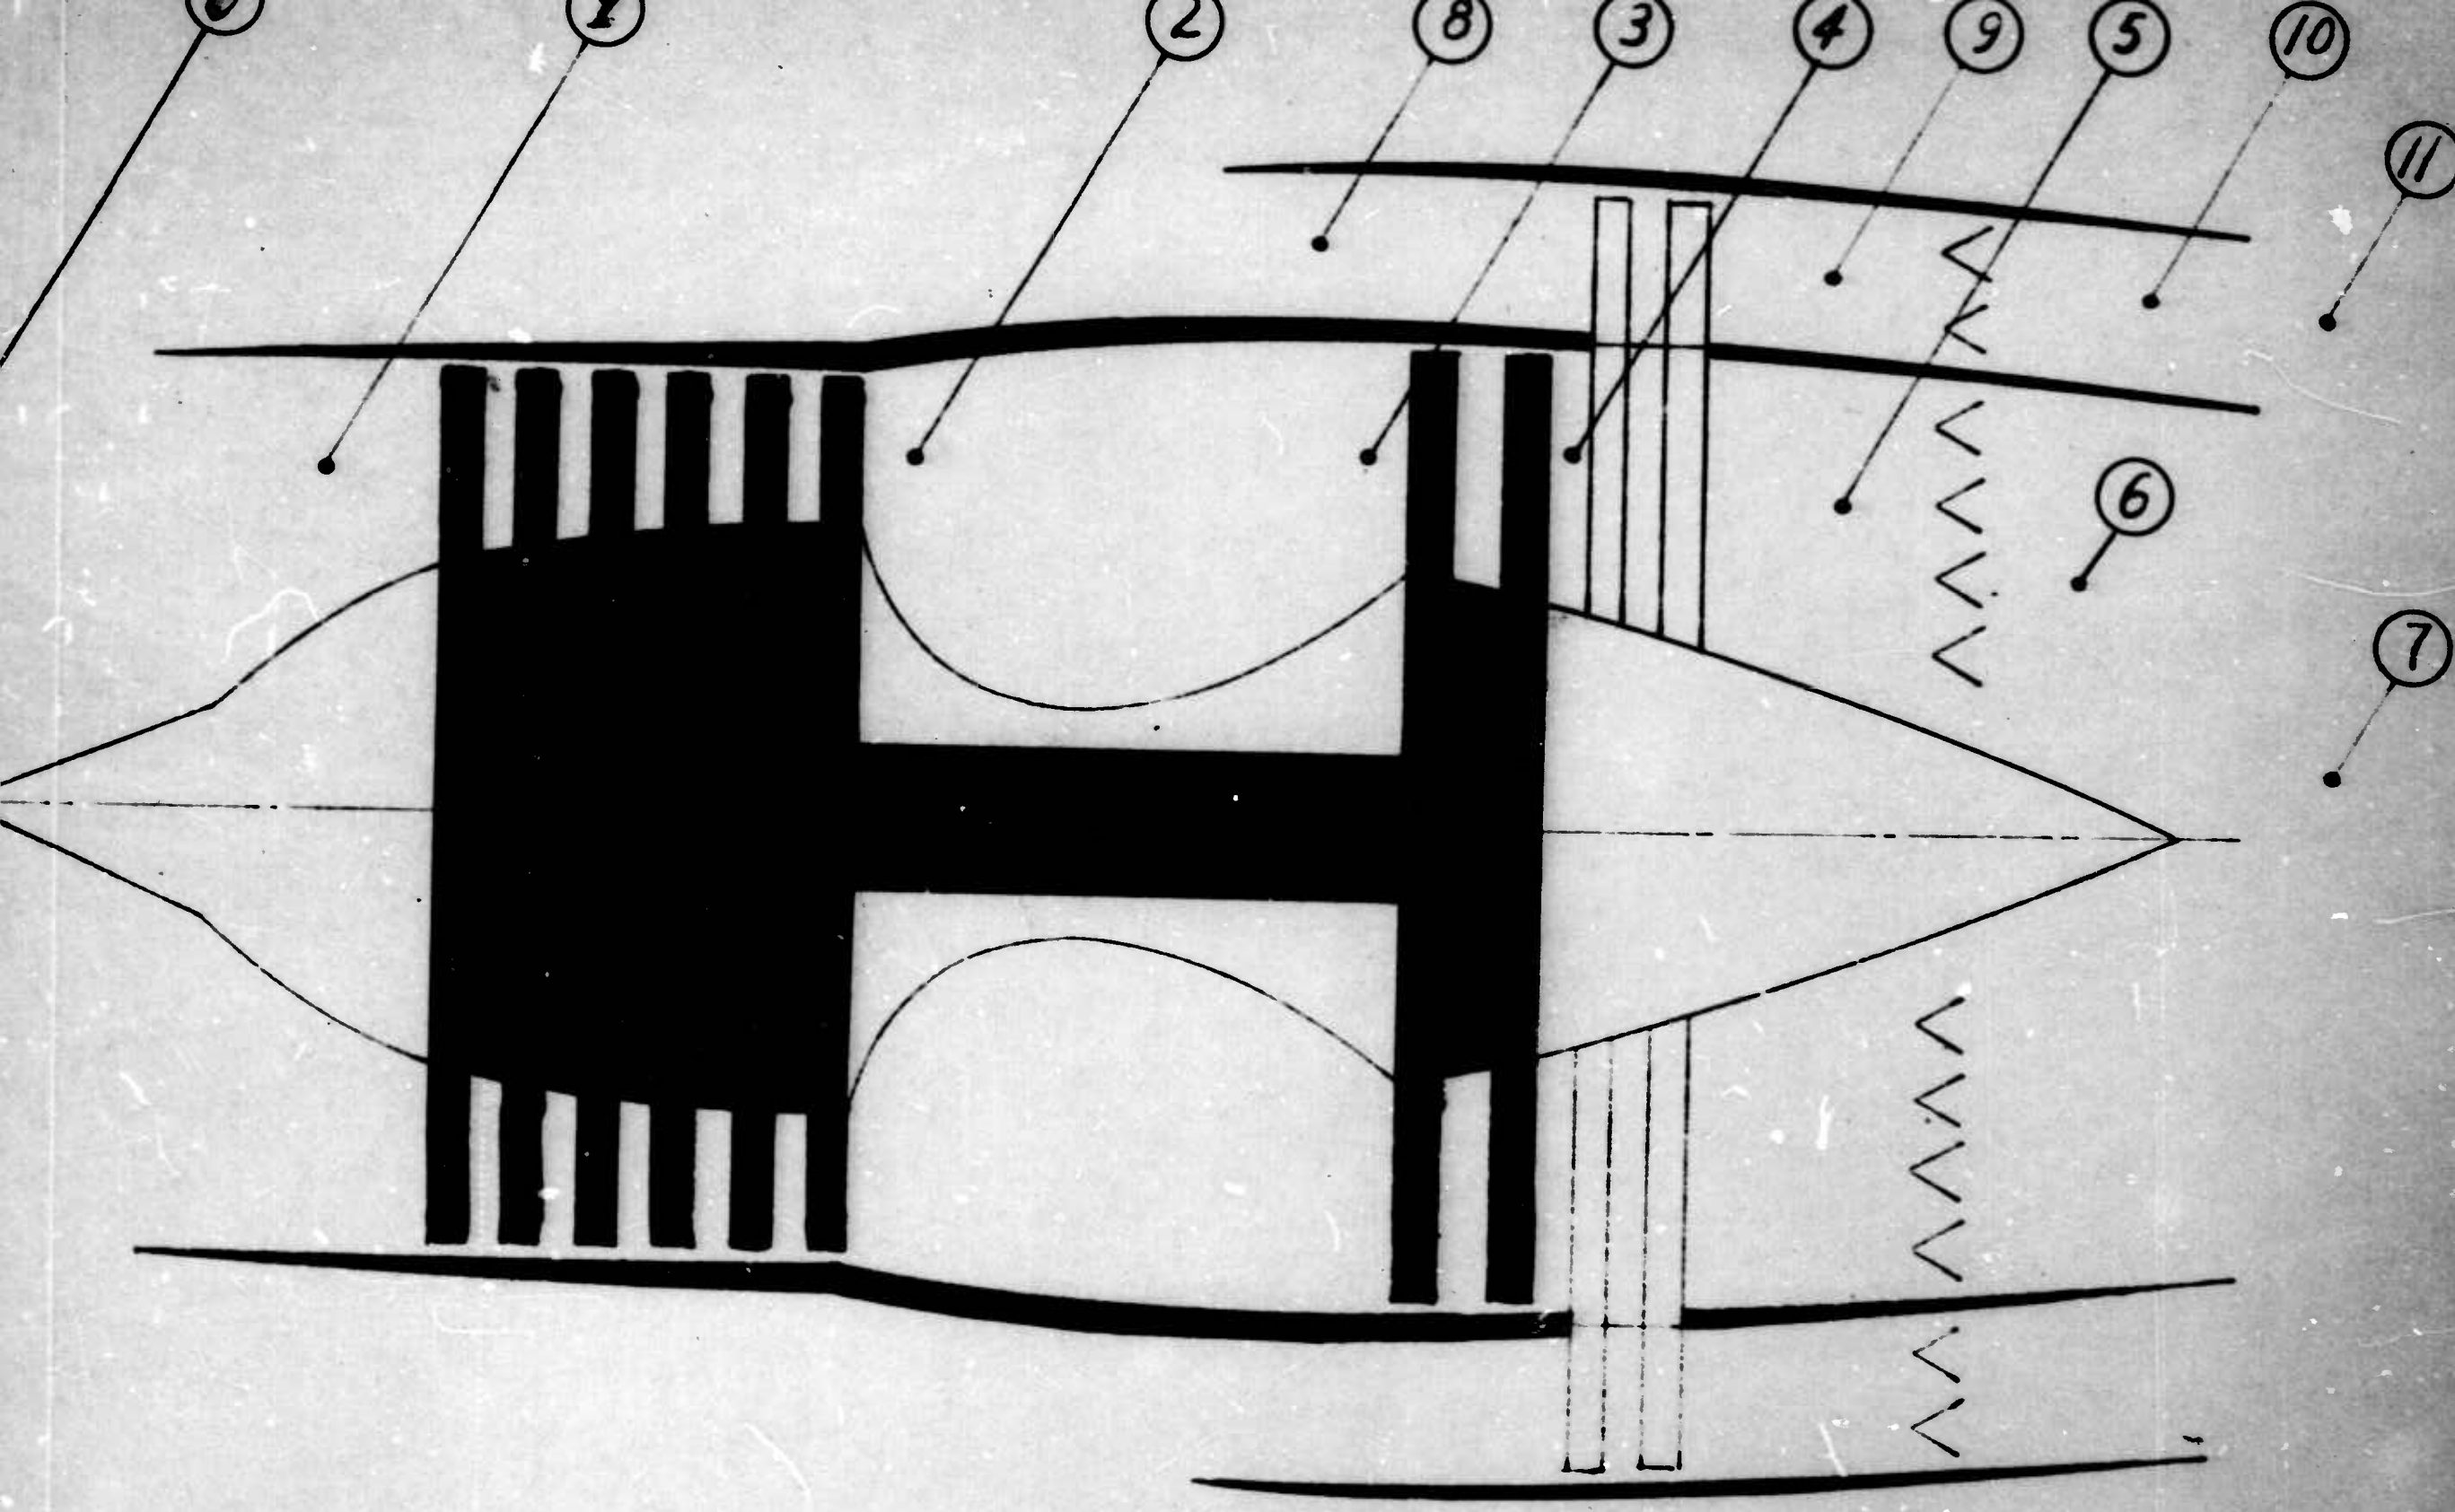

BY-PASS ENGINE WITH STATIONS NUMBERED AS USED IN THE COMPUTER PROGRAMS.

```
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      READ 10, RNSL, AMMB, ETF, ETFT, ETFN, ETMT, ETNM, AMABFAN, AMAB
   10 FORMAT (F8.2)
      READ 11, (Q(I),I = 1, 3), (R(I),I = 1, 9)
   11 FORMAT(12F3.2)
      DO 200 II = 1,3
      ZI = II
      ETC = .84 - .02 * ZI
      PRSL = 1. + 5. * ZI
  101 DO 200 I = 1,9
      SEG = 0.0
      AI = I
      H = (AI - 1.) * 10000.
      WRITE OUTPUT TAPE 3, 20, H, PRSL
      WRITE OUTPUT TAPE 3, 21
   20 FORMAT(10H1 ALTITUDE F8.1, 10H     PRSL = F4.0)
   21 FORMAT (101H   FMN      FAMB      FPRSL       BPR       T6        FAAB       TS1
     1       T10      FAFAB       TS2         SFC         TST)
      DO 200 K = 1, 3
      FMN = K
      T3 = 2000.
      DO 200 JJ= 1, 3
      BJ = JJ
      FPRSL = 1.3 + (BJ - 1.)*.2
      DO 200 L = 1, 3
      CL = L
      BPR = CL / 2. + 0.5
      DO 200 N = 1, 3
      J = N - 1
      GN = J
      WRITE OUTPUT TAPE 3,100
  100 FORMAT (1X)
      SEG = SEG + 1.
      IF(SEG-18.) 105,105,102
  102 WRITE OUTPUT TAPE 3, 26, H, PRSL
      WRITE OUTPUT TAPE 3, 27
   26 FORMAT(10H1 ALTITUDE F8.1, 10H     PRSL = F4.0)
   27 FORMAT (101H   FMN      FAMB      FPRSL       BPR       T6        FAAB       TS1
     1       T10      FAFAB       TS2         SFC         TST/)
      SEG = 1.0
  105 DO 200 M = 2000,3000,500
      T10 = M
      CALL DIFU
      CALL COMP
      IF(T2 - T3) 47, 60, 60
   47 CALL MB
      CALL MT
      CALL FT
      CALL AB
      IF (1. - PR60) 50, 50, 60
   50 CALL NM
      CALL FAN
      CALL FAB
      IF (1. - PR100) 70, 70, 60
   70 CALL NFAN
      A = SQRTF (1.6589 * TA1)
      SF1 = (FAMB + FAAB) * 3600. * (1./(1. + BPR))/(A * THS)
      SF2 =FAFAB * 3600. * (BPR/(1. + BPR )) / (A * THFS)
      SFC = SF1 + SF2
      TS1 = THS *(1./(1. + BPR )) *A
      TS2 = THFS * (BPR/(1. + BPR)) *A
      TST = TS1 + TS2
   60 WRITE OUTPUT TAPE 3, 22 FMN, FAMB, FPRSL, BPR, T6, FAAB, TS1, T10,
     1FAFAB, TS2, SFC, TST
   22 FORMAT(F5.1, F8.3, F8.2, F7.1, F9.0, F8.3, F10.2, F9.0, F8.1
```

```
      FUNCTION CP(RATIO, TEMP)
      TEMP1 = TEMP / 1000.
      CP1 = .22626 + .226 * RATIO
      CP2 = (.0282 - .0249 * RATIO) * TEMP1
      CP3 = (-.0007 + .1581 * RATIO) *  TEMP1 * TEMP1
      CP4 = (.00042 + .0354 * RATIO) *  TEMP1 * TEMP1 * TEMP1
      CP = CP1 + CP2 + CP3 - CP4
      RETURN
      END
      FUNCTION GAM(RATIO, TEMP)
      A = CP(RATIO, TEMP)
      GAM = A / (A - (53.34 + 9.05 * RATIO) / 778.16)
      RETURN
      END
      FUNCTION EN(GAM1,ETA)
      EN = GAM1 / (GAM1 * (1. - ETA) + ETA)
      RETURN
      END
      FUNCTION TA(H)
      IF (3.6089E4 - H) 20, 10, 10
   10 TA = (1. - 6.879E-6 * H) * 518.7
      RETURN
   20 TA = 3.89988E2
      RETURN
      END
      FUNCTION PA(H)
      IF (3.6089E4 - H) 20, 10, 10
   10 PA = (1. - 6.879E-6 * H) ** 5.2561 * 2.11622E3
      RETURN
   20 PA = (EXPF(-4.778E-5 * (H - 3.6089E4))) * 4.7268E2
      RETURN
      END
      SUBROUTINE DIFU
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      TA1 = TA(H)
      T1 = TA1
      ZETAD = .95
      IF (1. - FMN) 10, 20, 20
   10 ZETAD = 1. - 0.1 * (FMN - 1.0) ** 1.5
   20 DO 11 I = 1, 3
      GAMD = GAM(0., (TA1+ T1) / 2.)
   11 T1 = (1. + (GAMD - 1.) / 2. * FMN * FMN) * TA1
      PR10 = ZETAD * (T1 / TA1)** (GAMD/(GAMD - 1.))
      RETURN
      END
      SUBROUTINE COMP
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      T2 = T1
      DO 11 I = 1, 3
      CPCO = CP(0., (T1 + T2) / 2.)
      DELTC = ((PRSL ** .2857) - 1.) * 124.416 * (RNSL *RNSL) /(CPCO *
     1ETC)
   11 T2 = T1 + DELTC
      GAMC = GAM(0.,((T1 + T2) / 2.))
      PR21 = (1. + DELTC * ETC / T1) **(GAMC / (GAMC - 1.))
```

```
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      XI = H / 10000. + 1.
      I = XI
      ETMB = R(I)
      CP2 = CP(0., T2)
      FAMB = 0.
      DO 11 I = 1, 3
      CP3 = CP(FAMB, T3)
   11 FAMB = (T3 - T2 * CP2 / CP3) / (18550. * ETMB / CP3 - T3)
      PR30 = PR20 * (1. - AMMB)
      RETURN
      END
      SUBROUTINE MT
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      T4 = T3
      PA1 = PA(H)
      B = .99 *SQRTF(TA1) / (PA1* FMN)
      DO 11 I = 1, 3
      A = (T3 + T4) / 2.
      CPMT = CP(FAMB, A)
      DELTMT = CPCO * DELTC / (CPMT * (1. + FAMB - B))
   11 T4 = T3 - DELTMT
      GAMMT = GAM(FAMB, (T3 + T4) / 2.)
      PR43 = (1. - DELTMT / (T3 * ETMT)) ** (GAMMT / (GAMMT - 1.))
      PR40 = PR43 * PR30
      RETURN
      END
      SUBROUTINE FT
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      T9 = T1
      DO 11 I = 1, 3
      A = (T1 + T9) / 2.
      CPF = CP(0., A)
      DELTFAN =((FPRSL ** .2857) - 1.) * 124.416 / (CPF * ETF)
   11 T9 = T1 + DELTFAN
      T5 = T4
      DO 22 I = 1, 3
      A = (T4 + T5) / 2.
      CPFT = CP(FAMB, A)
      DELTFT = BPR * DELTFAN * CPF / (CPFT * (1. + FAMB - B))
   22 T5 = T4 - DELTFT
      GAMFT = GAM(FAMB, (T4 + T5) / 2.)
      PR54 = (1. - DELTFT / (T4 * ETFT)) ** (GAMFT / (GAMFT - 1.))
      PR50 = PR54 * PR40
      RETURN
      END
      SUBROUTINE AB
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
```

```
      GO TO 19
   14 T6 = 2500.
      GO TO 19
   15 T6=3000.
   19 ETAB = ETMB
      IF (T5 - T6) 20,20,35
   20 FAAB = 0.
      CP5 = CP(FAMB, T5)
      DO 29 I = 1, 3
      CP6 = CP((FAAB + FAMB), T6)
   29 FAAB = (1. + FAMB - B) * (T6 - CP5 * T5 / CP6) / (18550. * ETAB /
     1 CP6 - T6)
   33 PR60 = PR50 * (1. - AMAB)
      PR06 = 1./PR60
   35 RETURN
      END
      SUBROUTINE NM
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      GAMA = SQRTF(GAM(0., TA1))
      T7 = T6
      DO 11 I = 1, 3
      GAMNM = GAM((FAMB + FAAB), (T6 + T7) / 2.)
      ENNM = EN(GAMNM, ETNM)
      PR76 = (2. / (ENNM + 1.)) ** (ENNM / (ENNM - 1.))
   11 T7 = T6 * 2. / (GAMNM + 1.)
      IF (1. / PR60 - PR76) 20, 20, 30
   20 C7 = (2. * GAMNM * T6 * (ENNM - 1.) / (TA1* (GAMNM - 1.) * (ENNM +
     1 1.))) ** 0.5
      CA =(PR60 / (T6 / TA1)** 0.5)*((2. / (ENNM + 1.)) ** ( 1. / (ENNM
     1 - 1.)))* ((2. * GAMNM * (ENNM - 1.)) / ((GAMNM - 1.) *(ENNM + 1.)
     2 )  ** 0.5)
      PR70 = PR76 * PR60
      THS = (1. + FAMB + FAAB - B) * C7 + (1. + FAMB + FAAB - B) * (PR70
     1 - 1.) / CA - FMN * GAMA
      GO TO 35
   30 DO 33 I = 1, 3
      T7 = T6 * (1. / PR60) ** ((ENNM - 1.) / ENNM)
      GAMNM = GAM((FAAB + FAMB), ((T6 + T7) / 2.))
   33 ENNM = EN(GAMNM, ETNM)
      C7 = (2. * GAMNM / (GAMNM - 1.) * (T6 / TA1)* (1. - (1. / PR60) **
     1 ((ENNM - 1.) / ENNM))) ** 0.5
      THS = (1. + FAMB + FAAB - B) * C7 - FMN * GAMA
   35 RETURN
      END
      SUBROUTINE FAN
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      T9 = T1 + DELTFAN
      GAMFAN = GAM(0., ((T1 + T9 ) / 2.))
      PR90 = PR10 * (1. + DELTFAN * ETF   / T1) ** (GAMFAN / (GAMFAN -
     1 1.))
      PR91 = PR90 / PR10
      RETURN
      END
      SUBROUTINE FAB
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
```

```
      ETFNAB = ETMB
      CP9 = CP(0., T9)
      FAFAB = 0.0
      DO 39 I = 1,3
      CP10 = CP(FAFAB, T10)
   39 FAFAB = (T10 - CP9 * T9/CP10)/(18550. * ETFNAB/CP10 - T10)
      PR100 = (1. - AMABFAN) * PR90
      PR010 = 1./PR100
      RETURN
      END
      SUBROUTINE NFAN
      DIMENSION Q(3), R(9) , S(4,9,4)
      COMMON TA1,PA1,ZETAD, FMN, T1, PR10, T2, CPCO, DELTC, PRSL, RNSL,
     1ETC, PR21, PR20, T3, FAMB, ETMB, PR30, AMMB, B, T4, CPFT, ETMT,
     2PR40, DELTFAN, ETF, T9, T5, BPR, ETFT, PR50, T6, FAAB, PR60, GAMA,
     3ETNM, PR76, THS, PR90, ETFAN, T10, PR100, AMABFAN, ETFNAB, THFS,
     4FAFAB, ETFN, ETAB, AMAB,H, PR1110, PR91, Q, R, GN, FPRSL, PR06,
     5PR010,S, CP6
      T11 = T10
      DO 11 I = 1, 3
      GAMFN = GAM(FAFAB, (T10 + T11) / 2.)
      ENFN = EN(GAMFN, ETFN)
      PR1110 = (2. / (ENFN + 1.)) ** (ENFN / (ENFN - 1.))
   11 T11 = T10 * 2. / (GAMFN + 1.)
      IF (1. / PR100 - PR1110) 20, 20, 30
   20 C7 = (2. * GAMFN * T10 * (ENFN - 1.) /(TA1* (GAMFN - 1.) * (ENFN +
     1 1.))) ** 0.5
      CA =(PR100 / (T10 / TA1)** 0.5)*((2. / (ENFN + 1.)) ** (1. / (ENFN
     1 - 1.)))* ((2. * GAMFN * (ENFN - 1.)) / (( GAMFN - 1.) * (ENFN +
     2 1.))  ** 0.5)
      PR110 = PR1110 * PR100
      THFS = (1. + FAFAB) * C7 + (1. + FAFAB) * (PR110 - 1.) / CA - FMN
     1 * GAMA
      GO TO 35
   30 DO 33 I = 1, 3
      T11 = T10 * (1. / PR100) ** ((ENFN - 1.) / ENFN)
      GAMFN = GAM(FAFAB, ((T10 + T11) / 2.;)
   33 ENFN = EN(GAMFN, ETFN)
      C7 = (2. * GAMFN / (GAMFN - 1.) * T10 / TA1* (1. - (1. / PR100) **
     1 ((ENFN - 1.) / ENFN))) ** 0.5
      THFS = (1. + FAFAB ) *  C7 - FMN * GAMA
   35 RETURN
      END
      END
```

1.0	621.	1029.	4.77	2000.	.018	1643.	1643.	.000	.54	.33	1.686	38.91
1.0	621.	1029.	4.77	2000.	.018	1643.	2500.	.019	.55	.33	2.201	60.56
1.0	621.	1029.	4.77	2000.	.018	1643.	3000.	.031	.55	.33	2.452	72.54
1.0	621.	1029.	4.77	2500.	.029	2168.	2168.	.000	.55	.26	1.782	59.53
1.0	621.	1029.	4.77	2500.	.029	2168.	2500.	.008	.55	.26	1.953	68.60
1.0	621.	1029.	4.77	2500.	.029	2168.	3000.	.020	.55	.26	2.181	81.86
1.0	621.	1029.	4.77	3000.	.042	2690.	2690.	.000	.55	.23	1.920	78.16
1.0	621.	1029.	4.77	3000.	.042	2690.	2500.	.000	.55	.23	2.039	73.60
1.0	621.	1029.	4.77	3000.	.042	2690.	3000.	.008	.55	.23	2.052	86.73
2.0	919.	1315.	3.10	2000.	.013	1639.	1639.	.000	.54	.13	2.181	21.61
2.0	919.	1315.	3.10	2000.	.013	1639.	2500.	.019	.55	.13	2.288	49.87
2.0	919.	1315.	3.10	2000.	.013	1639.	3000.	.031	.55	.13	2.410	65.65
2.0	919.	1315.	3.10	2500.	.024	2165.	2165.	.000	.55	.10	2.075	41.84
2.0	919.	1315.	3.10	2500.	.024	2165.	2500.	.008	.55	.10	2.160	53.04
2.0	919.	1315.	3.10	2500.	.024	2165.	3000.	.020	.55	.10	2.289	69.32
2.0	919.	1315.	3.10	3000.	.036	2686.	2686.	.000	.55	.09	2.136	60.89
2.0	919.	1315.	3.10	3000.	.036	2686.	2500.	.000	.55	.09	2.338	55.62
2.0	919.	1315.	3.10	3000.	.036	2686.	3000.	.008	.55	.09	2.219	71.20
3.0	1390.	1770.	2.20	2000.	.005	1631.	1631.	.000	.54	.05	-2.219	-7.33
3.0	1390.	1770.	2.20	2000.	.005	1631.	2500.	.018	.55	.05	3.509	23.31
3.0	1390.	1770.	2.20	2000.	.005	1631.	3000.	.030	.55	.05	3.090	40.34
3.0	1390.	1770.	2.20	2500.	.015	2156.	2156.	.000	.55	.04	4.413	12.39
3.0	1390.	1770.	2.20	2500.	.015	2156.	2500.	.008	.55	.04	3.358	24.49
3.0	1390.	1770.	2.20	2500.	.015	2156.	3000.	.020	.55	.04	3.000	41.71
3.0	1390.	1770.	2.20	3000.	.027	2678.	2678.	.000	.55	.03	3.089	31.29
3.0	1390.	1770.	2.20	3000.	.027	2678.	2500.	.000	.55	.03	3.713	26.03
3.0	1390.	1770.	2.20	3000.	.027	2678.	3000.	.008	.55	.03	2.941	42.37

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	579.	988.	5.22	2000.	.019	1642.	1642.	.000	.54	.30	1.612	42.27
1.0	579.	988.	5.22	2000.	.019	1642.	2500.	.019	.55	.30	2.095	64.81
1.0	579.	988.	5.22	2000.	.019	1642.	3000.	.031	.55	.30	2.332	77.29
1.0	579.	988.	5.22	2500.	.030	2167.	2167.	.000	.55	.24	1.730	62.84
1.0	579.	988.	5.22	2500.	.030	2167.	2500.	.008	.55	.24	1.892	72.20
1.0	579.	988.	5.22	2500.	.030	2167.	3000.	.020	.55	.24	2.110	85.86
1.0	579.	988.	5.22	3000.	.042	2689.	2689.	.000	.55	.21	1.874	81.53
1.0	579.	988.	5.22	3000.	.042	2689.	2500.	.000	.55	.21	1.988	76.88
1.0	579.	988.	5.22	3000.	.042	2689.	3000.	.008	.55	.21	2.001	90.33
2.0	859.	1257.	3.31	2000.	.014	1640.	1640.	.000	.54	.12	2.063	24.69
2.0	859.	1257.	3.31	2000.	.014	1640.	2500.	.019	.55	.12	2.217	53.24
2.0	859.	1257.	3.31	2000.	.014	1640.	3000.	.031	.55	.12	2.344	69.19
2.0	859.	1257.	3.31	2500.	.025	2165.	2165.	.000	.55	.10	2.021	44.93
2.0	859.	1257.	3.31	2500.	.025	2165.	2500.	.008	.55	.10	2.109	56.22
2.0	859.	1257.	3.31	2500.	.025	2165.	3000.	.020	.55	.10	2.241	72.64
2.0	859.	1257.	3.31	3000.	.037	2687.	2687.	.000	.55	.08	2.096	64.03
2.0	859.	1257.	3.31	3000.	.037	2687.	2500.	.000	.55	.08	2.285	58.71
2.0	859.	1257.	3.31	3000.	.037	2687.	3000.	.008	.55	.08	2.180	74.39
3.0	1302.	1684.	2.31	2000.	.006	1633.	1633.	.000	.54	.05	-6.501	-3.41
3.0	1302.	1684.	2.31	2000.	.006	1633.	2500.	.018	.55	.05	3.218	27.34
3.0	1302.	1684.	2.31	2000.	.006	1633.	3000.	.030	.55	.05	2.947	44.45
3.0	1302.	1684.	2.31	2500.	.017	2157.	2157.	.000	.55	.04	3.720	16.36
3.0	1302.	1684.	2.31	2500.	.017	2157.	2500.	.008	.55	.04	3.107	28.48
3.0	1302.	1684.	2.31	2500.	.017	2157.	3000.	.020	.55	.04	2.874	45.77
3.0	1302.	1684.	2.31	3000.	.029	2679.	2679.	.000	.55	.03	2.919	35.32
3.0	1302.	1684.	2.31	3000.	.029	2679.	2500.	.000	.55	.03	3.436	30.00
3.0	1302.	1684.	2.31	3000.	.029	2679.	3000.	.008	.55	.03	2.824	46.41

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	537.	948.	5.78	2000.	.020	1640.	1640.	.000	.54	.27	1.554	45.48
1.0	537.	948.	5.78	2000.	.020	1640.	2500.	.019	.55	.27	2.005	68.88
1.0	537.	948.	5.78	2000.	.020	1640.	3000.	.031	.55	.27	2.229	81.82
1.0	537.	948.	5.78	2500.	.031	2166.	2166.	.000	.55	.22	1.688	65.97
1.0	537.	948.	5.78	2500.	.031	2166.	2500.	.008	.55	.22	1.841	75.62
1.0	537.	948.	5.78	2500.	.031	2166.	3000.	.020	.55	.22	2.047	89.64
1.0	537.	948.	5.78	3000.	.043	2688.	2688.	.000	.55	.19	1.837	84.69
1.0	537.	948.	5.78	3000.	.043	2688.	2500.	.000	.55	.19	1.945	79.98
1.0	537.	948.	5.78	3000.	.043	2688.	3000.	.008	.55	.19	1.958	93.72
2.0	798.	1198.	3.57	2000.	.015	1640.	1640.	.000	.54	.11	1.970	27.78
2.0	798.	1198.	3.57	2000.	.015	1640.	2500.	.019	.55	.11	2.153	56.61
2.0	798.	1198.	3.57	2000.	.015	1640.	3000.	.031	.55	.11	2.283	72.71
2.0	798.	1198.	3.57	2500.	.026	2165.	2165.	.000	.55	.09	1.974	48.02
2.0	798.	1198.	3.57	2500.	.026	2165.	2500.	.008	.55	.09	2.064	59.39
2.0	798.	1198.	3.57	2500.	.026	2165.	3000.	.020	.55	.09	2.196	75.93
2.0	798.	1198.	3.57	3000.	.038	2687.	2687.	.000	.55	.08	2.060	67.14
2.0	798.	1198.	3.57	3000.	.038	2687.	2500.	.000	.55	.08	2.238	61.79
2.0	798.	1198.	3.57	3000.	.038	2687.	3000.	.008	.55	.08	2.143	77.57
3.0	1212.	1598.	2.43	2000.	.008	1633.	1633.	.000	.54	.04	49.398	.57
3.0	1212.	1598.	2.43	2000.	.008	1633.	2500.	.018	.55	.04	2.994	31.43
3.0	1212.	1598.	2.43	2000.	.008	1633.	3000.	.030	.55	.04	2.824	48.62
3.0	1212.	1598.	2.43	2500.	.019	2158.	2158.	.000	.55	.03	3.288	20.39
3.0	1212.	1598.	2.43	2500.	.019	2158.	2500.	.008	.55	.03	2.911	32.52
3.0	1212.	1598.	2.43	2500.	.019	2158.	3000.	.020	.55	.03	2.765	49.89
3.0	1212.	1598.	2.43	3000.	.030	2680.	2680.	.000	.55	.03	2.779	39.40
3.0	1212.	1598.	2.43	3000.	.030	2680.	2500.	.000	.55	.03	3.217	34.04
3.0	1212.	1598.	2.43	3000.	.030	2680.	3000.	.008	.55	.03	2.722	50.49

FAN	T1	T2	PR2T	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	494.	908.	6.48	2000.	.022	1638.	1638.	.000	.54	.25	1.599	48.57
1.0	494.	908.	6.48	2000.	.022	1638.	2500.	.020	.55	.25	2.045	73.01
1.0	494.	908.	6.48	2000.	.022	1638.	3000.	.033	.55	.25	2.269	86.58
1.0	494.	908.	6.48	2500.	.034	2165.	2165.	.000	.55	.20	1.755	69.14
1.0	494.	908.	6.48	2500.	.034	2165.	2500.	.008	.55	.20	1.908	79.16
1.0	494.	908.	6.48	2500.	.034	2165.	3000.	.021	.55	.20	2.115	93.73
1.0	494.	908.	6.48	3000.	.047	2688.	2688.	.000	.55	.17	1.916	88.11
1.0	494.	908.	6.48	3000.	.047	2688.	2500.	.000	.55	.17	2.027	83.29
1.0	494.	908.	6.48	3000.	.047	2688.	3000.	.008	.55	.17	2.038	97.46
2.0	737.	1140.	3.90	2000.	.017	1640.	1640.	.000	.54	.10	2.005	31.00
2.0	737.	1140.	3.90	2000.	.017	1640.	2500.	.020	.55	.10	2.215	60.38
2.0	737.	1140.	3.90	2000.	.017	1640.	3000.	.033	.55	.10	2.355	76.88
2.0	737.	1140.	3.90	2500.	.029	2166.	2166.	.000	.55	.08	2.044	51.47
2.0	737.	1140.	3.90	2500.	.029	2166.	2500.	.008	.55	.08	2.139	62.97
2.0	737.	1140.	3.90	2500.	.029	2166.	3000.	.021	.55	.08	2.279	79.90
2.0	737.	1140.	3.90	3000.	.042	2689.	2689.	.000	.55	.07	2.145	70.82
2.0	737.	1140.	3.90	3000.	.042	2689.	2500.	.000	.55	.07	2.324	65.36
2.0	737.	1140.	3.90	3000.	.042	2689.	3000.	.008	.55	.07	2.232	81.42
3.0	1122.	1510.	2.59	2000.	.010	1634.	1634.	.000	.54	.04	7.689	4.70
3.0	1122.	1510.	2.59	2000.	.010	1634.	2500.	.020	.55	.04	2.965	35.96
3.0	1122.	1510.	2.59	2000.	.010	1634.	3000.	.032	.55	.04	2.861	53.48
3.0	1122.	1510.	2.59	2500.	.022	2160.	2160.	.000	.55	.03	3.148	24.75
3.0	1122.	1510.	2.59	2500.	.022	2160.	2500.	.008	.55	.03	2.902	37.01
3.0	1122.	1510.	2.59	2500.	.022	2160.	3000.	.021	.55	.03	2.813	54.70
3.0	1122.	1510.	2.59	3000.	.034	2683.	2683.	.000	.55	.03	2.805	44.08
3.0	1122.	1510.	2.59	3000.	.034	2683.	2500.	.000	.55	.03	3.204	38.59
3.0	1122.	1510.	2.59	3000.	.034	2683.	3000.	.008	.55	.03	2.776	55.28

1.0	469.	883.	7.01	2000.	.022	1632.	1632.	.000	.54	.23	1.617	49.04
1.0	469.	883.	7.01	2000.	.022	1632.	2500.	.020	.55	.23	2.037	73.70
1.0	469.	883.	7.01	2000.	.022	1632.	3000.	.033	.55	.23	2.249	87.29
1.0	469.	883.	7.01	2500.	.034	2159.	2159.	.000	.55	.18	1.772	69.39
1.0	469.	883.	7.01	2500.	.034	2159.	2500.	.008	.55	.18	1.918	79.57
1.0	469.	883.	7.01	2500.	.034	2159.	3000.	.021	.55	.18	2.114	94.11
1.0	469.	883.	7.01	3000.	.047	2683.	2683.	.000	.55	.16	1.934	88.20
1.0	469.	883.	7.01	3000.	.047	2683.	2500.	.000	.55	.16	2.043	83.52
1.0	469.	883.	7.01	3000.	.047	2683.	3000.	.008	.55	.16	2.051	97.67
2.0	699.	1104.	4.14	2000.	.018	1637.	1637.	.000	.54	.10	2.002	32.26
2.0	699.	1104.	4.14	2000.	.018	1637.	2500.	.020	.55	.10	2.203	61.68
2.0	699.	1104.	4.14	2000.	.018	1637.	3000.	.033	.55	.10	2.339	78.15
2.0	699.	1104.	4.14	2500.	.030	2164.	2164.	.000	.55	.08	2.047	52.57
2.0	699.	1104.	4.14	2500.	.030	2164.	2500.	.008	.55	.08	2.138	64.18
2.0	699.	1104.	4.14	2500.	.030	2164.	3000.	.021	.55	.08	2.273	81.05
2.0	699.	1104.	4.14	3000.	.043	2686.	2686.	.000	.55	.07	2.150	71.90
2.0	699.	1104.	4.14	3000.	.043	2686.	2500.	.000	.55	.07	2.324	66.51
2.0	699.	1104.	4.14	3000.	.043	2686.	3000.	.008	.55	.07	2.234	82.53
3.0	1067.	1457.	2.70	2000.	.011	1633.	1633.	.000	.54	.04	5.868	6.81
3.0	1067.	1457.	2.70	2000.	.011	1633.	2500.	.020	.55	.04	2.900	38.05
3.0	1067.	1457.	2.70	2000.	.011	1633.	3000.	.032	.55	.04	2.820	55.53
3.0	1067.	1457.	2.70	2500.	.023	2159.	2159.	.000	.55	.03	3.054	26.82
3.0	1067.	1457.	2.70	2500.	.023	2159.	2500.	.008	.55	.03	2.850	39.08
3.0	1067.	1457.	2.70	2500.	.023	2159.	3000.	.021	.55	.03	2.780	56.73
3.0	1067.	1457.	2.70	3000.	.035	2682.	2682.	.000	.55	.03	2.772	46.11
3.0	1067.	1457.	2.70	3000.	.035	2682.	2500.	.000	.55	.03	3.143	40.66
3.0	1067.	1457.	2.70	3000.	.035	2682.	3000.	.008	.55	.03	2.750	57.31

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	883.	7.01	2000.	.023	1621.	1621.	.000	.54	.24	1.845	45.79
1.0	469.	883.	7.01	2000.	.023	1621.	2500.	.021	.55	.24	2.270	69.98
1.0	469.	883.	7.01	2000.	.023	1621.	3000.	.034	.56	.24	2.488	83.20
1.0	469.	883.	7.01	2500.	.037	2151.	2151.	.000	.55	.19	1.991	66.01
1.0	469.	883.	7.01	2500.	.037	2151.	2500.	.009	.55	.19	2.140	76.21
1.0	469.	883.	7.01	2500.	.037	2151.	3000.	.022	.56	.19	2.338	90.45
1.0	469.	883.	7.01	3000.	.051	2676.	2676.	.000	.55	.16	2.158	84.74
1.0	469.	883.	7.01	3000.	.051	2676.	2500.	.000	.55	.16	2.275	80.36
1.0	469.	883.	7.01	3000.	.051	2676.	3000.	.009	.56	.16	2.277	94.26
2.0	699.	1104.	4.14	2000.	.019	1633.	1633.	.000	.54	.10	2.239	30.74
2.0	699.	1104.	4.14	2000.	.019	1633.	2500.	.021	.55	.10	2.401	60.16
2.0	699.	1104.	4.14	2000.	.019	1633.	3000.	.035	.55	.10	2.534	76.63
2.0	699.	1104.	4.14	2500.	.032	2161.	2161.	.000	.55	.08	2.252	51.07
2.0	699.	1104.	4.14	2500.	.032	2161.	2500.	.009	.55	.08	2.337	62.77
2.0	699.	1104.	4.14	2500.	.032	2161.	3000.	.023	.55	.08	2.467	79.67
2.0	699.	1104.	4.14	3000.	.046	2685.	2685.	.000	.55	.07	2.349	70.51
2.0	699.	1104.	4.14	3000.	.046	2685.	2500.	.000	.55	.07	2.540	65.23
2.0	699.	1104.	4.14	3000.	.046	2685.	3000.	.009	.55	.07	2.431	81.25
3.0	1067.	1457.	2.70	2000.	.012	1630.	1630.	.000	.54	.04	7.351	5.79
3.0	1067.	1457.	2.70	2000.	.012	1630.	2500.	.021	.55	.04	3.159	37.16
3.0	1067.	1457.	2.70	2000.	.012	1630.	3000.	.034	.55	.04	3.045	54.76
3.0	1067.	1457.	2.70	2500.	.024	2158.	2158.	.000	.55	.03	3.383	25.87
3.0	1067.	1457.	2.70	2500.	.024	2158.	2500.	.009	.55	.03	3.112	38.25
3.0	1067.	1457.	2.70	2500.	.024	2158.	3000.	.022	.55	.03	3.007	56.03
3.0	1067.	1457.	2.70	3000.	.038	2681.	2681.	.000	.55	.03	3.021	45.33
3.0	1067.	1457.	2.70	3000.	.038	2681.	2500.	.000	.55	.03	3.430	39.93
3.0	1067.	1457.	2.70	3000.	.038	2681.	3000.	.009	.55	.03	2.980	56.66

FAN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	883.	7.01	2000.	.023	1600.	1600.	.000	.54	.26	2.109	40.06
1.0	469.	883.	7.01	2000.	.023	1600.	2500.	.020	.55	.26	2.479	63.00
1.0	469.	883.	7.01	2000.	.023	1600.	3000.	.032	.55	.26	2.680	75.18
1.0	469.	883.	7.01	2500.	.037	2132.	2132.	.000	.55	.20	2.201	59.73
1.0	469.	883.	7.01	2500.	.037	2132.	2500.	.009	.55	.20	2.335	69.79
1.0	469.	883.	7.01	2500.	.037	2132.	3000.	.021	.56	.20	2.510	83.07
1.0	469.	883.	7.01	3000.	.051	2658.	2658.	.000	.55	.17	2.350	77.82
1.0	469.	883.	7.01	3000.	.051	2658.	2500.	.000	.55	.17	2.468	74.09
1.0	469.	883.	7.01	3000.	.051	2658.	3000.	.009	.56	.17	2.458	87.23
2.0	699.	1104.	4.14	2000.	.019	1623.	1623.	.000	.54	.10	2.466	27.91
2.0	699.	1104.	4.14	2000.	.019	1623.	2500.	.021	.55	.10	2.520	56.78
2.0	699.	1104.	4.14	2000.	.019	1623.	3000.	.034	.55	.10	2.632	72.73
2.0	699.	1104.	4.14	2500.	.032	2152.	2152.	.000	.55	.08	2.402	47.87
2.0	699.	1104.	4.14	2500.	.032	2152.	2500.	.009	.55	.08	2.462	59.54
2.0	699.	1104.	4.14	2500.	.032	2152.	3000.	.022	.55	.08	2.569	75.95
2.0	699.	1104.	4.14	3000.	.046	2677.	2677.	.000	.55	.07	2.474	66.95
2.0	699.	1104.	4.14	3000.	.046	2677.	2500.	.000	.55	.07	2.671	62.02
2.0	699.	1104.	4.14	3000.	.046	2677.	3000.	.009	.55	.07	2.543	77.65
3.0	1067.	1457.	2.70	2000.	.012	1624.	1624.	.000	.54	.04	10.876	3.92
3.0	1067.	1457.	2.70	2000.	.012	1624.	2500.	.021	.55	.04	3.336	34.94
3.0	1067.	1457.	2.70	2000.	.012	1624.	3000.	.034	.55	.04	3.160	52.18
3.0	1067.	1457.	2.70	2500.	.024	2152.	2152.	.000	.55	.03	3.688	23.73
3.0	1067.	1457.	2.70	2500.	.024	2152.	2500.	.009	.55	.03	3.296	36.10
3.0	1067.	1457.	2.70	2500.	.024	2152.	3000.	.022	.55	.03	3.128	53.54
3.0	1067.	1457.	2.70	3000.	.038	2676.	2676.	.000	.55	.03	3.189	42.24
3.0	1067.	1457.	2.70	3000.	.038	2676.	2500.	.000	.55	.03	3.625	37.78
3.0	1067.	1457.	2.70	3000.	.038	2676.	3000.	.009	.55	.03	3.111	54.24

1.0	469.	883.	7.01	2000.	.025	1562.	1562.	.000	.54	.29	2.927	30.89
1.0	469.	883.	7.01	2000.	.025	1562.	2500.	.020	.55	.29	3.141	51.94
1.0	469.	883.	7.01	2000.	.025	1562.	3000.	.032	.56	.29	3.310	62.64
1.0	469.	883.	7.01	2500.	.039	2099.	2099.	.000	.55	.21	2.822	50.02
1.0	469.	883.	7.01	2500.	.039	2099.	2500.	.009	.55	.21	2.915	59.93
1.0	469.	883.	7.01	2500.	.039	2099.	3000.	.022	.56	.21	3.051	71.94
1.0	469.	883.	7.01	3000.	.055	2631.	2631.	.000	.55	.18	2.919	67.49
1.0	469.	883.	7.01	3000.	.055	2631.	2500.	.000	.55	.18	3.045	64.68
1.0	469.	883.	7.01	3000.	.055	2631.	3000.	.009	.56	.18	3.002	76.82
2.0	699.	1104.	4.14	2000.	.020	1608.	1608.	.000	.54	.11	3.123	23.58
2.0	699.	1104.	4.14	2000.	.020	1608.	2500.	.022	.55	.11	2.916	51.92
2.0	699.	1104.	4.14	2000.	.020	1608.	3000.	.035	.55	.11	2.989	67.37
2.0	699.	1104.	4.14	2500.	.034	2139.	2139.	.000	.55	.08	2.856	43.25
2.0	699.	1104.	4.14	2500.	.034	2139.	2500.	.009	.55	.08	2.861	54.98
2.0	699.	1104.	4.14	2500.	.034	2139.	3000.	.023	.56	.08	2.926	70.95
2.0	699.	1104.	4.14	3000.	.050	2666.	2666.	.000	.55	.07	2.873	62.12
2.0	699.	1104.	4.14	3000.	.050	2666.	2500.	.000	.55	.07	3.096	57.63
2.0	699.	1104.	4.14	3000.	.050	2666.	3000.	.009	.56	.07	2.915	72.90
3.0	1067.	1457.	2.70	2000.	.013	1614.	1614.	.000	.54	.04	43.519	1.05
3.0	1067.	1457.	2.70	2000.	.013	1614.	2500.	.022	.55	.04	3.879	31.88
3.0	1067.	1457.	2.70	2000.	.013	1614.	3000.	.036	.55	.04	3.566	48.92
3.0	1067.	1457.	2.70	2500.	.026	2144.	2144.	.000	.55	.03	4.539	20.70
3.0	1067.	1457.	2.70	2500.	.026	2144.	2500.	.009	.55	.03	3.848	33.18
3.0	1067.	1457.	2.70	2500.	.026	2144.	3000.	.024	.55	.03	3.542	50.45
3.0	1067.	1457.	2.70	3000.	.041	2670.	2670.	.000	.55	.03	3.699	39.87
3.0	1067.	1457.	2.70	3000.	.041	2670.	2500.	.000	.55	.03	4.216	34.98
3.0	1067.	1457.	2.70	3000.	.041	2670.	3000.	.009	.55	.03	3.541	51.30

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	883.	7.01	2000.	.025	1479.	1479.	.000	.54	.38	6.144	14.72
1.0	469.	883.	7.01	2000.	.025	1479.	2500.	.018	.55	.38	4.941	31.55
1.0	469.	883.	7.01	2000.	.025	1479.	3000.	.028	.55	.38	4.900	39.27
1.0	469.	883.	7.01	2500.	.039	2025.	2025.	.000	.55	.26	4.270	33.06
1.0	469.	883.	7.01	2500.	.039	2025.	2500.	.009	.55	.26	4.113	42.36
1.0	469.	883.	7.01	2500.	.039	2025.	3000.	.020	.56	.26	4.083	51.80
1.0	469.	883.	7.01	3000.	.055	2564.	2564.	.000	.55	.20	4.013	49.08
1.0	469.	883.	7.01	3000.	.055	2564.	2500.	.000	.55	.20	4.108	47.95
1.0	469.	883.	7.01	3000.	.055	2564.	3000.	.009	.56	.20	3.966	58.04
2.0	699.	1104.	4.14	2000.	.020	1578.	1578.	.000	.54	.12	4.565	16.13
2.0	699.	1104.	4.14	2000.	.020	1578.	2500.	.021	.55	.12	3.437	42.97
2.0	699.	1104.	4.14	2000.	.020	1578.	3000.	.033	.55	.12	3.396	57.04
2.0	699.	1104.	4.14	2500.	.034	2112.	2112.	.000	.55	.09	3.540	34.89
2.0	699.	1104.	4.14	2500.	.034	2112.	2500.	.009	.55	.09	3.377	46.51
2.0	699.	1104.	4.14	2500.	.034	2112.	3000.	.022	.56	.09	3.327	61.17
2.0	699.	1104.	4.14	3000.	.050	2642.	2642.	.000	.55	.07	3.379	52.81
2.0	699.	1104.	4.14	3000.	.050	2642.	2500.	.000	.55	.07	3.623	49.25
2.0	699.	1104.	4.14	3000.	.050	2642.	3000.	.009	.56	.07	3.343	63.50
3.0	1067.	1457.	2.70	2000.	.013	1595.	1595.	.000	.54	.04	-11.825	-3.85
3.0	1067.	1457.	2.70	2000.	.013	1595.	2500.	.021	.55	.04	4.653	26.05
3.0	1067.	1457.	2.70	2000.	.013	1595.	3000.	.034	.55	.04	4.015	42.19
3.0	1067.	1457.	2.70	2500.	.026	2127.	2127.	.000	.55	.03	6.212	15.15
3.0	1067.	1457.	2.70	2500.	.026	2127.	2500.	.009	.55	.03	4.627	27.56
3.0	1067.	1457.	2.70	2500.	.026	2127.	3000.	.023	.55	.03	4.004	43.95
3.0	1067.	1457.	2.70	3000.	.041	2655.	2655.	.000	.55	.03	4.386	33.62
3.0	1067.	1457.	2.70	3000.	.041	2655.	2500.	.000	.55	.03	5.021	29.37
3.0	1067.	1457.	2.70	3000.	.041	2655.	3000.	.009	.55	.03	4.033	45.00

PMN	T1	T2	PR21	T3	PRM3	T5	T6	PR56	PR78	PR68	SPC	TST
1.0	621.	1230.	3.36	2000.	.015	1451.	1451.	.000	.54	.34	1.598	32.98
1.0	621.	1230.	8.36	2000.	.015	1451.	2500.	.022	.55	.34	2.252	59.36
1.0	621.	1230.	8.36	2000.	.015	1451.	3000.	.035	.55	.34	2.505	71.14
1.0	621.	1230.	8.36	2500.	.026	1990.	1990.	.000	.55	.23	1.597	58.02
1.0	621.	1230.	8.36	2500.	.026	1990.	2500.	.012	.55	.23	1.852	72.70
1.0	621.	1230.	8.36	2500.	.026	1990.	3000.	.024	.55	.23	2.070	86.61
1.0	621.	1230.	8.36	3000.	.038	2525.	2525.	.000	.55	.18	1.716	79.32
1.0	621.	1230.	8.36	3000.	.038	2525.	2500.	.000	.55	.18	1.730	78.69
1.0	621.	1230.	8.36	3000.	.038	2525.	3000.	.012	.55	.18	1.912	93.43
2.0	919.	1511.	4.79	2000.	.009	1446.	1446.	.000	.54	.15	2.576	13.21
2.0	919.	1511.	4.79	2000.	.009	1446.	2500.	.022	.55	.15	2.419	47.22
2.0	919.	1511.	4.79	2000.	.009	1446.	3000.	.035	.55	.15	2.529	62.57
2.0	919.	1511.	4.79	2500.	.020	1985.	1985.	.000	.55	.10	2.040	35.89
2.0	919.	1511.	4.79	2500.	.020	1985.	2500.	.012	.55	.10	2.163	53.18
2.0	919.	1511.	4.79	2500.	.020	1985.	3000.	.024	.55	.10	2.290	69.48
2.0	919.	1511.	4.79	3000.	.032	2519.	2519.	.000	.55	.08	2.055	56.41
2.0	919.	1511.	4.79	3000.	.032	2519.	2500.	.000	.55	.08	2.075	55.86
2.0	919.	1511.	4.79	3000.	.032	2519.	3000.	.012	.55	.08	2.185	72.48
3.0	1390.	1958.	3.04	2000.	.001	1434.	1434.	.000	.54	.06	-.189	-15.82
3.0	1390.	1958.	3.04	2000.	.001	1434.	2500.	.022	.55	.06	3.802	21.45
3.0	1390.	1958.	3.04	2000.	.001	1434.	3000.	.034	.55	.06	3.258	38.19
3.0	1390.	1958.	3.04	2500.	.011	1972.	1972.	.000	.55	.04	7.571	5.40
3.0	1390.	1958.	3.04	2500.	.011	1972.	2500.	.012	.55	.04	3.436	23.96
3.0	1390.	1958.	3.04	2500.	.011	1972.	3000.	.023	.55	.04	3.048	41.10
3.0	1390.	1958.	3.04	3000.	.023	2506.	2506.	.000	.55	.03	3.263	25.23
3.0	1390.	1958.	3.04	3000.	.023	2506.	2500.	.000	.55	.03	3.287	25.05
3.0	1390.	1958.	3.04	3000.	.023	2506.	3000.	.012	.55	.03	2.948	42.32

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	579.	1190.	9.36	2000.	.015	1450.	1450.	.000	.54	.30	1.505	36.73
1.0	579.	1190.	9.36	2000.	.015	1450.	2500.	.022	.55	.30	2.111	64.49
1.0	579.	1190.	9.36	2000.	.015	1450.	3000.	.035	.55	.30	2.348	76.91
1.0	579.	1190.	9.36	2500.	.026	1989.	1989.	.000	.55	.21	1.554	61.35
1.0	579.	1190.	9.36	2500.	.026	1989.	2500.	.012	.55	.21	1.795	76.50
1.0	579.	1190.	9.36	2500.	.026	1989.	3000.	.024	.55	.21	2.002	90.84
1.0	579.	1190.	9.36	3000.	.039	2524.	2524.	.000	.55	.16	1.683	82.51
1.0	579.	1190.	9.36	3000.	.039	2524.	2500.	.000	.55	.16	1.696	81.89
1.0	579.	1190.	9.36	3000.	.039	2524.	3000.	.012	.55	.16	1.871	96.97
2.0	859.	1454.	5.23	2000.	.011	1446.	1446.	.000	.54	.14	2.285	16.58
2.0	859.	1454.	5.23	2000.	.011	1446.	2500.	.022	.55	.14	2.312	51.11
2.0	859.	1454.	5.23	2000.	.011	1446.	3000.	.035	.55	.14	2.433	66.71
2.0	859.	1454.	5.23	2500.	.021	1986.	1986.	.000	.55	.09	1.973	39.13
2.0	859.	1454.	5.23	2500.	.021	1986.	2500.	.012	.55	.09	2.104	56.59
2.0	859.	1454.	5.23	2500.	.021	1986.	3000.	.024	.55	.09	2.234	73.07
2.0	859.	1454.	5.23	3000.	.033	2520.	2520.	.000	.55	.07	2.013	59.63
2.0	859.	1454.	5.23	3000.	.033	2520.	2500.	.000	.55	.07	2.033	59.06
2.0	859.	1454.	5.23	3000.	.033	2520.	3000.	.012	.55	.07	2.144	75.82
3.0	1302.	1874.	3.24	2000.	.002	1435.	1435.	.000	.54	.06	-.760	-11.78
3.0	1302.	1874.	3.24	2000.	.002	1435.	2500.	.022	.55	.06	3.417	25.69
3.0	1302.	1874.	3.24	2000.	.002	1435.	3000.	.034	.55	.06	3.075	42.54
3.0	1302.	1874.	3.24	2500.	.013	1974.	1974.	.000	.55	.04	4.981	9.45
3.0	1302.	1874.	3.24	2500.	.013	1974.	2500.	.012	.55	.04	3.159	28.06
3.0	1302.	1874.	3.24	2500.	.013	1974.	3000.	.024	.55	.04	2.908	45.29
3.0	1302.	1874.	3.24	3000.	.025	2508.	2508.	.000	.55	.03	3.027	29.33
3.0	1302.	1874.	3.24	3000.	.025	2508.	2500.	.000	.55	.03	3.052	29.09
3.0	1302.	1874.	3.24	3000.	.025	2508.	3000.	.012	.55	.03	2.826	46.43

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	537.	1151.	10.62	2000.	.016	1447.	1447.	.000	.54	.27	1.438	40.21
1.0	537.	1151.	10.62	2000.	.016	1447.	2500.	.022	.55	.27	1.999	69.29
1.0	537.	1151.	10.62	2000.	.016	1447.	3000.	.035	.55	.27	2.221	82.29
1.0	537.	1151.	10.62	2500.	.027	1987.	1987.	.000	.55	.18	1.522	64.40
1.0	537.	1151.	10.62	2500.	.027	1987.	2500.	.012	.55	.18	1.749	80.02
1.0	537.	1151.	10.62	2500.	.027	1987.	3000.	.024	.55	.18	1.945	94.74
1.0	537.	1151.	10.62	3000.	.039	2522.	2522.	.000	.55	.14	1.659	85.40
1.0	537.	1151.	10.62	3000.	.039	2522.	2500.	.000	.55	.14	1.670	84.83
1.0	537.	1151.	10.62	3000.	.039	2522.	3000.	.012	.55	.14	1.838	100.19
2.0	798.	1396.	5.77	2000.	.012	1446.	1446.	.000	.54	.13	2.093	19.94
2.0	798.	1396.	5.77	2000.	.012	1446.	2500.	.022	.55	.13	2.221	54.96
2.0	798.	1396.	5.77	2000.	.012	1446.	3000.	.035	.55	.13	2.347	70.80
2.0	798.	1396.	5.77	2500.	.023	1986.	1986.	.000	.55	.09	1.918	42.34
2.0	798.	1396.	5.77	2500.	.023	1986.	2500.	.012	.55	.09	2.053	59.97
2.0	798.	1396.	5.77	2500.	.023	1986.	3000.	.024	.55	.09	2.184	76.60
2.0	798.	1396.	5.77	3000.	.035	2520.	2520.	.000	.55	.07	1.978	62.81
2.0	798.	1396.	5.77	3000.	.035	2520.	2500.	.000	.55	.07	1.996	62.23
2.0	798.	1396.	5.77	3000.	.035	2520.	3000.	.012	.55	.07	2.108	79.10
3.0	1212.	1789.	3.48	2000.	.004	1437.	1437.	.000	.54	.06	-1.945	-7.67
3.0	1212.	1789.	3.48	2000.	.004	1437.	2500.	.022	.55	.06	3.133	29.99
3.0	1212.	1789.	3.48	2000.	.004	1437.	3000.	.034	.55	.06	2.921	46.95
3.0	1212.	1789.	3.48	2500.	.015	1975.	1975.	.000	.55	.04	3.928	13.57
3.0	1212.	1789.	3.48	2500.	.015	1975.	2500.	.012	.55	.04	2.946	32.21
3.0	1212.	1789.	3.48	2500.	.015	1975.	3000.	.024	.55	.04	2.789	49.53
3.0	1212.	1789.	3.48	3000.	.026	2510.	2510.	.000	.55	.03	2.844	33.48
3.0	1212.	1789.	3.48	3000.	.026	2510.	2500.	.000	.55	.03	2.869	33.19
3.0	1212.	1789.	3.48	3000.	.026	2510.	3000.	.012	.55	.03	2.721	50.60

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	494.	1111.	12.25	2000.	.018	1444.	1444.	.000	.54	.24	1.475	43.44
1.0	494.	1111.	12.25	2000.	.018	1444.	2500.	.024	.55	.24	2.025	73.99
1.0	494.	1111.	12.25	2000.	.018	1444.	3000.	.037	.55	.24	2.245	87.73
1.0	494.	1111.	12.25	2500.	.030	1986.	1986.	.000	.55	.16	1.590	67.37
1.0	494.	1111.	12.25	2500.	.030	1986.	2500.	.012	.55	.16	1.817	83.57
1.0	494.	1111.	12.25	2500.	.030	1986.	3000.	.026	.55	.16	2.014	98.86
1.0	494.	1111.	12.25	3000.	.043	2521.	2521.	.000	.55	.13	1.742	88.45
1.0	494.	1111.	12.25	3000.	.043	2521.	2500.	.000	.55	.13	1.753	87.86
1.0	494.	1111.	12.25	3000.	.043	2521.	3000.	.013	.55	.13	1.922	103.72
2.0	737.	1339.	6.46	2000.	.013	1446.	1446.	.000	.54	.11	2.071	23.35
2.0	737.	1339.	6.46	2000.	.013	1446.	2500.	.024	.55	.11	2.264	59.19
2.0	737.	1339.	6.46	2000.	.013	1446.	3000.	.037	.55	.11	2.401	75.49
2.0	737.	1339.	6.46	2500.	.025	1987.	1987.	.000	.55	.08	1.980	45.79
2.0	737.	1339.	6.46	2500.	.025	1987.	2500.	.012	.55	.08	2.123	63.74
2.0	737.	1339.	6.46	2500.	.025	1987.	3000.	.026	.55	.08	2.261	80.79
2.0	737.	1339.	6.46	3000.	.038	2522.	2522.	.000	.55	.06	2.060	66.49
2.0	737.	1339.	6.46	3000.	.038	2522.	2500.	.000	.55	.06	2.080	65.83
2.0	737.	1339.	6.46	3000.	.038	2522.	3000.	.013	.55	.06	2.195	83.06
3.0	1122.	1703.	3.79	2000.	.006	1438.	1438.	.000	.54	.05	-6.408	-3.46
3.0	1122.	1703.	3.79	2000.	.006	1438.	2500.	.023	.55	.05	3.068	34.72
3.0	1122.	1703.	3.79	2000.	.006	1438.	3000.	.036	.55	.05	2.939	52.04
3.0	1122.	1703.	3.79	2500.	.018	1978.	1978.	.000	.55	.03	3.527	17.95
3.0	1122.	1703.	3.79	2500.	.018	1978.	2500.	.012	.55	.03	2.925	36.81
3.0	1122.	1703.	3.79	2500.	.018	1978.	3000.	.025	.55	.03	2.830	54.47
3.0	1122.	1703.	3.79	3000.	.030	2513.	2513.	.000	.55	.03	2.842	38.15
3.0	1122.	1703.	3.79	3000.	.030	2513.	2500.	.000	.55	.03	2.873	37.75
3.0	1122.	1703.	3.79	3000.	.030	2513.	3000.	.013	.55	.03	2.771	55.47

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1087.	13.48	2000.	.018	1434.	1434.	.000	.54	.22	1.500	43.81
1.0	469.	1087.	13.48	2000.	.018	1434.	2500.	.024	.55	.22	2.016	74.70
1.0	469.	1087.	13.48	2000.	.018	1434.	3000.	.036	.55	.22	2.225	88.45
1.0	469.	1087.	13.48	2500.	.030	1977.	1977.	.000	.55	.15	1.615	67.37
1.0	469.	1087.	13.48	2500.	.030	1977.	2500.	.012	.55	.15	1.832	83.79
1.0	469.	1087.	13.48	2500.	.030	1977.	3000.	.025	.55	.15	2.018	99.01
1.0	469.	1087.	13.48	3000.	.043	2513.	2513.	.000	.55	.12	1.767	88.18
1.0	469.	1087.	13.48	3000.	.043	2513.	2500.	.000	.55	.12	1.774	87.82
1.0	469.	1087.	13.48	3000.	.043	2513.	3000.	.013	.55	.12	1.941	103.61
2.0	699.	1303.	6.97	2000.	.014	1442.	1442.	.000	.54	.11	2.058	24.71
2.0	699.	1303.	6.97	2000.	.014	1442.	2500.	.024	.55	.11	2.243	60.69
2.0	699.	1303.	6.97	2000.	.014	1442.	3000.	.037	.55	.11	2.378	76.99
2.0	699.	1303.	6.97	2500.	.026	1983.	1983.	.000	.55	.07	1.985	46.98
2.0	699.	1303.	6.97	2500.	.026	1983.	2500.	.012	.55	.07	2.121	65.02
2.0	699.	1303.	6.97	2500.	.026	1983.	3000.	.025	.55	.07	2.254	82.02
2.0	699.	1303.	6.97	3000.	.039	2519.	2519.	.000	.55	.06	2.067	67.55
2.0	699.	1303.	6.97	3000.	.039	2519.	2500.	.000	.55	.06	2.084	66.98
2.0	699.	1303.	6.97	3000.	.039	2519.	3000.	.013	.55	.06	2.197	84.18
3.0	1067.	1651.	4.01	2000.	.007	1436.	1436.	.000	.54	.05	-20.200	-1.29
3.0	1067.	1651.	4.01	2000.	.007	1436.	2500.	.023	.55	.05	2.987	36.93
3.0	1067.	1651.	4.01	2000.	.007	1436.	3000.	.036	.55	.05	2.887	54.22
3.0	1067.	1651.	4.01	2500.	.019	1977.	1977.	.000	.55	.03	3.356	20.06
3.0	1067.	1651.	4.01	2500.	.019	1977.	2500.	.012	.55	.03	2.868	38.94
3.0	1067.	1651.	4.01	2500.	.019	1977.	3000.	.025	.55	.03	2.794	56.57
3.0	1067.	1651.	4.01	3000.	.031	2512.	2512.	.000	.55	.03	2.800	40.22
3.0	1067.	1651.	4.01	3000.	.031	2512.	2500.	.000	.55	.03	2.826	39.85
3.0	1067.	1651.	4.01	3000.	.031	2512.	3000.	.013	.55	.03	2.744	57.54

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1087.	13.48	2000.	.019	1417.	1417.	.000	.54	.24	1.748	40.08
1.0	469.	1087.	13.48	2000.	.019	1417.	2500.	.025	.55	.24	2.268	70.25
1.0	469.	1087.	13.48	2000.	.019	1417.	3000.	.038	.56	.24	2.484	83.51
1.0	469.	1087.	13.48	2500.	.032	1963.	1963.	.000	.55	.15	1.826	63.69
1.0	469.	1087.	13.48	2500.	.032	1963.	2500.	.013	.55	.15	2.046	80.13
1.0	469.	1087.	13.48	2500.	.032	1963.	3000.	.027	.56	.15	2.235	95.02
1.0	469.	1087.	13.48	3000.	.046	2503.	2503.	.000	.55	.12	1.977	84.48
1.0	469.	1087.	13.48	3000.	.046	2503.	2500.	.000	.55	.12	1.978	84.42
1.0	469.	1087.	13.48	3000.	.046	2503.	3000.	.013	.56	.12	2.154	99.99
2.0	699.	1303.	6.97	2000.	.015	1434.	1434.	.000	.54	.11	2.351	23.04
2.0	699.	1303.	6.97	2000.	.015	1434.	2500.	.025	.55	.11	2.452	59.00
2.0	699.	1303.	6.97	2000.	.015	1434.	3000.	.039	.55	.11	2.583	75.28
2.0	699.	1303.	6.97	2500.	.028	1978.	1978.	.000	.55	.07	2.197	45.37
2.0	699.	1303.	6.97	2500.	.028	1978.	2500.	.013	.55	.07	2.318	63.55
2.0	699.	1303.	6.97	2500.	.028	1978.	3000.	.027	.55	.07	2.448	80.58
2.0	699.	1303.	6.97	3000.	.042	2516.	2516.	.000	.55	.06	2.265	66.06
2.0	699.	1303.	6.97	3000.	.042	2516.	2500.	.000	.55	.06	2.281	65.61
2.0	699.	1303.	6.97	3000.	.042	2516.	3000.	.013	.55	.06	2.391	82.87
3.0	1067.	1651.	4.01	2000.	.008	1431.	1431.	.000	.54	.05	-11.595	-2.39
3.0	1067.	1651.	4.01	2000.	.008	1431.	2500.	.025	.55	.05	3.261	35.98
3.0	1067.	1651.	4.01	2000.	.008	1431.	3000.	.039	.55	.05	3.122	53.38
3.0	1067.	1651.	4.01	2500.	.020	1973.	1973.	.000	.55	.03	3.779	19.03
3.0	1067.	1651.	4.01	2500.	.020	1973.	2500.	.013	.55	.03	3.133	38.09
3.0	1067.	1651.	4.01	2500.	.020	1973.	3000.	.027	.55	.03	3.023	55.84
3.0	1067.	1651.	4.01	3000.	.034	2511.	2511.	.000	.55	.03	3.066	39.36
3.0	1067.	1651.	4.01	3000.	.034	2511.	2500.	.000	.55	.03	3.091	39.04
3.0	1067.	1651.	4.01	3000.	.034	2511.	3000.	.013	.55	.03	2.974	56.88

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1087.	13.48	2000.	.019	1384.	1384.	.000	.54	.27	2.092	33.47
1.0	469.	1087.	13.48	2000.	.019	1384.	2500.	.024	.55	.27	2.535	61.77
1.0	469.	1087.	13.48	2000.	.019	1384.	3000.	.037	.55	.27	2.737	73.76
1.0	469.	1087.	13.48	2500.	.032	1933.	1933.	.000	.55	.17	2.043	56.91
1.0	469.	1087.	13.48	2500.	.032	1933.	2500.	.013	.55	.17	2.240	73.08
1.0	469.	1087.	13.48	2500.	.032	1933.	3000.	.026	.56	.17	2.409	86.90
1.0	469.	1087.	13.48	3000.	.046	2475.	2475.	.000	.55	.13	2.164	77.15
1.0	469.	1087.	13.48	3000.	.046	2475.	2500.	.001	.55	.13	2.172	77.89
1.0	469.	1087.	13.48	3000.	.046	2475.	3000.	.013	.56	.13	2.325	92.49
2.0	699.	1303.	6.97	2000.	.015	1419.	1419.	.000	.54	.12	2.706	20.02
2.0	699.	1303.	6.97	2000.	.015	1419.	2500.	.025	.55	.12	2.591	55.31
2.0	699.	1303.	6.97	2000.	.015	1419.	3000.	.038	.55	.12	2.699	71.02
2.0	699.	1303.	6.97	2500.	.028	1964.	1964.	.000	.55	.08	2.369	42.07
2.0	699.	1303.	6.97	2500.	.028	1964.	2500.	.013	.55	.08	2.446	60.19
2.0	699.	1303.	6.97	2500.	.028	1964.	3000.	.027	.55	.08	2.552	76.70
2.0	699.	1303.	6.97	3000.	.042	2503.	2503.	.000	.55	.06	2.397	62.42
2.0	699.	1303.	6.97	3000.	.042	2503.	2500.	.000	.55	.06	2.400	62.33
2.0	699.	1303.	6.97	3000.	.042	2503.	3000.	.013	.55	.06	2.501	79.17
3.0	1067.	1651.	4.01	2000.	.008	1421.	1421.	.000	.54	.05	-6.398	-4.33
3.0	1067.	1651.	4.01	2000.	.008	1421.	2500.	.025	.55	.05	3.460	33.66
3.0	1067.	1651.	4.01	2000.	.008	1421.	3000.	.038	.55	.05	3.250	50.70
3.0	1067.	1651.	4.01	2500.	.020	1964.	1964.	.000	.55	.03	4.266	16.86
3.0	1067.	1651.	4.01	2500.	.020	1964.	2500.	.013	.55	.03	3.323	35.90
3.0	1067.	1651.	4.01	2500.	.020	1964.	3000.	.027	.55	.03	3.147	53.31
3.0	1067.	1651.	4.01	3000.	.034	2502.	2502.	.000	.55	.03	3.266	36.94
3.0	1067.	1651.	4.01	3000.	.034	2502.	2500.	.000	.55	.03	3.272	36.88
3.0	1067.	1651.	4.01	3000.	.034	2502.	3000.	.013	.55	.03	3.105	54.43

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1087.	13.48	2000.	.021	1324.	1324.	.000	.54	.33	3.342	22.43
1.0	469.	1087.	13.48	2000.	.021	1324.	2500.	.025	.55	.33	3.446	47.42
1.0	469.	1087.	13.48	2000.	.021	1324.	3000.	.037	.56	.33	3.618	57.39
1.0	469.	1087.	13.48	2500.	.035	1881.	1881.	.000	.55	.19	2.700	46.26
1.0	469.	1087.	13.48	2500.	.035	1881.	2500.	.014	.55	.19	2.827	62.05
1.0	469.	1087.	13.48	2500.	.035	1881.	3000.	.026	.56	.19	2.960	74.40
1.0	469.	1087.	13.48	3000.	.050	2431.	2431.	.000	.55	.14	2.722	66.10
1.0	469.	1087.	13.48	3000.	.050	2431.	2500.	.002	.55	.14	2.735	67.97
1.0	469.	1087.	13.48	3000.	.050	2431.	3000.	.014	.56	.14	2.844	81.30
2.0	699.	1303.	6.97	2000.	.016	1395.	1395.	.000	.54	.13	3.787	15.31
2.0	699.	1303.	6.97	2000.	.016	1395.	2500.	.026	.55	.13	3.038	49.89
2.0	699.	1303.	6.97	2000.	.016	1395.	3000.	.040	.55	.13	3.101	65.00
2.0	699.	1303.	6.97	2500.	.030	1944.	1944.	.000	.55	.08	2.876	37.21
2.0	699.	1303.	6.97	2500.	.030	1944.	2500.	.014	.55	.08	2.850	55.41
2.0	699.	1303.	6.97	2500.	.030	1944.	3000.	.028	.56	.08	2.915	71.45
2.0	699.	1303.	6.97	3000.	.045	2487.	2487.	.000	.55	.06	2.807	57.40
2.0	699.	1303.	6.97	3000.	.045	2487.	2500.	.000	.55	.06	2.808	57.83
2.0	699.	1303.	6.97	3000.	.045	2487.	3000.	.014	.56	.06	2.868	74.28
3.0	1067.	1651.	4.01	2000.	.008	1405.	1405.	.000	.54	.05	-4.028	-7.36
3.0	1067.	1651.	4.01	2000.	.008	1405.	2500.	.026	.55	.05	4.058	30.43
3.0	1067.	1651.	4.01	2000.	.008	1405.	3000.	.040	.55	.05	3.689	47.24
3.0	1067.	1651.	4.01	2500.	.021	1951.	1951.	.000	.55	.04	5.631	13.71
3.0	1067.	1651.	4.01	2500.	.021	1951.	2500.	.014	.55	.04	3.887	32.92
3.0	1067.	1651.	4.01	2500.	.021	1951.	3000.	.028	.55	.04	3.569	50.15
3.0	1067.	1651.	4.01	3000.	.036	2492.	2492.	.000	.55	.03	3.848	33.76
3.0	1067.	1651.	4.01	3000.	.036	2492.	2500.	.000	.55	.03	3.840	34.03
3.0	1067.	1651.	4.01	3000.	.036	2492.	3000.	.014	.55	.03	3.536	51.45

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1087.	13.48	2000.	.021	1192.	1192.	.000	.54	.56	129.848	.58
1.0	469.	1087.	13.48	2000.	.021	1192.	2500.	.022	.55	.56	9.715	16.05
1.0	469.	1087.	13.48	2000.	.021	1192.	3000.	.033	.55	.56	9.052	21.26
1.0	469.	1087.	13.48	2500.	.035	1764.	1764.	.000	.55	.27	4.614	27.07
1.0	469.	1087.	13.48	2500.	.035	1764.	2500.	.014	.55	.27	4.224	41.35
1.0	469.	1087.	13.48	2500.	.035	1764.	3000.	.024	.56	.27	4.186	50.63
1.0	469.	1087.	13.48	3000.	.050	2327.	2327.	.000	.55	.18	3.890	46.25
1.0	469.	1087.	13.48	3000.	.050	2327.	2500.	.004	.55	.18	3.848	50.03
1.0	469.	1087.	13.48	3000.	.050	2327.	3000.	.014	.56	.18	3.797	60.69
2.0	699.	1303.	6.97	2000.	.016	1348.	1348.	.000	.54	.15	8.094	7.16
2.0	699.	1303.	6.97	2000.	.016	1348.	2500.	.025	.55	.15	3.717	39.76
2.0	699.	1303.	6.97	2000.	.016	1348.	3000.	.038	.55	.15	3.635	53.31
2.0	699.	1303.	6.97	2500.	.030	1902.	1902.	.000	.55	.09	3.754	28.51
2.0	699.	1303.	6.97	2500.	.030	1902.	2500.	.014	.55	.09	3.388	46.50
2.0	699.	1303.	6.97	2500.	.030	1902.	3000.	.027	.56	.09	3.336	61.15
2.0	699.	1303.	6.97	3000.	.045	2449.	2449.	.000	.55	.07	3.368	47.85
2.0	699.	1303.	6.97	3000.	.045	2449.	2500.	.001	.55	.07	3.354	49.42
2.0	699.	1303.	6.97	3000.	.045	2449.	3000.	.014	.56	.07	3.293	64.57
3.0	1067.	1651.	4.01	2000.	.008	1376.	1376.	.000	.54	.06	-2.378	-12.47
3.0	1067.	1651.	4.01	2000.	.008	1376.	2500.	.025	.55	.06	4.980	24.30
3.0	1067.	1651.	4.01	2000.	.008	1376.	3000.	.039	.55	.06	4.213	40.14
3.0	1067.	1651.	4.01	2500.	.021	1925.	1925.	.000	.55	.04	9.604	8.04
3.0	1067.	1651.	4.01	2500.	.021	1925.	2500.	.014	.55	.04	4.700	27.17
3.0	1067.	1651.	4.01	2500.	.021	1925.	3000.	.027	.55	.04	4.050	43.50
3.0	1067.	1651.	4.01	3000.	.036	2469.	2469.	.000	.55	.03	4.732	27.46
3.0	1067.	1651.	4.01	3000.	.036	2469.	2500.	.001	.55	.03	4.661	28.51
3.0	1067.	1651.	4.01	3000.	.036	2469.	3000.	.014	.55	.03	4.030	45.07

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	621.	1382.	11.92	2000.	.012	1299.	1299.	.000	.54	.40	1.784	23.94
1.0	621.	1382.	11.92	2000.	.012	1299.	2500.	.025	.55	.40	2.600	51.41
1.0	621.	1382.	11.92	2000.	.012	1299.	3000.	.038	.55	.40	2.878	61.92
1.0	621.	1382.	11.92	2500.	.023	1849.	1849.	.000	.55	.23	1.532	53.68
1.0	621.	1382.	11.92	2500.	.023	1849.	2500.	.015	.55	.23	1.863	72.45
1.0	621.	1382.	11.92	2500.	.023	1849.	3000.	.027	.55	.23	2.081	86.33
1.0	621.	1382.	11.92	3000.	.035	2394.	2394.	.000	.55	.17	1.627	77.01
1.0	621.	1382.	11.92	3000.	.035	2394.	2500.	.003	.55	.17	1.674	80.30
1.0	621.	1382.	11.92	3000.	.035	2394.	3000.	.015	.55	.17	1.876	95.43
2.0	919.	1659.	6.37	2000.	.007	1292.	1292.	.000	.54	.19	5.070	4.72
2.0	919.	1659.	6.37	2000.	.007	1292.	2500.	.025	.55	.19	2.717	41.98
2.0	919.	1659.	6.37	2000.	.007	1292.	3000.	.037	.55	.19	2.798	56.50
2.0	919.	1659.	6.37	2500.	.017	1842.	1842.	.000	.55	.11	2.076	30.18
2.0	919.	1659.	6.37	2500.	.017	1842.	2500.	.015	.55	.11	2.210	52.11
2.0	919.	1659.	6.37	2500.	.017	1842.	3000.	.027	.55	.11	2.334	68.25
2.0	919.	1659.	6.37	3000.	.029	2387.	2387.	.000	.55	.08	2.019	51.97
2.0	919.	1659.	6.37	3000.	.029	2387.	2500.	.003	.55	.08	2.051	55.84
2.0	919.	1659.	6.37	3000.	.029	2387.	3000.	.015	.55	.08	2.186	72.57
3.0	1390.	2101.	3.77	2000.	.029	2387.	3000.	.015	.55	.08	2.186	72.57
3.0	1390.	2101.	3.77	2000.	.029	2387.	3000.	.015	.55	.08	2.186	72.57
3.0	1390.	2101.	3.77	2000.	.029	2387.	3000.	.015	.55	.08	2.186	72.57
3.0	1390.	2101.	3.77	2500.	.008	1826.	1826.	.000	.54	.05	-58.578	-.52
3.0	1390.	2101.	3.77	2500.	.008	1826.	2500.	.014	.55	.05	3.565	23.08
3.0	1390.	2101.	3.77	2500.	.008	1826.	3000.	.026	.55	.05	3.124	40.08
3.0	1390.	2101.	3.77	3000.	.020	2370.	2370.	.000	.55	.04	3.533	20.17
3.0	1390.	2101.	3.77	3000.	.020	2370.	2500.	.003	.55	.04	3.312	24.74
3.0	1390.	2101.	3.77	3000.	.020	2370.	3000.	.015	.55	.04	2.972	42.00

PMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	579.	1343.	13.52	2000.	.013	1297.	1297.	.000	.54	.36	1.602	28.28
1.0	579.	1343.	13.52	2000.	.013	1297.	2500.	.025	.55	.36	2.355	57.83
1.0	579.	1343.	13.52	2000.	.013	1297.	3000.	.038	.55	.36	2.611	69.19
1.0	579.	1343.	13.52	2500.	.024	1848.	1848.	.000	.55	.21	1.486	57.14
1.0	579.	1343.	13.52	2500.	.024	1848.	2500.	.015	.55	.21	1.798	76.58
1.0	579.	1343.	13.52	2500.	.024	1848.	3000.	.027	.55	.21	2.004	90.93
1.0	579.	1343.	13.52	3000.	.036	2393.	2393.	.000	.55	.15	1.598	80.15
1.0	579.	1343.	13.52	3000.	.036	2393.	2500.	.003	.55	.15	1.643	83.55
1.0	579.	1343.	13.52	3000.	.036	2393.	3000.	.015	.55	.15	1.837	99.01
2.0	859.	1603.	7.03	2000.	.008	1293.	1293.	.000	.54	.18	3.293	8.44
2.0	859.	1603.	7.03	2000.	.008	1293.	2500.	.025	.55	.18	2.535	46.56
2.0	859.	1603.	7.03	2000.	.008	1293.	3000.	.037	.55	.18	2.639	61.44
2.0	859.	1603.	7.03	2500.	.019	1843.	1843.	.000	.55	.10	1.987	33.57
2.0	859.	1603.	7.03	2500.	.019	1843.	2500.	.015	.55	.10	2.139	55.76
2.0	859.	1603.	7.03	2500.	.019	1843.	3000.	.027	.55	.10	2.266	72.11
2.0	859.	1603.	7.03	3000.	.030	2387.	2387.	.000	.55	.07	1.975	55.26
2.0	859.	1603.	7.03	3000.	.030	2387.	2500.	.003	.55	.07	2.007	59.14
2.0	859.	1603.	7.03	3000.	.030	2387.	3000.	.015	.55	.07	2.142	76.03
3.0	1302.	2018.	4.06	2000.	.030	2387.	3000.	.015	.55	.07	2.142	76.03
3.0	1302.	2018.	4.06	2000.	.030	2387.	3000.	.015	.55	.07	2.142	76.03
3.0	1302.	2018.	4.06	2000.	.030	2387.	3000.	.015	.55	.07	2.142	76.03
3.0	1302.	2018.	4.06	2500.	.010	1828.	1828.	.000	.54	.05	10.075	3.62
3.0	1302.	2018.	4.06	2500.	.010	1828.	2500.	.014	.55	.05	3.246	27.29
3.0	1302.	2018.	4.06	2500.	.010	1828.	3000.	.026	.55	05	2.966	44.40
3.0	1302.	2018.	4.06	3000.	.022	2373.	2373.	.000	.55	.03	3.195	24.33
3.0	1302.	2018.	4.06	3000.	.022	2373.	2500.	.003	.55	.03	3.060	28.83
3.0	1302.	2018.	4.06	3000.	.022	2373.	3000.	.015	.55	.03	2.843	46.19

ALTITUDE 20000.0 PRSL = 16. STRAIGHT JET (BPR = 0.0, FPRSL = 1.0)

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	537.	1304.	15.56	2000.	.013	1293.	1293.	.000	.54	.32	1.484	32.27
1.0	537.	1304.	15.56	2000.	.013	1293.	2500.	.025	.55	.32	2.174	63.76
1.0	537.	1304.	15.56	2000.	.013	1293.	3000.	.037	.55	.32	2.409	75.88
1.0	537.	1304.	15.56	2500.	.024	1845.	1845.	.000	.55	.18	1.454	60.25
1.0	537.	1304.	15.56	2500.	.024	1845.	2500.	.015	.55	.18	1.747	80.34
1.0	537.	1304.	15.56	2500.	.024	1845.	3000.	.027	.55	.18	1.942	95.11
1.0	537.	1304.	15.56	3000.	.036	2390.	2390.	.000	.55	.13	1.578	82.93
1.0	537.	1304.	15.56	3000.	.036	2390.	2500.	.003	.55	.13	1.622	86.48
1.0	537.	1304.	15.56	3000.	.036	2390.	3000.	.015	.55	.13	1.806	102.23
2.0	798.	1546.	7.87	2000.	.009	1293.	1293.	.000	.54	.16	2.611	12.12
2.0	798.	1546.	7.87	2000.	.009	1293.	2500.	.025	.55	.16	2.388	51.07
2.0	798.	1546.	7.87	2000.	.009	1293.	3000.	.037	.55	.16	2.506	66.28
2.0	798.	1546.	7.87	2500.	.020	1843.	1843.	.000	.55	.09	1.916	36.90
2.0	798.	1546.	7.87	2500.	.020	1843.	2500.	.015	.55	.09	2.077	59.36
2.0	798.	1546.	7.87	2500.	.020	1843.	3000.	.027	.55	.09	2.207	75.89
2.0	798.	1546.	7.87	3000.	.031	2388.	2388.	.000	.55	.07	1.937	58.49
2.0	798.	1546.	7.87	3000.	.031	2388.	2500.	.003	.55	.07	1.969	62.40
2.0	798.	1546.	7.87	3000.	.031	2388.	3000.	.015	.55	.07	2.103	79.4[illegible]
3.0	1212.	1933.	4.42	2000.	.001	1280.	1280.	.000	.54	.08	-.315	-15.02
3.0	1212.	1933.	4.42	2000.	.001	1280.	2500.	.025	.55	.08	3.395	27.59
3.0	1212.	1933.	4.42	2000.	.001	1280.	3000.	.037	.55	.08	3.098	44.16
3.0	1212.	1933.	4.42	2500.	.012	1830.	1830.	.000	.54	.04	5.464	7.81
3.0	1212.	1933.	4.42	2500.	.012	1830.	2500.	.015	.55	.04	3.007	31.56
3.0	1212.	1933.	4.42	2500.	.012	1830.	3000.	.027	.55	.04	2.832	48.77
3.0	1212.	1933.	4.42	3000.	.023	2375.	2375.	.000	.55	.03	2.951	28.53
3.0	1212.	1933.	4.42	3000.	.023	2375.	2500.	.003	.55	.03	2.867	32.99
3.0	1212.	1933.	4.42	3000.	.023	2375.	3000.	.015	.55	.03	2.733	50.42

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	494.	1265.	18.22	2000.	.015	1289.	1289.	.000	.54	.28	1.492	35.8
1.0	494.	1265.	18.22	2000.	.015	1289.	2500.	.027	.55	.28	2.160	69.4
1.0	494.	1265.	18.22	2000.	.015	1289.	3000.	.040	.55	.28	2.391	82.4
1.0	494.	1265.	18.22	2500.	.027	1843.	1843.	.000	.55	.16	1.520	63.2
1.0	494.	1265.	18.22	2500.	.027	1843.	2500.	.016	.55	.16	1.811	84.0
1.0	494.	1265.	18.22	2500.	.027	1843.	3000.	.029	.55	.16	2.006	99.4
1.0	494.	1265.	18.22	3000.	.040	2390.	2390.	.000	.55	.11	1.661	85.8
1.0	494.	1265.	18.22	3000.	.040	2390.	2500.	.003	.55	.11	1.706	89.4
1.0	494.	1265.	18.22	3000.	.040	2390.	3000.	.016	.55	.11	1.891	105.7
2.0	737.	1489.	8.93	2000.	.010	1292.	1292.	.000	.54	.14	2.384	15.8
2.0	737.	1489.	8.93	2000.	.010	1292.	2500.	.027	.55	.14	2.396	55.8
2.0	737.	1489.	8.93	2000.	.010	1292.	3000.	.040	.55	.14	2.529	71.6
2.0	737.	1489.	8.93	2500.	.022	1844.	1844.	.000	.55	.08	1.967	40.4
2.0	737.	1489.	8.93	2500.	.022	1844.	2500.	.016	.55	.08	2.141	63.3
2.0	737.	1489.	8.93	2500.	.022	1844.	3000.	.029	.55	.08	2.278	80.3
2.0	737.	1489.	8.93	3000.	.035	2391.	2391.	.000	.55	.06	2.016	62.1
2.0	737.	1489.	8.93	3000.	.035	2391.	2500.	.003	.55	.06	2.048	66.0
2.0	737.	1489.	8.93	3000.	.035	2391.	3000.	.016	.55	.06	2.189	83.4
3.0	1122.	1849.	4.86	2000.	.003	1282.	1282.	.000	.54	.07	-1.064	-10.6
3.0	1122.	1849.	4.86	2000.	.003	1282.	2500.	.026	.55	.07	3.260	32.5
3.0	1122.	1849.	4.86	2000.	.003	1282.	3000.	.039	.55	.07	3.079	49.5
3.0	1122.	1849.	4.86	2500.	.014	1833.	1833.	.000	.54	.04	4.256	12.2
3.0	1122.	1849.	4.86	2500.	.014	1833.	2500.	.015	.55	.04	2.970	36.2
3.0	1122.	1849.	4.86	2500.	.014	1833.	3000.	.028	.55	.04	2.864	53.8
3.0	1122.	1849.	4.86	3000.	.027	2379.	2379.	.000	.55	.03	2.912	33.2
3.0	1122.	1849.	4.86	3000.	.027	2379.	2500.	.003	.55	.03	2.859	37.5
3.0	1122.	1849.	4.86	3000.	.027	2379.	3000.	.016	.55	.03	2.780	55.3

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1241.	20.26	2000.	.015	1276.	1276.	.000	.54	.26	1.522	36.26
1.0	469.	1241.	20.26	2000.	.015	1276.	2500.	.027	.55	.26	2.144	70.28
1.0	469.	1241.	20.26	2000.	.015	1276.	3000.	.039	.55	.26	2.363	83.32
1.0	469.	1241.	20.26	2500.	.027	1831.	1831.	.000	.55	.14	1.550	63.10
1.0	469.	1241.	20.26	2500.	.027	1831.	2500.	.016	.55	.14	1.827	84.27
1.0	469.	1241.	20.26	2500.	.027	1831.	3000.	.028	.55	.14	2.012	99.57
1.0	469.	1241.	20.26	3000.	.040	2379.	2379.	.000	.55	.10	1.691	85.38
1.0	469.	1241.	20.26	3000.	.040	2379.	2500.	.003	.55	.10	1.736	89.35
1.0	469.	1241.	20.26	3000.	.040	2379.	3000.	.016	.55	.10	1.911	105.48
2.0	699.	1454.	9.73	2000.	.011	1287.	1287.	.000	.54	.13	2.325	17.28
2.0	699.	1454.	9.73	2000.	.011	1287.	2500.	.027	.55	.13	2.361	57.65
2.0	699.	1454.	9.73	2000.	.011	1287.	3000.	.040	.55	.13	2.491	73.46
2.0	699.	1454.	9.73	2500.	.023	1840.	1840.	.000	.55	.07	1.972	41.64
2.0	699.	1454.	9.73	2500.	.023	1840.	2500.	.016	.55	.07	2.136	64.69
2.0	699.	1454.	9.73	2500.	.023	1840.	3000.	.029	.55	.07	2.268	81.64
2.0	699.	1454.	9.73	3000.	.036	2386.	2386.	.000	.55	.05	2.025	63.23
2.0	699.	1454.	9.73	3000.	.036	2386.	2500.	.003	.55	.05	2.056	67.25
2.0	699.	1454.	9.73	3000.	.036	2386.	3000.	.016	.55	.05	2.190	84.62
3.0	1067.	1797.	5.19	2000.	.004	1279.	1279.	.000	.54	.07	-1.803	-8.44
3.0	1067.	1797.	5.19	2000.	.004	1279.	2500.	.026	.55	.07	3.150	34.93
3.0	1067.	1797.	5.19	2000.	.004	1279.	3000.	.039	.55	.07	3.010	51.91
3.0	1067.	1797.	5.19	2500.	.016	1831.	1831.	.000	.55	.04	3.900	14.37
3.0	1067.	1797.	5.19	2500.	.016	1831.	2500.	.015	.55	.04	2.906	38.46
3.0	1067.	1797.	5.19	2500.	.016	1831.	3000.	.028	.55	.04	2.823	56.01
3.0	1067.	1797.	5.19	3000.	.028	2377.	2377.	.000	.55	.03	2.858	35.29
3.0	1067.	1797.	5.19	3000.	.028	2377.	2500.	.003	.55	.03	2.813	39.72
3.0	1067.	1797.	5.19	3000.	.028	2377.	3000.	.016	.55	.03	2.751	57.47

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1241.	20.26	2000.	.016	1254.	1254.	.000	.54	.28	1.842	31.9
1.0	469.	1241.	20.26	2000.	.016	1254.	2500.	.028	.55	.28	2.463	64.6
1.0	469.	1241.	20.26	2000.	.016	1254.	3000.	.041	.56	.28	2.693	77.0
1.0	469.	1241.	20.26	2500.	.029	1813.	1813.	.000	.55	.15	1.766	59.1
1.0	469.	1241.	20.26	2500.	.029	1813.	2500.	.017	.55	.15	2.047	80.3
1.0	469.	1241.	20.26	2500.	.029	1813.	3000.	.030	.56	.15	2.234	95.2
1.0	469.	1241.	20.26	3000.	.043	2365.	2365.	.000	.55	.11	1.898	81.5
1.0	469.	1241.	20.26	3000.	.043	2365.	2500.	.003	.55	.11	1.948	85.8
1.0	469.	1241.	20.26	3000.	.043	2365.	3000.	.017	.56	.11	2.122	101.7
2.0	699.	1454.	9.73	2000.	.012	1277.	1277.	.000	.54	.14	2.774	15.4
2.0	699.	1454.	9.73	2000.	.012	1277.	2500.	.028	.55	.14	2.597	55.6
2.0	699.	1454.	9.73	2000.	.012	1277.	3000.	.042	.55	.14	2.722	71.4
2.0	699.	1454.	9.73	2500.	.024	1832.	1832.	.000	.55	.08	2.197	39.9
2.0	699.	1454.	9.73	2500.	.024	1832.	2500.	.017	.55	.08	2.338	63.1
2.0	699.	1454.	9.73	2500.	.024	1832.	3000.	.031	.55	.08	2.466	80.1
2.0	699.	1454.	9.73	3000.	.038	2382.	2382.	.000	.55	.05	2.225	61.6
2.0	699.	1454.	9.73	3000.	.038	2382.	2500.	.003	.55	.05	2.255	65.8
2.0	699.	1454.	9.73	3000.	.038	2382.	3000.	.017	.55	.05	2.384	83.2
3.0	1067.	1797.	5.19	2000.	.005	1272.	1272.	.000	.54	.07	-1.682	-9.6
3.0	1067.	1797.	5.19	2000.	.005	1272.	2500.	.028	.55	.07	3.454	33.8
3.0	1067.	1797.	5.19	2000.	.005	1272.	3000.	.042	.55	.07	3.265	50.9
3.0	1067.	1797.	5.19	2500.	.017	1826.	1826.	.000	.55	.04	4.511	13.2
3.0	1067.	1797.	5.19	2500.	.017	1826.	2500.	.017	.55	.04	3.178	37.5
3.0	1067.	1797.	5.19	2500.	.017	1826.	3000.	.030	.55	.04	3.056	55.2
3.0	1067.	1797.	5.19	3000.	.030	2375.	2375.	.000	.55	.03	3.145	34.3
3.0	1067.	1797.	5.19	3000.	.030	2375.	2500.	.003	.55	.03	3.082	38.9
3.0	1067.	1797.	5.19	3000.	.030	2375.	3000.	.017	.55	.03	2.982	56.7

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1241.	20.26	2000.	.016	1211.	1211.	.000	.54	.34	2.442	24.08
1.0	469.	1241.	20.26	2000.	.016	1211.	2500.	.027	.55	.34	2.911	53.78
1.0	469.	1241.	20.26	2000.	.016	1211.	3000.	.040	.55	.34	3.131	64.47
1.0	469.	1241.	20.26	2500.	.029	1774.	1774.	.000	.55	.17	2.010	51.99
1.0	469.	1241.	20.26	2500.	.029	1774.	2500.	.017	.55	.17	2.258	72.68
1.0	469.	1241.	20.26	2500.	.029	1774.	3000.	.029	.56	.17	2.426	86.43
1.0	469.	1241.	20.26	3000.	.043	2330.	2330.	.000	.55	.12	2.092	73.95
1.0	469.	1241.	20.26	3000.	.043	2330.	2500.	.004	.55	.12	2.145	79.10
1.0	469.	1241.	20.26	3000.	.043	2330.	3000.	.017	.56	.12	2.295	93.90
2.0	699.	1454.	9.73	2000.	.012	1257.	1257.	.000	.54	.15	3.526	12.14
2.0	699.	1454.	9.73	2000.	.012	1257.	2500.	.028	.55	.15	2.781	51.50
2.0	699.	1454.	9.73	2000.	.012	1257.	3000.	.041	.55	.15	2.877	66.58
2.0	699.	1454.	9.73	2500.	.024	1815.	1815.	.000	.55	.08	2.402	36.54
2.0	699.	1454.	9.73	2500.	.024	1815.	2500.	.017	.55	.08	2.472	59.65
2.0	699.	1454.	9.73	2500.	.024	1815.	3000.	.030	.55	.08	2.577	76.08
2.0	699.	1454.	9.73	3000.	.038	2366.	2366.	.000	.55	.06	2.367	57.97
2.0	699.	1454.	9.73	3000.	.038	2366.	2500.	.003	.55	.06	2.392	62.59
2.0	699.	1454.	9.73	3000.	.038	2366.	3000.	.017	.55	.06	2. 95	79.50
3.0	1067.	1797.	5.19	2000.	.005	1259.	1259.	.000	.54	.07	-1.388	-11.68
3.0	1067.	1797.	5.19	2000.	.005	1259.	2500.	.028	.55	.07	3.699	31.39
3.0	1067.	1797.	5.19	2000.	.005	1259.	3000.	.041	.55	.07	3.421	48.06
3.0	1067.	1797.	5.19	2500.	.017	1815.	1815.	.000	.55	.04	5.411	11.07
3.0	1067.	1797.	5.19	2500.	.017	1815.	2500.	.017	.55	.04	3.376	35.34
3.0	1067.	1797.	5.19	2500.	.017	1815.	3000.	.030	.55	.04	3.187	52.66
3.0	1067.	1797.	5.19	3000.	.030	2364.	2364.	.000	.55	.03	3.385	31.93
3.0	1067.	1797.	5.19	3000.	.030	2364.	2500.	.003	.55	.03	3.281	36.77
3.0	1067.	1797.	5.19	3000.	.030	2364.	3000.	.017	.55	.03	3.116	54.33

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1241.	20.26	2000.	.017	1133.	1133.	.000	.54	.47	6.369	9.88
1.0	469.	1241.	20.26	2000.	.017	1133.	2500.	.028	.55	.47	4.958	32.93
1.0	469.	1241.	20.26	2000.	.017	1133.	3000.	.040	.56	.47	5.116	40.55
1.0	469.	1241.	20.26	2500.	.031	1707.	1707.	.000	.55	.21	2.776	40.43
1.0	469.	1241.	20.26	2500.	.031	1707.	2500.	.018	.55	.21	2.912	60.32
1.0	469.	1241.	20.26	2500.	.031	1707.	3000.	.030	.56	.21	3.045	72.40
1.0	469.	1241.	20.26	3000.	.046	2272.	2272.	.000	.55	.13	2.670	62.41
1.0	469.	1241.	20.26	3000.	.046	2272.	2500.	.005	.55	.13	2.712	68.68
1.0	469.	1241.	20.26	3000.	.046	2272.	3000.	.018	.56	.13	2.820	82.12
2.0	699.	1454.	9.73	2000.	.013	1225.	1225.	.000	.54	.17	6.667	6.87
2.0	699.	1454.	9.73	2000.	.013	1225.	2500.	.029	.55	.17	3.359	45.07
2.0	699.	1454.	9.73	2000.	.013	1225.	3000.	.043	.55	.17	3.390	59.39
2.0	699.	1454.	9.73	2500.	.026	1788.	1788.	.000	.55	.09	2.995	31.46
2.0	699.	1454.	9.73	2500.	.026	1788.	2500.	.018	.55	.09	2.894	54.64
2.0	699.	1454.	9.73	2500.	.026	1788.	3000.	.032	.56	.09	2.955	70.54
2.0	699.	1454.	9.73	3000.	.041	2344.	2344.	.000	.55	.06	2.799	52.80
2.0	699.	1454.	9.73	3000.	.041	2344.	2500.	.004	.55	.06	2.806	58.02
2.0	699.	1454.	9.73	3000.	.041	2344.	3000.	.018	.56	.06	2.865	74.49
3.0	1067.	1797.	5.19	2000.	.005	1238.	1238.	.000	.54	.08	-1.162	-14.94
3.0	1067.	1797.	5.19	2000.	.005	1238.	2500.	.029	.55	.08	4.420	27.85
3.0	1067.	1797.	5.19	2000.	.005	1238.	3000.	.043	.55	.08	3.931	44.22
3.0	1067.	1797.	5.19	2500.	.018	1798.	1798.	.000	.55	.04	8.239	7.80
3.0	1067.	1797.	5.19	2500.	.018	1798.	2500.	.018	.55	.04	3.964	32.28
3.0	1067.	1797.	5.19	2500.	.018	1798.	3000.	.032	.55	.04	3.623	49.40
3.0	1067.	1797.	5.19	3000.	.032	2351.	2351.	.000	.55	.03	4.062	28.66
3.0	1067.	1797.	5.19	3000.	.032	2351.	2500.	.004	.55	.03	3.860	33.90
3.0	1067.	1797.	5.19	3000.	.032	2351.	3000.	.018	.55	.03	3.550	51.30

FMN	T1	T2	PR21	T3	FAMB	T5	T6	FAAB	PR76	PR06	SFC	TST
1.0	469.	1241.	20.26	2000.	.017	961.	961.	.000	.55	1.11	3.550	51.30
1.0	469.	1241.	20.26	2000.	.017	961.	2500.	.026	.55	1.11	3.550	51.30
1.0	469.	1241.	20.26	2000.	.017	961.	3000.	.036	.55	1.11	3.550	51.30
1.0	469.	1241.	20.26	2500.	.031	1554.	1554.	.000	.54	.34	6.079	18.46
1.0	469.	1241.	20.26	2500.	.031	1554.	2500.	.017	.55	.34	4.981	35.07
1.0	469.	1241.	20.26	2500.	.031	1554.	3000.	.028	.56	.34	4.889	43.34
1.0	469.	1241.	20.26	3000.	.046	2137.	2137.	.000	.55	.19	4.026	41.39
1.0	469.	1241.	20.26	3000.	.046	2137.	2500.	.007	.55	.19	3.909	49.29
1.0	469.	1241.	20.26	3000.	.046	2137.	3000.	.018	.56	.19	3.854	59.84
2.0	699.	1454.	9.73	2000.	.013	1164.	1164.	.000	.54	.22	-18.428	-2.49
2.0	699.	1454.	9.73	2000.	.013	1164.	2500.	.028	.55	.22	4.527	32.58
2.0	699.	1454.	9.73	2000.	.013	1164.	3000.	.041	.55	.22	4.303	44.96
2.0	699.	1454.	9.73	2500.	.026	1733.	1733.	.000	.55	.10	4.209	22.38
2.0	699.	1454.	9.73	2500.	.026	1733.	2500.	.018	.55	.10	3.489	45.19
2.0	699.	1454.	9.73	2500.	.026	1733.	3000.	.031	.56	.10	3.423	59.63
2.0	699.	1454.	9.73	3000.	.041	2295.	2295.	.000	.55	.07	3.432	43.05
2.0	699.	1454.	9.73	3000.	.041	2295.	2500.	.005	.55	.07	3.362	49.38
2.0	699.	1454.	9.73	3000.	.041	2295.	3000.	.018	.56	.07	3.299	64.52
3.0	1067.	1797.	5.19	2000.	.005	1200.	1200.	.000	.54	.09	-.850	-20.40
3.0	1067.	1797.	5.19	2000.	.005	1200.	2500.	.029	.55	.09	5.717	21.08
3.0	1067.	1797.	5.19	2000.	.005	1200.	3000.	.042	.55	.09	4.633	36.40
3.0	1067.	1797.	5.19	2500.	.018	1763.	1763.	.000	.54	.05	31.976	2.01
3.0	1067.	1797.	5.19	2500.	.018	1763.	2500.	.018	.55	.05	4.839	26.38
3.0	1067.	1797.	5.19	2500.	.018	1763.	3000.	.031	.55	.05	4.136	42.58
3.0	1067.	1797.	5.19	3000.	.032	2320.	2320.	.000	.55	.03	5.222	22.29
3.0	1067.	1797.	5.19	3000.	.032	2320.	2500.	.005	.55	.03	4.697	28.32
3.0	1067.	1797.	5.19	3000.	.032	2320.	3000.	.018	.55	.03	4.053	44.84

1.0	.018	1.30	1.0	1603.	.000	17.26	2500.	.036	22.18	2.406	39.45
1.0	.018	1.30	1.0	1603.	.000	17.26	3000.	.048	26.86	2.570	44.13
1.0	.018	1.30	1.0	2500.	.020	27.95	2000.	.024	17.28	2.488	45.24
1.0	.018	1.30	1.0	2500.	.020	27.95	2500.	.036	22.18	2.675	50.14
1.0	.018	1.30	1.0	2500.	.020	27.95	3000.	.048	26.86	2.839	54.82
1.0	.018	1.30	1.0	3000.	.032	33.57	2000.	.024	17.28	2.617	50.85
1.0	.018	1.30	1.0	3000.	.032	33.57	2500.	.036	22.18	2.804	55.75
1.0	.018	1.30	1.0	3000.	.032	33.57	3000.	.048	26.86	2.968	60.43
1.0	.018	1.30	1.5	1583.	.000	12.87	2000.	.024	20.74	2.338	33.61
1.0	.018	1.30	1.5	1583.	.000	12.87	2500.	.036	26.62	2.562	39.49
1.0	.018	1.30	1.5	1583.	.000	12.87	3000.	.048	32.24	2.750	45.11
1.0	.018	1.30	1.5	2500.	.020	21.32	2000.	.024	20.74	2.557	42.06
1.0	.018	1.30	1.5	2500.	.020	21.32	2500.	.036	26.62	2.781	47.94
1.0	.018	1.30	1.5	2500.	.020	21.32	3000.	.048	32.24	2.978	53.56
1.0	.018	1.30	1.5	3000.	.032	25.65	2000.	.024	20.74	2.662	46.39
1.0	.018	1.30	1.5	3000.	.032	25.65	2500.	.036	26.62	2.886	52.27
1.0	.018	1.30	1.5	3000.	.032	25.65	3000.	.048	32.24	3.082	57.89
1.0	.018	1.30	2.0	1563.	.000	9.91	2000.	.024	23.04	2.428	32.96
1.0	.018	1.30	2.0	1563.	.000	9.91	2500.	.036	29.58	2.676	39.49
1.0	.018	1.30	2.0	1563.	.000	9.91	3000.	.048	35.82	2.895	45.73
1.0	.018	1.30	2.0	2500.	.020	16.84	2000.	.024	23.04	2.612	39.88
1.0	.018	1.30	2.0	2500.	.020	16.84	2500.	.036	29.58	2.860	46.41
1.0	.018	1.30	2.0	2500.	.020	16.84	3000.	.048	35.82	3.079	52.65
1.0	.018	1.30	2.0	3000.	.033	20.29	2000.	.024	23.04	2.700	43.34
1.0	.018	1.30	2.0	3000.	.033	20.29	2500.	.036	29.58	2.949	49.87
1.0	.018	1.30	2.0	3000.	.033	20.29	3000.	.048	35.82	3.168	56.11
1.0	.018	1.50	1.0	1580.	.000	15.91	2000.	.024	20.03	2.107	35.94
1.0	.018	1.50	1.0	1580.	.000	15.91	2500.	.035	25.46	2.283	41.37
1.0	.018	1.50	1.0	1580.	.000	15.91	3000.	.048	30.66	2.436	46.57
1.0	.018	1.50	1.0	2500.	.020	26.44	2000.	.024	20.03	2.381	46.47
1.0	.018	1.50	1.0	2500.	.020	26.44	2500.	.035	25.46	2.558	51.90
1.0	.018	1.50	1.0	2500.	.020	26.44	3000.	.048	30.66	2.711	57.11
1.0	.018	1.50	1.0	3000.	.033	31.82	2000.	.024	20.03	2.512	51.85
1.0	.018	1.50	1.0	3000.	.033	31.82	2500.	.035	25.46	2.689	57.28
1.0	.018	1.50	1.0	3000.	.033	31.82	3000.	.048	30.66	2.842	62.48
1.0	.018	1.50	1.5	1548.	.000	11.15	2000.	.024	24.04	2.232	35.18
1.0	.018	1.50	1.5	1548.	.000	11.15	2500.	.035	30.55	2.445	41.70
1.0	.018	1.50	1.5	1548.	.000	11.15	3000.	.048	36.79	2.628	47.94
1.0	.018	1.50	1.5	2500.	.021	19.32	2000.	.024	24.04	2.453	43.36
1.0	.018	1.50	1.5	2500.	.021	19.32	2500.	.035	30.55	2.666	49.88
1.0	.018	1.50	1.5	2500.	.021	19.32	3000.	.048	36.79	2.849	56.12
1.0	.018	1.50	1.5	3000.	.033	23.33	2000.	.024	24.04	2.561	47.37
1.0	.018	1.50	1.5	3000.	.033	23.33	2500.	.035	30.55	2.773	53.88
1.0	.018	1.50	1.5	3000.	.033	23.33	3000.	.048	36.79	2.957	60.13
1.0	.018	1.50	2.0	1516.	.000	7.87	2000.	.024	26.71	2.361	34.57
1.0	.018	1.50	2.0	1516.	.000	7.87	2500.	.035	33.94	2.597	41.81
1.0	.018	1.50	2.0	1516.	.000	7.87	3000.	.048	40.88	2.800	48.75
1.0	.018	1.50	2.0	2500.	.021	14.38	2000.	.024	26.71	2.537	41.09
1.0	.018	1.50	2.0	2500.	.021	14.38	2500.	.035	33.94	2.773	48.33
1.0	.018	1.50	2.0	2500.	.021	14.38	3000.	.048	40.88	2.977	55.27
1.0	.018	1.50	2.0	3000.	.034	17.45	2000.	.024	26.71	2.630	44.16

1.0	.018	1.70	1.0	1558.	.000	14.61	2500.	.035	28.02	2.247	42.63
1.0	.018	1.70	1.0	1558.	.000	14.61	3000.	.047	33.63	2.392	48.24
1.0	.018	1.70	1.0	2500.	.021	24.95	2000.	.024	22.18	2.354	47.13
1.0	.018	1.70	1.0	2500.	.021	24.95	2500.	.035	28.02	2.524	52.97
1.0	.018	1.70	1.0	2500.	.021	24.95	3000.	.047	33.63	2.669	58.59
1.0	.018	1.70	1.0	3000.	.033	30.09	2000.	.024	22.18	2.488	52.27
1.0	.018	1.70	1.0	3000.	.033	30.09	2500.	.035	28.02	2.657	58.11
1.0	.018	1.70	1.0	3000.	.033	30.09	3000.	.047	33.63	2.802	63.72
1.0	.018	1.70	1.5	1516.	.000	9.44	2000.	.024	26.62	2.258	36.06
1.0	.018	1.70	1.5	1516.	.000	9.44	2500.	.035	33.63	2.461	43.07
1.0	.018	1.70	1.5	1516.	.000	9.44	3000.	.047	40.36	2.635	49.80
1.0	.018	1.70	1.5	2500.	.021	17.26	2000.	.024	26.62	2.470	43.88
1.0	.018	1.70	1.5	2500.	.021	17.26	2500.	.035	33.63	2.673	50.89
1.0	.018	1.70	1.5	2500.	.021	17.26	3000.	.047	40.36	2.847	57.62
1.0	.018	1.70	1.5	3000.	.034	20.94	2000.	.024	26.62	2.581	47.56
1.0	.018	1.70	1.5	3000.	.034	20.94	2500.	.035	33.63	2.784	54.57
1.0	.018	1.70	1.5	3000.	.034	20.94	3000.	.047	40.36	2.958	61.30
1.0	.018	1.70	2.0	1474.	.000	5.78	2000.	.024	29.58	2.534	35.36
1.0	.018	1.70	2.0	1474.	.000	5.78	2500.	.035	37.36	2.760	43.15
1.0	.018	1.70	2.0	1474.	.000	5.78	3000.	.047	44.85	2.953	50.63
1.0	.018	1.70	2.0	2500.	.022	11.73	2000.	.024	29.58	2.656	41.31
1.0	.018	1.70	2.0	2500.	.022	11.73	2500.	.035	37.36	2.882	49.10
1.0	.018	1.70	2.0	2500.	.022	11.73	3000.	.047	44.85	3.075	56.58
1.0	.018	1.70	2.0	3000.	.035	14.38	2000.	.024	29.58	2.750	43.95
1.0	.018	1.70	2.0	3000.	.035	14.38	2500.	.035	37.36	2.976	51.74
1.0	.018	1.70	2.0	3000.	.035	14.38	3000.	.047	44.85	3.169	59.22
2.0	.013	1.30	1.0	1599.	.000	9.51	2000.	.019	17.09	2.259	26.60
2.0	.013	1.30	1.0	1599.	.000	9.51	2500.	.031	25.26	2.331	34.76
2.0	.013	1.30	1.0	1599.	.000	9.51	3000.	.043	33.19	2.403	42.70
2.0	.013	1.30	1.0	2500.	.019	24.08	2000.	.019	17.09	2.235	41.17
2.0	.013	1.30	1.0	2500.	.019	24.08	2500.	.031	25.26	2.308	49.34
2.0	.013	1.30	1.0	2500.	.019	24.08	3000.	.043	33.19	2.380	57.27
2.0	.013	1.30	1.0	3000.	.032	31.84	2000.	.019	17.09	2.286	48.93
2.0	.013	1.30	1.0	3000.	.032	31.84	2500.	.031	25.26	2.359	57.09
2.0	.013	1.30	1.0	3000.	.032	31.84	3000.	.043	33.19	2.430	65.03
2.0	.013	1.30	1.5	1579.	.000	7.06	2000.	.019	20.51	2.291	27.57
2.0	.013	1.30	1.5	1579.	.000	7.06	2500.	.031	30.31	2.378	37.37
2.0	.013	1.30	1.5	1579.	.000	7.06	3000.	.043	39.83	2.464	46.89
2.0	.013	1.30	1.5	2500.	.020	18.88	2000.	.019	20.51	2.229	39.39
2.0	.013	1.30	1.5	2500.	.020	18.88	2500.	.031	30.31	2.316	49.19
2.0	.013	1.30	1.5	2500.	.020	18.88	3000.	.043	39.83	2.402	58.71
2.0	.013	1.30	1.5	3000.	.032	25.03	2000.	.019	20.51	2.265	45.53
2.0	.013	1.30	1.5	3000.	.032	25.03	2500.	.031	30.31	2.352	55.33
2.0	.013	1.30	1.5	3000.	.032	25.03	3000.	.043	39.83	2.438	64.85
2.0	.013	1.30	2.0	1559.	.000	5.41	2000.	.019	22.79	2.326	28.20
2.0	.013	1.30	2.0	1559.	.000	5.41	2500.	.031	33.68	2.423	39.09
2.0	.013	1.30	2.0	1559.	.000	5.41	3000.	.043	44.25	2.518	49.67
2.0	.013	1.30	2.0	2500.	.020	15.39	2000.	.019	22.79	2.227	38.18
2.0	.013	1.30	2.0	2500.	.020	15.39	2500.	.031	33.68	2.324	49.07
2.0	.013	1.30	2.0	2500.	.020	15.39	3000.	.043	44.25	2.419	59.64
2.0	.013	1.30	2.0	3000.	.033	20.45	2000.	.019	22.79	2.253	43.24

2.0	.013	1.50	1.0	1576.	.000	8.72	2500.	.030	25.84	2.403	34.56
2.0	.013	1.50	1.0	1576.	.000	8.72	3000.	.042	33.87	2.479	42.58
2.0	.013	1.50	1.0	2500.	.020	23.53	2000.	.019	17.58	2.231	41.11
2.0	.013	1.50	1.0	2500.	.020	23.53	2500.	.030	25.84	2.315	49.37
2.0	.013	1.50	1.0	2500.	.020	23.53	3000.	.042	33.87	2.391	57.39
2.0	.013	1.50	1.0	3000.	.032	31.19	2000.	.019	17.58	2.276	48.77
2.0	.013	1.50	1.0	3000.	.032	31.19	2500.	.030	25.84	2.359	57.03
2.0	.013	1.50	1.0	3000.	.032	31.19	3000.	.042	33.87	2.435	65.06
2.0	.013	1.50	1.5	1544.	.000	6.07	2000.	.019	21.10	2.403	27.17
2.0	.013	1.50	1.5	1544.	.000	6.07	2500.	.030	31.01	2.503	37.08
2.0	.013	1.50	1.5	1544.	.000	6.07	3000.	.042	40.64	2.595	46.71
2.0	.013	1.50	1.5	2500.	.021	18.14	2000.	.019	21.10	2.231	39.24
2.0	.013	1.50	1.5	2500.	.021	18.14	2500.	.030	31.01	2.331	49.15
2.0	.013	1.50	1.5	2500.	.021	18.14	3000.	.042	40.64	2.423	58.78
2.0	.013	1.50	1.5	3000.	.033	24.16	2000.	.019	21.10	2.258	45.26
2.0	.013	1.50	1.5	3000.	.033	24.16	2500.	.030	31.01	2.358	55.17
2.0	.013	1.50	1.5	3000.	.033	24.16	3000.	.042	40.64	2.450	64.80
2.0	.013	1.50	2.0	1512.	.000	4.26	2000.	.019	23.44	2.519	27.71
2.0	.013	1.50	2.0	1512.	.000	4.26	2500.	.030	34.45	2.630	38.72
2.0	.013	1.50	2.0	1512.	.000	4.26	3000.	.042	45.15	2.731	49.42
2.0	.013	1.50	2.0	2500.	.021	14.47	2000.	.019	23.44	2.240	37.91
2.0	.013	1.50	2.0	2500.	.021	14.47	2500.	.030	34.45	2.351	48.93
2.0	.013	1.50	2.0	2500.	.021	14.47	3000.	.042	45.15	2.453	59.63
2.0	.013	1.50	2.0	3000.	.034	19.39	2000.	.019	23.44	2.254	42.83
2.0	.013	1.50	2.0	3000.	.034	19.39	2500.	.030	34.45	2.365	53.84
2.0	.013	1.50	2.0	3000.	.034	19.39	3000.	.042	45.15	2.466	64.54
2.0	.013	1.70	1.0	1555.	.000	7.97	2000.	.019	17.98	2.404	25.96
2.0	.013	1.70	1.0	1555.	.000	7.97	2500.	.030	26.31	2.495	34.29
2.0	.013	1.70	1.0	1555.	.000	7.97	3000.	.042	34.41	2.576	42.39
2.0	.013	1.70	1.0	2500.	.020	22.97	2000.	.019	17.98	2.237	40.95
2.0	.013	1.70	1.0	2500.	.020	22.97	2500.	.030	26.31	2.329	49.29
2.0	.013	1.70	1.0	2500.	.020	22.97	3000.	.042	34.41	2.409	57.39
2.0	.013	1.70	1.0	3060.	.033	30.55	2000.	.019	17.98	2.275	48.53
2.0	.013	1.70	1.0	3000.	.033	30.55	2500.	.030	26.31	2.366	56.86
2.0	.013	1.70	1.0	3000.	.033	30.55	3000.	.042	34.41	2.447	64.96
2.0	.013	1.70	1.5	1512.	.000	5.12	2000.	.019	21.58	2.585	26.70
2.0	.013	1.70	1.5	1512.	.000	5.12	2500.	.030	31.58	2.695	36.70
2.0	.013	1.70	1.5	1512.	.000	5.12	3000.	.042	41.30	2.791	46.41
2.0	.013	1.70	1.5	2500.	.021	17.37	2000.	.019	21.58	2.251	38.95
2.0	.013	1.70	1.5	2500.	.021	17.37	2500.	.030	31.58	2.360	48.94
2.0	.013	1.70	1.5	2500.	.021	17.37	3000.	.042	41.30	2.457	58.66
2.0	.013	1.70	1.5	3000.	.034	23.27	2000.	.019	21.58	2.267	44.85
2.0	.013	1.70	1.5	3000.	.034	23.27	2500.	.030	31.58	2.377	54.85
2.0	.013	1.70	1.5	3000.	.034	23.27	3000.	.042	41.30	2.473	64.57
2.0	.013	1.70	2.0	1469.	.000	3.13	2000.	.019	23.98	2.910	27.10
2.0	.013	1.70	2.0	1469.	.000	3.13	2500.	.030	35.09	3.033	38.21
2.0	.013	1.70	2.0	1469.	.000	3.13	3000.	.042	45.88	3.139	49.01
2.0	.013	1.70	2.0	2500.	.022	13.47	2000.	.019	23.98	2.281	37.45
2.0	.013	1.70	2.0	2500.	.022	13.47	2500.	.030	35.09	2.403	48.56
2.0	.013	1.70	2.0	2500.	.022	13.47	3000.	.042	45.88	2.510	59.36
2.0	.013	1.70	2.0	3000.	.034	18.23	2000.	.019	23.98	2.279	42.21

3.0	.005	1.30	1.0	1590.	.000	-4.60	2000.	.011	3.69	1.778	-.90
3.0	.005	1.30	1.0	1590.	.000	-4.60	2500.	.022	12.56	.682	7.96
3.0	.005	1.30	1.0	1590.	.000	-4.60	3000.	.034	21.22	.549	16.62
3.0	.005	1.30	1.0	2500.	.019	11.40	2000.	.011	3.69	4.519	15.10
3.0	.005	1.30	1.0	2500.	.019	11.40	2500.	.022	12.56	3.424	23.96
3.0	.005	1.30	1.0	2500.	.019	11.40	3000.	.034	21.22	3.291	32.62
3.0	.005	1.30	1.0	3000.	.031	19.88	2000.	.011	3.69	4.267	23.58
3.0	.005	1.30	1.0	3000.	.031	19.88	2500.	.022	12.56	3.173	32.44
3.0	.005	1.30	1.0	3000.	.031	19.88	3000.	.034	21.22	3.039	41.10
3.0	.005	1.30	1.5	1570.	.000	-4.06	2000.	.011	4.43	2.552	-.37
3.0	.005	1.30	1.5	1570.	.000	-4.06	2500.	.022	15.07	1.239	11.01
3.0	.005	1.30	1.5	1570.	.000	-4.06	3000.	.034	25.46	1.079	21.40
3.0	.005	1.30	1.5	2500.	.019	9.01	2000.	.011	4.43	4.725	13.44
3.0	.005	1.30	1.5	2500.	.019	9.01	2500.	.022	15.07	3.412	24.08
3.0	.005	1.30	1.5	2500.	.019	9.01	3000.	.034	25.46	3.252	34.47
3.0	.005	1.30	1.5	3000.	.031	15.77	2000.	.011	4.43	4.504	20.20
3.0	.005	1.30	1.5	3000.	.031	15.77	2500.	.022	15.07	3.191	30.84
3.0	.005	1.30	1.5	3000.	.031	15.77	3000.	.034	25.46	3.031	41.23
3.0	.005	1.30	2.0	1549.	.000	-3.71	2000.	.011	4.93	3.061	1.21
3.0	.005	1.30	2.0	1549.	.000	-3.71	2500.	.022	16.75	1.602	13.03
3.0	.005	1.30	2.0	1549.	.000	-3.71	3000.	.034	28.29	1.424	24.57
3.0	.005	1.30	2.0	2500.	.020	7.40	2000.	.011	4.93	4.865	12.32
3.0	.005	1.30	2.0	2500.	.020	7.40	2500.	.022	16.75	3.406	24.15
3.0	.005	1.30	2.0	2500.	.020	7.40	3000.	.034	28.29	3.228	35.69
3.0	.005	1.30	2.0	3000.	.032	13.02	2000.	.011	4.93	4.664	17.95
3.0	.005	1.30	2.0	3000.	.032	13.02	2500.	.022	16.75	3.205	29.77
3.0	.005	1.30	2.0	3000.	.032	13.02	3000.	.034	28.29	3.027	41.31
3.0	.005	1.50	1.0	1566.	.000	-5.16	2000.	.010	3.75	1.725	-1.41
3.0	.005	1.50	1.0	1566.	.000	-5.16	2500.	.021	12.62	.737	7.47
3.0	.005	1.50	1.0	1566.	.000	-5.16	3000.	.033	21.29	.619	16.13
3.0	.005	1.50	1.0	2500.	.020	11.23	2000.	.010	3.75	4.438	14.98
3.0	.005	1.50	1.0	2500.	.020	11.23	2500.	.021	12.62	3.450	23.86
3.0	.005	1.50	1.0	2500.	.020	11.23	3000.	.033	21.29	3.332	32.52
3.0	.005	1.50	1.0	3000.	.031	19.69	2000.	.010	3.75	4.158	23.43
3.0	.005	1.50	1.0	3000.	.031	19.69	2500.	.021	12.62	3.170	32.31
3.0	.005	1.50	1.0	3000.	.031	19.69	3000.	.033	21.29	3.053	40.97
3.0	.005	1.50	1.5	1534.	.000	-4.75	2000.	.010	4.50	2.469	-.25
3.0	.005	1.50	1.5	1534.	.000	-4.75	2500.	.021	15.15	1.283	10.39
3.0	.005	1.50	1.5	1534.	.000	-4.75	3000.	.033	25.54	1.142	20.79
3.0	.005	1.50	1.5	2500.	.020	8.78	2000.	.010	4.50	4.636	13.27
3.0	.005	1.50	1.5	2500.	.020	8.78	2500.	.021	15.15	3.449	23.92
3.0	.005	1.50	1.5	2500.	.020	8.78	3000.	.033	25.54	3.309	34.32
3.0	.005	1.50	1.5	3000.	.032	15.50	2000.	.010	4.50	4.378	20.00
3.0	.005	1.50	1.5	3000.	.032	15.50	2500.	.021	15.15	3.192	30.65
3.0	.005	1.50	1.5	3000.	.032	15.50	3000.	.033	25.54	3.051	41.05
3.0	.005	1.50	2.0	1501.	.000	-4.50	2000.	.010	5.00	2.950	-.50
3.0	.005	1.50	2.0	1501.	.000	-4.50	2500.	.021	16.83	1.632	12.33
3.0	.005	1.50	2.0	1501.	.000	-4.50	3000.	.033	28.38	1.475	23.88
3.0	.005	1.50	2.0	2500.	.021	7.11	2000.	.010	5.00	4.7[illegible]	12.10
3.0	.005	1.50	2.0	2500.	.021	7.11	2500.	.021	16.83	3.45[illegible]	23.94
3.0	.005	1.50	2.0	2500.	.021	7.11	3000.	.033	28.38	3.302	35.49
3.0	.005	1.50	2.0	3000.	.033	12.68	2000.	.010	5.00	4.529	17.68
3.0	.005	1.50	2.0	3000.	.033	12.68	2500.	.021	16.83	3.211	29.[illegible]
3.0	.005	1.50	2.0	3000.	.033	12.68	3000.	.033	28.38	3.078	41.[illegible]

3.0	.005	1.70	1.0	1545.	.000	-5.67	2000.	.010	3.79	1.671	-1.88
3.0	.005	1.70	1.0	1545.	.000	-5.67	2500.	.021	12.67	.772	7.00
3.0	.005	1.70	1.0	1545.	.000	-5.67	3000.	.033	21.34	.669	15.67
3.0	.005	1.70	1.0	2500.	.020	11.06	2000.	.010	3.79	4.377	14.85
3.0	.005	1.70	1.0	2500.	.020	11.06	2500.	.021	12.67	3.478	23.73
3.0	.005	1.70	1.0	2500.	.020	11.06	3000.	.033	21.34	3.375	32.40
3.0	.005	1.70	1.0	3000.	.032	19.49	2000.	.010	3.79	4.070	23.28
3.0	.005	1.70	1.0	3000.	.032	19.49	2500.	.021	12.67	3.171	32.16
3.0	.005	1.70	1.0	3000.	.032	19.49	3000.	.033	21.34	3.068	40.83
3.0	.005	1.70	1.5	1501.	.000	-5.40	2000.	.010	4.55	2.383	-.85
3.0	.005	1.70	1.5	1501.	.000	-5.40	2500.	.021	15.20	1.305	9.80
3.0	.005	1.70	1.5	1501.	.000	-5.40	3000.	.033	25.61	1.180	20.21
3.0	.005	1.70	1.5	2500.	.021	8.53	2000.	.010	4.55	4.575	13.08
3.0	.005	1.70	1.5	2500.	.021	8.53	2500.	.021	15.20	3.497	23.73
3.0	.005	1.70	1.5	2500.	.021	8.53	3000.	.033	25.61	3.372	34.14
3.0	.005	1.70	1.5	3000.	.033	15.22	2000.	.010	4.55	4.278	19.77
3.0	.005	1.70	1.5	3000.	.033	15.22	2500.	.021	15.20	3.199	30.42
3.0	.005	1.70	1.5	3000.	.033	15.22	3000.	.033	25.61	3.075	40.83
3.0	.005	1.70	2.0	1457.	.000	-5.26	2000.	.010	5.05	2.839	-.20
3.0	.005	1.70	2.0	1457.	.000	-5.26	2500.	.021	16.89	1.641	11.64
3.0	.005	1.70	2.0	1457.	.000	-5.26	3000.	.033	28.45	1.503	23.20
3.0	.005	1.70	2.0	2500.	.022	6.78	2000.	.010	5.05	4.728	11.83
3.0	.005	1.70	2.0	2500.	.022	6.78	2500.	.021	16.89	3.530	23.67
3.0	.005	1.70	2.0	2500.	.022	6.78	3000.	.033	28.45	3.392	35.23
3.0	.005	1.70	2.0	3000.	.034	12.30	2000.	.010	5.05	4.426	17.36
3.0	.005	1.70	2.0	3000.	.034	12.30	2500.	.021	16.89	3.228	29.20
3.0	.005	1.70	2.0	3000.	.034	12.30	3000.	.033	28.45	3.090	40.76

1.0	.019	1.30	1.0	1602.	.000	19.07	2500.	.037	23.28	2.303	42.34
1.0	.019	1.30	1.0	1602.	.000	19.07	3000.	.049	28.04	2.469	47.11
1.0	.019	1.30	1.0	2500.	.020	30.28	2000.	.025	18.30	2.379	48.57
1.0	.019	1.30	1.0	2500.	.020	30.28	2500.	.037	23.28	2.561	53.56
1.0	.019	1.30	1.0	2500.	.020	30.28	3000.	.049	28.04	2.722	58.32
1.0	.019	1.30	1.0	3000.	.032	36.18	2000.	.025	18.30	2.500	54.47
1.0	.019	1.30	1.0	3000.	.032	36.18	2500.	.037	23.28	2.682	59.45
1.0	.019	1.30	1.0	3000.	.032	36.18	3000.	.049	28.04	2.843	64.21
1.0	.019	1.30	1.5	1582.	.000	14.37	2000.	.025	21.96	2.238	36.33
1.0	.019	1.30	1.5	1582.	.000	14.37	2500.	.037	27.93	2.456	42.30
1.0	.019	1.30	1.5	1582.	.000	14.37	3000.	.049	33.65	2.649	48.02
1.0	.019	1.30	1.5	2500.	.020	23.27	2000.	.025	21.96	2.444	45.23
1.0	.019	1.30	1.5	2500.	.020	23.27	2500.	.037	27.93	2.662	51.20
1.0	.019	1.30	1.5	2500.	.020	23.27	3000.	.049	33.65	2.855	56.92
1.0	.019	1.30	1.5	3000.	.032	27.84	2000.	.025	21.96	2.542	49.79
1.0	.019	1.30	1.5	3000.	.032	27.84	2500.	.037	27.93	2.761	55.77
1.0	.019	1.30	1.5	3000.	.032	27.84	3000.	.049	33.65	2.954	61.48
1.0	.019	1.30	2.0	1562.	.000	11.20	2000.	.025	24.40	2.319	35.60
1.0	.019	1.30	2.0	1562.	.000	11.20	2500.	.037	31.04	2.562	42.24
1.0	.019	1.30	2.0	1562.	.000	11.20	3000.	.049	37.39	2.777	48.59
1.0	.019	1.30	2.0	2500.	.020	18.54	2000.	.025	24.40	2.493	42.93
1.0	.019	1.30	2.0	2500.	.020	18.54	2500.	.037	31.04	2.736	49.57
1.0	.019	1.30	2.0	2500.	.020	18.54	3000.	.049	37.39	2.951	55.92
1.0	.019	1.30	2.0	3000.	.033	22.21	2000.	.025	24.40	2.577	46.60
1.0	.019	1.30	2.0	3000.	.033	22.21	2500.	.037	31.04	2.820	53.24
1.0	.019	1.30	2.0	3000.	.033	22.21	3000.	.049	37.39	3.034	59.59
1.0	.019	1.50	1.0	1579.	.000	17.79	2000.	.025	21.18	2.004	38.96
1.0	.019	1.50	1.0	1579.	.000	17.79	2500.	.036	26.71	2.176	44.49
1.0	.019	1.50	1.0	1579.	.000	17.79	3000.	.049	32.02	2.324	49.80
1.0	.019	1.50	1.0	2500.	.020	28.89	2000.	.025	21.18	2.263	50.07
1.0	.019	1.50	1.0	2500.	.020	28.89	2500.	.036	26.71	2.434	55.60
1.0	.019	1.50	1.0	2500.	.020	28.89	3000.	.049	32.02	2.583	60.91
1.0	.019	1.50	1.0	3000.	.033	34.57	2000.	.025	21.18	2.386	55.75
1.0	.019	1.50	1.0	3000.	.033	34.57	2500.	.036	26.71	2.557	61.28
1.0	.019	1.50	1.0	3000.	.033	34.57	3000.	.049	32.02	2.706	66.59
1.0	.019	1.50	1.5	1547.	.000	12.74	2000.	.025	25.41	2.112	38.15
1.0	.019	1.50	1.5	1547.	.000	12.74	2500.	.036	32.05	2.317	44.79
1.0	.019	1.50	1.5	1547.	.000	12.74	3000.	.049	38.42	2.496	51.16
1.0	.019	1.50	1.5	2500.	.021	21.44	2000.	.025	25.41	2.323	46.85
1.0	.019	1.50	1.5	2500.	.021	21.44	2500.	.036	32.05	2.528	53.49
1.0	.019	1.50	1.5	2500.	.021	21.44	3000.	.049	38.42	2.707	59.86
1.0	.019	1.50	1.5	3000.	.033	25.71	2000.	.025	25.41	2.424	51.12
1.0	.019	1.50	1.5	3000.	.033	25.71	2500.	.036	32.05	2.629	57.76
1.0	.019	1.50	1.5	3000.	.033	25.71	3000.	.049	38.42	2.808	64.14
1.0	.019	1.50	2.0	1515.	.000	9.28	2000.	.025	28.23	2.212	37.51
1.0	.019	1.50	2.0	1515.	.000	9.28	2500.	.036	35.61	2.440	44.89
1.0	.019	1.50	2.0	1515.	.000	9.28	3000.	.049	42.69	2.638	51.97
1.0	.019	1.50	2.0	2500.	.021	16.29	2000.	.025	28.23	2.387	44.52
1.0	.019	1.50	2.0	2500.	.021	16.29	2500.	.036	35.61	2.615	51.90
1.0	.019	1.50	2.0	2500.	.021	16.29	3000.	.049	42.69	2.813	58.98

1.0	.019	1.70	1.0	1557.	.000	16.56	2500.	.036	29.37	2.124	45.93
1.0	.019	1.70	1.0	1557.	.000	16.56	3000.	.048	35.10	2.264	51.66
1.0	.019	1.70	1.0	2500.	.021	27.53	2000.	.024	23.41	2.223	50.93
1.0	.019	1.70	1.0	2500.	.021	27.53	2500.	.036	29.37	2.386	56.90
1.0	.019	1.70	1.0	2500.	.021	27.53	3000.	.048	35.10	2.526	62.63
1.0	.019	1.70	1.0	3000.	.033	32.99	2000.	.024	23.41	2.348	56.39
1.0	.019	1.70	1.0	3000.	.033	32.99	2500.	.036	29.37	2.511	62.36
1.0	.019	1.70	1.0	3000.	.033	32.99	3000.	.048	35.10	2.652	68.09
1.0	.019	1.70	1.5	1515.	.000	11.14	2000.	.024	28.09	2.097	39.22
1.0	.019	1.70	1.5	1515.	.000	11.14	2500.	.036	35.24	2.293	46.38
1.0	.019	1.70	1.5	1515.	.000	11.14	3000.	.048	42.12	2.462	53.26
1.0	.019	1.70	1.5	2500.	.021	19.55	2000.	.024	28.09	2.307	47.64
1.0	.019	1.70	1.5	2500.	.021	19.55	2500.	.036	35.24	2.503	54.79
1.0	.019	1.70	1.5	2500.	.021	19.55	3000.	.048	42.12	2.672	61.67
1.0	.019	1.70	1.5	3000.	.034	23.52	2000.	.024	28.09	2.411	51.61
1.0	.019	1.70	1.5	3000.	.034	23.52	2500.	.036	35.24	2.607	58.76
1.0	.019	1.70	1.5	3000.	.034	23.52	3000.	.048	42.12	2.776	65.64
1.0	.019	1.70	2.0	1472.	.000	7.32	2000.	.024	31.21	2.277	38.53
1.0	.019	1.70	2.0	1472.	.000	7.32	2500.	.036	39.16	2.494	46.48
1.0	.019	1.70	2.0	1472.	.000	7.32	3000.	.048	46.80	2.682	54.12
1.0	.019	1.70	2.0	2500.	.022	13.86	2000.	.024	31.21	2.433	45.06
1.0	.019	1.70	2.0	2500.	.022	13.86	2500.	.036	39.16	2.651	53.01
1.0	.019	1.70	2.0	2500.	.022	13.86	3000.	.048	46.80	2.838	60.66
1.0	.019	1.70	2.0	3000.	.035	16.78	2000.	.024	31.21	2.523	47.99
1.0	.019	1.70	2.0	3000.	.035	16.78	2500.	.036	39.16	2.741	55.94
1.0	.019	1.70	2.0	3000.	.035	16.78	3000.	.048	46.80	2.928	63.58
2.0	.014	1.30	1.0	1600.	.000	11.09	2000.	.020	18.44	2.144	29.52
2.0	.014	1.30	1.0	1600.	.000	11.09	2500.	.032	26.64	2.221	37.73
2.0	.014	1.30	1.0	1600.	.000	11.09	3000.	.044	34.61	2.294	45.69
2.0	.014	1.30	1.0	2500.	.019	25.83	2000.	.020	18.44	2.167	44.27
2.0	.014	1.30	1.0	2500.	.019	25.83	2500.	.032	26.64	2.244	52.47
2.0	.014	1.30	1.0	2500.	.019	25.83	3000.	.044	34.61	2.317	60.44
2.0	.014	1.30	1.0	3000.	.032	33.68	2000.	.020	18.44	2.223	52.11
2.0	.014	1.30	1.0	3000.	.032	33.68	2500.	.032	26.64	2.299	60.32
2.0	.014	1.30	1.0	3000.	.032	33.68	3000.	.044	34.61	2.372	68.28
2.0	.014	1.30	1.5	1579.	.000	8.34	2000.	.020	22.13	2.172	30.47
2.0	.014	1.30	1.5	1579.	.000	8.34	2500.	.032	31.97	2.264	40.31
2.0	.014	1.30	1.5	1579.	.000	8.34	3000.	.044	41.53	2.352	49.87
2.0	.014	1.30	1.5	2500.	.020	20.31	2000.	.020	22.13	2.160	42.43
2.0	.014	1.30	1.5	2500.	.020	20.31	2500.	.032	31.97	2.252	52.28
2.0	.014	1.30	1.5	2500.	.020	20.31	3000.	.044	41.53	2.340	61.83
2.0	.014	1.30	1.5	3000.	.032	26.53	2000.	.020	22.13	2.201	48.65
2.0	.014	1.30	1.5	3000.	.032	26.53	2500.	.032	31.97	2.293	58.50
2.0	.014	1.30	1.5	3000.	.032	26.53	3000.	.044	41.53	2.381	68.06
2.0	.014	1.30	2.0	1559.	.000	6.50	2000.	.020	24.58	2.199	31.08
2.0	.014	1.30	2.0	1559.	.000	6.50	2500.	.032	35.52	2.301	42.02
2.0	.014	1.30	2.0	1559.	.000	6.50	3000.	.044	46.14	2.398	52.64
2.0	.014	1.30	2.0	2500.	.020	16.60	2000.	.020	24.58	2.156	41.18
2.0	.014	1.30	2.0	2500.	.020	16.60	2500.	.032	35.52	2.260	52.12
2.0	.014	1.30	2.0	2500.	.020	16.60	3000.	.044	46.14	2.357	62.74
2.0	.014	1.30	2.0	3000.	.033	21.73	2000.	.020	24.58	2.193	51.68

2.0	.014	1.50	1.0	1576.	.000	10.32	2500.	.031	27.26	2.267	37.58
2.0	.014	1.50	1.0	1576.	.000	10.32	3000.	.044	35.32	2.344	45.64
2.0	.014	1.50	1.0	2500.	.020	25.31	2000.	.020	18.96	2.160	44.27
2.0	.014	1.50	1.0	2500.	.020	25.31	2500.	.031	27.26	2.245	52.57
2.0	.014	1.50	1.0	2500.	.020	25.31	3000.	.044	35.32	2.323	60.63
2.0	.014	1.50	1.0	3000.	.032	33.08	2000.	.020	18.96	2.210	52.03
2.0	.014	1.50	1.0	3000.	.032	33.08	2500.	.031	27.26	2.296	60.33
2.0	.014	1.50	1.0	3000.	.032	33.08	3000.	.044	35.32	2.373	68.40
2.0	.014	1.50	1.5	1544.	.000	7.38	2000.	.020	22.75	2.241	30.13
2.0	.014	1.50	1.5	1544.	.000	7.38	2500.	.031	32.71	2.343	40.09
2.0	.014	1.50	1.5	1544.	.000	7.38	3000.	.044	42.39	2.436	49.77
2.0	.014	1.50	1.5	2500.	.021	19.62	2000.	.020	22.75	2.158	42.37
2.0	.014	1.50	1.5	2500.	.021	19.62	2500.	.031	32.71	2.260	52.33
2.0	.014	1.50	1.5	2500.	.021	19.62	3000.	.044	42.39	2.353	62.00
2.0	.014	1.50	1.5	3000.	.033	25.73	2000.	.020	22.75	2.191	48.48
2.0	.014	1.50	1.5	3000.	.033	25.73	2500.	.031	32.71	2.294	58.44
2.0	.014	1.50	1.5	3000.	.033	25.73	3000.	.044	42.39	2.386	68.11
2.0	.014	1.50	2.0	1512.	.000	5.38	2000.	.020	25.28	2.315	30.66
2.0	.014	1.50	2.0	1512.	.000	5.38	2500.	.031	36.34	2.429	41.73
2.0	.014	1.50	2.0	1512.	.000	5.38	3000.	.044	47.10	2.532	52.48
2.0	.014	1.50	2.0	2500.	.021	15.75	2000.	.020	25.28	2.163	41.02
2.0	.014	1.50	2.0	2500.	.021	15.75	2500.	.031	36.34	2.277	52.09
2.0	.014	1.50	2.0	2500.	.021	15.75	3000.	.044	47.10	2.380	62.84
2.0	.014	1.50	2.0	3000.	.034	20.74	2000.	.020	25.28	2.185	46.02
2.0	.014	1.50	2.0	3000.	.034	20.74	2500.	.031	36.34	2.298	57.09
2.0	.014	1.50	2.0	3000.	.034	20.74	3000.	.044	47.10	2.401	67.84
2.0	.014	1.70	1.0	1555.	.000	9.60	2000.	.020	19.38	2.235	28.98
2.0	.014	1.70	1.0	1555.	.000	9.60	2500.	.031	27.76	2.327	37.36
2.0	.014	1.70	1.0	1555.	.000	9.60	3000.	.043	35.90	2.408	45.50
2.0	.014	1.70	1.0	2500.	.020	24.80	2000.	.020	19.38	2.162	44.17
2.0	.014	1.70	1.0	2500.	.020	24.80	2500.	.031	27.76	2.254	52.55
2.0	.014	1.70	1.0	2500.	.020	24.80	3000.	.043	35.90	2.335	60.69
2.0	.014	1.70	1.0	3000.	.033	32.48	2000.	.020	19.38	2.207	51.86
2.0	.014	1.70	1.0	3000.	.033	32.48	2500.	.031	27.76	2.299	60.24
2.0	.014	1.70	1.0	3000.	.033	32.48	3000.	.043	35.90	2.380	68.38
2.0	.014	1.70	1.5	1512.	.000	6.46	2000.	.020	23.25	2.352	29.71
2.0	.014	1.70	1.5	1512.	.000	6.46	2500.	.031	33.31	2.462	39.77
2.0	.014	1.70	1.5	1512.	.000	6.46	3000.	.043	43.08	2.559	49.54
2.0	.014	1.70	1.5	2500.	.021	18.90	2000.	.020	23.25	2.170	42.15
2.0	.014	1.70	1.5	2500.	.021	18.90	2500.	.031	33.31	2.280	52.20
2.0	.014	1.70	1.5	2500.	.021	18.90	3000.	.043	43.08	2.377	61.98
2.0	.014	1.70	1.5	3000.	.034	24.89	2000.	.020	23.25	2.195	48.15
2.0	.014	1.70	1.5	3000.	.034	24.89	2500.	.031	33.31	2.306	58.20
2.0	.014	1.70	1.5	3000.	.034	24.89	3000.	.043	43.08	2.403	67.97
2.0	.014	1.70	2.0	1469.	.000	4.28	2000.	.020	25.84	2.533	30.12
2.0	.014	1.70	2.0	1469.	.000	4.28	2500.	.031	37.01	2.656	41.29
2.0	.014	1.70	2.0	1469.	.000	4.28	3000.	.043	47.87	2.763	52.15
2.0	.014	1.70	2.0	2500.	.022	14.81	2000.	.020	25.84	2.191	40.65
2.0	.014	1.70	2.0	2500.	.022	14.81	2500.	.031	37.01	2.314	51.82
2.0	.014	1.70	2.0	2500.	.022	14.81	3000.	.043	47.87	2.422	62.68
2.0	.014	1.70	2.0	3000.	.035	18.66	2000.	.020	25.84	2.220	51.58

3.0	.006	1.30	1.0	1591.	.000	-2.63	2500.	.024	14.55	-.651	11.92
3.0	.006	1.30	1.0	1591.	.000	-2.63	3000.	.036	23.24	-.732	20.61
3.0	.006	1.30	1.0	2500.	.019	13.43	2000.	.013	5.64	3.696	19.07
3.0	.006	1.30	1.0	2500.	.019	13.43	2500.	.024	14.55	3.150	27.98
3.0	.006	1.30	1.0	2500.	.019	13.43	3000.	.036	23.24	3.069	36.67
3.0	.006	1.30	1.0	3000.	.031	21.96	2000.	.013	5.64	3.530	27.60
3.0	.006	1.30	1.0	3000.	.031	21.96	2500.	.024	14.55	2.984	36.50
3.0	.006	1.30	1.0	3000.	.031	21.96	3000.	.036	23.24	2.904	45.20
3.0	.006	1.30	1.5	1571.	.000	-2.49	2000.	.013	6.77	.976	4.28
3.0	.006	1.30	1.5	1571.	.000	-2.49	2500.	.024	17.46	.321	14.97
3.0	.006	1.30	1.5	1571.	.000	-2.49	3000.	.036	27.89	.224	25.40
3.0	.006	1.30	1.5	2500.	.020	10.64	2000.	.013	6.77	3.794	17.41
3.0	.006	1.30	1.5	2500.	.020	10.64	2500.	.024	17.46	3.139	28.10
3.0	.006	1.30	1.5	2500.	.020	10.64	3000.	.036	27.89	3.042	38.52
3.0	.006	1.30	1.5	3000.	.032	17.44	2000.	.013	6.77	3.648	24.21
3.0	.006	1.30	1.5	3000.	.032	17.44	2500.	.024	17.46	2.994	34.90
3.0	.006	1.30	1.5	3000.	.032	17.44	3000.	.036	27.89	2.896	45.33
3.0	.006	1.30	2.0	1550.	.000	-2.40	2000.	.013	7.52	1.642	5.12
3.0	.006	1.30	2.0	1550.	.000	-2.40	2500.	.024	19.40	.914	17.00
3.0	.006	1.30	2.0	1550.	.000	-2.40	3000.	.036	30.99	.806	28.59
3.0	.006	1.30	2.0	2500.	.020	8.76	2000.	.013	7.52	3.862	16.28
3.0	.006	1.30	2.0	2500.	.020	8.76	2500.	.024	19.40	3.134	28.16
3.0	.006	1.30	2.0	2500.	.020	8.76	3000.	.036	30.99	3.026	39.75
3.0	.006	1.30	2.0	3000.	.032	14.42	2000.	.013	7.52	3.728	21.94
3.0	.006	1.30	2.0	3000.	.032	14.42	2500.	.024	19.40	3.001	33.81
3.0	.006	1.30	2.0	3000.	.032	14.42	3000.	.036	30.99	2.893	45.40
3.0	.006	1.50	1.0	1568.	.000	-3.18	2000.	.012	5.70	-.168	2.52
3.0	.006	1.50	1.0	1568.	.000	-3.18	2500.	.023	14.62	-.321	11.43
3.0	.006	1.50	1.0	1568.	.000	-3.18	3000.	.035	23.32	-.390	20.13
3.0	.006	1.50	1.0	2500.	.020	13.27	2000.	.012	5.70	3.656	18.97
3.0	.006	1.50	1.0	2500.	.020	13.27	2500.	.023	14.62	3.167	27.89
3.0	.006	1.50	1.0	2500.	.020	13.27	3000.	.035	23.32	3.098	36.59
3.0	.006	1.50	1.0	3000.	.032	21.77	2000.	.012	5.70	3.471	27.47
3.0	.006	1.50	1.0	3000.	.032	21.77	2500.	.023	14.62	2.982	36.39
3.0	.006	1.50	1.0	3000.	.032	21.77	3000.	.035	23.32	2.913	45.09
3.0	.006	1.50	1.5	1535.	.000	-3.17	2000.	.012	6.84	1.171	3.67
3.0	.006	1.50	1.5	1535.	.000	-3.17	2500.	.023	17.54	.584	14.37
3.0	.006	1.50	1.5	1535.	.000	-3.17	3000.	.035	27.98	.502	24.81
3.0	.006	1.50	1.5	2500.	.020	10.42	2000.	.012	6.84	3.752	17.26
3.0	.006	1.50	1.5	2500.	.020	10.42	2500.	.023	17.54	3.165	27.96
3.0	.006	1.50	1.5	2500.	.020	10.42	3000.	.035	27.98	3.083	38.40
3.0	.006	1.50	1.5	3000.	.032	17.19	2000.	.012	6.84	3.581	24.03
3.0	.006	1.50	1.5	3000.	.032	17.19	2500.	.023	17.54	2.994	34.75
3.0	.006	1.50	1.5	3000.	.032	17.19	3000.	.035	27.98	2.911	45.17
3.0	.006	1.50	2.0	1502.	.000	-3.17	2000.	.012	7.60	1.771	4.42
3.0	.006	1.50	2.0	1502.	.000	-3.17	2500.	.023	19.49	1.118	16.31
3.0	.006	1.50	2.0	1502.	.000	-3.17	3000.	.035	31.09	1.027	27.92
3.0	.006	1.50	2.0	2500.	.021	8.49	2000.	.012	7.60	3.822	16.09
3.0	.006	1.50	2.0	2500.	.021	8.49	2500.	.023	19.49	3.170	27.98
3.0	.006	1.50	2.0	2500.	.021	8.49	3000.	.035	31.09	3.078	39.58
3.0	.006	1.50	2.0	3000.	.033	14.10	2000.	.012	7.60	3.667	21.78

3.0	.006	1.70	1.0	1546.	.000	-3.70	2000.	.012	5.75	-.329	2.05
3.0	.006	1.70	1.0	1546.	.000	-3.70	2500.	.023	14.67	-.111	10.97
3.0	.006	1.70	1.0	1546.	.000	-3.70	3000.	.035	23.38	-.169	19.68
3.0	.006	1.70	1.0	2500.	.020	13.11	2000.	.012	5.75	3.627	18.86
3.0	.006	1.70	1.0	2500.	.020	13.11	2500.	.023	14.67	3.187	27.78
3.0	.006	1.70	1.0	2500.	.020	13.11	3000.	.035	23.38	3.129	36.49
3.0	.006	1.70	1.0	3000.	.032	21.59	2000.	.012	5.75	3.423	27.33
3.0	.006	1.70	1.0	3000.	.032	21.59	2500.	.023	14.67	2.983	36.26
3.0	.006	1.70	1.0	3000.	.032	21.59	3000.	.035	23.38	2.925	44.96
3.0	.006	1.70	1.5	1503.	.000	-3.81	2000.	.012	6.90	1.264	3.09
3.0	.006	1.70	1.5	1503.	.000	-3.81	2500.	.023	17.60	.735	13.80
3.0	.006	1.70	1.5	1503.	.000	-3.81	3000.	.035	28.05	.666	24.25
3.0	.006	1.70	1.5	2500.	.021	10.19	2000.	.012	6.90	3.726	17.08
3.0	.006	1.70	1.5	2500.	.021	10.19	2500.	.023	17.60	3.197	27.79
3.0	.006	1.70	1.5	2500.	.021	10.19	3000.	.035	28.05	3.128	38.24
3.0	.006	1.70	1.5	3000.	.033	16.92	2000.	.012	6.90	3.528	23.81
3.0	.006	1.70	1.5	3000.	.033	16.92	2500.	.023	17.60	2.999	34.52
3.0	.006	1.70	1.5	3000.	.033	16.92	3000.	.035	28.05	2.930	44.97
3.0	.006	1.70	2.0	1459.	.000	-3.92	2000.	.012	7.66	1.811	3.74
3.0	.006	1.70	2.0	1459.	.000	-3.92	2500.	.023	19.56	1.224	15.64
3.0	.006	1.70	2.0	1459.	.000	-3.92	3000.	.035	31.17	1.147	27.25
3.0	.006	1.70	2.0	2500.	.022	8.18	2000.	.012	7.66	3.806	15.84
3.0	.006	1.70	2.0	2500.	.022	8.18	2500.	.023	19.56	3.219	27.74
3.0	.006	1.70	2.0	2500.	.022	8.18	3000.	.035	31.17	3.141	39.35
3.0	.006	1.70	2.0	3000.	.034	13.74	2000.	.012	7.66	3.605	21.40
3.0	.006	1.70	2.0	3000.	.034	13.74	2500.	.023	19.56	3.018	33.30
3.0	.006	1.70	2.0	3000.	.034	13.74	3000.	.035	31.17	2.941	44.91

1.0	.020	1.30	1.0	1600.	.000	20.79	2500.	.037	24.46	2.222	45.25
1.0	.020	1.30	1.0	1600.	.000	20.79	3000.	.050	29.31	2.380	50.10
1.0	.020	1.30	1.0	2500.	.020	32.51	2000.	.026	19.39	2.280	51.89
1.0	.020	1.30	1.0	2500.	.020	32.51	2500.	.037	24.46	2.458	56.97
1.0	.020	1.30	1.0	2500.	.020	32.51	3000.	.050	29.31	2.615	61.82
1.0	.020	1.30	1.0	3000.	.032	38.67	2000.	.026	19.39	2.394	58.06
1.0	.020	1.30	1.0	3000.	.032	38.67	2500.	.037	24.46	2.572	63.13
1.0	.020	1.30	1.0	3000.	.032	38.67	3000.	.050	29.31	2.729	67.98
1.0	.020	1.30	1.5	1580.	.000	15.80	2000.	.026	23.26	2.149	39.07
1.0	.020	1.30	1.5	1580.	.000	15.80	2500.	.037	29.35	2.363	45.15
1.0	.020	1.30	1.5	1580.	.000	15.80	3000.	.050	35.17	2.551	50.98
1.0	.020	1.30	1.5	2500.	.020	25.14	2000.	.026	23.26	2.342	48.41
1.0	.020	1.30	1.5	2500.	.020	25.14	2500.	.037	29.35	2.555	54.49
1.0	.020	1.30	1.5	2500.	.020	25.14	3000.	.050	35.17	2.744	60.32
1.0	.020	1.30	1.5	3000.	.032	29.94	2000.	.026	23.26	2.434	53.20
1.0	.020	1.30	1.5	3000.	.032	29.94	2500.	.037	29.35	2.647	59.29
1.0	.020	1.30	1.5	3000.	.032	29.94	3000.	.050	35.17	2.836	65.11
1.0	.020	1.30	2.0	1559.	.000	12.45	2000.	.026	25.85	2.224	38.29
1.0	.020	1.30	2.0	1559.	.000	12.45	2500.	.037	32.61	2.461	45.06
1.0	.020	1.30	2.0	1559.	.000	12.45	3000.	.050	39.08	2.671	51.53
1.0	.020	1.30	2.0	2500.	.020	20.18	2000.	.026	25.85	2.387	46.02
1.0	.020	1.30	2.0	2500.	.020	20.18	2500.	.037	32.61	2.624	52.79
1.0	.020	1.30	2.0	2500.	.020	20.18	3000.	.050	39.08	2.834	59.26
1.0	.020	1.30	2.0	3000.	.033	24.05	2000.	.026	25.85	2.465	49.89
1.0	.020	1.30	2.0	3000.	.033	24.05	2500.	.037	32.61	2.702	56.66
1.0	.020	1.30	2.0	3000.	.033	24.05	3000.	.050	39.08	2.912	63.13
1.0	.020	1.50	1.0	1577.	.000	19.59	2000.	.025	22.40	1.919	41.99
1.0	.020	1.50	1.0	1577.	.000	19.59	2500.	.037	28.06	2.084	47.65
1.0	.020	1.50	1.0	1577.	.000	19.59	3000.	.049	33.48	2.229	53.07
1.0	.020	1.50	1.0	2500.	.020	31.25	2000.	.025	22.40	2.160	53.66
1.0	.020	1.50	1.0	2500.	.020	31.25	2500.	.037	28.06	2.325	59.31
1.0	.020	1.50	1.0	2500.	.020	31.25	3000.	.049	33.48	2.470	64.74
1.0	.020	1.50	1.0	3000.	.032	37.22	2000.	.025	22.40	2.275	59.62
1.0	.020	1.50	1.0	3000.	.032	37.22	2500.	.037	28.06	2.440	65.27
1.0	.020	1.50	1.0	3000.	.032	37.22	3000.	.049	33.48	2.585	70.70
1.0	.020	1.50	1.5	1545.	.000	14.27	2000.	.025	26.89	2.012	41.16
1.0	.020	1.50	1.5	1545.	.000	14.27	2500.	.037	33.67	2.211	47.94
1.0	.020	1.50	1.5	1545.	.000	14.27	3000.	.049	40.18	2.384	54.45
1.0	.020	1.50	1.5	2500.	.021	23.48	2000.	.025	26.89	2.210	50.36
1.0	.020	1.50	1.5	2500.	.021	23.48	2500.	.037	33.67	2.409	57.15
1.0	.020	1.50	1.5	2500.	.021	23.48	3000.	.049	40.18	2.582	63.66
1.0	.020	1.50	1.5	3000.	.033	28.01	2000.	.025	26.89	2.304	54.89
1.0	.020	1.50	1.5	3000.	.033	28.01	2500.	.037	33.67	2.503	61.68
1.0	.020	1.50	1.5	3000.	.033	28.01	3000.	.049	40.18	2.676	68.19
1.0	.020	1.50	2.0	1513.	.000	10.64	2000.	.025	29.87	2.094	40.51
1.0	.020	1.50	2.0	1513.	.000	10.64	2500.	.037	37.41	2.314	48.05
1.0	.020	1.50	2.0	1513.	.000	10.64	3000.	.049	44.64	2.507	55.28
1.0	.020	1.50	2.0	2500.	.021	18.13	2000.	.025	29.87	2.260	48.00
1.0	.020	1.50	2.0	2500.	.021	18.13	2500.	.037	37.41	2.481	55.54
1.0	.020	1.50	2.0	2500.	.021	18.13	3000.	.049	44.64	2.674	62.77
1.0	.020	1.50	2.0	3000.	.034	21.68	2000.	.025	29.87	2.341	51.55

1.0	.020	1.70	1.0	1555.	.000	18.44	2500.	.036	30.81	2.023	49.25
1.0	.020	1.70	1.0	1555.	.000	18.44	3000.	.049	36.68	2.159	55.12
1.0	.020	1.70	1.0	2500.	.020	30.01	2000.	.025	24.72	2.111	54.73
1.0	.020	1.70	1.0	2500.	.020	30.01	2500.	.036	30.81	2.268	60.83
1.0	.020	1.70	1.0	2500.	.020	30.01	3000.	.049	36.68	2.404	66.69
1.0	.020	1.70	1.0	3000.	.033	35.78	2000.	.025	24.72	2.228	60.50
1.0	.020	1.70	1.0	3000.	.033	35.78	2500.	.036	30.81	2.385	66.59
1.0	.020	1.70	1.0	3000.	.033	35.78	3000.	.049	36.68	2.521	72.46
1.0	.020	1.70	1.5	1513.	.000	12.77	2000.	.025	29.66	1.974	42.43
1.0	.020	1.70	1.5	1513.	.000	12.77	2500.	.036	36.98	2.163	49.75
1.0	.020	1.70	1.5	1513.	.000	12.77	3000.	.049	44.02	2.326	56.79
1.0	.020	1.70	1.5	2500.	.021	21.76	2000.	.025	29.66	2.174	51.42
1.0	.020	1.70	1.5	2500.	.021	21.76	2500.	.036	36.98	2.363	58.74
1.0	.020	1.70	1.5	2500.	.021	21.76	3000.	.049	44.02	2.526	65.78
1.0	.020	1.70	1.5	3000.	.034	26.01	2000.	.025	29.66	2.271	55.68
1.0	.020	1.70	1.5	3000.	.034	26.01	2500.	.036	36.98	2.460	62.99
1.0	.020	1.70	1.5	3000.	.034	26.01	3000.	.049	44.02	2.623	70.03
1.0	.020	1.70	2.0	1470.	.000	8.81	2000.	.025	32.96	2.101	41.77
1.0	.020	1.70	2.0	1470.	.000	8.81	2500.	.036	41.09	2.311	49.89
1.0	.020	1.70	2.0	1470.	.000	8.81	3000.	.049	48.91	2.492	57.72
1.0	.020	1.70	2.0	2500.	.022	15.91	2000.	.025	32.96	2.262	48.87
1.0	.020	1.70	2.0	2500.	.022	15.91	2500.	.036	41.09	2.472	57.00
1.0	.020	1.70	2.0	2500.	.022	15.91	3000.	.049	48.91	2.654	64.82
1.0	.020	1.70	2.0	3000.	.035	19.11	2000.	.025	32.96	2.347	52.06
1.0	.020	1.70	2.0	3000.	.035	19.11	2500.	.036	41.09	2.556	60.19
1.0	.020	1.70	2.0	3000.	.035	19.11	3000.	.049	48.91	2.738	68.01
2.0	.015	1.30	1.0	1599.	.000	12.67	2000.	.021	19.84	2.052	32.51
2.0	.015	1.30	1.0	1599.	.000	12.67	2500.	.033	28.08	2.132	40.75
2.0	.015	1.30	1.0	1599.	.000	12.67	3000.	.045	36.08	2.207	48.75
2.0	.015	1.30	1.0	2500.	.019	27.58	2000.	.021	19.84	2.104	47.42
2.0	.015	1.30	1.0	2500.	.019	27.58	2500.	.033	28.08	2.184	55.66
2.0	.015	1.30	1.0	2500.	.019	27.58	3000.	.045	36.08	2.259	63.66
2.0	.015	1.30	1.0	3000.	.032	35.51	2000.	.021	19.84	2.163	55.35
2.0	.015	1.30	1.0	3000.	.032	35.51	2500.	.033	28.08	2.242	63.59
2.0	.015	1.30	1.0	3000.	.032	35.51	3000.	.045	36.08	2.317	71.59
2.0	.015	1.30	1.5	1579.	.000	9.62	2000.	.021	23.81	2.077	33.44
2.0	.015	1.30	1.5	1579.	.000	9.62	2500.	.033	33.70	2.172	43.32
2.0	.015	1.30	1.5	1579.	.000	9.62	3000.	.045	43.30	2.262	52.92
2.0	.015	1.30	1.5	2500.	.020	21.73	2000.	.021	23.81	2.097	45.54
2.0	.015	1.30	1.5	2500.	.020	21.73	2500.	.033	33.70	2.193	55.43
2.0	.015	1.30	1.5	2500.	.020	21.73	3000.	.045	43.30	2.282	65.03
2.0	.015	1.30	1.5	3000.	.032	28.03	2000.	.021	23.81	2.141	51.84
2.0	.015	1.30	1.5	3000.	.032	28.03	2500.	.033	33.70	2.236	61.73
2.0	.015	1.30	1.5	3000.	.032	28.03	3000.	.045	43.30	2.326	71.33
2.0	.015	1.30	2.0	1559.	.000	7.58	2000.	.021	26.46	2.099	34.04
2.0	.015	1.30	2.0	1559.	.000	7.58	2500.	.033	37.44	2.205	45.02
2.0	.015	1.30	2.0	1559.	.000	7.58	3000.	.045	48.11	2.304	55.69
2.0	.015	1.30	2.0	2500.	.020	17.81	2000.	.021	26.46	2.094	44.27
2.0	.015	1.30	2.0	2500.	.020	17.81	2500.	.033	37.44	2.200	55.26
2.0	.015	1.30	2.0	2500.	.020	17.81	3000.	.045	48.11	2.300	65.92
2.0	.015	1.30	2.0	3000.	.033	23.01	2000.	.021	26.46	2.128	49.43

2.0	.015	1.50	1.0	1576.	.000	11.93	2500.	.032	28.74	2.161	40.67
2.0	.015	1.50	1.0	1576.	.000	11.93	3000.	.045	36.84	2.239	48.77
2.0	.015	1.50	1.0	2500.	.020	27.10	2000.	.021	20.40	2.095	47.49
2.0	.015	1.50	1.0	2500.	.020	27.10	2500.	.032	28.74	2.182	55.84
2.0	.015	1.50	1.0	2500.	.020	27.10	3000.	.045	36.84	2.260	63.94
2.0	.015	1.50	1.0	3000.	.032	34.96	2000.	.021	20.40	2.149	55.35
2.0	.015	1.50	1.0	3000.	.032	34.96	2500.	.032	28.74	2.236	63.70
2.0	.015	1.50	1.0	3000.	.032	34.96	3000.	.045	36.84	2.314	71.80
2.0	.015	1.50	1.5	1544.	.000	8.70	2000.	.021	24.47	2.119	33.17
2.0	.015	1.50	1.5	1544.	.000	8.70	2500.	.032	34.49	2.223	43.19
2.0	.015	1.50	1.5	1544.	.000	8.70	3000.	.045	44.21	2.317	52.91
2.0	.015	1.50	1.5	2500.	.021	21.09	2000.	.021	24.47	2.090	45.57
2.0	.015	1.50	1.5	2500.	.021	21.09	2500.	.032	34.49	2.194	55.58
2.0	.015	1.50	1.5	2500.	.021	21.09	3000.	.045	44.21	2.288	65.31
2.0	.015	1.50	1.5	3000.	.033	27.29	2000.	.021	24.47	2.128	51.76
2.0	.015	1.50	1.5	3000.	.033	27.29	2500.	.032	34.49	2.233	61.78
2.0	.015	1.50	1.5	3000.	.033	27.29	3000.	.045	44.21	2.327	71.50
2.0	.015	1.50	2.0	1512.	.000	6.51	2000.	.021	27.19	2.170	33.70
2.0	.015	1.50	2.0	1512.	.000	6.51	2500.	.032	38.32	2.286	44.82
2.0	.015	1.50	2.0	1512.	.000	6.51	3000.	.045	49.12	2.390	55.63
2.0	.015	1.50	2.0	2500.	.021	17.02	2000.	.021	27.19	2.093	44.22
2.0	.015	1.50	2.0	2500.	.021	17.02	2500.	.032	38.32	2.208	55.34
2.0	.015	1.50	2.0	2500.	.021	17.02	3000.	.045	49.12	2.313	66.15
2.0	.015	1.50	2.0	3000.	.034	22.10	2000.	.021	27.19	2.119	49.29
2.0	.015	1.50	2.0	3000.	.034	22.10	2500.	.032	38.32	2.235	60.42
2.0	.015	1.50	2.0	3000.	.034	22.10	3000.	.045	49.12	2.340	71.22
2.0	.015	1.70	1.0	1555.	.000	11.23	2000.	.021	20.84	2.108	32.07
2.0	.015	1.70	1.0	1555.	.000	11.23	2500.	.032	29.26	2.201	40.50
2.0	.015	1.70	1.0	1555.	.000	11.23	3000.	.044	37.45	2.282	48.68
2.0	.015	1.70	1.0	2500.	.020	26.62	2000.	.021	20.84	2.093	47.46
2.0	.015	1.70	1.0	2500.	.020	26.62	2500.	.032	29.26	2.186	55.89
2.0	.015	1.70	1.0	2500.	.020	26.62	3000.	.044	37.45	2.267	64.08
2.0	.015	1.70	1.0	3000.	.033	34.41	2000.	.021	20.84	2.143	55.24
2.0	.015	1.70	1.0	3000.	.033	34.41	2500.	.032	29.26	2.236	63.67
2.0	.015	1.70	1.0	3000.	.033	34.41	3000.	.044	37.45	2.317	71.86
2.0	.015	1.70	1.5	1512.	.000	7.81	2000.	.021	25.01	2.189	32.81
2.0	.015	1.70	1.5	1512.	.000	7.81	2500.	.032	35.12	2.301	42.93
2.0	.015	1.70	1.5	1512.	.000	7.81	3000.	.044	44.94	2.398	52.75
2.0	.015	1.70	1.5	2500.	.021	20.43	2000.	.021	25.01	2.096	45.44
2.0	.015	1.70	1.5	2500.	.021	20.43	2500.	.032	35.12	2.208	55.55
2.0	.015	1.70	1.5	2500.	.021	20.43	3000.	.044	44.94	2.305	65.37
2.0	.015	1.70	1.5	3000.	.034	26.52	2000.	.021	25.01	2.128	51.52
2.0	.015	1.70	1.5	3000.	.034	26.52	2500.	.032	35.12	2.240	61.64
2.0	.015	1.70	1.5	3000.	.034	26.52	3000.	.044	44.94	2.337	71.46
2.0	.015	1.70	2.0	1469.	.000	5.45	2000.	.021	27.78	2.303	33.23
2.0	.015	1.70	2.0	1469.	.000	5.45	2500.	.032	39.02	2.427	44.47
2.0	.015	1.70	2.0	1469.	.000	5.45	3000.	.044	49.94	2.535	55.38
2.0	.015	1.70	2.0	2500.	.022	16.16	2000.	.021	27.78	2.111	43.95
2.0	.015	1.70	2.0	2500.	.022	16.16	2500.	.032	39.02	2.235	55.18
2.0	.015	1.70	2.0	2500.	.022	16.16	3000.	.044	49.94	2.343	66.10
2.0	.015	1.70	2.0	3000.	.035	21.10	2000.	.021	27.78	2.129	48.88

3.0	.008	1.30	1.0	1592.	.000	-.63	2500.	.025	16.61	-9.793	15.98
3.0	.008	1.30	1.0	1592.	.000	-.63	3000.	.037	25.34	-9.836	24.71
3.0	.008	1.30	1.0	2500.	.019	15.50	2000.	.014	7.66	3.233	23.16
3.0	.008	1.30	1.0	2500.	.019	15.50	2500.	.025	16.61	2.935	32.11
3.0	.008	1.30	1.0	2500.	.019	15.50	3000.	.037	25.34	2.891	40.83
3.0	.008	1.30	1.0	3000.	.031	24.06	2000.	.014	7.66	3.125	31.72
3.0	.008	1.30	1.0	3000.	.031	24.06	2500.	.025	16.61	2.827	40.67
3.0	.008	1.30	1.0	3000.	.031	24.06	3000.	.037	25.34	2.784	49.39
3.0	.008	1.30	1.5	1572.	.000	-.88	2000.	.014	9.19	-3.112	8.31
3.0	.008	1.30	1.5	1572.	.000	-.88	2500.	.025	19.93	-3.469	19.05
3.0	.008	1.30	1.5	1572.	.000	-.88	3000.	.037	30.40	-3.521	29.52
3.0	.008	1.30	1.5	2500.	.020	12.30	2000.	.014	9.19	3.282	21.48
3.0	.008	1.30	1.5	2500.	.020	12.30	2500.	.025	19.93	2.925	32.23
3.0	.008	1.30	1.5	2500.	.020	12.30	3000.	.037	30.40	2.873	42.70
3.0	.008	1.30	1.5	3000.	.032	19.13	2000.	.014	9.19	3.187	28.32
3.0	.008	1.30	1.5	3000.	.032	19.13	2500.	.025	19.93	2.829	39.06
3.0	.008	1.30	1.5	3000.	.032	19.13	3000.	.037	30.40	2.777	49.53
3.0	.008	1.30	2.0	1551.	.000	-1.05	2000.	.014	10.21	-.744	9.16
3.0	.008	1.30	2.0	1551.	.000	-1.05	2500.	.025	22.14	-1.141	21.09
3.0	.008	1.30	2.0	1551.	.000	-1.05	3000.	.037	33.78	-1.199	32.73
3.0	.008	1.30	2.0	2500.	.020	10.15	2000.	.014	10.21	3.317	20.36
3.0	.008	1.30	2.0	2500.	.020	10.15	2500.	.025	22.14	2.920	32.30
3.0	.008	1.30	2.0	2500.	.020	10.15	3000.	.037	33.78	2.862	43.93
3.0	.008	1.30	2.0	3000.	.032	15.83	2000.	.014	10.21	3.229	26.04
3.0	.008	1.30	2.0	3000.	.032	15.83	2500.	.025	22.14	2.832	37.98
3.0	.008	1.30	2.0	3000.	.032	15.83	3000.	.037	33.78	2.774	49.61
3.0	.008	1.50	1.0	1569.	.000	-1.18	2000.	.014	7.72	-4.386	6.55
3.0	.008	1.50	1.0	1569.	.000	-1.18	2500.	.025	16.68	-4.649	15.51
3.0	.008	1.50	1.0	1569.	.000	-1.18	3000.	.037	25.42	-4.683	24.25
3.0	.008	1.50	1.0	2500.	.020	15.35	2000.	.014	7.72	3.209	23.07
3.0	.008	1.50	1.0	2500.	.020	15.35	2500.	.025	16.68	2.946	32.03
3.0	.008	1.50	1.0	2500.	.020	15.35	3000.	.037	25.42	2.913	40.77
3.0	.008	1.50	1.0	3000.	.032	23.89	2000.	.014	7.72	3.088	31.61
3.0	.008	1.50	1.0	3000.	.032	23.89	2500.	.025	16.68	2.825	40.57
3.0	.008	1.50	1.0	3000.	.032	23.89	3000.	.037	25.42	2.791	49.31
3.0	.008	1.50	1.5	1536.	.000	-1.55	2000.	.014	9.27	-.981	7.72
3.0	.008	1.50	1.5	1536.	.000	-1.55	2500.	.025	20.02	-1.296	18.47
3.0	.008	1.50	1.5	1536.	.000	-1.55	3000.	.037	30.51	-1.336	28.96
3.0	.008	1.50	1.5	2500.	.020	12.09	2000.	.014	9.27	3.258	21.36
3.0	.008	1.50	1.5	2500.	.020	12.09	2500.	.025	20.02	2.943	32.11
3.0	.008	1.50	1.5	2500.	.020	12.09	3000.	.037	30.51	2.903	42.60
3.0	.008	1.50	1.5	3000.	.032	18.89	2000.	.014	9.27	3.144	28.16
3.0	.008	1.50	1.5	3000.	.032	18.89	2500.	.025	20.02	2.829	38.91
3.0	.008	1.50	1.5	3000.	.032	18.89	3000.	.037	30.51	2.789	49.40
3.0	.008	1.50	2.0	1504.	.000	-1.82	2000.	.014	10.30	.416	8.48
3.0	.008	1.50	2.0	1504.	.000	-1.82	2500.	.025	22.25	.066	20.42
3.0	.008	1.50	2.0	1504.	.000	-1.82	3000.	.037	33.90	.021	32.08
3.0	.008	1.50	2.0	2500.	.021	9.89	2000.	.014	10.30	3.295	20.19
3.0	.008	1.50	2.0	2500.	.021	9.89	2500.	.025	22.25	2.945	32.14
3.0	.008	1.50	2.0	2500.	.021	9.89	3000.	.037	33.90	2.900	43.79
3.0	.008	1.50	2.0	3000.	.033	15.53	2000.	.014	10.30	3.185	25.83

3.0	.008	1.70	1.0	1547.	.000	-1.68	2000.	.013	7.78	-2.642	6.10
3.0	.008	1.70	1.0	1547.	.000	-1.68	2500.	.024	16.74	-2.874	15.06
3.0	.008	1.70	1.0	1547.	.000	-1.68	3000.	.036	25.49	-2.899	23.81
3.0	.008	1.70	1.0	2500.	.020	15.20	2000.	.013	7.78	3.193	22.97
3.0	.008	1.70	1.0	2500.	.020	15.20	2500.	.024	16.74	2.960	31.94
3.0	.008	1.70	1.0	2500.	.020	15.20	3000.	.036	25.49	2.935	40.69
3.0	.008	1.70	1.0	3000.	.032	23.71	2000.	.013	7.78	3.057	31.49
3.0	.008	1.70	1.0	3000.	.032	23.71	2500.	.024	16.74	2.825	40.46
3.0	.008	1.70	1.0	3000.	.032	23.71	3000.	.036	25.49	2.800	49.20
3.0	.008	1.70	1.5	1504.	.000	-2.18	2000.	.013	9.33	-.211	7.15
3.0	.008	1.70	1.5	1504.	.000	-2.18	2500.	.024	20.09	-.490	17.91
3.0	.008	1.70	1.5	1504.	.000	-2.18	3000.	.036	30.59	-.520	28.41
3.0	.008	1.70	1.5	2500.	.021	11.87	2000.	.013	9.33	3.244	21.21
3.0	.008	1.70	1.5	2500.	.021	11.87	2500.	.024	20.09	2.966	31.97
3.0	.008	1.70	1.5	2500.	.021	11.87	3000.	.036	30.59	2.936	42.46
3.0	.008	1.70	1.5	3000.	.033	18.64	2000.	.013	9.33	3.112	27.97
3.0	.008	1.70	1.5	3000.	.033	18.64	2500.	.024	20.09	2.833	38.73
3.0	.008	1.70	1.5	3000.	.033	18.64	3000.	.036	30.59	2.803	49.23
3.0	.008	1.70	2.0	1460.	.000	-2.56	2000.	.013	10.37	.832	7.81
3.0	.008	1.70	2.0	1460.	.000	-2.56	2500.	.024	22.33	.522	19.77
3.0	.008	1.70	2.0	1460.	.000	-2.56	3000.	.036	33.99	.489	31.43
3.0	.008	1.70	2.0	2500.	.022	9.60	2000.	.013	10.37	3.289	19.97
3.0	.008	1.70	2.0	2500.	.022	9.60	2500.	.024	22.33	2.979	31.93
3.0	.008	1.70	2.0	2500.	.022	9.60	3000.	.036	33.99	2.946	43.59
3.0	.008	1.70	2.0	3000.	.034	15.20	2000.	.013	10.37	3.154	25.57
3.0	.008	1.70	2.0	3000.	.034	15.20	2500.	.024	22.33	2.844	37.52
3.0	.008	1.70	2.0	3000.	.034	15.20	3000.	.036	33.99	2.811	49.19

1.0	.022	1.30	1.0	1598.	.000	22.46	2500.	.040	25.87	2.272	48.33
1.0	.022	1.30	1.0	1598.	.000	22.46	3000.	.054	30.90	2.436	53.36
1.0	.022	1.30	1.0	2500.	.021	34.77	2000.	.028	20.64	2.320	55.41
1.0	.022	1.30	1.0	2500.	.021	34.77	2500.	.040	25.87	2.504	60.64
1.0	.022	1.30	1.0	2500.	.021	34.77	3000.	.054	30.90	2.668	65.67
1.0	.022	1.30	1.0	3000.	.034	41.28	2000.	.028	20.64	2.433	61.92
1.0	.022	1.30	1.0	3000.	.034	41.28	2500.	.040	25.87	2.617	67.15
1.0	.022	1.30	1.0	3000.	.034	41.28	3000.	.054	30.90	2.781	72.18
1.0	.022	1.30	1.5	1577.	.000	17.19	2000.	.028	24.77	2.191	41.96
1.0	.022	1.30	1.5	1577.	.000	17.19	2500.	.040	31.05	2.412	48.24
1.0	.022	1.30	1.5	1577.	.000	17.19	3000.	.054	37.08	2.609	54.27
1.0	.022	1.30	1.5	2500.	.021	27.04	2000.	.028	24.77	2.380	51.81
1.0	.022	1.30	1.5	2500.	.021	27.04	2500.	.040	31.05	2.601	58.09
1.0	.022	1.30	1.5	2500.	.021	27.04	3000.	.054	37.08	2.798	64.12
1.0	.022	1.30	1.5	3000.	.034	32.12	2000.	.028	24.77	2.471	56.89
1.0	.022	1.30	1.5	3000.	.034	32.12	2500.	.040	31.05	2.692	63.17
1.0	.022	1.30	1.5	3000.	.034	32.12	3000.	.054	37.08	2.889	69.20
1.0	.022	1.30	2.0	1557.	.000	13.65	2000.	.028	27.52	2.263	41.17
1.0	.022	1.30	2.0	1557.	.000	13.65	2500.	.040	34.50	2.509	48.14
1.0	.022	1.30	2.0	1557.	.000	13.65	3000.	.054	41.20	2.728	54.85
1.0	.022	1.30	2.0	2500.	.022	21.83	2000.	.028	27.52	2.423	49.35
1.0	.022	1.30	2.0	2500.	.022	21.83	2500.	.040	34.50	2.669	56.33
1.0	.022	1.30	2.0	2500.	.022	21.83	3000.	.054	41.20	2.888	63.03
1.0	.022	1.30	2.0	3000.	.035	25.96	2000.	.028	27.52	2.500	53.47
1.0	.022	1.30	2.0	3000.	.035	25.96	2500.	.040	34.50	2.746	60.45
1.0	.022	1.30	2.0	3000.	.035	25.96	3000.	.054	41.20	2.965	67.15
1.0	.022	1.50	1.0	1574.	.000	21.33	2000.	.028	23.82	1.953	45.15
1.0	.022	1.50	1.0	1574.	.000	21.33	2500.	.040	29.67	2.123	51.01
1.0	.022	1.50	1.0	1574.	.000	21.33	3000.	.053	35.32	2.273	56.65
1.0	.022	1.50	1.0	2500.	.021	33.64	2000.	.028	23.82	2.190	57.46
1.0	.022	1.50	1.0	2500.	.021	33.64	2500.	.040	29.67	2.360	63.32
1.0	.022	1.50	1.0	2500.	.021	33.64	3000.	.053	35.32	2.510	68.96
1.0	.022	1.50	1.0	3000.	.034	39.97	2000.	.028	23.82	2.304	63.79
1.0	.022	1.50	1.0	3000.	.034	39.97	2500.	.040	29.67	2.474	69.64
1.0	.022	1.50	1.0	3000.	.034	39.97	3000.	.053	35.32	2.624	75.28
1.0	.022	1.50	1.5	1542.	.000	15.76	2000.	.028	28.58	2.040	44.34
1.0	.022	1.50	1.5	1542.	.000	15.76	2500.	.040	35.61	2.244	51.37
1.0	.022	1.50	1.5	1542.	.000	15.76	3000.	.053	42.38	2.423	58.14
1.0	.022	1.50	1.5	2500.	.022	25.54	2000.	.028	28.58	2.234	54.12
1.0	.022	1.50	1.5	2500.	.022	25.54	2500.	.040	35.61	2.438	61.15
1.0	.022	1.50	1.5	2500.	.022	25.54	3000.	.053	42.38	2.618	67.92
1.0	.022	1.50	1.5	3000.	.035	30.38	2000.	.028	28.58	2.327	58.96
1.0	.022	1.50	1.5	3000.	.035	30.38	2500.	.040	35.61	2.532	65.99
1.0	.022	1.50	1.5	3000.	.035	30.38	3000.	.053	42.38	2.711	72.76
1.0	.022	1.50	2.0	1510.	.000	11.96	2000.	.028	31.76	2.112	43.72
1.0	.022	1.50	2.0	1510.	.000	11.96	2500.	.040	39.56	2.339	51.52
1.0	.022	1.50	2.0	1510.	.000	11.96	3000.	.053	47.09	2.538	59.05
1.0	.022	1.50	2.0	2500.	.023	19.99	2000.	.028	31.76	2.276	51.75
1.0	.022	1.50	2.0	2500.	.023	19.99	2500.	.040	39.56	2.503	59.55
1.0	.022	1.50	2.0	2500.	.023	19.99	3000.	.053	47.09	2.703	67.08
1.0	.022	1.50	2.0	3000.	.036	23.81	2000.	.028	31.76	2.356	55.57
1.0	.022	1.50	2.0	3000.	.036	23.81	2500.	.040	39.56	2.583	63.37

1.0	.022	1.70	1.0	1553.	.000	20.26	2000.	.027	26.23	1.891	46.49
1.0	.022	1.70	1.0	1553.	.000	20.26	2500.	.040	32.55	2.052	52.81
1.0	.022	1.70	1.0	1553.	.000	20.26	3000.	.053	38.66	2.193	58.92
1.0	.022	1.70	1.0	2500.	.022	32.52	2000.	.027	26.23	2.132	58.75
1.0	.022	1.70	1.0	2500.	.022	32.52	2500.	.040	32.55	2.293	65.07
1.0	.022	1.70	1.0	2500.	.022	32.52	3000.	.053	38.66	2.434	71.18
1.0	.022	1.70	1.0	3000.	.035	38.67	2000.	.027	26.23	2.248	64.90
1.0	.022	1.70	1.0	3000.	.035	38.67	2500.	.040	32.55	2.409	71.22
1.0	.022	1.70	1.0	3000.	.035	38.67	3000.	.053	38.66	2.549	77.33
1.0	.022	1.70	1.5	1510.	.000	14.36	2000.	.027	31.47	1.985	45.83
1.0	.022	1.70	1.5	1510.	.000	14.36	2500.	.040	39.06	2.178	53.41
1.0	.022	1.70	1.5	1510.	.000	14.36	3000.	.053	46.39	2.347	60.74
1.0	.022	1.70	1.5	2500.	.023	23.99	2000.	.027	31.47	2.183	55.46
1.0	.022	1.70	1.5	2500.	.023	23.99	2500.	.040	39.06	2.376	63.05
1.0	.022	1.70	1.5	2500.	.023	23.99	3000.	.053	46.39	2.544	70.38
1.0	.022	1.70	1.5	3000.	.036	28.57	2000.	.027	31.47	2.278	60.05
1.0	.022	1.70	1.5	3000.	.036	28.57	2500.	.040	39.06	2.471	67.63
1.0	.022	1.70	1.5	3000.	.036	28.57	3000.	.053	46.39	2.640	74.96
1.0	.022	1.70	2.0	1467.	.000	10.25	2000.	.027	34.97	2.085	45.22
1.0	.022	1.70	2.0	1467.	.000	10.25	2500.	.040	43.40	2.300	53.65
1.0	.022	1.70	2.0	1467.	.000	10.25	3000.	.053	51.54	2.487	61.80
1.0	.022	1.70	2.0	2500.	.024	17.98	2000.	.027	34.97	2.250	52.95
1.0	.022	1.70	2.0	2500.	.024	17.98	2500.	.040	43.40	2.464	61.38
1.0	.022	1.70	2.0	2500.	.024	17.98	3000.	.053	51.54	2.652	69.52
1.0	.022	1.70	2.0	3000.	.037	21.48	2000.	.027	34.97	2.332	56.45
1.0	.022	1.70	2.0	3000.	.037	21.48	2500.	.040	43.40	2.547	64.88
1.0	.022	1.70	2.0	3000.	.037	21.48	3000.	.053	51.54	2.734	73.02
2.0	.017	1.30	1.0	1600.	.000	14.32	2000.	.024	21.43	2.086	35.75
2.0	.017	1.30	1.0	1600.	.000	14.32	2500.	.036	29.82	2.174	44.13
2.0	.017	1.30	1.0	1600.	.000	14.32	3000.	.049	37.99	2.255	52.31
2.0	.017	1.30	1.0	2500.	.021	29.53	2000.	.024	21.43	2.161	50.96
2.0	.017	1.30	1.0	2500.	.021	29.53	2500.	.036	29.82	2.248	59.35
2.0	.017	1.30	1.0	2500.	.021	29.53	3000.	.049	37.99	2.329	67.52
2.0	.017	1.30	1.0	3000.	.034	37.68	2000.	.024	21.43	2.225	59.11
2.0	.017	1.30	1.0	3000.	.034	37.68	2500.	.036	29.82	2.312	67.49
2.0	.017	1.30	1.0	3000.	.034	37.68	3000.	.049	37.99	2.393	75.67
2.0	.017	1.30	1.5	1579.	.000	10.96	2000.	.024	25.72	2.109	36.68
2.0	.017	1.30	1.5	1579.	.000	10.96	2500.	.036	35.78	2.214	46.74
2.0	.017	1.30	1.5	1579.	.000	10.96	3000.	.049	45.59	2.311	56.55
2.0	.017	1.30	1.5	2500.	.021	23.33	2000.	.024	25.72	2.152	49.04
2.0	.017	1.30	1.5	2500.	.021	23.33	2500.	.036	35.78	2.257	59.11
2.0	.017	1.30	1.5	2500.	.021	23.33	3000.	.049	45.59	2.354	68.92
2.0	.017	1.30	1.5	3000.	.034	29.79	2000.	.024	25.72	2.201	55.51
2.0	.017	1.30	1.5	3000.	.034	29.79	2500.	.036	35.78	2.305	65.57
2.0	.017	1.30	1.5	3000.	.034	29.79	3000.	.049	45.59	2.403	75.38
2.0	.017	1.30	2.0	1559.	.000	8.71	2000.	.024	28.57	2.128	37.28
2.0	.017	1.30	2.0	1559.	.000	8.71	2500.	.036	39.76	2.244	48.47
2.0	.017	1.30	2.0	1559.	.000	8.71	3000.	.049	50.66	2.352	59.36
2.0	.017	1.30	2.0	2500.	.022	19.17	2000.	.024	28.57	2.148	47.74
2.0	.017	1.30	2.0	2500.	.022	19.17	2500.	.036	39.76	2.264	58.92
2.0	.017	1.30	2.0	2500.	.022	19.17	3000.	.049	50.66	2.372	69.82
2.0	.017	1.30	2.0	3000.	.035	24.51	2000.	.024	28.57	2.186	63.09

2.0	.017	1.50	1.0	1576.	.000	13.60	2000.	.023	22.02	2.098	35.62
2.0	.017	1.50	1.0	1576.	.000	13.60	2500.	.036	30.52	2.191	44.12
2.0	.017	1.50	1.0	1576.	.000	13.60	3000.	.049	38.80	2.276	52.41
2.0	.017	1.50	1.0	2500.	.021	29.10	2000.	.023	22.02	2.148	51.12
2.0	.017	1.50	1.0	2500.	.021	29.10	2500.	.036	30.52	2.242	59.61
2.0	.017	1.50	1.0	2500.	.021	29.10	3000.	.049	38.80	2.326	67.90
2.0	.017	1.50	1.0	3000.	.034	37.17	2000.	.023	22.02	2.209	59.19
2.0	.017	1.50	1.0	3000.	.034	37.17	2500.	.036	30.52	2.302	67.69
2.0	.017	1.50	1.0	3000.	.034	37.17	3000.	.049	38.80	2.386	75.98
2.0	.017	1.50	1.5	1544.	.000	10.07	2000.	.023	26.42	2.134	36.49
2.0	.017	1.50	1.5	1544.	.000	10.07	2500.	.036	36.62	2.247	46.69
2.0	.017	1.50	1.5	1544.	.000	10.07	3000.	.049	46.57	2.348	56.63
2.0	.017	1.50	1.5	2500.	.022	22.74	2000.	.023	26.42	2.141	49.17
2.0	.017	1.50	1.5	2500.	.022	22.74	2500.	.036	36.62	2.253	59.37
2.0	.017	1.50	1.5	2500.	.022	22.74	3000.	.049	46.57	2.354	69.31
2.0	.017	1.50	1.5	3000.	.035	29.12	2000.	.023	26.42	2.185	55.54
2.0	.017	1.50	1.5	3000.	.035	29.12	2500.	.036	36.62	2.297	65.74
2.0	.017	1.50	1.5	3000.	.035	29.12	3000.	.049	46.57	2.398	75.69
2.0	.017	1.50	2.0	1512.	.000	7.67	2000.	.023	29.36	2.174	37.03
2.0	.017	1.50	2.0	1512.	.000	7.67	2500.	.036	40.69	2.299	48.36
2.0	.017	1.50	2.0	1512.	.000	7.67	3000.	.049	51.74	2.411	59.41
2.0	.017	1.50	2.0	2500.	.023	18.45	2000.	.023	29.36	2.141	47.81
2.0	.017	1.50	2.0	2500.	.023	18.45	2500.	.036	40.69	2.266	59.14
2.0	.017	1.50	2.0	2500.	.023	18.45	3000.	.049	51.74	2.378	70.19
2.0	.017	1.50	2.0	3000.	.036	23.68	2000.	.023	29.36	2.173	53.04
2.0	.017	1.50	2.0	3000.	.036	23.68	2500.	.036	40.69	2.298	64.37
2.0	.017	1.50	2.0	3000.	.036	23.68	3000.	.049	51.74	2.410	75.42
2.0	.017	1.70	1.0	1555.	.000	12.93	2000.	.023	22.49	2.120	35.42
2.0	.017	1.70	1.0	1555.	.000	12.93	2500.	.035	31.07	2.219	44.00
2.0	.017	1.70	1.0	1555.	.000	12.93	3000.	.048	39.45	2.306	52.38
2.0	.017	1.70	1.0	2500.	.022	28.66	2000.	.023	22.49	2.144	51.15
2.0	.017	1.70	1.0	2500.	.022	28.66	2500.	.035	31.07	2.243	59.74
2.0	.017	1.70	1.0	2500.	.022	28.66	3000.	.048	39.45	2.330	68.11
2.0	.017	1.70	1.0	3000.	.035	36.67	2000.	.023	22.49	2.201	59.16
2.0	.017	1.70	1.0	3000.	.035	36.67	2500.	.035	31.07	2.300	67.74
2.0	.017	1.70	1.0	3000.	.035	36.67	3000.	.048	39.45	2.387	76.12
2.0	.017	1.70	1.5	1512.	.000	9.21	2000.	.023	26.98	2.182	36.19
2.0	.017	1.70	1.5	1512.	.000	9.21	2500.	.035	37.29	2.301	46.50
2.0	.017	1.70	1.5	1512.	.000	9.21	3000.	.048	47.34	2.405	56.55
2.0	.017	1.70	1.5	2500.	.023	22.14	2000.	.023	26.98	2.142	49.12
2.0	.017	1.70	1.5	2500.	.023	22.14	2500.	.035	37.29	2.261	59.43
2.0	.017	1.70	1.5	2500.	.023	22.14	3000.	.048	47.34	2.365	69.48
2.0	.017	1.70	1.5	3000.	.036	28.42	2000.	.023	26.98	2.181	55.40
2.0	.017	1.70	1.5	3000.	.036	28.42	2500.	.035	37.29	2.300	65.70
2.0	.017	1.70	1.5	3000.	.036	28.42	3000.	.048	47.34	2.404	75.75
2.0	.017	1.70	2.0	1469.	.000	6.66	2000.	.023	29.98	2.262	36.64
2.0	.017	1.70	2.0	1469.	.000	6.66	2500.	.035	41.43	2.394	48.09
2.0	.017	1.70	2.0	1469.	.000	6.66	3000.	.048	52.60	2.510	59.26
2.0	.017	1.70	2.0	2500.	.024	17.66	2000.	.023	29.98	2.152	47.64
2.0	.017	1.70	2.0	2500.	.024	17.66	2500.	.035	41.43	2.283	59.09
2.0	.017	1.70	2.0	2500.	.024	17.66	3000.	.048	52.60	2.399	70.26
2.0	.017	1.70	2.0	3000.	.037	22.76	2000.	.023	29.98	2.177	52.74
2.0	.017	1.70	2.0	3000.	.037	22.76	2500.	.035	41.43	2.309	64.19
2.0	.017	1.70	2.0	3000.	.037	22.76	3000.	.048	52.60	2.425	75.36

3.0	.010	1.30	1.0	1594.	.000	1.45	2000.	.017	9.85	7.777	11.30
3.0	.010	1.30	1.0	1594.	.000	1.45	2500.	.029	18.95	7.607	20.40
3.0	.010	1.30	1.0	1594.	.000	1.45	3000.	.042	27.86	7.591	29.31
3.0	.010	1.30	1.0	2500.	.020	17.78	2000.	.017	9.85	3.076	27.63
3.0	.010	1.30	1.0	2500.	.020	17.78	2500.	.029	18.95	2.905	36.73
3.0	.010	1.30	1.0	2500.	.020	17.78	3000.	.042	27.86	2.890	45.64
3.0	.010	1.30	1.0	3000.	.033	26.51	2000.	.017	9.85	3.006	36.36
3.0	.010	1.30	1.0	3000.	.033	26.51	2500.	.029	18.95	2.836	45.46
3.0	.010	1.30	1.0	3000.	.033	26.51	3000.	.042	27.86	2.820	54.37
3.0	.010	1.30	1.5	1573.	.000	.79	2000.	.017	11.82	9.196	12.61
3.0	.010	1.30	1.5	1573.	.000	.79	2500.	.029	22.74	8.992	23.53
3.0	.010	1.30	1.5	1573.	.000	.79	3000.	.042	33.43	8.973	34.22
3.0	.010	1.30	1.5	2500.	.021	14.13	2000.	.017	11.82	3.100	25.95
3.0	.010	1.30	1.5	2500.	.021	14.13	2500.	.029	22.74	2.895	36.88
3.0	.010	1.30	1.5	2500.	.021	14.13	3000.	.042	33.43	2.876	47.56
3.0	.010	1.30	1.5	3000.	.034	21.10	2000.	.017	11.82	3.037	32.93
3.0	.010	1.30	1.5	3000.	.034	21.10	2500.	.029	22.74	2.832	43.85
3.0	.010	1.30	1.5	3000.	.034	21.10	3000.	.042	33.43	2.813	54.53
3.0	.010	1.30	2.0	1553.	.000	.34	2000.	.017	13.13	13.881	13.47
3.0	.010	1.30	2.0	1553.	.000	.34	2500.	.029	25.27	13.654	25.61
3.0	.010	1.30	2.0	1553.	.000	.34	3000.	.042	37.14	13.633	37.48
3.0	.010	1.30	2.0	2500.	.021	11.69	2000.	.017	13.13	3.117	24.83
3.0	.010	1.30	2.0	2500.	.021	11.69	2500.	.029	25.27	2.889	36.96
3.0	.010	1.30	2.0	2500.	.021	11.69	3000.	.042	37.14	2.869	48.84
3.0	.010	1.30	2.0	3000.	.034	17.49	2000.	.017	13.13	3.057	30.62
3.0	.010	1.30	2.0	3000.	.034	17.49	2500.	.029	25.27	2.830	42.76
3.0	.010	1.30	2.0	3000.	.034	17.49	3000.	.042	37.14	2.809	54.63
3.0	.010	1.50	1.0	1570.	.000	.91	2000.	.016	9.92	11.415	10.83
3.0	.010	1.50	1.0	1570.	.000	.91	2500.	.028	19.03	11.269	19.94
3.0	.010	1.50	1.0	1570.	.000	.91	3000.	.041	27.95	11.262	28.86
3.0	.010	1.50	1.0	2500.	.021	17.65	2000.	.016	9.92	3.059	27.57
3.0	.010	1.50	1.0	2500.	.021	17.65	2500.	.028	19.03	2.914	36.68
3.0	.010	1.50	1.0	2500.	.021	17.65	3000.	.041	27.95	2.906	45.60
3.0	.010	1.50	1.0	3000.	.034	26.36	2000.	.016	9.92	2.979	36.28
3.0	.010	1.50	1.0	3000.	.034	26.36	2500.	.028	19.03	2.833	45.39
3.0	.010	1.50	1.0	3000.	.034	26.36	3000.	.041	27.95	2.826	54.31
3.0	.010	1.50	1.5	1537.	.000	.12	2000.	.016	11.91	48.341	12.03
3.0	.010	1.50	1.5	1537.	.000	.12	2500.	.028	22.84	48.166	22.97
3.0	.010	1.50	1.5	1537.	.000	.12	3000.	.041	33.54	48.157	33.67
3.0	.010	1.50	1.5	2500.	.022	13.95	2000.	.016	11.91	3.083	25.86
3.0	.010	1.50	1.5	2500.	.022	13.95	2500.	.028	22.84	2.908	36.79
3.0	.010	1.50	1.5	2500.	.022	13.95	3000.	.041	33.54	2.899	47.49
3.0	.010	1.50	1.5	3000.	.035	20.89	2000.	.016	11.91	3.006	32.80
3.0	.010	1.50	1.5	3000.	.035	20.89	2500.	.028	22.84	2.831	43.73
3.0	.010	1.50	1.5	3000.	.035	20.89	3000.	.041	33.54	2.822	54.44
3.0	.010	1.50	2.0	1505.	.000	-.42	2000.	.016	13.23	-7.675	12.81
3.0	.010	1.50	2.0	1505.	.000	-.42	2500.	.028	25.38	-7.869	24.96
3.0	.010	1.50	2.0	1505.	.000	-.42	3000.	.041	37.27	-7.879	36.86
3.0	.010	1.50	2.0	2500.	.022	11.46	2000.	.016	13.23	3.102	24.69
3.0	.010	1.50	2.0	2500.	.022	11.46	2500.	.028	25.38	2.908	36.84
3.0	.010	1.50	2.0	2500.	.022	11.46	3000.	.041	37.27	2.898	48.73
3.0	.010	1.50	2.0	3000.	.035	17.22	2000.	.016	13.23	3.026	30.45
3.0	.010	1.50	2.0	3000.	.035	17.22	2500.	.028	25.38	2.831	42.59
3.0	.010	1.50	2.0	3000.	.035	17.22	3000.	.041	37.27	2.822	54.49

3.0	.010	1.70	1.0	1548.	.000	.41	2000.	.016	9.98	23.465	10.39
3.0	.010	1.70	1.0	1548.	.000	.41	2500.	.028	19.10	23.341	19.51
3.0	.010	1.70	1.0	1548.	.000	.41	3000.	.041	28.03	23.341	28.44
3.0	.010	1.70	1.0	2500.	.021	17.51	2000.	.016	9.98	3.048	27.49
3.0	.010	1.70	1.0	2500.	.021	17.51	2500.	.028	19.10	2.924	36.61
3.0	.010	1.70	1.0	2500.	.021	17.51	3000.	.041	28.03	2.924	45.54
3.0	.010	1.70	1.0	3000.	.034	26.20	2000.	.016	9.98	2.957	36.18
3.0	.010	1.70	1.0	3000.	.034	26.20	2500.	.028	19.10	2.833	45.30
3.0	.010	1.70	1.0	3000.	.034	26.20	3000.	.041	28.03	2.833	54.23
3.0	.010	1.70	1.5	1505.	.000	-.50	2000.	.016	11.98	-9.881	11.48
3.0	.010	1.70	1.5	1505.	.000	-.50	2500.	.028	22.92	-10.029	22.42
3.0	.010	1.70	1.5	1505.	.000	-.50	3000.	.041	33.63	-10.030	33.14
3.0	.010	1.70	1.5	2500.	.022	13.75	2000.	.016	11.98	3.074	25.72
3.0	.010	1.70	1.5	2500.	.022	13.75	2500.	.028	22.92	2.925	36.67
3.0	.010	1.70	1.5	2500.	.022	13.75	3000.	.041	33.63	2.925	47.38
3.0	.010	1.70	1.5	3000.	.035	20.66	2000.	.016	11.98	2.983	32.64
3.0	.010	1.70	1.5	3000.	.035	20.66	2500.	.028	22.92	2.834	43.58
3.0	.010	1.70	1.5	3000.	.035	20.66	3000.	.041	33.63	2.834	54.29
3.0	.010	1.70	2.0	1462.	.000	-1.14	2000.	.016	13.31	-1.620	12.17
3.0	.010	1.70	2.0	1462.	.000	-1.14	2500.	.028	25.47	-1.786	24.33
3.0	.010	1.70	2.0	1462.	.000	-1.14	3000.	.041	37.37	-1.786	36.23
3.0	.010	1.70	2.0	2500.	.023	11.19	2000.	.016	13.31	3.099	24.50
3.0	.010	1.70	2.0	2500.	.023	11.19	2500.	.028	25.47	2.933	36.65
3.0	.010	1.70	2.0	2500.	.023	11.19	3000.	.041	37.37	2.933	48.56
3.0	.010	1.70	2.0	3000.	.036	16.90	2000.	.016	13.31	3.005	30.21
3.0	.010	1.70	2.0	3000.	.036	16.90	2500.	.028	25.47	2.839	42.37
3.0	.010	1.70	2.0	3000.	.036	16.90	3000.	.041	37.37	2.839	54.28

1.0	.022	1.30	1.0	1591.	.000	22.75	2000.	.028	21.41	2.069	44.16
1.0	.022	1.30	1.0	1591.	.000	22.75	2500.	.041	26.71	2.250	49.47
1.0	.022	1.30	1.0	1591.	.000	22.75	3000.	.054	31.81	2.411	54.56
1.0	.022	1.30	1.0	2500.	.021	35.21	2000.	.028	21.41	2.286	56.62
1.0	.022	1.30	1.0	2500.	.021	35.21	2500.	.041	26.71	2.467	61.92
1.0	.022	1.30	1.0	2500.	.021	35.21	3000.	.054	31.81	2.629	67.02
1.0	.022	1.30	1.0	3000.	.033	41.75	2000.	.028	21.41	2.393	63.15
1.0	.022	1.30	1.0	3000.	.033	41.75	2500.	.041	26.71	2.574	68.46
1.0	.022	1.30	1.0	3000.	.033	41.75	3000.	.054	31.81	2.736	73.55
1.0	.022	1.30	1.5	1570.	.000	17.45	2000.	.028	25.69	2.164	43.14
1.0	.022	1.30	1.5	1570.	.000	17.45	2500.	.041	32.05	2.381	49.50
1.0	.022	1.30	1.5	1570.	.000	17.45	3000.	.054	38.17	2.575	55.62
1.0	.022	1.30	1.5	2500.	.021	27.43	2000.	.028	25.69	2.341	53.12
1.0	.022	1.30	1.5	2500.	.021	27.43	2500.	.041	32.05	2.558	59.49
1.0	.022	1.30	1.5	2500.	.021	27.43	3000.	.054	38.17	2.752	65.60
1.0	.022	1.30	1.5	3000.	.034	32.54	2000.	.028	25.69	2.427	58.23
1.0	.022	1.30	1.5	3000.	.034	32.54	2500.	.041	32.05	2.644	64.59
1.0	.022	1.30	1.5	3000.	.034	32.54	3000.	.054	38.17	2.838	70.71
1.0	.022	1.30	2.0	1549.	.000	13.89	2000.	.028	28.54	2.231	42.43
1.0	.022	1.30	2.0	1549.	.000	13.89	2500.	.041	35.61	2.472	49.50
1.0	.022	1.30	2.0	1549.	.000	13.89	3000.	.054	42.41	2.688	56.30
1.0	.022	1.30	2.0	2500.	.021	22.20	2000.	.028	28.54	2.380	50.74
1.0	.022	1.30	2.0	2500.	.021	22.20	2500.	.041	35.61	2.622	57.81
1.0	.022	1.30	2.0	2500.	.021	22.20	3000.	.054	42.41	2.837	64.61
1.0	.022	1.30	2.0	3000.	.034	26.35	2000.	.028	28.54	2.453	54.89
1.0	.022	1.30	2.0	3000.	.034	26.35	2500.	.041	35.61	2.694	61.96
1.0	.022	1.30	2.0	3000.	.034	26.35	3000.	.054	42.41	2.909	68.76
1.0	.022	1.50	1.0	1567.	.000	21.66	2000.	.028	24.69	1.937	46.35
1.0	.022	1.50	1.0	1567.	.000	21.66	2500.	.040	30.63	2.103	52.29
1.0	.022	1.50	1.0	1567.	.000	21.66	3000.	.054	36.36	2.250	58.03
1.0	.022	1.50	1.0	2500.	.021	34.14	2000.	.028	24.69	2.158	58.83
1.0	.022	1.50	1.0	2500.	.021	34.14	2500.	.040	30.63	2.325	64.77
1.0	.022	1.50	1.0	2500.	.021	34.14	3000.	.054	36.36	2.471	70.51
1.0	.022	1.50	1.0	3000.	.034	40.50	2000.	.028	24.69	2.266	65.19
1.0	.022	1.50	1.0	3000.	.034	40.50	2500.	.040	30.63	2.433	71.13
1.0	.022	1.50	1.0	3000.	.034	40.50	3000.	.054	36.36	2.579	76.87
1.0	.022	1.50	1.5	1534.	.000	16.07	2000.	.028	29.62	2.016	45.69
1.0	.022	1.50	1.5	1534.	.000	16.07	2500.	.040	36.76	2.216	52.82
1.0	.022	1.50	1.5	1534.	.000	16.07	3000.	.054	43.64	2.391	59.70
1.0	.022	1.50	1.5	2500.	.022	26.01	2000.	.028	29.62	2.196	55.63
1.0	.022	1.50	1.5	2500.	.022	26.01	2500.	.040	36.76	2.396	62.77
1.0	.022	1.50	1.5	2500.	.022	26.01	3000.	.054	43.64	2.572	69.65
1.0	.022	1.50	1.5	3000.	.035	30.89	2000.	.028	29.62	2.284	60.51
1.0	.022	1.50	1.5	3000.	.035	30.89	2500.	.040	36.76	2.484	67.64
1.0	.022	1.50	1.5	3000.	.035	30.89	3000.	.054	43.64	2.660	74.52
1.0	.022	1.50	2.0	1501.	.000	12.25	2000.	.028	32.92	2.081	45.17
1.0	.022	1.50	2.0	1501.	.000	12.25	2500.	.040	40.84	2.303	53.09
1.0	.022	1.50	2.0	1501.	.000	12.25	3000.	.054	48.49	2.499	60.74
1.0	.022	1.50	2.0	2500.	.022	20.44	2000.	.028	32.92	2.234	53.35
1.0	.022	1.50	2.0	2500.	.022	20.44	2500.	.040	40.84	2.455	61.28
1.0	.022	1.50	2.0	2500.	.022	20.44	3000.	.054	48.49	2.651	68.92
1.0	.022	1.50	2.0	3000.	.035	24.30	2000.	.028	32.92	2.308	57.22
1.0	.022	1.50	2.0	3000.	.035	24.30	2500.	.040	40.84	2.530	65.14
1.0	.022	1.50	2.0	3000.	.035	24.30	3000.	.054	48.49	2.725	72.79

1.0	.022	1.70	1.0	1545.	.000	20.62	2000.	.028	27.15	1.877	47.77
1.0	.022	1.70	1.0	1545.	.000	20.62	2500.	.040	33.57	2.034	54.19
1.0	.022	1.70	1.0	1545.	.000	20.62	3000.	.053	39.78	2.171	60.40
1.0	.022	1.70	1.0	2500.	.022	33.08	2000.	.028	27.15	2.101	60.23
1.0	.022	1.70	1.0	2500.	.022	33.08	2500.	.040	33.57	2.258	66.65
1.0	.022	1.70	1.0	2500.	.022	33.08	3000.	.053	39.78	2.396	72.86
1.0	.022	1.70	1.0	3000.	.034	39.27	2000.	.028	27.15	2.210	66.42
1.0	.022	1.70	1.0	3000.	.034	39.27	2500.	.040	33.57	2.367	72.84
1.0	.022	1.70	1.0	3000.	.034	39.27	3000.	.053	39.78	2.505	79.05
1.0	.022	1.70	1.5	1501.	.000	14.71	2000.	.028	32.58	1.961	47.28
1.0	.022	1.70	1.5	1501.	.000	14.71	2500.	.040	40.28	2.150	54.99
1.0	.022	1.70	1.5	1501.	.000	14.71	3000.	.053	47.74	2.315	62.44
1.0	.022	1.70	1.5	2500.	.022	24.53	2000.	.028	32.58	2.144	57.10
1.0	.022	1.70	1.5	2500.	.022	24.53	2500.	.040	40.28	2.332	64.81
1.0	.022	1.70	1.5	2500.	.022	24.53	3000.	.053	47.74	2.497	72.26
1.0	.022	1.70	1.5	3000.	.035	29.17	2000.	.028	32.58	2.233	61.74
1.0	.022	1.70	1.5	3000.	.035	29.17	2500.	.040	40.28	2.422	69.45
1.0	.022	1.70	1.5	3000.	.035	29.17	3000.	.053	47.74	2.587	76.90
1.0	.022	1.70	2.0	1458.	.000	10.60	2000.	.028	36.20	2.052	46.79
1.0	.022	1.70	2.0	1458.	.000	10.60	2500.	.040	44.76	2.262	55.36
1.0	.022	1.70	2.0	1458.	.000	10.60	3000.	.053	53.04	2.445	63.64
1.0	.022	1.70	2.0	2500.	.023	18.52	2000.	.028	36.20	2.202	54.71
1.0	.022	1.70	2.0	2500.	.023	18.52	2500.	.040	44.76	2.412	63.28
1.0	.022	1.70	2.0	2500.	.023	18.52	3000.	.053	53.04	2.595	71.56
1.0	.022	1.70	2.0	3000.	.036	22.07	2000.	.028	36.20	2.280	58.27
1.0	.022	1.70	2.0	3000.	.036	22.07	2500.	.040	44.76	2.489	66.83
1.0	.022	1.70	2.0	3000.	.036	22.07	3000.	.053	53.04	2.672	75.11
2.0	.018	1.30	1.0	1597.	.000	14.97	2000.	.025	22.36	2.065	37.33
2.0	.018	1.30	1.0	1597.	.000	14.97	2500.	.037	30.78	2.153	45.75
2.0	.018	1.30	1.0	1597.	.000	14.97	3000.	.050	38.98	2.235	53.95
2.0	.018	1.30	1.0	2500.	.021	30.22	2000.	.025	22.36	2.137	52.58
2.0	.018	1.30	1.0	2500.	.021	30.22	2500.	.037	30.78	2.226	60.99
2.0	.018	1.30	1.0	2500.	.021	30.22	3000.	.050	38.98	2.307	69.19
2.0	.018	1.30	1.0	3000.	.034	38.35	2000.	.025	22.36	2.200	60.71
2.0	.018	1.30	1.0	3000.	.034	38.35	2500.	.037	30.78	2.288	69.13
2.0	.018	1.30	1.0	3000.	.034	38.35	3000.	.050	38.98	2.370	77.32
2.0	.018	1.30	1.5	1576.	.000	11.49	2000.	.025	26.84	2.083	38.33
2.0	.018	1.30	1.5	1576.	.000	11.49	2500.	.037	36.93	2.189	48.42
2.0	.018	1.30	1.5	1576.	.000	11.49	3000.	.050	46.77	2.287	58.26
2.0	.018	1.30	1.5	2500.	.021	23.89	2000.	.025	26.84	2.126	50.72
2.0	.018	1.30	1.5	2500.	.021	23.89	2500.	.037	36.93	2.232	60.82
2.0	.018	1.30	1.5	2500.	.021	23.89	3000.	.050	46.77	2.330	70.66
2.0	.018	1.30	1.5	3000.	.034	30.35	2000.	.025	26.84	2.173	57.19
2.0	.018	1.30	1.5	3000.	.034	30.35	2500.	.037	36.93	2.280	67.28
2.0	.018	1.30	1.5	3000.	.034	30.35	3000.	.050	46.77	2.378	77.12
2.0	.018	1.30	2.0	1556.	.000	9.16	2000.	.025	29.82	2.098	38.98
2.0	.018	1.30	2.0	1556.	.000	9.16	2500.	.037	41.04	2.217	50.20
2.0	.018	1.30	2.0	1556.	.000	9.16	3000.	.050	51.97	2.326	61.13
2.0	.018	1.30	2.0	2500.	.022	19.65	2000.	.025	29.82	2.119	49.47
2.0	.018	1.30	2.0	2500.	.022	19.65	2500.	.037	41.04	2.238	60.69
2.0	.018	1.30	2.0	2500.	.022	19.65	3000.	.050	51.97	2.347	71.62
2.0	.018	1.30	2.0	3000.	.035	24.99	2000.	.025	29.82	2.157	54.81
2.0	.018	1.30	2.0	3000.	.035	24.99	2500.	.037	41.04	2.275	66.03
2.0	.018	1.30	2.0	3000.	.035	24.99	3000.	.050	51.97	2.385	76.96

2.0	.018	1.50	1.0	1573.	.000	14.27	2000.	.024	22.98	2.073	37.24
2.0	.018	1.50	1.0	1573.	.000	14.27	2500.	.036	31.51	2.168	45.77
2.0	.018	1.50	1.0	1573.	.000	14.27	3000.	.050	39.82	2.252	54.09
2.0	.018	1.50	1.0	2500.	.021	29.80	2000.	.024	22.98	2.124	52.78
2.0	.018	1.50	1.0	2500.	.021	29.80	2500.	.036	31.51	2.218	61.31
2.0	.018	1.50	1.0	2500.	.021	29.80	3000.	.050	39.82	2.303	69.63
2.0	.018	1.50	1.0	3000.	.034	37.87	2000.	.024	22.98	2.183	60.85
2.0	.018	1.50	1.0	3000.	.034	37.87	2500.	.036	31.51	2.278	69.38
2.0	.018	1.50	1.0	3000.	.034	37.87	3000.	.050	39.82	2.362	77.69
2.0	.018	1.50	1.5	1541.	.000	10.62	2000.	.024	27.57	2.104	38.19
2.0	.018	1.50	1.5	1541.	.000	10.62	2500.	.036	37.81	2.217	48.42
2.0	.018	1.50	1.5	1541.	.000	10.62	3000.	.050	47.79	2.318	58.40
2.0	.018	1.50	1.5	2500.	.022	23.34	2000.	.024	27.57	2.114	50.91
2.0	.018	1.50	1.5	2500.	.022	23.34	2500.	.036	37.81	2.227	61.14
2.0	.018	1.50	1.5	2500.	.022	23.34	3000.	.050	47.79	2.328	71.12
2.0	.018	1.50	1.5	3000.	.035	29.71	2000.	.024	27.57	2.157	57.28
2.0	.018	1.50	1.5	3000.	.035	29.71	2500.	.036	37.81	2.270	67.52
2.0	.018	1.50	1.5	3000.	.035	29.71	3000.	.050	47.79	2.372	77.50
2.0	.018	1.50	2.0	1509.	.000	8.15	2000.	.024	30.63	2.137	38.78
2.0	.018	1.50	2.0	1509.	.000	8.15	2500.	.036	42.01	2.263	50.15
2.0	.018	1.50	2.0	1509.	.000	8.15	3000.	.050	53.10	2.375	61.24
2.0	.018	1.50	2.0	2500.	.023	18.97	2000.	.024	30.63	2.111	49.60
2.0	.018	1.50	2.0	2500.	.023	18.97	2500.	.036	42.01	2.237	60.97
2.0	.018	1.50	2.0	2500.	.023	18.97	3000.	.050	53.10	2.350	72.06
2.0	.018	1.50	2.0	3000.	.036	24.20	2000.	.024	30.63	2.143	54.83
2.0	.018	1.50	2.0	3000.	.036	24.20	2500.	.036	42.01	2.269	66.21
2.0	.018	1.50	2.0	3000.	.036	24.20	3000.	.050	53.10	2.382	77.30
2.0	.018	1.70	1.0	1552.	.000	13.61	2000.	.024	23.46	2.093	37.07
2.0	.018	1.70	1.0	1552.	.000	13.61	2500.	.036	32.08	2.192	45.69
2.0	.018	1.70	1.0	1552.	.000	13.61	3000.	.049	40.49	2.278	54.10
2.0	.018	1.70	1.0	2500.	.022	29.39	2000.	.024	23.46	2.119	52.85
2.0	.018	1.70	1.0	2500.	.022	29.39	2500.	.036	32.08	2.218	61.47
2.0	.018	1.70	1.0	2500.	.022	29.39	3000.	.049	40.49	2.305	69.88
2.0	.018	1.70	1.0	3000.	.035	37.39	2000.	.024	23.46	2.175	60.85
2.0	.018	1.70	1.0	3000.	.035	37.39	2500.	.036	32.08	2.274	69.47
2.0	.018	1.70	1.0	3000.	.035	37.39	3000.	.049	40.49	2.361	77.88
2.0	.018	1.70	1.5	1509.	.000	9.78	2000.	.024	28.15	2.145	37.93
2.0	.018	1.70	1.5	1509.	.000	9.78	2500.	.036	38.50	2.263	48.27
2.0	.018	1.70	1.5	1509.	.000	9.78	3000.	.049	48.59	2.368	58.36
2.0	.018	1.70	1.5	2500.	.023	22.76	2000.	.024	28.15	2.114	50.91
2.0	.018	1.70	1.5	2500.	.023	22.76	2500.	.036	38.50	2.233	61.26
2.0	.018	1.70	1.5	2500.	.023	22.76	3000.	.049	48.59	2.337	71.35
2.0	.018	1.70	1.5	3000.	.036	29.04	2000.	.024	28.15	2.153	57.19
2.0	.018	1.70	1.5	3000.	.036	29.04	2500.	.036	38.50	2.271	67.54
2.0	.018	1.70	1.5	3000.	.036	29.04	3000.	.049	48.59	2.376	77.63
2.0	.018	1.70	2.0	1465.	.000	7.15	2000.	.024	31.28	2.212	38.43
2.0	.018	1.70	2.0	1465.	.000	7.15	2500.	.036	42.77	2.344	49.92
2.0	.018	1.70	2.0	1465.	.000	7.15	3000.	.049	53.98	2.460	61.13
2.0	.018	1.70	2.0	2500.	.024	18.21	2000.	.024	31.28	2.119	49.49
2.0	.018	1.70	2.0	2500.	.024	18.21	2500.	.036	42.77	2.251	60.99
2.0	.018	1.70	2.0	2500.	.024	18.21	3000.	.049	53.98	2.367	72.20
2.0	.018	1.70	2.0	3000.	.037	23.33	2000.	.024	31.28	2.146	54.60
2.0	.018	1.70	2.0	3000.	.037	23.33	2500.	.036	42.77	2.278	66.10
2.0	.018	1.70	2.0	3000.	.037	23.33	3000.	.049	53.98	2.394	77.31

3.0	.011	1.30	1.0	1592.	.000	2.51	2000.	.018	11.18	5.419	13.68
3.0	.011	1.30	1.0	1592.	.000	2.51	2500.	.030	20.30	5.304	22.81
3.0	.011	1.30	1.0	1592.	.000	2.51	3000.	.043	29.24	5.302	31.74
3.0	.011	1.30	1.0	2500.	.020	18.84	2000.	.018	11.18	2.941	30.01
3.0	.011	1.30	1.0	2500.	.020	18.84	2500.	.030	20.30	2.826	39.14
3.0	.011	1.30	1.0	2500.	.020	18.84	3000.	.043	29.24	2.824	48.07
3.0	.011	1.30	1.0	3000.	.033	27.55	2000.	.018	11.18	2.886	38.73
3.0	.011	1.30	1.0	3000.	.033	27.55	2500.	.030	20.30	2.770	47.85
3.0	.011	1.30	1.0	3000.	.033	27.55	3000.	.043	29.24	2.769	56.79
3.0	.011	1.30	1.5	1572.	.000	1.64	2000.	.018	13.41	5.627	15.05
3.0	.011	1.30	1.5	1572.	.000	1.64	2500.	.030	24.36	5.489	26.00
3.0	.011	1.30	1.5	1572.	.000	1.64	3000.	.043	35.08	5.487	36.72
3.0	.011	1.30	1.5	2500.	.021	14.98	2000.	.018	13.41	2.951	28.39
3.0	.011	1.30	1.5	2500.	.021	14.98	2500.	.030	24.36	2.813	39.35
3.0	.011	1.30	1.5	2500.	.021	14.98	3000.	.043	35.08	2.811	50.07
3.0	.011	1.30	1.5	3000.	.034	21.94	2000.	.018	13.41	2.900	35.35
3.0	.011	1.30	1.5	3000.	.034	21.94	2500.	.030	24.36	2.762	46.30
3.0	.011	1.30	1.5	3000.	.034	21.94	3000.	.043	35.08	2.760	57.02
3.0	.011	1.30	2.0	1551.	.000	1.05	2000.	.018	14.90	6.139	15.95
3.0	.011	1.30	2.0	1551.	.000	1.05	2500.	.030	27.07	5.985	28.12
3.0	.011	1.30	2.0	1551.	.000	1.05	3000.	.043	38.98	5.983	40.03
3.0	.011	1.30	2.0	2500.	.021	12.40	2000.	.018	14.90	2.958	27.31
3.0	.011	1.30	2.0	2500.	.021	12.40	2500.	.030	27.07	2.805	39.48
3.0	.011	1.30	2.0	2500.	.021	12.40	3000.	.043	38.98	2.802	51.38
3.0	.011	1.30	2.0	3000.	.034	18.19	2000.	.018	14.90	2.910	33.09
3.0	.011	1.30	2.0	3000.	.034	18.19	2500.	.030	27.07	2.756	45.26
3.0	.011	1.30	2.0	3000.	.034	18.19	3000.	.043	38.98	2.754	57.17
3.0	.011	1.50	1.0	1569.	.000	1.97	2000.	.017	11.25	6.449	13.23
3.0	.011	1.50	1.0	1569.	.000	1.97	2500.	.029	20.39	6.354	22.37
3.0	.011	1.50	1.0	1569.	.000	1.97	3000.	.042	29.34	6.359	31.31
3.0	.011	1.50	1.0	2500.	.021	18.71	2000.	.017	11.25	2.928	29.96
3.0	.011	1.50	1.0	2500.	.021	18.71	2500.	.029	20.39	2.833	39.10
3.0	.011	1.50	1.0	2500.	.021	18.71	3000.	.042	29.34	2.839	48.05
3.0	.011	1.50	1.0	3000.	.034	27.40	2000.	.017	11.25	2.863	38.66
3.0	.011	1.50	1.0	3000.	.034	27.40	2500.	.029	20.39	2.768	47.80
3.0	.011	1.50	1.0	3000.	.034	27.40	3000.	.042	29.34	2.774	56.74
3.0	.011	1.50	1.5	1536.	.000	.98	2000.	.017	13.50	8.189	14.48
3.0	.011	1.50	1.5	1536.	.000	.98	2500.	.029	24.47	8.075	25.45
3.0	.011	1.50	1.5	1536.	.000	.98	3000.	.042	35.21	8.082	36.19
3.0	.011	1.50	1.5	2500.	.022	14.81	2000.	.017	13.50	2.938	28.31
3.0	.011	1.50	1.5	2500.	.022	14.81	2500.	.029	24.47	2.824	39.28
3.0	.011	1.50	1.5	2500.	.022	14.81	3000.	.042	35.21	2.831	50.01
3.0	.011	1.50	1.5	3000.	.035	21.73	2000.	.017	13.50	2.875	35.24
3.0	.011	1.50	1.5	3000.	.035	21.73	2500.	.029	24.47	2.761	46.21
3.0	.011	1.50	1.5	3000.	.035	21.73	3000.	.042	35.21	2.767	56.94
3.0	.011	1.50	2.0	1503.	.000	.30	2000.	.017	15.00	16.616	15.31
3.0	.011	1.50	2.0	1503.	.000	.30	2500.	.029	27.19	16.489	27.49
3.0	.011	1.50	2.0	1503.	.000	.30	3000.	.042	39.12	16.497	39.42
3.0	.011	1.50	2.0	2500.	.022	12.18	2000.	.017	15.00	2.947	27.18
3.0	.011	1.50	2.0	2500.	.022	12.18	2500.	.029	27.19	2.821	39.37
3.0	.011	1.50	2.0	2500.	.022	12.18	3000.	.042	39.12	2.828	51.30
3.0	.011	1.50	2.0	3000.	.035	17.93	2000.	.017	15.00	2.884	32.93
3.0	.011	1.50	2.0	3000.	.035	17.93	2500.	.029	27.19	2.758	45.12
3.0	.011	1.50	2.0	3000.	.035	17.93	3000.	.042	39.12	2.765	57.04

3.0	.011	1.70	1.0	1547.	.000	1.48	2000.	.017	11.31	8.105	12.79
3.0	.011	1.70	1.0	1547.	.000	1.48	2500.	.029	20.46	8.028	21.94
3.0	.011	1.70	1.0	1547.	.000	1.48	3000.	.042	29.42	8.039	30.90
3.0	.011	1.70	1.0	2500.	.021	18.58	2000.	.017	11.31	2.920	29.89
3.0	.011	1.70	1.0	2500.	.021	18.58	2500.	.029	20.46	2.842	39.04
3.0	.011	1.70	1.0	2500.	.021	18.58	3000.	.042	29.42	2.854	48.00
3.0	.011	1.70	1.0	3000.	.034	27.25	2000.	.017	11.31	2.846	38.56
3.0	.011	1.70	1.0	3000.	.034	27.25	2500.	.029	20.46	2.768	47.71
3.0	.011	1.70	1.0	3000.	.034	27.25	3000.	.042	29.42	2.780	56.67
3.0	.011	1.70	1.5	1503.	.000	.36	2000.	.017	13.58	19.288	13.94
3.0	.011	1.70	1.5	1503.	.000	.36	2500.	.029	24.56	19.195	24.92
3.0	.011	1.70	1.5	1503.	.000	.36	3000.	.042	35.30	19.209	35.66
3.0	.011	1.70	1.5	2500.	.022	14.61	2000.	.017	13.58	2.932	28.19
3.0	.011	1.70	1.5	2500.	.022	14.61	2500.	.029	24.56	2.839	39.17
3.0	.011	1.70	1.5	2500.	.022	14.61	3000.	.042	35.30	2.853	49.92
3.0	.011	1.70	1.5	3000.	.035	21.51	2000.	.017	13.58	2.856	35.09
3.0	.011	1.70	1.5	3000.	.035	21.51	2500.	.029	24.56	2.763	46.07
3.0	.011	1.70	1.5	3000.	.035	21.51	3000.	.042	35.30	2.778	56.82
3.0	.011	1.70	2.0	1460.	.000	-.42	2000.	.017	15.09	-8.893	14.67
3.0	.011	1.70	2.0	1460.	.000	-.42	2500.	.029	27.28	-8.996	26.87
3.0	.011	1.70	2.0	1460.	.000	-.42	3000.	.042	39.23	-8.980	38.81
3.0	.011	1.70	2.0	2500.	.023	11.92	2000.	.017	15.09	2.946	27.01
3.0	.011	1.70	2.0	2500.	.023	11.92	2500.	.029	27.28	2.843	39.20
3.0	.011	1.70	2.0	2500.	.023	11.92	3000.	.042	39.23	2.859	51.15
3.0	.011	1.70	2.0	3000.	.036	17.63	2000.	.017	15.09	2.868	32.71
3.0	.011	1.70	2.0	3000.	.036	17.63	2500.	.029	27.28	2.765	44.91
3.0	.011	1.70	2.0	3000.	.036	17.63	3000.	.042	39.23	2.781	56.85

1.0	.023	1.30	1.0	1579.	.000	21.08	2000.	.030	21.49	2.273	42.57
1.0	.023	1.30	1.0	1579.	.000	21.08	2500.	.044	26.87	2.467	47.95
1.0	.023	1.30	1.0	1579.	.000	21.08	3000.	.058	32.05	2.640	53.13
1.0	.023	1.30	1.0	2500.	.022	33.27	2000.	.030	21.49	2.490	54.76
1.0	.023	1.30	1.0	2500.	.022	33.27	2500.	.044	26.87	2.684	60.14
1.0	.023	1.30	1.0	2500.	.022	33.27	3000.	.058	32.05	2.857	65.32
1.0	.023	1.30	1.0	3000.	.035	39.60	2000.	.030	21.49	2.600	61.10
1.0	.023	1.30	1.0	3000.	.035	39.60	2500.	.044	26.87	2.794	66.47
1.0	.023	1.30	1.0	3000.	.035	39.60	3000.	.058	32.05	2.967	71.65
1.0	.023	1.30	1.5	1558.	.000	16.09	2000.	.030	25.79	2.365	41.88
1.0	.023	1.30	1.5	1558.	.000	16.09	2500.	.044	32.24	2.598	48.33
1.0	.023	1.30	1.5	1558.	.000	16.09	3000.	.058	38.46	2.806	54.55
1.0	.023	1.30	1.5	2500.	.022	25.84	2000.	.030	25.79	2.540	51.63
1.0	.023	1.30	1.5	2500.	.022	25.84	2500.	.044	32.24	2.773	58.08
1.0	.023	1.30	1.5	2500.	.022	25.84	3000.	.058	38.46	2.981	64.30
1.0	.023	1.30	1.5	3000.	.036	30.78	2000.	.030	25.79	2.629	56.57
1.0	.023	1.30	1.5	3000.	.036	30.78	2500.	.044	32.24	2.862	63.02
1.0	.023	1.30	1.5	3000.	.036	30.78	3000.	.058	38.46	3.070	69.24
1.0	.023	1.30	2.0	1536.	.000	12.73	2000.	.030	28.66	2.432	41.39
1.0	.023	1.30	2.0	1536.	.000	12.73	2500.	.044	35.82	2.691	48.55
1.0	.023	1.30	2.0	1536.	.000	12.73	3000.	.058	42.73	2.922	55.46
1.0	.023	1.30	2.0	2500.	.023	20.83	2000.	.030	28.66	2.578	49.49
1.0	.023	1.30	2.0	2500.	.023	20.83	2500.	.044	35.82	2.837	56.65
1.0	.023	1.30	2.0	2500.	.023	20.83	3000.	.058	42.73	3.068	63.56
1.0	.023	1.30	2.0	3000.	.036	24.83	2000.	.030	28.66	2.653	53.49
1.0	.023	1.30	2.0	3000.	.036	24.83	2500.	.044	35.82	2.911	60.65
1.0	.023	1.30	2.0	3000.	.036	24.83	3000.	.058	42.73	3.143	67.56
1.0	.023	1.50	1.0	1554.	.000	19.96	2000.	.030	24.79	2.143	44.75
1.0	.023	1.50	1.0	1554.	.000	19.96	2500.	.043	30.81	2.321	50.77
1.0	.023	1.50	1.0	1554.	.000	19.96	3000.	.058	36.65	2.478	56.61
1.0	.023	1.50	1.0	2500.	.022	32.14	2000.	.030	24.79	2.362	56.93
1.0	.023	1.50	1.0	2500.	.022	32.14	2500.	.043	30.81	2.540	62.95
1.0	.023	1.50	1.0	2500.	.022	32.14	3000.	.058	36.65	2.697	68.79
1.0	.023	1.50	1.0	3000.	.036	38.29	2000.	.030	24.79	2.473	63.08
1.0	.023	1.50	1.0	3000.	.036	38.29	2500.	.043	30.81	2.651	69.10
1.0	.023	1.50	1.0	3000.	.036	38.29	3000.	.058	36.65	2.808	74.94
1.0	.023	1.50	1.5	1521.	.000	14.66	2000.	.030	29.74	2.224	44.41
1.0	.023	1.50	1.5	1521.	.000	14.66	2500.	.043	36.97	2.437	51.63
1.0	.023	1.50	1.5	1521.	.000	14.66	3000.	.058	43.98	2.626	58.64
1.0	.023	1.50	1.5	2500.	.023	24.33	2000.	.030	29.74	2.399	54.08
1.0	.023	1.50	1.5	2500.	.023	24.33	2500.	.043	36.97	2.613	61.30
1.0	.023	1.50	1.5	2500.	.023	24.33	3000.	.058	43.98	2.801	68.31
1.0	.023	1.50	1.5	3000.	.036	29.02	2000.	.030	29.74	2.489	58.77
1.0	.023	1.50	1.5	3000.	.036	29.02	2500.	.043	36.97	2.703	66.00
1.0	.023	1.50	1.5	3000.	.036	29.02	3000.	.058	43.98	2.891	73.00
1.0	.023	1.50	2.0	1487.	.000	11.04	2000.	.030	33.05	2.296	44.09
1.0	.023	1.50	2.0	1487.	.000	11.04	2500.	.043	41.08	2.534	52.12
1.0	.023	1.50	2.0	1487.	.000	11.04	3000.	.058	48.86	2.743	59.90
1.0	.023	1.50	2.0	2500.	.024	18.96	2000.	.030	33.05	2.440	52.01
1.0	.023	1.50	2.0	2500.	.024	18.96	2500.	.043	41.08	2.678	60.04
1.0	.023	1.50	2.0	2500.	.024	18.96	3000.	.058	48.86	2.887	67.82
1.0	.023	1.50	2.0	3000.	.037	22.65	2000.	.030	33.05	2.516	55.70
1.0	.023	1.50	2.0	3000.	.037	22.65	2500.	.043	41.08	2.754	63.74
1.0	.023	1.50	2.0	3000.	.037	22.65	3000.	.058	48.86	2.963	71.52

1.0	.023	1.70	1.0	1532.	.000	18.89	2000.	.029	27.26	2.090	46.14
1.0	.023	1.70	1.0	1532.	.000	18.89	2500.	.043	33.77	2.258	52.65
1.0	.023	1.70	1.0	1532.	.000	18.89	3000.	.057	40.09	2.405	58.98
1.0	.023	1.70	1.0	2500.	.023	31.02	2000.	.029	27.26	2.310	58.27
1.0	.023	1.70	1.0	2500.	.023	31.02	2500.	.043	33.77	2.478	64.79
1.0	.023	1.70	1.0	2500.	.023	31.02	3000.	.057	40.09	2.625	71.11
1.0	.023	1.70	1.0	3000.	.036	36.98	2000.	.029	27.26	2.422	64.24
1.0	.023	1.70	1.0	3000.	.036	36.98	2500.	.043	33.77	2.590	70.75
1.0	.023	1.70	1.0	3000.	.036	36.98	3000.	.057	40.09	2.737	77.07
1.0	.023	1.70	1.5	1487.	.000	13.25	2000.	.029	32.71	2.186	45.96
1.0	.023	1.70	1.5	1487.	.000	13.25	2500.	.043	40.52	2.388	53.77
1.0	.023	1.70	1.5	1487.	.000	13.25	3000.	.057	48.11	2.565	61.36
1.0	.023	1.70	1.5	2500.	.024	22.75	2000.	.029	32.71	2.359	55.46
1.0	.023	1.70	1.5	2500.	.024	22.75	2500.	.043	40.52	2.560	63.27
1.0	.023	1.70	1.5	2500.	.024	22.75	3000.	.057	48.11	2.737	70.86
1.0	.023	1.70	1.5	3000.	.037	27.19	2000.	.029	32.71	2.450	59.90
1.0	.023	1.70	1.5	3000.	.037	27.19	2500.	.043	40.52	2.652	67.71
1.0	.023	1.70	1.5	3000.	.037	27.19	3000.	.057	48.11	2.828	75.30
1.0	.023	1.70	2.0	1442.	.000	9.32	2000.	.029	36.34	2.303	45.66
1.0	.023	1.70	2.0	1442.	.000	9.32	2500.	.043	45.02	2.527	54.34
1.0	.023	1.70	2.0	1442.	.000	9.32	3000.	.057	53.46	2.724	62.77
1.0	.023	1.70	2.0	2500.	.025	16.90	2000.	.029	36.34	2.434	53.24
1.0	.023	1.70	2.0	2500.	.025	16.90	2500.	.043	45.02	2.658	61.93
1.0	.023	1.70	2.0	2500.	.025	16.90	3000.	.057	53.46	2.854	70.36
1.0	.023	1.70	2.0	3000.	.038	20.26	2000.	.029	36.34	2.513	56.60
1.0	.023	1.70	2.0	3000.	.038	20.26	2500.	.043	45.02	2.737	65.29
1.0	.023	1.70	2.0	3000.	.038	20.26	3000.	.057	53.46	2.933	73.72
2.0	.019	1.30	1.0	1592.	.000	14.20	2000.	.026	22.50	2.256	38.70
2.0	.019	1.30	1.0	1592.	.000	14.20	2500.	.039	31.04	2.351	45.24
2.0	.019	1.30	1.0	1592.	.000	14.20	3000.	.054	39.40	2.438	53.60
2.0	.019	1.30	1.0	2500.	.022	29.44	2000.	.026	22.50	2.300	51.95
2.0	.019	1.30	1.0	2500.	.022	29.44	2500.	.039	31.04	2.395	60.48
2.0	.019	1.30	1.0	2500.	.022	29.44	3000.	.054	39.40	2.482	68.84
2.0	.019	1.30	1.0	3000.	.036	37.58	2000.	.026	22.50	2.360	60.08
2.0	.019	1.30	1.0	3000.	.036	37.58	2500.	.039	31.04	2.455	68.61
2.0	.019	1.30	1.0	3000.	.036	37.58	3000.	.054	39.40	2.542	76.97
2.0	.019	1.30	1.5	1571.	.000	10.87	2000.	.026	27.00	2.266	37.87
2.0	.019	1.30	1.5	1571.	.000	10.87	2500.	.039	37.25	2.380	48.12
2.0	.019	1.30	1.5	1571.	.000	10.87	3000.	.054	47.28	2.485	58.15
2.0	.019	1.30	1.5	2500.	.022	23.27	2000.	.026	27.00	2.282	50.27
2.0	.019	1.30	1.5	2500.	.022	23.27	2500.	.039	37.25	2.396	60.51
2.0	.019	1.30	1.5	2500.	.022	23.27	3000.	.054	47.28	2.500	70.54
2.0	.019	1.30	1.5	3000.	.036	29.72	2000.	.026	27.00	2.328	56.73
2.0	.019	1.30	1.5	3000.	.036	29.72	2500.	.039	37.25	2.441	66.97
2.0	.019	1.30	1.5	3000.	.036	29.72	3000.	.054	47.28	2.546	77.00
2.0	.019	1.30	2.0	1550.	.000	8.64	2000.	.026	30.00	2.278	38.64
2.0	.019	1.30	2.0	1550.	.000	8.64	2500.	.039	41.38	2.404	50.02
2.0	.019	1.30	2.0	1550.	.000	8.64	3000.	.054	52.53	2.521	61.17
2.0	.019	1.30	2.0	2500.	.023	19.13	2000.	.026	30.00	2.272	49.13
2.0	.019	1.30	2.0	2500.	.023	19.13	2500.	.039	41.38	2.398	60.51
2.0	.019	1.30	2.0	2500.	.023	19.13	3000.	.054	52.53	2.514	71.65
2.0	.019	1.30	2.0	3000.	.037	24.46	2000.	.026	30.00	2.307	54.47
2.0	.019	1.30	2.0	3000.	.037	24.46	2500.	.039	41.38	2.433	65.85
2.0	.019	1.30	2.0	3000.	.037	24.46	3000.	.054	52.53	2.550	76.99

2.0	.019	1.50	1.0	1568.	.000	13.49	2000.	.026	23.11	2.273	36.61
2.0	.019	1.50	1.0	1568.	.000	13.49	2500.	.039	31.77	2.374	45.26
2.0	.019	1.50	1.0	1568.	.000	13.49	3000.	.053	40.25	2.464	53.74
2.0	.019	1.50	1.0	2500.	.023	29.02	2000.	.026	23.11	2.288	52.14
2.0	.019	1.50	1.0	2500.	.023	29.02	2500.	.039	31.77	2.389	60.79
2.0	.019	1.50	1.0	2500.	.023	29.02	3000.	.053	40.25	2.479	69.27
2.0	.019	1.50	1.0	3000.	.036	37.09	2000.	.026	23.11	2.345	60.20
2.0	.019	1.50	1.0	3000.	.036	37.09	2500.	.039	31.77	2.446	68.86
2.0	.019	1.50	1.0	3000.	.036	37.09	3000.	.053	40.25	2.536	77.33
2.0	.019	1.50	1.5	1535.	.000	9.99	2000.	.026	27.74	2.300	37.72
2.0	.019	1.50	1.5	1535.	.000	9.99	2500.	.039	38.12	2.421	48.11
2.0	.019	1.50	1.5	1535.	.000	9.99	3000.	.053	48.30	2.529	58.28
2.0	.019	1.50	1.5	2500.	.023	22.70	2000.	.026	27.74	2.272	50.44
2.0	.019	1.50	1.5	2500.	.023	22.70	2500.	.039	38.12	2.393	60.82
2.0	.019	1.50	1.5	2500.	.023	22.70	3000.	.053	48.30	2.501	71.00
2.0	.019	1.50	1.5	3000.	.037	29.07	2000.	.026	27.74	2.313	56.80
2.0	.019	1.50	1.5	3000.	.037	29.07	2500.	.039	38.12	2.434	67.19
2.0	.019	1.50	1.5	3000.	.037	29.07	3000.	.053	48.30	2.542	77.36
2.0	.019	1.50	2.0	1502.	.000	7.61	2000.	.026	30.82	2.335	38.43
2.0	.019	1.50	2.0	1502.	.000	7.61	2500.	.039	42.36	2.469	49.97
2.0	.019	1.50	2.0	1502.	.000	7.61	3000.	.053	53.66	2.589	61.27
2.0	.019	1.50	2.0	2500.	.024	18.42	2000.	.026	30.82	2.266	49.24
2.0	.019	1.50	2.0	2500.	.024	18.42	2500.	.039	42.36	2.401	60.78
2.0	.019	1.50	2.0	2500.	.024	18.42	3000.	.053	53.66	2.521	72.08
2.0	.019	1.50	2.0	3000.	.038	23.65	2000.	.026	30.82	2.296	54.47
2.0	.019	1.50	2.0	3000.	.038	23.65	2500.	.039	42.36	2.430	66.00
2.0	.019	1.50	2.0	3000.	.038	23.65	3000.	.053	53.66	2.550	77.31
2.0	.019	1.70	1.0	1546.	.000	12.83	2000.	.025	23.60	2.302	36.42
2.0	.019	1.70	1.0	1546.	.000	12.83	2500.	.038	32.34	2.407	45.17
2.0	.019	1.70	1.0	1546.	.000	12.83	3000.	.053	40.92	2.500	53.74
2.0	.019	1.70	1.0	2500.	.023	28.60	2000.	.025	23.60	2.285	52.20
2.0	.019	1.70	1.0	2500.	.023	28.60	2500.	.038	32.34	2.391	60.95
2.0	.019	1.70	1.0	2500.	.023	28.60	3000.	.053	40.92	2.484	69.52
2.0	.019	1.70	1.0	3000.	.037	36.60	2000.	.025	23.60	2.338	60.19
2.0	.019	1.70	1.0	3000.	.037	36.60	2500.	.038	32.34	2.444	68.94
2.0	.019	1.70	1.0	3000.	.037	36.60	3000.	.053	40.92	2.536	77.51
2.0	.019	1.70	1.5	1502.	.000	9.14	2000.	.025	28.32	2.357	37.45
2.0	.019	1.70	1.5	1502.	.000	9.14	2500.	.038	38.81	2.484	47.95
2.0	.019	1.70	1.5	1502.	.000	9.14	3000.	.053	49.10	2.595	58.23
2.0	.019	1.70	1.5	2500.	.024	22.11	2000.	.025	28.32	2.276	50.42
2.0	.019	1.70	1.5	2500.	.024	22.11	2500.	.038	38.81	2.402	60.92
2.0	.019	1.70	1.5	2500.	.024	22.11	3000.	.053	49.10	2.513	71.21
2.0	.019	1.70	1.5	3000.	.038	28.38	2000.	.025	28.32	2.311	56.69
2.0	.019	1.70	1.5	3000.	.038	28.38	2500.	.038	38.81	2.437	67.19
2.0	.019	1.70	1.5	3000.	.038	28.38	3000.	.053	49.10	2.548	77.48
2.0	.019	1.70	2.0	1459.	.000	6.60	2000.	.025	31.46	2.438	38.06
2.0	.019	1.70	2.0	1459.	.000	6.60	2500.	.038	43.12	2.579	49.73
2.0	.019	1.70	2.0	1459.	.000	6.60	3000.	.053	54.55	2.702	61.16
2.0	.019	1.70	2.0	2500.	.025	17.65	2000.	.025	31.46	2.280	49.11
2.0	.019	1.70	2.0	2500.	.025	17.65	2500.	.038	43.12	2.421	60.77
2.0	.019	1.70	2.0	2500.	.025	17.65	3000.	.053	54.55	2.544	72.20
2.0	.019	1.70	2.0	3000.	.039	22.74	2000.	.025	31.46	2.302	54.21
2.0	.019	1.70	2.0	3000.	.039	22.74	2500.	.038	43.12	2.443	65.87
2.0	.019	1.70	2.0	3000.	.039	22.74	3000.	.053	54.55	2.567	77.30

3.0	.012	1.30	1.0	1589.	.000	2.00	2000.	.019	11.29	6.847	13.29
3.0	.012	1.30	1.0	1589.	.000	2.00	2500.	.032	20.54	6.728	22.54
3.0	.012	1.30	1.0	1589.	.000	2.00	3000.	.046	29.64	6.727	31.64
3.0	.012	1.30	1.0	2500.	.022	18.40	2000.	.019	11.29	3.155	29.68
3.0	.012	1.30	1.0	2500.	.022	18.40	2500.	.032	20.54	3.035	38.94
3.0	.012	1.30	1.0	2500.	.022	18.40	3000.	.046	29.64	3.035	48.04
3.0	.012	1.30	1.0	3000.	.035	27.16	2000.	.019	11.29	3.080	38.45
3.0	.012	1.30	1.0	3000.	.035	27.16	2500.	.032	20.54	2.961	47.71
3.0	.012	1.30	1.0	3000.	.035	27.16	3000.	.046	29.64	2.960	56.81
3.0	.012	1.30	1.5	1568.	.000	1.23	2000.	.019	13.55	7.372	14.77
3.0	.012	1.30	1.5	1568.	.000	1.23	2500.	.032	24.65	7.228	25.88
3.0	.012	1.30	1.5	1568.	.000	1.23	3000.	.046	35.57	7.227	36.80
3.0	.012	1.30	1.5	2500.	.022	14.63	2000.	.019	13.55	3.156	28.18
3.0	.012	1.30	1.5	2500.	.022	14.63	2500.	.032	24.65	3.012	39.28
3.0	.012	1.30	1.5	2500.	.022	14.63	3000.	.046	35.57	3.011	50.20
3.0	.012	1.30	1.5	3000.	.036	21.63	2000.	.019	13.55	3.089	35.18
3.0	.012	1.30	1.5	3000.	.036	21.63	2500.	.032	24.65	2.945	46.28
3.0	.012	1.30	1.5	3000.	.036	21.63	3000.	.046	35.57	2.944	57.20
3.0	.012	1.30	2.0	1547.	.000	.71	2000.	.019	15.05	8.709	15.76
3.0	.012	1.30	2.0	1547.	.000	.71	2500.	.032	27.39	8.549	28.10
3.0	.012	1.30	2.0	1547.	.000	.71	3000.	.046	39.52	8.548	40.23
3.0	.012	1.30	2.0	2500.	.023	12.11	2000.	.019	15.05	3.157	27.16
3.0	.012	1.30	2.0	2500.	.023	12.11	2500.	.032	27.39	2.998	39.50
3.0	.012	1.30	2.0	2500.	.023	12.11	3000.	.046	39.52	2.997	51.63
3.0	.012	1.30	2.0	3000.	.036	17.93	2000.	.019	15.05	3.095	32.98
3.0	.012	1.30	2.0	3000.	.036	17.93	2500.	.032	27.39	2.935	45.32
3.0	.012	1.30	2.0	3000.	.036	17.93	3000.	.046	39.52	2.934	57.45
3.0	.012	1.50	1.0	1565.	.000	1.46	2000.	.018	11.36	8.755	12.82
3.0	.012	1.50	1.0	1565.	.000	1.46	2500.	.031	20.63	8.656	22.09
3.0	.012	1.50	1.0	1565.	.000	1.46	3000.	.045	29.74	8.663	31.20
3.0	.012	1.50	1.0	2500.	.022	18.27	2000.	.018	11.36	3.144	29.63
3.0	.012	1.50	1.0	2500.	.022	18.27	2500.	.031	20.63	3.045	38.90
3.0	.012	1.50	1.0	2500.	.022	18.27	3000.	.045	29.74	3.052	48.01
3.0	.012	1.50	1.0	3000.	.036	27.02	2000.	.018	11.36	3.058	38.38
3.0	.012	1.50	1.0	3000.	.036	27.02	2500.	.031	20.63	2.959	47.64
3.0	.012	1.50	1.0	3000.	.036	27.02	3000.	.045	29.74	2.966	56.76
3.0	.012	1.50	1.5	1532.	.000	.57	2000.	.018	13.64	13.784	14.20
3.0	.012	1.50	1.5	1532.	.000	.57	2500.	.031	24.75	13.665	25.32
3.0	.012	1.50	1.5	1532.	.000	.57	3000.	.045	35.69	13.674	36.26
3.0	.012	1.50	1.5	2500.	.023	14.45	2000.	.018	13.64	3.145	28.09
3.0	.012	1.50	1.5	2500.	.023	14.45	2500.	.031	24.75	3.027	39.21
3.0	.012	1.50	1.5	2500.	.023	14.45	3000.	.045	35.69	3.035	50.14
3.0	.012	1.50	1.5	3000.	.037	21.42	2000.	.018	13.64	3.064	35.06
3.0	.012	1.50	1.5	3000.	.037	21.42	2500.	.031	24.75	2.945	46.18
3.0	.012	1.50	1.5	3000.	.037	21.42	3000.	.045	35.69	2.953	57.11
3.0	.012	1.50	2.0	1499.	.000	-.05	2000.	.018	15.15	-100.107	15.11
3.0	.012	1.50	2.0	1499.	.000	-.05	2500.	.031	27.51	-100.239	27.46
3.0	.012	1.50	2.0	1499.	.000	-.05	3000.	.045	39.65	-100.229	39.61
3.0	.012	1.50	2.0	2500.	.024	11.88	2000.	.018	15.15	3.149	27.03
3.0	.012	1.50	2.0	2500.	.024	11.88	2500.	.031	27.51	3.018	39.39
3.0	.012	1.50	2.0	2500.	.024	11.88	3000.	.045	39.65	3.027	51.54
3.0	.012	1.50	2.0	3000.	.038	17.67	2000.	.018	15.15	3.070	32.82
3.0	.012	1.50	2.0	3000.	.038	17.67	2500.	.031	27.51	2.938	45.17
3.0	.012	1.50	2.0	3000.	.038	17.67	3000.	.045	39.65	2.947	57.32

3.0	.012	1.70	1.0	1543.	.000	.96	2000.	.018	11.42	12.484	12.39
3.0	.012	1.70	1.0	1543.	.000	.96	2500.	.031	20.70	12.403	21.66
3.0	.012	1.70	1.0	1543.	.000	.96	3000.	.045	29.82	12.417	30.78
3.0	.012	1.70	1.0	2500.	.023	18.14	2000.	.018	11.42	3.137	29.56
3.0	.012	1.70	1.0	2500.	.023	18.14	2500.	.031	20.70	3.056	38.83
3.0	.012	1.70	1.0	2500.	.023	18.14	3000.	.045	29.82	3.070	47.95
3.0	.012	1.70	1.0	3000.	.037	26.86	2000.	.018	11.42	3.041	38.29
3.0	.012	1.70	1.0	3000.	.037	26.86	2500.	.031	20.70	2.960	47.56
3.0	.012	1.70	1.0	3000.	.037	26.86	3000.	.045	29.82	2.974	56.68
3.0	.012	1.70	1.5	1499.	.000	-.05	2000.	.018	13.71	-122.906	13.65
3.0	.012	1.70	1.5	1499.	.000	-.05	2500.	.031	24.84	-123.002	24.78
3.0	.012	1.70	1.5	1499.	.000	-.05	3000.	.045	35.78	-122.986	35.73
3.0	.012	1.70	1.5	2500.	.024	14.26	2000.	.018	13.71	3.141	27.96
3.0	.012	1.70	1.5	2500.	.024	14.26	2500.	.031	24.84	3.045	39.09
3.0	.012	1.70	1.5	2500.	.024	14.26	3000.	.045	35.78	3.061	50.04
3.0	.012	1.70	1.5	3000.	.038	21.20	2000.	.018	13.71	3.046	34.91
3.0	.012	1.70	1.5	3000.	.038	21.20	2500.	.031	24.84	2.950	46.04
3.0	.012	1.70	1.5	3000.	.038	21.20	3000.	.045	35.78	2.966	56.98
3.0	.012	1.70	2.0	1455.	.000	-.77	2000.	.018	15.23	-4.279	14.46
3.0	.012	1.70	2.0	1455.	.000	-.77	2500.	.031	27.59	-4.386	26.83
3.0	.012	1.70	2.0	1455.	.000	-.77	3000.	.045	39.76	-4.368	38.99
3.0	.012	1.70	2.0	2500.	.025	11.62	2000.	.018	15.23	3.152	26.85
3.0	.012	1.70	2.0	2500.	.025	11.62	2500.	.031	27.59	3.045	39.21
3.0	.012	1.70	2.0	2500.	.025	11.62	3000.	.045	39.76	3.063	51.38
3.0	.012	1.70	2.0	3000.	.039	17.36	2000.	.018	15.23	3.055	32.59
3.0	.012	1.70	2.0	3000.	.039	17.36	2500.	.031	27.59	2.948	44.96
3.0	.012	1.70	2.0	3000.	.039	17.36	3000.	.045	39.76	2.966	57.12

1.0	.023	1.30	1.0	1555.	.000	18.13	2000.	.030	21.49	2.436	39.62
1.0	.023	1.30	1.0	1555.	.000	18.13	2500.	.044	26.87	2.630	44.99
1.0	.023	1.30	1.0	1555.	.000	18.13	3000.	.058	32.05	2.803	50.18
1.0	.023	1.30	1.0	2500.	.021	29.62	2000.	.030	21.49	2.618	51.11
1.0	.023	1.30	1.0	2500.	.021	29.62	2500.	.044	26.87	2.812	56.49
1.0	.023	1.30	1.0	2500.	.021	29.62	3000.	.058	32.05	2.985	61.67
1.0	.023	1.30	1.0	3000.	.033	35.41	2000.	.030	21.49	2.718	56.90
1.0	.023	1.30	1.0	3000.	.033	35.41	2500.	.044	26.87	2.912	62.27
1.0	.023	1.30	1.0	3000.	.033	35.41	3000.	.058	32.05	3.086	67.46
1.0	.023	1.30	1.5	1533.	.000	13.69	2000.	.030	25.79	2.513	39.48
1.0	.023	1.30	1.5	1533.	.000	13.69	2500.	.044	32.24	2.746	45.92
1.0	.023	1.30	1.5	1533.	.000	13.69	3000.	.058	38.46	2.954	52.14
1.0	.023	1.30	1.5	2500.	.021	22.84	2000.	.030	25.79	2.655	48.63
1.0	.023	1.30	1.5	2500.	.021	22.84	2500.	.044	32.24	2.888	55.08
1.0	.023	1.30	1.5	2500.	.021	22.84	3000.	.058	38.46	3.096	61.30
1.0	.023	1.30	1.5	3000.	.034	27.34	2000.	.030	25.79	2.735	53.13
1.0	.023	1.30	1.5	3000.	.034	27.34	2500.	.044	32.24	2.968	59.57
1.0	.023	1.30	1.5	3000.	.034	27.34	3000.	.058	38.46	3.176	65.79
1.0	.023	1.30	2.0	1510.	.000	10.69	2000.	.030	28.66	2.573	39.35
1.0	.023	1.30	2.0	1510.	.000	10.69	2500.	.044	35.82	2.832	46.51
1.0	.023	1.30	2.0	1510.	.000	10.69	3000.	.058	42.73	3.063	53.42
1.0	.023	1.30	2.0	2500.	.022	18.26	2000.	.030	28.66	2.686	46.92
1.0	.023	1.30	2.0	2500.	.022	18.26	2500.	.044	35.82	2.945	54.08
1.0	.023	1.30	2.0	2500.	.022	18.26	3000.	.058	42.73	3.176	60.99
1.0	.023	1.30	2.0	3000.	.034	21.88	2000.	.030	28.66	2.754	50.53
1.0	.023	1.30	2.0	3000.	.034	21.88	2500.	.044	35.82	3.013	57.70
1.0	.023	1.30	2.0	3000.	.034	21.88	3000.	.058	42.73	3.244	64.61
1.0	.023	1.50	1.0	1529.	.000	16.94	2000.	.030	24.79	2.331	41.73
1.0	.023	1.50	1.0	1529.	.000	16.94	2500.	.043	30.81	2.509	47.76
1.0	.023	1.50	1.0	1529.	.000	16.94	3000.	.058	36.65	2.666	53.59
1.0	.023	1.50	1.0	2500.	.021	28.38	2000.	.030	24.79	2.508	53.17
1.0	.023	1.50	1.0	2500.	.021	28.38	2500.	.043	30.81	2.686	59.19
1.0	.023	1.50	1.0	2500.	.021	28.38	3000.	.058	36.65	2.843	65.02
1.0	.023	1.50	1.0	3000.	.034	33.97	2000.	.030	24.79	2.608	58.75
1.0	.023	1.50	1.0	3000.	.034	33.97	2500.	.043	30.81	2.787	64.78
1.0	.023	1.50	1.0	3000.	.034	33.97	3000.	.058	36.65	2.944	70.61
1.0	.023	1.50	1.5	1494.	.000	12.17	2000.	.030	29.74	2.413	41.91
1.0	.023	1.50	1.5	1494.	.000	12.17	2500.	.043	36.97	2.626	49.14
1.0	.023	1.50	1.5	1494.	.000	12.17	3000.	.058	43.98	2.815	56.14
1.0	.023	1.50	1.5	2500.	.022	21.17	2000.	.030	29.74	2.543	50.91
1.0	.023	1.50	1.5	2500.	.022	21.17	2500.	.043	36.97	2.756	58.14
1.0	.023	1.50	1.5	2500.	.022	21.17	3000.	.058	43.98	2.945	65.14
1.0	.023	1.50	1.5	3000.	.035	25.39	2000.	.030	29.74	2.624	55.14
1.0	.023	1.50	1.5	3000.	.035	25.39	2500.	.043	36.97	2.837	62.37
1.0	.023	1.50	1.5	3000.	.035	25.39	3000.	.058	43.98	3.026	69.37
1.0	.023	1.50	2.0	1458.	.000	8.88	2000.	.030	33.05	2.503	41.93
1.0	.023	1.50	2.0	1458.	.000	8.88	2500.	.043	41.08	2.741	49.96
1.0	.023	1.50	2.0	1458.	.000	8.88	3000.	.058	48.86	2.950	57.74
1.0	.023	1.50	2.0	2500.	.023	16.17	2000.	.030	33.05	2.593	49.22
1.0	.023	1.50	2.0	2500.	.023	16.17	2500.	.043	41.08	2.831	57.25
1.0	.023	1.50	2.0	2500.	.023	16.17	3000.	.058	48.86	3.040	65.03
1.0	.023	1.50	2.0	3000.	.036	19.45	2000.	.030	33.05	2.661	52.50
1.0	.023	1.50	2.0	3000.	.036	19.45	2500.	.043	41.08	2.898	60.53
1.0	.023	1.50	2.0	3000.	.036	19.45	3000.	.058	48.86	3.108	68.31

1.0	.023	1.70	1.0	1506.	.000	15.81	2000.	.029	27.26	2.308	43.06
1.0	.023	1.70	1.0	1506.	.000	15.81	2500.	.043	33.77	2.476	49.57
1.0	.023	1.70	1.0	1506.	.000	15.81	3000.	.057	40.09	2.623	55.90
1.0	.023	1.70	1.0	2500.	.022	27.13	2000.	.029	27.26	2.477	54.39
1.0	.023	1.70	1.0	2500.	.022	27.13	2500.	.043	33.77	2.645	60.90
1.0	.023	1.70	1.0	2500.	.022	27.13	3000.	.057	40.09	2.792	67.22
1.0	.023	1.70	1.0	3000.	.035	32.52	2000.	.029	27.26	2.578	59.78
1.0	.023	1.70	1.0	3000.	.035	32.52	2500.	.043	33.77	2.746	66.29
1.0	.023	1.70	1.0	3000.	.035	32.52	3000.	.057	40.09	2.893	72.61
1.0	.023	1.70	1.5	1458.	.000	10.66	2000.	.029	32.71	2.435	43.37
1.0	.023	1.70	1.5	1458.	.000	10.66	2500.	.043	40.52	2.636	51.18
1.0	.023	1.70	1.5	1458.	.000	10.66	3000.	.057	48.11	2.813	58.77
1.0	.023	1.70	1.5	2500.	.023	19.40	2000.	.029	32.71	2.542	52.11
1.0	.023	1.70	1.5	2500.	.023	19.40	2500.	.043	40.52	2.744	59.93
1.0	.023	1.70	1.5	2500.	.023	19.40	3000.	.057	48.11	2.920	67.51
1.0	.023	1.70	1.5	3000.	.036	23.34	2000.	.029	32.71	2.624	56.05
1.0	.023	1.70	1.5	3000.	.036	23.34	2500.	.043	40.52	2.825	63.86
1.0	.023	1.70	1.5	3000.	.036	23.34	3000.	.057	48.11	3.002	71.45
1.0	.023	1.70	2.0	1410.	.000	7.01	2000.	.029	36.34	2.634	43.36
1.0	.023	1.70	2.0	1410.	.000	7.01	2500.	.043	45.02	2.858	52.04
1.0	.023	1.70	2.0	1410.	.000	7.01	3000.	.057	53.46	3.054	60.47
1.0	.023	1.70	2.0	2500.	.024	13.84	2000.	.029	36.34	2.664	50.18
1.0	.023	1.70	2.0	2500.	.024	13.84	2500.	.043	45.02	2.888	58.86
1.0	.023	1.70	2.0	2500.	.024	13.84	3000.	.057	53.46	3.084	67.29
1.0	.023	1.70	2.0	3000.	.037	16.74	2000.	.029	36.34	2.731	53.08
1.0	.023	1.70	2.0	3000.	.037	16.74	2500.	.043	45.02	2.955	61.77
1.0	.023	1.70	2.0	3000.	.037	16.74	3000.	.057	53.46	3.152	70.20
2.0	.019	1.30	1.0	1581.	.000	12.77	2000.	.026	22.50	2.392	35.27
2.0	.019	1.30	1.0	1581.	.000	12.77	2500.	.039	31.04	2.487	43.81
2.0	.019	1.30	1.0	1581.	.000	12.77	3000.	.054	39.40	2.574	52.16
2.0	.019	1.30	1.0	2500.	.022	27.72	2000.	.026	22.50	2.366	50.23
2.0	.019	1.30	1.0	2500.	.022	27.72	2500.	.039	31.04	2.460	58.76
2.0	.019	1.30	1.0	2500.	.022	27.72	3000.	.054	39.40	2.548	67.12
2.0	.019	1.30	1.0	3000.	.035	35.59	2000.	.026	22.50	2.414	58.09
2.0	.019	1.30	1.0	3000.	.035	35.59	2500.	.039	31.04	2.509	66.63
2.0	.019	1.30	1.0	3000.	.035	35.59	3000.	.054	39.40	2.596	74.99
2.0	.019	1.30	1.5	1560.	.000	9.72	2000.	.026	27.00	2.387	36.72
2.0	.019	1.30	1.5	1560.	.000	9.72	2500.	.039	37.25	2.500	46.96
2.0	.019	1.30	1.5	1560.	.000	9.72	3000.	.054	47.28	2.605	56.99
2.0	.019	1.30	1.5	2500.	.022	21.88	2000.	.026	27.00	2.338	48.88
2.0	.019	1.30	1.5	2500.	.022	21.88	2500.	.039	37.25	2.451	59.12
2.0	.019	1.30	1.5	2500.	.022	21.88	3000.	.054	47.28	2.556	69.15
2.0	.019	1.30	1.5	3000.	.036	28.12	2000.	.026	27.00	2.373	55.12
2.0	.019	1.30	1.5	3000.	.036	28.12	2500.	.039	37.25	2.487	65.37
2.0	.019	1.30	1.5	3000.	.036	28.12	3000.	.054	47.28	2.591	75.40
2.0	.019	1.30	2.0	1538.	.000	7.67	2000.	.026	30.00	2.390	37.67
2.0	.019	1.30	2.0	1538.	.000	7.67	2500.	.039	41.38	2.516	49.05
2.0	.019	1.30	2.0	1538.	.000	7.67	3000.	.054	52.53	2.632	60.20
2.0	.019	1.30	2.0	2500.	.023	17.95	2000.	.026	30.00	2.321	47.96
2.0	.019	1.30	2.0	2500.	.023	17.95	2500.	.039	41.38	2.447	59.34
2.0	.019	1.30	2.0	2500.	.023	17.95	3000.	.054	52.53	2.563	70.48
2.0	.019	1.30	2.0	3000.	.036	23.11	2000.	.026	30.00	2.347	53.11
2.0	.019	1.30	2.0	3000.	.036	23.11	2500.	.039	41.38	2.473	64.50
2.0	.019	1.30	2.0	3000.	.036	23.11	3000.	.054	52.53	2.590	75.64

2.0	.019	1.50	1.0	1556.	.000	12.05	2000.	.026	23.11	2.426	35.16
2.0	.019	1.50	1.0	1556.	.000	12.05	2500.	.039	31.77	2.526	43.82
2.0	.019	1.50	1.0	1556.	.000	12.05	3000.	.053	40.25	2.617	52.29
2.0	.019	1.50	1.0	2500.	.022	27.28	2000.	.026	23.11	2.358	50.40
2.0	.019	1.50	1.0	2500.	.022	27.28	2500.	.039	31.77	2.459	59.05
2.0	.019	1.50	1.0	2500.	.022	27.28	3000.	.053	40.25	2.549	67.53
2.0	.019	1.50	1.0	3000.	.036	35.08	2000.	.026	23.11	2.402	58.19
2.0	.019	1.50	1.0	3000.	.036	35.08	2500.	.039	31.77	2.503	66.85
2.0	.019	1.50	1.0	3000.	.036	35.08	3000.	.053	40.25	2.593	75.33
2.0	.019	1.50	1.5	1523.	.000	8.82	2000.	.026	27.74	2.446	36.55
2.0	.019	1.50	1.5	1523.	.000	8.82	2500.	.039	38.12	2.567	46.94
2.0	.019	1.50	1.5	1523.	.000	8.82	3000.	.053	48.30	2.675	57.11
2.0	.019	1.50	1.5	2500.	.023	21.28	2000.	.026	27.74	2.334	49.02
2.0	.019	1.50	1.5	2500.	.023	21.28	2500.	.039	38.12	2.455	59.40
2.0	.019	1.50	1.5	2500.	.023	21.28	3000.	.053	48.30	2.563	69.58
2.0	.019	1.50	1.5	3000.	.036	27.43	2000.	.026	27.74	2.363	55.17
2.0	.019	1.50	1.5	3000.	.036	27.43	2500.	.039	38.12	2.484	65.55
2.0	.019	1.50	1.5	3000.	.036	27.43	3000.	.053	48.30	2.592	75.73
2.0	.019	1.50	2.0	1489.	.000	6.62	2000.	.026	30.82	2.485	37.44
2.0	.019	1.50	2.0	1489.	.000	6.62	2500.	.039	42.36	2.619	48.98
2.0	.019	1.50	2.0	1489.	.000	6.62	3000.	.053	53.66	2.740	60.28
2.0	.019	1.50	2.0	2500.	.024	17.21	2000.	.026	30.82	2.324	48.03
2.0	.019	1.50	2.0	2500.	.024	17.21	2500.	.039	42.36	2.458	59.57
2.0	.019	1.50	2.0	2500.	.024	17.21	3000.	.053	53.66	2.578	70.87
2.0	.019	1.50	2.0	3000.	.037	22.25	2000.	.026	30.82	2.342	53.07
2.0	.019	1.50	2.0	3000.	.037	22.25	2500.	.039	42.36	2.477	64.61
2.0	.019	1.50	2.0	3000.	.037	22.25	3000.	.053	53.66	2.597	75.91
2.0	.019	1.70	1.0	1534.	.000	11.37	2000.	.025	23.60	2.473	34.97
2.0	.019	1.70	1.0	1534.	.000	11.37	2500.	.038	32.34	2.579	43.71
2.0	.019	1.70	1.0	1534.	.000	11.37	3000.	.053	40.92	2.672	52.28
2.0	.019	1.70	1.0	2500.	.023	26.84	2000.	.025	23.60	2.360	50.44
2.0	.019	1.70	1.0	2500.	.023	26.84	2500.	.038	32.34	2.466	59.18
2.0	.019	1.70	1.0	2500.	.023	26.84	3000.	.053	40.92	2.558	67.76
2.0	.019	1.70	1.0	3000.	.036	34.56	2000.	.025	23.60	2.399	58.16
2.0	.019	1.70	1.0	3000.	.036	34.56	2500.	.038	32.34	2.505	66.91
2.0	.019	1.70	1.0	3000.	.036	34.56	3000.	.053	40.92	2.597	75.48
2.0	.019	1.70	1.5	1489.	.000	7.95	2000.	.025	28.32	2.538	36.26
2.0	.019	1.70	1.5	1489.	.000	7.95	2500.	.038	38.81	2.664	46.76
2.0	.019	1.70	1.5	1489.	.000	7.95	3000.	.053	49.10	2.775	57.05
2.0	.019	1.70	1.5	2500.	.024	20.65	2000.	.025	28.32	2.344	48.97
2.0	.019	1.70	1.5	2500.	.024	20.65	2500.	.038	38.81	2.471	59.47
2.0	.019	1.70	1.5	2500.	.024	20.65	3000.	.053	49.10	2.582	69.75
2.0	.019	1.70	1.5	3000.	.037	26.70	2000.	.025	28.32	2.367	55.02
2.0	.019	1.70	1.5	3000.	.037	26.70	2500.	.038	38.81	2.493	65.51
2.0	.019	1.70	1.5	3000.	.037	26.70	3000.	.053	49.10	2.604	75.80
2.0	.019	1.70	2.0	1444.	.000	5.59	2000.	.025	31.46	2.649	37.05
2.0	.019	1.70	2.0	1444.	.000	5.59	2500.	.038	43.12	2.790	48.71
2.0	.019	1.70	2.0	1444.	.000	5.59	3000.	.053	54.55	2.913	60.14
2.0	.019	1.70	2.0	2500.	.025	16.39	2000.	.025	31.46	2.348	47.85
2.0	.019	1.70	2.0	2500.	.025	16.39	2500.	.038	43.12	2.488	59.51
2.0	.019	1.70	2.0	2500.	.025	16.39	3000.	.053	54.55	2.612	70.94
2.0	.019	1.70	2.0	3000.	.038	21.29	2000.	.025	31.46	2.357	52.75
2.0	.019	1.70	2.0	3000.	.038	21.29	2500.	.038	43.12	2.498	64.42
2.0	.019	1.70	2.0	3000.	.038	21.29	3000.	.053	54.55	2.621	75.85

3.0	.012	1.30	1.0	1582.	.000	1.05	2000.	.019	11.29	11.636	12.34
3.0	.012	1.30	1.0	1582.	.000	1.05	2500.	.032	20.54	11.517	21.59
3.0	.012	1.30	1.0	1582.	.000	1.05	3000.	.046	29.64	11.516	30.69
3.0	.012	1.30	1.0	2500.	.021	17.27	2000.	.019	11.29	3.249	28.56
3.0	.012	1.30	1.0	2500.	.021	17.27	2500.	.032	20.54	3.129	37.82
3.0	.012	1.30	1.0	2500.	.021	17.27	3000.	.046	29.64	3.129	46.92
3.0	.012	1.30	1.0	3000.	.035	25.87	2000.	.019	11.29	3.141	37.16
3.0	.012	1.30	1.0	3000.	.035	25.87	2500.	.032	20.54	3.021	46.41
3.0	.012	1.30	1.0	3000.	.035	25.87	3000.	.046	29.64	3.021	55.51
3.0	.012	1.30	1.5	1561.	.000	.47	2000.	.019	13.55	16.363	14.02
3.0	.012	1.30	1.5	1561.	.000	.47	2500.	.032	24.65	16.219	25.12
3.0	.012	1.30	1.5	1561.	.000	.47	3000.	.046	35.57	16.218	36.04
3.0	.012	1.30	1.5	2500.	.022	13.73	2000.	.019	13.55	3.234	27.27
3.0	.012	1.30	1.5	2500.	.022	13.73	2500.	.032	24.65	3.090	38.38
3.0	.012	1.30	1.5	2500.	.022	13.73	3000.	.046	35.57	3.089	49.30
3.0	.012	1.30	1.5	3000.	.035	20.59	2000.	.019	13.55	3.139	34.14
3.0	.012	1.30	1.5	3000.	.035	20.59	2500.	.032	24.65	2.995	45.24
3.0	.012	1.30	1.5	3000.	.035	20.59	3000.	.046	35.57	2.994	56.16
3.0	.012	1.30	2.0	1540.	.000	.07	2000.	.019	15.05	66.722	15.13
3.0	.012	1.30	2.0	1540.	.000	.07	2500.	.032	27.39	66.562	27.46
3.0	.012	1.30	2.0	1540.	.000	.07	3000.	.046	39.52	66.561	39.59
3.0	.012	1.30	2.0	2500.	.022	11.35	2000.	.019	15.05	3.225	26.41
3.0	.012	1.30	2.0	2500.	.022	11.35	2500.	.032	27.39	3.065	38.74
3.0	.012	1.30	2.0	2500.	.022	11.35	3000.	.046	39.52	3.064	50.88
3.0	.012	1.30	2.0	3000.	.036	17.06	2000.	.019	15.05	3.138	32.11
3.0	.012	1.30	2.0	3000.	.036	17.06	2500.	.032	27.39	2.978	44.45
3.0	.012	1.30	2.0	3000.	.036	17.06	3000.	.046	39.52	2.977	56.58
3.0	.012	1.50	1.0	1557.	.000	.51	2000.	.018	11.36	22.255	11.88
3.0	.012	1.50	1.0	1557.	.000	.51	2500.	.031	20.63	22.157	21.14
3.0	.012	1.50	1.0	1557.	.000	.51	3000.	.045	29.74	22.163	30.25
3.0	.012	1.50	1.0	2500.	.022	17.14	2000.	.018	11.36	3.241	28.50
3.0	.012	1.50	1.0	2500.	.022	17.14	2500.	.031	20.63	3.143	37.77
3.0	.012	1.50	1.0	2500.	.022	17.14	3000.	.045	29.74	3.149	46.88
3.0	.012	1.50	1.0	3000.	.036	25.71	2000.	.018	11.36	3.121	37.08
3.0	.012	1.50	1.0	3000.	.036	25.71	2500.	.031	20.63	3.022	46.34
3.0	.012	1.50	1.0	3000.	.036	25.71	3000.	.045	29.74	3.029	55.45
3.0	.012	1.50	1.5	1524.	.000	-.20	2000.	.018	13.64	-32.893	13.44
3.0	.012	1.50	1.5	1524.	.000	-.20	2500.	.031	24.75	-33.011	24.56
3.0	.012	1.50	1.5	1524.	.000	-.20	3000.	.045	35.69	-33.003	35.49
3.0	.012	1.50	1.5	2500.	.023	13.54	2000.	.018	13.64	3.228	27.18
3.0	.012	1.50	1.5	2500.	.023	13.54	2500.	.031	24.75	3.109	38.30
3.0	.012	1.50	1.5	2500.	.023	13.54	3000.	.045	35.69	3.118	49.23
3.0	.012	1.50	1.5	3000.	.036	20.37	2000.	.018	13.64	3.117	34.01
3.0	.012	1.50	1.5	3000.	.036	20.37	2500.	.031	24.75	2.998	45.13
3.0	.012	1.50	1.5	3000.	.036	20.37	3000.	.045	35.69	3.006	56.06
3.0	.012	1.50	2.0	1491.	.000	-.69	2000.	.018	15.15	-4.936	14.47
3.0	.012	1.50	2.0	1491.	.000	-.69	2500.	.031	27.51	-5.068	26.82
3.0	.012	1.50	2.0	1491.	.000	-.69	3000.	.045	39.65	-5.059	38.97
3.0	.012	1.50	2.0	2500.	.024	11.12	2000.	.018	15.15	3.223	26.27
3.0	.012	1.50	2.0	2500.	.024	11.12	2500.	.031	27.51	3.091	38.62
3.0	.012	1.50	2.0	2500.	.024	11.12	3000.	.045	39.65	3.100	50.77
3.0	.012	1.50	2.0	3000.	.037	16.78	2000.	.018	15.15	3.117	31.93
3.0	.012	1.50	2.0	3000.	.037	16.78	2500.	.031	27.51	2.985	44.29
3.0	.012	1.50	2.0	3000.	.037	16.78	3000.	.045	39.65	2.994	56.44

FAN	FAAB	FPRSL	BPR	T8	FAAB	TST	T10	FAFAB	TS2	SFC	TST
3.0	.012	1.70	1.0	1535.	.000	.01	2000.	.018	11.42	1023.733	11.43
3.0	.012	1.70	1.0	1535.	.000	.01	2500.	.031	20.70	1023.653	20.71
3.0	.012	1.70	1.0	1535.	.000	.01	3000.	.045	29.82	1023.666	29.83
3.0	.012	1.70	1.0	2500.	.023	17.00	2000.	.018	11.42	3.238	28.43
3.0	.012	1.70	1.0	2500.	.023	17.00	2500.	.031	20.70	3.158	37.70
3.0	.012	1.70	1.0	2500.	.023	17.00	3000.	.045	29.82	3.171	46.82
3.0	.012	1.70	1.0	3000.	.036	25.55	2000.	.018	11.42	3.106	36.98
3.0	.012	1.70	1.0	3000.	.036	25.55	2500.	.031	20.70	3.025	46.25
3.0	.012	1.70	1.0	3000.	.036	25.55	3000.	.045	29.82	3.039	55.37
3.0	.012	1.70	1.5	1491.	.000	-.82	2000.	.018	13.71	-6.571	12.88
3.0	.012	1.70	1.5	1491.	.000	-.82	2500.	.031	24.84	-6.667	24.01
3.0	.012	1.70	1.5	1491.	.000	-.82	3000.	.045	35.78	-6.651	34.96
3.0	.012	1.70	1.5	2500.	.024	13.34	2000.	.018	13.71	3.230	27.05
3.0	.012	1.70	1.5	2500.	.024	13.34	2500.	.031	24.64	3.133	38.17
3.0	.012	1.70	1.5	2500.	.024	13.34	3000.	.045	35.78	3.149	49.12
3.0	.012	1.70	1.5	3000.	.037	20.14	2000.	.018	13.71	3.102	33.85
3.0	.012	1.70	1.5	3000.	.037	20.14	2500.	.031	24.84	3.006	44.97
3.0	.012	1.70	1.5	3000.	.037	20.14	3000.	.045	35.78	3.022	55.92
3.0	.012	1.70	2.0	1446.	.000	-1.42	2000.	.018	15.23	-1.451	13.82
3.0	.012	1.70	2.0	1446.	.000	-1.42	2500.	.031	27.59	-1.558	26.18
3.0	.012	1.70	2.0	1446.	.000	-1.42	3000.	.045	39.76	-1.540	38.34
3.0	.012	1.70	2.0	2500.	.025	10.84	2000.	.018	15.23	3.233	26.07
3.0	.012	1.70	2.0	2500.	.025	10.84	2500.	.031	27.59	3.126	38.44
3.0	.012	1.70	2.0	2500.	.025	10.84	3000.	.045	39.76	3.144	50.60
3.0	.012	1.70	2.0	3000.	.038	16.46	2000.	.018	15.23	3.106	31.70
3.0	.012	1.70	2.0	3000.	.038	16.46	2500.	.031	27.59	2.999	44.06
3.0	.012	1.70	2.0	3000.	.038	16.46	3000.	.045	39.76	3.017	56.22

1.0	.025	1.30	1.0	1513.	.000	13.36	2000.	.032	21.59	3.046	34.96
1.0	.025	1.30	1.0	1513.	.000	13.36	2500.	.047	27.04	3.255	40.41
1.0	.025	1.30	1.0	1513.	.000	13.36	3000.	.063	32.33	3.442	45.69
1.0	.025	1.30	1.0	2500.	.021	23.76	2000.	.032	21.59	3.109	45.35
1.0	.025	1.30	1.0	2500.	.021	23.76	2500.	.047	27.04	3.318	50.80
1.0	.025	1.30	1.0	2500.	.021	23.76	3000.	.063	32.33	3.505	56.08
1.0	.025	1.30	1.0	3000.	.034	28.75	2000.	.032	21.59	3.190	50.34
1.0	.025	1.30	1.0	3000.	.034	28.75	2500.	.047	27.04	3.399	55.79
1.0	.025	1.30	1.0	3000.	.034	28.75	3000.	.063	32.33	3.586	61.08
1.0	.025	1.30	1.5	1489.	.000	9.78	2000.	.032	25.91	3.104	35.70
1.0	.025	1.30	1.5	1489.	.000	9.78	2500.	.047	32.45	3.354	42.24
1.0	.025	1.30	1.5	1489.	.000	9.78	3000.	.063	38.79	3.579	48.58
1.0	.025	1.30	1.5	2500.	.022	17.98	2000.	.032	25.91	3.124	43.89
1.0	.025	1.30	1.5	2500.	.022	17.98	2500.	.047	32.45	3.375	50.43
1.0	.025	1.30	1.5	2500.	.022	17.98	3000.	.063	38.79	3.600	56.77
1.0	.025	1.30	1.5	3000.	.034	21.81	2000.	.032	25.91	3.187	47.72
1.0	.025	1.30	1.5	3000.	.034	21.81	2500.	.047	32.45	3.438	54.26
1.0	.025	1.30	1.5	3000.	.034	21.81	3000.	.063	38.79	3.663	60.61
1.0	.025	1.30	2.0	1464.	.000	7.35	2000.	.032	28.79	3.172	36.14
1.0	.025	1.30	2.0	1464.	.000	7.35	2500.	.047	36.06	3.451	43.41
1.0	.025	1.30	2.0	1464.	.000	7.35	3000.	.063	43.10	3.700	50.45
1.0	.025	1.30	2.0	2500.	.022	14.04	2000.	.032	28.79	3.153	42.84
1.0	.025	1.30	2.0	2500.	.022	14.04	2500.	.047	36.06	3.432	50.10
1.0	.025	1.30	2.0	2500.	.022	14.04	3000.	.063	43.10	3.681	57.15
1.0	.025	1.30	2.0	3000.	.035	17.08	2000.	.032	28.79	3.203	45.88
1.0	.025	1.30	2.0	3000.	.035	17.08	2500.	.047	36.06	3.482	53.14
1.0	.025	1.30	2.0	3000.	.035	17.08	3000.	.063	43.10	3.731	60.19
1.0	.025	1.50	1.0	1485.	.000	12.05	2000.	.032	24.90	3.032	36.95
1.0	.025	1.50	1.0	1485.	.000	12.05	2500.	.046	31.02	3.223	43.07
1.0	.025	1.50	1.0	1485.	.000	12.05	3000.	.062	36.97	3.393	49.02
1.0	.025	1.50	1.0	2500.	.022	22.27	2000.	.032	24.90	3.051	47.17
1.0	.025	1.50	1.0	2500.	.022	22.27	2500.	.046	31.02	3.242	53.29
1.0	.025	1.50	1.0	2500.	.022	22.27	3000.	.062	36.97	3.412	59.24
1.0	.025	1.50	1.0	3000.	.034	27.02	2000.	.032	24.90	3.129	51.92
1.0	.025	1.50	1.0	3000.	.034	27.02	2500.	.046	31.02	3.321	58.04
1.0	.025	1.50	1.0	3000.	.034	27.02	3000.	.062	36.97	3.490	63.99
1.0	.025	1.50	1.5	1446.	.000	8.08	2000.	.032	29.88	3.178	37.96
1.0	.025	1.50	1.5	1446.	.000	8.08	2500.	.046	37.22	3.407	45.30
1.0	.025	1.50	1.5	1446.	.000	8.08	3000.	.062	44.37	3.611	52.44
1.0	.025	1.50	1.5	2500.	.023	15.95	2000.	.032	29.88	3.108	45.83
1.0	.025	1.50	1.5	2500.	.023	15.95	2500.	.046	37.22	3.338	53.17
1.0	.025	1.50	1.5	2500.	.023	15.95	3000.	.062	44.37	3.541	60.32
1.0	.025	1.50	1.5	3000.	.035	19.45	2000.	.032	29.88	3.166	49.33
1.0	.025	1.50	1.5	3000.	.035	19.45	2500.	.046	37.22	3.395	56.67
1.0	.025	1.50	1.5	3000.	.035	19.45	3000.	.062	44.37	3.599	63.82
1.0	.025	1.50	2.0	1406.	.000	5.29	2000.	.032	33.20	3.439	38.50
1.0	.025	1.50	2.0	1406.	.000	5.29	2500.	.046	41.36	3.694	46.65
1.0	.025	1.50	2.0	1406.	.000	5.29	3000.	.062	49.30	3.920	54.59
1.0	.025	1.50	2.0	2500.	.023	11.47	2000.	.032	33.20	3.231	44.67
1.0	.025	1.50	2.0	2500.	.023	11.47	2500.	.046	41.36	3.487	52.83
1.0	.025	1.50	2.0	2500.	.023	11.47	3000.	.062	49.30	3.712	60.76
1.0	.025	1.50	2.0	3000.	.036	14.09	2000.	.032	33.20	3.269	47.29
1.0	.025	1.50	2.0	3000.	.036	14.09	2500.	.046	41.36	3.525	55.45
1.0	.025	1.50	2.0	3000.	.036	14.09	3000.	.062	49.30	3.751	63.39

1.0	.025	1.70	1.0	1459.	.000	10.77	2000.	.031	27.38	3.134	38.15
1.0	.025	1.70	1.0	1459.	.000	10.77	2500.	.046	34.00	3.315	44.77
1.0	.025	1.70	1.0	1459.	.000	10.77	3000.	.062	40.45	3.473	51.22
1.0	.025	1.70	1.0	2500.	.022	20.76	2000.	.031	27.38	3.091	48.14
1.0	.025	1.70	1.0	2500.	.022	20.76	2500.	.046	34.00	3.272	54.75
1.0	.025	1.70	1.0	2500.	.022	20.76	3000.	.062	40.45	3.430	61.21
1.0	.025	1.70	1.0	3000.	.035	25.27	2000.	.031	27.38	3.165	52.65
1.0	.025	1.70	1.0	3000.	.035	25.27	2500.	.046	34.00	3.346	59.26
1.0	.025	1.70	1.0	3000.	.035	25.27	3000.	.062	40.45	3.504	65.72
1.0	.025	1.70	1.5	1406.	.000	6.35	2000.	.031	32.86	3.519	39.21
1.0	.025	1.70	1.5	1406.	.000	6.35	2500.	.046	40.80	3.736	47.15
1.0	.025	1.70	1.5	1406.	.000	6.35	3000.	.062	48.54	3.926	54.90
1.0	.025	1.70	1.5	2500.	.023	13.76	2000.	.031	32.86	3.271	46.62
1.0	.025	1.70	1.5	2500.	.023	13.76	2500.	.046	40.80	3.487	54.56
1.0	.025	1.70	1.5	2500.	.023	13.76	3000.	.062	48.54	3.677	62.31
1.0	.025	1.70	1.5	3000.	.036	16.91	2000.	.031	32.86	3.316	49.77
1.0	.025	1.70	1.5	3000.	.036	16.91	2500.	.046	40.80	3.533	57.71
1.0	.025	1.70	1.5	3000.	.036	16.91	3000.	.062	48.54	3.723	65.46
1.0	.025	1.70	2.0	1354.	.000	3.14	2000.	.031	36.51	4.581	39.65
1.0	.025	1.70	2.0	1354.	.000	3.14	2500.	.046	45.33	4.821	48.47
1.0	.025	1.70	2.0	1354.	.000	3.14	3000.	.062	53.94	5.033	57.08
1.0	.025	1.70	2.0	2500.	.024	8.52	2000.	.031	36.51	3.706	45.03
1.0	.025	1.70	2.0	2500.	.024	8.52	2500.	.046	45.33	3.946	53.85
1.0	.025	1.70	2.0	2500.	.024	8.52	3000.	.062	53.94	4.157	62.46
1.0	.025	1.70	2.0	3000.	.037	10.66	2000.	.031	36.51	3.706	47.17
1.0	.025	1.70	2.0	3000.	.037	10.66	2500.	.046	45.33	3.947	55.99
1.0	.025	1.70	2.0	3000.	.037	10.66	3000.	.062	53.94	4.158	64.60
2.0	.020	1.30	1.0	1564.	.000	10.57	2000.	.028	22.66	2.651	33.23
2.0	.020	1.30	1.0	1564.	.000	10.57	2500.	.042	31.34	2.953	41.91
2.0	.020	1.30	1.0	1564.	.000	10.57	3000.	.058	39.88	3.047	50.46
2.0	.020	1.30	1.0	2500.	.023	25.24	2000.	.028	22.66	2.645	47.90
2.0	.020	1.30	1.0	2500.	.023	25.24	2500.	.042	31.34	2.747	56.58
2.0	.020	1.30	1.0	2500.	.023	25.24	3000.	.058	39.88	2.841	65.13
2.0	.020	1.30	1.0	3000.	.037	32.85	2000.	.028	22.66	2.672	55.51
2.0	.020	1.30	1.0	3000.	.037	32.85	2500.	.042	31.34	2.773	64.19
2.0	.020	1.30	1.0	3000.	.037	32.85	3000.	.058	39.88	2.867	72.74
2.0	.020	1.30	1.5	1542.	.000	7.95	2000.	.028	27.19	2.815	35.14
2.0	.020	1.30	1.5	1542.	.000	7.95	2500.	.042	37.61	2.937	45.55
2.0	.020	1.30	1.5	1542.	.000	7.95	3000.	.058	47.86	3.049	55.81
2.0	.020	1.30	1.5	2500.	.023	19.87	2000.	.028	27.19	2.595	47.06
2.0	.020	1.30	1.5	2500.	.023	19.87	2500.	.042	37.61	2.717	57.47
2.0	.020	1.30	1.5	2500.	.023	19.87	3000.	.058	47.86	2.830	67.73
2.0	.020	1.30	1.5	3000.	.037	25.90	2000.	.028	27.19	2.612	53.09
2.0	.020	1.30	1.5	3000.	.037	25.90	2500.	.042	37.61	2.733	63.51
2.0	.020	1.30	1.5	3000.	.037	25.90	3000.	.058	47.86	2.846	73.76
2.0	.020	1.30	2.0	1520.	.000	6.18	2000.	.028	30.21	2.804	36.39
2.0	.020	1.30	2.0	1520.	.000	6.18	2500.	.042	41.78	2.939	47.97
2.0	.020	1.30	2.0	1520.	.000	6.18	3000.	.058	53.18	3.064	59.36
2.0	.020	1.30	2.0	2500.	.024	16.26	2000.	.028	30.21	2.565	46.47
2.0	.020	1.30	2.0	2500.	.024	16.26	2500.	.042	41.78	2.700	58.04
2.0	.020	1.30	2.0	2500.	.024	16.26	3000.	.058	53.18	2.825	69.44
2.0	.020	1.30	2.0	3000.	.038	21.24	2000.	.028	30.21	2.574	51.45
2.0	.020	1.30	2.0	3000.	.038	21.24	2500.	.042	41.78	2.709	63.02
2.0	.020	1.30	2.0	3000.	.038	21.24	3000.	.058	53.18	2.834	74.41

2.0	.020	1.50	1.0	1538.	.000	9.83	2000.	.027	23.27	2.933	33.11
2.0	.020	1.50	1.0	1538.	.000	9.83	2500.	.042	32.07	3.041	41.90
2.0	.020	1.50	1.0	1538.	.000	9.83	3000.	.057	40.74	3.137	50.57
2.0	.020	1.50	1.0	2500.	.023	24.77	2000.	.027	23.27	2.647	48.04
2.0	.020	1.50	1.0	2500.	.023	24.77	2500.	.042	32.07	2.755	56.84
2.0	.020	1.50	1.0	2500.	.023	24.77	3000.	.057	40.74	2.851	65.51
2.0	.020	1.50	1.0	3000.	.037	32.30	2000.	.027	23.27	2.666	55.57
2.0	.020	1.50	1.0	3000.	.037	32.30	2500.	.042	32.07	2.774	64.37
2.0	.020	1.50	1.0	3000.	.037	32.30	3000.	.057	40.74	2.870	73.04
2.0	.020	1.50	1.5	1504.	.000	7.02	2000.	.027	27.93	2.952	34.94
2.0	.020	1.50	1.5	1504.	.000	7.02	2500.	.042	38.48	3.081	45.50
2.0	.020	1.50	1.5	1504.	.000	7.02	3000.	.057	48.88	3.197	55.90
2.0	.020	1.50	1.5	2500.	.024	19.22	2000.	.027	27.93	2.605	47.15
2.0	.020	1.50	1.5	2500.	.024	19.22	2500.	.042	38.48	2.734	57.71
2.0	.020	1.50	1.5	2500.	.024	19.22	3000.	.057	48.88	2.850	68.11
2.0	.020	1.50	1.5	3000.	.038	25.15	2000.	.027	27.93	2.611	53.08
2.0	.020	1.50	1.5	3000.	.038	25.15	2500.	.042	38.48	2.741	63.63
2.0	.020	1.50	1.5	3000.	.038	25.15	3000.	.057	48.88	2.857	74.04
2.0	.020	1.50	2.0	1469.	.000	5.09	2000.	.027	31.03	3.020	36.12
2.0	.020	1.50	2.0	1469.	.000	5.09	2500.	.042	42.76	3.164	47.86
2.0	.020	1.50	2.0	1469.	.000	5.09	3000.	.057	54.32	3.293	59.41
2.0	.020	1.50	2.0	2500.	.025	15.45	2000.	.027	31.03	2.586	46.48
2.0	.020	1.50	2.0	2500.	.025	15.45	2500.	.042	42.76	2.730	58.21
2.0	.020	1.50	2.0	2500.	.025	15.45	3000.	.057	54.32	2.858	69.76
2.0	.020	1.50	2.0	3000.	.039	20.29	2000.	.027	31.03	2.583	51.32
2.0	.020	1.50	2.0	3000.	.039	20.29	2500.	.042	42.76	2.726	63.05
2.0	.020	1.50	2.0	3000.	.039	20.29	3000.	.057	54.32	2.855	74.61
2.0	.020	1.70	1.0	1515.	.000	9.13	2000.	.027	23.75	3.037	32.89
2.0	.020	1.70	1.0	1515.	.000	9.13	2500.	.041	32.65	3.150	41.78
2.0	.020	1.70	1.0	1515.	.000	9.13	3000.	.057	41.41	3.249	50.54
2.0	.020	1.70	1.0	2500.	.024	24.29	2000.	.027	23.75	2.658	48.04
2.0	.020	1.70	1.0	2500.	.024	24.29	2500.	.041	32.65	2.771	56.93
2.0	.020	1.70	1.0	2500.	.024	24.29	3000.	.057	41.41	2.870	65.70
2.0	.020	1.70	1.0	3000.	.038	31.74	2000.	.027	23.75	2.670	55.49
2.0	.020	1.70	1.0	3000.	.038	31.74	2500.	.041	32.65	2.783	64.39
2.0	.020	1.70	1.0	3000.	.038	31.74	3000.	.057	41.41	2.882	73.15
2.0	.020	1.70	1.5	1469.	.000	6.12	2000.	.027	28.50	3.152	34.62
2.0	.020	1.70	1.5	1469.	.000	6.12	2500.	.041	39.17	3.288	45.29
2.0	.020	1.70	1.5	1469.	.000	6.12	3000.	.057	49.69	3.407	55.81
2.0	.020	1.70	1.5	2500.	.025	18.54	2000.	.027	28.50	2.631	47.04
2.0	.020	1.70	1.5	2500.	.025	18.54	2500.	.041	39.17	2.767	57.71
2.0	.020	1.70	1.5	2500.	.025	18.54	3000.	.057	49.69	2.886	68.23
2.0	.020	1.70	1.5	3000.	.039	24.35	2000.	.027	28.50	2.627	52.86
2.0	.020	1.70	1.5	3000.	.039	24.35	2500.	.041	39.17	2.763	63.53
2.0	.020	1.70	1.5	3000.	.039	24.35	3000.	.057	49.69	2.882	74.04
2.0	.020	1.70	2.0	1422.	.000	4.01	2000.	.027	31.67	3.400	35.68
2.0	.020	1.70	2.0	1422.	.000	4.01	2500.	.041	43.53	3.551	47.54
2.0	.020	1.70	2.0	1422.	.000	4.01	3000.	.057	55.21	3.683	59.22
2.0	.020	1.70	2.0	2500.	.026	14.54	2000.	.027	31.67	2.635	46.21
2.0	.020	1.70	2.0	2500.	.026	14.54	2500.	.041	43.53	2.786	58.06
2.0	.020	1.70	2.0	2500.	.026	14.54	3000.	.057	55.21	2.918	69.75
2.0	.020	1.70	2.0	3000.	.040	19.23	2000.	.027	31.67	2.617	50.90
2.0	.020	1.70	2.0	3000.	.040	19.23	2500.	.041	43.53	2.768	62.76
2.0	.020	1.70	2.0	3000.	.040	19.23	3000.	.057	55.21	2.900	74.45

3.0	.013	1.30	1.0	1571.	.000	-.39	2000.	.020	11.42	-27.505	11.03
3.0	.013	1.30	1.0	1571.	.000	-.39	2500.	.034	20.82	-27.630	20.43
3.0	.013	1.30	1.0	1571.	.000	-.39	3000.	.049	30.11	-27.630	29.72
3.0	.013	1.30	1.0	2500.	.023	15.74	2000.	.020	11.42	3.623	27.16
3.0	.013	1.30	1.0	2500.	.023	15.74	2500.	.034	20.82	3.498	36.55
3.0	.013	1.30	1.0	2500.	.023	15.74	3000.	.049	30.11	3.499	45.85
3.0	.013	1.30	1.0	3000.	.037	24.23	2000.	.020	11.42	3.440	35.65
3.0	.013	1.30	1.0	3000.	.037	24.23	2500.	.034	20.82	3.316	45.05
3.0	.013	1.30	1.0	3000.	.037	24.23	3000.	.049	30.11	3.316	54.34
3.0	.013	1.30	1.5	1549.	.000	-.69	2000.	.020	13.70	-8.641	13.01
3.0	.013	1.30	1.5	1549.	.000	-.69	2500.	.034	24.98	-8.790	24.29
3.0	.013	1.30	1.5	1549.	.000	-.69	3000.	.049	36.13	-8.790	35.44
3.0	.013	1.30	1.5	2500.	.023	12.49	2000.	.020	13.70	3.575	26.20
3.0	.013	1.30	1.5	2500.	.023	12.49	2500.	.034	24.98	3.425	37.47
3.0	.013	1.30	1.5	2500.	.023	12.49	3000.	.049	36.13	3.425	48.63
3.0	.013	1.30	1.5	3000.	.037	19.27	2000.	.020	13.70	3.417	32.97
3.0	.013	1.30	1.5	3000.	.037	19.27	2500.	.034	24.98	3.267	44.25
3.0	.013	1.30	1.5	3000.	.037	19.27	3000.	.049	36.13	3.268	55.40
3.0	.013	1.30	2.0	1527.	.000	-.90	2000.	.020	15.22	-3.514	14.33
3.0	.013	1.30	2.0	1527.	.000	-.90	2500.	.034	27.76	-3.680	26.86
3.0	.013	1.30	2.0	1527.	.000	-.90	3000.	.049	40.15	-3.679	39.25
3.0	.013	1.30	2.0	2500.	.024	10.32	2000.	.020	15.22	3.544	25.55
3.0	.013	1.30	2.0	2500.	.024	10.32	2500.	.034	27.76	3.378	38.08
3.0	.013	1.30	2.0	2500.	.024	10.32	3000.	.049	40.15	3.378	50.47
3.0	.013	1.30	2.0	3000.	.038	15.96	2000.	.020	15.22	3.403	31.18
3.0	.013	1.30	2.0	3000.	.038	15.96	2500.	.034	27.76	3.236	43.71
3.0	.013	1.30	2.0	3000.	.038	15.96	3000.	.049	40.15	3.237	56.10
3.0	.013	1.50	1.0	1546.	.000	-.94	2000.	.020	11.49	-10.607	10.55
3.0	.013	1.50	1.0	1546.	.000	-.94	2500.	.034	20.90	-10.710	19.96
3.0	.013	1.50	1.0	1546.	.000	-.94	3000.	.049	30.21	-10.701	29.27
3.0	.013	1.50	1.0	2500.	.023	15.60	2000.	.020	11.49	3.622	27.09
3.0	.013	1.50	1.0	2500.	.023	15.60	2500.	.034	20.90	3.520	36.50
3.0	.013	1.50	1.0	2500.	.023	15.60	3000.	.049	30.21	3.528	45.80
3.0	.013	1.50	1.0	3000.	.037	24.07	2000.	.020	11.49	3.423	35.56
3.0	.013	1.50	1.0	3000.	.037	24.07	2500.	.034	20.90	3.321	44.97
3.0	.013	1.50	1.0	3000.	.037	24.07	3000.	.049	30.21	3.329	54.27
3.0	.013	1.50	1.5	1511.	.000	-1.36	2000.	.020	13.79	-3.487	12.42
3.0	.013	1.50	1.5	1511.	.000	-1.36	2500.	.034	25.08	-3.610	23.72
3.0	.013	1.50	1.5	1511.	.000	-1.36	3000.	.049	36.25	-3.600	34.88
3.0	.013	1.50	1.5	2500.	.024	12.30	2000.	.020	13.79	3.579	26.09
3.0	.013	1.50	1.5	2500.	.024	12.30	2500.	.034	25.08	3.456	37.38
3.0	.013	1.50	1.5	2500.	.024	12.30	3000.	.049	36.25	3.466	48.55
3.0	.013	1.50	1.5	3000.	.038	19.05	2000.	.020	13.79	3.400	32.83
3.0	.013	1.50	1.5	3000.	.038	19.05	2500.	.034	25.08	3.276	44.13
3.0	.013	1.50	1.5	3000.	.038	19.05	3000.	.049	36.25	3.286	55.29
3.0	.013	1.50	2.0	1477.	.000	-1.67	2000.	.020	15.32	-.971	13.65
3.0	.013	1.50	2.0	1477.	.000	-1.67	2500.	.034	27.87	-1.108	26.20
3.0	.013	1.50	2.0	1477.	.000	-1.67	3000.	.049	40.27	-1.097	38.61
3.0	.013	1.50	2.0	2500.	.025	10.07	2000.	.020	15.32	3.556	25.39
3.0	.013	1.50	2.0	2500.	.025	10.07	2500.	.034	27.87	3.419	37.94
3.0	.013	1.50	2.0	2500.	.025	10.07	3000.	.049	40.27	3.430	50.34
3.0	.013	1.50	2.0	3000.	.039	15.66	2000.	.020	15.32	3.387	30.98
3.0	.013	1.50	2.0	3000.	.039	15.66	2500.	.034	27.87	3.251	43.53
3.0	.013	1.50	2.0	3000.	.039	15.66	3000.	.049	40.27	3.262	55.94

3.0	.013	1.70	1.0	1523.	.000	-1.45	2000.	.019	11.55	-6.380	10.10
3.0	.013	1.70	1.0	1523.	.000	-1.45	2500.	.033	20.96	-6.463	19.52
3.0	.013	1.70	1.0	1523.	.000	-1.45	3000.	.048	30.28	-6.448	28.83
3.0	.013	1.70	1.0	2500.	.024	15.45	2000.	.019	11.55	3.627	27.00
3.0	.013	1.70	1.0	2500.	.024	15.45	2500.	.033	20.96	3.544	36.42
3.0	.013	1.70	1.0	2500.	.024	15.45	3000.	.048	30.28	3.559	45.73
3.0	.013	1.70	1.0	3000.	.038	23.90	2000.	.019	11.55	3.411	35.45
3.0	.013	1.70	1.0	3000.	.038	23.90	2500.	.033	20.96	3.328	44.86
3.0	.013	1.70	1.0	3000.	.038	23.90	3000.	.048	30.28	3.343	54.18
3.0	.013	1.70	1.5	1477.	.000	-2.00	2000.	.019	13.86	-1.842	11.85
3.0	.013	1.70	1.5	1477.	.000	-2.00	2500.	.033	25.16	-1.942	23.15
3.0	.013	1.70	1.5	1477.	.000	-2.00	3000.	.048	36.33	-1.924	34.33
3.0	.013	1.70	1.5	2500.	.025	12.08	2000.	.019	13.86	3.592	25.94
3.0	.013	1.70	1.5	2500.	.025	12.08	2500.	.033	25.16	3.492	37.24
3.0	.013	1.70	1.5	2500.	.025	12.08	3000.	.048	36.33	3.511	48.42
3.0	.013	1.70	1.5	3000.	.039	18.80	2000.	.019	13.86	3.390	32.65
3.0	.013	1.70	1.5	3000.	.039	18.80	2500.	.033	25.16	3.290	43.95
3.0	.013	1.70	1.5	3000.	.039	18.80	3000.	.048	36.33	3.309	55.13
3.0	.013	1.70	2.0	1431.	.000	-2.41	2000.	.019	15.39	-.098	12.99
3.0	.013	1.70	2.0	1431.	.000	-2.41	2500.	.033	27.95	-.209	25.54
3.0	.013	1.70	2.0	1431.	.000	-2.41	3000.	.048	40.37	-.189	37.96
3.0	.013	1.70	2.0	2500.	.026	9.78	2000.	.019	15.39	3.582	25.17
3.0	.013	1.70	2.0	2500.	.026	9.78	2500.	.033	27.95	3.471	37.73
3.0	.013	1.70	2.0	2500.	.026	9.78	3000.	.048	40.37	3.492	50.15
3.0	.013	1.70	2.0	3000.	.040	15.32	2000.	.019	15.39	3.384	30.72
3.0	.013	1.70	2.0	3000.	.040	15.32	2500.	.033	27.95	3.273	43.27
3.0	.013	1.70	2.0	3000.	.040	15.32	3000.	.048	40.37	3.294	55.70

1.0	.025	1.30	1.0	1420.	.000	4.77	2000.	.032	21.59	6.096	26.36
1.0	.025	1.30	1.0	1420.	.000	4.77	2500.	.047	27.04	6.305	31.81
1.0	.025	1.30	1.0	1420.	.000	4.77	3000.	.063	32.33	6.492	37.09
1.0	.025	1.30	1.0	2500.	.019	12.61	2000.	.032	21.59	4.516	34.20
1.0	.025	1.30	1.0	2500.	.019	12.61	2500.	.047	27.04	4.725	39.65
1.0	.025	1.30	1.0	2500.	.019	12.61	3000.	.063	32.33	4.912	44.93
1.0	.025	1.30	1.0	3000.	.029	15.96	2000.	.032	21.59	4.425	37.56
1.0	.025	1.30	1.0	3000.	.029	15.96	2500.	.047	27.04	4.634	43.01
1.0	.025	1.30	1.0	3000.	.029	15.96	3000.	.063	32.33	4.821	48.29
1.0	.025	1.30	1.5	1390.	.000	2.65	2000.	.032	25.91	7.083	28.56
1.0	.025	1.30	1.5	1390.	.000	2.65	2500.	.047	32.45	7.334	35.10
1.0	.025	1.30	1.5	1390.	.000	2.65	3000.	.063	38.79	7.558	41.44
1.0	.025	1.30	1.5	2500.	.020	8.57	2000.	.032	25.91	4.636	34.48
1.0	.025	1.30	1.5	2500.	.020	8.57	2500.	.047	32.45	4.886	41.02
1.0	.025	1.30	1.5	2500.	.020	8.57	3000.	.063	38.79	5.111	47.36
1.0	.025	1.30	1.5	3000.	.030	11.01	2000.	.032	25.91	4.500	36.92
1.0	.025	1.30	1.5	3000.	.030	11.01	2500.	.047	32.45	4.751	43.46
1.0	.025	1.30	1.5	3000.	.030	11.01	3000.	.063	38.79	4.976	49.81
1.0	.025	1.30	2.0	1361.	.000	1.16	2000.	.032	28.79	10.440	29.95
1.0	.025	1.30	2.0	1361.	.000	1.16	2500.	.047	36.06	10.718	37.22
1.0	.025	1.30	2.0	1361.	.000	1.16	3000.	.063	43.10	10.968	44.27
1.0	.025	1.30	2.0	2500.	.020	5.71	2000.	.032	28.79	4.978	34.50
1.0	.025	1.30	2.0	2500.	.020	5.71	2500.	.047	36.06	5.257	41.77
1.0	.025	1.30	2.0	2500.	.020	5.71	3000.	.063	43.10	5.506	48.81
1.0	.025	1.30	2.0	3000.	.030	7.52	2000.	.032	28.79	4.757	36.31
1.0	.025	1.30	2.0	3000.	.030	7.52	2500.	.047	36.06	5.036	43.58
1.0	.025	1.30	2.0	3000.	.030	7.52	3000.	.063	43.10	5.285	50.62
1.0	.025	1.50	1.0	1386.	.000	3.08	2000.	.032	24.90	8.504	27.98
1.0	.025	1.50	1.0	1386.	.000	3.08	2500.	.046	31.02	8.696	34.09
1.0	.025	1.50	1.0	1386.	.000	3.08	3000.	.062	36.97	8.865	40.05
1.0	.025	1.50	1.0	2500.	.020	10.39	2000.	.032	24.90	5.040	35.29
1.0	.025	1.50	1.0	2500.	.020	10.39	2500.	.046	31.02	5.232	41.41
1.0	.025	1.50	1.0	2500.	.020	10.39	3000.	.062	36.97	5.401	47.36
1.0	.025	1.50	1.0	3000.	.030	13.40	2000.	.032	24.90	4.854	38.30
1.0	.025	1.50	1.0	3000.	.030	13.40	2500.	.046	31.02	5.045	44.42
1.0	.025	1.50	1.0	3000.	.030	13.40	3000.	.062	36.97	5.215	50.37
1.0	.025	1.50	1.5	1339.	.000	.52	2000.	.032	29.88	29.478	30.40
1.0	.025	1.50	1.5	1339.	.000	.52	2500.	.046	37.22	29.708	37.74
1.0	.025	1.50	1.5	1339.	.000	.52	3000.	.062	44.37	29.911	44.88
1.0	.025	1.50	1.5	2500.	.021	5.71	2000.	.032	29.88	5.990	35.59
1.0	.025	1.50	1.5	2500.	.021	5.71	2500.	.046	37.22	6.220	42.93
1.0	.025	1.50	1.5	2500.	.021	5.71	3000.	.062	44.37	6.423	50.08
1.0	.025	1.50	1.5	3000.	.031	7.71	2000.	.032	29.88	5.558	37.60
1.0	.025	1.50	1.5	3000.	.031	7.71	2500.	.046	37.22	5.788	44.93
1.0	.025	1.50	1.5	3000.	.031	7.71	3000.	.062	44.37	5.991	52.08
1.0	.025	1.50	2.0	1292.	.000	-1.37	2000.	.032	33.20	-5.800	31.83
1.0	.025	1.50	2.0	1292.	.000	-1.37	2500.	.046	41.36	-5.545	39.99
1.0	.025	1.50	2.0	1292.	.000	-1.37	3000.	.062	49.30	-5.319	47.93
1.0	.025	1.50	2.0	2500.	.021	2.44	2000.	.032	33.20	9.148	35.64
1.0	.025	1.50	2.0	2500.	.021	2.44	2500.	.046	41.36	9.404	43.80
1.0	.025	1.50	2.0	2500.	.021	2.44	3000.	.062	49.30	9.630	51.74
1.0	.025	1.50	2.0	3000.	.032	3.84	2000.	.032	33.20	7.439	37.05
1.0	.025	1.50	2.0	3000.	.032	3.84	2500.	.046	41.36	7.695	45.20
1.0	.025	1.50	2.0	3000.	.032	3.84	3000.	.062	49.30	7.920	53.14

1.0	.025	1.70	1.0	1355.	.000	1.44	2000.	.031	27.38	16.693	28.83
1.0	.025	1.70	1.0	1355.	.000	1.44	2500.	.046	34.00	16.873	35.44
1.0	.025	1.70	1.0	1355.	.000	1.44	3000.	.062	40.45	17.032	41.90
1.0	.025	1.70	1.0	2500.	.020	8.13	2000.	.031	27.38	6.058	35.51
1.0	.025	1.70	1.0	2500.	.020	8.13	2500.	.046	34.00	6.238	42.13
1.0	.025	1.70	1.0	2500.	.020	8.13	3000.	.062	40.45	6.396	48.58
1.0	.025	1.70	1.0	3000.	.030	10.75	2000.	.031	27.38	5.690	38.13
1.0	.025	1.70	1.0	3000.	.030	10.75	2500.	.046	34.00	5.870	44.75
1.0	.025	1.70	1.0	3000.	.030	10.75	3000.	.062	40.45	6.029	51.20
1.0	.025	1.70	1.5	1292.	.000	-1.64	2000.	.031	32.86	-7.586	31.22
1.0	.025	1.70	1.5	1292.	.000	-1.64	2500.	.046	40.80	-7.369	39.16
1.0	.025	1.70	1.5	1292.	.000	-1.64	3000.	.062	48.54	-7.179	46.90
1.0	.025	1.70	1.5	2500.	.021	2.93	2000.	.031	32.86	10.357	35.79
1.0	.025	1.70	1.5	2500.	.021	2.93	2500.	.046	40.80	10.573	43.73
1.0	.025	1.70	1.5	2500.	.021	2.93	3000.	.062	48.54	10.763	51.48
1.0	.025	1.70	1.5	3000.	.032	4.62	2000.	.031	32.86	8.312	37.48
1.0	.025	1.70	1.5	3000.	.032	4.62	2500.	.046	40.80	8.529	45.41
1.0	.025	1.70	1.5	3000.	.032	4.62	3000.	.062	48.54	8.719	53.16
1.0	.025	1.70	2.0	1229.	.000	-4.66	2000.	.031	36.51	-.777	31.85
1.0	.025	1.70	2.0	1229.	.000	-4.66	2500.	.046	45.33	-.536	40.67
1.0	.025	1.70	2.0	1229.	.000	-4.66	3000.	.062	53.94	-.325	49.28
1.0	.025	1.70	2.0	2500.	.022	-2.10	2000.	.031	36.51	-7.665	34.41
1.0	.025	1.70	2.0	2500.	.022	-2.10	2500.	.046	45.33	-7.424	43.23
1.0	.025	1.70	2.0	2500.	.022	-2.10	3000.	.062	53.94	-7.213	51.84
1.0	.025	1.70	2.0	3000.	.033	-1.21	2000.	.031	36.51	-17.729	35.30
1.0	.025	1.70	2.0	3000.	.033	-1.21	2500.	.046	45.33	-17.488	44.12
1.0	.025	1.70	2.0	3000.	.033	-1.21	3000.	.062	53.94	-17.277	52.73
2.0	.020	1.30	1.0	1530.	.000	6.79	2000.	.028	22.66	3.822	29.45
2.0	.020	1.30	1.0	1530.	.000	6.79	2500.	.042	31.34	3.924	38.13
2.0	.020	1.30	1.0	1530.	.000	6.79	3000.	.058	39.88	4.017	46.67
2.0	.020	1.30	1.0	2500.	.022	20.67	2000.	.028	22.66	2.941	43.33
2.0	.020	1.30	1.0	2500.	.022	20.67	2500.	.042	31.34	3.042	52.00
2.0	.020	1.30	1.0	2500.	.022	20.67	3000.	.058	39.88	3.136	60.55
2.0	.020	1.30	1.0	3000.	.034	27.57	2000.	.028	22.66	2.901	50.23
2.0	.020	1.30	1.0	3000.	.034	27.57	2500.	.042	31.34	3.002	58.91
2.0	.020	1.30	1.0	3000.	.034	27.57	3000.	.058	39.88	3.096	67.45
2.0	.020	1.30	1.5	1507.	.000	4.89	2000.	.028	27.19	3.742	32.08
2.0	.020	1.30	1.5	1507.	.000	4.89	2500.	.042	37.61	3.864	42.50
2.0	.020	1.30	1.5	1507.	.000	4.89	3000.	.058	47.86	3.976	52.75
2.0	.020	1.30	1.5	2500.	.022	16.15	2000.	.028	27.19	2.849	43.34
2.0	.020	1.30	1.5	2500.	.022	16.15	2500.	.042	37.61	2.971	53.76
2.0	.020	1.30	1.5	2500.	.022	16.15	3000.	.058	47.86	3.083	64.01
2.0	.020	1.30	1.5	3000.	.035	21.61	2000.	.028	27.19	2.808	48.81
2.0	.020	1.30	1.5	3000.	.035	21.61	2500.	.042	37.61	2.930	59.22
2.0	.020	1.30	1.5	3000.	.035	21.61	3000.	.058	47.86	3.042	69.47
2.0	.020	1.30	2.0	1483.	.000	3.61	2000.	.028	30.21	3.750	33.82
2.0	.020	1.30	2.0	1483.	.000	3.61	2500.	.042	41.78	3.885	45.39
2.0	.020	1.30	2.0	1483.	.000	3.61	3000.	.058	53.18	4.010	56.78
2.0	.020	1.30	2.0	2500.	.023	13.11	2000.	.028	30.21	2.793	43.32
2.0	.020	1.30	2.0	2500.	.023	13.11	2500.	.042	41.78	2.929	54.90
2.0	.020	1.30	2.0	2500.	.023	13.11	3000.	.058	53.18	3.054	66.29
2.0	.020	1.30	2.0	3000.	.035	17.60	2000.	.028	30.21	2.750	47.82
2.0	.020	1.30	2.0	3000.	.035	17.60	2500.	.042	41.78	2.886	59.39
2.0	.020	1.30	2.0	3000.	.035	17.60	3000.	.058	53.18	3.011	70.78

2.0	.020	1.50	1.0	1503.	.000	6.00	2000.	.027	23.27	4.127	29.28
2.0	.020	1.50	1.0	1503.	.000	6.00	2500.	.042	32.07	4.235	38.08
2.0	.020	1.50	1.0	1503.	.000	6.00	3000.	.057	40.74	4.331	46.74
2.0	.020	1.50	1.0	2500.	.022	20.11	2000.	.027	23.27	2.968	43.38
2.0	.020	1.50	1.0	2500.	.022	20.11	2500.	.042	32.07	3.075	52.18
2.0	.020	1.50	1.0	2500.	.022	20.11	3000.	.057	40.74	3.172	60.85
2.0	.020	1.50	1.0	3000.	.035	26.93	2000.	.027	23.27	2.914	50.20
2.0	.020	1.50	1.0	3000.	.035	26.93	2500.	.042	32.07	3.022	59.00
2.0	.020	1.50	1.0	3000.	.035	26.93	3000.	.057	40.74	3.119	67.66
2.0	.020	1.50	1.5	1465.	.000	3.90	2000.	.027	27.93	4.297	31.82
2.0	.020	1.50	1.5	1465.	.000	3.90	2500.	.042	38.48	4.426	42.38
2.0	.020	1.50	1.5	1465.	.000	3.90	3000.	.057	48.88	4.542	52.78
2.0	.020	1.50	1.5	2500.	.023	15.40	2000.	.027	27.93	2.897	43.32
2.0	.020	1.50	1.5	2500.	.023	15.40	2500.	.042	38.48	3.026	53.88
2.0	.020	1.50	1.5	2500.	.023	15.40	3000.	.057	48.88	3.142	64.28
2.0	.020	1.50	1.5	3000.	.036	20.73	2000.	.027	27.93	2.836	48.66
2.0	.020	1.50	1.5	3000.	.036	20.73	2500.	.042	38.48	2.966	59.22
2.0	.020	1.50	1.5	3000.	.036	20.73	3000.	.057	48.88	3.082	69.62
2.0	.020	1.50	2.0	1427.	.000	2.44	2000.	.027	31.03	4.773	33.47
2.0	.020	1.50	2.0	1427.	.000	2.44	2500.	.042	42.76	4.917	45.20
2.0	.020	1.50	2.0	1427.	.000	2.44	3000.	.057	54.32	5.045	56.75
2.0	.020	1.50	2.0	2500.	.024	12.15	2000.	.027	31.03	2.869	43.18
2.0	.020	1.50	2.0	2500.	.024	12.15	2500.	.042	42.76	3.013	54.91
2.0	.020	1.50	2.0	2500.	.024	12.15	3000.	.057	54.32	3.142	66.47
2.0	.020	1.50	2.0	3000.	.037	16.49	2000.	.027	31.03	2.800	47.52
2.0	.020	1.50	2.0	3000.	.037	16.49	2500.	.042	42.76	2.943	59.25
2.0	.020	1.50	2.0	3000.	.037	16.49	3000.	.057	54.32	3.072	70.81
2.0	.020	1.70	1.0	1478.	.000	5.26	2000.	.027	23.75	4.522	29.01
2.0	.020	1.70	1.0	1478.	.000	5.26	2500.	.041	32.65	4.635	37.90
2.0	.020	1.70	1.0	1478.	.000	5.26	3000.	.057	41.41	4.734	46.67
2.0	.020	1.70	1.0	2500.	.023	19.55	2000.	.027	23.75	3.007	43.30
2.0	.020	1.70	1.0	2500.	.023	19.55	2500.	.041	32.65	3.120	52.20
2.0	.020	1.70	1.0	2500.	.023	19.55	3000.	.057	41.41	3.219	60.96
2.0	.020	1.70	1.0	3000.	.036	26.27	2000.	.027	23.75	2.940	50.03
2.0	.020	1.70	1.0	3000.	.036	26.27	2500.	.041	32.65	3.053	58.92
2.0	.020	1.70	1.0	3000.	.036	26.27	3000.	.057	41.41	3.152	67.68
2.0	.020	1.70	1.5	1428.	.000	2.93	2000.	.027	28.50	5.253	31.43
2.0	.020	1.70	1.5	1428.	.000	2.93	2500.	.041	39.17	5.389	42.10
2.0	.020	1.70	1.5	1428.	.000	2.93	3000.	.057	49.69	5.508	52.62
2.0	.020	1.70	1.5	2500.	.024	14.58	2000.	.027	28.50	2.971	43.09
2.0	.020	1.70	1.5	2500.	.024	14.58	2500.	.041	39.17	3.107	53.76
2.0	.020	1.70	1.5	2500.	.024	14.58	3000.	.057	49.69	3.226	64.27
2.0	.020	1.70	1.5	3000.	.037	19.79	2000.	.027	28.50	2.887	48.29
2.0	.020	1.70	1.5	3000.	.037	19.79	2500.	.041	39.17	3.023	58.96
2.0	.020	1.70	1.5	3000.	.037	19.79	3000.	.057	49.69	3.142	69.48
2.0	.020	1.70	2.0	1377.	.000	1.26	2000.	.027	31.67	7.879	32.93
2.0	.020	1.70	2.0	1377.	.000	1.26	2500.	.041	43.53	8.029	44.78
2.0	.020	1.70	2.0	1377.	.000	1.26	3000.	.057	55.21	8.162	56.47
2.0	.020	1.70	2.0	2500.	.025	11.05	2000.	.027	31.67	2.999	42.72
2.0	.020	1.70	2.0	2500.	.025	11.05	2500.	.041	43.53	3.149	54.58
2.0	.020	1.70	2.0	2500.	.025	11.05	3000.	.057	55.21	3.282	66.26
2.0	.020	1.70	2.0	3000.	.038	15.21	2000.	.027	31.67	2.892	46.88
2.0	.020	1.70	2.0	3000.	.038	15.21	2500.	.041	43.53	3.042	58.74
2.0	.020	1.70	2.0	3000.	.038	15.21	3000.	.057	55.21	3.174	70.42

3.0	.013	1.30	1.0	1550.	.000	-2.86	2000.	.020	11.42	-2.384	8.56
3.0	.013	1.30	1.0	1550.	.000	-2.86	2500.	.034	20.82	-2.508	17.96
3.0	.013	1.30	1.0	1550.	.000	-2.86	3000.	.049	30.11	-2.508	27.25
3.0	.013	1.30	1.0	2500.	.022	12.80	2000.	.020	11.42	4.040	24.22
3.0	.013	1.30	1.0	2500.	.022	12.80	2500.	.034	20.82	3.915	33.61
3.0	.013	1.30	1.0	2500.	.022	12.80	3000.	.049	30.11	3.915	42.91
3.0	.013	1.30	1.0	3000.	.035	20.83	2000.	.020	11.42	3.679	32.25
3.0	.013	1.30	1.0	3000.	.035	20.83	2500.	.034	20.82	3.555	41.65
3.0	.013	1.30	1.0	3000.	.035	20.83	3000.	.049	30.11	3.555	50.94
3.0	.013	1.30	1.5	1527.	.000	-2.67	2000.	.020	13.70	-.807	11.03
3.0	.013	1.30	1.5	1527.	.000	-2.67	2500.	.034	24.98	-.956	22.31
3.0	.013	1.30	1.5	1527.	.000	-2.67	3000.	.049	36.13	-.956	33.46
3.0	.013	1.30	1.5	2500.	.023	10.13	2000.	.020	13.70	3.922	23.83
3.0	.013	1.30	1.5	2500.	.023	10.13	2500.	.034	24.98	3.772	35.11
3.0	.013	1.30	1.5	2500.	.023	10.13	3000.	.049	36.13	3.773	46.26
3.0	.013	1.30	1.5	3000.	.036	16.54	2000.	.020	13.70	3.615	30.24
3.0	.013	1.30	1.5	3000.	.036	16.54	2500.	.034	24.98	3.465	41.52
3.0	.013	1.30	1.5	3000.	.036	16.54	3000.	.049	36.13	3.466	52.67
3.0	.013	1.30	2.0	1505.	.000	-2.56	2000.	.020	15.22	.154	12.67
3.0	.013	1.30	2.0	1505.	.000	-2.56	2500.	.034	27.76	-.012	25.20
3.0	.013	1.30	2.0	1505.	.000	-2.56	3000.	.049	40.15	-.012	37.59
3.0	.013	1.30	2.0	2500.	.023	8.34	2000.	.020	15.22	3.846	23.56
3.0	.013	1.30	2.0	2500.	.023	8.34	2500.	.034	27.76	3.680	36.09
3.0	.013	1.30	2.0	2500.	.023	8.34	3000.	.049	40.15	3.681	48.49
3.0	.013	1.30	2.0	3000.	.036	13.66	2000.	.020	15.22	3.574	28.89
3.0	.013	1.30	2.0	3000.	.036	13.66	2500.	.034	27.76	3.407	41.42
3.0	.013	1.30	2.0	3000.	.036	13.66	3000.	.049	40.15	3.408	53.81
3.0	.013	1.50	1.0	1524.	.000	-3.42	2000.	.020	11.49	-1.786	8.07
3.0	.013	1.50	1.0	1524.	.000	-3.42	2500.	.034	20.90	-1.888	17.48
3.0	.013	1.50	1.0	1524.	.000	-3.42	3000.	.049	30.21	-1.880	26.79
3.0	.013	1.50	1.0	2500.	.023	12.64	2000.	.020	11.49	4.059	24.13
3.0	.013	1.50	1.0	2500.	.023	12.64	2500.	.034	20.90	3.957	33.54
3.0	.013	1.50	1.0	2500.	.023	12.64	3000.	.049	30.21	3.965	42.85
3.0	.013	1.50	1.0	3000.	.036	20.65	2000.	.020	11.49	3.672	32.14
3.0	.013	1.50	1.0	3000.	.036	20.65	2500.	.034	20.90	3.569	41.55
3.0	.013	1.50	1.0	3000.	.036	20.65	3000.	.049	30.21	3.577	50.85
3.0	.013	1.50	1.5	1488.	.000	-3.36	2000.	.020	13.79	-.310	10.43
3.0	.013	1.50	1.5	1488.	.000	-3.36	2500.	.034	25.08	-.433	21.72
3.0	.013	1.50	1.5	1488.	.000	-3.36	3000.	.049	36.25	-.423	32.88
3.0	.013	1.50	1.5	2500.	.023	9.91	2000.	.020	13.79	3.954	23.70
3.0	.013	1.50	1.5	2500.	.023	9.91	2500.	.034	25.08	3.831	34.99
3.0	.013	1.50	1.5	2500.	.023	9.91	3000.	.049	36.25	3.841	46.15
3.0	.013	1.50	1.5	3000.	.037	16.28	2000.	.020	13.79	3.611	30.07
3.0	.013	1.50	1.5	3000.	.037	16.28	2500.	.034	25.08	3.488	41.36
3.0	.013	1.50	1.5	3000.	.037	16.28	3000.	.049	36.25	3.498	52.53
3.0	.013	1.50	2.0	1452.	.000	-3.35	2000.	.020	15.32	.553	11.97
3.0	.013	1.50	2.0	1452.	.000	-3.35	2500.	.034	27.87	.416	24.52
3.0	.013	1.50	2.0	1452.	.000	-3.35	3000.	.049	40.27	.427	36.93
3.0	.013	1.50	2.0	2500.	.024	8.05	2000.	.020	15.32	3.895	23.37
3.0	.013	1.50	2.0	2500.	.024	8.05	2500.	.034	27.87	3.758	35.92
3.0	.013	1.50	2.0	2500.	.024	8.05	3000.	.049	40.27	3.769	48.33
3.0	.013	1.50	2.0	3000.	.038	13.33	2000.	.020	15.32	3.576	28.65
3.0	.013	1.50	2.0	3000.	.038	13.33	2500.	.034	27.87	3.439	41.20
3.0	.013	1.50	2.0	3000.	.038	13.33	3000.	.049	40.27	3.450	53.61

3.0	.013	1.70	1.0	1500.	.000	-3.94	2000.	.019	11.55	-1.391	7.61
3.0	.013	1.70	1.0	1500.	.000	-3.94	2500.	.033	20.96	-1.474	17.03
3.0	.013	1.70	1.0	1500.	.000	-3.94	3000.	.048	30.28	-1.459	26.34
3.0	.013	1.70	1.0	2500.	.023	12.48	2000.	.019	11.55	4.084	24.02
3.0	.013	1.70	1.0	2500.	.023	12.48	2500.	.033	20.96	4.001	33.44
3.0	.013	1.70	1.0	2500.	.023	12.48	3000.	.048	30.28	4.016	42.75
3.0	.013	1.70	1.0	3000.	.037	20.46	2000.	.019	11.55	3.670	32.00
3.0	.013	1.70	1.0	3000.	.037	20.46	2500.	.033	20.96	3.587	41.42
3.0	.013	1.70	1.0	3000.	.037	20.46	3000.	.048	30.28	3.602	50.73
3.0	.013	1.70	1.5	1452.	.000	-4.02	2000.	.019	13.86	-.011	9.84
3.0	.013	1.70	1.5	1452.	.000	-4.02	2500.	.033	25.16	-.111	21.14
3.0	.013	1.70	1.5	1452.	.000	-4.02	3000.	.048	36.33	-.093	32.32
3.0	.013	1.70	1.5	2500.	.024	9.66	2000.	.019	13.86	3.999	23.52
3.0	.013	1.70	1.5	2500.	.024	9.66	2500.	.033	25.16	3.899	34.82
3.0	.013	1.70	1.5	2500.	.024	9.66	3000.	.048	36.33	3.917	46.00
3.0	.013	1.70	1.5	3000.	.038	16.00	2000.	.019	13.86	3.616	29.85
3.0	.013	1.70	1.5	3000.	.038	16.00	2500.	.033	25.16	3.516	41.15
3.0	.013	1.70	1.5	3000.	.038	16.00	3000.	.048	36.33	3.535	52.33
3.0	.013	1.70	2.0	1403.	.000	-4.12	2000.	.019	15.39	.773	11.28
3.0	.013	1.70	2.0	1403.	.000	-4.12	2500.	.033	27.95	.662	23.83
3.0	.013	1.70	2.0	1403.	.000	-4.12	3000.	.048	40.37	.683	36.26
3.0	.013	1.70	2.0	2500.	.025	7.72	2000.	.019	15.39	3.968	23.11
3.0	.013	1.70	2.0	2500.	.025	7.72	2500.	.033	27.95	3.857	35.67
3.0	.013	1.70	2.0	2500.	.025	7.72	3000.	.048	40.37	3.877	48.09
3.0	.013	1.70	2.0	3000.	.039	12.94	2000.	.019	15.39	3.594	28.34
3.0	.013	1.70	2.0	3000.	.039	12.94	2500.	.033	27.95	3.483	40.89
3.0	.013	1.70	2.0	3000.	.039	12.94	3000.	.048	40.37	3.503	53.31

1.0	.015	1.30	1.0	1410.	.000	14.13	2000.	.024	17.28	2.202	31.41
1.0	.015	1.30	1.0	1410.	.000	14.13	2500.	.036	22.18	2.388	36.31
1.0	.015	1.30	1.0	1410.	.000	14.13	3000.	.048	26.86	2.552	40.99
1.0	.015	1.30	1.0	2500.	.023	26.91	2000.	.024	17.28	2.538	44.19
1.0	.015	1.30	1.0	2500.	.023	26.91	2500.	.036	22.18	2.725	49.09
1.0	.015	1.30	1.0	2500.	.023	26.91	3000.	.048	26.86	2.889	53.77
1.0	.015	1.30	1.0	3000.	.036	32.36	2000.	.024	17.28	2.670	49.64
1.0	.015	1.30	1.0	3000.	.036	32.36	2500.	.036	22.18	2.856	54.54
1.0	.015	1.30	1.0	3000.	.036	32.36	3000.	.048	26.86	3.020	59.23
1.0	.015	1.30	1.5	1389.	.000	10.29	2000.	.024	20.74	2.343	31.03
1.0	.015	1.30	1.5	1389.	.000	10.29	2500.	.036	26.62	2.567	36.91
1.0	.015	1.30	1.5	1389.	.000	10.29	3000.	.048	32.24	2.764	42.52
1.0	.015	1.30	1.5	2500.	.024	20.27	2000.	.024	20.74	2.613	41.01
1.0	.015	1.30	1.5	2500.	.024	20.27	2500.	.036	26.62	2.837	46.89
1.0	.015	1.30	1.5	2500.	.024	20.27	3000.	.048	32.24	3.034	52.51
1.0	.015	1.30	1.5	3000.	.036	24.43	2000.	.024	20.74	2.721	45.17
1.0	.015	1.30	1.5	3000.	.036	24.43	2500.	.036	26.62	2.944	51.05
1.0	.015	1.30	1.5	3000.	.036	24.43	3000.	.048	32.24	3.141	56.67
1.0	.015	1.30	2.0	1369.	.000	7.68	2000.	.024	23.04	2.455	30.72
1.0	.015	1.30	2.0	1369.	.000	7.68	2500.	.036	29.58	2.704	37.25
1.0	.015	1.30	2.0	1369.	.000	7.68	3000.	.048	35.82	2.923	43.49
1.0	.015	1.30	2.0	2500.	.024	15.76	2000.	.024	23.04	2.677	38.80
1.0	.015	1.30	2.0	2500.	.024	15.76	2500.	.036	29.58	2.925	45.33
1.0	.015	1.30	2.0	2500.	.024	15.76	3000.	.048	35.82	3.144	51.57
1.0	.015	1.30	2.0	3000.	.037	19.04	2000.	.024	23.04	2.768	42.08
1.0	.015	1.30	2.0	3000.	.037	19.04	2500.	.036	29.58	3.017	48.62
1.0	.015	1.30	2.0	3000.	.037	19.04	3000.	.048	35.82	3.236	54.86
1.0	.015	1.50	1.0	1386.	.000	12.65	2000.	.024	20.03	2.117	32.68
1.0	.015	1.50	1.0	1386.	.000	12.65	2500.	.035	25.46	2.294	38.11
1.0	.015	1.50	1.0	1386.	.000	12.65	3000.	.048	30.66	2.447	43.32
1.0	.015	1.50	1.0	2500.	.024	25.09	2000.	.024	20.03	2.454	45.12
1.0	.015	1.50	1.0	2500.	.024	25.09	2500.	.035	25.46	2.631	50.54
1.0	.015	1.50	1.0	2500.	.024	25.09	3000.	.048	30.66	2.784	55.75
1.0	.015	1.50	1.0	3000.	.036	30.25	2000.	.024	20.03	2.589	50.28
1.0	.015	1.50	1.0	3000.	.036	30.25	2500.	.035	25.46	2.766	55.70
1.0	.015	1.50	1.0	3000.	.036	30.25	3000.	.048	30.66	2.919	60.91
1.0	.015	1.50	1.5	1353.	.000	8.38	2000.	.024	24.04	2.297	32.42
1.0	.015	1.50	1.5	1353.	.000	8.38	2500.	.035	30.55	2.509	38.93
1.0	.015	1.50	1.5	1353.	.000	8.38	3000.	.048	36.79	2.692	45.18
1.0	.015	1.50	1.5	2500.	.024	17.83	2000.	.024	24.04	2.554	41.86
1.0	.015	1.50	1.5	2500.	.024	17.83	2500.	.035	30.55	2.766	48.38
1.0	.015	1.50	1.5	2500.	.024	17.83	3000.	.048	36.79	2.949	54.62
1.0	.015	1.50	1.5	3000.	.037	21.60	2000.	.024	24.04	2.665	45.63
1.0	.015	1.50	1.5	3000.	.037	21.60	2500.	.035	30.55	2.878	52.15
1.0	.015	1.50	1.5	3000.	.037	21.60	3000.	.048	36.79	3.061	58.39
1.0	.015	1.50	2.0	1321.	.000	5.40	2000.	.024	26.71	2.518	32.11
1.0	.015	1.50	2.0	1321.	.000	5.40	2500.	.035	33.94	2.754	39.35
1.0	.015	1.50	2.0	1321.	.000	5.40	3000.	.048	40.88	2.958	46.28
1.0	.015	1.50	2.0	2500.	.025	12.71	2000.	.024	26.71	2.685	39.42
1.0	.015	1.50	2.0	2500.	.025	12.71	2500.	.035	33.94	2.921	46.65
1.0	.015	1.50	2.0	2500.	.025	12.71	3000.	.048	40.88	3.125	53.59
1.0	.015	1.50	2.0	3000.	.038	15.50	2000.	.024	26.71	2.781	42.21
1.0	.015	1.50	2.0	3000.	.038	15.50	2500.	.035	33.94	3.017	49.45
1.0	.015	1.50	2.0	3000.	.038	15.50	3000.	.048	40.88	3.221	56.39

1.0	.015	1.70	1.0	1364.	.000	11.23	2000.	.024	22.18	2.129	33.41
1.0	.015	1.70	1.0	1364.	.000	11.23	2500.	.035	28.02	2.298	39.25
1.0	.015	1.70	1.0	1364.	.000	11.23	3000.	.047	33.63	2.443	44.86
1.0	.015	1.70	1.0	2500.	.024	23.26	2000.	.024	22.18	2.459	45.45
1.0	.015	1.70	1.0	2500.	.024	23.26	2500.	.035	28.02	2.628	51.29
1.0	.015	1.70	1.0	2500.	.024	23.26	3000.	.047	33.63	2.773	56.90
1.0	.015	1.70	1.0	3000.	.037	28.13	2000.	.024	22.18	2.597	50.31
1.0	.015	1.70	1.0	3000.	.037	28.13	2500.	.035	28.02	2.766	56.15
1.0	.015	1.70	1.0	3000.	.037	28.13	3000.	.047	33.63	2.911	61.77
1.0	.015	1.70	1.5	1321.	.000	6.48	2000.	.024	26.62	2.447	33.10
1.0	.015	1.70	1.5	1321.	.000	6.48	2500.	.035	33.63	2.650	40.11
1.0	.015	1.70	1.5	1321.	.000	6.48	3000.	.047	40.36	2.824	46.85
1.0	.015	1.70	1.5	2500.	.025	15.25	2000.	.024	26.62	2.647	41.87
1.0	.015	1.70	1.5	2500.	.025	15.25	2500.	.035	33.63	2.850	48.88
1.0	.015	1.70	1.5	2500.	.025	15.25	3000.	.047	40.36	3.024	55.61
1.0	.015	1.70	1.5	3000.	.038	18.61	2000.	.024	26.62	2.763	45.23
1.0	.015	1.70	1.5	3000.	.038	18.61	2500.	.035	33.63	2.966	52.24
1.0	.015	1.70	1.5	3000.	.038	18.61	3000.	.047	40.36	3.140	58.97
1.0	.015	1.70	2.0	1277.	.000	3.20	2000.	.024	29.58	3.106	32.77
1.0	.015	1.70	2.0	1277.	.000	3.20	2500.	.035	37.36	3.332	40.56
1.0	.015	1.70	2.0	1277.	.000	3.20	3000.	.047	44.85	3.525	48.04
1.0	.015	1.70	2.0	2500.	.026	9.71	2000.	.024	29.58	2.946	39.29
1.0	.015	1.70	2.0	2500.	.026	9.71	2500.	.035	37.36	3.172	47.08
1.0	.015	1.70	2.0	2500.	.026	9.71	3000.	.047	44.85	3.365	54.56
1.0	.015	1.70	2.0	3000.	.038	12.06	2000.	.024	29.58	3.036	41.64
1.0	.015	1.70	2.0	3000.	.038	12.06	2500.	.035	37.36	3.262	49.42
1.0	.015	1.70	2.0	3000.	.038	12.06	3000.	.047	44.65	3.455	56.90
2.0	.009	1.30	1.0	1405.	.000	5.13	2000.	.019	17.09	2.678	22.22
2.0	.009	1.30	1.0	1405.	.000	5.13	2500.	.031	25.26	2.751	30.39
2.0	.009	1.30	1.0	1405.	.000	5.13	3000.	.043	33.19	2.823	38.32
2.0	.009	1.30	1.0	2500.	.023	22.43	2000.	.019	17.09	2.326	39.52
2.0	.009	1.30	1.0	2500.	.023	22.43	2500.	.031	25.26	2.398	47.69
2.0	.009	1.30	1.0	2500.	.023	22.43	3000.	.043	33.19	2.470	55.62
2.0	.009	1.30	1.0	3000.	.035	29.92	2000.	.019	17.09	2.368	47.01
2.0	.009	1.30	1.0	3000.	.035	29.92	2500.	.031	25.26	2.440	55.18
2.0	.009	1.30	1.0	3000.	.035	29.92	3000.	.043	33.19	2.512	63.11
2.0	.009	1.30	1.5	1384.	.000	3.48	2000.	.019	20.51	2.790	23.98
2.0	.009	1.30	1.5	1384.	.000	3.48	2500.	.031	30.31	2.877	33.78
2.0	.009	1.30	1.5	1384.	.000	3.48	3000.	.043	39.83	2.963	43.30
2.0	.009	1.30	1.5	2500.	.024	17.41	2000.	.019	20.51	2.314	37.91
2.0	.009	1.30	1.5	2500.	.024	17.41	2500.	.031	30.31	2.401	47.71
2.0	.009	1.30	1.5	2500.	.024	17.41	3000.	.043	39.83	2.487	57.23
2.0	.009	1.30	1.5	3000.	.036	23.31	2000.	.019	20.51	2.341	43.82
2.0	.009	1.30	1.5	3000.	.036	23.31	2500.	.031	30.31	2.429	53.62
2.0	.009	1.30	1.5	3000.	.036	23.31	3000.	.043	39.83	2.514	63.14
2.0	.009	1.30	2.0	1363.	.000	2.35	2000.	.019	22.79	2.967	25.14
2.0	.009	1.30	2.0	1363.	.000	2.35	2500.	.031	33.68	3.064	36.03
2.0	.009	1.30	2.0	1363.	.000	2.35	3000.	.043	44.25	3.159	46.61
2.0	.009	1.30	2.0	2500.	.024	14.01	2000.	.019	22.79	2.312	36.80
2.0	.009	1.30	2.0	2500.	.024	14.01	2500.	.031	33.68	2.409	47.69
2.0	.009	1.30	2.0	2500.	.024	14.01	3000.	.043	44.25	2.504	58.27
2.0	.009	1.30	2.0	3000.	.036	18.86	2000.	.019	22.79	2.328	41.65
2.0	.009	1.30	2.0	3000.	.036	18.86	2500.	.031	33.68	2.425	52.54
2.0	.009	1.30	2.0	3000.	.036	18.86	3000.	.043	44.25	2.520	63.11

2.0	.009	1.50	1.0	1381.	.000	4.22	2000.	.019	17.58	2.984	21.80
2.0	.009	1.50	1.0	1381.	.000	4.22	2500.	.030	25.84	3.068	30.06
2.0	.009	1.50	1.0	1381.	.000	4.22	3000.	.042	33.87	3.144	38.09
2.0	.009	1.50	1.0	2500.	.024	21.65	2000.	.019	17.58	2.341	39.23
2.0	.009	1.50	1.0	2500.	.024	21.65	2500.	.030	25.84	2.425	47.49
2.0	.009	1.50	1.0	2500.	.024	21.65	3000.	.042	33.87	2.501	55.51
2.0	.009	1.50	1.0	3000.	.036	29.01	2000.	.019	17.58	2.374	46.60
2.0	.009	1.50	1.0	3000.	.036	29.01	2500.	.030	25.84	2.457	54.85
2.0	.009	1.50	1.0	3000.	.036	29.01	3000.	.042	33.87	2.533	62.88
2.0	.009	1.50	1.5	1348.	.000	2.33	2000.	.019	21.10	3.504	23.42
2.0	.009	1.50	1.5	1348.	.000	2.33	2500.	.030	31.01	3.604	33.33
2.0	.009	1.50	1.5	1348.	.000	2.33	3000.	.042	40.64	3.695	42.96
2.0	.009	1.50	1.5	2500.	.024	16.35	2000.	.019	21.10	2.348	37.45
2.0	.009	1.50	1.5	2500.	.024	16.35	2500.	.030	31.01	2.448	47.36
2.0	.009	1.50	1.5	2500.	.024	16.35	3000.	.042	40.64	2.540	56.99
2.0	.009	1.50	1.5	3000.	.037	22.09	2000.	.019	21.10	2.361	43.19
2.0	.009	1.50	1.5	3000.	.037	22.09	2500.	.030	31.01	2.461	53.10
2.0	.009	1.50	1.5	3000.	.037	22.09	3000.	.042	40.64	2.552	62.73
2.0	.009	1.50	2.0	1315.	.000	1.00	2000.	.019	23.44	5.081	24.44
2.0	.009	1.50	2.0	1315.	.000	1.00	2500.	.030	34.45	5.192	35.45
2.0	.009	1.50	2.0	1315.	.000	1.00	3000.	.042	45.15	5.294	46.15
2.0	.009	1.50	2.0	2500.	.025	12.69	2000.	.019	23.44	2.373	36.14
2.0	.009	1.50	2.0	2500.	.025	12.69	2500.	.030	34.45	2.484	47.15
2.0	.009	1.50	2.0	2500.	.025	12.69	3000.	.042	45.15	2.585	57.85
2.0	.009	1.50	2.0	3000.	.037	17.33	2000.	.019	23.44	2.368	40.77
2.0	.009	1.50	2.0	3000.	.037	17.33	2500.	.030	34.45	2.479	51.78
2.0	.009	1.50	2.0	3000.	.037	17.33	3000.	.042	45.15	2.581	62.48
2.0	.009	1.70	1.0	1359.	.000	3.36	2000.	.019	17.98	3.462	21.34
2.0	.009	1.70	1.0	1359.	.000	3.36	2500.	.030	26.31	3.553	29.67
2.0	.009	1.70	1.0	1359.	.000	3.36	3000.	.042	34.41	3.634	37.77
2.0	.009	1.70	1.0	2500.	.024	20.86	2000.	.019	17.98	2.370	38.84
2.0	.009	1.70	1.0	2500.	.024	20.86	2500.	.030	26.31	2.462	47.18
2.0	.009	1.70	1.0	2500.	.024	20.86	3000.	.042	34.41	2.542	55.28
2.0	.009	1.70	1.0	3000.	.036	28.10	2000.	.019	17.98	2.392	46.09
2.0	.009	1.70	1.0	3000.	.036	28.10	2500.	.030	26.31	2.484	54.42
2.0	.009	1.70	1.0	3000.	.036	28.10	3000.	.042	34.41	2.564	62.52
2.0	.009	1.70	1.5	1315.	.000	1.20	2000.	.019	21.58	5.653	22.78
2.0	.009	1.70	1.5	1315.	.000	1.20	2500.	.030	31.58	5.763	32.78
2.0	.009	1.70	1.5	1315.	.000	1.20	3000.	.042	41.30	5.859	42.50
2.0	.009	1.70	1.5	2500.	.025	15.24	2000.	.019	21.58	2.410	36.81
2.0	.009	1.70	1.5	2500.	.025	15.24	2500.	.030	31.58	2.519	46.81
2.0	.009	1.70	1.5	2500.	.025	15.24	3000.	.042	41.30	2.616	56.53
2.0	.009	1.70	1.5	3000.	.037	20.80	2000.	.019	21.58	2.404	42.38
2.0	.009	1.70	1.5	3000.	.037	20.80	2500.	.030	31.58	2.514	52.37
2.0	.009	1.70	1.5	3000.	.037	20.80	3000.	.042	41.30	2.610	62.09
2.0	.009	1.70	2.0	1271.	.000	-.37	2000.	.019	23.98	-8.956	23.61
2.0	.009	1.70	2.0	1271.	.000	-.37	2500.	.030	35.09	-8.834	34.71
2.0	.009	1.70	2.0	1271.	.000	-.37	3000.	.042	45.88	-8.727	45.51
2.0	.009	1.70	2.0	2500.	.026	11.22	2000.	.019	23.98	2.490	35.20
2.0	.009	1.70	2.0	2500.	.026	11.22	2500.	.030	35.09	2.612	46.31
2.0	.009	1.70	2.0	2500.	.026	11.22	3000.	.042	45.88	2.719	57.11
2.0	.009	1.70	2.0	3000.	.038	15.62	2000.	.019	23.98	2.453	39.60
2.0	.009	1.70	2.0	3000.	.038	15.62	2500.	.030	35.09	2.575	50.71
2.0	.009	1.70	2.0	3000.	.038	15.62	3000.	.042	45.88	2.682	61.51

3.0	.001	1.30	1.0	1391.	.000	-8.98	2000.	.011	3.69	2.577	-5.29
3.0	.001	1.30	1.0	1391.	.000	-8.98	2500.	.022	12.56	1.483	3.58
3.0	.001	1.30	1.0	1391.	.000	-8.98	3000.	.034	21.22	1.350	12.24
3.0	.001	1.30	1.0	2500.	.023	10.29	2000.	.011	3.69	4.713	13.98
3.0	.001	1.30	1.0	2500.	.023	10.29	2500.	.022	12.56	3.619	22.85
3.0	.001	1.30	1.0	2500.	.023	10.29	3000.	.034	21.22	3.486	31.51
3.0	.001	1.30	1.0	3000.	.035	18.59	2000.	.011	3.69	4.374	22.29
3.0	.001	1.30	1.0	3000.	.035	18.59	2500.	.022	12.56	3.280	31.15
3.0	.001	1.30	1.0	3000.	.035	18.59	3000.	.034	21.22	3.147	39.81
3.0	.001	1.30	1.5	1370.	.000	-7.63	2000.	.011	4.43	3.130	-3.20
3.0	.001	1.30	1.5	1370.	.000	-7.63	2500.	.022	15.07	1.817	7.44
3.0	.001	1.30	1.5	1370.	.000	-7.63	3000.	.034	25.46	1.657	17.83
3.0	.001	1.30	1.5	2500.	.023	8.03	2000.	.011	4.43	4.905	12.46
3.0	.001	1.30	1.5	2500.	.023	8.03	2500.	.022	15.07	3.592	23.10
3.0	.001	1.30	1.5	2500.	.023	8.03	3000.	.034	25.46	3.432	33.49
3.0	.001	1.30	1.5	3000.	.035	14.64	2000.	.011	4.43	4.602	19.07
3.0	.001	1.30	1.5	3000.	.035	14.64	2500.	.022	15.07	3.289	29.71
3.0	.001	1.30	1.5	3000.	.035	14.64	3000.	.034	25.46	3.129	40.10
3.0	.001	1.30	2.0	1349.	.000	-6.74	2000.	.011	4.93	3.498	-1.81
3.0	.001	1.30	2.0	1349.	.000	-6.74	2500.	.022	16.75	2.039	10.01
3.0	.001	1.30	2.0	1349.	.000	-6.74	3000.	.034	28.29	1.861	21.55
3.0	.001	1.30	2.0	2500.	.023	6.50	2000.	.011	4.93	5.040	11.43
3.0	.001	1.30	2.0	2500.	.023	6.50	2500.	.022	16.75	3.582	23.25
3.0	.001	1.30	2.0	2500.	.023	6.50	3000.	.034	28.29	3.404	34.79
3.0	.001	1.30	2.0	3000.	.035	11.98	2000.	.011	4.93	4.757	16.91
3.0	.001	1.30	2.0	3000.	.035	11.98	2500.	.022	16.75	3.298	28.73
3.0	.001	1.30	2.0	3000.	.035	11.98	3000.	.034	28.29	3.121	40.27
3.0	.001	1.50	1.0	1367.	.000	-9.62	2000.	.010	3.75	2.436	-5.88
3.0	.001	1.50	1.0	1367.	.000	-9.62	2500.	.021	12.62	1.447	3.00
3.0	.001	1.50	1.0	1367.	.000	-9.62	3000.	.033	21.29	1.330	11.66
3.0	.001	1.50	1.0	2500.	.023	10.00	2000.	.010	3.75	4.669	13.74
3.0	.001	1.50	1.0	2500.	.023	10.00	2500.	.021	12.62	3.681	22.62
3.0	.001	1.50	1.0	2500.	.023	10.00	3000.	.033	21.29	3.563	31.28
3.0	.001	1.50	1.0	3000.	.035	18.25	2000.	.010	3.75	4.284	22.00
3.0	.001	1.50	1.0	3000.	.035	18.25	2500.	.021	12.62	3.295	30.87
3.0	.001	1.50	1.0	3000.	.035	18.25	3000.	.033	21.29	3.178	39.53
3.0	.001	1.50	1.5	1333.	.000	-8.43	2000.	.010	4.50	2.959	-3.93
3.0	.001	1.50	1.5	1333.	.000	-8.43	2500.	.021	15.15	1.773	6.72
3.0	.001	1.50	1.5	1333.	.000	-8.43	3000.	.033	25.54	1.632	17.11
3.0	.001	1.50	1.5	2500.	.024	7.63	2000.	.010	4.50	4.873	12.12
3.0	.001	1.50	1.5	2500.	.024	7.63	2500.	.021	15.15	3.687	22.77
3.0	.001	1.50	1.5	2500.	.024	7.63	3000.	.033	25.54	3.546	33.17
3.0	.001	1.50	1.5	3000.	.036	14.17	2000.	.010	4.50	4.502	18.67
3.0	.001	1.50	1.5	3000.	.036	14.17	2500.	.021	15.15	3.316	29.32
3.0	.001	1.50	1.5	3000.	.036	14.17	3000.	.033	25.54	3.175	39.71
3.0	.001	1.50	2.0	1299.	.000	-7.67	2000.	.010	5.00	3.308	-2.67
3.0	.001	1.50	2.0	1299.	.000	-7.67	2500.	.021	16.83	1.990	9.16
3.0	.001	1.50	2.0	1299.	.000	-7.67	3000.	.033	28.38	1.833	20.71
3.0	.001	1.50	2.0	2500.	.024	5.99	2000.	.010	5.00	5.035	10.99
3.0	.001	1.50	2.0	2500.	.024	5.99	2500.	.021	16.83	3.717	22.82
3.0	.001	1.50	2.0	2500.	.024	5.99	3000.	.033	28.38	3.561	34.37
3.0	.001	1.50	2.0	3000.	.036	11.39	2000.	.010	5.00	4.659	16.39
3.0	.001	1.50	2.0	3000.	.036	11.39	2500.	.021	16.83	3.341	28.22
3.0	.001	1.50	2.0	3000.	.036	11.39	3000.	.033	28.38	3.184	39.77

FAN	FAMB	FPRSL	BPR	T8	FAAB	T51	T10	FAPAB	T32		T51
3.0	.001	1.70	1.0	1344.	.000	-10.23	2000.	.010	3.79	2.314	-6.44
3.0	.001	1.70	1.0	1344.	.000	-10.23	2500.	.021	12.67	1.416	2.44
3.0	.001	1.70	1.0	1344.	.000	-10.23	3000.	.033	21.34	1.312	11.11
3.0	.001	1.70	1.0	2500.	.024	9.70	2000.	.010	3.79	4.650	13.49
3.0	.001	1.70	1.0	2500.	.024	9.70	2500.	.021	12.67	3.751	22.37
3.0	.001	1.70	1.0	2500.	.024	9.70	3000.	.033	21.34	3.647	31.04
3.0	.001	1.70	1.0	3000.	.036	17.90	2000.	.010	3.79	4.214	21.69
3.0	.001	1.70	1.0	3000.	.036	17.90	2500.	.021	12.67	3.316	30.57
3.0	.001	1.70	1.0	3000.	.036	17.90	3000.	.033	21.34	3.212	39.24
3.0	.001	1.70	1.5	1300.	.000	-9.20	2000.	.010	4.55	2.813	-4.65
3.0	.001	1.70	1.5	1300.	.000	-9.20	2500.	.021	15.20	1.734	6.01
3.0	.001	1.70	1.5	1300.	.000	-9.20	3000.	.033	25.61	1.610	16.41
3.0	.001	1.70	1.5	2500.	.024	7.19	2000.	.010	4.55	4.885	11.74
3.0	.001	1.70	1.5	2500.	.024	7.19	2500.	.021	15.20	3.807	22.39
3.0	.001	1.70	1.5	2500.	.024	7.19	3000.	.033	25.61	3.683	32.80
3.0	.001	1.70	1.5	3000.	.036	13.67	2000.	.010	4.55	4.434	18.22
3.0	.001	1.70	1.5	3000.	.036	13.67	2500.	.021	15.20	3.355	28.87
3.0	.001	1.70	1.5	3000.	.036	13.67	3000.	.033	25.61	3.231	39.28
3.0	.001	1.70	2.0	1255.	.000	-8.57	2000.	.010	5.05	3.144	-3.52
3.0	.001	1.70	2.0	1255.	.000	-8.57	2500.	.021	16.89	1.946	8.32
3.0	.001	1.70	2.0	1255.	.000	-8.57	3000.	.033	28.45	1.808	19.88
3.0	.001	1.70	2.0	2500.	.025	5.41	2000.	.010	5.05	5.112	10.46
3.0	.001	1.70	2.0	2500.	.025	5.41	2500.	.021	16.89	3.914	22.30
3.0	.001	1.70	2.0	2500.	.025	5.41	3000.	.033	28.45	3.776	33.86
3.0	.001	1.70	2.0	3000.	.037	10.71	2000.	.010	5.05	4.606	15.77
3.0	.001	1.70	2.0	3000.	.037	10.71	2500.	.021	16.89	3.408	27.61
3.0	.001	1.70	2.0	3000.	.037	10.71	3000.	.033	28.45	3.270	39.17

1.0	.015	1.30	1.0	1408.	.000	16.17	2000.	.025	18.30	2.087	34.46
1.0	.015	1.30	1.0	1408.	.000	16.17	2500.	.037	23.28	2.270	39.44
1.0	.015	1.30	1.0	1408.	.000	16.17	3000.	.049	28.04	2.430	44.21
1.0	.015	1.30	1.0	2500.	.023	29.77	2000.	.025	18.30	2.401	48.06
1.0	.015	1.30	1.0	2500.	.023	29.77	2500.	.037	23.28	2.583	53.04
1.0	.015	1.30	1.0	2500.	.023	29.77	3000.	.049	28.04	2.744	57.81
1.0	.015	1.30	1.0	3000.	.036	35.58	2000.	.025	18.30	2.523	53.88
1.0	.015	1.30	1.0	3000.	.036	35.58	2500.	.037	23.28	2.706	58.86
1.0	.015	1.30	1.0	3000.	.036	35.58	3000.	.049	28.04	2.866	63.62
1.0	.015	1.30	1.5	1388.	.000	11.98	2000.	.025	21.96	2.217	33.94
1.0	.015	1.30	1.5	1388.	.000	11.98	2500.	.037	27.93	2.436	39.92
1.0	.015	1.30	1.5	1388.	.000	11.98	3000.	.049	33.65	2.629	45.63
1.0	.015	1.30	1.5	2500.	.024	22.69	2000.	.025	21.96	2.471	44.64
1.0	.015	1.30	1.5	2500.	.024	22.69	2500.	.037	27.93	2.690	50.62
1.0	.015	1.30	1.5	2500.	.024	22.69	3000.	.049	33.65	2.883	56.33
1.0	.015	1.30	1.5	3000.	.036	27.16	2000.	.025	21.96	2.571	49.12
1.0	.015	1.30	1.5	3000.	.036	27.16	2500.	.037	27.93	2.789	55.09
1.0	.015	1.30	1.5	3000.	.036	27.16	3000.	.049	33.65	2.982	60.81
1.0	.015	1.30	2.0	1367.	.000	9.16	2000.	.025	24.40	2.314	33.55
1.0	.015	1.30	2.0	1367.	.000	9.16	2500.	.037	31.04	2.557	40.19
1.0	.015	1.30	2.0	1367.	.000	9.16	3000.	.049	37.39	2.772	46.54
1.0	.015	1.30	2.0	2500.	.024	17.88	2000.	.025	24.40	2.526	42.28
1.0	.015	1.30	2.0	2500.	.024	17.88	2500.	.037	31.04	2.769	48.92
1.0	.015	1.30	2.0	2500.	.024	17.88	3000.	.049	37.39	2.984	55.27
1.0	.015	1.30	2.0	3000.	.037	21.45	2000.	.025	24.40	2.611	45.84
1.0	.015	1.30	2.0	3000.	.037	21.45	2500.	.037	31.04	2.854	52.49
1.0	.015	1.30	2.0	3000.	.037	21.45	3000.	.049	37.39	3.069	58.83
1.0	.015	1.50	1.0	1385.	.000	14.79	2000.	.025	21.18	1.981	35.97
1.0	.015	1.50	1.0	1385.	.000	14.79	2500.	.036	26.71	2.152	41.50
1.0	.015	1.50	1.0	1385.	.000	14.79	3000.	.049	32.02	2.301	46.81
1.0	.015	1.50	1.0	2500.	.024	28.13	2000.	.025	21.18	2.299	49.30
1.0	.015	1.50	1.0	2500.	.024	28.13	2500.	.036	26.71	2.470	54.84
1.0	.015	1.50	1.0	2500.	.024	28.13	3000.	.049	32.02	2.619	60.15
1.0	.015	1.50	1.0	3000.	.036	33.68	2000.	.025	21.18	2.424	54.86
1.0	.015	1.50	1.0	3000.	.036	33.68	2500.	.036	26.71	2.595	60.39
1.0	.015	1.50	1.0	3000.	.036	33.68	3000.	.049	32.02	2.744	65.70
1.0	.015	1.50	1.5	1352.	.000	10.22	2000.	.025	25.41	2.122	35.63
1.0	.015	1.50	1.5	1352.	.000	10.22	2500.	.036	32.05	2.327	42.27
1.0	.015	1.50	1.5	1352.	.000	10.22	3000.	.049	38.42	2.506	48.64
1.0	.015	1.50	1.5	2500.	.024	20.49	2000.	.025	25.41	2.374	45.90
1.0	.015	1.50	1.5	2500.	.024	20.49	2500.	.036	32.05	2.580	52.54
1.0	.015	1.50	1.5	2500.	.024	20.49	3000.	.049	38.42	2.758	58.91
1.0	.015	1.50	1.5	3000.	.037	24.61	2000.	.025	25.41	2.478	50.02
1.0	.015	1.50	1.5	3000.	.037	24.61	2500.	.036	32.05	2.683	56.66
1.0	.015	1.50	1.5	3000.	.037	24.61	3000.	.049	38.42	2.862	63.03
1.0	.015	1.50	2.0	1319.	.000	7.05	2000.	.025	28.23	2.267	35.28
1.0	.015	1.50	2.0	1319.	.000	7.05	2500.	.036	35.61	2.496	42.66
1.0	.015	1.50	2.0	1319.	.000	7.05	3000.	.049	42.69	2.694	49.74
1.0	.015	1.50	2.0	2500.	.025	15.14	2000.	.025	28.23	2.464	43.38
1.0	.015	1.50	2.0	2500.	.025	15.14	2500.	.036	35.61	2.692	50.75
1.0	.015	1.50	2.0	2500.	.025	15.14	3000.	.049	42.69	2.890	57.83
1.0	.015	1.50	2.0	3000.	.038	18.27	2000.	.025	28.23	2.553	46.50
1.0	.015	1.50	2.0	3000.	.038	18.27	2500.	.036	35.61	2.782	53.88
1.0	.015	1.50	2.0	3000.	.038	18.27	3000.	.049	42.69	2.980	60.96

1.0	.015	1.70	1.0	1363.	.000	13.47	2000.	.024	23.41	1.958	36.87
1.0	.015	1.70	1.0	1363.	.000	13.47	2500.	.036	29.37	2.121	42.84
1.0	.015	1.70	1.0	1363.	.000	13.47	3000.	.048	35.10	2.262	48.57
1.0	.015	1.70	1.0	2500.	.024	26.49	2000.	.024	23.41	2.276	49.90
1.0	.015	1.70	1.0	2500.	.024	26.49	2500.	.036	29.37	2.439	55.86
1.0	.015	1.70	1.0	2500.	.024	26.49	3000.	.048	35.10	2.580	61.59
1.0	.015	1.70	1.0	3000.	.037	31.79	2000.	.024	23.41	2.404	55.19
1.0	.015	1.70	1.0	3000.	.037	31.79	2500.	.036	29.37	2.567	61.15
1.0	.015	1.70	1.0	3000.	.037	31.79	3000.	.048	35.10	2.708	66.89
1.0	.015	1.70	1.5	1319.	.000	8.46	2000.	.024	28.09	2.164	36.55
1.0	.015	1.70	1.5	1319.	.000	8.46	2500.	.036	35.24	2.360	43.70
1.0	.015	1.70	1.5	1319.	.000	8.46	3000.	.048	42.12	2.529	50.58
1.0	.015	1.70	1.5	2500.	.025	18.17	2000.	.024	28.09	2.400	46.26
1.0	.015	1.70	1.5	2500.	.025	18.17	2500.	.036	35.24	2.596	53.42
1.0	.015	1.70	1.5	2500.	.025	18.17	3000.	.048	42.12	2.764	60.30
1.0	.015	1.70	1.5	3000.	.038	21.93	2000.	.024	28.09	2.507	50.02
1.0	.015	1.70	1.5	3000.	.038	21.93	2500.	.036	35.24	2.703	57.17
1.0	.015	1.70	1.5	3000.	.038	21.93	3000.	.048	42.12	2.872	64.05
1.0	.015	1.70	2.0	1275.	.000	4.86	2000.	.024	31.21	2.506	36.07
1.0	.015	1.70	2.0	1275.	.000	4.86	2500.	.036	39.16	2.723	44.02
1.0	.015	1.70	2.0	1275.	.000	4.86	3000.	.048	46.80	2.911	51.66
1.0	.015	1.70	2.0	2500.	.026	12.10	2000.	.024	31.21	2.608	43.31
1.0	.015	1.70	2.0	2500.	.026	12.10	2500.	.036	39.16	2.825	51.26
1.0	.015	1.70	2.0	2500.	.026	12.10	3000.	.048	46.80	3.013	58.90
1.0	.015	1.70	2.0	3000.	.038	14.74	2000.	.024	31.21	2.702	45.95
1.0	.015	1.70	2.0	3000.	.038	14.74	2500.	.036	39.16	2.920	53.90
1.0	.015	1.70	2.0	3000.	.038	14.74	3000.	.048	46.80	3.107	61.54
2.0	.011	1.30	1.0	1405.	.000	6.87	2000.	.020	18.44	2.374	25.31
2.0	.011	1.30	1.0	1405.	.000	6.87	2500.	.032	26.64	2.450	33.51
2.0	.011	1.30	1.0	1405.	.000	6.87	3000.	.044	34.61	2.524	41.48
2.0	.011	1.30	1.0	2500.	.023	24.48	2000.	.020	18.44	2.233	42.92
2.0	.011	1.30	1.0	2500.	.023	24.48	2500.	.032	26.64	2.309	51.12
2.0	.011	1.30	1.0	2500.	.023	24.48	3000.	.044	34.61	2.383	59.09
2.0	.011	1.30	1.0	3000.	.035	32.11	2000.	.020	18.44	2.283	50.55
2.0	.011	1.30	1.0	3000.	.035	32.11	2500.	.032	26.64	2.360	58.75
2.0	.011	1.30	1.0	3000.	.035	32.11	3000.	.044	34.61	2.433	66.72
2.0	.011	1.30	1.5	1384.	.000	4.90	2000.	.020	22.13	2.433	27.02
2.0	.011	1.30	1.5	1384.	.000	4.90	2500.	.032	31.97	2.524	36.87
2.0	.011	1.30	1.5	1384.	.000	4.90	3000.	.044	41.53	2.612	46.43
2.0	.011	1.30	1.5	2500.	.024	19.09	2000.	.020	22.13	2.222	41.22
2.0	.011	1.30	1.5	2500.	.024	19.09	2500.	.032	31.97	2.314	51.06
2.0	.011	1.30	1.5	2500.	.024	19.09	3000.	.044	41.53	2.402	60.62
2.0	.011	1.30	1.5	3000.	.036	25.12	2000.	.020	22.13	2.258	47.25
2.0	.011	1.30	1.5	3000.	.036	25.12	2500.	.032	31.97	2.350	57.09
2.0	.011	1.30	1.5	3000.	.036	25.12	3000.	.044	41.53	2.438	66.65
2.0	.011	1.30	2.0	1364.	.000	3.56	2000.	.020	24.58	2.510	28.14
2.0	.011	1.30	2.0	1364.	.000	3.56	2500.	.032	35.52	2.612	39.08
2.0	.011	1.30	2.0	1364.	.000	3.56	3000.	.044	46.14	2.710	49.70
2.0	.011	1.30	2.0	2500.	.024	15.46	2000.	.020	24.58	2.219	40.05
2.0	.011	1.30	2.0	2500.	.024	15.46	2500.	.032	35.52	2.321	50.98
2.0	.011	1.30	2.0	2500.	.024	15.46	3000.	.044	46.14	2.419	61.61
2.0	.011	1.30	2.0	3000.	.036	20.42	2000.	.020	24.58	2.244	45.00
2.0	.011	1.30	2.0	3000.	.036	20.42	2500.	.032	35.52	2.346	55.94
2.0	.011	1.30	2.0	3000.	.036	20.42	3000.	.044	46.14	2.444	66.56

2.0	.011	1.50	1.0	1381.	.000	6.00	2000.	.020	18.96	2.526	24.96
2.0	.011	1.50	1.0	1381.	.000	6.00	2500.	.031	27.26	2.611	33.26
2.0	.011	1.50	1.0	1381.	.000	6.00	3000.	.044	35.32	2.688	41.32
2.0	.011	1.50	1.0	2500.	.024	23.77	2000.	.020	18.96	2.240	42.72
2.0	.011	1.50	1.0	2500.	.024	23.77	2500.	.031	27.26	2.325	51.02
2.0	.011	1.50	1.0	2500.	.024	23.77	3000.	.044	35.32	2.402	59.09
2.0	.011	1.50	1.0	3000.	.036	31.28	2000.	.020	18.96	2.283	50.24
2.0	.011	1.50	1.0	3000.	.036	31.28	2500.	.031	27.26	2.368	58.54
2.0	.011	1.50	1.0	3000.	.036	31.28	3000.	.044	35.32	2.446	66.61
2.0	.011	1.50	1.5	1348.	.000	3.80	2000.	.020	22.75	2.734	26.55
2.0	.011	1.50	1.5	1348.	.000	3.80	2500.	.031	32.71	2.836	36.51
2.0	.011	1.50	1.5	1348.	.000	3.80	3000.	.044	42.39	2.929	46.18
2.0	.011	1.50	1.5	2500.	.024	18.13	2000.	.020	22.75	2.242	40.88
2.0	.011	1.50	1.5	2500.	.024	18.13	2500.	.031	32.71	2.344	50.84
2.0	.011	1.50	1.5	2500.	.024	18.13	3000.	.044	42.39	2.437	60.52
2.0	.011	1.50	1.5	3000.	.037	24.01	2000.	.020	22.75	2.267	46.76
2.0	.011	1.50	1.5	3000.	.037	24.01	2500.	.031	32.71	2.370	56.72
2.0	.011	1.50	1.5	3000.	.037	24.01	3000.	.044	42.39	2.462	66.39
2.0	.011	1.50	2.0	1315.	.000	2.27	2000.	.020	25.28	3.120	27.55
2.0	.011	1.50	2.0	1315.	.000	2.27	2500.	.031	36.34	3.234	38.61
2.0	.011	1.50	2.0	1315.	.000	2.27	3000.	.044	47.10	3.337	49.36
2.0	.011	1.50	2.0	2500.	.025	14.26	2000.	.020	25.28	2.257	39.54
2.0	.011	1.50	2.0	2500.	.025	14.26	2500.	.031	36.34	2.371	50.60
2.0	.011	1.50	2.0	2500.	.025	14.26	3000.	.044	47.10	2.474	61.35
2.0	.011	1.50	2.0	3000.	.037	19.02	2000.	.020	25.28	2.268	44.30
2.0	.011	1.50	2.0	3000.	.037	19.02	2500.	.031	36.34	2.382	55.36
2.0	.011	1.50	2.0	3000.	.037	19.02	3000.	.044	47.10	2.485	66.11
2.0	.011	1.70	1.0	1359.	.000	5.18	2000.	.020	19.38	2.739	24.56
2.0	.011	1.70	1.0	1359.	.000	5.18	2500.	.031	27.76	2.831	32.93
2.0	.011	1.70	1.0	1359.	.000	5.18	3000.	.043	35.90	2.912	41.07
2.0	.011	1.70	1.0	2500.	.024	23.05	2000.	.020	19.38	2.258	42.43
2.0	.011	1.70	1.0	2500.	.024	23.05	2500.	.031	27.76	2.350	50.81
2.0	.011	1.70	1.0	2500.	.024	23.05	3000.	.043	35.90	2.431	58.95
2.0	.011	1.70	1.0	3000.	.036	30.45	2000.	.020	19.38	2.294	49.83
2.0	.011	1.70	1.0	3000.	.036	30.45	2500.	.031	27.76	2.386	58.21
2.0	.011	1.70	1.0	3000.	.036	30.45	3000.	.043	35.90	2.467	66.35
2.0	.011	1.70	1.5	1315.	.000	2.72	2000.	.020	23.25	3.317	25.98
2.0	.011	1.70	1.5	1315.	.000	2.72	2500.	.031	33.31	3.428	36.03
2.0	.011	1.70	1.5	1315.	.000	2.72	3000.	.043	43.08	3.525	45.80
2.0	.011	1.70	1.5	2500.	.025	17.11	2000.	.020	23.25	2.282	40.37
2.0	.011	1.70	1.5	2500.	.025	17.11	2500.	.031	33.31	2.393	50.42
2.0	.011	1.70	1.5	2500.	.025	17.11	3000.	.043	43.08	2.490	60.19
2.0	.011	1.70	1.5	3000.	.037	22.82	2000.	.020	23.25	2.296	46.08
2.0	.011	1.70	1.5	3000.	.037	22.82	2500.	.031	33.31	2.406	56.13
2.0	.011	1.70	1.5	3000.	.037	22.82	3000.	.043	43.08	2.503	65.90
2.0	.011	1.70	2.0	1271.	.000	.96	2000.	.020	25.84	5.575	26.80
2.0	.011	1.70	2.0	1271.	.000	.96	2500.	.031	37.01	5.698	37.97
2.0	.011	1.70	2.0	1271.	.000	.96	3000.	.043	47.87	5.806	48.83
2.0	.011	1.70	2.0	2500.	.026	12.91	2000.	.020	25.84	2.335	38.75
2.0	.011	1.70	2.0	2500.	.026	12.91	2500.	.031	37.01	2.458	49.92
2.0	.011	1.70	2.0	2500.	.026	12.91	3000.	.043	47.87	2.566	60.78
2.0	.011	1.70	2.0	3000.	.038	17.46	2000.	.020	25.84	2.326	43.30
2.0	.011	1.70	2.0	3000.	.038	17.46	2500.	.031	37.01	2.449	54.47
2.0	.011	1.70	2.0	3000.	.038	17.46	3000.	.043	47.87	2.557	65.32

3.0	.002	1.30	1.0	1393.	.000	-6.94	2000.	.013	5.64	1.680	-1.30
3.0	.002	1.30	1.0	1393.	.000	-6.94	2500.	.024	14.55	1.135	7.61
3.0	.002	1.30	1.0	1393.	.000	-6.94	3000.	.036	23.24	1.054	16.30
3.0	.002	1.30	1.0	2500.	.023	12.44	2000.	.013	5.64	3.826	18.08
3.0	.002	1.30	1.0	2500.	.023	12.44	2500.	.024	14.55	3.281	26.99
3.0	.002	1.30	1.0	2500.	.023	12.44	3000.	.036	23.24	3.200	35.68
3.0	.002	1.30	1.0	3000.	.035	20.80	2000.	.013	5.64	3.612	26.44
3.0	.002	1.30	1.0	3000.	.035	20.80	2500.	.024	14.55	3.066	35.35
3.0	.002	1.30	1.0	3000.	.035	20.80	3000.	.036	23.24	2.985	44.04
3.0	.002	1.30	1.5	1372.	.000	-5.99	2000.	.013	6.77	2.164	.78
3.0	.002	1.30	1.5	1372.	.000	-5.99	2500.	.024	17.46	1.510	11.47
3.0	.002	1.30	1.5	1372.	.000	-5.99	3000.	.036	27.89	1.413	21.90
3.0	.002	1.30	1.5	2500.	.023	9.77	2000.	.013	6.77	3.914	16.53
3.0	.002	1.30	1.5	2500.	.023	9.77	2500.	.024	17.46	3.260	27.22
3.0	.002	1.30	1.5	2500.	.023	9.77	3000.	.036	27.89	3.162	37.65
3.0	.002	1.30	1.5	3000.	.035	16.43	2000.	.013	6.77	3.722	23.19
3.0	.002	1.30	1.5	3000.	.035	16.43	2500.	.024	17.46	3.068	33.88
3.0	.002	1.30	1.5	3000.	.035	16.43	3000.	.036	27.89	2.971	44.31
3.0	.002	1.30	2.0	1351.	.000	-5.37	2000.	.013	7.52	2.485	2.15
3.0	.002	1.30	2.0	1351.	.000	-5.37	2500.	.024	19.40	1.758	14.03
3.0	.002	1.30	2.0	1351.	.000	-5.37	3000.	.036	30.99	1.650	25.62
3.0	.002	1.30	2.0	2500.	.024	7.96	2000.	.013	7.52	3.978	15.48
3.0	.002	1.30	2.0	2500.	.024	7.96	2500.	.024	19.40	3.250	27.36
3.0	.002	1.30	2.0	2500.	.024	7.96	3000.	.036	30.99	3.142	38.95
3.0	.002	1.30	2.0	3000.	.036	13.49	2000.	.013	7.52	3.799	21.01
3.0	.002	1.30	2.0	3000.	.036	13.49	2500.	.024	19.40	3.071	32.89
3.0	.002	1.30	2.0	3000.	.036	13.49	3000.	.036	30.99	2.963	44.47
3.0	.002	1.50	1.0	1369.	.000	-7.57	2000.	.012	5.70	1.615	-1.88
3.0	.002	1.50	1.0	1369.	.000	-7.57	2500.	.023	14.62	1.126	7.04
3.0	.002	1.50	1.0	1369.	.000	-7.57	3000.	.035	23.32	1.057	15.74
3.0	.002	1.50	1.0	2500.	.023	12.17	2000.	.012	5.70	3.810	17.87
3.0	.002	1.50	1.0	2500.	.023	12.17	2500.	.023	14.62	3.321	26.78
3.0	.002	1.50	1.0	2500.	.023	12.17	3000.	.035	23.32	3.252	35.48
3.0	.002	1.50	1.0	3000.	.035	20.49	2000.	.012	5.70	3.566	26.19
3.0	.002	1.50	1.0	3000.	.035	20.49	2500.	.023	14.62	3.077	35.10
3.0	.002	1.50	1.0	3000.	.035	20.49	3000.	.035	23.32	3.008	43.81
3.0	.002	1.50	1.5	1335.	.000	-6.78	2000.	.012	6.84	2.081	.06
3.0	.002	1.50	1.5	1335.	.000	-6.78	2500.	.023	17.54	1.494	10.76
3.0	.002	1.50	1.5	1335.	.000	-6.78	3000.	.035	27.98	1.412	21.20
3.0	.002	1.50	1.5	2500.	.024	9.39	2000.	.012	6.84	3.907	16.23
3.0	.002	1.50	1.5	2500.	.024	9.39	2500.	.023	17.54	3.320	26.93
3.0	.002	1.50	1.5	2500.	.024	9.39	3000.	.035	27.98	3.238	37.37
3.0	.002	1.50	1.5	3000.	.036	15.99	2000.	.012	6.84	3.674	22.83
3.0	.002	1.50	1.5	3000.	.036	15.99	2500.	.023	17.54	3.087	33.53
3.0	.002	1.50	1.5	3000.	.036	15.99	3000.	.035	27.98	3.005	43.97
3.0	.002	1.50	2.0	1302.	.000	-6.27	2000.	.012	7.60	2.389	1.33
3.0	.002	1.50	2.0	1302.	.000	-6.27	2500.	.023	19.49	1.737	13.21
3.0	.002	1.50	2.0	1302.	.000	-6.27	3000.	.035	31.09	1.645	24.82
3.0	.002	1.50	2.0	2500.	.024	7.49	2000.	.012	7.60	3.988	15.09
3.0	.002	1.50	2.0	2500.	.024	7.49	2500.	.023	19.49	3.336	26.98
3.0	.002	1.50	2.0	2500.	.024	7.49	3000.	.035	31.09	3.244	38.58
3.0	.002	1.50	2.0	3000.	.037	12.94	2000.	.012	7.60	3.754	20.54
3.0	.002	1.50	2.0	3000.	.037	12.94	2500.	.023	19.49	3.102	32.43
3.0	.002	1.50	2.0	3000.	.037	12.94	3000.	.035	31.09	3.010	44.03

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.002	1.70	1.0	1346.	.000	-8.17	2000.	.012	5.75	1.556	-2.42
3.0	.002	1.70	1.0	1346.	.000	-8.17	2500.	.023	14.67	1.116	6.50
3.0	.002	1.70	1.0	1346.	.000	-8.17	3000.	.035	23.38	1.058	15.21
3.0	.002	1.70	1.0	2500.	.024	11.89	2000.	.012	5.75	3.807	17.64
3.0	.002	1.70	1.0	2500.	.024	11.89	2500.	.023	14.67	3.366	26.56
3.0	.002	1.70	1.0	2500.	.024	11.89	3000.	.035	23.38	3.308	35.27
3.0	.002	1.70	1.0	3000.	.036	20.17	2000.	.012	5.75	3.532	25.91
3.0	.002	1.70	1.0	3000.	.036	20.17	2500.	.023	14.67	3.091	34.84
3.0	.002	1.70	1.0	3000.	.036	20.17	3000.	.035	23.38	3.034	43.55
3.0	.0C2	1.70	1.5	1302.	.000	-7.53	2000.	.012	6.90	2.006	-.63
3.0	.002	1.70	1.5	1302.	.000	-7.53	2500.	.023	17.60	1.478	10.08
3.0	.002	1.70	1.5	1302.	.000	-7.53	3000.	.035	28.05	1.408	20.53
3.0	.002	1.70	1.5	2500.	.024	8.99	2000.	.012	6.90	3.925	15.88
3.0	.002	1.70	1.5	2500.	.024	8.99	2500.	.023	17.60	3.396	26.59
3.0	.002	1.70	1.5	2500.	.024	8.99	3000.	.035	28.05	3.327	37.04
3.0	.002	1.70	1.5	3000.	.037	15.53	2000.	.012	6.90	3.644	22.42
3.0	.002	1.70	1.5	3000.	.037	15.53	2500.	.023	17.60	3.116	33.13
3.0	.002	1.70	1.5	3000.	.037	15.53	3000.	.035	28.05	3.046	43.58
3.0	.002	1.70	2.0	1257.	.000	-7.16	2000.	.012	7.66	2.302	.50
3.0	.002	1.70	2.0	1257.	.000	-7.16	2500.	.023	19.56	1.715	12.40
3.0	.002	1.70	2.0	1257.	.000	-7.16	3000.	.035	31.17	1.637	24.01
3.0	.002	1.70	2.0	2500.	.025	6.94	2000.	.012	7.66	4.043	14.61
3.0	.002	1.70	2.0	2500.	.025	6.94	2500.	.023	19.56	3.456	26.50
3.0	.002	1.70	2.0	2500.	.025	6.94	3000.	.035	31.17	3.379	38.12
3.0	.002	1.70	2.0	3000.	.037	12.31	2000.	.012	7.66	3.737	19.97
3.0	.002	1.70	2.0	3000.	.037	12.31	2500.	.023	19.56	3.150	31.87
3.0	.002	1.70	2.0	3000.	.037	12.31	3000.	.035	31.17	3.073	43.48

1.0	.016	1.30	1.0	1406.	.000	18.06	2000.	.026	19.39	1.995	37.45
1.0	.016	1.30	1.0	1406.	.000	18.06	2500.	.037	24.46	2.173	42.52
1.0	.016	1.30	1.0	1406.	.000	18.06	3000.	.050	29.31	2.330	47.37
1.0	.016	1.30	1.0	2500.	.023	32.44	2000.	.026	19.39	2.286	51.83
1.0	.016	1.30	1.0	2500.	.023	32.44	2500.	.037	24.46	2.463	56.90
1.0	.016	1.30	1.0	2500.	.023	32.44	3000.	.050	29.31	2.621	61.75
1.0	.016	1.30	1.0	3000.	.036	38.59	2000.	.026	19.39	2.399	57.98
1.0	.016	1.30	1.0	3000.	.036	38.59	2500.	.037	24.46	2.577	63.05
1.0	.016	1.30	1.0	3000.	.036	38.59	3000.	.050	29.31	2.734	67.90
1.0	.016	1.30	1.5	1385.	.000	13.57	2000.	.026	23.26	2.116	36.83
1.0	.016	1.30	1.5	1385.	.000	13.57	2500.	.037	29.35	2.329	42.92
1.0	.016	1.30	1.5	1385.	.000	13.57	3000.	.050	35.17	2.518	48.74
1.0	.016	1.30	1.5	2500.	.024	24.95	2000.	.026	23.26	2.351	48.21
1.0	.016	1.30	1.5	2500.	.024	24.95	2500.	.037	29.35	2.564	54.30
1.0	.016	1.30	1.5	2500.	.024	24.95	3000.	.050	35.17	2.753	60.12
1.0	.016	1.30	1.5	3000.	.036	29.71	2000.	.026	23.26	2.443	52.98
1.0	.016	1.30	1.5	3000.	.036	29.71	2500.	.037	29.35	2.657	59.06
1.0	.016	1.30	1.5	3000.	.036	29.71	3000.	.050	35.17	2.845	64.88
1.0	.016	1.30	2.0	1364.	.000	10.54	2000.	.026	25.85	2.203	36.39
1.0	.016	1.30	2.0	1364.	.000	10.54	2500.	.037	32.61	2.440	43.15
1.0	.016	1.30	2.0	1364.	.000	10.54	3000.	.050	39.08	2.650	49.62
1.0	.016	1.30	2.0	2500.	.024	19.88	2000.	.026	25.85	2.401	45.73
1.0	.016	1.30	2.0	2500.	.024	19.88	2500.	.037	32.61	2.638	52.49
1.0	.016	1.30	2.0	2500.	.024	19.88	3000.	.050	39.08	2.848	58.96
1.0	.016	1.30	2.0	3000.	.036	23.70	2000.	.026	25.85	2.479	49.55
1.0	.016	1.30	2.0	3000.	.036	23.70	2500.	.037	32.61	2.716	56.32
1.0	.016	1.30	2.0	3000.	.036	23.70	3000.	.050	39.08	2.926	62.78
1.0	.016	1.50	1.0	1382.	.000	16.79	2000.	.025	22.40	1.878	39.19
1.0	.016	1.50	1.0	1382.	.000	16.79	2500.	.037	28.06	2.043	44.85
1.0	.016	1.50	1.0	1382.	.000	16.79	3000.	.049	33.48	2.188	50.27
1.0	.016	1.50	1.0	2500.	.024	30.98	2000.	.025	22.40	2.173	53.39
1.0	.016	1.50	1.0	2500.	.024	30.98	2500.	.037	28.06	2.338	59.04
1.0	.016	1.50	1.0	2500.	.024	30.98	3000.	.049	33.48	2.483	64.47
1.0	.016	1.50	1.0	3000.	.036	36.90	2000.	.025	22.40	2.288	59.31
1.0	.016	1.50	1.0	3000.	.036	36.90	2500.	.037	28.06	2.454	64.96
1.0	.016	1.50	1.0	3000.	.036	36.90	3000.	.049	33.48	2.598	70.39
1.0	.016	1.50	1.5	1349.	.000	11.94	2000.	.025	26.89	1.995	38.82
1.0	.016	1.50	1.5	1349.	.000	11.94	2500.	.037	33.67	2.194	45.30
1.0	.016	1.50	1.5	1349.	.000	11.94	3000.	.049	40.18	2.367	52.12
1.0	.016	1.50	1.5	2500.	.024	22.99	2000.	.025	26.89	2.233	49.88
1.0	.016	1.50	1.5	2500.	.024	22.99	2500.	.037	33.67	2.432	56.66
1.0	.016	1.50	1.5	2500.	.024	22.99	3000.	.049	40.18	2.605	63.17
1.0	.016	1.50	1.5	3000.	.037	27.44	2000.	.025	26.89	2.329	54.33
1.0	.016	1.50	1.5	3000.	.037	27.44	2500.	.037	33.67	2.527	61.11
1.0	.016	1.50	1.5	3000.	.037	27.44	3000.	.049	40.18	2.701	67.62
1.0	.016	1.50	2.0	1316.	.000	8.59	2000.	.025	29.87	2.104	38.46
1.0	.016	1.50	2.0	1316.	.000	8.59	2500.	.037	37.41	2.325	46.00
1.0	.016	1.50	2.0	1316.	.000	8.59	3000.	.049	44.64	2.517	53.23
1.0	.016	1.50	2.0	2500.	.025	17.44	2000.	.025	29.87	2.298	47.31
1.0	.016	1.50	2.0	2500.	.025	17.44	2500.	.037	37.41	2.519	54.85
1.0	.016	1.50	2.0	2500.	.025	17.44	3000.	.049	44.64	2.712	62.08
1.0	.016	1.50	2.0	3000.	.037	20.87	2000.	.025	29.87	2.381	50.74
1.0	.016	1.50	2.0	3000.	.037	20.87	2500.	.037	37.41	2.602	58.28
1.0	.016	1.50	2.0	3000.	.037	20.87	3000.	.049	44.64	2.794	65.51

1.0	.016	1.70	1.0	1360.	.000	15.56	2000.	.025	24.72	1.856	40.28
1.0	.016	1.70	1.0	1360.	.000	15.56	2500.	.036	30.81	1.994	46.38
1.0	.016	1.70	1.0	1360.	.000	15.56	3000.	.049	36.68	2.130	52.24
1.0	.016	1.70	1.0	2500.	.024	29.52	2000.	.025	24.72	2.133	54.24
1.0	.016	1.70	1.0	2500.	.024	29.52	2500.	.036	30.81	2.291	60.34
1.0	.016	1.70	1.0	2500.	.024	29.52	3000.	.049	36.68	2.427	66.21
1.0	.016	1.70	1.0	3000.	.037	35.21	2000.	.025	24.72	2.251	59.93
1.0	.016	1.70	1.0	3000.	.037	35.21	2500.	.036	30.81	2.409	66.03
1.0	.016	1.70	1.0	3000.	.037	35.21	3000.	.049	36.68	2.545	71.89
1.0	.016	1.70	1.5	1316.	.000	10.31	2000.	.025	29.66	1.986	39.97
1.0	.016	1.70	1.5	1316.	.000	10.31	2500.	.036	36.98	2.175	47.29
1.0	.016	1.70	1.5	1316.	.000	10.31	3000.	.049	44.02	2.339	54.33
1.0	.016	1.70	1.5	2500.	.025	20.93	2000.	.025	29.66	2.220	50.59
1.0	.016	1.70	1.5	2500.	.025	20.93	2500.	.036	36.98	2.409	57.90
1.0	.016	1.70	1.5	2500.	.025	20.93	3000.	.049	44.02	2.572	64.94
1.0	.016	1.70	1.5	3000.	.037	25.05	2000.	.025	29.66	2.319	54.71
1.0	.016	1.70	1.5	3000.	.037	25.05	2500.	.036	36.98	2.507	62.03
1.0	.016	1.70	1.5	3000.	.037	25.05	3000.	.049	44.02	2.671	69.06
1.0	.016	1.70	2.0	1272.	.000	6.57	2000.	.025	32.96	2.187	39.53
1.0	.016	1.70	2.0	1272.	.000	6.57	2500.	.036	41.09	2.397	47.66
1.0	.016	1.70	2.0	1272.	.000	6.57	3000.	.049	48.91	2.578	55.48
1.0	.016	1.70	2.0	2500.	.026	14.71	2000.	.025	32.96	2.350	47.67
1.0	.016	1.70	2.0	2500.	.026	14.71	2500.	.036	41.09	2.560	55.80
1.0	.016	1.70	2.0	2500.	.026	14.71	3000.	.049	48.91	2.742	63.62
1.0	.016	1.70	2.0	3000.	.038	17.71	2000.	.025	32.96	2.438	50.67
1.0	.016	1.70	2.0	3000.	.038	17.71	2500.	.036	41.09	2.647	58.80
1.0	.016	1.70	2.0	3000.	.038	17.71	3000.	.049	48.91	2.829	66.62
2.0	.012	1.30	1.0	1405.	.000	8.61	2000.	.021	19.84	2.184	28.45
2.0	.012	1.30	1.0	1405.	.000	8.61	2500.	.033	28.08	2.264	36.69
2.0	.012	1.30	1.0	1405.	.000	8.61	3000.	.045	36.08	2.338	44.69
2.0	.012	1.30	1.0	2500.	.023	26.51	2000.	.021	19.84	2.151	46.36
2.0	.012	1.30	1.0	2500.	.023	26.51	2500.	.033	28.08	2.231	54.60
2.0	.012	1.30	1.0	2500.	.023	26.51	3000.	.045	36.08	2.305	62.60
2.0	.012	1.30	1.0	3000.	.035	34.28	2000.	.021	19.84	2.207	54.12
2.0	.012	1.30	1.0	3000.	.035	34.28	2500.	.033	28.08	2.286	62.36
2.0	.012	1.30	1.0	3000.	.035	34.28	3000.	.045	36.08	2.361	70.36
2.0	.012	1.30	1.5	1384.	.000	6.31	2000.	.021	23.81	2.224	30.12
2.0	.012	1.30	1.5	1384.	.000	6.31	2500.	.033	33.70	2.320	40.01
2.0	.012	1.30	1.5	1384.	.000	6.31	3000.	.045	43.30	2.409	49.61
2.0	.012	1.30	1.5	2500.	.024	20.77	2000.	.021	23.81	2.141	44.58
2.0	.012	1.30	1.5	2500.	.024	20.77	2500.	.033	33.70	2.237	54.47
2.0	.012	1.30	1.5	2500.	.024	20.77	3000.	.045	43.30	2.326	64.07
2.0	.012	1.30	1.5	3000.	.036	26.91	2000.	.021	23.81	2.182	50.72
2.0	.012	1.30	1.5	3000.	.036	26.91	2500.	.033	33.70	2.278	60.61
2.0	.012	1.30	1.5	3000.	.036	26.91	3000.	.045	43.30	2.367	70.21
2.0	.012	1.30	2.0	1363.	.000	4.76	2000.	.021	26.46	2.270	31.22
2.0	.012	1.30	2.0	1363.	.000	4.76	2500.	.033	37.44	2.376	42.21
2.0	.012	1.30	2.0	1363.	.000	4.76	3000.	.045	48.11	2.475	52.87
2.0	.012	1.30	2.0	2500.	.024	16.90	2000.	.021	26.46	2.138	43.36
2.0	.012	1.30	2.0	2500.	.024	16.90	2500.	.033	37.44	2.244	54.35
2.0	.012	1.30	2.0	2500.	.024	16.90	3000.	.045	48.11	2.343	65.01
2.0	.012	1.30	2.0	3000.	.036	21.96	2000.	.021	26.46	2.168	48.41
2.0	.012	1.30	2.0	3000.	.036	21.96	2500.	.033	37.44	2.274	59.40
2.0	.012	1.30	2.0	3000.	.036	21.96	3000.	.045	48.11	2.374	70.07

2.0	.012	1.50	1.0	1381.	.000	7.78	2000.	.021	20.40	2.268	28.17
2.0	.012	1.50	1.0	1381.	.000	7.78	2500.	.032	28.74	2.355	36.52
2.0	.012	1.50	1.0	1381.	.000	7.78	3000.	.045	36.84	2.433	44.62
2.0	.012	1.50	1.0	2500.	.024	25.87	2000.	.021	20.40	2.151	46.27
2.0	.012	1.50	1.0	2500.	.024	25.87	2500.	.032	28.74	2.238	54.61
2.0	.012	1.50	1.0	2500.	.024	25.87	3000.	.045	36.84	2.317	62.71
2.0	.012	1.50	1.0	3000.	.036	33.53	2000.	.021	20.40	2.202	53.93
2.0	.012	1.50	1.0	3000.	.036	33.53	2500.	.032	28.74	2.289	62.27
2.0	.012	1.50	1.0	3000.	.036	33.53	3000.	.045	36.84	2.367	70.37
2.0	.012	1.50	1.5	1348.	.000	5.26	2000.	.021	24.47	2.381	29.74
2.0	.012	1.50	1.5	1348.	.000	5.26	2500.	.032	34.49	2.485	39.75
2.0	.012	1.50	1.5	1348.	.000	5.26	3000.	.045	44.21	2.579	49.47
2.0	.012	1.50	1.5	2500.	.024	19.90	2000.	.021	24.47	2.150	44.37
2.0	.012	1.50	1.5	2500.	.024	19.90	2500.	.032	34.49	2.254	54.39
2.0	.012	1.50	1.5	2500.	.024	19.90	3000.	.045	44.21	2.348	64.11
2.0	.012	1.50	1.5	3000.	.037	25.90	2000.	.021	24.47	2.183	50.38
2.0	.012	1.50	1.5	3000.	.037	25.90	2500.	.032	34.49	2.288	60.39
2.0	.012	1.50	1.5	3000.	.037	25.90	3000.	.045	44.21	2.382	70.11
2.0	.012	1.50	2.0	1315.	.000	3.53	2000.	.021	27.19	2.548	30.73
2.0	.012	1.50	2.0	1315.	.000	3.53	2500.	.032	38.32	2.664	41.85
2.0	.012	1.50	2.0	1315.	.000	3.53	3000.	.045	49.12	2.769	52.66
2.0	.012	1.50	2.0	2500.	.025	15.81	2000.	.021	27.19	2.159	43.01
2.0	.012	1.50	2.0	2500.	.025	15.81	2500.	.032	38.32	2.275	54.13
2.0	.012	1.50	2.0	2500.	.025	15.81	3000.	.045	49.12	2.379	64.94
2.0	.012	1.50	2.0	3000.	.037	20.69	2000.	.021	27.19	2.180	47.89
2.0	.012	1.50	2.0	3000.	.037	20.69	2500.	.032	38.32	2.296	59.01
2.0	.012	1.50	2.0	3000.	.037	20.69	3000.	.045	49.12	2.400	69.82
2.0	.012	1.70	1.0	1359.	.000	6.99	2000.	.021	20.84	2.383	27.83
2.0	.012	1.70	1.0	1359.	.000	6.99	2500.	.032	29.26	2.476	36.25
2.0	.012	1.70	1.0	1359.	.000	6.99	3000.	.044	37.45	2.557	44.44
2.0	.012	1.70	1.0	2500.	.024	25.22	2000.	.021	20.84	2.161	46.06
2.0	.012	1.70	1.0	2500.	.024	25.22	2500.	.032	29.26	2.254	54.49
2.0	.012	1.70	1.0	2500.	.024	25.22	3000.	.044	37.45	2.335	62.67
2.0	.012	1.70	1.0	3000.	.036	32.78	2000.	.021	20.84	2.206	53.62
2.0	.012	1.70	1.0	3000.	.036	32.78	2500.	.032	29.26	2.299	62.05
2.0	.012	1.70	1.0	3000.	.036	32.78	3000.	.044	37.45	2.380	70.23
2.0	.012	1.70	1.5	1315.	.000	4.24	2000.	.021	25.01	2.643	29.25
2.0	.012	1.70	1.5	1315.	.000	4.24	2500.	.032	35.12	2.754	39.36
2.0	.012	1.70	1.5	1315.	.000	4.24	3000.	.044	44.94	2.851	49.18
2.0	.012	1.70	1.5	2500.	.025	18.98	2000.	.021	25.01	2.176	43.98
2.0	.012	1.70	1.5	2500.	.025	18.98	2500.	.032	35.12	2.287	54.09
2.0	.012	1.70	1.5	2500.	.025	18.98	3000.	.044	44.94	2.384	63.92
2.0	.012	1.70	1.5	3000.	.037	24.83	2000.	.021	25.01	2.201	49.84
2.0	.012	1.70	1.5	3000.	.037	24.83	2500.	.032	35.12	2.312	59.95
2.0	.012	1.70	1.5	3000.	.037	24.83	3000.	.044	44.94	2.410	69.77
2.0	.012	1.70	2.0	1271.	.000	2.30	2000.	.021	27.78	3.207	30.08
2.0	.012	1.70	2.0	1271.	.000	2.30	2500.	.032	39.02	3.330	41.31
2.0	.012	1.70	2.0	1271.	.000	2.30	3000.	.044	49.94	3.439	52.23
2.0	.012	1.70	2.0	2500.	.026	14.59	2000.	.021	27.78	2.211	42.37
2.0	.012	1.70	2.0	2500.	.026	14.59	2500.	.032	39.02	2.334	53.61
2.0	.012	1.70	2.0	2500.	.026	14.59	3000.	.044	49.94	2.442	64.53
2.0	.012	1.70	2.0	3000.	.038	19.28	2000.	.021	27.78	2.219	47.06
2.0	.012	1.70	2.0	3000.	.038	19.28	2500.	.032	39.02	2.342	58.30
2.0	.012	1.70	2.0	3000.	.038	19.28	3000.	.044	49.94	2.450	69.21

3.0	.004	1.30	1.0	1395.	.000	-4.87	2000.	.014	7.66	.900	2.79
3.0	.004	1.30	1.0	1395.	.000	-4.87	2500.	.025	16.61	.602	11.74
3.0	.004	1.30	1.0	1395.	.000	-4.87	3000.	.037	25.34	.559	20.47
3.0	.004	1.30	1.0	2500.	.023	14.63	2000.	.014	7.66	3.323	22.28
3.0	.004	1.30	1.0	2500.	.023	14.63	2500.	.025	16.61	3.025	31.23
3.0	.004	1.30	1.0	2500.	.023	14.63	3000.	.037	25.34	2.982	39.96
3.0	.004	1.30	1.0	3000.	.035	23.05	2000.	.014	7.66	3.187	30.71
3.0	.004	1.30	1.0	3000.	.035	23.05	2500.	.025	16.61	2.889	39.66
3.0	.004	1.30	1.0	3000.	.035	23.05	3000.	.037	25.34	2.846	48.38
3.0	.004	1.30	1.5	1373.	.000	-4.32	2000.	.014	9.19	1.447	4.87
3.0	.004	1.30	1.5	1373.	.000	-4.32	2500.	.025	19.93	1.090	15.61
3.0	.004	1.30	1.5	1373.	.000	-4.32	3000.	.037	30.40	1.038	26.08
3.0	.004	1.30	1.5	2500.	.023	11.53	2000.	.014	9.19	3.365	20.72
3.0	.004	1.30	1.5	2500.	.023	11.53	2500.	.025	19.93	3.008	31.46
3.0	.004	1.30	1.5	2500.	.023	11.53	3000.	.037	30.40	2.956	41.93
3.0	.004	1.30	1.5	3000.	.035	18.24	2000.	.014	9.19	3.243	27.43
3.0	.004	1.30	1.5	3000.	.035	18.24	2500.	.025	19.93	2.886	38.17
3.0	.004	1.30	1.5	3000.	.035	18.24	3000.	.037	30.40	2.834	48.64
3.0	.004	1.30	2.0	1352.	.000	-3.97	2000.	.014	10.21	1.804	6.24
3.0	.004	1.30	2.0	1352.	.000	-3.97	2500.	.025	22.14	1.407	18.17
3.0	.004	1.30	2.0	1352.	.000	-3.97	3000.	.037	33.78	1.349	29.81
3.0	.004	1.30	2.0	2500.	.024	9.45	2000.	.014	10.21	3.396	19.66
3.0	.004	1.30	2.0	2500.	.024	9.45	2500.	.025	22.14	2.999	31.59
3.0	.004	1.30	2.0	2500.	.024	9.45	3000.	.037	33.78	2.941	43.23
3.0	.004	1.30	2.0	3000.	.036	15.01	2000.	.014	10.21	3.282	25.22
3.0	.004	1.30	2.0	3000.	.036	15.01	2500.	.025	22.14	2.885	37.16
3.0	.004	1.30	2.0	3000.	.036	15.01	3000.	.037	33.78	2.827	48.80
3.0	.004	1.50	1.0	1370.	.000	-5.49	2000.	.014	7.72	.920	2.24
3.0	.004	1.50	1.0	1370.	.000	-5.49	2500.	.025	16.68	.657	11.20
3.0	.004	1.50	1.0	1370.	.000	-5.49	3000.	.037	25.42	.623	19.93
3.0	.004	1.50	1.0	2500.	.023	14.38	2000.	.014	7.72	3.315	22.10
3.0	.004	1.50	1.0	2500.	.023	14.38	2500.	.025	16.68	3.052	31.06
3.0	.004	1.50	1.0	2500.	.023	14.38	3000.	.037	25.42	3.019	39.80
3.0	.004	1.50	1.0	3000.	.035	22.76	2000.	.014	7.72	3.159	30.48
3.0	.004	1.50	1.0	3000.	.035	22.76	2500.	.025	16.68	2.897	39.44
3.0	.004	1.50	1.0	3000.	.035	22.76	3000.	.037	25.42	2.863	48.18
3.0	.004	1.50	1.5	1337.	.000	-5.09	2000.	.014	9.27	1.451	4.18
3.0	.004	1.50	1.5	1337.	.000	-5.09	2500.	.025	20.02	1.135	14.93
3.0	.004	1.50	1.5	1337.	.000	-5.09	3000.	.037	30.51	1.095	25.42
3.0	.004	1.50	1.5	2500.	.024	11.18	2000.	.014	9.27	3.364	20.45
3.0	.004	1.50	1.5	2500.	.024	11.18	2500.	.025	20.02	3.049	31.20
3.0	.004	1.50	1.5	2500.	.024	11.18	3000.	.037	30.51	3.008	41.69
3.0	.004	1.50	1.5	3000.	.036	17.84	2000.	.014	9.27	3.214	27.11
3.0	.004	1.50	1.5	3000.	.036	17.84	2500.	.025	20.02	2.899	37.86
3.0	.004	1.50	1.5	3000.	.036	17.84	3000.	.037	30.51	2.859	48.35
3.0	.004	1.50	2.0	1303.	.000	-4.86	2000.	.014	10.30	1.791	5.44
3.0	.004	1.50	2.0	1303.	.000	-4.86	2500.	.025	22.25	1.441	17.39
3.0	.004	1.50	2.0	1303.	.000	-4.86	3000.	.037	33.90	1.396	29.04
3.0	.004	1.50	2.0	2500.	.025	9.01	2000.	.014	10.30	3.406	19.31
3.0	.004	1.50	2.0	2500.	.025	9.01	2500.	.025	22.25	3.056	31.25
3.0	.004	1.50	2.0	2500.	.025	9.01	3000.	.037	33.90	3.011	42.91
3.0	.004	1.50	2.0	3000.	.037	14.51	2000.	.014	10.30	3.257	24.81
3.0	.004	1.50	2.0	3000.	.037	14.51	2500.	.025	22.25	2.907	36.75
3.0	.004	1.50	2.0	3000.	.037	14.51	3000.	.037	33.90	2.862	48.40

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.004	1.70	1.0	1348.	.000	-6.07	2000.	.013	7.78	.926	1.71
3.0	.004	1.70	1.0	1348.	.000	-6.07	2500.	.024	16.74	.694	10.68
3.0	.004	1.70	1.0	1348.	.000	-6.07	3000.	.036	25.49	.669	19.42
3.0	.004	1.70	1.0	2500.	.024	14.12	2000.	.013	7.78	3.315	21.90
3.0	.004	1.70	1.0	2500.	.024	14.12	2500.	.024	16.74	3.083	30.86
3.0	.004	1.70	1.0	2500.	.024	14.12	3000.	.036	25.49	3.058	39.61
3.0	.004	1.70	1.0	3000.	.036	22.46	2000.	.013	7.78	3.139	30.24
3.0	.004	1.70	1.0	3000.	.036	22.46	2500.	.024	16.74	2.907	39.21
3.0	.004	1.70	1.0	3000.	.036	22.46	3000.	.036	25.49	2.882	47.95
3.0	.004	1.70	1.5	1303.	.000	-5.83	2000.	.013	9.33	1.440	3.51
3.0	.004	1.70	1.5	1303.	.000	-5.83	2500.	.024	20.09	1.161	14.27
3.0	.004	1.70	1.5	1303.	.000	-5.83	3000.	.036	30.59	1.131	24.76
3.0	.004	1.70	1.5	2500.	.025	10.81	2000.	.013	9.33	3.378	20.14
3.0	.004	1.70	1.5	2500.	.025	10.81	2500.	.024	20.09	3.099	30.90
3.0	.004	1.70	1.5	2500.	.025	10.81	3000.	.036	30.59	3.069	41.40
3.0	.004	1.70	1.5	3000.	.037	17.41	2000.	.013	9.33	3.199	26.74
3.0	.004	1.70	1.5	3000.	.037	17.41	2500.	.024	20.09	2.920	37.50
3.0	.004	1.70	1.5	3000.	.037	17.41	3000.	.036	30.59	2.890	48.00
3.0	.004	1.70	2.0	1259.	.000	-5.72	2000.	.013	10.37	1.765	4.65
3.0	.004	1.70	2.0	1259.	.000	-5.72	2500.	.024	22.33	1.456	16.60
3.0	.004	1.70	2.0	1259.	.000	-5.72	3000.	.036	33.99	1.422	28.27
3.0	.004	1.70	2.0	2500.	.025	8.51	2000.	.013	10.37	3.444	18.87
3.0	.004	1.70	2.0	2500.	.025	8.51	2500.	.024	22.33	3.135	30.83
3.0	.004	1.70	2.0	2500.	.025	8.51	3000.	.036	33.99	3.101	42.49
3.0	.004	1.70	2.0	3000.	.038	13.93	2000.	.013	10.37	3.252	24.29
3.0	.004	1.70	2.0	3000.	.038	13.93	2500.	.024	22.33	2.942	36.25
3.0	.004	1.70	2.0	3000.	.038	13.93	3000.	.036	33.99	2.909	47.91

1.0	.018	1.30	1.0	1402.	.000	19.83	2000.	.028	20.64	2.031	40.47
1.0	.018	1.30	1.0	1402.	.000	19.83	2500.	.040	25.87	2.216	45.70
1.0	.018	1.30	1.0	1402.	.000	19.83	3000.	.054	30.90	2.380	50.73
1.0	.018	1.30	1.0	2500.	.025	35.06	2000.	.028	20.64	2.314	55.69
1.0	.018	1.30	1.0	2500.	.025	35.06	2500.	.040	25.87	2.499	60.93
1.0	.018	1.30	1.0	2500.	.025	35.06	3000.	.054	30.90	2.663	65.95
1.0	.018	1.30	1.0	3000.	.038	41.61	2000.	.028	20.64	2.426	62.25
1.0	.018	1.30	1.0	3000.	.038	41.61	2500.	.040	25.87	2.611	67.48
1.0	.018	1.30	1.0	3000.	.038	41.61	3000.	.054	30.90	2.775	72.51
1.0	.018	1.30	1.5	1381.	.000	15.05	2000.	.028	24.77	2.149	39.81
1.0	.018	1.30	1.5	1381.	.000	15.05	2500.	.040	31.05	2.370	46.10
1.0	.018	1.30	1.5	1381.	.000	15.05	3000.	.054	37.08	2.567	52.13
1.0	.018	1.30	1.5	2500.	.025	27.16	2000.	.028	24.77	2.378	51.93
1.0	.018	1.30	1.5	2500.	.025	27.16	2500.	.040	31.05	2.600	58.21
1.0	.018	1.30	1.5	2500.	.025	27.16	3000.	.054	37.08	2.796	64.24
1.0	.018	1.30	1.5	3000.	.038	32.26	2000.	.028	24.77	2.469	57.03
1.0	.018	1.30	1.5	3000.	.038	32.26	2500.	.040	31.05	2.690	63.31
1.0	.018	1.30	1.5	3000.	.038	32.26	3000.	.054	37.08	2.887	69.34
1.0	.018	1.30	2.0	1360.	.000	11.83	2000.	.028	27.52	2.233	39.35
1.0	.018	1.30	2.0	1360.	.000	11.83	2500.	.040	34.50	2.479	46.32
1.0	.018	1.30	2.0	1360.	.000	11.83	3000.	.054	41.20	2.697	53.03
1.0	.018	1.30	2.0	2500.	.026	21.83	2000.	.028	27.52	2.426	49.34
1.0	.018	1.30	2.0	2500.	.026	21.83	2500.	.040	34.50	2.672	56.32
1.0	.018	1.30	2.0	2500.	.026	21.83	3000.	.054	41.20	2.890	63.02
1.0	.018	1.30	2.0	3000.	.039	25.95	2000.	.028	27.52	2.502	53.47
1.0	.018	1.30	2.0	3000.	.039	25.95	2500.	.040	34.50	2.718	60.44
1.0	.018	1.30	2.0	3000.	.039	25.95	3000.	.054	41.20	2.967	67.14
1.0	.018	1.50	1.0	1378.	.000	18.65	2000.	.028	23.82	1.902	42.47
1.0	.018	1.50	1.0	1378.	.000	18.65	2500.	.040	29.67	2.072	48.32
1.0	.018	1.50	1.0	1378.	.000	18.65	3000.	.053	35.32	2.222	53.96
1.0	.018	1.50	1.0	2500.	.025	33.77	2000.	.028	23.82	2.189	57.59
1.0	.018	1.50	1.0	2500.	.025	33.77	2500.	.040	29.67	2.359	63.44
1.0	.018	1.50	1.0	2500.	.025	33.77	3000.	.053	35.32	2.508	69.09
1.0	.018	1.50	1.0	3000.	.038	40.12	2000.	.028	23.82	2.302	63.94
1.0	.018	1.50	1.0	3000.	.038	40.12	2500.	.040	29.67	2.473	69.79
1.0	.018	1.50	1.0	3000.	.038	40.12	3000.	.053	35.32	2.622	75.43
1.0	.018	1.50	1.5	1345.	.000	13.54	2000.	.028	28.58	2.008	42.12
1.0	.018	1.50	1.5	1345.	.000	13.54	2500.	.040	35.61	2.213	49.15
1.0	.018	1.50	1.5	1345.	.000	13.54	3000.	.053	42.38	2.392	55.92
1.0	.018	1.50	1.5	2500.	.026	25.43	2000.	.028	28.58	2.241	54.01
1.0	.018	1.50	1.5	2500.	.026	25.43	2500.	.040	35.61	2.445	61.03
1.0	.018	1.50	1.5	2500.	.026	25.43	3000.	.053	42.38	2.625	67.81
1.0	.018	1.50	1.5	3000.	.039	30.25	2000.	.028	28.58	2.334	58.83
1.0	.018	1.50	1.5	3000.	.039	30.25	2500.	.040	35.61	2.538	65.85
1.0	.018	1.50	1.5	3000.	.039	30.25	3000.	.053	42.38	2.718	72.63
1.0	.018	1.50	2.0	1312.	.000	10.03	2000.	.028	31.76	2.100	41.79
1.0	.018	1.50	2.0	1312.	.000	10.03	2500.	.040	39.56	2.327	49.60
1.0	.018	1.50	2.0	1312.	.000	10.03	3000.	.053	47.09	2.526	57.12
1.0	.018	1.50	2.0	2500.	.027	19.66	2000.	.028	31.76	2.293	51.42
1.0	.018	1.50	2.0	2500.	.027	19.66	2500.	.040	39.56	2.520	59.22
1.0	.018	1.50	2.0	2500.	.027	19.66	3000.	.053	47.09	2.720	66.75
1.0	.018	1.50	2.0	3000.	.040	23.43	2000.	.028	31.76	2.373	55.19
1.0	.018	1.50	2.0	3000.	.040	23.43	2500.	.040	39.56	2.600	62.99
1.0	.018	1.50	2.0	3000.	.040	23.43	3000.	.053	47.09	2.800	70.52

1.0	.018	1.70	1.0	1356.	.000	17.52	2000.	.027	26.23	1.847	43.74
1.0	.018	1.70	1.0	1356.	.000	17.52	2500.	.040	32.55	2.008	50.06
1.0	.018	1.70	1.0	1356.	.000	17.52	3000.	.053	38.66	2.149	56.17
1.0	.018	1.70	1.0	2500.	.026	32.48	2000.	.027	26.23	2.137	58.71
1.0	.018	1.70	1.0	2500.	.026	32.48	2500.	.040	32.55	2.298	65.03
1.0	.018	1.70	1.0	2500.	.026	32.48	3000.	.053	38.66	2.439	71.14
1.0	.018	1.70	1.0	3000.	.039	38.62	2000.	.027	26.23	2.253	64.84
1.0	.018	1.70	1.0	3000.	.039	38.62	2500.	.040	32.55	2.414	71.17
1.0	.018	1.70	1.0	3000.	.039	38.62	3000.	.053	38.66	2.554	77.28
1.0	.018	1.70	1.5	1312.	.000	12.04	2000.	.027	31.47	1.971	43.51
1.0	.018	1.70	1.5	1312.	.000	12.04	2500.	.040	39.06	2.164	51.10
1.0	.018	1.70	1.5	1312.	.000	12.04	3000.	.053	46.39	2.333	58.43
1.0	.018	1.70	1.5	2500.	.027	23.59	2000.	.027	31.47	2.203	55.07
1.0	.018	1.70	1.5	2500.	.027	23.59	2500.	.040	39.06	2.396	62.65
1.0	.018	1.70	1.5	2500.	.027	23.59	3000.	.053	46.39	2.565	69.98
1.0	.018	1.70	1.5	3000.	.040	28.12	2000.	.027	31.47	2.299	59.59
1.0	.018	1.70	1.5	3000.	.040	28.12	2500.	.040	39.06	2.492	67.18
1.0	.018	1.70	1.5	3000.	.040	28.12	3000.	.053	46.39	2.661	74.51
1.0	.018	1.70	2.0	1267.	.000	8.18	2000.	.027	34.97	2.114	43.15
1.0	.018	1.70	2.0	1267.	.000	8.18	2500.	.040	43.40	2.329	51.58
1.0	.018	1.70	2.0	1267.	.000	8.18	3000.	.053	51.54	2.516	59.72
1.0	.018	1.70	2.0	2500.	.028	17.24	2000.	.027	34.97	2.295	52.21
1.0	.018	1.70	2.0	2500.	.028	17.24	2500.	.040	43.40	2.510	60.64
1.0	.018	1.70	2.0	2500.	.028	17.24	3000.	.053	51.54	2.697	68.78
1.0	.018	1.70	2.0	3000.	.041	20.62	2000.	.027	34.97	2.380	55.59
1.0	.018	1.70	2.0	3000.	.041	20.62	2500.	.040	43.40	2.594	64.01
1.0	.018	1.70	2.0	3000.	.041	20.62	3000.	.053	51.54	2.782	72.16
2.0	.013	1.30	1.0	1405.	.000	10.38	2000.	.024	21.43	2.167	31.81
2.0	.013	1.30	1.0	1405.	.000	10.38	2500.	.036	29.82	2.254	40.19
2.0	.013	1.30	1.0	1405.	.000	10.38	3000.	.049	37.99	2.335	48.37
2.0	.013	1.30	1.0	2500.	.025	28.73	2000.	.024	21.43	2.195	50.16
2.0	.013	1.30	1.0	2500.	.025	28.73	2500.	.036	29.82	2.282	58.55
2.0	.013	1.30	1.0	2500.	.025	28.73	3000.	.049	37.99	2.363	66.73
2.0	.013	1.30	1.0	3000.	.038	36.75	2000.	.024	21.43	2.257	58.18
2.0	.013	1.30	1.0	3000.	.038	36.75	2500.	.036	29.82	2.344	66.57
2.0	.013	1.30	1.0	3000.	.038	36.75	3000.	.049	37.99	2.425	74.74
2.0	.013	1.30	1.5	1384.	.000	7.75	2000.	.024	25.72	2.200	33.47
2.0	.013	1.30	1.5	1384.	.000	7.75	2500.	.036	35.78	2.305	43.53
2.0	.013	1.30	1.5	1384.	.000	7.75	3000.	.049	45.59	2.402	53.34
2.0	.013	1.30	1.5	2500.	.025	22.59	2000.	.024	25.72	2.184	48.31
2.0	.013	1.30	1.5	2500.	.025	22.59	2500.	.036	35.78	2.289	58.37
2.0	.013	1.30	1.5	2500.	.025	22.59	3000.	.049	45.59	2.386	68.18
2.0	.013	1.30	1.5	3000.	.038	28.94	2000.	.024	25.72	2.231	54.66
2.0	.013	1.30	1.5	3000.	.038	28.94	2500.	.036	35.78	2.336	64.72
2.0	.013	1.30	1.5	3000.	.038	28.94	3000.	.049	45.59	2.433	74.53
2.0	.013	1.30	2.0	1363.	.000	5.99	2000.	.024	28.57	2.233	34.56
2.0	.013	1.30	2.0	1363.	.000	5.99	2500.	.036	39.76	2.349	45.74
2.0	.013	1.30	2.0	1363.	.000	5.99	3000.	.049	50.66	2.457	56.64
2.0	.013	1.30	2.0	2500.	.026	18.47	2000.	.024	28.57	2.180	47.04
2.0	.013	1.30	2.0	2500.	.026	18.47	2500.	.036	39.76	2.296	58.22
2.0	.013	1.30	2.0	2500.	.026	18.47	3000.	.049	50.66	2.404	69.12
2.0	.013	1.30	2.0	3000.	.039	23.70	2000.	.024	28.57	2.216	52.27
2.0	.013	1.30	2.0	3000.	.039	23.70	2500.	.036	39.76	2.332	63.[illegible]
2.0	.013	1.30	2.0	3000.	.039	23.70	3000.	.049	50.66	2.440	74.36

2.0	.013	1.50	1.0	1381.	.000	9.58	2000.	.023	22.02	2.218	31.60
2.0	.013	1.50	1.0	1381.	.000	9.58	2500.	.036	30.52	2.311	40.10
2.0	.013	1.50	1.0	1381.	.000	9.58	3000.	.049	38.80	2.395	48.39
2.0	.013	1.50	1.0	2500.	.025	28.16	2000.	.023	22.02	2.190	50.18
2.0	.013	1.50	1.0	2500.	.025	28.16	2500.	.036	30.52	2.283	58.68
2.0	.013	1.50	1.0	2500.	.025	28.16	3000.	.049	38.80	2.367	66.96
2.0	.013	1.50	1.0	3000.	.038	36.08	2000.	.023	22.02	2.248	58.10
2.0	.013	1.50	1.0	3000.	.038	36.08	2500.	.036	30.52	2.341	66.60
2.0	.013	1.50	1.0	3000.	.038	36.08	3000.	.049	38.80	2.425	74.89
2.0	.013	1.50	1.5	1348.	.000	6.75	2000.	.023	26.42	2.293	33.18
2.0	.013	1.50	1.5	1348.	.000	6.75	2500.	.036	36.62	2.405	43.37
2.0	.013	1.50	1.5	1348.	.000	6.75	3000.	.049	46.57	2.506	53.32
2.0	.013	1.50	1.5	2500.	.026	21.82	2000.	.023	26.42	2.185	48.24
2.0	.013	1.50	1.5	2500.	.026	21.82	2500.	.036	36.62	2.297	58.44
2.0	.013	1.50	1.5	2500.	.026	21.82	3000.	.049	46.57	2.398	68.38
2.0	.013	1.50	1.5	3000.	.039	28.04	2000.	.023	26.42	2.226	54.46
2.0	.013	1.50	1.5	3000.	.039	28.04	2500.	.036	36.62	2.338	64.66
2.0	.013	1.50	1.5	3000.	.039	28.04	3000.	.049	46.57	2.439	74.61
2.0	.013	1.50	2.0	1315.	.000	4.82	2000.	.023	29.36	2.390	34.18
2.0	.013	1.50	2.0	1315.	.000	4.82	2500.	.036	40.69	2.515	45.51
2.0	.013	1.50	2.0	1315.	.000	4.82	3000.	.049	51.74	2.627	56.56
2.0	.013	1.50	2.0	2500.	.027	17.49	2000.	.023	29.36	2.189	46.85
2.0	.013	1.50	2.0	2500.	.027	17.49	2500.	.036	40.69	2.314	58.18
2.0	.013	1.50	2.0	2500.	.027	17.49	3000.	.049	51.74	2.426	69.23
2.0	.013	1.50	2.0	3000.	.040	22.57	2000.	.023	29.36	2.218	51.93
2.0	.013	1.50	2.0	3000.	.040	22.57	2500.	.036	40.69	2.343	63.26
2.0	.013	1.50	2.0	3000.	.040	22.57	3000.	.049	51.74	2.455	74.31
2.0	.013	1.70	1.0	1359.	.000	8.83	2000.	.023	22.49	2.288	31.32
2.0	.013	1.70	1.0	1359.	.000	8.83	2500.	.035	31.07	2.387	39.90
2.0	.013	1.70	1.0	1359.	.000	8.83	3000.	.048	39.45	2.474	48.28
2.0	.013	1.70	1.0	2500.	.026	27.58	2000.	.023	22.49	2.194	50.07
2.0	.013	1.70	1.0	2500.	.026	27.58	2500.	.035	31.07	2.293	58.56
2.0	.013	1.70	1.0	2500.	.026	27.58	3000.	.048	39.45	2.379	67.03
2.0	.013	1.70	1.0	3000.	.039	35.41	2000.	.023	22.49	2.248	57.90
2.0	.013	1.70	1.0	3000.	.039	35.41	2500.	.035	31.07	2.347	66.49
2.0	.013	1.70	1.0	3000.	.039	35.41	3000.	.048	39.45	2.433	74.86
2.0	.013	1.70	1.5	1315.	.000	5.78	2000.	.023	26.98	2.441	32.77
2.0	.013	1.70	1.5	1315.	.000	5.78	2500.	.035	37.29	2.560	43.07
2.0	.013	1.70	1.5	1315.	.000	5.78	3000.	.048	47.34	2.664	53.12
2.0	.013	1.70	1.5	2500.	.027	20.99	2000.	.023	26.98	2.200	47.97
2.0	.013	1.70	1.5	2500.	.027	20.99	2500.	.035	37.29	2.319	58.28
2.0	.013	1.70	1.5	2500.	.027	20.99	3000.	.048	47.34	2.423	68.33
2.0	.013	1.70	1.5	3000.	.040	27.08	2000.	.023	26.98	2.235	54.07
2.0	.013	1.70	1.5	3000.	.040	27.08	2500.	.035	37.29	2.354	64.37
2.0	.013	1.70	1.5	3000.	.040	27.08	3000.	.048	47.34	2.458	74.42
2.0	.013	1.70	2.0	1271.	.000	3.65	2000.	.023	29.98	2.699	33.63
2.0	.013	1.70	2.0	1271.	.000	3.65	2500.	.035	41.43	2.831	45.08
2.0	.013	1.70	2.0	1271.	.000	3.65	3000.	.048	52.60	2.946	56.25
2.0	.013	1.70	2.0	2500.	.027	16.40	2000.	.023	29.98	2.223	46.38
2.0	.013	1.70	2.0	2500.	.027	16.40	2500.	.035	41.43	2.355	57.83
2.0	.013	1.70	2.0	2500.	.027	16.40	3000.	.048	52.60	2.471	68.99
2.0	.013	1.70	2.0	3000.	.041	21.30	2000.	.023	29.98	2.243	51.28
2.0	.013	1.70	2.0	3000.	.041	21.30	2500.	.035	41.43	2.375	62.73
2.0	.013	1.70	2.0	3000.	.041	21.30	3000.	.048	52.60	2.491	73.89

3.0	.006	1.30	1.0	1396.	.000	-2.74	2000.	.017	9.85	-.490	7.11
3.0	.006	1.30	1.0	1396.	.000	-2.74	2500.	.029	18.95	-.660	16.21
3.0	.006	1.30	1.0	1396.	.000	-2.74	3000.	.042	27.86	-.676	25.12
	.006	1.30	1.0	2500.	.024	17.03	2000.	.017	9.85	3.142	26.88
	.006	1.30	1.0	2500.	.024	17.03	2500.	.029	18.95	2.972	35.98
	.006	1.30	1.0	2500.	.024	17.03	3000.	.042	27.86	2.956	44.89
3.0	.006	1.30	1.0	3000.	.037	25.64	2000.	.017	9.85	3.055	35.49
3.0	.006	1.30	1.0	3000.	.037	25.64	2500.	.029	18.95	2.885	44.59
3.0	.006	1.30	1.0	3000.	.037	25.64	3000.	.042	27.86	2.869	53.50
3.0	.006	1.30	1.5	1375.	.000	-2.61	2000.	.017	11.82	.481	9.21
3.0	.006	1.30	1.5	1375.	.000	-2.61	2500.	.029	22.74	.276	20.13
3.0	.006	1.30	1.5	1375.	.000	-2.61	3000.	.042	33.43	.257	30.82
3.0	.006	1.30	1.5	2500.	.025	13.47	2000.	.017	11.82	3.160	25.29
3.0	.006	1.30	1.5	2500.	.025	13.47	2500.	.029	22.74	2.956	36.21
3.0	.006	1.30	1.5	2500.	.025	13.47	3000.	.042	33.43	2.937	46.90
3.0	.006	1.30	1.5	3000.	.038	20.33	2000.	.017	11.82	3.081	32.15
3.0	.006	1.30	1.5	3000.	.038	20.33	2500.	.029	22.74	2.876	43.07
3.0	.006	1.30	1.5	3000.	.038	20.33	3000.	.042	33.43	2.857	53.76
3.0	.006	1.30	2.0	1354.	.000	-2.53	2000.	.017	13.13	1.071	10.60
3.0	.006	1.30	2.0	1354.	.000	-2.53	2500.	.029	25.27	.844	22.73
3.0	.006	1.30	2.0	1354.	.000	-2.53	3000.	.042	37.14	.823	34.61
3.0	.006	1.30	2.0	2500.	.025	11.08	2000.	.017	13.13	3.174	24.21
3.0	.006	1.30	2.0	2500.	.025	11.08	2500.	.029	25.27	2.947	36.35
3.0	.006	1.30	2.0	2500.	.025	11.08	3000.	.042	37.14	2.926	48.22
3.0	.006	1.30	2.0	3000.	.038	16.78	2000.	.017	13.13	3.099	29.91
3.0	.006	1.30	2.0	3000.	.038	16.78	2500.	.029	25.27	2.872	42.04
3.0	.006	1.30	2.0	3000.	.038	16.78	3000.	.042	37.14	2.851	53.92
3.0	.006	1.50	1.0	1371.	.000	-3.35	2000.	.016	9.92	-.178	6.58
3.0	.006	1.50	1.0	1371.	.000	-3.35	2500.	.028	19.03	-.323	15.69
3.0	.006	1.50	1.0	1371.	.000	-3.35	3000.	.041	27.95	-.331	24.61
3.0	.006	1.50	1.0	2500.	.025	16.80	2000.	.016	9.92	3.137	26.73
3.0	.006	1.50	1.0	2500.	.025	16.80	2500.	.028	19.03	2.991	35.84
3.0	.006	1.50	1.0	2500.	.025	16.80	3000.	.041	27.95	2.984	44.76
3.0	.006	1.50	1.0	3000.	.038	25.38	2000.	.016	9.92	3.035	35.30
3.0	.006	1.50	1.0	3000.	.038	25.38	2500.	.028	19.03	2.890	44.41
3.0	.006	1.50	1.0	3000.	.038	25.38	3000.	.041	27.95	2.882	53.33
3.0	.006	1.50	1.5	1338.	.000	-3.36	2000.	.016	11.91	.719	8.54
3.0	.006	1.50	1.5	1338.	.000	-3.36	2500.	.028	22.84	.544	19.48
3.0	.006	1.50	1.5	1338.	.000	-3.36	3000.	.041	33.54	.536	30.18
3.0	.006	1.50	1.5	2500.	.026	13.16	2000.	.016	11.91	3.160	25.07
3.0	.006	1.50	1.5	2500.	.026	13.16	2500.	.028	22.84	2.985	36.00
3.0	.006	1.50	1.5	2500.	.026	13.16	3000.	.041	33.54	2.976	46.70
3.0	.006	1.50	1.5	3000.	.038	19.97	2000.	.016	11.91	3.061	31.88
3.0	.006	1.50	1.5	3000.	.038	19.97	2500.	.028	22.84	2.886	42.81
3.0	.006	1.50	1.5	3000.	.038	19.97	3000.	.041	33.54	2.877	53.52
3.0	.006	1.50	2.0	1305.	.000	-3.40	2000.	.016	13.23	1.246	9.83
3.0	.006	1.50	2.0	1305.	.000	-3.40	2500.	.028	25.38	1.052	21.98
3.0	.006	1.50	2.0	1305.	.000	-3.40	3000.	.041	37.27	1.042	33.87
3.0	.006	1.50	2.0	2500.	.026	10.68	2000.	.016	13.23	3.182	23.91
3.0	.006	1.50	2.0	2500.	.026	10.68	2500.	.028	25.38	2.988	36.06
3.0	.006	1.50	2.0	2500.	.026	10.68	3000.	.041	37.27	2.978	47.95
3.0	.006	1.50	2.0	3000.	.039	16.32	2000.	.016	13.23	3.082	29.55
3.0	.006	1.50	2.0	3000.	.039	16.32	2500.	.028	25.38	2.888	41.69
3.0	.006	1.50	2.0	3000.	.039	16.32	3000.	.041	37.27	2.878	53.59

ALTITUDE 30000.0 PRSL = 11.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.006	1.70	1.0	1349.	.000	-3.91	2000.	.016	9.98	.015	6.07
3.0	.006	1.70	1.0	1349.	.000	-3.91	2500.	.028	19.10	-.109	15.18
3.0	.006	1.70	1.0	1349.	.000	-3.91	3000.	.041	28.03	-.109	24.11
3.0	.006	1.70	1.0	2500.	.025	16.57	2000.	.016	9.98	3.137	26.55
3.0	.006	1.70	1.0	2500.	.025	16.57	2500.	.028	19.10	3.013	35.67
3.0	.006	1.70	1.0	2500.	.025	16.57	3000.	.041	28.03	3.013	44.60
3.0	.006	1.70	1.0	3000.	.038	25.11	2000.	.016	9.98	3.022	35.09
3.0	.006	1.70	1.0	3000.	.038	25.11	2500.	.028	19.10	2.898	44.21
3.0	.006	1.70	1.0	3000.	.038	25.11	3000.	.041	28.03	2.897	53.14
3.0	.006	1.70	1.5	1305.	.000	-4.08	2000.	.016	11.98	.847	7.90
3.0	.006	1.70	1.5	1305.	.000	-4.08	2500.	.028	22.92	.699	18.84
3.0	.006	1.70	1.5	1305.	.000	-4.08	3000.	.041	33.63	.698	29.55
3.0	.006	1.70	1.5	2500.	.026	12.82	2000.	.016	11.98	3.170	24.80
3.0	.006	1.70	1.5	2500.	.026	12.82	2500.	.028	22.92	3.021	35.74
3.0	.006	1.70	1.5	2500.	.026	12.82	3000.	.041	33.63	3.021	46.45
3.0	.006	1.70	1.5	3000.	.039	19.58	2000.	.016	11.98	3.051	31.56
3.0	.006	1.70	1.5	3000.	.039	19.58	2500.	.028	22.92	2.902	42.50
3.0	.006	1.70	1.5	3000.	.039	19.58	3000.	.041	33.63	2.902	53.21
3.0	.006	1.70	2.0	1260.	.000	-4.24	2000.	.016	13.31	1.327	9.06
3.0	.006	1.70	2.0	1260.	.000	-4.24	2500.	.028	25.47	1.161	21.22
3.0	.006	1.70	2.0	1260.	.000	-4.24	3000.	.041	37.37	1.161	33.13
3.0	.006	1.70	2.0	2500.	.027	10.22	2000.	.016	13.31	3.209	23.53
3.0	.006	1.70	2.0	2500.	.027	10.22	2500.	.028	25.47	3.043	35.69
3.0	.006	1.70	2.0	2500.	.027	10.22	3000.	.041	37.37	3.043	47.60
3.0	.006	1.70	2.0	3000.	.040	15.78	2000.	.016	13.31	3.081	29.09
3.0	.006	1.70	2.0	3000.	.040	15.78	2500.	.028	25.47	2.915	41.25
3.0	.006	1.70	2.0	3000.	.040	15.78	3000.	.041	37.37	2.915	53.16

1.0	.018	1.30	1.0	1391.	.000	20.07	2000.	.028	21.41	2.016	41.48
1.0	.018	1.30	1.0	1391.	.000	20.07	2500.	.041	26.71	2.197	46.78
1.0	.018	1.30	1.0	1391.	.000	20.07	3000.	.054	31.81	2.359	51.88
1.0	.018	1.30	1.0	2500.	.024	35.52	2000.	.028	21.41	2.280	56.92
1.0	.018	1.30	1.0	2500.	.024	35.52	2500.	.041	26.71	2.461	62.23
1.0	.018	1.30	1.0	2500.	.024	35.52	3000.	.054	31.81	2.623	67.32
1.0	.018	1.30	1.0	3000.	.037	42.10	2000.	.028	21.41	2.386	63.50
1.0	.018	1.30	1.0	3000.	.037	42.10	2500.	.041	26.71	2.567	68.81
1.0	.018	1.30	1.0	3000.	.037	42.10	3000.	.054	31.81	2.729	73.90
1.0	.018	1.30	1.5	1370.	.000	15.27	2000.	.028	25.69	2.126	40.96
1.0	.018	1.30	1.5	1370.	.000	15.27	2500.	.041	32.05	2.343	47.32
1.0	.018	1.30	1.5	1370.	.000	15.27	3000.	.054	38.17	2.537	53.44
1.0	.018	1.30	1.5	2500.	.025	27.57	2000.	.028	25.69	2.339	53.26
1.0	.018	1.30	1.5	2500.	.025	27.57	2500.	.041	32.05	2.556	59.63
1.0	.018	1.30	1.5	2500.	.025	27.57	3000.	.054	38.17	2.750	65.74
1.0	.018	1.30	1.5	3000.	.038	32.70	2000.	.028	25.69	2.424	58.39
1.0	.018	1.30	1.5	3000.	.038	32.70	2500.	.041	32.05	2.642	64.75
1.0	.018	1.30	1.5	3000.	.038	32.70	3000.	.054	38.17	2.835	70.87
1.0	.018	1.30	2.0	1349.	.000	12.03	2000.	.028	28.54	2.203	40.57
1.0	.018	1.30	2.0	1349.	.000	12.03	2500.	.041	35.61	2.445	47.65
1.0	.018	1.30	2.0	1349.	.000	12.03	3000.	.054	42.41	2.660	54.44
1.0	.018	1.30	2.0	2500.	.025	22.21	2000.	.028	28.54	2.382	50.75
1.0	.018	1.30	2.0	2500.	.025	22.21	2500.	.041	35.61	2.623	57.82
1.0	.018	1.30	2.0	2500.	.025	22.21	3000.	.054	42.41	2.839	64.62
1.0	.018	1.30	2.0	3000.	.038	26.36	2000.	.028	28.54	2.454	54.90
1.0	.018	1.30	2.0	3000.	.038	26.36	2500.	.041	35.61	2.696	61.98
1.0	.018	1.30	2.0	3000.	.038	26.36	3000.	.054	42.41	2.911	68.77
1.0	.018	1.50	1.0	1367.	.000	16.93	2000.	.028	24.69	1.890	43.62
1.0	.018	1.50	1.0	1367.	.000	18.93	2500.	.040	30.63	2.056	49.56
1.0	.018	1.50	1.0	1367.	.000	18.93	3000.	.054	36.36	2.203	55.29
1.0	.018	1.50	1.0	2500.	.025	34.29	2000.	.028	24.69	2.156	58.98
1.0	.018	1.50	1.0	2500.	.025	34.29	2500.	.040	30.63	2.323	64.92
1.0	.018	1.50	1.0	2500.	.025	34.29	3000.	.054	36.36	2.469	70.66
1.0	.018	1.50	1.0	3000.	.038	40.68	2000.	.028	24.69	2.263	65.36
1.0	.018	1.50	1.0	3000.	.038	40.68	2500.	.040	30.63	2.430	71.31
1.0	.018	1.50	1.0	3000.	.038	40.68	3000.	.054	36.36	2.576	77.04
1.0	.018	1.50	1.5	1333.	.000	13.81	2000.	.028	29.62	1.988	43.43
1.0	.018	1.50	1.5	1333.	.000	13.81	2500.	.040	36.76	2.188	50.56
1.0	.018	1.50	1.5	1333.	.000	13.81	3000.	.054	43.64	2.364	57.44
1.0	.018	1.50	1.5	2500.	.026	25.92	2000.	.028	29.62	2.202	55.54
1.0	.018	1.50	1.5	2500.	.026	25.92	2500.	.040	36.76	2.402	62.68
1.0	.018	1.50	1.5	2500.	.026	25.92	3000.	.054	43.64	2.578	69.56
1.0	.018	1.50	1.5	3000.	.039	30.78	2000.	.028	29.62	2.290	60.41
1.0	.018	1.50	1.5	3000.	.039	30.78	2500.	.040	36.76	2.489	67.54
1.0	.018	1.50	1.5	3000.	.039	30.78	3000.	.054	43.64	2.665	74.42
1.0	.018	1.50	2.0	1299.	.000	10.29	2000.	.028	32.92	2.072	43.21
1.0	.018	1.50	2.0	1299.	.000	10.29	2500.	.040	40.84	2.294	51.13
1.0	.018	1.50	2.0	1299.	.000	10.29	3000.	.054	48.49	2.489	58.78
1.0	.018	1.50	2.0	2500.	.026	20.14	2000.	.028	32.92	2.249	53.05
1.0	.018	1.50	2.0	2500.	.026	20.14	2500.	.040	40.84	2.470	60.98
1.0	.018	1.50	2.0	2500.	.026	20.14	3000.	.054	48.49	2.666	68.62
1.0	.018	1.50	2.0	3000.	.039	23.95	2000.	.028	32.92	2.324	56.87
1.0	.018	1.50	2.0	3000.	.039	23.95	2500.	.040	40.84	2.546	64.80
1.0	.018	1.50	2.0	3000.	.039	23.95	3000.	.054	48.49	2.741	72.44

1.0	.018	1.70	1.0	1344.	.000	17.83	2000.	.028	27.15	1.837	44.98
1.0	.018	1.70	1.0	1344.	.000	17.83	2500.	.040	33.57	1.994	51.40
1.0	.018	1.70	1.0	1344.	.000	17.83	3000.	.053	39.78	2.132	57.61
1.0	.018	1.70	1.0	2500.	.025	33.06	2000.	.028	27.15	2.105	60.21
1.0	.018	1.70	1.0	2500.	.025	33.06	2500.	.040	33.57	2.262	66.63
1.0	.018	1.70	1.0	2500.	.025	33.06	3000.	.053	39.78	2.399	72.84
1.0	.018	1.70	1.0	3000.	.038	39.25	2000.	.028	27.15	2.213	66.40
1.0	.018	1.70	1.0	3000.	.038	39.25	2500.	.040	33.57	2.370	72.82
1.0	.018	1.70	1.0	3000.	.038	39.25	3000.	.053	39.78	2.508	79.03
1.0	.018	1.70	1.5	1299.	.000	12.35	2000.	.028	32.58	1.950	44.93
1.0	.018	1.70	1.5	1299.	.000	12.35	2500.	.040	40.28	2.139	52.63
1.0	.018	1.70	1.5	1299.	.000	12.35	3000.	.053	47.74	2.303	60.09
1.0	.018	1.70	1.5	2500.	.026	24.17	2000.	.028	32.58	2.162	56.74
1.0	.018	1.70	1.5	2500.	.026	24.17	2500.	.040	40.28	2.350	64.45
1.0	.018	1.70	1.5	2500.	.026	24.17	3000.	.053	47.74	2.515	71.90
1.0	.018	1.70	1.5	3000.	.039	28.75	2000.	.028	32.58	2.252	61.33
1.0	.018	1.70	1.5	3000.	.039	28.75	2500.	.040	40.28	2.440	69.03
1.0	.018	1.70	1.5	3000.	.039	28.75	3000.	.053	47.74	2.605	76.48
1.0	.018	1.70	2.0	1254.	.000	8.49	2000.	.028	36.20	2.081	44.69
1.0	.018	1.70	2.0	1254.	.000	8.49	2500.	.040	44.76	2.290	53.25
1.0	.018	1.70	2.0	1254.	.000	8.49	3000.	.053	53.04	2.473	61.53
1.0	.018	1.70	2.0	2500.	.027	17.81	2000.	.028	36.20	2.243	54.00
1.0	.018	1.70	2.0	2500.	.027	17.81	2500.	.040	44.76	2.453	62.57
1.0	.018	1.70	2.0	2500.	.027	17.81	3000.	.053	53.04	2.636	70.85
1.0	.018	1.70	2.0	3000.	.040	21.25	2000.	.028	36.20	2.322	57.45
1.0	.018	1.70	2.0	3000.	.040	21.25	2500.	.040	44.76	2.532	66.01
1.0	.018	1.70	2.0	3000.	.040	21.25	3000.	.053	53.04	2.715	74.29
2.0	.014	1.30	1.0	1400.	.000	11.08	2000.	.025	22.36	2.133	33.45
2.0	.014	1.30	1.0	1400.	.000	11.08	2500.	.037	30.78	2.222	41.86
2.0	.014	1.30	1.0	1400.	.000	11.08	3000.	.050	38.98	2.304	50.06
2.0	.014	1.30	1.0	2500.	.025	29.54	2000.	.025	22.36	2.165	51.90
2.0	.014	1.30	1.0	2500.	.025	29.54	2500.	.037	30.78	2.254	60.31
2.0	.014	1.30	1.0	2500.	.025	29.54	3000.	.050	38.98	2.336	68.51
2.0	.014	1.30	1.0	3000.	.038	37.56	2000.	.025	22.36	2.227	59.92
2.0	.014	1.30	1.0	3000.	.038	37.56	2500.	.037	30.78	2.315	68.34
2.0	.014	1.30	1.0	3000.	.038	37.56	3000.	.050	38.98	2.397	76.54
2.0	.014	1.30	1.5	1379.	.000	8.33	2000.	.025	26.84	2.160	35.17
2.0	.014	1.30	1.5	1379.	.000	8.33	2500.	.037	36.93	2.266	45.26
2.0	.014	1.30	1.5	1379.	.000	8.33	3000.	.050	46.77	2.364	55.10
2.0	.014	1.30	1.5	2500.	.025	23.26	2000.	.025	26.84	2.153	50.09
2.0	.014	1.30	1.5	2500.	.025	23.26	2500.	.037	36.93	2.259	60.19
2.0	.014	1.30	1.5	2500.	.025	23.26	3000.	.050	46.77	2.357	70.03
2.0	.014	1.30	1.5	3000.	.038	29.62	2000.	.025	26.84	2.199	56.45
2.0	.014	1.30	1.5	3000.	.038	29.62	2500.	.037	36.93	2.306	66.55
2.0	.014	1.30	1.5	3000.	.038	29.62	3000.	.050	46.77	2.404	76.39
2.0	.014	1.30	2.0	1358.	.000	6.48	2000.	.025	29.82	2.187	36.30
2.0	.014	1.30	2.0	1358.	.000	6.48	2500.	.037	41.04	2.305	47.52
2.0	.014	1.30	2.0	1358.	.000	6.48	3000.	.050	51.97	2.414	58.45
2.0	.014	1.30	2.0	2500.	.025	19.04	2000.	.025	29.82	2.146	48.86
2.0	.014	1.30	2.0	2500.	.025	19.04	2500.	.037	41.04	2.265	60.08
2.0	.014	1.30	2.0	2500.	.025	19.04	3000.	.050	51.97	2.374	71.01
2.0	.014	1.30	2.0	3000.	.039	24.29	2000.	.025	29.82	2.183	54.10
2.0	.014	1.30	2.0	3000.	.039	24.29	2500.	.037	41.04	2.301	65.32
2.0	.014	1.30	2.0	3000.	.039	24.29	3000.	.050	51.97	2.410	76.25

2.0	.014	1.50	1.0	1376.	.000	10.31	2000.	.024	22.98	2.175	33.28
2.0	.014	1.50	1.0	1376.	.000	10.31	2500.	.036	31.51	2.269	41.81
2.0	.014	1.50	1.0	1376.	.000	10.31	3000.	.050	39.82	2.354	50.13
2.0	.014	1.50	1.0	2500.	.025	29.00	2000.	.024	22.98	2.159	51.97
2.0	.014	1.50	1.0	2500.	.025	29.00	2500.	.036	31.51	2.253	60.50
2.0	.014	1.50	1.0	2500.	.025	29.00	3000.	.050	39.82	2.338	68.82
2.0	.014	1.50	1.0	3000.	.038	36.93	2000.	.024	22.98	2.216	59.91
2.0	.014	1.50	1.0	3000.	.038	36.93	2500.	.036	31.51	2.311	68.44
2.0	.014	1.50	1.0	3000.	.038	36.93	3000.	.050	39.82	2.395	76.76
2.0	.014	1.50	1.5	1343.	.000	7.36	2000.	.024	27.57	2.236	34.93
2.0	.014	1.50	1.5	1343.	.000	7.36	2500.	.036	37.81	2.349	45.16
2.0	.014	1.50	1.5	1343.	.000	7.36	3000.	.050	47.79	2.451	55.14
2.0	.014	1.50	1.5	2500.	.026	22.53	2000.	.024	27.57	2.150	50.10
2.0	.014	1.50	1.5	2500.	.026	22.53	2500.	.036	37.81	2.264	60.33
2.0	.014	1.50	1.5	2500.	.026	22.53	3000.	.050	47.79	2.365	70.31
2.0	.014	1.50	1.5	3000.	.039	28.77	2000.	.024	27.57	2.192	56.34
2.0	.014	1.50	1.5	3000.	.039	28.77	2500.	.036	37.81	2.305	66.57
2.0	.014	1.50	1.5	3000.	.039	28.77	3000.	.050	47.79	2.406	76.55
2.0	.014	1.50	2.0	1310.	.000	5.34	2000.	.024	30.63	2.314	35.97
2.0	.014	1.50	2.0	1310.	.000	5.34	2500.	.036	42.01	2.440	47.35
2.0	.014	1.50	2.0	1310.	.000	5.34	3000.	.050	53.10	2.552	58.44
2.0	.014	1.50	2.0	2500.	.026	18.12	2000.	.024	30.63	2.152	48.75
2.0	.014	1.50	2.0	2500.	.026	18.12	2500.	.036	42.01	2.278	60.13
2.0	.014	1.50	2.0	2500.	.026	18.12	3000.	.050	53.10	2.390	71.22
2.0	.014	1.50	2.0	3000.	.040	23.22	2000.	.024	30.63	2.182	53.85
2.0	.014	1.50	2.0	3000.	.040	23.22	2500.	.036	42.01	2.307	65.22
2.0	.014	1.50	2.0	3000.	.040	23.22	3000.	.050	53.10	2.420	76.31
2.0	.014	1.70	1.0	1354.	.000	9.57	2000.	.024	23.46	2.234	33.03
2.0	.014	1.70	1.0	1354.	.000	9.57	2500.	.036	32.08	2.333	41.65
2.0	.014	1.70	1.0	1354.	.000	9.57	3000.	.049	40.49	2.420	50.06
2.0	.014	1.70	1.0	2500.	.026	28.45	2000.	.024	23.46	2.161	51.91
2.0	.014	1.70	1.0	2500.	.026	28.45	2500.	.036	32.08	2.260	60.53
2.0	.014	1.70	1.0	2500.	.026	28.45	3000.	.049	40.49	2.347	68.94
2.0	.014	1.70	1.0	3000.	.039	36.30	2000.	.024	23.46	2.215	59.76
2.0	.014	1.70	1.0	3000.	.039	36.30	2500.	.036	32.08	2.314	68.38
2.0	.014	1.70	1.0	3000.	.039	36.30	3000.	.049	40.49	2.401	76.79
2.0	.014	1.70	1.5	1310.	.000	6.41	2000.	.024	28.15	2.357	34.56
2.0	.014	1.70	1.5	1310.	.000	6.41	2500.	.036	38.50	2.476	44.90
2.0	.014	1.70	1.5	1310.	.000	6.41	3000.	.049	48.59	2.580	54.99
2.0	.014	1.70	1.5	2500.	.026	21.75	2000.	.024	28.15	2.163	49.90
2.0	.014	1.70	1.5	2500.	.026	21.75	2500.	.036	38.50	2.282	60.24
2.0	.014	1.70	1.5	2500.	.026	21.75	3000.	.049	48.59	2.386	70.33
2.0	.014	1.70	1.5	3000.	.040	27.86	2000.	.024	28.15	2.198	56.01
2.0	.014	1.70	1.5	3000.	.040	27.86	2500.	.036	38.50	2.317	66.36
2.0	.014	1.70	1.5	3000.	.040	27.86	3000.	.049	48.59	2.421	76.45
2.0	.014	1.70	2.0	1265.	.000	4.20	2000.	.024	31.28	2.554	35.48
2.0	.014	1.70	2.0	1265.	.000	4.20	2500.	.036	42.77	2.686	46.97
2.0	.014	1.70	2.0	1265.	.000	4.20	3000.	.049	53.98	2.801	58.18
2.0	.014	1.70	2.0	2500.	.027	17.08	2000.	.024	31.28	2.180	48.36
2.0	.014	1.70	2.0	2500.	.027	17.08	2500.	.036	42.77	2.312	59.85
2.0	.014	1.70	2.0	2500.	.027	17.08	3000.	.049	53.98	2.428	71.07
2.0	.014	1.70	2.0	3000.	.041	22.01	2000.	.024	31.28	2.202	53.29
2.0	.014	1.70	2.0	3000.	.041	22.01	2500.	.036	42.77	2.334	64.78
2.0	.014	1.70	2.0	3000.	.041	22.01	3000.	.049	53.98	2.450	76.00

3.0	.007	1.30	1.0	1394.	.000	-1.64	2000.	.018	11.18	-2.518	9.53
3.0	.007	1.30	1.0	1394.	.000	-1.64	2500.	.030	20.30	-2.634	18.66
3.0	.007	1.30	1.0	1394.	.000	-1.64	3000.	.043	29.24	-2.635	27.59
3.0	.007	1.30	1.0	2500.	.024	18.15	2000.	.018	11.18	2.997	29.33
3.0	.007	1.30	1.0	2500.	.024	18.15	2500.	.030	20.30	2.882	38.45
3.0	.007	1.30	1.0	2500.	.024	18.15	3000.	.043	29.24	2.880	47.39
3.0	.007	1.30	1.0	3000.	.037	26.75	2000.	.018	11.18	2.928	37.93
3.0	.007	1.30	1.0	3000.	.037	26.75	2500.	.030	20.30	2.813	47.05
3.0	.007	1.30	1.0	3000.	.037	26.75	3000.	.043	29.24	2.811	55.99
3.0	.007	1.30	1.5	1373.	.000	-1.73	2000.	.018	13.41	-.683	11.68
3.0	.007	1.30	1.5	1373.	.000	-1.73	2500.	.030	24.36	-.821	22.63
3.0	.007	1.30	1.5	1373.	.000	-1.73	3000.	.043	35.08	-.823	33.35
3.0	.007	1.30	1.5	2500.	.025	14.37	2000.	.018	13.41	3.002	27.78
3.0	.007	1.30	1.5	2500.	.025	14.37	2500.	.030	24.36	2.863	38.74
3.0	.007	1.30	1.5	2500.	.025	14.37	3000.	.043	35.08	2.862	49.46
3.0	.007	1.30	1.5	3000.	.038	21.23	2000.	.018	13.41	2.938	34.64
3.0	.007	1.30	1.5	3000.	.038	21.23	2500.	.030	24.36	2.800	45.59
3.0	.007	1.30	1.5	3000.	.038	21.23	3000.	.043	35.08	2.798	56.31
3.0	.007	1.30	2.0	1352.	.000	-1.80	2000.	.018	14.90	.304	13.10
3.0	.007	1.30	2.0	1352.	.000	-1.80	2500.	.030	27.07	.150	25.27
3.0	.007	1.30	2.0	1352.	.000	-1.80	3000.	.043	38.98	.148	37.18
3.0	.007	1.30	2.0	2500.	.025	11.84	2000.	.018	14.90	3.007	26.74
3.0	.007	1.30	2.0	2500.	.025	11.84	2500.	.030	27.07	2.853	38.91
3.0	.007	1.30	2.0	2500.	.025	11.84	3000.	.043	38.98	2.851	50.82
3.0	.007	1.30	2.0	3000.	.038	17.53	2000.	.018	14.90	2.946	32.43
3.0	.007	1.30	2.0	3000.	.038	17.53	2500.	.030	27.07	2.793	44.60
3.0	.007	1.30	2.0	3000.	.038	17.53	3000.	.043	38.98	2.790	56.51
3.0	.007	1.50	1.0	1369.	.000	-2.25	2000.	.017	11.25	-1.509	9.01
3.0	.007	1.50	1.0	1369.	.000	-2.25	2500.	.029	20.39	-1.605	18.15
3.0	.007	1.50	1.0	1369.	.000	-2.25	3000.	.042	29.34	-1.599	27.09
3.0	.007	1.50	1.0	2500.	.025	17.94	2000.	.017	11.25	2.993	29.19
3.0	.007	1.50	1.0	2500.	.025	17.94	2500.	.029	20.39	2.898	38.33
3.0	.007	1.50	1.0	2500.	.025	17.94	3000.	.042	29.34	2.904	47.27
3.0	.007	1.50	1.0	3000.	.038	26.50	2000.	.017	11.25	2.912	37.76
3.0	.007	1.50	1.0	3000.	.038	26.50	2500.	.029	20.39	2.817	46.90
3.0	.007	1.50	1.0	3000.	.038	26.50	3000.	.042	29.34	2.823	55.84
3.0	.007	1.50	1.5	1336.	.000	-2.47	2000.	.017	13.50	-.017	11.03
3.0	.007	1.50	1.5	1336.	.000	-2.47	2500.	.029	24.47	-.132	22.00
3.0	.007	1.50	1.5	1336.	.000	-2.47	3000.	.042	35.21	-.125	32.73
3.0	.007	1.50	1.5	2500.	.025	14.08	2000.	.017	13.50	3.002	27.58
3.0	.007	1.50	1.5	2500.	.025	14.08	2500.	.029	24.47	2.888	38.55
3.0	.007	1.50	1.5	2500.	.025	14.08	3000.	.042	35.21	2.895	49.28
3.0	.007	1.50	1.5	3000.	.038	20.89	2000.	.017	13.50	2.922	34.39
3.0	.007	1.50	1.5	3000.	.038	20.89	2500.	.029	24.47	2.808	45.36
3.0	.007	1.50	1.5	3000.	.038	20.89	3000.	.042	35.21	2.815	56.09
3.0	.007	1.50	2.0	1302.	.000	-2.65	2000.	.017	15.00	.760	12.35
3.0	.007	1.50	2.0	1302.	.000	-2.65	2500.	.029	27.19	.633	24.54
3.0	.007	1.50	2.0	1302.	.000	-2.65	3000.	.042	39.12	.640	36.47
3.0	.007	1.50	2.0	2500.	.026	11.46	2000.	.017	15.00	3.014	26.47
3.0	.007	1.50	2.0	2500.	.026	11.46	2500.	.029	27.19	2.887	38.65
3.0	.007	1.50	2.0	2500.	.026	11.46	3000.	.042	39.12	2.895	50.58
3.0	.007	1.50	2.0	3000.	.039	17.09	2000.	.017	15.00	2.933	32.10
3.0	.007	1.50	2.0	3000.	.039	17.09	2500.	.029	27.19	2.807	44.29
3.0	.007	1.50	2.0	3000.	.039	17.09	3000.	.042	39.12	2.814	56.21

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.007	1.70	1.0	1347.	.000	-2.81	2000.	.017	11.31	-.972	8.51
3.0	.007	1.70	1.0	1347.	.000	-2.81	2500.	.029	20.46	-1.050	17.66
3.0	.007	1.70	1.0	1347.	.000	-2.81	3000.	.042	29.42	-1.038	26.61
3.0	.007	1.70	1.0	2500.	.025	17.72	2000.	.017	11.31	2.995	29.03
3.0	.007	1.70	1.0	2500.	.025	17.72	2500.	.029	20.46	2.917	38.18
3.0	.007	1.70	1.0	2500.	.025	17.72	3000.	.042	29.42	2.929	47.14
3.0	.007	1.70	1.0	3000.	.038	26.25	2000.	.017	11.31	2.901	37.56
3.0	.007	1.70	1.0	3000.	.038	26.25	2500.	.029	20.46	2.824	46.71
3.0	.007	1.70	1.0	3000.	.038	26.25	3000.	.042	29.42	2.836	55.67
3.0	.007	1.70	1.5	1302.	.000	-3.18	2000.	.017	13.58	.306	10.40
3.0	.007	1.70	1.5	1302.	.000	-3.18	2500.	.029	24.56	.213	21.37
3.0	.007	1.70	1.5	1302.	.000	-3.18	3000.	.042	35.30	.228	32.12
3.0	.007	1.70	1.5	2500.	.026	13.75	2000.	.017	13.58	3.012	27.33
3.0	.007	1.70	1.5	2500.	.026	13.75	2500.	.029	24.56	2.919	38.31
3.0	.007	1.70	1.5	2500.	.026	13.75	3000.	.042	35.30	2.933	49.06
3.0	.007	1.70	1.5	3000.	.039	20.51	2000.	.017	13.58	2.915	34.09
3.0	.007	1.70	1.5	3000.	.039	20.51	2500.	.029	24.56	2.822	45.07
3.0	.007	1.70	1.5	3000.	.039	20.51	3000.	.042	35.30	2.837	55.82
3.0	.007	1.70	2.0	1258.	.000	-3.48	2000.	.017	15.09	.964	11.60
3.0	.007	1.70	2.0	1258.	.000	-3.48	2500.	.029	27.28	.860	23.80
3.0	.007	1.70	2.0	1258.	.000	-3.48	3000.	.042	39.23	.876	35.74
3.0	.007	1.70	2.0	2500.	.027	11.02	2000.	.017	15.09	3.038	26.11
3.0	.007	1.70	2.0	2500.	.027	11.02	2500.	.029	27.28	2.935	38.31
3.0	.007	1.70	2.0	2500.	.027	11.02	3000.	.042	39.23	2.950	50.25
3.0	.007	1.70	2.0	3000.	.040	16.59	2000.	.017	15.09	2.934	31.67
3.0	.007	1.70	2.0	3000.	.040	16.59	2500.	.029	27.28	2.830	43.87
3.0	.007	1.70	2.0	3000.	.040	16.59	3000.	.042	39.23	2.846	55.81

1.0	.019	1.30	1.0	1373.	.000	18.12	2000.	.030	21.49	2.237	39.62
1.0	.019	1.30	1.0	1373.	.000	18.12	2500.	.044	26.87	2.431	44.99
1.0	.019	1.30	1.0	1373.	.000	18.12	3000.	.058	32.05	2.604	50.17
1.0	.019	1.30	1.0	2500.	.026	33.13	2000.	.030	21.49	2.499	54.62
1.0	.019	1.30	1.0	2500.	.026	33.13	2500.	.044	26.87	2.693	59.99
1.0	.019	1.30	1.0	2500.	.026	33.13	3000.	.058	32.05	2.866	65.17
1.0	.019	1.30	1.0	3000.	.039	39.43	2000.	.030	21.49	2.609	60.93
1.0	.019	1.30	1.0	3000.	.039	39.43	2500.	.044	26.87	2.803	66.30
1.0	.019	1.30	1.0	3000.	.039	39.43	3000.	.058	32.05	2.976	71.48
1.0	.019	1.30	1.5	1351.	.000	13.67	2000.	.030	25.79	2.345	39.46
1.0	.019	1.30	1.5	1351.	.000	13.67	2500.	.044	32.24	2.578	45.91
1.0	.019	1.30	1.5	1351.	.000	13.67	3000.	.058	38.46	2.786	52.13
1.0	.019	1.30	1.5	2500.	.026	25.58	2000.	.030	25.79	2.553	51.37
1.0	.019	1.30	1.5	2500.	.026	25.58	2500.	.044	32.24	2.786	57.82
1.0	.019	1.30	1.5	2500.	.026	25.58	3000.	.058	38.46	2.994	64.04
1.0	.019	1.30	1.5	3000.	.040	30.48	2000.	.030	25.79	2.642	54.27
1.0	.019	1.30	1.5	3000.	.040	30.48	2500.	.044	32.24	2.875	62.72
1.0	.019	1.30	1.5	3000.	.040	30.48	3000.	.058	38.46	3.083	68.94
1.0	.019	1.30	2.0	1329.	.000	10.67	2000.	.030	28.66	2.424	39.32
1.0	.019	1.30	2.0	1329.	.000	10.67	2500.	.044	35.82	2.683	46.49
1.0	.019	1.30	2.0	1329.	.000	10.67	3000.	.058	42.73	2.914	53.40
1.0	.019	1.30	2.0	2500.	.027	20.48	2000.	.030	28.66	2.596	49.13
1.0	.019	1.30	2.0	2500.	.027	20.48	2500.	.044	35.82	2.855	56.30
1.0	.019	1.30	2.0	2500.	.027	20.48	3000.	.058	42.73	3.086	63.21
1.0	.019	1.30	2.0	3000.	.040	24.42	2000.	.030	28.66	2.671	53.08
1.0	.019	1.30	2.0	3000.	.040	24.42	2500.	.044	35.82	2.929	60.24
1.0	.019	1.30	2.0	3000.	.040	24.42	3000.	.058	42.73	3.160	67.15
1.0	.019	1.50	1.0	1348.	.000	16.92	2000.	.030	24.79	2.119	41.71
1.0	.019	1.50	1.0	1348.	.000	16.92	2500.	.043	30.81	2.297	47.73
1.0	.019	1.50	1.0	1348.	.000	16.92	3000.	.058	36.65	2.454	53.57
1.0	.019	1.50	1.0	2500.	.026	31.79	2000.	.030	24.79	2.379	56.58
1.0	.019	1.50	1.0	2500.	.026	31.79	2500.	.043	30.81	2.557	62.60
1.0	.019	1.50	1.0	2500.	.026	31.79	3000.	.058	36.65	2.715	68.43
1.0	.019	1.50	1.0	3000.	.040	37.88	2000.	.030	24.79	2.490	62.67
1.0	.019	1.50	1.0	3000.	.040	37.88	2500.	.043	30.81	2.669	68.69
1.0	.019	1.50	1.0	3000.	.040	37.88	3000.	.058	36.65	2.826	74.52
1.0	.019	1.50	1.5	1313.	.000	12.13	2000.	.030	29.74	2.225	41.87
1.0	.019	1.50	1.5	1313.	.000	12.13	2500.	.043	36.97	2.439	49.10
1.0	.019	1.50	1.5	1313.	.000	12.13	3000.	.058	43.98	2.628	56.10
1.0	.019	1.50	1.5	2500.	.027	23.76	2000.	.030	29.74	2.428	53.51
1.0	.019	1.50	1.5	2500.	.027	23.76	2500.	.043	36.97	2.642	60.74
1.0	.019	1.50	1.5	2500.	.027	23.76	3000.	.058	43.98	2.830	67.74
1.0	.019	1.50	1.5	3000.	.040	28.36	2000.	.030	29.74	2.519	58.11
1.0	.019	1.50	1.5	3000.	.040	28.36	2500.	.043	36.97	2.732	65.34
1.0	.019	1.50	1.5	3000.	.040	28.36	3000.	.058	43.98	2.921	72.34
1.0	.019	1.50	2.0	1278.	.000	8.82	2000.	.030	33.05	2.329	41.87
1.0	.019	1.50	2.0	1278.	.000	8.82	2500.	.043	41.08	2.566	49.90
1.0	.019	1.50	2.0	1278.	.000	8.82	3000.	.058	48.86	2.776	57.68
1.0	.019	1.50	2.0	2500.	.028	18.18	2000.	.030	33.05	2.485	51.23
1.0	.019	1.50	2.0	2500.	.028	18.18	2500.	.043	41.08	2.722	59.26
1.0	.019	1.50	2.0	2500.	.028	18.18	3000.	.058	48.86	2.932	67.04
1.0	.019	1.50	2.0	3000.	.041	21.75	2000.	.030	33.05	2.563	54.80
1.0	.019	1.50	2.0	3000.	.041	21.75	2500.	.043	41.08	2.800	62.83
1.0	.019	1.50	2.0	3000.	.041	21.75	3000.	.058	48.86	3.010	70.61

1.0	.019	1.70	1.0	1325.	.000	15.77	2000.	.029	27.26	2.082	43.02
1.0	.019	1.70	1.0	1325.	.000	15.77	2500.	.043	33.77	2.250	49.54
1.0	.019	1.70	1.0	1325.	.000	15.77	3000.	.057	40.09	2.397	55.86
1.0	.019	1.70	1.0	2500.	.027	30.44	2000.	.029	27.26	2.338	57.70
1.0	.019	1.70	1.0	2500.	.027	30.44	2500.	.043	33.77	2.507	64.21
1.0	.019	1.70	1.0	2500.	.027	30.44	3000.	.057	40.09	2.654	70.53
1.0	.019	1.70	1.0	3000.	.040	36.31	2000.	.029	27.26	2.451	63.56
1.0	.019	1.70	1.0	3000.	.040	36.31	2500.	.043	33.77	2.619	70.08
1.0	.019	1.70	1.0	3000.	.040	36.31	3000.	.057	40.09	2.766	76.40
1.0	.019	1.70	1.5	1278.	.000	10.58	2000.	.029	32.71	2.225	43.29
1.0	.019	1.70	1.5	1278.	.000	10.58	2500.	.043	40.52	2.426	51.11
1.0	.019	1.70	1.5	1278.	.000	10.58	3000.	.057	48.11	2.603	58.69
1.0	.019	1.70	1.5	2500.	.028	21.82	2000.	.029	32.71	2.412	54.53
1.0	.019	1.70	1.5	2500.	.028	21.82	2500.	.043	40.52	2.614	62.34
1.0	.019	1.70	1.5	2500.	.028	21.82	3000.	.057	48.11	2.790	69.93
1.0	.019	1.70	1.5	3000.	.041	26.11	2000.	.029	32.71	2.506	58.81
1.0	.019	1.70	1.5	3000.	.041	26.11	2500.	.043	40.52	2.707	66.63
1.0	.019	1.70	1.5	3000.	.041	26.11	3000.	.057	48.11	2.884	74.22
1.0	.019	1.70	2.0	1231.	.000	6.89	2000.	.029	36.34	2.425	43.24
1.0	.019	1.70	2.0	1231.	.000	6.89	2500.	.043	45.02	2.649	51.92
1.0	.019	1.70	2.0	1231.	.000	6.89	3000.	.057	53.46	2.845	60.35
1.0	.019	1.70	2.0	2500.	.029	15.58	2000.	.029	36.34	2.533	51.92
1.0	.019	1.70	2.0	2500.	.029	15.58	2500.	.043	45.02	2.757	60.60
1.0	.019	1.70	2.0	2500.	.029	15.58	3000.	.057	53.46	2.953	69.03
1.0	.019	1.70	2.0	3000.	.042	18.72	2000.	.029	36.34	2.614	55.07
1.0	.019	1.70	2.0	3000.	.042	18.72	2500.	.043	45.02	2.839	63.75
1.0	.019	1.70	2.0	3000.	.042	18.72	3000.	.057	53.46	3.035	72.18
2.0	.015	1.30	1.0	1392.	.000	10.23	2000.	.026	22.50	2.368	32.73
2.0	.015	1.30	1.0	1392.	.000	10.23	2500.	.039	31.04	2.463	41.27
2.0	.015	1.30	1.0	1392.	.000	10.23	3000.	.054	39.40	2.550	49.63
2.0	.015	1.30	1.0	2500.	.026	28.66	2000.	.026	22.50	2.336	51.16
2.0	.015	1.30	1.0	2500.	.026	28.66	2500.	.039	31.04	2.431	59.70
2.0	.015	1.30	1.0	2500.	.026	28.66	3000.	.054	39.40	2.518	68.06
2.0	.015	1.30	1.0	3000.	.040	36.67	2000.	.026	22.50	2.395	59.17
2.0	.015	1.30	1.0	3000.	.040	36.67	2500.	.039	31.04	2.489	67.70
2.0	.015	1.30	1.0	3000.	.040	36.67	3000.	.054	39.40	2.577	76.06
2.0	.015	1.30	1.5	1371.	.000	7.64	2000.	.026	27.00	2.388	34.64
2.0	.015	1.30	1.5	1371.	.000	7.64	2500.	.039	37.25	2.501	44.89
2.0	.015	1.30	1.5	1371.	.000	7.64	3000.	.054	47.28	2.606	54.92
2.0	.015	1.30	1.5	2500.	.027	22.54	2000.	.026	27.00	2.316	49.55
2.0	.015	1.30	1.5	2500.	.027	22.54	2500.	.039	37.25	2.430	59.79
2.0	.015	1.30	1.5	2500.	.027	22.54	3000.	.054	47.28	2.535	69.82
2.0	.015	1.30	1.5	3000.	.040	28.88	2000.	.026	27.00	2.360	55.88
2.0	.015	1.30	1.5	3000.	.040	28.88	2500.	.039	37.25	2.474	66.13
2.0	.015	1.30	1.5	3000.	.040	28.88	3000.	.054	47.28	2.578	76.16
2.0	.015	1.30	2.0	1350.	.000	5.90	2000.	.026	30.00	2.414	35.90
2.0	.015	1.30	2.0	1350.	.000	5.90	2500.	.039	41.38	2.540	47.28
2.0	.015	1.30	2.0	1350.	.000	5.90	3000.	.054	52.53	2.656	58.43
2.0	.015	1.30	2.0	2500.	.027	18.43	2000.	.026	30.00	2.306	48.43
2.0	.015	1.30	2.0	2500.	.027	18.43	2500.	.039	41.38	2.432	59.82
2.0	.015	1.30	2.0	2500.	.027	18.43	3000.	.054	52.53	2.548	70.96
2.0	.015	1.30	2.0	3000.	.041	23.66	2000.	.026	30.00	2.339	53.66
2.0	.015	1.30	2.0	3000.	.041	23.66	2500.	.039	41.38	2.466	65.04
2.0	.015	1.30	2.0	3000.	.041	23.66	3000.	.054	52.53	2.582	76.19

2.0	.015	1.50	1.0	1368.	.000	9.44	2000.	.026	23.11	2.432	32.56
2.0	.015	1.50	1.0	1368.	.000	9.44	2500.	.039	31.77	2.533	41.21
2.0	.015	1.50	1.0	1368.	.000	9.44	3000.	.053	40.25	2.623	49.69
2.0	.015	1.50	1.0	2500.	.027	28.10	2000.	.026	23.11	2.333	51.21
2.0	.015	1.50	1.0	2500.	.027	28.10	2500.	.039	31.77	2.433	59.87
2.0	.015	1.50	1.0	2500.	.027	28.10	3000.	.053	40.25	2.523	68.35
2.0	.015	1.50	1.0	3000.	.041	36.01	2000.	.026	23.11	2.386	59.13
2.0	.015	1.50	1.0	3000.	.041	36.01	2500.	.039	31.77	2.487	67.78
2.0	.015	1.50	1.0	3000.	.041	36.01	3000.	.053	40.25	2.577	76.26
2.0	.015	1.50	1.5	1334.	.000	6.65	2000.	.026	27.74	2.501	34.38
2.0	.015	1.50	1.5	1334.	.000	6.65	2500.	.039	38.12	2.622	44.77
2.0	.015	1.50	1.5	1334.	.000	6.65	3000.	.053	48.30	2.730	54.94
2.0	.015	1.50	1.5	2500.	.027	21.78	2000.	.026	27.74	2.319	49.51
2.0	.015	1.50	1.5	2500.	.027	21.78	2500.	.039	38.12	2.440	59.90
2.0	.015	1.50	1.5	2500.	.027	21.78	3000.	.053	48.30	2.548	70.07
2.0	.015	1.50	1.5	3000.	.041	27.99	2000.	.026	27.74	2.357	55.73
2.0	.015	1.50	1.5	3000.	.041	27.99	2500.	.039	38.12	2.477	66.12
2.0	.015	1.50	1.5	3000.	.041	27.99	3000.	.053	48.30	2.586	76.29
2.0	.015	1.50	2.0	1300.	.000	4.73	2000.	.026	30.82	2.602	35.55
2.0	.015	1.50	2.0	1300.	.000	4.73	2500.	.039	42.36	2.736	47.09
2.0	.015	1.50	2.0	1300.	.000	4.73	3000.	.053	53.66	2.857	58.39
2.0	.015	1.50	2.0	2500.	.028	17.47	2000.	.026	30.82	2.319	48.28
2.0	.015	1.50	2.0	2500.	.028	17.47	2500.	.039	42.36	2.453	59.82
2.0	.015	1.50	2.0	2500.	.028	17.47	3000.	.053	53.66	2.573	71.13
2.0	.015	1.50	2.0	3000.	.042	22.53	2000.	.026	30.82	2.344	53.35
2.0	.015	1.50	2.0	3000.	.042	22.53	2500.	.039	42.36	2.478	64.89
2.0	.015	1.50	2.0	3000.	.042	22.53	3000.	.053	53.66	2.599	76.20
2.0	.015	1.70	1.0	1345.	.000	8.70	2000.	.025	23.60	2.518	32.29
2.0	.015	1.70	1.0	1345.	.000	8.70	2500.	.038	32.34	2.623	41.04
2.0	.015	1.70	1.0	1345.	.000	8.70	3000.	.053	40.92	2.716	49.61
2.0	.015	1.70	1.0	2500.	.027	27.53	2000.	.025	23.60	2.339	51.13
2.0	.015	1.70	1.0	2500.	.027	27.53	2500.	.038	32.34	2.444	59.87
2.0	.015	1.70	1.0	2500.	.027	27.53	3000.	.053	40.92	2.537	68.45
2.0	.015	1.70	1.0	3000.	.041	35.35	2000.	.025	23.60	2.388	58.95
2.0	.015	1.70	1.0	3000.	.041	35.35	2500.	.038	32.34	2.494	67.69
2.0	.015	1.70	1.0	3000.	.041	35.35	3000.	.053	40.92	2.586	76.27
2.0	.015	1.70	1.5	1300.	.000	5.68	2000.	.025	28.32	2.678	34.00
2.0	.015	1.70	1.5	1300.	.000	5.68	2500.	.038	38.81	2.805	44.49
2.0	.015	1.70	1.5	1300.	.000	5.68	3000.	.053	49.10	2.916	54.78
2.0	.015	1.70	1.5	2500.	.028	20.96	2000.	.025	28.32	2.338	49.27
2.0	.015	1.70	1.5	2500.	.028	20.96	2500.	.038	38.81	2.465	59.77
2.0	.015	1.70	1.5	2500.	.028	20.96	3000.	.053	49.10	2.576	70.06
2.0	.015	1.70	1.5	3000.	.042	27.04	2000.	.025	28.32	2.369	55.36
2.0	.015	1.70	1.5	3000.	.042	27.04	2500.	.038	38.81	2.495	65.85
2.0	.015	1.70	1.5	3000.	.042	27.04	3000.	.053	49.10	2.606	76.14
2.0	.015	1.70	2.0	1255.	.000	3.57	2000.	.025	31.46	2.968	35.03
2.0	.015	1.70	2.0	1255.	.000	3.57	2500.	.038	43.12	3.109	46.69
2.0	.015	1.70	2.0	1255.	.000	3.57	3000.	.053	54.55	3.232	58.12
2.0	.015	1.70	2.0	2500.	.029	16.37	2000.	.025	31.46	2.359	47.83
2.0	.015	1.70	2.0	2500.	.029	16.37	2500.	.038	43.12	2.499	59.49
2.0	.015	1.70	2.0	2500.	.029	16.37	3000.	.053	54.55	2.623	70.92
2.0	.015	1.70	2.0	3000.	.043	21.26	2000.	.025	31.46	2.374	52.72
2.0	.015	1.70	2.0	3000.	.043	21.26	2500.	.038	43.12	2.515	64.38
2.0	.015	1.70	2.0	3000.	.043	21.26	3000.	.053	54.55	2.638	75.81

3.0	.008	1.30	1.0	1388.	.000	-2.20	2000.	.019	11.29	-1.632	9.09
3.0	.008	1.30	1.0	1388.	.000	-2.20	2500.	.032	20.54	-1.752	18.34
3.0	.008	1.30	1.0	1388.	.000	-2.20	3000.	.046	29.64	-1.753	27.44
3.0	.008	1.30	1.0	2500.	.026	17.67	2000.	.019	11.29	3.221	28.96
3.0	.008	1.30	1.0	2500.	.026	17.67	2500.	.032	20.54	3.101	38.21
3.0	.008	1.30	1.0	2500.	.026	17.67	3000.	.046	29.64	3.100	47.31
3.0	.008	1.30	1.0	3000.	.040	26.32	2000.	.019	11.29	3.129	37.61
3.0	.008	1.30	1.0	3000.	.040	26.32	2500.	.032	20.54	3.010	46.86
3.0	.008	1.30	1.0	3000.	.040	26.32	3000.	.046	29.64	3.009	55.96
3.0	.008	1.30	1.5	1367.	.000	-2.18	2000.	.019	13.55	-.218	11.37
3.0	.008	1.30	1.5	1367.	.000	-2.18	2500.	.032	24.65	-.362	22.47
3.0	.008	1.30	1.5	1367.	.000	-2.18	3000.	.046	35.57	-.363	33.39
3.0	.008	1.30	1.5	2500.	.026	13.99	2000.	.019	13.55	3.216	27.53
3.0	.008	1.30	1.5	2500.	.026	13.99	2500.	.032	24.65	3.072	38.64
3.0	.008	1.30	1.5	2500.	.026	13.99	3000.	.046	35.57	3.071	49.56
3.0	.008	1.30	1.5	3000.	.040	20.88	2000.	.019	13.55	3.133	34.43
3.0	.008	1.30	1.5	3000.	.040	20.88	2500.	.032	24.65	2.989	45.53
3.0	.008	1.30	1.5	3000.	.040	20.88	3000.	.046	35.57	2.988	56.45
3.0	.008	1.30	2.0	1345.	.000	-2.17	2000.	.019	15.05	.601	12.88
3.0	.008	1.30	2.0	1345.	.000	-2.17	2500.	.032	27.39	.441	25.22
3.0	.008	1.30	2.0	1345.	.000	-2.17	3000.	.046	39.52	.440	37.35
3.0	.008	1.30	2.0	2500.	.027	11.52	2000.	.019	15.05	3.215	26.57
3.0	.008	1.30	2.0	2500.	.027	11.52	2500.	.032	27.39	3.055	38.91
3.0	.008	1.30	2.0	2500.	.027	11.52	3000.	.046	39.52	3.054	51.04
3.0	.008	1.30	2.0	3000.	.041	17.24	2000.	.019	15.05	3.137	32.29
3.0	.008	1.30	2.0	3000.	.041	17.24	2500.	.032	27.39	2.977	44.63
3.0	.008	1.30	2.0	3000.	.041	17.24	3000.	.046	39.52	2.976	56.76
3.0	.008	1.50	1.0	1364.	.000	-2.81	2000.	.018	11.36	-1.005	8.56
3.0	.008	1.50	1.0	1364.	.000	-2.81	2500.	.031	20.63	-1.103	17.82
3.0	.008	1.50	1.0	1364.	.000	-2.81	3000.	.045	29.74	-1.097	26.93
3.0	.008	1.50	1.0	2500.	.026	17.45	2000.	.018	11.36	3.220	28.82
3.0	.008	1.50	1.0	2500.	.026	17.45	2500.	.031	20.63	3.121	38.08
3.0	.008	1.50	1.0	2500.	.026	17.45	3000.	.045	29.74	3.128	47.19
3.0	.008	1.50	1.0	3000.	.040	26.07	2000.	.018	11.36	3.114	37.43
3.0	.008	1.50	1.0	3000.	.040	26.07	2500.	.031	20.63	3.016	46.70
3.0	.008	1.50	1.0	3000.	.040	26.07	3000.	.045	29.74	3.023	55.81
3.0	.008	1.50	1.5	1330.	.000	-2.93	2000.	.018	13.64	.243	10.71
3.0	.008	1.50	1.5	1330.	.000	-2.93	2500.	.031	24.75	.124	21.82
3.0	.008	1.50	1.5	1330.	.000	-2.93	3000.	.045	35.69	.132	32.76
3.0	.008	1.50	1.5	2500.	.027	13.68	2000.	.018	13.64	3.221	27.32
3.0	.008	1.50	1.5	2500.	.027	13.68	2500.	.031	24.75	3.102	38.44
3.0	.008	1.50	1.5	2500.	.027	13.68	3000.	.045	35.69	3.111	49.37
3.0	.008	1.50	1.5	3000.	.041	20.53	2000.	.018	13.64	3.119	34.17
3.0	.008	1.50	1.5	3000.	.041	20.53	2500.	.031	24.75	3.001	45.28
3.0	.008	1.50	1.5	3000.	.041	20.53	3000.	.045	35.69	3.009	56.22
3.0	.008	1.50	2.0	1296.	.000	-3.04	2000.	.018	15.15	.937	12.11
3.0	.008	1.50	2.0	1296.	.000	-3.04	2500.	.031	27.51	.806	24.47
3.0	.008	1.50	2.0	1296.	.000	-3.04	3000.	.045	39.65	.815	36.62
3.0	.008	1.50	2.0	2500.	.028	11.13	2000.	.018	15.15	3.229	26.28
3.0	.008	1.50	2.0	2500.	.028	11.13	2500.	.031	27.51	3.097	38.63
3.0	.008	1.50	2.0	2500.	.028	11.13	3000.	.045	39.65	3.106	50.78
3.0	.008	1.50	2.0	3000.	.042	16.79	2000.	.018	15.15	3.127	31.94
3.0	.008	1.50	2.0	3000.	.042	16.79	2500.	.031	27.51	2.995	44.29
3.0	.008	1.50	2.0	3000.	.042	16.79	3000.	.045	39.65	3.005	56.44

ALTITUDE 30000.0 PRSL = 11.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.008	1.70	1.0	1341.	.000	-3.37	2000.	.018	11.42	-.635	8.05
3.0	.008	1.70	1.0	1341.	.000	-3.37	2500.	.031	20.70	-.715	17.32
3.0	.008	1.70	1.0	1341.	.000	-3.37	3000.	.045	29.82	-.702	26.45
3.0	.008	1.70	1.0	2500.	.027	17.23	2000.	.018	11.42	3.225	28.65
3.0	.008	1.70	1.0	2500.	.027	17.23	2500.	.031	20.70	3.145	37.92
3.0	.008	1.70	1.0	2500.	.027	17.23	3000.	.045	29.82	3.158	47.04
3.0	.008	1.70	1.0	3000.	.041	25.81	2000.	.018	11.42	3.105	37.23
3.0	.008	1.70	1.0	3000.	.041	25.81	2500.	.031	20.70	3.025	46.50
3.0	.008	1.70	1.0	3000.	.041	25.81	3000.	.045	29.82	3.038	55.62
3.0	.008	1.70	1.5	1296.	.000	-3.64	2000.	.018	13.71	.487	10.06
3.0	.008	1.70	1.5	1296.	.000	-3.64	2500.	.031	24.84	.390	21.19
3.0	.008	1.70	1.5	1296.	.000	-3.64	3000.	.045	35.78	.406	32.14
3.0	.008	1.70	1.5	2500.	.028	13.35	2000.	.018	13.71	3.236	27.06
3.0	.008	1.70	1.5	2500.	.028	13.35	2500.	.031	24.84	3.140	38.19
3.0	.008	1.70	1.5	2500.	.028	13.35	3000.	.045	35.78	3.156	49.13
3.0	.008	1.70	1.5	3000.	.042	20.14	2000.	.018	13.71	3.115	33.85
3.0	.008	1.70	1.5	3000.	.042	20.14	2500.	.031	24.84	3.018	44.98
3.0	.008	1.70	1.5	3000.	.042	20.14	3000.	.045	35.78	3.034	55.93
3.0	.008	1.70	2.0	1251.	.000	-3.88	2000.	.018	15.23	1.099	11.35
3.0	.008	1.70	2.0	1251.	.000	-3.88	2500.	.031	27.59	.992	23.72
3.0	.008	1.70	2.0	1251.	.000	-3.88	3000.	.045	39.76	1.010	35.88
3.0	.008	1.70	2.0	2500.	.029	10.67	2000.	.018	15.23	3.261	25.90
3.0	.008	1.70	2.0	2500.	.029	10.67	2500.	.031	27.59	3.154	38.27
3.0	.008	1.70	2.0	2500.	.029	10.67	3000.	.045	39.76	3.172	50.43
3.0	.008	1.70	2.0	3000.	.043	16.26	2000.	.018	15.23	3.132	31.49
3.0	.008	1.70	2.0	3000.	.043	16.26	2500.	.031	27.59	3.025	43.86
3.0	.008	1.70	2.0	3000.	.043	16.26	3000.	.045	39.76	3.043	56.02

1.0	.019	1.30	1.0	1337.	.000	14.65	2000.	.030	21.49	2.466	36.14
1.0	.019	1.30	1.0	1337.	.000	14.65	2500.	.044	26.87	2.660	41.52
1.0	.019	1.30	1.0	1337.	.000	14.65	3000.	.058	32.05	2.833	46.70
1.0	.019	1.30	1.0	2500.	.025	28.56	2000.	.030	21.49	2.671	50.05
1.0	.019	1.30	1.0	2500.	.025	28.56	2500.	.044	26.87	2.865	55.42
1.0	.019	1.30	1.0	2500.	.025	28.56	3000.	.058	32.05	3.039	60.60
1.0	.019	1.30	1.0	3000.	.038	34.17	2000.	.030	21.49	2.773	55.66
1.0	.019	1.30	1.0	3000.	.038	34.17	2500.	.044	26.87	2.968	61.04
1.0	.019	1.30	1.0	3000.	.038	34.17	3000.	.058	32.05	3.141	66.22
1.0	.019	1.30	1.5	1314.	.000	10.81	2000.	.030	25.79	2.562	36.60
1.0	.019	1.30	1.5	1314.	.000	10.81	2500.	.044	32.24	2.794	43.05
1.0	.019	1.30	1.5	1314.	.000	10.81	3000.	.058	38.46	3.002	49.27
1.0	.019	1.30	1.5	2500.	.025	21.76	2000.	.030	25.79	2.713	47.55
1.0	.019	1.30	1.5	2500.	.025	21.76	2500.	.044	32.24	2.946	54.00
1.0	.019	1.30	1.5	2500.	.025	21.76	3000.	.058	38.46	3.154	60.22
1.0	.019	1.30	1.5	3000.	.038	26.08	2000.	.030	25.79	2.796	51.87
1.0	.019	1.30	1.5	3000.	.038	26.08	2500.	.044	32.24	3.029	58.32
1.0	.019	1.30	1.5	3000.	.038	26.08	3000.	.058	38.46	3.237	64.54
1.0	.019	1.30	2.0	1291.	.000	8.21	2000.	.030	28.66	2.643	36.86
1.0	.019	1.30	2.0	1291.	.000	8.21	2500.	.044	35.82	2.902	44.03
1.0	.019	1.30	2.0	1291.	.000	8.21	3000.	.058	42.73	3.133	50.94
1.0	.019	1.30	2.0	2500.	.026	17.13	2000.	.030	28.66	2.754	45.79
1.0	.019	1.30	2.0	2500.	.026	17.13	2500.	.044	35.82	3.012	52.95
1.0	.019	1.30	2.0	2500.	.026	17.13	3000.	.058	42.73	3.243	59.87
1.0	.019	1.30	2.0	3000.	.039	20.57	2000.	.030	28.66	2.823	49.23
1.0	.019	1.30	2.0	3000.	.039	20.57	2500.	.044	35.82	3.081	56.39
1.0	.019	1.30	2.0	3000.	.039	20.57	3000.	.058	42.73	3.313	63.30
1.0	.019	1.50	1.0	1310.	.000	13.33	2000.	.030	24.79	2.398	38.12
1.0	.019	1.50	1.0	1310.	.000	13.33	2500.	.043	30.81	2.576	44.14
1.0	.019	1.50	1.0	1310.	.000	13.33	3000.	.058	36.65	2.733	49.98
1.0	.019	1.50	1.0	2500.	.026	26.98	2000.	.030	24.79	2.585	51.77
1.0	.019	1.50	1.0	2500.	.026	26.98	2500.	.043	30.81	2.763	57.79
1.0	.019	1.50	1.0	2500.	.026	26.98	3000.	.058	36.65	2.920	63.62
1.0	.019	1.50	1.0	3000.	.038	32.34	2000.	.030	24.79	2.688	57.13
1.0	.019	1.50	1.0	3000.	.038	32.34	2500.	.043	30.81	2.866	63.15
1.0	.019	1.50	1.0	3000.	.038	32.34	3000.	.058	36.65	3.023	68.99
1.0	.019	1.50	1.5	1274.	.000	9.10	2000.	.030	29.74	2.533	38.84
1.0	.019	1.50	1.5	1274.	.000	9.10	2500.	.043	36.97	2.747	46.07
1.0	.019	1.50	1.5	1274.	.000	9.10	3000.	.058	43.98	2.935	53.07
1.0	.019	1.50	1.5	2500.	.026	19.60	2000.	.030	29.74	2.645	49.34
1.0	.019	1.50	1.5	2500.	.026	19.60	2500.	.043	36.97	2.858	56.57
1.0	.019	1.50	1.5	2500.	.026	19.60	3000.	.058	43.98	3.047	63.57
1.0	.019	1.50	1.5	3000.	.039	23.56	2000.	.030	29.74	2.728	53.31
1.0	.019	1.50	1.5	3000.	.039	23.56	2500.	.043	36.97	2.942	60.54
1.0	.019	1.50	1.5	3000.	.039	23.56	3000.	.058	43.98	3.130	67.54
1.0	.019	1.50	2.0	1237.	.000	6.13	2000.	.030	33.05	2.715	39.18
1.0	.019	1.50	2.0	1237.	.000	6.13	2500.	.043	41.08	2.952	47.22
1.0	.019	1.50	2.0	1237.	.000	6.13	3000.	.058	48.86	3.162	55.00
1.0	.019	1.50	2.0	2500.	.027	14.37	2000.	.030	33.05	2.738	47.42
1.0	.019	1.50	2.0	2500.	.027	14.37	2500.	.043	41.08	2.976	55.45
1.0	.019	1.50	2.0	2500.	.027	14.37	3000.	.058	48.86	3.185	63.23
1.0	.019	1.50	2.0	3000.	.040	17.36	2000.	.030	33.05	2.808	50.41
1.0	.019	1.50	2.0	3000.	.040	17.36	2500.	.043	41.08	3.046	58.45
1.0	.019	1.50	2.0	3000.	.040	17.36	3000.	.058	48.86	3.255	66.23

1.0	.019	1.70	1.0	1286.	.000	12.05	2000.	.029	27.26	2.425	39.31
1.0	.019	1.70	1.0	1286.	.000	12.05	2500.	.043	33.77	2.593	45.82
1.0	.019	1.70	1.0	1286.	.000	12.05	3000.	.057	40.09	2.740	52.14
1.0	.019	1.70	1.0	2500.	.026	25.37	2000.	.029	27.26	2.584	52.63
1.0	.019	1.70	1.0	2500.	.026	25.37	2500.	.043	33.77	2.752	59.14
1.0	.019	1.70	1.0	2500.	.026	25.37	3000.	.057	40.09	2.899	65.46
1.0	.019	1.70	1.0	3000.	.039	30.47	2000.	.029	27.26	2.688	57.73
1.0	.019	1.70	1.0	3000.	.039	30.47	2500.	.043	33.77	2.856	64.24
1.0	.019	1.70	1.0	3000.	.039	30.47	3000.	.057	40.09	3.003	70.57
1.0	.019	1.70	1.5	1237.	.000	7.36	2000.	.029	32.71	2.688	40.07
1.0	.019	1.70	1.5	1237.	.000	7.36	2500.	.043	40.52	2.890	47.89
1.0	.019	1.70	1.5	1237.	.000	7.36	3000.	.057	48.11	3.066	55.47
1.0	.019	1.70	1.5	2500.	.027	17.25	2000.	.029	32.71	2.[illegible]	49.96
1.0	.019	1.70	1.5	2500.	.027	17.25	2500.	.043	40.52	2.916	57.77
1.0	.019	1.70	1.5	2500.	.027	17.25	3000.	.057	48.11	3.09[illegible]	65.36
1.0	.019	1.70	1.5	3000.	.040	20.84	2000.	.029	32.71	2.800	53.55
1.0	.019	1.70	1.5	3000.	.040	20.84	2500.	.043	40.52	3.002	61.36
1.0	.019	1.70	1.5	3000.	.040	20.84	3000.	.057	48.11	3.178	68.95
1.0	.019	1.70	2.0	1187.	.000	3.94	2000.	.029	36.34	3.273	40.28
1.0	.019	1.70	2.0	1187.	.000	3.94	2500.	.043	45.02	3.497	48.96
1.0	.019	1.70	2.0	1187.	.000	3.94	3000.	.057	53.46	3.693	57.39
1.0	.019	1.70	2.0	2500.	.028	11.18	2000.	.029	36.34	2.991	47.52
1.0	.019	1.70	2.0	2500.	.028	11.18	2500.	.043	45.02	3.215	56.21
1.0	.019	1.70	2.0	2500.	.028	11.18	3000.	.057	53.46	3.412	64.64
1.0	.019	1.70	2.0	3000.	.041	13.65	2000.	.029	36.34	3.057	50.00
1.0	.019	1.70	2.0	3000.	.041	13.65	2500.	.043	45.02	3.281	58.68
1.0	.019	1.70	2.0	3000.	.041	13.65	3000.	.057	53.46	3.478	67.11
2.0	.015	1.30	1.0	1376.	.000	8.69	2000.	.026	22.50	2.604	31.19
2.0	.015	1.30	1.0	1376.	.000	8.69	2500.	.039	31.04	2.698	39.72
2.0	.015	1.30	1.0	1376.	.000	8.69	3000.	.054	39.40	2.786	48.08
2.0	.015	1.30	1.0	2500.	.026	26.75	2000.	.026	22.50	2.415	49.26
2.0	.015	1.30	1.0	2500.	.026	26.75	2500.	.039	31.04	2.510	57.79
2.0	.015	1.30	1.0	2500.	.026	26.75	3000.	.054	39.40	2.597	66.15
2.0	.015	1.30	1.0	3000.	.039	34.46	2000.	.026	22.50	2.460	56.96
2.0	.015	1.30	1.0	3000.	.039	34.46	2500.	.039	31.04	2.555	65.50
2.0	.015	1.30	1.0	3000.	.039	34.46	3000.	.054	39.40	2.642	73.86
2.0	.015	1.30	1.5	1354.	.000	6.39	2000.	.026	27.00	2.610	33.39
2.0	.015	1.30	1.5	1354.	.000	6.39	2500.	.039	37.25	2.724	43.63
2.0	.015	1.30	1.5	1354.	.000	6.39	3000.	.054	47.28	2.829	53.66
2.0	.015	1.30	1.5	2500.	.026	20.99	2000.	.026	27.00	2.385	47.99
2.0	.015	1.30	1.5	2500.	.026	20.99	2500.	.039	37.25	2.498	58.23
2.0	.015	1.30	1.5	2500.	.026	20.99	3000.	.054	47.28	2.603	68.26
2.0	.015	1.30	1.5	3000.	.040	27.09	2000.	.026	27.00	2.417	54.09
2.0	.015	1.30	1.5	3000.	.040	27.09	2500.	.039	37.25	2.530	64.33
2.0	.015	1.30	1.5	3000.	.040	27.09	3000.	.054	47.28	2.635	74.36
2.0	.015	1.30	2.0	1332.	.000	4.84	2000.	.026	30.00	2.637	34.84
2.0	.015	1.30	2.0	1332.	.000	4.84	2500.	.039	41.38	2.763	46.22
2.0	.015	1.30	2.0	1332.	.000	4.84	3000.	.054	52.53	2.880	57.37
2.0	.015	1.30	2.0	2500.	.027	17.10	2000.	.026	30.00	2.368	47.11
2.0	.015	1.30	2.0	2500.	.027	17.10	2500.	.039	41.38	2.494	58.49
2.0	.015	1.30	2.0	2500.	.027	17.10	3000.	.054	52.53	2.610	69.63
2.0	.015	1.30	2.0	3000.	.040	22.12	2000.	.026	30.00	2.391	52.13
2.0	.015	1.30	2.0	3000.	.040	22.12	2500.	.039	41.38	2.517	63.51
2.0	.015	1.30	2.0	3000.	.040	22.12	3000.	.054	52.53	2.633	74.65

2.0	.015	1.50	1.0	1351.	.000	7.87	2000.	.026	23.11	2.818	39.64
2.0	.015	1.50	1.0	1351.	.000	7.87	2500.	.039	31.77	2.818	39.64
2.0	.015	1.50	1.0	1351.	.000	7.87	3000.	.053	40.25	2.909	48.12
2.0	.015	1.50	1.0	2500.	.026	26.15	2000.	.026	23.11	2.419	49.26
2.0	.015	1.50	1.0	2500.	.026	26.15	2500.	.039	31.77	2.520	57.91
2.0	.015	1.50	1.0	2500.	.026	26.15	3000.	.053	40.25	2.610	66.39
2.0	.015	1.50	1.0	3000.	.040	33.76	2000.	.026	23.11	2.458	56.87
2.0	.015	1.50	1.0	3000.	.040	33.76	2500.	.039	31.77	2.559	65.52
2.0	.015	1.50	1.0	3000.	.040	33.76	3000.	.053	40.25	2.649	74.00
2.0	.015	1.50	1.5	1316.	.000	5.36	2000.	.026	27.74	2.814	33.10
2.0	.015	1.50	1.5	1316.	.000	5.36	2500.	.039	38.12	2.935	43.48
2.0	.015	1.50	1.5	1316.	.000	5.36	3000.	.053	48.30	3.043	53.66
2.0	.015	1.50	1.5	2500.	.027	20.15	2000.	.026	27.74	2.398	47.89
2.0	.015	1.50	1.5	2500.	.027	20.15	2500.	.039	38.12	2.519	58.28
2.0	.015	1.50	1.5	2500.	.027	20.15	3000.	.053	48.30	2.627	68.45
2.0	.015	1.50	1.5	3000.	.041	26.12	2000.	.026	27.74	2.422	53.86
2.0	.015	1.50	1.5	3000.	.041	26.12	2500.	.039	38.12	2.543	64.24
2.0	.015	1.50	1.5	3000.	.041	26.12	3000.	.053	48.30	2.651	74.42
2.0	.015	1.50	2.0	1281.	.000	3.63	2000.	.026	30.82	2.989	34.45
2.0	.015	1.50	2.0	1281.	.000	3.63	2500.	.039	42.36	3.123	45.99
2.0	.015	1.50	2.0	1281.	.000	3.63	3000.	.053	53.66	3.243	57.29
2.0	.015	1.50	2.0	2500.	.028	16.05	2000.	.026	30.82	2.396	46.87
2.0	.015	1.50	2.0	2500.	.028	16.05	2500.	.039	42.36	2.530	58.41
2.0	.015	1.50	2.0	2500.	.028	16.05	3000.	.053	53.66	2.651	69.71
2.0	.015	1.50	2.0	3000.	.041	20.90	2000.	.026	30.82	2.408	51.72
2.0	.015	1.50	2.0	3000.	.041	20.90	2500.	.039	42.36	2.542	63.26
2.0	.015	1.50	2.0	3000.	.041	20.90	3000.	.053	53.66	2.663	74.56
2.0	.015	1.70	1.0	1328.	.000	7.10	2000.	.025	23.60	2.867	30.70
2.0	.015	1.70	1.0	1328.	.000	7.10	2500.	.038	32.34	2.973	39.44
2.0	.015	1.70	1.0	1328.	.000	7.10	3000.	.053	40.92	3.065	48.02
2.0	.015	1.70	1.0	2500.	.027	25.53	2000.	.025	23.60	2.433	49.12
2.0	.015	1.70	1.0	2500.	.027	25.53	2500.	.038	32.34	2.539	57.87
2.0	.015	1.70	1.0	2500.	.027	25.53	3000.	.053	40.92	2.631	66.44
2.0	.015	1.70	1.0	3000.	.040	33.04	2000.	.025	23.60	2.466	56.64
2.0	.015	1.70	1.0	3000.	.040	33.04	2500.	.038	32.34	2.572	65.38
2.0	.015	1.70	1.0	3000.	.040	33.04	3000.	.053	40.92	2.665	73.95
2.0	.015	1.70	1.5	1282.	.000	4.36	2000.	.025	28.32	3.142	32.67
2.0	.015	1.70	1.5	1282.	.000	4.36	2500.	.038	38.81	3.269	43.17
2.0	.015	1.70	1.5	1282.	.000	4.36	3000.	.053	49.10	3.380	53.45
2.0	.015	1.70	1.5	2500.	.028	19.26	2000.	.025	28.32	2.431	47.58
2.0	.015	1.70	1.5	2500.	.028	19.26	2500.	.038	38.81	2.558	58.07
2.0	.015	1.70	1.5	2500.	.028	19.26	3000.	.053	49.10	2.669	68.36
2.0	.015	1.70	1.5	3000.	.041	25.08	2000.	.025	28.32	2.446	53.40
2.0	.015	1.70	1.5	3000.	.041	25.08	2500.	.038	38.81	2.572	63.89
2.0	.015	1.70	1.5	3000.	.041	25.08	3000.	.053	49.10	2.683	74.18
2.0	.015	1.70	2.0	1235.	.000	2.41	2000.	.025	31.46	3.778	33.87
2.0	.015	1.70	2.0	1235.	.000	2.41	2500.	.038	43.12	3.919	45.53
2.0	.015	1.70	2.0	1235.	.000	2.41	3000.	.053	54.55	4.042	56.96
2.0	.015	1.70	2.0	2500.	.029	14.85	2000.	.025	31.46	2.459	46.31
2.0	.015	1.70	2.0	2500.	.029	14.85	2500.	.038	43.12	2.599	57.97
2.0	.015	1.70	2.0	2500.	.029	14.85	3000.	.053	54.55	2.723	69.40
2.0	.015	1.70	2.0	3000.	.042	19.50	2000.	.025	31.46	2.456	50.96
2.0	.015	1.70	2.0	3000.	.042	19.50	2500.	.038	43.12	2.597	62.63
2.0	.015	1.70	2.0	3000.	.042	19.50	3000.	.053	54.55	2.720	74.06

3.0	.008	1.30	1.0	1378.	.000	-3.18	2000.	.019	11.29	-.662	8.10
3.0	.008	1.30	1.0	1378.	.000	-3.18	2500.	.032	20.54	-.782	17.36
3.0	.008	1.30	1.0	1378.	.000	-3.18	3000.	.046	29.64	-.782	26.46
3.0	.008	1.30	1.0	2500.	.026	16.49	2000.	.019	11.29	3.329	27.78
3.0	.008	1.30	1.0	2500.	.026	16.49	2500.	.032	20.54	3.210	37.03
3.0	.008	1.30	1.0	2500.	.026	16.49	3000.	.046	29.64	3.209	46.13
3.0	.008	1.30	1.0	3000.	.039	24.96	2000.	.019	11.29	3.199	36.25
3.0	.008	1.30	1.0	3000.	.039	24.96	2500.	.032	20.54	3.079	45.50
3.0	.008	1.30	1.0	3000.	.039	24.96	3000.	.046	29.64	3.078	54.60
3.0	.008	1.30	1.5	1356.	.000	-2.97	2000.	.019	13.55	.324	10.58
3.0	.008	1.30	1.5	1356.	.000	-2.97	2500.	.032	24.65	.180	21.68
3.0	.008	1.30	1.5	1356.	.000	-2.97	3000.	.046	35.57	.179	32.60
3.0	.008	1.30	1.5	2500.	.026	13.03	2000.	.019	13.55	3.307	26.58
3.0	.008	1.30	1.5	2500.	.026	13.03	2500.	.032	24.65	3.163	37.68
3.0	.008	1.30	1.5	2500.	.026	13.03	3000.	.046	35.57	3.163	48.60
3.0	.008	1.30	1.5	3000.	.040	19.78	2000.	.019	13.55	3.191	33.33
3.0	.008	1.30	1.5	3000.	.040	19.78	2500.	.032	24.65	3.047	44.43
3.0	.008	1.30	1.5	3000.	.040	19.78	3000.	.046	35.57	3.047	55.35
3.0	.008	1.30	2.0	1334.	.000	-2.84	2000.	.019	15.05	.933	12.21
3.0	.008	1.30	2.0	1334.	.000	-2.84	2500.	.032	27.39	.773	24.55
3.0	.008	1.30	2.0	1334.	.000	-2.84	3000.	.046	39.52	.772	36.68
3.0	.008	1.30	2.0	2500.	.027	10.71	2000.	.019	15.05	3.295	25.76
3.0	.008	1.30	2.0	2500.	.027	10.71	2500.	.032	27.39	3.135	38.10
3.0	.008	1.30	2.0	2500.	.027	10.71	3000.	.046	39.52	3.134	50.23
3.0	.008	1.30	2.0	3000.	.040	16.31	2000.	.019	15.05	3.188	31.36
3.0	.008	1.30	2.0	3000.	.040	16.31	2500.	.032	27.39	3.028	43.70
3.0	.008	1.30	2.0	3000.	.040	16.31	3000.	.046	39.52	3.027	55.83
3.0	.008	1.50	1.0	1352.	.000	-3.80	2000.	.018	11.36	-.361	7.57
3.0	.008	1.50	1.0	1352.	.000	-3.80	2500.	.031	20.63	-.460	16.83
3.0	.008	1.50	1.0	1352.	.000	-3.80	3000.	.045	29.74	-.453	25.94
3.0	.008	1.50	1.0	2500.	.026	16.26	2000.	.018	11.36	3.335	27.62
3.0	.008	1.50	1.0	2500.	.026	16.26	2500.	.031	20.63	3.236	36.89
3.0	.008	1.50	1.0	2500.	.026	16.26	3000.	.045	29.74	3.243	46.00
3.0	.008	1.50	1.0	3000.	.040	24.69	2000.	.018	11.36	3.188	36.05
3.0	.008	1.50	1.0	3000.	.040	24.69	2500.	.031	20.63	3.089	45.32
3.0	.008	1.50	1.0	3000.	.040	24.69	3000.	.045	29.74	3.096	54.43
3.0	.008	1.50	1.5	1318.	.000	-3.73	2000.	.018	13.64	.568	9.90
3.0	.008	1.50	1.5	1318.	.000	-3.73	2500.	.031	24.75	.450	21.02
3.0	.008	1.50	1.5	1318.	.000	-3.73	3000.	.045	35.69	.458	31.96
3.0	.008	1.50	1.5	2500.	.027	12.71	2000.	.018	13.64	3.322	26.35
3.0	.008	1.50	1.5	2500.	.027	12.71	2500.	.031	24.75	3.203	37.47
3.0	.008	1.50	1.5	2500.	.027	12.71	3000.	.045	35.69	3.211	48.40
3.0	.008	1.50	1.5	3000.	.040	19.41	2000.	.018	13.64	3.183	33.04
3.0	.008	1.50	1.5	3000.	.040	19.41	2500.	.031	24.75	3.064	44.16
3.0	.008	1.50	1.5	3000.	.040	19.41	3000.	.045	35.69	3.072	55.10
3.0	.008	1.50	2.0	1283.	.000	-3.72	2000.	.018	15.15	1.123	11.44
3.0	.008	1.50	2.0	1283.	.000	-3.72	2500.	.031	27.51	.991	23.79
3.0	.008	1.50	2.0	1283.	.000	-3.72	3000.	.045	39.65	1.000	35.94
3.0	.008	1.50	2.0	2500.	.028	10.30	2000.	.018	15.15	3.322	25.45
3.0	.008	1.50	2.0	2500.	.028	10.30	2500.	.031	27.51	3.190	37.80
3.0	.008	1.50	2.0	2500.	.028	10.30	3000.	.045	39.65	3.199	49.95
3.0	.008	1.50	2.0	3000.	.041	15.83	2000.	.018	15.15	3.185	30.98
3.0	.008	1.50	2.0	3000.	.041	15.83	2500.	.031	27.51	3.053	43.33
3.0	.008	1.50	2.0	3000.	.041	15.83	3000.	.045	39.65	3.063	55.48

ALTITUDE 60000.0 PRSL = 11.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.008	1.70	1.0	1330.	.000	-4.37	2000.	.018	11.42	-.165	7.05
3.0	.008	1.70	1.0	1330.	.000	-4.37	2500.	.031	20.70	-.246	16.32
3.0	.008	1.70	1.0	1330.	.000	-4.37	3000.	.045	29.82	-.232	25.45
3.0	.008	1.70	1.0	2500.	.027	16.02	2000.	.018	11.42	3.347	27.44
3.0	.008	1.70	1.0	2500.	.027	16.02	2500.	.031	20.70	3.266	36.72
3.0	.008	1.70	1.0	2500.	.027	16.02	3000.	.045	29.82	3.280	45.84
3.0	.008	1.70	1.0	3000.	.040	24.41	2000.	.018	11.42	3.182	35.83
3.0	.008	1.70	1.0	3000.	.040	24.41	2500.	.031	20.70	3.102	45.11
3.0	.008	1.70	1.0	3000.	.040	24.41	3000.	.045	29.82	3.116	54.23
3.0	.008	1.70	1.5	1284.	.000	-4.46	2000.	.018	13.71	.709	9.25
3.0	.008	1.70	1.5	1284.	.000	-4.46	2500.	.031	24.84	.613	20.38
3.0	.008	1.70	1.5	1284.	.000	-4.46	3000.	.045	35.78	.629	31.32
3.0	.008	1.70	1.5	2500.	.028	12.36	2000.	.018	13.71	3.348	26.06
3.0	.008	1.70	1.5	2500.	.028	12.36	2500.	.031	24.84	3.252	37.19
3.0	.008	1.70	1.5	2500.	.028	12.36	3000.	.045	35.78	3.268	49.14
3.0	.008	1.70	1.5	3000.	.041	19.00	2000.	.018	13.71	3.184	32.70
3.0	.008	1.70	1.5	3000.	.041	19.00	2500.	.031	24.84	3.088	43.83
3.0	.008	1.70	1.5	3000.	.041	19.00	3000.	.045	35.78	3.104	54.78
3.0	.008	1.70	2.0	1237.	.000	-4.57	2000.	.018	15.23	1.220	10.66
3.0	.008	1.70	2.0	1237.	.000	-4.57	2500.	.031	27.59	1.113	23.02
3.0	.008	1.70	2.0	1237.	.000	-4.57	3000.	.045	39.76	1.130	35.18
3.0	.008	1.70	2.0	2500.	.029	9.81	2000.	.018	15.23	3.371	25.04
3.0	.008	1.70	2.0	2500.	.029	9.81	2500.	.031	27.59	3.263	37.41
3.0	.008	1.70	2.0	2500.	.029	9.81	3000.	.045	39.76	3.281	49.57
3.0	.008	1.70	2.0	3000.	.042	15.27	2000.	.018	15.23	3.199	30.50
3.0	.008	1.70	2.0	3000.	.042	15.27	2500.	.031	27.59	3.092	42.86
3.0	.008	1.70	2.0	3000.	.042	15.27	3000.	.045	39.76	3.110	55.02

1.0	.021	1.30	1.0	1273.	.000	8.74	2000.	.032	21.59	3.498	30.33
1.0	.021	1.30	1.0	1273.	.000	8.74	2500.	.047	27.04	3.707	35.78
1.0	.021	1.30	1.0	1273.	.000	8.74	3000.	.063	32.33	3.894	41.07
1.0	.021	1.30	1.0	2500.	.026	20.58	2000.	.032	21.59	3.382	42.17
1.0	.021	1.30	1.0	2500.	.026	20.58	2500.	.047	27.04	3.591	47.62
1.0	.021	1.30	1.0	2500.	.026	20.58	3000.	.063	32.33	3.778	52.91
1.0	.021	1.30	1.0	3000.	.038	25.06	2000.	.032	21.59	3.462	46.66
1.0	.021	1.30	1.0	3000.	.038	25.06	2500.	.047	27.04	3.672	52.11
1.0	.021	1.30	1.0	3000.	.038	25.06	3000.	.063	32.33	3.858	57.39
1.0	.021	1.30	1.5	1247.	.000	5.89	2000.	.032	25.91	3.660	31.80
1.0	.021	1.30	1.5	1247.	.000	5.89	2500.	.047	32.45	3.911	38.34
1.0	.021	1.30	1.5	1247.	.000	5.89	3000.	.063	38.79	4.135	44.69
1.0	.021	1.30	1.5	2500.	.026	14.98	2000.	.032	25.91	3.427	40.89
1.0	.021	1.30	1.5	2500.	.026	14.98	2500.	.047	32.45	3.678	47.43
1.0	.021	1.30	1.5	2500.	.026	14.98	3000.	.063	38.79	3.902	53.77
1.0	.021	1.30	1.5	3000.	.038	18.33	2000.	.032	25.91	3.486	44.24
1.0	.021	1.30	1.5	3000.	.038	18.33	2500.	.047	32.45	3.737	50.78
1.0	.021	1.30	1.5	3000.	.038	18.33	3000.	.063	38.79	3.962	57.12
1.0	.021	1.30	2.0	1222.	.000	3.92	2000.	.032	28.79	3.928	32.71
1.0	.021	1.30	2.0	1222.	.000	3.92	2500.	.047	36.06	4.207	39.98
1.0	.021	1.30	2.0	1222.	.000	3.92	3000.	.063	43.10	4.456	47.03
1.0	.021	1.30	2.0	2500.	.027	11.09	2000.	.032	28.79	3.513	39.88
1.0	.021	1.30	2.0	2500.	.027	11.09	2500.	.047	36.06	3.792	47.15
1.0	.021	1.30	2.0	2500.	.027	11.09	3000.	.063	43.10	4.041	54.20
1.0	.021	1.30	2.0	3000.	.039	13.65	2000.	.032	28.79	3.555	42.45
1.0	.021	1.30	2.0	3000.	.039	13.65	2500.	.047	36.06	3.834	49.71
1.0	.021	1.30	2.0	3000.	.039	13.65	3000.	.063	43.10	4.083	56.76
1.0	.021	1.50	1.0	1243.	.000	7.14	2000.	.032	24.90	3.779	32.05
1.0	.021	1.50	1.0	1243.	.000	7.14	2500.	.046	31.02	3.970	38.16
1.0	.021	1.50	1.0	1243.	.000	7.14	3000.	.062	36.97	4.140	44.12
1.0	.021	1.50	1.0	2500.	.026	18.42	2000.	.032	24.90	3.449	43.32
1.0	.021	1.50	1.0	2500.	.026	18.42	2500.	.046	31.02	3.641	49.44
1.0	.021	1.50	1.0	2500.	.026	18.42	3000.	.062	36.97	3.810	55.39
1.0	.021	1.50	1.0	3000.	.038	22.55	2000.	.032	24.90	3.523	47.45
1.0	.021	1.50	1.0	3000.	.038	22.55	2500.	.046	31.02	3.714	53.57
1.0	.021	1.50	1.0	3000.	.038	22.55	3000.	.062	36.97	3.883	59.52
1.0	.021	1.50	1.5	1203.	.000	3.78	2000.	.032	29.88	4.562	33.66
1.0	.021	1.50	1.5	1203.	.000	3.78	2500.	.046	37.22	4.791	41.00
1.0	.021	1.50	1.5	1203.	.000	3.78	3000.	.062	44.37	4.995	48.14
1.0	.021	1.50	1.5	2500.	.027	11.95	2000.	.032	29.88	3.686	41.84
1.0	.021	1.50	1.5	2500.	.027	11.95	2500.	.046	37.22	3.916	49.17
1.0	.021	1.50	1.5	2500.	.027	11.95	3000.	.062	44.37	4.119	56.32
1.0	.021	1.50	1.5	3000.	.039	14.81	2000.	.032	29.88	3.725	44.69
1.0	.021	1.50	1.5	3000.	.039	14.81	2500.	.046	37.22	3.955	52.03
1.0	.021	1.50	1.5	3000.	.039	14.81	3000.	.062	44.37	4.158	59.17
1.0	.021	1.50	2.0	1162.	.000	1.42	2000.	.032	33.20	7.418	34.62
1.0	.021	1.50	2.0	1162.	.000	1.42	2500.	.046	41.36	7.673	42.77
1.0	.021	1.50	2.0	1162.	.000	1.42	3000.	.062	49.30	7.899	50.71
1.0	.021	1.50	2.0	2500.	.028	7.43	2000.	.032	33.20	4.151	40.64
1.0	.021	1.50	2.0	2500.	.028	7.43	2500.	.046	41.36	4.406	48.79
1.0	.021	1.50	2.0	2500.	.028	7.43	3000.	.062	49.30	4.632	56.73
1.0	.021	1.50	2.0	3000.	.040	9.41	2000.	.032	33.20	4.130	42.41
1.0	.021	1.50	2.0	3000.	.040	9.41	2500.	.046	41.36	4.385	50.77
1.0	.021	1.50	2.0	3000.	.040	9.41	3000.	.062	49.30	4.611	58.71

1.0	.021	1.70	1.0	1216.	.000	5.57	2000.	.031	27.38	4.403	32.93
1.0	.021	1.70	1.0	1216.	.000	5.57	2500.	.046	34.00	4.583	39.56
1.0	.021	1.70	1.0	1216.	.000	5.57	3000.	.062	40.45	4.741	46.02
1.0	.021	1.70	1.0	2500.	.027	16.18	2000.	.031	27.38	3.676	43.54
1.0	.021	1.70	1.0	2500.	.027	16.18	2500.	.046	34.00	3.856	50.17
1.0	.021	1.70	1.0	2500.	.027	16.18	3000.	.062	40.45	4.015	56.63
1.0	.021	1.70	1.0	3000.	.039	19.94	2000.	.031	27.38	3.736	47.33
1.0	.021	1.70	1.0	3000.	.039	19.94	2500.	.046	34.00	3.916	53.94
1.0	.021	1.70	1.0	3000.	.039	19.94	3000.	.062	40.45	4.075	60.40
1.0	.021	1.70	1.5	1162.	.000	1.70	2000.	.031	32.86	8.282	34.56
1.0	.021	1.70	1.5	1162.	.000	1.70	2500.	.046	40.80	8.498	42.50
1.0	.021	1.70	1.5	1162.	.000	1.70	3000.	.062	48.54	8.688	50.25
1.0	.021	1.70	1.5	2500.	.028	8.92	2000.	.031	32.86	4.373	41.78
1.0	.021	1.70	1.5	2500.	.028	8.92	2500.	.046	40.80	4.590	49.72
1.0	.021	1.70	1.5	2500.	.028	8.92	3000.	.062	48.54	4.780	57.41
1.0	.021	1.70	1.5	3000.	.040	11.30	2000.	.031	32.86	4.348	44.16
1.0	.021	1.70	1.5	3000.	.040	11.30	2500.	.046	40.80	4.565	52.09
1.0	.021	1.70	1.5	3000.	.040	11.30	3000.	.062	48.54	4.755	59.84
1.0	.021	1.70	2.0	1107.	.000	-1.27	2000.	.031	36.51	-5.163	35.24
1.0	.021	1.70	2.0	1107.	.000	-1.27	2500.	.046	45.33	-4.923	44.06
1.0	.021	1.70	2.0	1107.	.000	-1.27	3000.	.062	53.94	-4.711	52.66
1.0	.021	1.70	2.0	2500.	.029	3.65	2000.	.031	36.51	6.808	40.16
1.0	.021	1.70	2.0	2500.	.029	3.65	2500.	.046	45.33	7.049	48.98
1.0	.021	1.70	2.0	2500.	.029	3.65	3000.	.062	53.94	7.260	57.59
1.0	.021	1.70	2.0	3000.	.041	5.19	2000.	.031	36.51	6.156	41.70
1.0	.021	1.70	2.0	3000.	.041	5.19	2500.	.046	45.33	6.397	50.52
1.0	.021	1.70	2.0	3000.	.041	5.19	3000.	.062	53.94	6.608	59.13
2.0	.016	1.30	1.0	1350.	.000	6.27	2000.	.028	22.66	3.423	28.93
2.0	.016	1.30	1.0	1350.	.000	6.27	2500.	.042	31.34	3.524	37.60
2.0	.016	1.30	1.0	1350.	.000	6.27	3000.	.058	39.88	3.618	46.15
2.0	.016	1.30	1.0	2500.	.027	23.92	2000.	.028	22.66	2.732	46.58
2.0	.016	1.30	1.0	2500.	.027	23.92	2500.	.042	31.34	2.833	55.26
2.0	.016	1.30	1.0	2500.	.027	23.92	3000.	.058	39.88	2.927	63.81
2.0	.016	1.30	1.0	3000.	.041	31.31	2000.	.028	22.66	2.749	53.97
2.0	.016	1.30	1.0	3000.	.041	31.31	2500.	.042	31.34	2.851	62.65
2.0	.016	1.30	1.0	3000.	.041	31.31	3000.	.058	39.88	2.945	71.20
2.0	.016	1.30	1.5	1327.	.000	4.42	2000.	.028	27.19	3.430	31.61
2.0	.016	1.30	1.5	1327.	.000	4.42	2500.	.042	37.61	3.551	42.03
2.0	.016	1.30	1.5	1327.	.000	4.42	3000.	.058	47.86	3.664	52.28
2.0	.016	1.30	1.5	2500.	.027	18.66	2000.	.028	27.19	2.678	45.85
2.0	.016	1.30	1.5	2500.	.027	18.66	2500.	.042	37.61	2.800	56.27
2.0	.016	1.30	1.5	2500.	.027	18.66	3000.	.058	47.86	2.912	66.52
2.0	.016	1.30	1.5	3000.	.041	24.50	2000.	.028	27.19	2.686	51.69
2.0	.016	1.30	1.5	3000.	.041	24.50	2500.	.042	37.61	2.807	62.10
2.0	.016	1.30	1.5	3000.	.041	24.50	3000.	.058	47.86	2.920	72.36
2.0	.016	1.30	2.0	1304.	.000	3.17	2000.	.028	30.21	3.512	33.38
2.0	.016	1.30	2.0	1304.	.000	3.17	2500.	.042	41.78	3.647	44.95
2.0	.016	1.30	2.0	1304.	.000	3.17	3000.	.058	53.18	3.772	56.35
2.0	.016	1.30	2.0	2500.	.028	15.11	2000.	.028	30.21	2.648	45.32
2.0	.016	1.30	2.0	2500.	.028	15.11	2500.	.042	41.78	2.783	56.90
2.0	.016	1.30	2.0	2500.	.028	15.11	3000.	.058	53.18	2.908	68.29
2.0	.016	1.30	2.0	3000.	.042	19.90	2000.	.028	30.21	2.648	50.11
2.0	.016	1.30	2.0	3000.	.042	19.90	2500.	.042	41.78	2.783	61.69
2.0	.016	1.30	2.0	3000.	.042	19.90	3000.	.058	53.18	2.908	73.08

2.0	.016	1.50	1.0	1324.	.000	5.41	2000.	.027	23.27	3.740	28.68
2.0	.016	1.50	1.0	1324.	.000	5.41	2500.	.042	32.07	3.847	37.48
2.0	.016	1.50	1.0	1324.	.000	5.41	3000.	.057	40.74	3.944	46.15
2.0	.016	1.50	1.0	2500.	.028	23.23	2000.	.027	23.27	2.753	46.50
2.0	.016	1.50	1.0	2500.	.028	23.23	2500.	.042	32.07	2.861	55.30
2.0	.016	1.50	1.0	2500.	.028	23.23	3000.	.057	40.74	2.957	63.97
2.0	.016	1.50	1.0	3000.	.042	30.51	2000.	.027	23.27	2.761	53.78
2.0	.016	1.50	1.0	3000.	.042	30.51	2500.	.042	32.07	2.869	62.58
2.0	.016	1.50	1.0	3000.	.042	30.51	3000.	.057	40.74	2.966	71.24
2.0	.016	1.50	1.5	1287.	.000	3.33	2000.	.027	27.93	4.056	31.26
2.0	.016	1.50	1.5	1287.	.000	3.33	2500.	.042	38.48	4.186	41.82
2.0	.016	1.50	1.5	1287.	.000	3.33	3000.	.057	48.88	4.302	52.22
2.0	.016	1.50	1.5	2500.	.028	17.71	2000.	.027	27.93	2.719	45.64
2.0	.016	1.50	1.5	2500.	.028	17.71	2500.	.042	38.48	2.848	56.19
2.0	.016	1.50	1.5	2500.	.028	17.71	3000.	.057	48.88	2.964	66.59
2.0	.016	1.50	1.5	3000.	.042	23.39	2000.	.027	27.93	2.713	51.31
2.0	.016	1.50	1.5	3000.	.042	23.39	2500.	.042	38.48	2.842	61.87
2.0	.016	1.50	1.5	3000.	.042	23.39	3000.	.057	48.88	2.958	72.27
2.0	.016	1.50	2.0	1251.	.000	1.88	2000.	.027	31.03	4.840	32.91
2.0	.016	1.50	2.0	1251.	.000	1.88	2500.	.042	42.76	4.984	44.64
2.0	.016	1.50	2.0	1251.	.000	1.88	3000.	.057	54.32	5.113	56.20
2.0	.016	1.50	2.0	2500.	.029	13.89	2000.	.027	31.03	2.717	44.92
2.0	.016	1.50	2.0	2500.	.029	13.89	2500.	.042	42.76	2.861	56.65
2.0	.016	1.50	2.0	2500.	.029	13.89	3000.	.057	54.32	2.990	68.21
2.0	.016	1.50	2.0	3000.	.043	18.48	2000.	.027	31.03	2.697	49.51
2.0	.016	1.50	2.0	3000.	.043	18.48	2500.	.042	42.76	2.841	61.24
2.0	.016	1.50	2.0	3000.	.043	18.48	3000.	.057	54.32	2.970	72.80
2.0	.016	1.70	1.0	1300.	.000	4.59	2000.	.027	23.75	4.177	28.34
2.0	.016	1.70	1.0	1300.	.000	4.59	2500.	.041	32.65	4.290	37.24
2.0	.016	1.70	1.0	1300.	.000	4.59	3000.	.057	41.41	4.390	[illegible]00
2.0	.016	1.70	1.0	2500.	.028	22.52	2000.	.027	23.75	2.787	46.28
2.0	.016	1.70	1.0	2500.	.028	22.52	2500.	.041	32.65	2.900	55.17
2.0	.016	1.70	1.0	2500.	.028	22.52	3000.	.057	41.41	2.999	63.93
2.0	.016	1.70	1.0	3000.	.042	29.68	2000.	.027	23.75	2.785	53.44
2.0	.016	1.70	1.0	3000.	.042	29.68	2500.	.041	32.65	2.898	62.33
2.0	.016	1.70	1.0	3000.	.042	29.68	3000.	.057	41.41	2.997	71.09
2.0	.016	1.70	1.5	1251.	.000	2.26	2000.	.027	28.50	5.333	30.76
2.0	.016	1.70	1.5	1251.	.000	2.26	2500.	.041	39.17	5.469	41.43
2.0	.016	1.70	1.5	1251.	.000	2.26	3000.	.057	49.69	5.588	51.95
2.0	.016	1.70	1.5	2500.	.029	16.67	2000.	.027	28.50	2.788	45.18
2.0	.016	1.70	1.5	2500.	.029	16.67	2500.	.041	39.17	2.924	55.85
2.0	.016	1.70	1.5	2500.	.029	16.67	3000.	.057	49.69	3.043	66.36
2.0	.016	1.70	1.5	3000.	.043	22.18	2000.	.027	28.50	2.765	50.68
2.0	.016	1.70	1.5	3000.	.043	22.18	2500.	.041	39.17	2.900	61.36
2.0	.016	1.70	1.5	3000.	.043	22.18	3000.	.057	49.69	3.019	71.87
2.0	.016	1.70	2.0	1203.	.000	.56	2000.	.027	31.67	12.830	32.23
2.0	.016	1.70	2.0	1203.	.000	.56	2500.	.041	43.53	12.981	44.09
2.0	.016	1.70	2.0	1203.	.000	.56	3000.	.057	55.21	13.113	55.77
2.0	.016	1.70	2.0	2500.	.030	12.48	2000.	.027	31.67	2.845	44.15
2.0	.016	1.70	2.0	2500.	.030	12.48	2500.	.041	43.53	2.995	56.01
2.0	.016	1.70	2.0	2500.	.030	12.48	3000.	.057	55.21	3.128	67.69
2.0	.016	1.70	2.0	3000.	.044	16.84	2000.	.027	31.67	2.795	48.51
2.0	.016	1.70	2.0	3000.	.044	16.84	2500.	.041	43.53	2.946	60.37
2.0	.016	1.70	2.0	3000.	.044	16.84	3000.	.057	55.21	3.078	72.05

3.0	.008	1.30	1.0	1360.	.000	-4.72	2000.	.020	11.42	.031	6.70
3.0	.008	1.30	1.0	1360.	.000	-4.72	2500.	.034	20.82	-.094	16.10
3.0	.008	1.30	1.0	1360.	.000	-4.72	3000.	.049	30.11	-.093	25.39
3.0	.008	1.30	1.0	2500.	.027	14.85	2000.	.020	11.42	3.740	26.27
3.0	.008	1.30	1.0	2500.	.027	14.85	2500.	.034	20.82	3.616	35.67
3.0	.008	1.30	1.0	2500.	.027	14.85	3000.	.049	30.11	3.616	44.96
3.0	.008	1.30	1.0	3000.	.041	23.19	2000.	.020	11.42	3.520	34.61
3.0	.008	1.30	1.0	3000.	.041	23.19	2500.	.034	20.82	3.395	44.01
3.0	.008	1.30	1.0	3000.	.041	23.19	3000.	.049	30.11	3.396	53.30
3.0	.008	1.30	1.5	1338.	.000	-4.21	2000.	.020	13.70	.794	9.49
3.0	.008	1.30	1.5	1338.	.000	-4.21	2500.	.034	24.98	.645	20.77
3.0	.008	1.30	1.5	1338.	.000	-4.21	3000.	.049	36.13	.645	31.92
3.0	.008	1.30	1.5	2500.	.028	11.71	2000.	.020	13.70	3.683	25.41
3.0	.008	1.30	1.5	2500.	.028	11.71	2500.	.034	24.98	3.533	36.69
3.0	.008	1.30	1.5	2500.	.028	11.71	3000.	.049	36.13	3.534	47.84
3.0	.008	1.30	1.5	3000.	.042	18.35	2000.	.020	13.70	3.490	32.05
3.0	.008	1.30	1.5	3000.	.042	18.35	2500.	.034	24.98	3.340	43.33
3.0	.008	1.30	1.5	3000.	.042	18.35	3000.	.049	36.13	3.341	54.49
3.0	.008	1.30	2.0	1316.	.000	-3.88	2000.	.020	15.22	1.286	11.34
3.0	.008	1.30	2.0	1316.	.000	-3.88	2500.	.034	27.76	1.119	23.88
3.0	.008	1.30	2.0	1316.	.000	-3.88	3000.	.049	40.15	1.120	36.27
3.0	.008	1.30	2.0	2500.	.028	9.59	2000.	.020	15.22	3.649	24.82
3.0	.008	1.30	2.0	2500.	.028	9.59	2500.	.034	27.76	3.482	37.35
3.0	.008	1.30	2.0	2500.	.028	9.59	3000.	.049	40.15	3.483	49.74
3.0	.008	1.30	2.0	3000.	.042	15.10	2000.	.020	15.22	3.472	30.33
3.0	.008	1.30	2.0	3000.	.042	15.10	2500.	.034	27.76	3.306	42.86
3.0	.008	1.30	2.0	3000.	.042	15.10	3000.	.049	40.15	3.306	55.25
3.0	.008	1.50	1.0	1335.	.000	-5.35	2000.	.020	11.49	.163	6.14
3.0	.008	1.50	1.0	1335.	.000	-5.35	2500.	.034	20.90	.060	15.55
3.0	.008	1.50	1.0	1335.	.000	-5.35	3000.	.049	30.21	.068	24.86
3.0	.008	1.50	1.0	2500.	.028	14.60	2000.	.020	11.49	3.761	26.09
3.0	.008	1.50	1.0	2500.	.028	14.60	2500.	.034	20.90	3.658	35.49
3.0	.008	1.50	1.0	2500.	.028	14.60	3000.	.049	30.21	3.667	44.80
3.0	.008	1.50	1.0	3000.	.042	22.90	2000.	.020	11.49	3.516	34.39
3.0	.008	1.50	1.0	3000.	.042	22.90	2500.	.034	20.90	3.413	43.80
3.0	.008	1.50	1.0	3000.	.042	22.90	3000.	.049	30.21	3.422	53.10
3.0	.008	1.50	1.5	1299.	.000	-4.99	2000.	.020	13.79	.908	8.80
3.0	.008	1.50	1.5	1299.	.000	-4.99	2500.	.034	25.08	.785	20.09
3.0	.008	1.50	1.5	1299.	.000	-4.99	3000.	.049	36.25	.795	31.26
3.0	.008	1.50	1.5	2500.	.028	11.35	2000.	.020	13.79	3.719	25.14
3.0	.008	1.50	1.5	2500.	.028	11.35	2500.	.034	25.08	3.596	36.43
3.0	.008	1.50	1.5	2500.	.028	11.35	3000.	.049	36.25	3.606	47.60
3.0	.008	1.50	1.5	3000.	.043	17.94	2000.	.020	13.79	3.492	31.73
3.0	.008	1.50	1.5	3000.	.043	17.94	2500.	.034	25.08	3.369	43.02
3.0	.008	1.50	1.5	3000.	.043	17.94	3000.	.049	36.25	3.379	54.19
3.0	.008	1.50	2.0	1264.	.000	-4.78	2000.	.020	15.32	1.376	10.54
3.0	.008	1.50	2.0	1264.	.000	-4.78	2500.	.034	27.87	1.240	23.08
3.0	.008	1.50	2.0	1264.	.000	-4.78	3000.	.049	40.27	1.251	35.49
3.0	.008	1.50	2.0	2500.	.029	9.13	2000.	.020	15.32	3.705	24.45
3.0	.008	1.50	2.0	2500.	.029	9.13	2500.	.034	27.87	3.568	37.00
3.0	.008	1.50	2.0	2500.	.029	9.13	3000.	.049	40.27	3.579	49.41
3.0	.008	1.50	2.0	3000.	.043	14.57	2000.	.020	15.32	3.484	29.89
3.0	.008	1.50	2.0	3000.	.043	14.57	2500.	.034	27.87	3.347	42.44
3.0	.008	1.50	2.0	3000.	.043	14.57	3000.	.049	40.27	3.355	54.84

ALTITUDE 70000.0 PRSL = 11.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.008	1.70	1.0	1311.	.000	-5.94	2000.	.019	11.55	.254	5.61
3.0	.008	1.70	1.0	1311.	.000	-5.94	2500.	.033	20.96	.171	15.03
3.0	.008	1.70	1.0	1311.	.000	-5.94	3000.	.048	30.28	.186	24.34
3.0	.008	1.70	1.0	2500.	.028	14.33	2000.	.019	11.55	3.788	25.83
3.0	.008	1.70	1.0	2500.	.028	14.33	2500.	.033	20.96	3.705	35.30
3.0	.008	1.70	1.0	2500.	.028	14.33	3000.	.048	30.28	3.720	44.61
3.0	.008	1.70	1.0	3000.	.042	22.59	2000.	.019	11.55	3.518	34.14
3.0	.008	1.70	1.0	3000.	.042	22.59	2500.	.033	20.96	3.435	43.56
3.0	.008	1.70	1.0	3000.	.042	22.59	3000.	.048	30.28	3.450	52.87
3.0	.008	1.70	1.5	1264.	.000	-5.74	2000.	.019	13.86	.977	8.12
3.0	.008	1.70	1.5	1264.	.000	-5.74	2500.	.033	25.16	.877	19.42
3.0	.008	1.70	1.5	1264.	.000	-5.74	3000.	.048	36.33	.895	30.59
3.0	.008	1.70	1.5	2500.	.029	10.96	2000.	.019	13.86	3.771	24.81
3.0	.008	1.70	1.5	2500.	.029	10.96	2500.	.033	25.16	3.671	36.11
3.0	.008	1.70	1.5	2500.	.029	10.96	3000.	.048	36.33	3.690	47.29
3.0	.008	1.70	1.5	3000.	.043	17.49	2000.	.019	13.86	3.506	31.34
3.0	.008	1.70	1.5	3000.	.043	17.49	2500.	.033	25.16	3.406	42.64
3.0	.008	1.70	1.5	3000.	.043	17.49	3000.	.048	36.33	3.425	53.82
3.0	.008	1.70	2.0	1216.	.000	-5.67	2000.	.019	15.39	1.423	9.72
3.0	.008	1.70	2.0	1216.	.000	-5.67	2500.	.033	27.95	1.312	22.28
3.0	.008	1.70	2.0	1216.	.000	-5.67	3000.	.048	40.37	1.332	34.70
3.0	.008	1.70	2.0	2500.	.030	8.59	2000.	.019	15.39	3.795	23.99
3.0	.008	1.70	2.0	2500.	.030	8.59	2500.	.033	27.95	3.684	36.54
3.0	.008	1.70	2.0	2500.	.030	8.59	3000.	.048	40.37	3.704	48.96
3.0	.008	1.70	2.0	3000.	.045	13.94	2000.	.019	15.39	3.518	29.34
3.0	.008	1.70	2.0	3000.	.045	13.94	2500.	.033	27.95	3.407	41.89
3.0	.008	1.70	2.0	3000.	.045	13.94	3000.	.048	40.37	3.427	54.31

1.0	.021	1.30	1.0	1131.	.000	-3.26	2000.	.032	21.59	-4.386	18.33
1.0	.021	1.30	1.0	1131.	.000	-3.26	2500.	.047	27.04	-4.177	23.78
1.0	.021	1.30	1.0	1131.	.000	-3.26	3000.	.063	32.33	-3.990	29.06
1.0	.021	1.30	1.0	2500.	.023	3.15	2000.	.032	21.59	13.996	24.74
1.0	.021	1.30	1.0	2500.	.023	3.15	2500.	.047	27.04	14.205	30.19
1.0	.021	1.30	1.0	2500.	.023	3.15	3000.	.063	32.33	14.392	35.48
1.0	.021	1.30	1.0	3000.	.034	5.20	2000.	.032	21.59	10.785	26.79
1.0	.021	1.30	1.0	3000.	.034	5.20	2500.	.047	27.04	10.994	32.24
1.0	.021	1.30	1.0	3000.	.034	5.20	3000.	.063	32.33	11.181	37.52
1.0	.021	1.30	1.5	1100.	.000	-4.43	2000.	.032	25.91	-1.079	21.48
1.0	.021	1.30	1.5	1100.	.000	-4.43	2500.	.047	32.45	-.829	28.02
1.0	.021	1.30	1.5	1100.	.000	-4.43	3000.	.063	38.79	-.604	34.36
1.0	.021	1.30	1.5	2500.	.024	-.13	2000.	.032	25.91	-194.579	25.78
1.0	.021	1.30	1.5	2500.	.024	-.13	2500.	.047	32.45	-194.328	32.32
1.0	.021	1.30	1.5	2500.	.024	-.13	3000.	.063	38.79	-194.104	38.66
1.0	.021	1.30	1.5	3000.	.034	1.20	2000.	.032	25.91	27.929	27.11
1.0	.021	1.30	1.5	3000.	.034	1.20	2500.	.047	32.45	28.179	33.65
1.0	.021	1.30	1.5	3000.	.034	1.20	3000.	.063	38.79	28.404	40.00
1.0	.021	1.30	2.0	1069.	.000	-5.73	2000.	.032	28.79	.352	23.06
1.0	.021	1.30	2.0	1069.	.000	-5.73	2500.	.047	36.06	.631	30.33
1.0	.021	1.30	2.0	1069.	.000	-5.73	3000.	.063	43.10	.880	37.37
1.0	.021	1.30	2.0	2500.	.024	-3.20	2000.	.032	28.79	-3.849	25.59
1.0	.021	1.30	2.0	2500.	.024	-3.20	2500.	.047	36.06	-3.570	32.86
1.0	.021	1.30	2.0	2500.	.024	-3.20	3000.	.063	43.10	-3.321	39.90
1.0	.021	1.30	2.0	3000.	.035	-2.44	2000.	.032	28.79	-7.302	26.36
1.0	.021	1.30	2.0	3000.	.035	-2.44	2500.	.047	36.06	-7.023	33.62
1.0	.021	1.30	2.0	3000.	.035	-2.44	3000.	.063	43.10	-6.774	40.67
1.0	.021	1.50	1.0	1095.	.000	-5.95	2000.	.032	24.90	-1.994	18.95
1.0	.021	1.50	1.0	1095.	.000	-5.95	2500.	.046	31.02	-1.802	25.07
1.0	.021	1.50	1.0	1095.	.000	-5.95	3000.	.062	36.97	-1.633	31.02
1.0	.021	1.50	1.0	2500.	.024	-.77	2000.	.032	24.90	-51.204	24.13
1.0	.021	1.50	1.0	2500.	.024	-.77	2500.	.046	31.02	-51.013	30.25
1.0	.021	1.50	1.0	2500.	.024	-.77	3000.	.062	36.97	-50.843	36.20
1.0	.021	1.50	1.0	3000.	.034	.83	2000.	.032	24.90	60.871	25.73
1.0	.021	1.50	1.0	3000.	.034	.83	2500.	.046	31.02	61.063	31.85
1.0	.021	1.50	1.0	3000.	.034	.83	3000.	.062	36.97	61.232	37.80
1.0	.021	1.50	1.5	1046.	.000	-10.11	2000.	.032	29.88	.201	19.77
1.0	.021	1.50	1.5	1046.	.000	-10.11	2500.	.046	37.22	.431	27.11
1.0	.021	1.50	1.5	1046.	.000	-10.11	3000.	.062	44.37	.634	34.25
1.0	.021	1.50	1.5	2500.	.025	-8.94	2000.	.032	29.88	-1.551	20.94
1.0	.021	1.50	1.5	2500.	.025	-8.94	2500.	.046	37.22	-1.321	28.23
1.0	.021	1.50	1.5	2500.	.025	-8.94	3000.	.062	44.37	-1.118	35.43
1.0	.021	1.50	1.5	3000.	.035	-8.59	2000.	.032	29.88	-2.356	21.29
1.0	.021	1.50	1.5	3000.	.035	-8.59	2500.	.046	37.22	-2.126	28.63
1.0	.021	1.50	1.5	3000.	.035	-8.59	3000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	997.	.000	-8.59	2000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	997.	.000	-8.59	2500.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	997.	.000	-8.59	3000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	2500.	.026	-8.59	2000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	2500.	.026	-8.59	2500.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	2500.	.026	-8.59	3000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	3000.	.036	-8.59	2000.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	3000.	.036	-8.59	2500.	.062	44.37	-1.923	35.78
1.0	.021	1.50	2.0	3000.	.036	-8.59	3000.	.062	44.37	-1.923	35.78

FMN	FAMB	FPRSL	BPR	T6	FAAB	TST	TT0	FAPAB	TS2	STC	TST
1.0	.021	1.70	1.0	1062.	.000	-9.43	2000.	.031	27.38	-.951	17.95
1.0	.021	1.70	1.0	1062.	.000	-9.43	2500.	.046	34.00	-.771	24.56
1.0	.021	1.70	1.0	1062.	.000	-9.43	3000.	.062	40.45	-.613	31.02
1.0	.021	1.70	1.0	2500.	.025	-6.10	2000.	.031	27.38	-5.657	21.29
1.0	.021	1.70	1.0	2500.	.025	-6.10	2500.	.046	34.00	-5.476	27.90
1.0	.021	1.70	1.0	2500.	.025	-6.10	3000.	.062	40.45	-5.318	34.36
1.0	.021	1.70	1.0	3000.	.035	-5.09	2000.	.031	27.38	-8.778	22.29
1.0	.021	1.70	1.0	3000.	.035	-5.09	2500.	.046	34.00	-8.597	28.90
1.0	.021	1.70	1.0	3000.	.035	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	997.	.000	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	997.	.000	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	997.	.000	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	2500.	.026	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	2500.	.026	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	2500.	.026	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	3000.	.036	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	3000.	.036	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	1.5	3000.	.036	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	931.	.000	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	931.	.000	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	931.	.000	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	2500.	.027	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	2500.	.027	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	2500.	.027	-5.09	3000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	3000.	.037	-5.09	2000.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	3000.	.037	-5.09	2500.	.062	40.45	-8.439	35.36
1.0	.021	1.70	2.0	3000.	.037	-5.09	3000.	.062	40.45	-8.439	35.36
2.0	.016	1.30	1.0	1299.	.000	2.05	2000.	.028	22.66	8.173	24.71
2.0	.016	1.30	1.0	1299.	.000	2.05	2500.	.042	31.34	8.275	33.39
2.0	.016	1.30	1.0	1299.	.000	2.05	3000.	.058	39.88	8.369	41.94
2.0	.016	1.30	1.0	2500.	.026	18.59	2000.	.028	22.66	3.146	41.25
2.0	.016	1.30	1.0	2500.	.026	18.59	2500.	.042	31.34	3.247	49.93
2.0	.016	1.30	1.0	2500.	.026	18.59	3000.	.058	39.88	3.341	58.47
2.0	.016	1.30	1.0	3000.	.039	25.15	2000.	.028	22.66	3.073	47.81
2.0	.016	1.30	1.0	3000.	.039	25.15	2500.	.042	31.34	3.175	56.49
2.0	.016	1.30	1.0	3000.	.039	25.15	3000.	.058	39.88	3.268	65.04
2.0	.016	1.30	1.5	1274.	.000	.98	2000.	.028	27.19	10.776	28.17
2.0	.016	1.30	1.5	1274.	.000	.98	2500.	.042	37.61	10.898	38.59
2.0	.016	1.30	1.5	1274.	.000	.98	3000.	.058	47.86	11.010	48.84
2.0	.016	1.30	1.5	2500.	.026	14.26	2000.	.028	27.19	3.050	41.45
2.0	.016	1.30	1.5	2500.	.026	14.26	2500.	.042	37.61	3.172	51.87
2.0	.016	1.30	1.5	2500.	.026	14.26	3000.	.058	47.86	3.284	62.12
2.0	.016	1.30	1.5	3000.	.039	19.41	2000.	.028	27.19	2.975	46.60
2.0	.016	1.30	1.5	3000.	.039	19.41	2500.	.042	37.61	3.097	57.02
2.0	.016	1.30	1.5	3000.	.039	19.41	3000.	.058	47.86	3.209	67.27
2.0	.016	1.30	2.0	1250.	.000	.24	2000.	.028	30.21	28.502	30.45
2.0	.016	1.30	2.0	1250.	.000	.24	2500.	.042	41.78	28.638	42.02
2.0	.016	1.30	2.0	1250.	.000	.24	3000.	.058	53.18	28.762	53.42
2.0	.016	1.30	2.0	2500.	.027	11.31	2000.	.028	30.21	3.002	41.53
2.0	.016	1.30	2.0	2500.	.027	11.31	2500.	.042	41.78	3.137	53.10
2.0	.016	1.30	2.0	2500.	.027	11.31	3000.	.058	53.18	3.262	64.49
2.0	.016	1.30	2.0	3000.	.040	15.51	2000.	.028	30.21	2.921	45.73
2.0	.016	1.30	2.0	3000.	.040	15.51	2500.	.042	41.78	3.057	57.30
2.0	.016	1.30	2.0	3000.	.040	15.51	3000.	.058	53.18	3.181	68.69

FAN	FAMB	FPRSL	BPR	T8	FAMB	VSL	FTO	FAMB	VSL		
2.0	.016	1.50	1.0	1271.	.000	1.10	2000.	.027	23.27	14.292	24.37
2.0	.016	1.50	1.0	1271.	.000	1.10	2500.	.042	32.07	14.400	33.17
2.0	.016	1.50	1.0	1271.	.000	1.10	3000.	.057	40.74	14.496	41.83
2.0	.016	1.50	1.0	2500.	.027	17.70	2000.	.027	23.27	3.228	40.97
2.0	.016	1.50	1.0	2500.	.027	17.70	2500.	.042	32.07	3.335	49.77
2.0	.016	1.50	1.0	2500.	.027	17.70	3000.	.057	40.74	3.432	58.44
2.0	.016	1.50	1.0	3000.	.039	24.12	2000.	.027	23.27	3.130	47.39
2.0	.016	1.50	1.0	3000.	.039	24.12	2500.	.042	32.07	3.238	56.19
2.0	.016	1.50	1.0	3000.	.039	24.12	3000.	.057	40.74	3.334	64.86
2.0	.016	1.50	1.5	1232.	.000	-.25	2000.	.027	27.93	-35.757	27.68
2.0	.016	1.50	1.5	1232.	.000	-.25	2500.	.042	38.48	-35.628	38.23
2.0	.016	1.50	1.5	1232.	.000	-.25	3000.	.057	48.88	-35.512	48.63
2.0	.016	1.50	1.5	2500.	.027	13.02	2000.	.027	27.93	3.192	40.94
2.0	.016	1.50	1.5	2500.	.027	13.02	2500.	.042	38.48	3.322	51.50
2.0	.016	1.50	1.5	2500.	.027	13.02	3000.	.057	48.88	3.438	61.90
2.0	.016	1.50	1.5	3000.	.040	17.97	2000.	.027	27.93	3.076	45.90
2.0	.016	1.50	1.5	3000.	.040	17.97	2500.	.042	38.48	3.206	56.45
2.0	.016	1.50	1.5	3000.	.040	17.97	3000.	.057	48.88	3.322	66.85
2.0	.016	1.50	2.0	1192.	.000	-1.24	2000.	.027	31.03	-3.777	29.79
2.0	.016	1.50	2.0	1192.	.000	-1.24	2500.	.042	42.76	-3.633	41.52
2.0	.016	1.50	2.0	1192.	.000	-1.24	3000.	.057	54.32	-3.504	53.08
2.0	.016	1.50	2.0	2500.	.028	9.70	2000.	.027	31.03	3.235	40.73
2.0	.016	1.50	2.0	2500.	.028	9.70	2500.	.042	42.76	3.379	52.46
2.0	.016	1.50	2.0	2500.	.028	9.70	3000.	.057	54.32	3.508	64.02
2.0	.016	1.50	2.0	3000.	.041	13.64	2000.	.027	31.03	3.088	44.67
2.0	.016	1.50	2.0	3000.	.041	13.64	2500.	.042	42.76	3.231	56.40
2.0	.016	1.50	2.0	3000.	.041	13.64	3000.	.057	54.32	3.360	67.96
2.0	.016	1.70	1.0	1245.	.000	.17	2000.	.027	23.75	85.239	23.93
2.0	.016	1.70	1.0	1245.	.000	.17	2500.	.041	32.65	85.352	32.82
2.0	.016	1.70	1.0	1245.	.000	.17	3000.	.057	41.41	85.452	41.58
2.0	.016	1.70	1.0	2500.	.027	16.78	2000.	.027	23.75	3.334	40.53
2.0	.016	1.70	1.0	2500.	.027	16.78	2500.	.041	32.65	3.447	49.43
2.0	.016	1.70	1.0	2500.	.027	16.78	3000.	.057	41.41	3.546	58.19
2.0	.016	1.70	1.0	3000.	.040	23.05	2000.	.027	23.75	3.207	46.80
2.0	.016	1.70	1.0	3000.	.040	23.05	2500.	.041	32.65	3.320	55.70
2.0	.016	1.70	1.0	3000.	.040	23.05	3000.	.057	41.41	3.419	64.46
2.0	.016	1.70	1.5	1192.	.000	-1.49	2000.	.027	28.50	-5.013	27.02
2.0	.016	1.70	1.5	1192.	.000	-1.49	2500.	.041	39.17	-4.877	37.69
2.0	.016	1.70	1.5	1192.	.000	-1.49	3000.	.057	49.69	-4.758	48.20
2.0	.016	1.70	1.5	2500.	.028	11.65	2000.	.027	28.50	3.409	40.15
2.0	.016	1.70	1.5	2500.	.028	11.65	2500.	.041	39.17	3.545	50.82
2.0	.016	1.70	1.5	2500.	.028	11.65	3000.	.057	49.69	3.664	61.34
2.0	.016	1.70	1.5	3000.	.041	16.37	2000.	.027	28.50	3.233	44.88
2.0	.016	1.70	1.5	3000.	.041	16.37	2500.	.041	39.17	3.369	55.55
2.0	.016	1.70	1.5	3000.	.041	16.37	3000.	.057	49.69	3.488	66.06
2.0	.016	1.70	2.0	1140.	.000	-2.79	2000.	.027	31.67	-.945	28.88
2.0	.016	1.70	2.0	1140.	.000	-2.79	2500.	.041	43.53	-.794	40.73
2.0	.016	1.70	2.0	1140.	.000	-2.79	3000.	.057	55.21	-.662	52.42
2.0	.016	1.70	2.0	2500.	.029	7.79	2000.	.027	31.67	3.682	39.46
2.0	.016	1.70	2.0	2500.	.029	7.79	2500.	.041	43.53	3.833	51.32
2.0	.016	1.70	2.0	2500.	.029	7.79	3000.	.057	55.21	3.965	63.00
2.0	.016	1.70	2.0	3000.	.042	11.42	2000.	.027	31.67	3.399	43.09
2.0	.016	1.70	2.0	3000.	.042	11.42	2500.	.041	43.53	3.549	54.94
2.0	.016	1.70	2.0	3000.	.042	11.42	3000.	.057	55.21	3.681	66.63

FAN	FAMB	FPRSL	BPR	T8	PAMB	T51	T18	PAMB	T52	SFC	T51
3.0	.008	1.30	1.0	1329.	.000	-7.31	2000.	.020	11.42	.588	4.10
3.0	.008	1.30	1.0	1329.	.000	-7.31	2500.	.034	20.82	.463	13.50
3.0	.008	1.30	1.0	1329.	.000	-7.31	3000.	.049	30.11	.463	22.80
3.0	.008	1.30	1.0	2500.	.026	11.71	2000.	.020	11.42	4.260	23.13
3.0	.008	1.30	1.0	2500.	.026	11.71	2500.	.034	20.82	4.135	32.53
3.0	.008	1.30	1.0	2500.	.026	11.71	3000.	.049	30.11	4.135	41.82
3.0	.008	1.30	1.0	3000.	.040	19.57	2000.	.020	11.42	3.810	30.98
3.0	.008	1.30	1.0	3000.	.040	19.57	2500.	.034	20.82	3.685	40.38
3.0	.008	1.30	1.0	3000.	.040	19.57	3000.	.049	30.11	3.685	49.68
3.0	.008	1.30	1.5	1306.	.000	-6.30	2000.	.020	13.70	1.169	7.40
3.0	.008	1.30	1.5	1306.	.000	-6.30	2500.	.034	24.98	1.019	18.68
3.0	.008	1.30	1.5	1306.	.000	-6.30	3000.	.049	36.13	1.020	29.83
3.0	.008	1.30	1.5	2500.	.027	9.16	2000.	.020	13.70	4.128	22.86
3.0	.008	1.30	1.5	2500.	.027	9.16	2500.	.034	24.98	3.978	34.14
3.0	.008	1.30	1.5	2500.	.027	9.16	3000.	.049	36.13	3.978	45.30
3.0	.008	1.30	1.5	3000.	.040	15.41	2000.	.020	13.70	3.735	29.11
3.0	.008	1.30	1.5	3000.	.040	15.41	2500.	.034	24.98	3.586	40.39
3.0	.008	1.30	1.5	3000.	.040	15.41	3000.	.049	36.13	3.586	51.54
3.0	.008	1.30	2.0	1282.	.000	-5.64	2000.	.020	15.22	1.551	9.58
3.0	.008	1.30	2.0	1282.	.000	-5.64	2500.	.034	27.76	1.385	22.11
3.0	.008	1.30	2.0	1282.	.000	-5.64	3000.	.049	40.15	1.385	34.50
3.0	.008	1.30	2.0	2500.	.027	7.44	2000.	.020	15.22	4.048	22.66
3.0	.008	1.30	2.0	2500.	.027	7.44	2500.	.034	27.76	3.882	35.20
3.0	.008	1.30	2.0	2500.	.027	7.44	3000.	.049	40.15	3.883	47.59
3.0	.008	1.30	2.0	3000.	.041	12.62	2000.	.020	15.22	3.690	27.84
3.0	.008	1.30	2.0	3000.	.041	12.62	2500.	.034	27.76	3.524	40.37
3.0	.008	1.30	2.0	3000.	.041	12.62	3000.	.049	40.15	3.524	52.76
3.0	.008	1.50	1.0	1302.	.000	-7.97	2000.	.020	11.49	.619	3.52
3.0	.008	1.50	1.0	1302.	.000	-7.97	2500.	.034	20.90	.516	12.93
3.0	.008	1.50	1.0	1302.	.000	-7.97	3000.	.049	30.21	.524	22.24
3.0	.008	1.50	1.0	2500.	.027	11.41	2000.	.020	11.49	4.323	22.90
3.0	.008	1.50	1.0	2500.	.027	11.41	2500.	.034	20.90	4.221	32.31
3.0	.008	1.50	1.0	2500.	.027	11.41	3000.	.049	30.21	4.229	41.62
3.0	.008	1.50	1.0	3000.	.040	19.21	2000.	.020	11.49	3.826	30.70
3.0	.008	1.50	1.0	3000.	.040	19.21	2500.	.034	20.90	3.723	40.11
3.0	.008	1.50	1.0	3000.	.040	19.21	3000.	.049	30.21	3.731	49.42
3.0	.008	1.50	1.5	1265.	.000	-7.12	2000.	.020	13.79	1.193	6.66
3.0	.008	1.50	1.5	1265.	.000	-7.12	2500.	.034	25.08	1.069	17.95
3.0	.008	1.50	1.5	1265.	.000	-7.12	3000.	.049	36.25	1.079	29.12
3.0	.008	1.50	1.5	2500.	.028	8.74	2000.	.020	13.79	4.229	22.53
3.0	.008	1.50	1.5	2500.	.028	8.74	2500.	.034	25.08	4.106	33.82
3.0	.008	1.50	1.5	2500.	.028	8.74	3000.	.049	36.25	4.116	44.98
3.0	.008	1.50	1.5	3000.	.041	14.92	2000.	.020	13.79	3.767	28.71
3.0	.008	1.50	1.5	3000.	.041	14.92	2500.	.034	25.08	3.644	40.00
3.0	.008	1.50	1.5	3000.	.041	14.92	3000.	.049	36.25	3.654	51.16
3.0	.008	1.50	2.0	1227.	.000	-6.60	2000.	.020	15.32	1.566	8.72
3.0	.008	1.50	2.0	1227.	.000	-6.60	2500.	.034	27.87	1.429	21.27
3.0	.008	1.50	2.0	1227.	.000	-6.60	3000.	.049	40.27	1.440	33.68
3.0	.008	1.50	2.0	2500.	.028	6.89	2000.	.020	15.32	4.199	22.21
3.0	.008	1.50	2.0	2500.	.028	6.89	2500.	.034	27.87	4.062	34.75
3.0	.008	1.50	2.0	2500.	.028	6.89	3000.	.049	40.27	4.073	47.16
3.0	.008	1.50	2.0	3000.	.042	11.97	2000.	.020	15.32	3.743	27.29
3.0	.008	1.50	2.0	3000.	.042	11.97	2500.	.034	27.87	3.607	39.84
3.0	.008	1.50	2.0	3000.	.042	11.97	3000.	.049	40.27	3.618	52.25

ALTITUDE 80000.0 PRSL = 11.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.008	1.70	1.0	1277.	.000	-8.59	2000.	.019	11.55	.640	2.96
3.0	.008	1.70	1.0	1277.	.000	-8.59	2500.	.033	20.96	.556	12.38
3.0	.008	1.70	1.0	1277.	.000	-8.59	3000.	.048	30.28	.571	21.69
3.0	.008	1.70	1.0	2500.	.027	11.10	2000.	.019	11.55	4.398	22.64
3.0	.008	1.70	1.0	2500.	.027	11.10	2500.	.033	20.96	4.315	32.06
3.0	.008	1.70	1.0	2500.	.027	11.10	3000.	.048	30.28	4.330	41.37
3.0	.008	1.70	1.0	3000.	.041	18.85	2000.	.019	11.55	3.850	30.39
3.0	.008	1.70	1.0	3000.	.041	18.85	2500.	.033	20.96	3.767	39.81
3.0	.008	1.70	1.0	3000.	.041	18.85	3000.	.048	30.28	3.782	49.13
3.0	.008	1.70	1.5	1227.	.000	-7.92	2000.	.019	13.86	1.204	5.94
3.0	.008	1.70	1.5	1227.	.000	-7.92	2500.	.033	25.16	1.104	17.24
3.0	.008	1.70	1.5	1227.	.000	-7.92	3000.	.048	36.33	1.122	28.42
3.0	.008	1.70	1.5	2500.	.028	8.26	2000.	.019	13.86	4.363	22.12
3.0	.008	1.70	1.5	2500.	.028	8.26	2500.	.033	25.16	4.263	33.42
3.0	.008	1.70	1.5	2500.	.028	8.26	3000.	.048	36.33	4.282	44.60
3.0	.008	1.70	1.5	3000.	.042	14.37	2000.	.019	13.86	3.817	28.22
3.0	.008	1.70	1.5	3000.	.042	14.37	2500.	.033	25.16	3.717	39.52
3.0	.008	1.70	1.5	3000.	.042	14.37	3000.	.048	36.33	3.736	50.70
3.0	.008	1.70	2.0	1177.	.000	-7.55	2000.	.019	15.39	1.567	7.85
3.0	.008	1.70	2.0	1177.	.000	-7.55	2500.	.033	27.95	1.456	20.40
3.0	.008	1.70	2.0	1177.	.000	-7.55	3000.	.048	40.37	1.476	32.82
3.0	.008	1.70	2.0	2500.	.030	6.23	2000.	.019	15.39	4.430	21.62
3.0	.008	1.70	2.0	2500.	.030	6.23	2500.	.033	27.95	4.318	34.18
3.0	.008	1.70	2.0	2500.	.030	6.23	3000.	.048	40.37	4.339	46.60
3.0	.008	1.70	2.0	3000.	.043	11.21	2000.	.019	15.39	3.836	26.60
3.0	.008	1.70	2.0	3000.	.043	11.21	2500.	.033	27.95	3.724	39.16
3.0	.008	1.70	2.0	3000.	.043	11.21	3000.	.048	40.37	3.745	51.58



1.0	.012	1.30	1.0	1257.	.000	9.17	2000.	.024	17.28	2.434	26.45
1.0	.012	1.30	1.0	1257.	.000	9.17	2500.	.036	22.18	2.620	31.35
1.0	.012	1.30	1.0	1257.	.000	9.17	3000.	.048	26.86	2.784	36.03
1.0	.012	1.30	1.0	2500.	.026	21.94	2000.	.024	17.28	2.826	39.22
1.0	.012	1.30	1.0	2500.	.026	21.94	2500.	.036	22.18	3.012	44.12
1.0	.012	1.30	1.0	2500.	.026	21.94	3000.	.048	26.86	3.176	48.81
1.0	.012	1.30	1.0	3000.	.038	26.60	2000.	.024	17.28	2.973	43.88
1.0	.012	1.30	1.0	3000.	.038	26.60	2500.	.036	22.18	3.160	48.78
1.0	.012	1.30	1.0	3000.	.038	26.60	3000.	.048	26.86	3.324	53.46
1.0	.012	1.30	1.5	1236.	.000	6.11	2000.	.024	20.74	2.642	26.85
1.0	.012	1.30	1.5	1236.	.000	6.11	2500.	.036	26.62	2.865	32.73
1.0	.012	1.30	1.5	1236.	.000	6.11	3000.	.048	32.24	3.062	38.34
1.0	.012	1.30	1.5	2500.	.026	15.82	2000.	.024	20.74	2.919	36.56
1.0	.012	1.30	1.5	2500.	.026	15.82	2500.	.036	26.62	3.143	42.44
1.0	.012	1.30	1.5	2500.	.026	15.82	3000.	.048	32.24	3.340	48.06
1.0	.012	1.30	1.5	3000.	.039	19.27	2000.	.024	20.74	3.041	40.01
1.0	.012	1.30	1.5	3000.	.039	19.27	2500.	.036	26.62	3.265	45.89
1.0	.012	1.30	1.5	3000.	.039	19.27	3000.	.048	32.24	3.462	51.51
1.0	.012	1.30	2.0	1214.	.000	4.00	2000.	.024	23.04	2.878	27.04
1.0	.012	1.30	2.0	1214.	.000	4.00	2500.	.036	29.58	3.127	33.58
1.0	.012	1.30	2.0	1214.	.000	4.00	3000.	.048	35.82	3.345	39.82
1.0	.012	1.30	2.0	2500.	.027	11.60	2000.	.024	23.04	3.029	34.64
1.0	.012	1.30	2.0	2500.	.027	11.60	2500.	.036	29.58	3.278	41.17
1.0	.012	1.30	2.0	2500.	.027	11.60	3000.	.048	35.82	3.497	47.42
1.0	.012	1.30	2.0	3000.	.039	14.22	2000.	.024	23.04	3.133	37.26
1.0	.012	1.30	2.0	3000.	.039	14.22	2500.	.036	29.58	3.382	43.80
1.0	.012	1.30	2.0	3000.	.039	14.22	3000.	.048	35.82	3.600	50.04
1.0	.012	1.50	1.0	1232.	.000	7.39	2000.	.024	20.03	2.521	27.42
1.0	.012	1.50	1.0	1232.	.000	7.39	2500.	.035	25.46	2.697	32.85
1.0	.012	1.50	1.0	1232.	.000	7.39	3000.	.048	30.66	2.850	38.05
1.0	.012	1.50	1.0	2500.	.027	19.42	2000.	.024	20.03	2.856	39.45
1.0	.012	1.50	1.0	2500.	.027	19.42	2500.	.035	25.46	3.033	44.88
1.0	.012	1.50	1.0	2500.	.027	19.42	3000.	.048	30.66	3.186	50.08
1.0	.012	1.50	1.0	3000.	.039	23.68	2000.	.024	20.03	3.009	43.71
1.0	.012	1.50	1.0	3000.	.039	23.68	2500.	.035	25.46	3.185	49.14
1.0	.012	1.50	1.0	3000.	.039	23.68	3000.	.048	30.66	3.338	54.34
1.0	.012	1.50	1.5	1199.	.000	3.88	2000.	.024	24.04	3.052	27.92
1.0	.012	1.50	1.5	1199.	.000	3.88	2500.	.035	30.55	3.264	34.43
1.0	.012	1.50	1.5	1199.	.000	3.88	3000.	.048	36.79	3.448	40.67
1.0	.012	1.50	1.5	2500.	.027	12.59	2000.	.024	24.04	3.078	36.63
1.0	.012	1.50	1.5	2500.	.027	12.59	2500.	.035	30.55	3.290	43.14
1.0	.012	1.50	1.5	2500.	.027	12.59	3000.	.048	36.79	3.474	49.38
1.0	.012	1.50	1.5	3000.	.040	15.51	2000.	.024	24.04	3.204	39.55
1.0	.012	1.50	1.5	3000.	.040	15.51	2500.	.035	30.55	3.416	46.06
1.0	.012	1.50	1.5	3000.	.040	15.51	3000.	.048	36.79	3.600	52.30
1.0	.012	1.50	2.0	1165.	.000	1.43	2000.	.024	26.71	4.750	28.14
1.0	.012	1.50	2.0	1165.	.000	1.43	2500.	.035	33.94	4.986	35.38
1.0	.012	1.50	2.0	1165.	.000	1.43	3000.	.048	40.88	5.190	42.31
1.0	.012	1.50	2.0	2500.	.028	8.08	2000.	.024	26.71	3.401	34.78
1.0	.012	1.50	2.0	2500.	.028	8.08	2500.	.035	33.94	3.637	42.02
1.0	.012	1.50	2.0	2500.	.028	8.08	3000.	.048	40.88	3.841	48.96
1.0	.012	1.50	2.0	3000.	.040	10.24	2000.	.024	26.71	3.474	36.94
1.0	.012	1.50	2.0	3000.	.040	10.24	2500.	.035	33.94	3.710	44.18
1.0	.012	1.50	2.0	3000.	.040	10.24	3000.	.048	40.88	3.913	51.12

FMN	FAMB	FPRSL	BPR	T6	PAMB	T5T	T10	PAMB	T8E	T8C	T8
1.0	.012	1.70	1.0	1210.	.000	5.68	2000.	.024	22.18	2.835	27.86
1.0	.012	1.70	1.0	1210.	.000	5.68	2500.	.035	28.02	3.005	33.70
1.0	.012	1.70	1.0	1210.	.000	5.68	3000.	.047	33.63	3.150	39.31
1.0	.012	1.70	1.0	2500.	.027	16.88	2000.	.024	22.18	3.027	39.06
1.0	.012	1.70	1.0	2500.	.027	16.88	2500.	.035	28.02	3.197	44.90
1.0	.012	1.70	1.0	2500.	.027	16.88	3000.	.047	33.63	3.342	50.51
1.0	.012	1.70	1.0	3000.	.039	20.72	2000.	.024	22.18	3.183	42.91
1.0	.012	1.70	1.0	3000.	.039	20.72	2500.	.035	28.02	3.352	48.75
1.0	.012	1.70	1.0	3000.	.039	20.72	3000.	.047	33.63	3.497	54.36
1.0	.012	1.70	1.5	1166.	.000	1.72	2000.	.024	26.62	5.118	28.34
1.0	.012	1.70	1.5	1166.	.000	1.72	2500.	.035	33.63	5.321	35.35
1.0	.012	1.70	1.5	1166.	.000	1.72	3000.	.047	40.36	5.495	42.08
1.0	.012	1.70	1.5	2500.	.028	9.70	2000.	.024	26.62	3.505	36.32
1.0	.012	1.70	1.5	2500.	.028	9.70	2500.	.035	33.63	3.709	43.32
1.0	.012	1.70	1.5	2500.	.028	9.70	3000.	.047	40.36	3.883	50.06
1.0	.012	1.70	1.5	3000.	.040	12.29	2000.	.024	26.62	3.593	38.91
1.0	.012	1.70	1.5	3000.	.040	12.29	2500.	.035	33.63	3.796	45.91
1.0	.012	1.70	1.5	3000.	.040	12.29	3000.	.047	40.36	3.970	52.65
1.0	.012	1.70	2.0	1121.	.000	-1.48	2000.	.024	29.58	-1.937	28.10
1.0	.012	1.70	2.0	1121.	.000	-1.48	2500.	.035	37.36	-1.711	35.89
1.0	.012	1.70	2.0	1121.	.000	-1.48	3000.	.047	44.85	-1.518	43.37
1.0	.012	1.70	2.0	2500.	.029	3.97	2000.	.024	29.58	5.359	33.55
1.0	.012	1.70	2.0	2500.	.029	3.97	2500.	.035	37.36	5.585	41.33
1.0	.012	1.70	2.0	2500.	.029	3.97	3000.	.047	44.85	5.779	48.82
1.0	.012	1.70	2.0	3000.	.041	5.67	2000.	.024	29.58	5.017	35.25
1.0	.012	1.70	2.0	3000.	.041	5.67	2500.	.035	37.36	5.243	43.04
1.0	.012	1.70	2.0	3000.	.041	5.67	3000.	.047	44.85	5.436	50.52
2.0	.007	1.30	1.0	1250.	.000	-.59	2000.	.019	17.09	11.171	17.68
2.0	.007	1.30	1.0	1250.	.000	-.59	2500.	.031	25.26	11.243	25.85
2.0	.007	1.30	1.0	1250.	.000	-.59	3000.	.043	33.19	11.315	33.78
2.0	.007	1.30	1.0	2500.	.026	19.23	2000.	.019	17.09	2.540	36.32
2.0	.007	1.30	1.0	2500.	.026	19.23	2500.	.031	25.26	2.613	44.49
2.0	.007	1.30	1.0	2500.	.026	19.23	3000.	.043	33.19	2.684	52.42
2.0	.007	1.30	1.0	3000.	.038	26.21	2000.	.019	17.09	2.556	43.30
2.0	.007	1.30	1.0	3000.	.038	26.21	2500.	.031	25.26	2.629	51.47
2.0	.007	1.30	1.0	3000.	.038	26.21	3000.	.043	33.19	2.701	59.40
2.0	.007	1.30	1.5	1229.	.000	-.29	2000.	.019	20.51	-11.958	20.22
2.0	.007	1.30	1.5	1229.	.000	-.29	2500.	.031	30.31	-11.871	30.02
2.0	.007	1.30	1.5	1229.	.000	-.29	3000.	.043	39.83	-11.785	39.54
2.0	.007	1.30	1.5	2500.	.026	14.57	2000.	.019	20.51	2.524	35.08
2.0	.007	1.30	1.5	2500.	.026	14.57	2500.	.031	30.31	2.611	44.88
2.0	.007	1.30	1.5	2500.	.026	14.57	3000.	.043	39.83	2.697	54.40
2.0	.007	1.30	1.5	3000.	.039	20.03	2000.	.019	20.51	2.523	40.54
2.0	.007	1.30	1.5	3000.	.039	20.03	2500.	.031	30.31	2.610	50.34
2.0	.007	1.30	1.5	3000.	.039	20.03	3000.	.043	39.83	2.696	59.86
2.0	.007	1.30	2.0	1207.	.000	-.91	2000.	.019	22.79	-1.560	21.88
2.0	.007	1.30	2.0	1207.	.000	-.91	2500.	.031	33.68	-1.463	32.77
2.0	.007	1.30	2.0	1207.	.000	-.91	3000.	.043	44.25	-1.367	43.34
2.0	.007	1.30	2.0	2500.	.027	11.40	2000.	.019	22.79	2.528	34.18
2.0	.007	1.30	2.0	2500.	.027	11.40	2500.	.031	33.68	2.626	45.07
2.0	.007	1.30	2.0	2500.	.027	11.40	3000.	.043	44.25	2.721	55.65
2.0	.007	1.30	2.0	3000.	.039	15.82	2000.	.019	22.79	2.512	38.61
2.0	.007	1.30	2.0	3000.	.039	15.82	2500.	.031	33.68	2.609	49.50
2.0	.007	1.30	2.0	3000.	.039	15.82	3000.	.043	44.25	2.705	60.08

PAN	PARB	PRSE	BPR	T0	PARB	TST	T10	PAPAB	TS2	SFC	TST
2.0	.007	1.50	1.0	1225.	.000	-.52	2000.	.019	17.58	-10.629	17.07
2.0	.007	1.50	1.0	1225.	.000	-.52	2500.	.030	25.84	-10.546	25.32
2.0	.007	1.50	1.0	1225.	.000	-.52	3000.	.042	33.87	-10.470	33.35
2.0	.007	1.50	1.0	2500.	.026	18.05	2000.	.019	17.58	2.612	35.63
2.0	.007	1.50	1.0	2500.	.026	18.05	2500.	.030	25.84	2.695	43.89
2.0	.007	1.50	1.0	2500.	.026	18.05	3000.	.042	33.87	2.772	51.91
2.0	.007	1.50	1.0	3000.	.039	24.84	2000.	.019	17.58	2.608	42.42
2.0	.007	1.50	1.0	3000.	.039	24.84	2500.	.030	25.84	2.691	50.68
2.0	.007	1.50	1.0	3000.	.039	24.84	3000.	.042	33.87	2.767	58.71
2.0	.007	1.50	1.5	1192.	.000	-1.71	2000.	.019	21.10	-1.077	19.39
2.0	.007	1.50	1.5	1192.	.000	-1.71	2500.	.030	31.01	-.977	29.30
2.0	.007	1.50	1.5	1192.	.000	-1.71	3000.	.042	40.64	-.885	38.93
2.0	.007	1.50	1.5	2500.	.027	12.96	2000.	.019	21.10	2.656	34.06
2.0	.007	1.50	1.5	2500.	.027	12.96	2500.	.030	31.01	2.756	43.97
2.0	.007	1.50	1.5	2500.	.027	12.96	3000.	.042	40.64	2.847	53.60
2.0	.007	1.50	1.5	3000.	.039	18.16	2000.	.019	21.10	2.619	39.25
2.0	.007	1.50	1.5	3000.	.039	18.16	2500.	.030	31.01	2.719	49.16
2.0	.007	1.50	1.5	3000.	.039	18.16	3000.	.042	40.64	2.810	58.79
2.0	.007	1.50	2.0	1158.	.000	-2.61	2000.	.019	23.44	.271	20.84
2.0	.007	1.50	2.0	1158.	.000	-2.61	2500.	.030	34.45	.382	31.85
2.0	.007	1.50	2.0	1158.	.000	-2.61	3000.	.042	45.15	.484	42.55
2.0	.007	1.50	2.0	2500.	.028	9.35	2000.	.019	23.44	2.757	32.79
2.0	.007	1.50	2.0	2500.	.028	9.35	2500.	.030	34.45	2.868	43.80
2.0	.007	1.50	2.0	2500.	.028	9.35	3000.	.042	45.15	2.970	54.50
2.0	.007	1.50	2.0	3000.	.040	13.45	2000.	.019	23.44	2.677	36.89
2.0	.007	1.50	2.0	3000.	.040	13.45	2500.	.030	34.45	2.788	47.90
2.0	.007	1.50	2.0	3000.	.040	13.45	3000.	.042	45.15	2.889	58.60
2.0	.007	1.70	1.0	1203.	.000	-1.58	2000.	.019	17.98	-2.860	16.40
2.0	.007	1.70	1.0	1203.	.000	-1.58	2500.	.030	26.31	-2.768	24.74
2.0	.007	1.70	1.0	1203.	.000	-1.58	3000.	.042	34.41	-2.688	32.83
2.0	.007	1.70	1.0	2500.	.027	16.85	2000.	.019	17.98	2.710	34.83
2.0	.007	1.70	1.0	2500.	.027	16.85	2500.	.030	26.31	2.802	43.16
2.0	.007	1.70	1.0	2500.	.027	16.85	3000.	.042	34.41	2.882	51.26
2.0	.007	1.70	1.0	3000.	.039	23.45	2000.	.019	17.98	2.680	41.43
2.0	.007	1.70	1.0	3000.	.039	23.45	2500.	.030	26.31	2.772	49.77
2.0	.007	1.70	1.0	3000.	.039	23.45	3000.	.042	34.41	2.852	57.86
2.0	.007	1.70	1.5	1158.	.000	-3.12	2000.	.019	21.58	-.113	18.45
2.0	.007	1.70	1.5	1158.	.000	-3.12	2500.	.030	31.58	-.003	28.45
2.0	.007	1.70	1.5	1158.	.000	-3.12	3000.	.042	41.30	.093	38.17
2.0	.007	1.70	1.5	2500.	.028	11.22	2000.	.019	21.58	2.871	32.80
2.0	.007	1.70	1.5	2500.	.028	11.22	2500.	.030	31.58	2.980	42.80
2.0	.007	1.70	1.5	2500.	.028	11.22	3000.	.042	41.30	3.077	52.51
2.0	.007	1.70	1.5	3000.	.040	16.14	2000.	.019	21.58	2.774	37.72
2.0	.007	1.70	1.5	3000.	.040	16.14	2500.	.030	31.58	2.884	47.72
2.0	.007	1.70	1.5	3000.	.040	16.14	3000.	.042	41.30	2.981	57.44
2.0	.007	1.70	2.0	1113.	.000	-4.37	2000.	.019	23.98	.627	19.61
2.0	.007	1.70	2.0	1113.	.000	-4.37	2500.	.030	35.09	.749	30.72
2.0	.007	1.70	2.0	1113.	.000	-4.37	3000.	.042	45.88	.856	41.52
2.0	.007	1.70	2.0	2500.	.028	7.00	2000.	.019	23.98	3.242	30.97
2.0	.007	1.70	2.0	2500.	.028	7.00	2500.	.030	35.09	3.364	42.08
2.0	.007	1.70	2.0	2500.	.028	7.00	3000.	.042	45.88	3.471	52.88
2.0	.007	1.70	2.0	3000.	.041	10.72	2000.	.019	23.98	3.006	34.70
2.0	.007	1.70	2.0	3000.	.041	10.72	2500.	.030	35.09	3.128	45.81
2.0	.007	1.70	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61

FMN	FAMB	FPRSL	BPR	TB	PAMB	TSY	TTO	PS	TSE	SPD	TOT
3.0	.007	1.30	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.30	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.50	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61

ALTITUDE .0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.007	1.70	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	1.5	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	2000.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	2500.	.042	45.88	3.235	56.61
3.0	.007	1.70	2.0	3000.	.041	10.72	3000.	.042	45.88	3.235	56.61

FMN	FAMB	FPRSL	BPR	T8	PAMB	T5T	PT0				
1.0	.013	1.30	1.0	1255.	.000	11.56	2000.	.025	18.30	2.212	29.86
1.0	.013	1.30	1.0	1255.	.000	11.56	2500.	.037	23.28	2.394	36.84
1.0	.013	1.30	1.0	1255.	.000	11.56	3000.	.049	28.04	2.555	39.60
1.0	.013	1.30	1.0	2500.	.026	25.58	2000.	.025	18.30	2.593	43.87
1.0	.013	1.30	1.0	2500.	.026	25.58	2500.	.037	23.28	2.775	48.85
1.0	.013	1.30	1.0	2500.	.026	25.58	3000.	.049	28.04	2.936	53.62
1.0	.013	1.30	1.0	3000.	.038	30.72	2000.	.025	18.30	2.728	49.02
1.0	.013	1.30	1.0	3000.	.038	30.72	2500.	.037	23.28	2.910	54.00
1.0	.013	1.30	1.0	3000.	.038	30.72	3000.	.049	28.04	3.071	58.76
1.0	.013	1.30	1.5	1234.	.000	8.12	2000.	.025	21.96	2.372	30.07
1.0	.013	1.30	1.5	1234.	.000	8.12	2500.	.037	27.93	2.590	36.05
1.0	.013	1.30	1.5	1234.	.000	8.12	3000.	.049	33.65	2.783	41.77
1.0	.013	1.30	1.5	2500.	.026	18.92	2000.	.025	21.96	2.668	40.88
1.0	.013	1.30	1.5	2500.	.026	18.92	2500.	.037	27.93	2.887	46.86
1.0	.013	1.30	1.5	2500.	.026	18.92	3000.	.049	33.65	3.080	52.57
1.0	.013	1.30	1.5	3000.	.039	22.79	2000.	.025	21.96	2.779	44.75
1.0	.013	1.30	1.5	3000.	.039	22.79	2500.	.037	27.93	2.998	50.73
1.0	.013	1.30	1.5	3000.	.039	22.79	3000.	.049	33.65	3.191	56.44
1.0	.013	1.30	2.0	1212.	.000	5.77	2000.	.025	24.40	2.516	30.16
1.0	.013	1.30	2.0	1212.	.000	5.77	2500.	.037	31.04	2.759	36.80
1.0	.013	1.30	2.0	1212.	.000	5.77	3000.	.049	37.39	2.974	43.15
1.0	.013	1.30	2.0	2500.	.027	14.35	2000.	.025	24.40	2.743	38.75
1.0	.013	1.30	2.0	2500.	.027	14.35	2500.	.037	31.04	2.986	45.39
1.0	.013	1.30	2.0	2500.	.027	14.35	3000.	.049	37.39	3.201	51.74
1.0	.013	1.30	2.0	3000.	.039	17.36	2000.	.025	24.40	2.839	41.75
1.0	.013	1.30	2.0	3000.	.039	17.36	2500.	.037	31.04	3.082	48.40
1.0	.013	1.30	2.0	3000.	.039	17.36	3000.	.049	37.39	3.297	54.74
1.0	.013	1.50	1.0	1230.	.000	9.92	2000.	.025	21.18	2.188	31.10
1.0	.013	1.50	1.0	1230.	.000	9.92	2500.	.036	26.71	2.359	36.63
1.0	.013	1.50	1.0	1230.	.000	9.92	3000.	.049	32.02	2.508	41.94
1.0	.013	1.50	1.0	2500.	.027	23.34	2000.	.025	21.18	2.556	44.51
1.0	.013	1.50	1.0	2500.	.027	23.34	2500.	.036	26.71	2.727	50.04
1.0	.013	1.50	1.0	2500.	.027	23.34	3000.	.049	32.02	2.876	55.35
1.0	.013	1.50	1.0	3000.	.039	28.13	2000.	.025	21.18	2.695	49.30
1.0	.013	1.50	1.0	3000.	.039	28.13	2500.	.036	26.71	2.867	54.84
1.0	.013	1.50	1.0	3000.	.039	28.13	3000.	.049	32.02	3.015	60.14
1.0	.013	1.50	1.5	1197.	.000	5.99	2000.	.025	25.41	2.467	31.40
1.0	.013	1.50	1.5	1197.	.000	5.99	2500.	.036	32.05	2.672	38.04
1.0	.013	1.50	1.5	1197.	.000	5.99	3000.	.049	38.42	2.851	44.41
1.0	.013	1.50	1.5	2500.	.027	15.87	2000.	.025	25.41	2.699	41.28
1.0	.013	1.50	1.5	2500.	.027	15.87	2500.	.036	32.05	2.905	47.92
1.0	.013	1.50	1.5	2500.	.027	15.87	3000.	.049	38.42	3.083	54.29
1.0	.013	1.50	1.5	3000.	.040	19.26	2000.	.025	25.41	2.817	44.67
1.0	.013	1.50	1.5	3000.	.040	19.26	2500.	.036	32.05	3.023	51.31
1.0	.013	1.50	1.5	3000.	.040	19.26	3000.	.049	38.42	3.201	57.68
1.0	.013	1.50	2.0	1163.	.000	3.27	2000.	.025	28.23	2.936	31.50
1.0	.013	1.50	2.0	1163.	.000	3.27	2500.	.036	35.61	3.164	38.88
1.0	.013	1.50	2.0	1163.	.000	3.27	3000.	.049	42.69	3.362	45.96
1.0	.013	1.50	2.0	2500.	.028	10.69	2000.	.025	28.23	2.907	38.93
1.0	.013	1.50	2.0	2500.	.028	10.69	2500.	.036	35.61	3.136	46.31
1.0	.013	1.50	2.0	2500.	.028	10.69	3000.	.049	42.69	3.334	53.38
1.0	.013	1.50	2.0	3000.	.040	13.11	2000.	.025	28.23	3.009	41.34
1.0	.013	1.50	2.0	3000.	.040	13.11	2500.	.036	35.61	3.237	48.72
1.0	.013	1.50	2.0	3000.	.040	13.11	3000.	.049	42.69	3.436	55.80

1.0	.013	1.70	1.0	1208.	.000	8.33	2000.	.024	23.41	2.292	31.73
1.0	.013	1.70	1.0	1208.	.000	8.33	2500.	.036	29.37	2.455	37.69
1.0	.013	1.70	1.0	1208.	.000	8.33	3000.	.048	35.10	2.596	43.43
1.0	.013	1.70	1.0	2500.	.027	21.07	2000.	.024	23.41	2.621	44.48
1.0	.013	1.70	1.0	2500.	.027	21.07	2500.	.036	29.37	2.785	50.44
1.0	.013	1.70	1.0	2500.	.027	21.07	3000.	.048	35.10	2.925	56.17
1.0	.013	1.70	1.0	3000.	.039	25.50	2000.	.024	23.41	2.766	48.90
1.0	.013	1.70	1.0	3000.	.039	25.50	2500.	.036	29.37	2.930	54.87
1.0	.013	1.70	1.0	3000.	.039	25.50	3000.	.048	35.10	3.070	60.60
1.0	.013	1.70	1.5	1163.	.000	3.92	2000.	.024	28.09	2.965	32.01
1.0	.013	1.70	1.5	1163.	.000	3.92	2500.	.036	35.24	3.161	39.17
1.0	.013	1.70	1.5	1163.	.000	3.92	3000.	.048	42.12	3.329	46.05
1.0	.013	1.70	1.5	2500.	.028	12.84	2000.	.024	28.09	2.932	40.92
1.0	.013	1.70	1.5	2500.	.028	12.84	2500.	.036	35.24	3.127	48.08
1.0	.013	1.70	1.5	2500.	.028	12.84	3000.	.048	42.12	3.296	54.96
1.0	.013	1.70	1.5	3000.	.040	15.73	2000.	.024	28.09	3.054	43.82
1.0	.013	1.70	1.5	3000.	.040	15.73	2500.	.036	35.24	3.250	50.97
1.0	.013	1.70	1.5	3000.	.040	15.73	3000.	.048	42.12	3.418	57.85
1.0	.013	1.70	2.0	1119.	.000	.73	2000.	.024	31.21	8.103	31.94
1.0	.013	1.70	2.0	1119.	.000	.73	2500.	.036	39.16	8.321	39.89
1.0	.013	1.70	2.0	1119.	.000	.73	3000.	.048	46.80	8.508	47.53
1.0	.013	1.70	2.0	2500.	.029	7.20	2000.	.024	31.21	3.534	38.41
1.0	.013	1.70	2.0	2500.	.029	7.20	2500.	.036	39.16	3.752	46.36
1.0	.013	1.70	2.0	2500.	.029	7.20	3000.	.048	46.80	3.939	54.00
1.0	.013	1.70	2.0	3000.	.041	9.22	2000.	.024	31.21	3.574	40.43
1.0	.013	1.70	2.0	3000.	.041	9.22	2500.	.036	39.16	3.792	48.38
1.0	.013	1.70	2.0	3000.	.041	9.22	3000.	.048	46.80	3.979	56.02
2.0	.008	1.30	1.0	1251.	.000	2.54	2000.	.020	18.44	3.731	20.98
2.0	.008	1.30	1.0	1251.	.000	2.54	2500.	.032	26.64	3.807	29.18
2.0	.008	1.30	1.0	1251.	.000	2.54	3000.	.044	34.61	3.881	37.15
2.0	.008	1.30	1.0	2500.	.026	21.70	2000.	.020	18.44	2.390	40.13
2.0	.008	1.30	1.0	2500.	.026	21.70	2500.	.032	26.64	2.466	48.34
2.0	.008	1.30	1.0	2500.	.026	21.70	3000.	.044	34.61	2.540	56.30
2.0	.008	1.30	1.0	3000.	.038	28.88	2000.	.020	18.44	2.426	47.32
2.0	.008	1.30	1.0	3000.	.038	28.88	2500.	.032	26.64	2.502	55.52
2.0	.008	1.30	1.0	3000.	.038	28.88	3000.	.044	34.61	2.575	63.49
2.0	.008	1.30	1.5	1229.	.000	1.31	2000.	.020	22.13	4.586	23.44
2.0	.008	1.30	1.5	1229.	.000	1.31	2500.	.032	31.97	4.678	33.28
2.0	.008	1.30	1.5	1229.	.000	1.31	3000.	.044	41.53	4.766	42.84
2.0	.008	1.30	1.5	2500.	.026	16.62	2000.	.020	22.13	2.374	38.75
2.0	.008	1.30	1.5	2500.	.026	16.62	2500.	.032	31.97	2.465	48.59
2.0	.008	1.30	1.5	2500.	.026	16.62	3000.	.044	41.53	2.553	58.15
2.0	.008	1.30	1.5	3000.	.039	22.26	2000.	.020	22.13	2.393	44.38
2.0	.008	1.30	1.5	3000.	.039	22.26	2500.	.032	31.97	2.485	54.22
2.0	.008	1.30	1.5	3000.	.039	22.26	3000.	.044	41.53	2.573	63.78
2.0	.008	1.30	2.0	1208.	.000	.46	2000.	.020	24.58	8.030	25.04
2.0	.008	1.30	2.0	1208.	.000	.46	2500.	.032	35.52	8.132	35.98
2.0	.008	1.30	2.0	1208.	.000	.46	3000.	.044	46.14	8.229	46.60
2.0	.008	1.30	2.0	2500.	.027	13.18	2000.	.020	24.58	2.373	37.76
2.0	.008	1.30	2.0	2500.	.027	13.18	2500.	.032	35.52	2.475	48.70
2.0	.008	1.30	2.0	2500.	.027	13.18	3000.	.044	46.14	2.572	59.32
2.0	.008	1.30	2.0	3000.	.039	17.76	2000.	.020	24.58	2.380	42.35
2.0	.008	1.30	2.0	3000.	.039	17.76	2500.	.032	35.52	2.482	53.28
2.0	.008	1.30	2.0	3000.	.039	17.76	3000.	.044	46.14	2.580	63.90

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	TT0	FAFAB	TS2	SFC	TST
2.0	.008	1.50	1.0	1226.	.000	1.49	2000.	.020	18.96	5.597	20.45
2.0	.008	1.50	1.0	1226.	.000	1.49	2500.	.031	27.26	5.682	28.75
2.0	.008	1.50	1.0	1226.	.000	1.49	3000.	.044	35.32	5.759	36.82
2.0	.008	1.50	1.0	2500.	.026	20.63	2000.	.020	18.96	2.434	39.59
2.0	.008	1.50	1.0	2500.	.026	20.63	2500.	.031	27.26	2.520	47.89
2.0	.008	1.50	1.0	2500.	.026	20.63	3000.	.044	35.32	2.597	55.95
2.0	.008	1.50	1.0	3000.	.039	27.64	2000.	.020	18.96	2.457	46.60
2.0	.008	1.50	1.0	3000.	.039	27.64	2500.	.031	27.26	2.543	54.90
2.0	.008	1.50	1.0	3000.	.039	27.64	3000.	.044	35.32	2.620	62.97
2.0	.008	1.50	1.5	1192.	.000	-.03	2000.	.020	22.75	-151.256	22.72
2.0	.008	1.50	1.5	1192.	.000	-.03	2500.	.031	32.71	-151.154	32.68
2.0	.008	1.50	1.5	1192.	.000	-.03	3000.	.044	42.39	-151.061	42.36
2.0	.008	1.50	1.5	2500.	.027	15.16	2000.	.020	22.75	2.456	37.91
2.0	.008	1.50	1.5	2500.	.027	15.16	2500.	.031	32.71	2.558	47.87
2.0	.008	1.50	1.5	2500.	.027	15.16	3000.	.044	42.39	2.651	57.55
2.0	.008	1.50	1.5	3000.	.039	20.56	2000.	.020	22.75	2.455	43.31
2.0	.008	1.50	1.5	3000.	.039	20.56	2500.	.031	32.71	2.557	53.27
2.0	.008	1.50	1.5	3000.	.039	20.56	3000.	.044	42.39	2.650	62.95
2.0	.008	1.50	2.0	1159.	.000	-1.14	2000.	.020	25.28	-1.453	24.14
2.0	.008	1.50	2.0	1159.	.000	-1.14	2500.	.031	36.34	-1.339	35.21
2.0	.008	1.50	2.0	1159.	.000	-1.14	3000.	.044	47.10	-1.236	45.96
2.0	.008	1.50	2.0	2500.	.028	11.32	2000.	.020	25.28	2.512	36.60
2.0	.008	1.50	2.0	2500.	.028	11.32	2500.	.031	36.34	2.626	47.67
2.0	.008	1.50	2.0	2500.	.028	11.32	3000.	.044	47.10	2.729	58.42
2.0	.008	1.50	2.0	3000.	.040	15.62	2000.	.020	25.28	2.485	40.89
2.0	.008	1.50	2.0	3000.	.040	15.62	2500.	.031	36.34	2.599	51.96
2.0	.008	1.50	2.0	3000.	.040	15.62	3000.	.044	47.10	2.702	62.71
2.0	.008	1.70	1.0	1204.	.000	.49	2000.	.020	19.38	15.098	19.87
2.0	.008	1.70	1.0	1204.	.000	.49	2500.	.031	27.76	15.191	28.25
2.0	.008	1.70	1.0	1204.	.000	.49	3000.	.043	35.90	15.271	36.39
2.0	.008	1.70	1.0	2500.	.027	19.54	2000.	.020	19.38	2.497	38.92
2.0	.008	1.70	1.0	2500.	.027	19.54	2500.	.031	27.76	2.590	47.30
2.0	.008	1.70	1.0	2500.	.027	19.54	3000.	.043	35.90	2.670	55.44
2.0	.008	1.70	1.0	3000.	.039	26.39	2000.	.020	19.38	2.505	45.77
2.0	.008	1.70	1.0	3000.	.039	26.39	2500.	.031	27.76	2.598	54.15
2.0	.008	1.70	1.0	3000.	.039	26.39	3000.	.043	35.90	2.678	62.29
2.0	.008	1.70	1.5	1159.	.000	-1.36	2000.	.020	23.25	-2.174	21.89
2.0	.008	1.70	1.5	1159.	.000	-1.36	2500.	.031	33.31	-2.064	31.95
2.0	.008	1.70	1.5	1159.	.000	-1.36	3000.	.043	43.08	-1.967	41.72
2.0	.008	1.70	1.5	2500.	.028	13.59	2000.	.020	23.25	2.589	36.85
2.0	.008	1.70	1.5	2500.	.028	13.59	2500.	.031	33.31	2.699	46.90
2.0	.008	1.70	1.5	2500.	.028	13.59	3000.	.043	43.08	2.796	56.67
2.0	.008	1.70	1.5	3000.	.040	18.74	2000.	.020	23.25	2.556	42.00
2.0	.008	1.70	1.5	3000.	.040	18.74	2500.	.031	33.31	2.667	52.05
2.0	.008	1.70	1.5	3000.	.040	18.74	3000.	.043	43.08	2.764	61.82
2.0	.008	1.70	2.0	1114.	.000	-2.79	2000.	.020	25.84	.104	23.05
2.0	.008	1.70	2.0	1114.	.000	-2.79	2500.	.031	37.01	.227	34.22
2.0	.008	1.70	2.0	1114.	.000	-2.79	3000.	.043	47.87	.335	45.08
2.0	.008	1.70	2.0	2500.	.028	9.20	2000.	.020	25.84	2.786	35.04
2.0	.008	1.70	2.0	2500.	.028	9.20	2500.	.031	37.01	2.909	46.21
2.0	.008	1.70	2.0	2500.	.028	9.20	3000.	.043	47.87	3.016	57.06
2.0	.008	1.70	2.0	3000.	.041	13.15	2000.	.020	25.84	2.689	38.99
2.0	.008	1.70	2.0	3000.	.041	13.15	2500.	.031	37.01	2.812	50.16
2.0	.008	1.70	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02

FMN	FAMB	FPRSL	BPR	T6	PAMB	V3V	PT6				
3.0	.008	1.30	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.30	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.50	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02

ALTITUDE 10000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.008	1.70	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	1.5	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2000.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	2500.	.043	47.87	2.920	61.02
3.0	.008	1.70	2.0	3000.	.041	13.15	3000.	.043	47.87	2.920	61.02

FAN	FAMB	FPRSL	BPR	T6	FARB	TSI	TTO	FAPAB	TS2	SFC	TSI
1.0	.013	1.30	1.0	1251.	.000	13.76	2000.	.026	19.39	2.065	33.14
1.0	.013	1.30	1.0	1251.	.000	13.76	2500.	.037	24.46	2.243	38.22
1.0	.013	1.30	1.0	1251.	.000	13.76	3000.	.050	29.31	2.400	43.07
1.0	.013	1.30	1.0	2500.	.026	28.93	2000.	.026	19.39	2.418	48.32
1.0	.013	1.30	1.0	2500.	.026	28.93	2500.	.037	24.46	2.596	53.39
1.0	.013	1.30	1.0	2500.	.026	28.93	3000.	.050	29.31	2.753	58.24
1.0	.013	1.30	1.0	3000.	.038	34.52	2000.	.026	19.39	2.541	53.91
1.0	.013	1.30	1.0	3000.	.038	34.52	2500.	.037	24.46	2.719	58.98
1.0	.013	1.30	1.0	3000.	.038	34.52	3000.	.050	29.31	2.876	63.83
1.0	.013	1.30	1.5	1230.	.000	9.97	2000.	.026	23.26	2.202	33.23
1.0	.013	1.30	1.5	1230.	.000	9.97	2500.	.037	29.35	2.415	39.32
1.0	.013	1.30	1.5	1230.	.000	9.97	3000.	.050	35.17	2.604	45.14
1.0	.013	1.30	1.5	2500.	.026	21.79	2000.	.026	23.26	2.484	45.05
1.0	.013	1.30	1.5	2500.	.026	21.79	2500.	.037	29.35	2.698	51.14
1.0	.013	1.30	1.5	2500.	.026	21.79	3000.	.050	35.17	2.886	56.96
1.0	.013	1.30	1.5	3000.	.039	26.04	2000.	.026	23.26	2.585	49.31
1.0	.013	1.30	1.5	3000.	.039	26.04	2500.	.037	29.35	2.799	55.39
1.0	.013	1.30	1.5	3000.	.039	26.04	3000.	.050	35.17	2.988	61.22
1.0	.013	1.30	2.0	1209.	.000	7.39	2000.	.026	25.85	2.313	33.24
1.0	.013	1.30	2.0	1209.	.000	7.39	2500.	.037	32.61	2.550	40.00
1.0	.013	1.30	2.0	1209.	.000	7.39	3000.	.050	39.08	2.760	46.47
1.0	.013	1.30	2.0	2500.	.027	16.91	2000.	.026	25.85	2.543	42.75
1.0	.013	1.30	2.0	2500.	.027	16.91	2500.	.037	32.61	2.780	49.52
1.0	.013	1.30	2.0	2500.	.027	16.91	3000.	.050	39.08	2.990	55.99
1.0	.013	1.30	2.0	3000.	.039	20.25	2000.	.026	25.85	2.630	46.10
1.0	.013	1.30	2.0	3000.	.039	20.25	2500.	.037	32.61	2.867	52.87
1.0	.013	1.30	2.0	3000.	.039	20.25	3000.	.050	39.08	3.077	59.33
1.0	.013	1.50	1.0	1227.	.000	12.25	2000.	.025	22.40	1.993	34.66
1.0	.013	1.50	1.0	1227.	.000	12.25	2500.	.037	28.06	2.159	40.31
1.0	.013	1.50	1.0	1227.	.000	12.25	3000.	.049	33.48	2.303	45.74
1.0	.013	1.50	1.0	2500.	.026	26.95	2000.	.025	22.40	2.345	49.36
1.0	.013	1.50	1.0	2500.	.026	26.95	2500.	.037	28.06	2.511	55.01
1.0	.013	1.50	1.0	2500.	.026	26.95	3000.	.049	33.48	2.656	60.44
1.0	.013	1.50	1.0	3000.	.039	32.23	2000.	.025	22.40	2.472	54.63
1.0	.013	1.50	1.0	3000.	.039	32.23	2500.	.037	28.06	2.638	60.29
1.0	.013	1.50	1.0	3000.	.039	32.23	3000.	.049	33.48	2.783	65.71
1.0	.013	1.50	1.5	1193.	.000	8.01	2000.	.025	26.89	2.176	34.90
1.0	.013	1.50	1.5	1193.	.000	8.01	2500.	.037	33.67	2.374	41.68
1.0	.013	1.50	1.5	1193.	.000	8.01	3000.	.049	40.18	2.548	48.19
1.0	.013	1.50	1.5	2500.	.027	19.09	2000.	.025	26.89	2.440	45.97
1.0	.013	1.50	1.5	2500.	.027	19.09	2500.	.037	33.67	2.639	52.76
1.0	.013	1.50	1.5	2500.	.027	19.09	3000.	.049	40.18	2.812	59.27
1.0	.013	1.50	1.5	3000.	.040	22.91	2000.	.025	26.89	2.547	49.80
1.0	.013	1.50	1.5	3000.	.040	22.91	2500.	.037	33.67	2.746	56.58
1.0	.013	1.50	1.5	3000.	.040	22.91	3000.	.049	40.18	2.919	63.09
1.0	.013	1.50	2.0	1159.	.000	5.03	2000.	.025	29.87	2.414	34.90
1.0	.013	1.50	2.0	1159.	.000	5.03	2500.	.037	37.41	2.634	42.44
1.0	.013	1.50	2.0	1159.	.000	5.03	3000.	.049	44.64	2.827	49.67
1.0	.013	1.50	2.0	2500.	.028	13.49	2000.	.025	29.87	2.574	43.36
1.0	.013	1.50	2.0	2500.	.028	13.49	2500.	.037	37.41	2.795	50.90
1.0	.013	1.50	2.0	2500.	.028	13.49	3000.	.049	44.64	2.988	58.13
1.0	.013	1.50	2.0	3000.	.040	16.29	2000.	.025	29.87	2.669	46.16
1.0	.013	1.50	2.0	3000.	.040	16.29	2500.	.037	37.41	2.889	53.70
1.0	.013	1.50	2.0	3000.	.040	16.29	3000.	.049	44.64	3.082	60.93

FAN	FAMB	FFRSE	BPR								
1.0	.013	1.70	1.0	1204.	.000	10.79	2000.	.025	24.72	2.016	35.51
1.0	.013	1.70	1.0	1204.	.000	10.79	2500.	.036	30.81	2.174	41.61
1.0	.013	1.70	1.0	1204.	.000	10.79	3000.	.049	36.68	2.310	47.47
1.0	.013	1.70	1.0	2500.	.027	24.95	2000.	.025	24.72	2.358	49.67
1.0	.013	1.70	1.0	2500.	.027	24.95	2500.	.036	30.81	2.516	55.76
1.0	.013	1.70	1.0	2500.	.027	24.95	3000.	.049	36.68	2.652	61.63
1.0	.013	1.70	1.0	3000.	.039	29.91	2000.	.025	24.72	2.490	54.62
1.0	.013	1.70	1.0	3000.	.039	29.91	2500.	.036	30.81	2.647	60.72
1.0	.013	1.70	1.0	3000.	.039	29.91	3000.	.049	36.68	2.783	66.59
1.0	.013	1.70	1.5	1159.	.000	6.04	2000.	.025	29.66	2.358	35.70
1.0	.013	1.70	1.5	1159.	.000	6.04	2500.	.036	36.98	2.546	43.01
1.0	.013	1.70	1.5	1159.	.000	6.04	3000.	.049	44.02	2.710	50.05
1.0	.013	1.70	1.5	2500.	.028	16.19	2000.	.025	29.66	2.550	45.85
1.0	.013	1.70	1.5	2500.	.028	16.19	2500.	.036	36.98	2.739	53.17
1.0	.013	1.70	1.5	2500.	.028	16.19	3000.	.049	44.02	2.903	60.20
1.0	.013	1.70	1.5	3000.	.040	19.55	2000.	.025	29.66	2.664	49.22
1.0	.013	1.70	1.5	3000.	.040	19.55	2500.	.036	36.98	2.853	56.53
1.0	.013	1.70	1.5	3000.	.040	19.55	3000.	.049	44.02	3.016	63.57
1.0	.013	1.70	2.0	1114.	.000	2.67	2000.	.025	32.96	3.200	35.63
1.0	.013	1.70	2.0	1114.	.000	2.67	2500.	.036	41.09	3.410	43.76
1.0	.013	1.70	2.0	1114.	.000	2.67	3000.	.049	48.91	3.591	51.58
1.0	.013	1.70	2.0	2500.	.029	10.04	2000.	.025	32.96	2.881	43.00
1.0	.013	1.70	2.0	2500.	.029	10.04	2500.	.036	41.09	3.090	51.13
1.0	.013	1.70	2.0	2500.	.029	10.04	3000.	.049	48.91	3.272	58.95
1.0	.013	1.70	2.0	3000.	.041	12.33	2000.	.025	32.96	2.973	45.29
1.0	.013	1.70	2.0	3000.	.041	12.33	2500.	.036	41.09	3.183	53.42
1.0	.013	1.70	2.0	3000.	.041	12.33	3000.	.049	48.91	3.364	61.24
2.0	.009	1.30	1.0	1250.	.000	4.47	2000.	.021	19.84	2.743	24.31
2.0	.009	1.30	1.0	1250.	.000	4.47	2500.	.033	28.08	2.822	32.55
2.0	.009	1.30	1.0	1250.	.000	4.47	3000.	.045	36.08	2.897	40.55
2.0	.009	1.30	1.0	2500.	.026	24.12	2000.	.021	19.84	2.267	43.96
2.0	.009	1.30	1.0	2500.	.026	24.12	2500.	.033	28.08	2.346	52.20
2.0	.009	1.30	1.0	2500.	.026	24.12	3000.	.045	36.08	2.421	60.20
2.0	.009	1.30	1.0	3000.	.038	31.50	2000.	.021	19.84	2.314	51.34
2.0	.009	1.30	1.0	3000.	.038	31.50	2500.	.033	28.08	2.394	59.58
2.0	.009	1.30	1.0	3000.	.038	31.50	3000.	.045	36.08	2.469	67.58
2.0	.009	1.30	1.5	1229.	.000	2.89	2000.	.021	23.81	2.917	26.70
2.0	.009	1.30	1.5	1229.	.000	2.89	2500.	.033	33.70	3.012	36.59
2.0	.009	1.30	1.5	1229.	.000	2.89	3000.	.045	43.30	3.102	46.19
2.0	.009	1.30	1.5	2500.	.026	18.64	2000.	.021	23.81	2.252	42.45
2.0	.009	1.30	1.5	2500.	.026	18.64	2500.	.033	33.70	2.347	52.34
2.0	.009	1.30	1.5	2500.	.026	18.64	3000.	.045	43.30	2.437	61.94
2.0	.009	1.30	1.5	3000.	.039	24.44	2000.	.021	23.81	2.284	48.25
2.0	.009	1.30	1.5	3000.	.039	24.44	2500.	.033	33.70	2.379	58.14
2.0	.009	1.30	1.5	3000.	.039	24.44	3000.	.045	43.30	2.469	67.74
2.0	.009	1.30	2.0	1208.	.000	1.82	2000.	.021	26.46	3.233	28.27
2.0	.009	1.30	2.0	1208.	.000	1.82	2500.	.033	37.44	3.339	39.26
2.0	.009	1.30	2.0	1208.	.000	1.82	3000.	.045	48.11	3.439	49.93
2.0	.009	1.30	2.0	2500.	.027	14.93	2000.	.021	26.46	2.248	41.38
2.0	.009	1.30	2.0	2500.	.027	14.93	2500.	.033	37.44	2.354	52.37
2.0	.009	1.30	2.0	2500.	.027	14.93	3000.	.045	48.11	2.454	63.04
2.0	.009	1.30	2.0	3000.	.039	19.67	2000.	.021	26.46	2.269	46.12
2.0	.009	1.30	2.0	3000.	.039	19.67	2500.	.033	37.44	2.375	57.11
2.0	.009	1.30	2.0	3000.	.039	19.67	3000.	.045	48.11	2.475	67.78

PHN	PAMB	PPRSE	BPR								
2.0	.009	1.50	1.0	1226.	.000	3.48	2000.	.021	20.40	3.200	23.88
2.0	.009	1.50	1.0	1226.	.000	3.48	2500.	.032	28.74	3.287	32.22
2.0	.009	1.50	1.0	1226.	.000	3.48	3000.	.045	36.84	3.365	40.33
2.0	.009	1.50	1.0	2500.	.026	23.16	2000.	.021	20.40	2.293	43.56
2.0	.009	1.50	1.0	2500.	.026	23.16	2500.	.032	28.74	2.380	51.90
2.0	.009	1.50	1.0	2500.	.026	23.16	3000.	.045	36.84	2.458	60.01
2.0	.009	1.50	1.0	3000.	.039	30.39	2000.	.021	20.40	2.332	50.79
2.0	.009	1.50	1.0	3000.	.039	30.39	2500.	.032	28.74	2.419	59.13
2.0	.009	1.50	1.0	3000.	.039	30.39	3000.	.045	36.84	2.497	67.24
2.0	.009	1.50	1.5	1192.	.000	1.63	2000.	.021	24.47	4.218	26.11
2.0	.009	1.50	1.5	1192.	.000	1.63	2500.	.032	34.49	4.322	36.12
2.0	.009	1.50	1.5	1192.	.000	1.63	3000.	.045	44.21	4.416	45.84
2.0	.009	1.50	1.5	2500.	.027	17.33	2000.	.021	24.47	2.302	41.81
2.0	.009	1.50	1.5	2500.	.027	17.33	2500.	.032	34.49	2.406	51.82
2.0	.009	1.50	1.5	2500.	.027	17.33	3000.	.045	44.21	2.500	61.54
2.0	.009	1.50	1.5	3000.	.039	22.93	2000.	.021	24.47	2.321	47.40
2.0	.009	1.50	1.5	3000.	.039	22.93	2500.	.032	34.49	2.425	57.41
2.0	.009	1.50	1.5	3000.	.039	22.93	3000.	.045	44.21	2.519	67.14
2.0	.009	1.50	2.0	1158.	.000	.31	2000.	.021	27.19	12.460	27.51
2.0	.009	1.50	2.0	1158.	.000	.31	2500.	.032	38.32	12.576	38.63
2.0	.009	1.50	2.0	1158.	.000	.31	3000.	.045	49.12	12.680	49.44
2.0	.009	1.50	2.0	2500.	.028	13.27	2000.	.021	27.19	2.334	40.46
2.0	.009	1.50	2.0	2500.	.028	13.27	2500.	.032	38.32	2.450	51.59
2.0	.009	1.50	2.0	2500.	.028	13.27	3000.	.045	49.12	2.555	62.39
2.0	.009	1.50	2.0	3000.	.040	17.74	2000.	.021	27.19	2.336	44.94
2.0	.009	1.50	2.0	3000.	.040	17.74	2500.	.032	38.32	2.451	56.06
2.0	.009	1.50	2.0	3000.	.040	17.74	3000.	.045	49.12	2.556	66.87
2.0	.009	1.70	1.0	1203.	.000	2.53	2000.	.021	20.84	4.013	23.37
2.0	.009	1.70	1.0	1203.	.000	2.53	2500.	.032	29.26	4.106	31.80
2.0	.009	1.70	1.0	1203.	.000	2.53	3000.	.044	37.45	4.187	39.99
2.0	.009	1.70	1.0	2500.	.027	22.19	2000.	.021	20.84	2.333	43.03
2.0	.009	1.70	1.0	2500.	.027	22.19	2500.	.032	29.26	2.426	51.46
2.0	.009	1.70	1.0	2500.	.027	22.19	3000.	.044	37.45	2.507	59.65
2.0	.009	1.70	1.0	3000.	.039	29.27	2000.	.021	20.84	2.363	50.11
2.0	.009	1.70	1.0	3000.	.039	29.27	2500.	.032	29.26	2.456	58.53
2.0	.009	1.70	1.0	3000.	.039	29.27	3000.	.044	37.45	2.537	66.72
2.0	.009	1.70	1.5	1158.	.000	.38	2000.	.021	25.01	14.467	25.38
2.0	.009	1.70	1.5	1158.	.000	.38	2500.	.032	35.12	14.578	35.50
2.0	.009	1.70	1.5	1158.	.000	.38	3000.	.044	44.94	14.676	45.32
2.0	.009	1.70	1.5	2500.	.028	15.92	2000.	.021	25.01	2.386	40.93
2.0	.009	1.70	1.5	2500.	.028	15.92	2500.	.032	35.12	2.497	51.04
2.0	.009	1.70	1.5	2500.	.028	15.92	3000.	.044	44.94	2.595	60.87
2.0	.009	1.70	1.5	3000.	.040	21.29	2000.	.021	25.01	2.388	46.30
2.0	.009	1.70	1.5	3000.	.040	21.29	2500.	.032	35.12	2.499	56.41
2.0	.009	1.70	1.5	3000.	.040	21.29	3000.	.044	44.94	2.596	66.23
2.0	.009	1.70	2.0	1113.	.000	-1.23	2000.	.021	27.78	-1.663	26.55
2.0	.009	1.70	2.0	1113.	.000	-1.23	2500.	.032	39.02	-1.539	37.78
2.0	.009	1.70	2.0	1113.	.000	-1.23	3000.	.044	49.94	-1.431	48.70
2.0	.009	1.70	2.0	2500.	.029	11.36	2000.	.021	27.78	2.500	39.15
2.0	.009	1.70	2.0	2500.	.029	11.36	2500.	.032	39.02	2.623	50.38
2.0	.009	1.70	2.0	2500.	.029	11.36	3000.	.044	49.94	2.731	61.30
2.0	.009	1.70	2.0	3000.	.041	15.53	2000.	.021	27.78	2.466	43.32
2.0	.009	1.70	2.0	3000.	.041	15.53	2500.	.032	39.02	2.589	54.55
2.0	.009	1.70	2.0	3000.	.041	15.53	3000.	.044	49.94	2.698	65.47

PHN	PAMB	VPRSE	BPR	VO	VMAS	VOT	VS	VSAT	VSAT	VSAT
3.0	.001	1.30	1.0	1237.	.000	-8.70	2000.	.014	7.66	1.530	-1.04
3.0	.001	1.30	1.0	1237.	.000	-8.70	2500.	.025	16.61	1.233	7.91
3.0	.001	1.30	1.0	1237.	.000	-8.70	3000.	.037	25.34	1.189	16.64
3.0	.001	1.30	1.0	2500.	.026	13.17	2000.	.014	7.66	3.500	20.83
3.0	.001	1.30	1.0	2500.	.026	13.17	2500.	.025	16.61	3.202	29.78
3.0	.001	1.30	1.0	2500.	.026	13.17	3000.	.037	25.34	3.159	38.51
3.0	.001	1.30	1.0	3000.	.038	21.36	2000.	.014	7.66	3.303	29.02
3.0	.001	1.30	1.0	3000.	.038	21.36	2500.	.025	16.61	3.005	37.97
3.0	.001	1.30	1.0	3000.	.038	21.36	3000.	.037	25.34	2.962	46.69
3.0	.001	1.30	1.5	1216.	.000	-7.46	2000.	.014	9.19	1.898	1.73
3.0	.001	1.30	1.5	1216.	.000	-7.46	2500.	.025	19.93	1.541	12.47
3.0	.001	1.30	1.5	1216.	.000	-7.46	3000.	.037	30.40	1.489	22.94
3.0	.001	1.30	1.5	2500.	.026	10.24	2000.	.014	9.19	3.531	19.43
3.0	.001	1.30	1.5	2500.	.026	10.24	2500.	.025	19.93	3.174	30.17
3.0	.001	1.30	1.5	2500.	.026	10.24	3000.	.037	30.40	3.122	40.64
3.0	.001	1.30	1.5	3000.	.038	16.75	2000.	.014	9.19	3.350	25.94
3.0	.001	1.30	1.5	3000.	.038	16.75	2500.	.025	19.93	2.993	36.68
3.0	.001	1.30	1.5	3000.	.038	16.75	3000.	.037	30.40	2.941	47.15
3.0	.001	1.30	2.0	1194.	.000	-6.65	2000.	.014	10.21	2.143	3.56
3.0	.001	1.30	2.0	1194.	.000	-6.65	2500.	.025	22.14	1.746	15.50
3.0	.001	1.30	2.0	1194.	.000	-6.65	3000.	.037	33.78	1.688	27.13
3.0	.001	1.30	2.0	2500.	.026	8.26	2000.	.014	10.21	3.560	18.47
3.0	.001	1.30	2.0	2500.	.026	8.26	2500.	.025	22.14	3.163	30.41
3.0	.001	1.30	2.0	2500.	.026	8.26	3000.	.037	33.78	3.105	42.04
3.0	.001	1.30	2.0	3000.	.038	13.64	2000.	.014	10.21	3.386	23.85
3.0	.001	1.30	2.0	3000.	.038	13.64	2500.	.025	22.14	2.989	35.78
3.0	.001	1.30	2.0	3000.	.038	13.64	3000.	.037	33.78	2.931	47.42
3.0	.001	1.50	1.0	1212.	.000	-9.42	2000.	.014	7.72	1.474	-1.70
3.0	.001	1.50	1.0	1212.	.000	-9.42	2500.	.025	16.68	1.211	7.26
3.0	.001	1.50	1.0	1212.	.000	-9.42	3000.	.037	25.42	1.178	16.00
3.0	.001	1.50	1.0	2500.	.026	12.74	2000.	.014	7.72	3.528	20.47
3.0	.001	1.50	1.0	2500.	.026	12.74	2500.	.025	16.68	3.265	29.43
3.0	.001	1.50	1.0	2500.	.026	12.74	3000.	.037	25.42	3.232	38.17
3.0	.001	1.50	1.0	3000.	.038	20.86	2000.	.014	7.72	3.296	28.59
3.0	.001	1.50	1.0	3000.	.038	20.86	2500.	.025	16.68	3.034	37.55
3.0	.001	1.50	1.0	3000.	.038	20.86	3000.	.037	25.42	3.000	46.29
3.0	.001	1.50	1.5	1178.	.000	-8.37	2000.	.014	9.27	1.829	.90
3.0	.001	1.50	1.5	1178.	.000	-8.37	2500.	.025	20.02	1.514	11.65
3.0	.001	1.50	1.5	1178.	.000	-8.37	3000.	.037	30.51	1.474	22.14
3.0	.001	1.50	1.5	2500.	.027	9.65	2000.	.014	9.27	3.587	18.92
3.0	.001	1.50	1.5	2500.	.027	9.65	2500.	.025	20.02	3.272	29.67
3.0	.001	1.50	1.5	2500.	.027	9.65	3000.	.037	30.51	3.231	40.16
3.0	.001	1.50	1.5	3000.	.039	16.06	2000.	.014	9.27	3.354	25.33
3.0	.001	1.50	1.5	3000.	.039	16.06	2500.	.025	20.02	3.039	36.08
3.0	.001	1.50	1.5	3000.	.039	16.06	3000.	.037	30.51	2.998	46.57
3.0	.001	1.50	2.0	1144.	.000	-7.71	2000.	.014	10.30	2.065	2.59
3.0	.001	1.50	2.0	1144.	.000	-7.71	2500.	.025	22.25	1.714	14.54
3.0	.001	1.50	2.0	1144.	.000	-7.71	3000.	.037	33.90	1.670	26.19
3.0	.001	1.50	2.0	2500.	.027	7.50	2000.	.014	10.30	3.656	17.80
3.0	.001	1.50	2.0	2500.	.027	7.50	2500.	.025	22.25	3.306	29.75
3.0	.001	1.50	2.0	2500.	.027	7.50	3000.	.037	33.90	3.261	41.40
3.0	.001	1.50	2.0	3000.	.039	12.76	2000.	.014	10.30	3.407	23.06
3.0	.001	1.50	2.0	3000.	.039	12.76	2500.	.025	22.25	3.057	35.01
3.0	.001	1.50	2.0	3000.	.039	12.76	3000.	.037	33.90	3.012	46.66

ALTITUDE 20000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.001	1.70	1.0	1190.	.000	-10.11	2000.	.013	7.78	1.424	-2.33
3.0	.001	1.70	1.0	1190.	.000	-10.11	2500.	.024	16.74	1.192	6.64
3.0	.001	1.70	1.0	1190.	.000	-10.11	3000.	.036	25.49	1.167	15.39
3.0	.001	1.70	1.0	2500.	.026	12.30	2000.	.013	7.78	3.569	20.08
3.0	.001	1.70	1.0	2500.	.026	12.30	2500.	.024	16.74	3.337	29.05
3.0	.001	1.70	1.0	2500.	.026	12.30	3000.	.036	25.49	3.312	37.80
3.0	.001	1.70	1.0	3000.	.038	20.36	2000.	.013	7.78	3.300	28.13
3.0	.001	1.70	1.0	3000.	.038	20.36	2500.	.024	16.74	3.068	37.10
3.0	.001	1.70	1.0	3000.	.038	20.36	3000.	.036	25.49	3.043	45.85
3.0	.001	1.70	1.5	1144.	.000	-9.25	2000.	.013	9.33	1.768	.08
3.0	.001	1.70	1.5	1144.	.000	-9.25	2500.	.024	20.09	1.489	10.84
3.0	.001	1.70	1.5	1144.	.000	-9.25	3000.	.036	30.59	1.459	21.34
3.0	.001	1.70	1.5	2500.	.027	9.00	2000.	.013	9.33	3.677	18.34
3.0	.001	1.70	1.5	2500.	.027	9.00	2500.	.024	20.09	3.399	29.10
3.0	.001	1.70	1.5	2500.	.027	9.00	3000.	.036	30.59	3.369	39.59
3.0	.001	1.70	1.5	3000.	.039	15.32	2000.	.013	9.33	3.379	24.65
3.0	.001	1.70	1.5	3000.	.039	15.32	2500.	.024	20.09	3.100	35.41
3.0	.001	1.70	1.5	3000.	.039	15.32	3000.	.036	30.59	3.070	45.91
3.0	.001	1.70	2.0	1098.	.000	-8.77	2000.	.013	10.37	1.995	1.60
3.0	.001	1.70	2.0	1098.	.000	-8.77	2500.	.024	22.33	1.686	13.55
3.0	.001	1.70	2.0	1098.	.000	-8.77	3000.	.036	33.99	1.652	25.22
3.0	.001	1.70	2.0	2500.	.028	6.62	2000.	.013	10.37	3.833	16.99
3.0	.001	1.70	2.0	2500.	.028	6.62	2500.	.024	22.33	3.524	28.94
3.0	.001	1.70	2.0	2500.	.028	6.62	3000.	.036	33.99	3.491	40.61
3.0	.001	1.70	2.0	3000.	.040	11.74	2000.	.013	10.37	3.471	22.11
3.0	.001	1.70	2.0	3000.	.040	11.74	2500.	.024	22.33	3.161	34.06
3.0	.001	1.70	2.0	3000.	.040	11.74	3000.	.036	33.99	3.128	45.73

PHN	PAHB	PPRSE	BPR								
1.0	.015	1.30	1.0	1246.	.000	15.75	2000.	.028	20.64	2.073	36.39
1.0	.015	1.30	1.0	1246.	.000	15.75	2500.	.040	25.87	2.257	41.63
1.0	.015	1.30	1.0	1246.	.000	15.75	3000.	.054	30.90	2.421	46.65
1.0	.015	1.30	1.0	2500.	.028	32.12	2000.	.028	20.64	2.414	52.76
1.0	.015	1.30	1.0	2500.	.028	32.12	2500.	.040	25.87	2.599	57.99
1.0	.015	1.30	1.0	2500.	.028	32.12	3000.	.054	30.90	2.763	63.02
1.0	.015	1.30	1.0	3000.	.041	38.20	2000.	.028	20.64	2.534	58.84
1.0	.015	1.30	1.0	3000.	.041	38.20	2500.	.040	25.87	2.718	64.07
1.0	.015	1.30	1.0	3000.	.041	38.20	3000.	.054	30.90	2.882	69.10
1.0	.015	1.30	1.5	1225.	.000	11.65	2000.	.028	24.77	2.203	36.42
1.0	.015	1.30	1.5	1225.	.000	11.65	2500.	.040	31.05	2.424	42.70
1.0	.015	1.30	1.5	1225.	.000	11.65	3000.	.054	37.08	2.621	48.73
1.0	.015	1.30	1.5	2500.	.028	24.50	2000.	.028	24.77	2.477	49.26
1.0	.015	1.30	1.5	2500.	.028	24.50	2500.	.040	31.05	2.699	55.55
1.0	.015	1.30	1.5	2500.	.028	24.50	3000.	.054	37.08	2.895	61.58
1.0	.015	1.30	1.5	3000.	.041	29.17	2000.	.028	24.77	2.575	53.93
1.0	.015	1.30	1.5	3000.	.041	29.17	2500.	.040	31.05	2.797	60.22
1.0	.015	1.30	1.5	3000.	.041	29.17	3000.	.054	37.08	2.993	66.25
1.0	.015	1.30	2.0	1203.	.000	8.87	2000.	.028	27.52	2.301	36.39
1.0	.015	1.30	2.0	1203.	.000	8.87	2500.	.040	34.50	2.547	43.37
1.0	.015	1.30	2.0	1203.	.000	8.87	3000.	.054	41.20	2.766	50.07
1.0	.015	1.30	2.0	2500.	.029	19.31	2000.	.028	27.52	2.529	46.83
1.0	.015	1.30	2.0	2500.	.029	19.31	2500.	.040	34.50	2.775	53.81
1.0	.015	1.30	2.0	2500.	.029	19.31	3000.	.054	41.20	2.994	60.51
1.0	.015	1.30	2.0	3000.	.042	23.03	2000.	.028	27.52	2.613	50.55
1.0	.015	1.30	2.0	3000.	.042	23.03	2500.	.040	34.50	2.859	57.52
1.0	.015	1.30	2.0	3000.	.042	23.03	3000.	.054	41.20	3.077	64.23
1.0	.015	1.50	1.0	1221.	.000	14.37	2000.	.028	23.82	1.974	38.19
1.0	.015	1.50	1.0	1221.	.000	14.37	2500.	.040	29.67	2.144	44.05
1.0	.015	1.50	1.0	1221.	.000	14.37	3000.	.053	35.32	2.293	49.69
1.0	.015	1.50	1.0	2500.	.028	30.38	2000.	.028	23.82	2.317	54.20
1.0	.015	1.50	1.0	2500.	.028	30.38	2500.	.040	29.67	2.487	60.05
1.0	.015	1.50	1.0	2500.	.028	30.38	3000.	.053	35.32	2.637	65.69
1.0	.015	1.50	1.0	3000.	.041	36.18	2000.	.028	23.82	2.440	60.00
1.0	.015	1.50	1.0	3000.	.041	36.18	2500.	.040	29.67	2.610	65.85
1.0	.015	1.50	1.0	3000.	.041	36.18	3000.	.053	35.32	2.759	71.49
1.0	.015	1.50	1.5	1188.	.000	9.86	2000.	.028	28.58	2.119	38.45
1.0	.015	1.50	1.5	1188.	.000	9.86	2500.	.040	35.61	2.324	45.47
1.0	.015	1.50	1.5	1188.	.000	9.86	3000.	.053	42.38	2.503	52.24
1.0	.015	1.50	1.5	2500.	.029	22.12	2000.	.028	28.58	2.389	50.70
1.0	.015	1.50	1.5	2500.	.029	22.12	2500.	.040	35.61	2.593	57.73
1.0	.015	1.50	1.5	2500.	.029	22.12	3000.	.053	42.38	2.773	64.50
1.0	.015	1.50	1.5	3000.	.042	26.40	2000.	.028	28.58	2.492	54.99
1.0	.015	1.50	1.5	3000.	.042	26.40	2500.	.040	35.61	2.696	62.01
1.0	.015	1.50	1.5	3000.	.042	26.40	3000.	.053	42.38	2.875	68.78
1.0	.015	1.50	2.0	1154.	.000	6.71	2000.	.028	31.76	2.276	38.47
1.0	.015	1.50	2.0	1154.	.000	6.71	2500.	.040	39.56	2.503	46.28
1.0	.015	1.50	2.0	1154.	.000	6.71	3000.	.053	47.09	2.703	53.80
1.0	.015	1.50	2.0	2500.	.030	16.29	2000.	.028	31.76	2.480	48.05
1.0	.015	1.50	2.0	2500.	.030	16.29	2500.	.040	39.56	2.707	55.86
1.0	.015	1.50	2.0	2500.	.030	16.29	3000.	.053	47.09	2.906	63.38
1.0	.015	1.50	2.0	3000.	.043	19.52	2000.	.028	31.76	2.570	51.28
1.0	.015	1.50	2.0	3000.	.043	19.52	2500.	.040	39.56	2.797	59.08
1.0	.015	1.50	2.0	3000.	.043	19.52	3000.	.053	47.09	2.997	66.61

FAN	FAMB	FPRSE	BPR	TO	FAMB	TOT	FAN	FAMB	TOT	SFC	TOT
1.0	.015	1.70	1.0	1199.	.000	13.04	2000.	.027	26.23	1.959	39.26
1.0	.015	1.70	1.0	1199.	.000	13.04	2500.	.040	32.55	2.120	45.58
1.0	.015	1.70	1.0	1199.	.000	13.04	3000.	.053	38.66	2.261	51.69
1.0	.015	1.70	1.0	2500.	.029	28.61	2000.	.027	26.23	2.300	54.84
1.0	.015	1.70	1.0	2500.	.029	28.61	2500.	.040	32.55	2.461	61.16
1.0	.015	1.70	1.0	2500.	.029	28.61	3000.	.053	38.66	2.601	67.27
1.0	.015	1.70	1.0	3000.	.042	34.12	2000.	.027	26.23	2.426	60.35
1.0	.015	1.70	1.0	3000.	.042	34.12	2500.	.040	32.55	2.587	66.67
1.0	.015	1.70	1.0	3000.	.042	34.12	3000.	.053	38.66	2.728	72.78
1.0	.015	1.70	1.5	1154.	.000	8.06	2000.	.027	31.47	2.182	39.53
1.0	.015	1.70	1.5	1154.	.000	8.06	2500.	.040	39.06	2.376	47.12
1.0	.015	1.70	1.5	1154.	.000	8.06	3000.	.053	46.39	2.544	54.45
1.0	.015	1.70	1.5	2500.	.030	19.55	2000.	.027	31.47	2.426	51.03
1.0	.015	1.70	1.5	2500.	.030	19.55	2500.	.040	39.06	2.620	58.61
1.0	.015	1.70	1.5	2500.	.030	19.55	3000.	.053	46.39	2.788	65.94
1.0	.015	1.70	1.5	3000.	.043	23.43	2000.	.027	31.47	2.535	54.90
1.0	.015	1.70	1.5	3000.	.043	23.43	2500.	.040	39.06	2.728	62.48
1.0	.015	1.70	1.5	3000.	.043	23.43	3000.	.053	46.39	2.897	69.82
1.0	.015	1.70	2.0	1108.	.000	4.43	2000.	.027	34.97	2.586	39.40
1.0	.015	1.70	2.0	1108.	.000	4.43	2500.	.040	43.40	2.801	47.83
1.0	.015	1.70	2.0	1108.	.000	4.43	3000.	.053	51.54	2.988	55.97
1.0	.015	1.70	2.0	2500.	.030	12.82	2000.	.027	34.97	2.657	47.79
1.0	.015	1.70	2.0	2500.	.030	12.82	2500.	.040	43.40	2.871	56.22
1.0	.015	1.70	2.0	2500.	.030	12.82	3000.	.053	51.54	3.058	64.37
1.0	.015	1.70	2.0	3000.	.044	15.48	2000.	.027	34.97	2.755	50.45
1.0	.015	1.70	2.0	3000.	.044	15.48	2500.	.040	43.40	2.970	58.88
1.0	.015	1.70	2.0	3000.	.044	15.48	3000.	.053	51.54	3.157	67.03
2.0	.010	1.30	1.0	1250.	.000	6.40	2000.	.024	21.43	2.474	27.83
2.0	.010	1.30	1.0	1250.	.000	6.40	2500.	.036	29.82	2.561	36.22
2.0	.010	1.30	1.0	1250.	.000	6.40	3000.	.049	37.99	2.642	44.39
2.0	.010	1.30	1.0	2500.	.028	26.69	2000.	.024	21.43	2.285	48.12
2.0	.010	1.30	1.0	2500.	.028	26.69	2500.	.036	29.82	2.372	56.51
2.0	.010	1.30	1.0	2500.	.028	26.69	3000.	.049	37.99	2.453	64.69
2.0	.010	1.30	1.0	3000.	.041	34.38	2000.	.024	21.43	2.343	55.81
2.0	.010	1.30	1.0	3000.	.041	34.38	2500.	.036	29.82	2.430	64.20
2.0	.010	1.30	1.0	3000.	.041	34.38	3000.	.049	37.99	2.511	72.37
2.0	.010	1.30	1.5	1228.	.000	4.48	2000.	.024	25.72	2.549	30.19
2.0	.010	1.30	1.5	1228.	.000	4.48	2500.	.036	35.78	2.654	40.26
2.0	.010	1.30	1.5	1228.	.000	4.48	3000.	.049	45.59	2.751	50.07
2.0	.010	1.30	1.5	2500.	.028	20.77	2000.	.024	25.72	2.269	46.49
2.0	.010	1.30	1.5	2500.	.028	20.77	2500.	.036	35.78	2.374	56.56
2.0	.010	1.30	1.5	2500.	.028	20.77	3000.	.049	45.59	2.471	66.36
2.0	.010	1.30	1.5	3000.	.041	26.83	2000.	.024	25.72	2.311	52.55
2.0	.010	1.30	1.5	3000.	.041	26.83	2500.	.036	35.78	2.416	62.61
2.0	.010	1.30	1.5	3000.	.041	26.83	3000.	.049	45.59	2.513	72.42
2.0	.010	1.30	2.0	1207.	.000	3.17	2000.	.024	28.57	2.657	31.74
2.0	.010	1.30	2.0	1207.	.000	3.17	2500.	.036	39.76	2.773	42.93
2.0	.010	1.30	2.0	1207.	.000	3.17	3000.	.049	50.66	2.881	53.83
2.0	.010	1.30	2.0	2500.	.028	16.78	2000.	.024	28.57	2.264	45.35
2.0	.010	1.30	2.0	2500.	.028	16.78	2500.	.036	39.76	2.380	56.53
2.0	.010	1.30	2.0	2500.	.028	16.78	3000.	.049	50.66	2.488	67.43
2.0	.010	1.30	2.0	3000.	.042	21.74	2000.	.024	28.57	2.295	50.31
2.0	.010	1.30	2.0	3000.	.042	21.74	2500.	.036	39.76	2.411	61.49
2.0	.010	1.30	2.0	3000.	.042	21.74	3000.	.049	50.66	2.519	72.39

FMN	FAMB	FPRSL	BPR	T6	PAR6	T5T	FN2	FAR2	W22	W23	W31
2.0	.010	1.50	1.0	1225.	.000	5.47	2000.	.023	22.02	2.679	27.49
2.0	.010	1.50	1.0	1225.	.000	5.47	2500.	.036	30.52	2.773	35.99
2.0	.010	1.50	1.0	1225.	.000	5.47	3000.	.049	38.80	2.857	44.27
2.0	.010	1.50	1.0	2500.	.028	25.85	2000.	.023	22.02	2.299	47.87
2.0	.010	1.50	1.0	2500.	.028	25.85	2500.	.036	30.52	2.392	56.37
2.0	.010	1.50	1.0	2500.	.028	25.85	3000.	.049	38.80	2.477	64.65
2.0	.010	1.50	1.0	3000.	.041	33.40	2000.	.023	22.02	2.351	55.42
2.0	.010	1.50	1.0	3000.	.041	33.40	2500.	.036	30.52	2.444	63.92
2.0	.010	1.50	1.0	3000.	.041	33.40	3000.	.049	38.80	2.528	72.20
2.0	.010	1.50	1.5	1191.	.000	3.29	2000.	.023	26.42	2.981	29.71
2.0	.010	1.50	1.5	1191.	.000	3.29	2500.	.036	36.62	3.093	39.91
2.0	.010	1.50	1.5	1191.	.000	3.29	3000.	.049	46.57	3.194	49.85
2.0	.010	1.50	1.5	2500.	.029	19.62	2000.	.023	26.42	2.300	46.04
2.0	.010	1.50	1.5	2500.	.029	19.62	2500.	.036	36.62	2.412	56.24
2.0	.010	1.50	1.5	2500.	.029	19.62	3000.	.049	46.57	2.513	66.18
2.0	.010	1.50	1.5	3000.	.042	25.49	2000.	.023	26.42	2.333	51.91
2.0	.010	1.50	1.5	3000.	.042	25.49	2500.	.036	36.62	2.445	62.11
2.0	.010	1.50	1.5	3000.	.042	25.49	3000.	.049	46.57	2.546	72.05
2.0	.010	1.50	2.0	1158.	.000	1.76	2000.	.023	29.36	3.652	31.12
2.0	.010	1.50	2.0	1158.	.000	1.76	2500.	.036	40.69	3.777	42.45
2.0	.010	1.50	2.0	1158.	.000	1.76	3000.	.049	51.74	3.889	53.50
2.0	.010	1.50	2.0	2500.	.029	15.30	2000.	.023	29.36	2.318	44.66
2.0	.010	1.50	2.0	2500.	.029	15.30	2500.	.036	40.69	2.443	55.99
2.0	.010	1.50	2.0	2500.	.029	15.30	3000.	.049	51.74	2.555	67.04
2.0	.010	1.50	2.0	3000.	.043	20.02	2000.	.023	29.36	2.337	49.38
2.0	.010	1.50	2.0	3000.	.043	20.02	2500.	.036	40.69	2.462	60.71
2.0	.010	1.50	2.0	3000.	.043	20.02	3000.	.049	51.74	2.574	71.76
2.0	.010	1.70	1.0	1203.	.000	4.58	2000.	.023	22.49	2.978	27.06
2.0	.010	1.70	1.0	1203.	.000	4.58	2500.	.035	31.07	3.077	35.65
2.0	.010	1.70	1.0	1203.	.000	4.58	3000.	.048	39.45	3.164	44.03
2.0	.010	1.70	1.0	2500.	.029	24.99	2000.	.023	22.49	2.325	47.48
2.0	.010	1.70	1.0	2500.	.029	24.99	2500.	.035	31.07	2.424	56.06
2.0	.010	1.70	1.0	2500.	.029	24.99	3000.	.048	39.45	2.510	64.44
2.0	.010	1.70	1.0	3000.	.042	32.40	2000.	.023	22.49	2.370	54.89
2.0	.010	1.70	1.0	3000.	.042	32.40	2500.	.035	31.07	2.469	63.47
2.0	.010	1.70	1.0	3000.	.042	32.40	3000.	.048	39.45	2.555	71.85
2.0	.010	1.70	1.5	1158.	.000	2.12	2000.	.023	26.98	3.953	29.10
2.0	.010	1.70	1.5	1158.	.000	2.12	2500.	.035	37.29	4.072	39.40
2.0	.010	1.70	1.5	1158.	.000	2.12	3000.	.048	47.34	4.176	49.45
2.0	.010	1.70	1.5	2500.	.029	18.37	2000.	.023	26.98	2.355	45.35
2.0	.010	1.70	1.5	2500.	.029	18.37	2500.	.035	37.29	2.474	55.65
2.0	.010	1.70	1.5	2500.	.029	18.37	3000.	.048	47.34	2.578	65.70
2.0	.010	1.70	1.5	3000.	.043	24.03	2000.	.023	26.98	2.378	51.02
2.0	.010	1.70	1.5	3000.	.043	24.03	2500.	.035	37.29	2.496	61.32
2.0	.010	1.70	1.5	3000.	.043	24.03	3000.	.048	47.34	2.600	71.37
2.0	.010	1.70	2.0	1112.	.000	.32	2000.	.023	29.98	14.427	30.30
2.0	.010	1.70	2.0	1112.	.000	.32	2500.	.035	41.43	14.559	41.75
2.0	.010	1.70	2.0	1112.	.000	.32	3000.	.048	52.60	14.674	52.92
2.0	.010	1.70	2.0	2500.	.030	13.61	2000.	.023	29.98	2.426	43.59
2.0	.010	1.70	2.0	2500.	.030	13.61	2500.	.035	41.43	2.558	55.04
2.0	.010	1.70	2.0	2500.	.030	13.61	3000.	.048	52.60	2.674	66.20
2.0	.010	1.70	2.0	3000.	.044	18.05	2000.	.023	29.98	2.425	48.03
2.0	.010	1.70	2.0	3000.	.044	18.05	2500.	.035	41.43	2.557	59.48
2.0	.010	1.70	2.0	3000.	.044	18.05	3000.	.048	52.60	2.672	70.65

FMN	FAMB	FPRSE	BSR	TB	PAMB	TST	PTO	PAMB	TSE	SPC	ST
3.0	.003	1.30	1.0	1239.	.000	-6.50	2000.	.017	9.85	1.095	3.35
3.0	.003	1.30	1.0	1239.	.000	-6.50	2500.	.029	18.95	.925	12.45
3.0	.003	1.30	1.0	1239.	.000	-6.50	3000.	.042	27.86	.909	21.36
3.0	.003	1.30	1.0	2500.	.027	15.73	2000.	.017	9.85	3.270	25.59
3.0	.003	1.30	1.0	2500.	.027	15.73	2500.	.029	18.95	3.099	34.69
3.0	.003	1.30	1.0	2500.	.027	15.73	3000.	.042	27.86	3.084	43.59
3.0	.003	1.30	1.0	3000.	.040	24.13	2000.	.017	9.85	3.147	33.98
3.0	.003	1.30	1.0	3000.	.040	24.13	2500.	.029	18.95	2.976	43.08
3.0	.003	1.30	1.0	3000.	.040	24.13	3000.	.042	27.86	2.961	51.99
3.0	.003	1.30	1.5	1217.	.000	-5.68	2000.	.017	11.82	1.519	6.14
3.0	.003	1.30	1.5	1217.	.000	-5.68	2500.	.029	22.74	1.314	17.06
3.0	.003	1.30	1.5	1217.	.000	-5.68	3000.	.042	33.43	1.295	27.75
3.0	.003	1.30	1.5	2500.	.028	12.32	2000.	.017	11.82	3.279	24.14
3.0	.003	1.30	1.5	2500.	.028	12.32	2500.	.029	22.74	3.074	35.06
3.0	.003	1.30	1.5	2500.	.028	12.32	3000.	.042	33.43	3.055	45.75
3.0	.003	1.30	1.5	3000.	.041	19.00	2000.	.017	11.82	3.165	30.82
3.0	.003	1.30	1.5	3000.	.041	19.00	2500.	.029	22.74	2.960	41.74
3.0	.003	1.30	1.5	3000.	.041	19.00	3000.	.042	33.43	2.941	52.43
3.0	.003	1.30	2.0	1195.	.000	-5.15	2000.	.017	13.13	1.798	7.98
3.0	.003	1.30	2.0	1195.	.000	-5.15	2500.	.029	25.27	1.571	20.11
3.0	.003	1.30	2.0	1195.	.000	-5.15	3000.	.042	37.14	1.550	31.99
3.0	.003	1.30	2.0	2500.	.028	10.02	2000.	.017	13.13	3.290	23.16
3.0	.003	1.30	2.0	2500.	.028	10.02	2500.	.029	25.27	3.062	35.29
3.0	.003	1.30	2.0	2500.	.028	10.02	3000.	.042	37.14	3.042	47.17
3.0	.003	1.30	2.0	3000.	.041	15.55	2000.	.017	13.13	3.180	28.68
3.0	.003	1.30	2.0	3000.	.041	15.55	2500.	.029	25.27	2.953	40.82
3.0	.003	1.30	2.0	3000.	.041	15.55	3000.	.042	37.14	2.932	52.69
3.0	.003	1.50	1.0	1214.	.000	-7.20	2000.	.016	9.92	1.083	2.72
3.0	.003	1.50	1.0	1214.	.000	-7.20	2500.	.028	19.03	.938	11.83
3.0	.003	1.50	1.0	1214.	.000	-7.20	3000.	.041	27.95	.930	20.75
3.0	.003	1.50	1.0	2500.	.028	15.35	2000.	.016	9.92	3.288	25.27
3.0	.003	1.50	1.0	2500.	.028	15.35	2500.	.028	19.03	3.143	34.38
3.0	.003	1.50	1.0	2500.	.028	15.35	3000.	.041	27.95	3.135	43.30
3.0	.003	1.50	1.0	3000.	.041	23.69	2000.	.016	9.92	3.143	33.61
3.0	.003	1.50	1.0	3000.	.041	23.69	2500.	.028	19.03	2.997	42.72
3.0	.003	1.50	1.0	3000.	.041	23.69	3000.	.041	27.95	2.990	51.64
3.0	.003	1.50	1.5	1180.	.000	-6.57	2000.	.016	11.91	1.497	5.34
3.0	.003	1.50	1.5	1180.	.000	-6.57	2500.	.028	22.84	1.322	16.28
3.0	.003	1.50	1.5	1180.	.000	-6.57	3000.	.041	33.54	1.313	26.98
3.0	.003	1.50	1.5	2500.	.028	11.79	2000.	.016	11.91	3.315	23.70
3.0	.003	1.50	1.5	2500.	.028	11.79	2500.	.028	22.84	3.141	34.63
3.0	.003	1.50	1.5	2500.	.028	11.79	3000.	.041	33.54	3.132	45.33
3.0	.003	1.50	1.5	3000.	.041	18.38	2000.	.016	11.91	3.169	30.29
3.0	.003	1.50	1.5	3000.	.041	18.38	2500.	.028	22.84	2.994	41.22
3.0	.003	1.50	1.5	3000.	.041	18.38	3000.	.041	33.54	2.985	51.93
3.0	.003	1.50	2.0	1145.	.000	-6.18	2000.	.016	13.23	1.766	7.05
3.0	.003	1.50	2.0	1145.	.000	-6.18	2500.	.028	25.38	1.572	19.20
3.0	.003	1.50	2.0	1145.	.000	-6.18	3000.	.041	37.27	1.562	31.09
3.0	.003	1.50	2.0	2500.	.029	9.34	2000.	.016	13.23	3.352	22.57
3.0	.003	1.50	2.0	2500.	.029	9.34	2500.	.028	25.38	3.158	34.71
3.0	.003	1.50	2.0	2500.	.029	9.34	3000.	.041	37.27	3.148	46.61
3.0	.003	1.50	2.0	3000.	.042	14.75	2000.	.016	13.23	3.197	27.98
3.0	.003	1.50	2.0	3000.	.042	14.75	2500.	.028	25.38	3.003	40.13
3.0	.003	1.50	2.0	3000.	.042	14.75	3000.	.041	37.27	2.993	52.02

ALTITUDE 30000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.003	1.70	1.0	1191.	.000	-7.86	2000.	.016	9.98	1.069	2.12
3.0	.003	1.70	1.0	1191.	.000	-7.86	2500.	.028	19.10	.945	11.23
3.0	.003	1.70	1.0	1191.	.000	-7.86	3000.	.041	28.03	.945	20.16
3.0	.003	1.70	1.0	2500.	.028	14.95	2000.	.016	9.98	3.316	24.93
3.0	.003	1.70	1.0	2500.	.028	14.95	2500.	.028	19.10	3.192	34.05
3.0	.003	1.70	1.0	2500.	.028	14.95	3000.	.041	28.03	3.192	42.98
3.0	.003	1.70	1.0	3000.	.041	23.23	2000.	.016	9.98	3.146	33.21
3.0	.003	1.70	1.0	3000.	.041	23.23	2500.	.028	19.10	3.022	42.33
3.0	.003	1.70	1.0	3000.	.041	23.23	3000.	.041	28.03	3.022	51.26
3.0	.003	1.70	1.5	1145.	.000	-7.42	2000.	.016	11.98	1.471	4.56
3.0	.003	1.70	1.5	1145.	.000	-7.42	2500.	.028	22.92	1.323	15.50
3.0	.003	1.70	1.5	1145.	.000	-7.42	3000.	.041	33.63	1.322	26.22
3.0	.003	1.70	1.5	2500.	.029	11.20	2000.	.016	11.98	3.374	23.18
3.0	.003	1.70	1.5	2500.	.029	11.20	2500.	.028	22.92	3.225	34.12
3.0	.003	1.70	1.5	2500.	.029	11.20	3000.	.041	33.63	3.225	44.84
3.0	.003	1.70	1.5	3000.	.042	17.70	2000.	.016	11.98	3.188	29.68
3.0	.003	1.70	1.5	3000.	.042	17.70	2500.	.028	22.92	3.039	40.62
3.0	.003	1.70	1.5	3000.	.042	17.70	3000.	.041	33.63	3.039	51.34
3.0	.003	1.70	2.0	1100.	.000	-7.21	2000.	.016	13.31	1.732	6.10
3.0	.003	1.70	2.0	1100.	.000	-7.21	2500.	.028	25.47	1.567	18.26
3.0	.003	1.70	2.0	1100.	.000	-7.21	3000.	.041	37.37	1.566	30.17
3.0	.003	1.70	2.0	2500.	.030	8.53	2000.	.016	13.31	3.461	21.84
3.0	.003	1.70	2.0	2500.	.030	8.53	2500.	.028	25.47	3.296	34.00
3.0	.003	1.70	2.0	2500.	.030	8.53	3000.	.041	37.37	3.295	45.90
3.0	.003	1.70	2.0	3000.	.043	13.82	2000.	.016	13.31	3.244	27.13
3.0	.003	1.70	2.0	3000.	.043	13.82	2500.	.028	25.47	3.078	39.28
3.0	.003	1.70	2.0	3000.	.043	13.82	3000.	.041	37.37	3.078	51.19

FAN	FAMB	FPRSL	BPR	T6	T3	T4	T5	WAIR	W6	W7	W8
1.0	.015	1.30	1.0	1233.	.000	16.01	2000.	.028	21.41	2.059	37.41
1.0	.015	1.30	1.0	1233.	.000	16.01	2500.	.041	26.71	2.240	42.72
1.0	.015	1.30	1.0	1233.	.000	16.01	3000.	.054	31.81	2.402	47.81
1.0	.015	1.30	1.0	2500.	.027	32.67	2000.	.028	21.41	2.375	54.07
1.0	.015	1.30	1.0	2500.	.027	32.67	2500.	.041	26.71	2.556	59.38
1.0	.015	1.30	1.0	2500.	.027	32.67	3000.	.054	31.81	2.717	64.48
1.0	.015	1.30	1.0	3000.	.040	38.79	2000.	.028	21.41	2.488	60.20
1.0	.015	1.30	1.0	3000.	.040	38.79	2500.	.041	26.71	2.669	65.50
1.0	.015	1.30	1.0	3000.	.040	38.79	3000.	.054	31.81	2.830	70.60
1.0	.015	1.30	1.5	1211.	.000	11.88	2000.	.028	25.69	2.180	37.57
1.0	.015	1.30	1.5	1211.	.000	11.88	2500.	.041	32.05	2.397	43.93
1.0	.015	1.30	1.5	1211.	.000	11.88	3000.	.054	38.17	2.591	50.05
1.0	.015	1.30	1.5	2500.	.028	24.99	2000.	.028	25.69	2.432	50.67
1.0	.015	1.30	1.5	2500.	.028	24.99	2500.	.041	32.05	2.649	57.04
1.0	.015	1.30	1.5	2500.	.028	24.99	3000.	.054	38.17	2.843	63.16
1.0	.015	1.30	1.5	3000.	.041	29.70	2000.	.028	25.69	2.524	55.39
1.0	.015	1.30	1.5	3000.	.041	29.70	2500.	.041	32.05	2.741	61.75
1.0	.015	1.30	1.5	3000.	.041	29.70	3000.	.054	38.17	2.935	67.87
1.0	.015	1.30	2.0	1189.	.000	9.08	2000.	.028	28.54	2.272	37.62
1.0	.015	1.30	2.0	1189.	.000	9.08	2500.	.041	35.61	2.513	44.70
1.0	.015	1.30	2.0	1189.	.000	9.08	3000.	.054	42.41	2.728	51.49
1.0	.015	1.30	2.0	2500.	.028	19.76	2000.	.028	28.54	2.479	48.30
1.0	.015	1.30	2.0	2500.	.028	19.76	2500.	.041	35.61	2.721	55.38
1.0	.015	1.30	2.0	2500.	.028	19.76	3000.	.054	42.41	2.936	62.17
1.0	.015	1.30	2.0	3000.	.041	23.52	2000.	.028	28.54	2.558	52.06
1.0	.015	1.30	2.0	3000.	.041	23.52	2500.	.041	35.61	2.799	59.13
1.0	.015	1.30	2.0	3000.	.041	23.52	3000.	.054	42.41	3.014	65.93
1.0	.015	1.50	1.0	1207.	.000	14.67	2000.	.028	24.69	1.962	39.35
1.0	.015	1.50	1.0	1207.	.000	14.67	2500.	.040	30.63	2.129	45.30
1.0	.015	1.50	1.0	1207.	.000	14.67	3000.	.054	36.36	2.275	51.03
1.0	.015	1.50	1.0	2500.	.028	31.00	2000.	.028	24.69	2.277	55.68
1.0	.015	1.50	1.0	2500.	.028	31.00	2500.	.040	30.63	2.444	61.63
1.0	.015	1.50	1.0	2500.	.028	31.00	3000.	.054	36.36	2.590	67.36
1.0	.015	1.50	1.0	3000.	.041	36.85	2000.	.028	24.69	2.393	61.54
1.0	.015	1.50	1.0	3000.	.041	36.85	2500.	.040	30.63	2.559	67.48
1.0	.015	1.50	1.0	3000.	.041	36.85	3000.	.054	36.36	2.706	73.21
1.0	.015	1.50	1.5	1173.	.000	10.14	2000.	.028	29.62	2.097	39.76
1.0	.015	1.50	1.5	1173.	.000	10.14	2500.	.040	36.76	2.297	46.90
1.0	.015	1.50	1.5	1173.	.000	10.14	3000.	.054	43.64	2.473	53.78
1.0	.015	1.50	1.5	2500.	.029	22.69	2000.	.028	29.62	2.341	52.32
1.0	.015	1.50	1.5	2500.	.029	22.69	2500.	.040	36.76	2.541	59.45
1.0	.015	1.50	1.5	2500.	.029	22.69	3000.	.054	43.64	2.717	66.33
1.0	.015	1.50	1.5	3000.	.042	27.03	2000.	.028	29.62	2.437	56.66
1.0	.015	1.50	1.5	3000.	.042	27.03	2500.	.040	36.76	2.637	63.79
1.0	.015	1.50	1.5	3000.	.042	27.03	3000.	.054	43.64	2.813	70.67
1.0	.015	1.50	2.0	1138.	.000	6.98	2000.	.028	32.92	2.241	39.89
1.0	.015	1.50	2.0	1138.	.000	6.98	2500.	.040	40.84	2.463	47.82
1.0	.015	1.50	2.0	1138.	.000	6.98	3000.	.054	48.49	2.658	55.46
1.0	.015	1.50	2.0	2500.	.029	16.83	2000.	.028	32.92	2.422	49.75
1.0	.015	1.50	2.0	2500.	.029	16.83	2500.	.040	40.84	2.644	57.67
1.0	.015	1.50	2.0	2500.	.029	16.83	3000.	.054	48.49	2.840	65.32
1.0	.015	1.50	2.0	3000.	.042	20.12	2000.	.028	32.92	2.507	53.03
1.0	.015	1.50	2.0	3000.	.042	20.12	2500.	.040	40.84	2.729	60.96
1.0	.015	1.50	2.0	3000.	.042	20.12	3000.	.054	48.49	2.924	68.60

FMN	FAMB	FPRSL	BPR	T6	FAMB	VSV	FAC				
1.0	.015	1.70	1.0	1184.	.000	13.36	2000.	.028	27.15	1.948	40.51
1.0	.015	1.70	1.0	1184.	.000	13.36	2500.	.040	33.57	2.105	46.93
1.0	.015	1.70	1.0	1184.	.000	13.36	3000.	.053	39.78	2.242	53.14
1.0	.015	1.70	1.0	2500.	.028	29.29	2000.	.028	27.15	2.258	56.44
1.0	.015	1.70	1.0	2500.	.028	29.29	2500.	.040	33.57	2.415	62.86
1.0	.015	1.70	1.0	2500.	.028	29.29	3000.	.053	39.78	2.552	69.07
1.0	.015	1.70	1.0	3000.	.041	34.87	2000.	.028	27.15	2.376	62.02
1.0	.015	1.70	1.0	3000.	.041	34.87	2500.	.040	33.57	2.533	68.44
1.0	.015	1.70	1.0	3000.	.041	34.87	3000.	.053	39.78	2.671	74.65
1.0	.015	1.70	1.5	1138.	.000	8.38	2000.	.028	32.58	2.153	40.95
1.0	.015	1.70	1.5	1138.	.000	8.38	2500.	.040	40.28	2.341	48.66
1.0	.015	1.70	1.5	1138.	.000	8.38	3000.	.053	47.74	2.506	56.11
1.0	.015	1.70	1.5	2500.	.029	20.20	2000.	.028	32.58	2.370	52.78
1.0	.015	1.70	1.5	2500.	.029	20.20	2500.	.040	40.28	2.559	60.49
1.0	.015	1.70	1.5	2500.	.029	20.20	3000.	.053	47.74	2.724	67.94
1.0	.015	1.70	1.5	3000.	.042	24.15	2000.	.028	32.58	2.471	56.72
1.0	.015	1.70	1.5	3000.	.042	24.15	2500.	.040	40.28	2.660	64.43
1.0	.015	1.70	1.5	3000.	.042	24.15	3000.	.053	47.74	2.825	71.88
1.0	.015	1.70	2.0	1092.	.000	4.75	2000.	.028	36.20	2.513	40.94
1.0	.015	1.70	2.0	1092.	.000	4.75	2500.	.040	44.76	2.722	49.50
1.0	.015	1.70	2.0	1092.	.000	4.75	3000.	.053	53.04	2.906	57.78
1.0	.015	1.70	2.0	2500.	.030	13.45	2000.	.028	36.20	2.574	49.64
1.0	.015	1.70	2.0	2500.	.030	13.45	2500.	.040	44.76	2.784	58.21
1.0	.015	1.70	2.0	2500.	.030	13.45	3000.	.053	53.04	2.967	66.49
1.0	.015	1.70	2.0	3000.	.043	16.18	2000.	.028	36.20	2.666	52.38
1.0	.015	1.70	2.0	3000.	.043	16.18	2500.	.040	44.76	2.876	60.94
1.0	.015	1.70	2.0	3000.	.043	16.18	3000.	.053	53.04	3.059	69.22
2.0	.011	1.30	1.0	1244.	.000	7.17	2000.	.025	22.36	2.386	29.54
2.0	.011	1.30	1.0	1244.	.000	7.17	2500.	.037	30.78	2.475	37.95
2.0	.011	1.30	1.0	1244.	.000	7.17	3000.	.050	38.98	2.557	46.15
2.0	.011	1.30	1.0	2500.	.028	27.65	2000.	.025	22.36	2.245	50.01
2.0	.011	1.30	1.0	2500.	.028	27.65	2500.	.037	30.78	2.334	58.43
2.0	.011	1.30	1.0	2500.	.028	27.65	3000.	.050	38.98	2.415	66.63
2.0	.011	1.30	1.0	3000.	.041	35.37	2000.	.025	22.36	2.303	57.73
2.0	.011	1.30	1.0	3000.	.041	35.37	2500.	.037	30.78	2.391	66.14
2.0	.011	1.30	1.0	3000.	.041	35.37	3000.	.050	38.98	2.473	74.34
2.0	.011	1.30	1.5	1223.	.000	5.11	2000.	.025	26.84	2.440	31.95
2.0	.011	1.30	1.5	1223.	.000	5.11	2500.	.037	36.93	2.547	42.05
2.0	.011	1.30	1.5	1223.	.000	5.11	3000.	.050	46.77	2.645	51.89
2.0	.011	1.30	1.5	2500.	.028	21.57	2000.	.025	26.84	2.228	48.41
2.0	.011	1.30	1.5	2500.	.028	21.57	2500.	.037	36.93	2.334	58.51
2.0	.011	1.30	1.5	2500.	.028	21.57	3000.	.050	46.77	2.432	68.34
2.0	.011	1.30	1.5	3000.	.041	27.66	2000.	.025	26.84	2.270	54.50
2.0	.011	1.30	1.5	3000.	.041	27.66	2500.	.037	36.93	2.377	64.59
2.0	.011	1.30	1.5	3000.	.041	27.66	3000.	.050	46.77	2.475	74.43
2.0	.011	1.30	2.0	1201.	.000	3.72	2000.	.025	29.82	2.516	33.53
2.0	.011	1.30	2.0	1201.	.000	3.72	2500.	.037	41.04	2.634	44.75
2.0	.011	1.30	2.0	1201.	.000	3.72	3000.	.050	51.97	2.743	55.68
2.0	.011	1.30	2.0	2500.	.028	17.47	2000.	.025	29.82	2.220	47.29
2.0	.011	1.30	2.0	2500.	.028	17.47	2500.	.037	41.04	2.338	58.51
2.0	.011	1.30	2.0	2500.	.028	17.47	3000.	.050	51.97	2.448	69.44
2.0	.011	1.30	2.0	3000.	.041	22.46	2000.	.025	29.82	2.252	52.28
2.0	.011	1.30	2.0	3000.	.041	22.46	2500.	.037	41.04	2.371	63.50
2.0	.011	1.30	2.0	3000.	.041	22.46	3000.	.050	51.97	2.480	74.43

FAN	FANB	FPRSL	BPR	VJ	FANB	VJ	VJ	FANB	VJ	VJ	VJ
2.0	.011	1.50	1.0	1219.	.000	6.27	2000.	.024	22.98	2.544	29.24
2.0	.011	1.50	1.0	1219.	.000	6.27	2500.	.036	31.51	2.639	37.77
2.0	.011	1.50	1.0	1219.	.000	6.27	3000.	.050	39.82	2.723	46.09
2.0	.011	1.50	1.0	2500.	.028	26.85	2000.	.024	22.98	2.255	49.83
2.0	.011	1.50	1.0	2500.	.028	26.85	2500.	.036	31.51	2.349	58.36
2.0	.011	1.50	1.0	2500.	.028	26.85	3000.	.050	39.82	2.434	66.68
2.0	.011	1.50	1.0	3000.	.041	34.44	2000.	.024	22.98	2.307	57.42
2.0	.011	1.50	1.0	3000.	.041	34.44	2500.	.036	31.51	2.402	65.95
2.0	.011	1.50	1.0	3000.	.041	34.44	3000.	.050	39.82	2.486	74.27
2.0	.011	1.50	1.5	1185.	.000	3.96	2000.	.024	27.57	2.754	31.53
2.0	.011	1.50	1.5	1185.	.000	3.96	2500.	.036	37.81	2.867	41.77
2.0	.011	1.50	1.5	1185.	.000	3.96	3000.	.050	47.79	2.968	51.75
2.0	.011	1.50	1.5	2500.	.029	20.48	2000.	.024	27.57	2.251	48.05
2.0	.011	1.50	1.5	2500.	.029	20.48	2500.	.036	37.81	2.365	58.29
2.0	.011	1.50	1.5	2500.	.029	20.48	3000.	.050	47.79	2.466	68.27
2.0	.011	1.50	1.5	3000.	.042	26.39	2000.	.024	27.57	2.286	53.96
2.0	.011	1.50	1.5	3000.	.042	26.39	2500.	.036	37.81	2.400	64.20
2.0	.011	1.50	1.5	3000.	.042	26.39	3000.	.050	47.79	2.501	74.18
2.0	.011	1.50	2.0	1151.	.000	2.35	2000.	.024	30.63	3.157	32.98
2.0	.011	1.50	2.0	1151.	.000	2.35	2500.	.036	42.01	3.283	44.36
2.0	.011	1.50	2.0	1151.	.000	2.35	3000.	.050	53.10	3.396	55.44
2.0	.011	1.50	2.0	2500.	.029	16.08	2000.	.024	30.63	2.264	46.71
2.0	.011	1.50	2.0	2500.	.029	16.08	2500.	.036	42.01	2.390	58.09
2.0	.011	1.50	2.0	2500.	.029	16.08	3000.	.050	53.10	2.503	69.17
2.0	.011	1.50	2.0	3000.	.043	20.84	2000.	.024	30.63	2.286	51.48
2.0	.011	1.50	2.0	3000.	.043	20.84	2500.	.036	42.01	2.412	62.85
2.0	.011	1.50	2.0	3000.	.043	20.84	3000.	.050	53.10	2.525	73.94
2.0	.011	1.70	1.0	1197.	.000	5.40	2000.	.024	23.46	2.766	28.86
2.0	.011	1.70	1.0	1197.	.000	5.40	2500.	.036	32.08	2.865	37.48
2.0	.011	1.70	1.0	1197.	.000	5.40	3000.	.049	40.49	2.952	45.89
2.0	.011	1.70	1.0	2500.	.028	26.04	2000.	.024	23.46	2.276	49.50
2.0	.011	1.70	1.0	2500.	.028	26.04	2500.	.036	32.08	2.375	58.12
2.0	.011	1.70	1.0	2500.	.028	26.04	3000.	.049	40.49	2.462	66.53
2.0	.011	1.70	1.0	3000.	.042	33.50	2000.	.024	23.46	2.323	56.96
2.0	.011	1.70	1.0	3000.	.042	33.50	2500.	.036	32.08	2.422	65.58
2.0	.011	1.70	1.0	3000.	.042	33.50	3000.	.049	40.49	2.509	73.99
2.0	.011	1.70	1.5	1151.	.000	2.82	2000.	.024	28.15	3.368	30.97
2.0	.011	1.70	1.5	1151.	.000	2.82	2500.	.036	38.50	3.487	41.31
2.0	.011	1.70	1.5	1151.	.000	2.82	3000.	.049	48.59	3.591	51.41
2.0	.011	1.70	1.5	2500.	.029	19.30	2000.	.024	28.15	2.298	47.45
2.0	.011	1.70	1.5	2500.	.029	19.30	2500.	.036	38.50	2.417	57.79
2.0	.011	1.70	1.5	2500.	.029	19.30	3000.	.049	48.59	2.521	67.88
2.0	.011	1.70	1.5	3000.	.043	25.02	2000.	.024	28.15	2.324	53.16
2.0	.011	1.70	1.5	3000.	.043	25.02	2500.	.036	38.50	2.443	63.51
2.0	.011	1.70	1.5	3000.	.043	25.02	3000.	.049	48.59	2.547	73.60
2.0	.011	1.70	2.0	1106.	.000	.95	2000.	.024	31.28	5.930	32.22
2.0	.011	1.70	2.0	1106.	.000	.95	2500.	.036	42.77	6.062	43.72
2.0	.011	1.70	2.0	1106.	.000	.95	3000.	.049	53.98	6.178	54.93
2.0	.011	1.70	2.0	2500.	.030	14.47	2000.	.024	31.28	2.355	45.74
2.0	.011	1.70	2.0	2500.	.030	14.47	2500.	.036	42.77	2.487	57.24
2.0	.011	1.70	2.0	2500.	.030	14.47	3000.	.049	53.98	2.602	68.45
2.0	.011	1.70	2.0	3000.	.043	18.97	2000.	.024	31.28	2.360	50.25
2.0	.011	1.70	2.0	3000.	.043	18.97	2500.	.036	42.77	2.492	61.74
2.0	.011	1.70	2.0	3000.	.043	18.97	3000.	.049	53.98	2.608	72.96

FMN	FAMB	FPRSL	BPR	T6	FAMB						
3.0	.004	1.30	1.0	1236.	.000	-5.36	2000.	.018	11.18	.725	5.81
3.0	.004	1.30	1.0	1236.	.000	-5.36	2500.	.030	20.30	.610	14.94
3.0	.004	1.30	1.0	1236.	.000	-5.36	3000.	.043	29.24	.608	23.87
3.0	.004	1.30	1.0	2500.	.027	16.94	2000.	.018	11.18	3.105	28.11
3.0	.004	1.30	1.0	2500.	.027	16.94	2500.	.030	20.30	2.989	37.24
3.0	.004	1.30	1.0	2500.	.027	16.94	3000.	.043	29.24	2.988	46.17
3.0	.004	1.30	1.0	3000.	.040	25.34	2000.	.018	11.18	3.008	36.52
3.0	.004	1.30	1.0	3000.	.040	25.34	2500.	.030	20.30	2.893	45.64
3.0	.004	1.30	1.0	3000.	.040	25.34	3000.	.043	29.24	2.891	54.58
3.0	.004	1.30	1.5	1214.	.000	-4.77	2000.	.018	13.41	1.211	8.64
3.0	.004	1.30	1.5	1214.	.000	-4.77	2500.	.030	24.36	1.072	19.60
3.0	.004	1.30	1.5	1214.	.000	-4.77	3000.	.043	35.08	1.070	30.32
3.0	.004	1.30	1.5	2500.	.028	13.30	2000.	.018	13.41	3.101	26.71
3.0	.004	1.30	1.5	2500.	.028	13.30	2500.	.030	24.36	2.963	37.66
3.0	.004	1.30	1.5	2500.	.028	13.30	3000.	.043	35.08	2.961	48.38
3.0	.004	1.30	1.5	3000.	.041	19.98	2000.	.018	13.41	3.011	33.39
3.0	.004	1.30	1.5	3000.	.041	19.98	2500.	.030	24.36	2.873	44.35
3.0	.004	1.30	1.5	3000.	.041	19.98	3000.	.043	35.08	2.871	55.06
3.0	.004	1.30	2.0	1193.	.000	-4.38	2000.	.018	14.90	1.527	10.52
3.0	.004	1.30	2.0	1193.	.000	-4.38	2500.	.030	27.07	1.373	22.69
3.0	.004	1.30	2.0	1193.	.000	-4.38	3000.	.043	38.98	1.371	34.60
3.0	.004	1.30	2.0	2500.	.028	10.85	2000.	.018	14.90	3.103	25.75
3.0	.004	1.30	2.0	2500.	.028	10.85	2500.	.030	27.07	2.950	37.92
3.0	.004	1.30	2.0	2500.	.028	10.85	3000.	.043	38.98	2.948	49.83
3.0	.004	1.30	2.0	3000.	.041	16.38	2000.	.018	14.90	3.016	31.28
3.0	.004	1.30	2.0	3000.	.041	16.38	2500.	.030	27.07	2.863	43.45
3.0	.004	1.30	2.0	3000.	.041	16.38	3000.	.043	38.98	2.861	55.36
3.0	.004	1.50	1.0	1211.	.000	-6.05	2000.	.017	11.25	.758	5.20
3.0	.004	1.50	1.0	1211.	.000	-6.05	2500.	.029	20.39	.663	14.34
3.0	.004	1.50	1.0	1211.	.000	-6.05	3000.	.042	29.34	.669	23.29
3.0	.004	1.50	1.0	2500.	.028	16.57	2000.	.017	11.25	3.121	27.83
3.0	.004	1.50	1.0	2500.	.028	16.57	2500.	.029	20.39	3.026	36.97
3.0	.004	1.50	1.0	2500.	.028	16.57	3000.	.042	29.34	3.031	45.91
3.0	.004	1.50	1.0	3000.	.041	24.92	2000.	.017	11.25	3.006	36.17
3.0	.004	1.50	1.0	3000.	.041	24.92	2500.	.029	20.39	2.911	45.31
3.0	.004	1.50	1.0	3000.	.041	24.92	3000.	.042	29.34	2.916	54.26
3.0	.004	1.50	1.5	1177.	.000	-5.63	2000.	.017	13.50	1.232	7.87
3.0	.004	1.50	1.5	1177.	.000	-5.63	2500.	.029	24.47	1.118	18.84
3.0	.004	1.50	1.5	1177.	.000	-5.63	3000.	.042	35.21	1.124	29.57
3.0	.004	1.50	1.5	2500.	.028	12.79	2000.	.017	13.50	3.132	26.30
3.0	.004	1.50	1.5	2500.	.028	12.79	2500.	.029	24.47	3.018	37.26
3.0	.004	1.50	1.5	2500.	.028	12.79	3000.	.042	35.21	3.025	48.00
3.0	.004	1.50	1.5	3000.	.041	19.39	2000.	.017	13.50	3.016	32.90
3.0	.004	1.50	1.5	3000.	.041	19.39	2500.	.029	24.47	2.902	43.87
3.0	.004	1.50	1.5	3000.	.041	19.39	3000.	.042	35.21	2.909	54.60
3.0	.004	1.50	2.0	1142.	.000	-5.40	2000.	.017	15.00	1.535	9.61
3.0	.004	1.50	2.0	1142.	.000	-5.40	2500.	.029	27.19	1.409	21.80
3.0	.004	1.50	2.0	1142.	.000	-5.40	3000.	.042	39.12	1.416	33.72
3.0	.004	1.50	2.0	2500.	.029	10.19	2000.	.017	15.00	3.155	25.20
3.0	.004	1.50	2.0	2500.	.029	10.19	2500.	.029	27.19	3.028	37.39
3.0	.004	1.50	2.0	2500.	.029	10.19	3000.	.042	39.12	3.036	49.31
3.0	.004	1.50	2.0	3000.	.042	15.62	2000.	.017	15.00	3.033	30.63
3.0	.004	1.50	2.0	3000.	.042	15.62	2500.	.029	27.19	2.906	42.81
3.0	.004	1.50	2.0	3000.	.042	15.62	3000.	.042	39.12	2.914	54.74

ALTITUDE 40000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.004	1.70	1.0	1188.	.000	-6.71	2000.	.017	11.31	.778	4.61
3.0	.004	1.70	1.0	1188.	.000	-6.71	2500.	.029	20.46	.700	13.76
3.0	.004	1.70	1.0	1188.	.000	-6.71	3000.	.042	29.42	.712	22.71
3.0	.004	1.70	1.0	2500.	.028	16.20	2000.	.017	11.31	3.144	27.51
3.0	.004	1.70	1.0	2500.	.028	16.20	2500.	.029	20.46	3.067	36.66
3.0	.004	1.70	1.0	2500.	.028	16.20	3000.	.042	29.42	3.079	45.62
3.0	.004	1.70	1.0	3000.	.041	24.48	2000.	.017	11.31	3.010	35.80
3.0	.004	1.70	1.0	3000.	.041	24.48	2500.	.029	20.46	2.933	44.95
3.0	.004	1.70	1.0	3000.	.041	24.48	3000.	.042	29.42	2.944	53.90
3.0	.004	1.70	1.5	1143.	.000	-6.47	2000.	.017	13.58	1.238	7.10
3.0	.004	1.70	1.5	1143.	.000	-6.47	2500.	.029	24.56	1.145	18.08
3.0	.004	1.70	1.5	1143.	.000	-6.47	3000.	.042	35.30	1.159	28.83
3.0	.004	1.70	1.5	2500.	.029	12.23	2000.	.017	13.58	3.181	25.81
3.0	.004	1.70	1.5	2500.	.029	12.23	2500.	.029	24.56	3.088	36.79
3.0	.004	1.70	1.5	2500.	.029	12.23	3000.	.042	35.30	3.102	47.54
3.0	.004	1.70	1.5	3000.	.042	18.75	2000.	.017	13.58	3.034	32.33
3.0	.004	1.70	1.5	3000.	.042	18.75	2500.	.029	24.56	2.941	43.30
3.0	.004	1.70	1.5	3000.	.042	18.75	3000.	.042	35.30	2.956	54.05
3.0	.004	1.70	2.0	1097.	.000	-6.40	2000.	.017	15.09	1.529	8.69
3.0	.004	1.70	2.0	1097.	.000	-6.40	2500.	.029	27.28	1.426	20.88
3.0	.004	1.70	2.0	1097.	.000	-6.40	3000.	.042	39.23	1.441	32.83
3.0	.004	1.70	2.0	2500.	.030	9.43	2000.	.017	15.09	3.244	24.51
3.0	.004	1.70	2.0	2500.	.030	9.43	2500.	.029	27.28	3.140	36.71
3.0	.004	1.70	2.0	2500.	.030	9.43	3000.	.042	39.23	3.156	48.65
3.0	.004	1.70	2.0	3000.	.043	14.73	2000.	.017	15.09	3.074	29.82
3.0	.004	1.70	2.0	3000.	.043	14.73	2500.	.029	27.28	2.971	42.02
3.0	.004	1.70	2.0	3000.	.043	14.73	3000.	.042	39.23	2.987	53.96

PHN	PAMB	PPRSE	BPR								
1.0	.016	1.30	1.0	1209.	.000	13.69	2000.	.030	21.49	2.345	35.18
1.0	.016	1.30	1.0	1209.	.000	13.69	2500.	.044	26.87	2.539	40.55
1.0	.016	1.30	1.0	1209.	.000	13.69	3000.	.058	32.05	2.712	45.74
1.0	.016	1.30	1.0	2500.	.029	29.55	2000.	.030	21.49	2.647	51.05
1.0	.016	1.30	1.0	2500.	.029	29.55	2500.	.044	26.87	2.841	56.42
1.0	.016	1.30	1.0	2500.	.029	29.55	3000.	.058	32.05	3.015	61.60
1.0	.016	1.30	1.0	3000.	.042	35.28	2000.	.030	21.49	2.766	56.77
1.0	.016	1.30	1.0	3000.	.042	35.28	2500.	.044	26.87	2.960	62.14
1.0	.016	1.30	1.0	3000.	.042	35.28	3000.	.058	32.05	3.133	67.33
1.0	.016	1.30	1.5	1186.	.000	9.96	2000.	.030	25.79	2.470	35.75
1.0	.016	1.30	1.5	1186.	.000	9.96	2500.	.044	32.24	2.703	42.19
1.0	.016	1.30	1.5	1186.	.000	9.96	3000.	.058	38.46	2.911	48.41
1.0	.016	1.30	1.5	2500.	.029	22.34	2000.	.030	25.79	2.702	48.13
1.0	.016	1.30	1.5	2500.	.029	22.34	2500.	.044	32.24	2.935	54.58
1.0	.016	1.30	1.5	2500.	.029	22.34	3000.	.058	38.46	3.143	60.79
1.0	.016	1.30	1.5	3000.	.043	26.70	2000.	.030	25.79	2.800	52.50
1.0	.016	1.30	1.5	3000.	.043	26.70	2500.	.044	32.24	3.033	58.94
1.0	.016	1.30	1.5	3000.	.043	26.70	3000.	.058	38.46	3.241	65.16
1.0	.016	1.30	2.0	1164.	.000	7.41	2000.	.030	28.66	2.576	36.07
1.0	.016	1.30	2.0	1164.	.000	7.41	2500.	.044	35.82	2.835	43.23
1.0	.016	1.30	2.0	1164.	.000	7.41	3000.	.058	42.73	3.066	50.14
1.0	.016	1.30	2.0	2500.	.030	17.40	2000.	.030	28.66	2.755	46.06
1.0	.016	1.30	2.0	2500.	.030	17.40	2500.	.044	35.82	3.014	53.22
1.0	.016	1.30	2.0	2500.	.030	17.40	3000.	.058	42.73	3.245	60.13
1.0	.016	1.30	2.0	3000.	.043	20.84	2000.	.030	28.66	2.838	49.50
1.0	.016	1.30	2.0	3000.	.043	20.84	2500.	.044	35.82	3.097	56.66
1.0	.016	1.30	2.0	3000.	.043	20.84	3000.	.058	42.73	3.328	63.57
1.0	.016	1.50	1.0	1183.	.000	12.24	2000.	.030	24.79	2.285	37.03
1.0	.016	1.50	1.0	1183.	.000	12.24	2500.	.043	30.81	2.463	43.05
1.0	.016	1.50	1.0	1183.	.000	12.24	3000.	.058	36.65	2.620	48.89
1.0	.016	1.50	1.0	2500.	.029	27.65	2000.	.030	24.79	2.573	52.44
1.0	.016	1.50	1.0	2500.	.029	27.65	2500.	.043	30.81	2.751	58.46
1.0	.016	1.50	1.0	2500.	.029	27.65	3000.	.058	36.65	2.908	64.30
1.0	.016	1.50	1.0	3000.	.043	33.06	2000.	.030	24.79	2.695	57.85
1.0	.016	1.50	1.0	3000.	.043	33.06	2500.	.043	30.81	2.873	63.88
1.0	.016	1.50	1.0	3000.	.043	33.06	3000.	.058	36.65	3.030	69.71
1.0	.016	1.50	1.5	1147.	.000	8.07	2000.	.030	29.74	2.468	37.81
1.0	.016	1.50	1.5	1147.	.000	8.07	2500.	.043	36.97	2.682	45.04
1.0	.016	1.50	1.5	1147.	.000	8.07	3000.	.058	43.98	2.870	52.04
1.0	.016	1.50	1.5	2500.	.030	19.71	2000.	.030	29.74	2.659	49.45
1.0	.016	1.50	1.5	2500.	.030	19.71	2500.	.043	36.97	2.873	56.68
1.0	.016	1.50	1.5	2500.	.030	19.71	3000.	.058	43.98	3.062	63.68
1.0	.016	1.50	1.5	3000.	.044	23.64	2000.	.030	29.74	2.761	53.39
1.0	.016	1.50	1.5	3000.	.044	23.64	2500.	.043	36.97	2.975	60.62
1.0	.016	1.50	1.5	3000.	.044	23.64	3000.	.058	43.98	3.164	67.62
1.0	.016	1.50	2.0	1111.	.000	5.11	2000.	.030	33.05	2.725	38.16
1.0	.016	1.50	2.0	1111.	.000	5.11	2500.	.043	41.08	2.962	46.19
1.0	.016	1.50	2.0	1111.	.000	5.11	3000.	.058	48.86	3.172	53.97
1.0	.016	1.50	2.0	2500.	.031	14.02	2000.	.030	33.05	2.792	47.07
1.0	.016	1.50	2.0	2500.	.031	14.02	2500.	.043	41.08	3.030	55.10
1.0	.016	1.50	2.0	2500.	.031	14.02	3000.	.058	48.86	3.239	62.88
1.0	.016	1.50	2.0	3000.	.044	16.91	2000.	.030	33.05	2.882	49.96
1.0	.016	1.50	2.0	3000.	.044	16.91	2500.	.043	41.08	3.119	57.99
1.0	.016	1.50	2.0	3000.	.044	16.91	3000.	.058	48.86	3.329	65.77

FAN	FAMB	FPRSE	BPR	VO							
1.0	.016	1.70	1.0	1159.	.000	10.83	2000.	.029	27.26	2.329	38.09
1.0	.016	1.70	1.0	1159.	.000	10.83	2500.	.043	33.77	2.497	44.60
1.0	.016	1.70	1.0	1159.	.000	10.83	3000.	.057	40.09	2.644	50.92
1.0	.016	1.70	1.0	2500.	.030	25.70	2000.	.029	27.26	2.590	52.96
1.0	.016	1.70	1.0	2500.	.030	25.70	2500.	.043	33.77	2.758	59.47
1.0	.016	1.70	1.0	2500.	.030	25.70	3000.	.057	40.09	2.905	65.79
1.0	.016	1.70	1.0	3000.	.043	30.80	2000.	.029	27.26	2.716	58.05
1.0	.016	1.70	1.0	3000.	.043	30.80	2500.	.043	33.77	2.884	64.56
1.0	.016	1.70	1.0	3000.	.043	30.80	3000.	.057	40.09	3.031	70.89
1.0	.016	1.70	1.5	1111.	.000	6.13	2000.	.029	32.71	2.700	38.84
1.0	.016	1.70	1.5	1111.	.000	6.13	2500.	.043	40.52	2.901	46.66
1.0	.016	1.70	1.5	1111.	.000	6.13	3000.	.057	48.11	3.078	54.24
1.0	.016	1.70	1.5	2500.	.031	16.83	2000.	.029	32.71	2.781	49.54
1.0	.016	1.70	1.5	2500.	.031	16.83	2500.	.043	40.52	2.983	57.35
1.0	.016	1.70	1.5	2500.	.031	16.83	3000.	.057	48.11	3.159	64.94
1.0	.016	1.70	1.5	3000.	.044	20.30	2000.	.029	32.71	2.888	53.00
1.0	.016	1.70	1.5	3000.	.044	20.30	2500.	.043	40.52	3.090	60.82
1.0	.016	1.70	1.5	3000.	.044	20.30	3000.	.057	48.11	3.266	68.41
1.0	.016	1.70	2.0	1064.	.000	2.73	2000.	.029	36.34	3.692	39.07
1.0	.016	1.70	2.0	1064.	.000	2.73	2500.	.043	45.02	3.916	47.75
1.0	.016	1.70	2.0	1064.	.000	2.73	3000.	.057	53.46	4.112	56.18
1.0	.016	1.70	2.0	2500.	.032	10.32	2000.	.029	36.34	3.162	46.66
1.0	.016	1.70	2.0	2500.	.032	10.32	2500.	.043	45.02	3.386	55.34
1.0	.016	1.70	2.0	2500.	.032	10.32	3000.	.057	53.46	3.582	63.78
1.0	.016	1.70	2.0	3000.	.045	12.61	2000.	.029	36.34	3.253	48.95
1.0	.016	1.70	2.0	3000.	.045	12.61	2500.	.043	45.02	3.477	57.63
1.0	.016	1.70	2.0	3000.	.045	12.61	3000.	.057	53.46	3.673	66.06
2.0	.012	1.30	1.0	1233.	.000	6.22	2000.	.026	22.50	2.766	28.72
2.0	.012	1.30	1.0	1233.	.000	6.22	2500.	.039	31.04	2.861	37.25
2.0	.012	1.30	1.0	1233.	.000	6.22	3000.	.054	39.40	2.948	45.61
2.0	.012	1.30	1.0	2500.	.029	26.60	2000.	.026	22.50	2.435	49.10
2.0	.012	1.30	1.0	2500.	.029	26.60	2500.	.039	31.04	2.530	57.64
2.0	.012	1.30	1.0	2500.	.029	26.60	3000.	.054	39.40	2.617	66.00
2.0	.012	1.30	1.0	3000.	.043	34.26	2000.	.026	22.50	2.488	56.77
2.0	.012	1.30	1.0	3000.	.043	34.26	2500.	.039	31.04	2.583	65.30
2.0	.012	1.30	1.0	3000.	.043	34.26	3000.	.054	39.40	2.670	73.66
2.0	.012	1.30	1.5	1211.	.000	4.33	2000.	.026	27.00	2.835	31.33
2.0	.012	1.30	1.5	1211.	.000	4.33	2500.	.039	37.25	2.948	41.58
2.0	.012	1.30	1.5	1211.	.000	4.33	3000.	.054	47.28	3.053	51.61
2.0	.012	1.30	1.5	2500.	.030	20.70	2000.	.026	27.00	2.410	47.70
2.0	.012	1.30	1.5	2500.	.030	20.70	2500.	.039	37.25	2.524	57.94
2.0	.012	1.30	1.5	2500.	.030	20.70	3000.	.054	47.28	2.628	67.97
2.0	.012	1.30	1.5	3000.	.044	26.74	2000.	.026	27.00	2.448	53.74
2.0	.012	1.30	1.5	3000.	.044	26.74	2500.	.039	37.25	2.562	63.98
2.0	.012	1.30	1.5	3000.	.044	26.74	3000.	.054	47.28	2.666	74.01
2.0	.012	1.30	2.0	1190.	.000	3.05	2000.	.026	30.00	2.953	33.05
2.0	.012	1.30	2.0	1190.	.000	3.05	2500.	.039	41.38	3.079	44.43
2.0	.012	1.30	2.0	1190.	.000	3.05	3000.	.054	52.53	3.196	55.58
2.0	.012	1.30	2.0	2500.	.030	16.71	2000.	.026	30.00	2.399	46.71
2.0	.012	1.30	2.0	2500.	.030	16.71	2500.	.039	41.38	2.525	58.09
2.0	.012	1.30	2.0	2500.	.030	16.71	3000.	.054	52.53	2.641	69.24
2.0	.012	1.30	2.0	3000.	.044	21.65	2000.	.026	30.00	2.426	51.66
2.0	.012	1.30	2.0	3000.	.044	21.65	2500.	.039	41.38	2.552	63.04
2.0	.012	1.30	2.0	3000.	.044	21.65	3000.	.054	52.53	2.669	74.18

PHN	PAMB	PPRSE	BPR	VO							
2.0	.012	1.50	1.0	1208.	.000	5.29	2000.	.026	23.11	3.022	28.40
2.0	.012	1.50	1.0	1208.	.000	5.29	2500.	.039	31.77	3.123	37.05
2.0	.012	1.50	1.0	1208.	.000	5.29	3000.	.053	40.25	3.213	45.53
2.0	.012	1.50	1.0	2500.	.030	25.75	2000.	.026	23.11	2.453	48.87
2.0	.012	1.50	1.0	2500.	.030	25.75	2500.	.039	31.77	2.553	57.52
2.0	.012	1.50	1.0	2500.	.030	25.75	3000.	.053	40.25	2.644	66.00
2.0	.012	1.50	1.0	3000.	.044	33.28	2000.	.026	23.11	2.499	56.39
2.0	.012	1.50	1.0	3000.	.044	33.28	2500.	.039	31.77	2.600	65.05
2.0	.012	1.50	1.0	3000.	.044	33.28	3000.	.053	40.25	2.690	73.53
2.0	.012	1.50	1.5	1174.	.000	3.14	2000.	.026	27.74	3.377	30.88
2.0	.012	1.50	1.5	1174.	.000	3.14	2500.	.039	38.12	3.498	41.26
2.0	.012	1.50	1.5	1174.	.000	3.14	3000.	.053	48.30	3.606	51.44
2.0	.012	1.50	1.5	2500.	.030	19.53	2000.	.026	27.74	2.447	47.27
2.0	.012	1.50	1.5	2500.	.030	19.53	2500.	.039	38.12	2.567	57.65
2.0	.012	1.50	1.5	2500.	.030	19.53	3000.	.053	48.30	2.676	67.83
2.0	.012	1.50	1.5	3000.	.044	25.38	2000.	.026	27.74	2.475	53.12
2.0	.012	1.50	1.5	3000.	.044	25.38	2500.	.039	38.12	2.596	63.50
2.0	.012	1.50	1.5	3000.	.044	25.38	3000.	.053	48.30	2.704	73.67
2.0	.012	1.50	2.0	1139.	.000	1.64	2000.	.026	30.82	4.238	32.45
2.0	.012	1.50	2.0	1139.	.000	1.64	2500.	.039	42.36	4.372	43.99
2.0	.012	1.50	2.0	1139.	.000	1.64	3000.	.053	53.66	4.492	55.30
2.0	.012	1.50	2.0	2500.	.031	15.22	2000.	.026	30.82	2.463	46.04
2.0	.012	1.50	2.0	2500.	.031	15.22	2500.	.039	42.36	2.597	57.58
2.0	.012	1.50	2.0	2500.	.031	15.22	3000.	.053	53.66	2.717	68.88
2.0	.012	1.50	2.0	3000.	.045	19.92	2000.	.026	30.82	2.476	50.73
2.0	.012	1.50	2.0	3000.	.045	19.92	2500.	.039	42.36	2.610	62.27
2.0	.012	1.50	2.0	3000.	.045	19.92	3000.	.053	53.66	2.730	73.58
2.0	.012	1.70	1.0	1185.	.000	4.39	2000.	.025	23.60	3.396	27.99
2.0	.012	1.70	1.0	1185.	.000	4.39	2500.	.038	32.34	3.501	36.74
2.0	.012	1.70	1.0	1185.	.000	4.39	3000.	.053	40.92	3.594	45.31
2.0	.012	1.70	1.0	2500.	.030	24.89	2000.	.025	23.60	2.483	48.48
2.0	.012	1.70	1.0	2500.	.030	24.89	2500.	.038	32.34	2.589	57.23
2.0	.012	1.70	1.0	2500.	.030	24.89	3000.	.053	40.92	2.681	65.80
2.0	.012	1.70	1.0	3000.	.044	32.27	2000.	.025	23.60	2.523	55.87
2.0	.012	1.70	1.0	3000.	.044	32.27	2500.	.038	32.34	2.628	64.63
2.0	.012	1.70	1.0	3000.	.044	32.27	3000.	.053	40.92	2.721	73.19
2.0	.012	1.70	1.5	1139.	.000	1.97	2000.	.025	28.32	4.638	30.28
2.0	.012	1.70	1.5	1139.	.000	1.97	2500.	.038	38.81	4.765	40.78
2.0	.012	1.70	1.5	1139.	.000	1.97	3000.	.053	49.10	4.876	51.06
2.0	.012	1.70	1.5	2500.	.031	18.26	2000.	.025	28.32	2.511	46.58
2.0	.012	1.70	1.5	2500.	.031	18.26	2500.	.038	38.81	2.638	57.08
2.0	.012	1.70	1.5	2500.	.031	18.26	3000.	.053	49.10	2.749	67.36
2.0	.012	1.70	1.5	3000.	.045	23.90	2000.	.025	28.32	2.527	52.22
2.0	.012	1.70	1.5	3000.	.045	23.90	2500.	.038	38.81	2.654	62.71
2.0	.012	1.70	1.5	3000.	.045	23.90	3000.	.053	49.10	2.765	73.00
2.0	.012	1.70	2.0	1093.	.000	.18	2000.	.025	31.46	27.684	31.64
2.0	.012	1.70	2.0	1093.	.000	.18	2500.	.038	43.12	27.825	43.30
2.0	.012	1.70	2.0	1093.	.000	.18	3000.	.053	54.55	27.948	54.73
2.0	.012	1.70	2.0	2500.	.032	13.48	2000.	.025	31.46	2.583	44.94
2.0	.012	1.70	2.0	2500.	.032	13.48	2500.	.038	43.12	2.728	56.61
2.0	.012	1.70	2.0	2500.	.032	13.48	3000.	.053	54.55	2.852	68.04
2.0	.012	1.70	2.0	3000.	.046	17.90	2000.	.025	31.46	2.578	49.36
2.0	.012	1.70	2.0	3000.	.046	17.90	2500.	.038	43.12	2.719	61.02
2.0	.012	1.70	2.0	3000.	.046	17.90	3000.	.053	54.55	2.842	72.45

FMN	FAMB	FPRSL	BPR	T6	PAMB	TST	FTO	FAPAB	TS2	SFC	TST
3.0	.005	1.30	1.0	1228.	.000	-5.97	2000.	.019	11.29	.835	5.32
3.0	.005	1.30	1.0	1228.	.000	-5.97	2500.	.032	20.54	.715	14.57
3.0	.005	1.30	1.0	1228.	.000	-5.97	3000.	.046	29.64	.714	23.67
3.0	.005	1.30	1.0	2500.	.029	16.39	2000.	.019	11.29	3.349	27.68
3.0	.005	1.30	1.0	2500.	.029	16.39	2500.	.032	20.54	3.229	36.93
3.0	.005	1.30	1.0	2500.	.029	16.39	3000.	.046	29.64	3.229	46.03
3.0	.005	1.30	1.0	3000.	.043	24.83	2000.	.019	11.29	3.223	36.12
3.0	.005	1.30	1.0	3000.	.043	24.83	2500.	.032	20.54	3.103	45.37
3.0	.005	1.30	1.0	3000.	.043	24.83	3000.	.046	29.64	3.102	54.47
3.0	.005	1.30	1.5	1207.	.000	-5.26	2000.	.019	13.55	1.323	8.28
3.0	.005	1.30	1.5	1207.	.000	-5.26	2500.	.032	24.65	1.179	19.39
3.0	.005	1.30	1.5	1207.	.000	-5.26	3000.	.046	35.57	1.178	30.31
3.0	.005	1.30	1.5	2500.	.029	12.85	2000.	.019	13.55	3.335	26.40
3.0	.005	1.30	1.5	2500.	.029	12.85	2500.	.032	24.65	3.191	37.50
3.0	.005	1.30	1.5	2500.	.029	12.85	3000.	.046	35.57	3.190	48.42
3.0	.005	1.30	1.5	3000.	.043	19.56	2000.	.019	13.55	3.219	33.11
3.0	.005	1.30	1.5	3000.	.043	19.56	2500.	.032	24.65	3.075	44.21
3.0	.005	1.30	1.5	3000.	.043	19.56	3000.	.046	35.57	3.074	55.13
3.0	.005	1.30	2.0	1185.	.000	-4.80	2000.	.019	15.05	1.643	10.25
3.0	.005	1.30	2.0	1185.	.000	-4.80	2500.	.032	27.39	1.483	22.59
3.0	.005	1.30	2.0	1185.	.000	-4.80	3000.	.046	39.52	1.482	34.72
3.0	.005	1.30	2.0	2500.	.030	10.47	2000.	.019	15.05	3.331	25.52
3.0	.005	1.30	2.0	2500.	.030	10.47	2500.	.032	27.39	3.171	37.86
3.0	.005	1.30	2.0	2500.	.030	10.47	3000.	.046	39.52	3.170	49.99
3.0	.005	1.30	2.0	3000.	.044	16.02	2000.	.019	15.05	3.219	31.07
3.0	.005	1.30	2.0	3000.	.044	16.02	2500.	.032	27.39	3.060	43.41
3.0	.005	1.30	2.0	3000.	.044	16.02	3000.	.046	39.52	3.059	55.54
3.0	.005	1.50	1.0	1203.	.000	-6.67	2000.	.018	11.36	.856	4.69
3.0	.005	1.50	1.0	1203.	.000	-6.67	2500.	.031	20.63	.757	13.95
3.0	.005	1.50	1.0	1203.	.000	-6.67	3000.	.045	29.74	.764	23.07
3.0	.005	1.50	1.0	2500.	.029	16.01	2000.	.018	11.36	3.373	27.37
3.0	.005	1.50	1.0	2500.	.029	16.01	2500.	.031	20.63	3.274	36.64
3.0	.005	1.50	1.0	2500.	.029	16.01	3000.	.045	29.74	3.281	45.75
3.0	.005	1.50	1.0	3000.	.043	24.39	2000.	.018	11.36	3.224	35.75
3.0	.005	1.50	1.0	3000.	.043	24.39	2500.	.031	20.63	3.125	45.02
3.0	.005	1.50	1.0	3000.	.043	24.39	3000.	.045	29.74	3.132	54.13
3.0	.005	1.50	1.5	1169.	.000	-6.14	2000.	.018	13.64	1.334	7.49
3.0	.005	1.50	1.5	1169.	.000	-6.14	2500.	.031	24.75	1.215	18.61
3.0	.005	1.50	1.5	1169.	.000	-6.14	3000.	.045	35.69	1.223	29.55
3.0	.005	1.50	1.5	2500.	.030	12.32	2000.	.018	13.64	3.378	25.96
3.0	.005	1.50	1.5	2500.	.030	12.32	2500.	.031	24.75	3.259	37.08
3.0	.005	1.50	1.5	2500.	.030	12.32	3000.	.045	35.69	3.267	48.01
3.0	.005	1.50	1.5	3000.	.044	18.95	2000.	.018	13.64	3.230	32.58
3.0	.005	1.50	1.5	3000.	.044	18.95	2500.	.031	24.75	3.111	43.70
3.0	.005	1.50	1.5	3000.	.044	18.95	3000.	.045	35.69	3.119	54.63
3.0	.005	1.50	2.0	1134.	.000	-5.83	2000.	.018	15.15	1.642	9.32
3.0	.005	1.50	2.0	1134.	.000	-5.83	2500.	.031	27.51	1.510	21.67
3.0	.005	1.50	2.0	1134.	.000	-5.83	3000.	.045	39.65	1.519	33.82
3.0	.005	1.50	2.0	2500.	.031	9.78	2000.	.018	15.15	3.399	24.93
3.0	.005	1.50	2.0	2500.	.031	9.78	2500.	.031	27.51	3.268	37.29
3.0	.005	1.50	2.0	2500.	.031	9.78	3000.	.045	39.65	3.277	49.44
3.0	.005	1.50	2.0	3000.	.045	15.22	2000.	.018	15.15	3.245	30.37
3.0	.005	1.50	2.0	3000.	.045	15.22	2500.	.031	27.51	3.113	42.73
3.0	.005	1.50	2.0	3000.	.045	15.22	3000.	.045	39.65	3.122	54.88

ALTITUDE 50000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.005	1.70	1.0	1180.	.000	-7.34	2000.	.018	11.42	.867	4.09
3.0	.005	1.70	1.0	1180.	.000	-7.34	2500.	.031	20.70	.787	13.36
3.0	.005	1.70	1.0	1180.	.000	-7.34	3000.	.045	29.82	.800	22.48
3.0	.005	1.70	1.0	2500.	.030	15.62	2000.	.018	11.42	3.405	27.04
3.0	.005	1.70	1.0	2500.	.030	15.62	2500.	.031	20.70	3.324	36.31
3.0	.005	1.70	1.0	2500.	.030	15.62	3000.	.045	29.82	3.338	45.44
3.0	.005	1.70	1.0	3000.	.044	23.93	2000.	.018	11.42	3.233	35.36
3.0	.005	1.70	1.0	3000.	.044	23.93	2500.	.031	20.70	3.153	44.63
3.0	.005	1.70	1.0	3000.	.044	23.93	3000.	.045	29.82	3.166	53.75
3.0	.005	1.70	1.5	1134.	.000	-7.00	2000.	.018	13.71	1.333	6.71
3.0	.005	1.70	1.5	1134.	.000	-7.00	2500.	.031	24.84	1.236	17.84
3.0	.005	1.70	1.5	1134.	.000	-7.00	3000.	.045	35.78	1.252	28.79
3.0	.005	1.70	1.5	2500.	.031	11.74	2000.	.018	13.71	3.441	25.45
3.0	.005	1.70	1.5	2500.	.031	11.74	2500.	.031	24.84	3.345	36.57
3.0	.005	1.70	1.5	2500.	.031	11.74	3000.	.045	35.78	3.361	47.52
3.0	.005	1.70	1.5	3000.	.045	18.27	2000.	.018	13.71	3.256	31.97
3.0	.005	1.70	1.5	3000.	.045	18.27	2500.	.031	24.84	3.159	43.10
3.0	.005	1.70	1.5	3000.	.045	18.27	3000.	.045	35.78	3.175	54.05
3.0	.005	1.70	2.0	1087.	.000	-6.85	2000.	.018	15.23	1.630	8.38
3.0	.005	1.70	2.0	1087.	.000	-6.85	2500.	.031	27.59	1.523	20.74
3.0	.005	1.70	2.0	1087.	.000	-6.85	3000.	.045	39.76	1.541	32.90
3.0	.005	1.70	2.0	2500.	.032	8.97	2000.	.018	15.23	3.514	24.20
3.0	.005	1.70	2.0	2500.	.032	8.97	2500.	.031	27.59	3.407	36.57
3.0	.005	1.70	2.0	2500.	.032	8.97	3000.	.045	39.76	3.425	48.73
3.0	.005	1.70	2.0	3000.	.046	14.28	2000.	.018	15.23	3.300	29.51
3.0	.005	1.70	2.0	3000.	.046	14.28	2500.	.031	27.59	3.193	41.88
3.0	.005	1.70	2.0	3000.	.046	14.28	3000.	.045	39.76	3.210	54.04

FMN	FAMB	FPRSL	BPR	T6	FARB	TST	T10	FARB	TSC	SFC	TSV
1.0	.016	1.30	1.0	1163.	.000	9.44	2000.	.030	21.49	2.828	30.94
1.0	.016	1.30	1.0	1163.	.000	9.44	2500.	.044	26.87	3.022	36.31
1.0	.016	1.30	1.0	1163.	.000	9.44	3000.	.058	32.05	3.195	41.49
1.0	.016	1.30	1.0	2500.	.028	23.40	2000.	.030	21.49	2.979	44.89
1.0	.016	1.30	1.0	2500.	.028	23.40	2500.	.044	26.87	3.173	50.26
1.0	.016	1.30	1.0	2500.	.028	23.40	3000.	.058	32.05	3.347	55.44
1.0	.016	1.30	1.0	3000.	.041	28.18	2000.	.030	21.49	3.092	49.67
1.0	.016	1.30	1.0	3000.	.041	28.18	2500.	.044	26.87	3.286	55.04
1.0	.016	1.30	1.0	3000.	.041	28.18	3000.	.058	32.05	3.460	60.23
1.0	.016	1.30	1.5	1139.	.000	6.40	2000.	.030	25.79	2.995	32.19
1.0	.016	1.30	1.5	1139.	.000	6.40	2500.	.044	32.24	3.228	38.64
1.0	.016	1.30	1.5	1139.	.000	6.40	3000.	.058	38.46	3.436	44.86
1.0	.016	1.30	1.5	2500.	.029	17.06	2000.	.030	25.79	3.040	42.85
1.0	.016	1.30	1.5	2500.	.029	17.06	2500.	.044	32.24	3.273	49.30
1.0	.016	1.30	1.5	2500.	.029	17.06	3000.	.058	38.46	3.481	55.52
1.0	.016	1.30	1.5	3000.	.041	20.62	2000.	.030	25.79	3.132	46.41
1.0	.016	1.30	1.5	3000.	.041	20.62	2500.	.044	32.24	3.365	52.85
1.0	.016	1.30	1.5	3000.	.041	20.62	3000.	.058	38.46	3.573	59.07
1.0	.016	1.30	2.0	1115.	.000	4.29	2000.	.030	28.66	3.216	32.95
1.0	.016	1.30	2.0	1115.	.000	4.29	2500.	.044	35.82	3.475	40.11
1.0	.016	1.30	2.0	1115.	.000	4.29	3000.	.058	42.73	3.706	47.03
1.0	.016	1.30	2.0	2500.	.029	12.66	2000.	.030	28.66	3.127	41.32
1.0	.016	1.30	2.0	2500.	.029	12.66	2500.	.044	35.82	3.386	48.48
1.0	.016	1.30	2.0	2500.	.029	12.66	3000.	.058	42.73	3.617	55.39
1.0	.016	1.30	2.0	3000.	.042	15.37	2000.	.030	28.66	3.203	44.03
1.0	.016	1.30	2.0	3000.	.042	15.37	2500.	.044	35.82	3.462	51.19
1.0	.016	1.30	2.0	3000.	.042	15.37	3000.	.058	42.73	3.693	58.10
1.0	.016	1.50	1.0	1135.	.000	7.76	2000.	.030	24.79	2.978	32.55
1.0	.016	1.50	1.0	1135.	.000	7.76	2500.	.043	30.81	3.156	38.58
1.0	.016	1.50	1.0	1135.	.000	7.76	3000.	.058	36.65	3.313	44.41
1.0	.016	1.50	1.0	2500.	.029	20.98	2000.	.030	24.79	3.013	45.76
1.0	.016	1.50	1.0	2500.	.029	20.98	2500.	.043	30.81	3.191	51.79
1.0	.016	1.50	1.0	2500.	.029	20.98	3000.	.058	36.65	3.348	57.62
1.0	.016	1.50	1.0	3000.	.041	25.37	2000.	.030	24.79	3.127	50.16
1.0	.016	1.50	1.0	3000.	.041	25.37	2500.	.043	30.81	3.305	56.18
1.0	.016	1.50	1.0	3000.	.041	25.37	3000.	.058	36.65	3.462	62.01
1.0	.016	1.50	1.5	1098.	.000	4.17	2000.	.030	29.74	3.555	33.92
1.0	.016	1.50	1.5	1098.	.000	4.17	2500.	.043	36.97	3.769	41.15
1.0	.016	1.50	1.5	1098.	.000	4.17	3000.	.058	43.98	3.958	48.15
1.0	.016	1.50	1.5	2500.	.029	13.67	2000.	.030	29.74	3.225	43.42
1.0	.016	1.50	1.5	2500.	.029	13.67	2500.	.043	36.97	3.439	50.64
1.0	.016	1.50	1.5	2500.	.029	13.67	3000.	.058	43.98	3.628	57.65
1.0	.016	1.50	1.5	3000.	.042	16.68	2000.	.030	29.74	3.316	46.42
1.0	.016	1.50	1.5	3000.	.042	16.68	2500.	.043	36.97	3.529	53.65
1.0	.016	1.50	1.5	3000.	.042	16.68	3000.	.058	43.98	3.718	60.65
1.0	.016	1.50	2.0	1060.	.000	1.67	2000.	.030	33.05	5.359	34.72
1.0	.016	1.50	2.0	1060.	.000	1.67	2500.	.043	41.08	5.597	42.75
1.0	.016	1.50	2.0	1060.	.000	1.67	3000.	.058	48.86	5.806	50.53
1.0	.016	1.50	2.0	2500.	.030	8.66	2000.	.030	33.05	3.589	41.71
1.0	.016	1.50	2.0	2500.	.030	8.66	2500.	.043	41.08	3.826	49.74
1.0	.016	1.50	2.0	2500.	.030	8.66	3000.	.058	48.86	4.036	57.52
1.0	.016	1.50	2.0	3000.	.043	10.76	2000.	.030	33.05	3.643	43.81
1.0	.016	1.50	2.0	3000.	.043	10.76	2500.	.043	41.08	3.880	51.84
1.0	.016	1.50	2.0	3000.	.043	10.76	3000.	.058	48.86	4.090	59.62

FNN	FANB	FPRSL	BPR	T8	FANB	TST	T10	FANB	TSE	SFC	T4
1.0	.016	1.70	1.0	1110.	.000	6.11	2000.	.029	27.26	3.380	33.36
1.0	.016	1.70	1.0	1110.	.000	6.11	2500.	.043	33.77	3.548	39.87
1.0	.016	1.70	1.0	1110.	.000	6.11	3000.	.057	40.09	3.695	46.20
1.0	.016	1.70	1.0	2500.	.029	18.47	2000.	.029	27.26	3.185	45.73
1.0	.016	1.70	1.0	2500.	.029	18.47	2500.	.043	33.77	3.353	52.24
1.0	.016	1.70	1.0	2500.	.029	18.47	3000.	.057	40.09	3.500	58.56
1.0	.016	1.70	1.0	3000.	.042	22.46	2000.	.029	27.26	3.299	49.71
1.0	.016	1.70	1.0	3000.	.042	22.46	2500.	.043	33.77	3.467	56.23
1.0	.016	1.70	1.0	3000.	.042	22.46	3000.	.057	40.09	3.614	62.55
1.0	.016	1.70	1.5	1060.	.000	2.01	2000.	.029	32.71	5.854	34.72
1.0	.016	1.70	1.5	1060.	.000	2.01	2500.	.043	40.52	6.056	42.53
1.0	.016	1.70	1.5	1060.	.000	2.01	3000.	.057	48.11	6.232	50.12
1.0	.016	1.70	1.5	2500.	.030	10.40	2000.	.029	32.71	3.736	43.10
1.0	.016	1.70	1.5	2500.	.030	10.40	2500.	.043	40.52	3.937	50.92
1.0	.016	1.70	1.5	2500.	.030	10.40	3000.	.057	48.11	4.114	58.51
1.0	.016	1.70	1.5	3000.	.043	12.91	2000.	.029	32.71	3.801	45.62
1.0	.016	1.70	1.5	3000.	.043	12.91	2500.	.043	40.52	4.003	53.44
1.0	.016	1.70	1.5	3000.	.043	12.91	3000.	.057	48.11	4.179	61.02
1.0	.016	1.70	2.0	1009.	.000	-1.23	2000.	.029	36.34	-4.013	35.11
1.0	.016	1.70	2.0	1009.	.000	-1.23	2500.	.043	45.02	-3.789	43.79
1.0	.016	1.70	2.0	1009.	.000	-1.23	3000.	.057	53.46	-3.593	52.23
1.0	.016	1.70	2.0	2500.	.031	4.37	2000.	.029	36.34	5.632	40.71
1.0	.016	1.70	2.0	2500.	.031	4.37	2500.	.043	45.02	5.856	49.39
1.0	.016	1.70	2.0	2500.	.031	4.37	3000.	.057	53.46	6.052	57.82
1.0	.016	1.70	2.0	3000.	.044	5.97	2000.	.029	36.34	5.318	42.32
1.0	.016	1.70	2.0	3000.	.044	5.97	2500.	.043	45.02	5.542	51.00
1.0	.016	1.70	2.0	3000.	.044	5.97	3000.	.057	53.46	5.738	59.43
2.0	.012	1.30	1.0	1213.	.000	4.50	2000.	.026	22.50	3.422	27.00
2.0	.012	1.30	1.0	1213.	.000	4.50	2500.	.039	31.04	3.516	35.54
2.0	.012	1.30	1.0	1213.	.000	4.50	3000.	.054	39.40	3.604	43.90
2.0	.012	1.30	1.0	2500.	.029	24.37	2000.	.026	22.50	2.548	46.87
2.0	.012	1.30	1.0	2500.	.029	24.37	2500.	.039	31.04	2.643	55.41
2.0	.012	1.30	1.0	2500.	.029	24.37	3000.	.054	39.40	2.730	63.77
2.0	.012	1.30	1.0	3000.	.042	31.69	2000.	.026	22.50	2.583	54.19
2.0	.012	1.30	1.0	3000.	.042	31.69	2500.	.039	31.04	2.678	62.73
2.0	.012	1.30	1.0	3000.	.042	31.69	3000.	.054	39.40	2.765	71.09
2.0	.012	1.30	1.5	1190.	.000	2.93	2000.	.026	27.00	3.593	29.93
2.0	.012	1.30	1.5	1190.	.000	2.93	2500.	.039	37.25	3.706	40.17
2.0	.012	1.30	1.5	1190.	.000	2.93	3000.	.054	47.28	3.811	50.20
2.0	.012	1.30	1.5	2500.	.029	18.85	2000.	.026	27.00	2.512	45.85
2.0	.012	1.30	1.5	2500.	.029	18.85	2500.	.039	37.25	2.625	56.09
2.0	.012	1.30	1.5	2500.	.029	18.85	3000.	.054	47.28	2.730	66.12
2.0	.012	1.30	1.5	3000.	.043	24.60	2000.	.026	27.00	2.533	51.60
2.0	.012	1.30	1.5	3000.	.043	24.60	2500.	.039	37.25	2.647	61.84
2.0	.012	1.30	1.5	3000.	.043	24.60	3000.	.054	47.28	2.752	71.88
2.0	.012	1.30	2.0	1168.	.000	1.85	2000.	.026	30.00	3.965	31.85
2.0	.012	1.30	2.0	1168.	.000	1.85	2500.	.039	41.38	4.092	43.23
2.0	.012	1.30	2.0	1168.	.000	1.85	3000.	.054	52.53	4.208	54.38
2.0	.012	1.30	2.0	2500.	.030	15.11	2000.	.026	30.00	2.495	45.11
2.0	.012	1.30	2.0	2500.	.030	15.11	2500.	.039	41.38	2.621	56.49
2.0	.012	1.30	2.0	2500.	.030	15.11	3000.	.054	52.53	2.738	67.63
2.0	.012	1.30	2.0	3000.	.043	19.80	2000.	.026	30.00	2.507	49.80
2.0	.012	1.30	2.0	3000.	.043	19.80	2500.	.039	41.38	2.633	61.18
2.0	.012	1.30	2.0	3000.	.043	19.80	3000.	.054	52.53	2.749	72.33

FAN	FAMB	FPRSL	BPR	T0	PAMB	VSL					
2.0	.012	1.50	1.0	1187.	.000	3.53	2000.	.026	23.11	4.034	26.64
2.0	.012	1.50	1.0	1187.	.000	3.53	2500.	.039	31.77	4.134	35.29
2.0	.012	1.50	1.0	1187.	.000	3.53	3000.	.053	40.25	4.225	43.77
2.0	.012	1.50	1.0	2500.	.029	23.43	2000.	.026	23.11	2.582	46.54
2.0	.012	1.50	1.0	2500.	.029	23.43	2500.	.039	31.77	2.683	55.20
2.0	.012	1.50	1.0	2500.	.029	23.43	3000.	.053	40.25	2.773	63.67
2.0	.012	1.50	1.0	3000.	.043	30.59	2000.	.026	23.11	2.608	53.71
2.0	.012	1.50	1.0	3000.	.043	30.59	2500.	.039	31.77	2.708	62.36
2.0	.012	1.50	1.0	3000.	.043	30.59	3000.	.053	40.25	2.799	70.84
2.0	.012	1.50	1.5	1151.	.000	1.67	2000.	.026	27.74	5.291	29.41
2.0	.012	1.50	1.5	1151.	.000	1.67	2500.	.039	38.12	5.412	39.80
2.0	.012	1.50	1.5	1151.	.000	1.67	3000.	.053	48.30	5.520	49.97
2.0	.012	1.50	1.5	2500.	.030	17.54	2000.	.026	27.74	2.575	45.28
2.0	.012	1.50	1.5	2500.	.030	17.54	2500.	.039	38.12	2.696	55.66
2.0	.012	1.50	1.5	2500.	.030	17.54	3000.	.053	48.30	2.804	65.84
2.0	.012	1.50	1.5	3000.	.044	23.08	2000.	.026	27.74	2.582	50.82
2.0	.012	1.50	1.5	3000.	.044	23.08	2500.	.039	38.12	2.703	61.20
2.0	.012	1.50	1.5	3000.	.044	23.08	3000.	.053	48.30	2.811	71.38
2.0	.012	1.50	2.0	1116.	.000	.35	2000.	.026	30.82	14.964	31.17
2.0	.012	1.50	2.0	1116.	.000	.35	2500.	.039	42.36	15.099	42.71
2.0	.012	1.50	2.0	1116.	.000	.35	3000.	.053	53.66	15.219	54.01
2.0	.012	1.50	2.0	2500.	.031	13.42	2000.	.026	30.82	2.603	44.24
2.0	.012	1.50	2.0	2500.	.031	13.42	2500.	.039	42.36	2.737	55.78
2.0	.012	1.50	2.0	2500.	.031	13.42	3000.	.053	53.66	2.857	67.08
2.0	.012	1.50	2.0	3000.	.044	17.84	2000.	.026	30.82	2.591	48.66
2.0	.012	1.50	2.0	3000.	.044	17.84	2500.	.039	42.36	2.725	60.20
2.0	.012	1.50	2.0	3000.	.044	17.84	3000.	.053	53.66	2.846	71.50
2.0	.012	1.70	1.0	1163.	.000	2.58	2000.	.025	23.60	5.101	26.18
2.0	.012	1.70	1.0	1163.	.000	2.58	2500.	.038	32.34	5.206	34.93
2.0	.012	1.70	1.0	1163.	.000	2.58	3000.	.053	40.92	5.299	43.50
2.0	.012	1.70	1.0	2500.	.030	22.46	2000.	.025	23.60	2.632	46.05
2.0	.012	1.70	1.0	2500.	.030	22.46	2500.	.038	32.34	2.738	54.80
2.0	.012	1.70	1.0	2500.	.030	22.46	3000.	.053	40.92	2.831	63.37
2.0	.012	1.70	1.0	3000.	.043	29.47	2000.	.025	23.60	2.647	53.06
2.0	.012	1.70	1.0	3000.	.043	29.47	2500.	.038	32.34	2.753	61.81
2.0	.012	1.70	1.0	3000.	.043	29.47	3000.	.053	40.92	2.845	70.38
2.0	.012	1.70	1.5	1116.	.000	.42	2000.	.025	28.32	17.436	28.74
2.0	.012	1.70	1.5	1116.	.000	.42	2500.	.038	38.81	17.563	39.23
2.0	.012	1.70	1.5	1116.	.000	.42	3000.	.053	49.10	17.674	49.52
2.0	.012	1.70	1.5	2500.	.031	16.11	2000.	.025	28.32	2.679	44.42
2.0	.012	1.70	1.5	2500.	.031	16.11	2500.	.038	38.81	2.806	54.92
2.0	.012	1.70	1.5	2500.	.031	16.11	3000.	.053	49.10	2.917	65.21
2.0	.012	1.70	1.5	3000.	.044	21.41	2000.	.025	28.32	2.665	49.73
2.0	.012	1.70	1.5	3000.	.044	21.41	2500.	.038	38.81	2.792	60.23
2.0	.012	1.70	1.5	3000.	.044	21.41	3000.	.053	49.10	2.903	70.51
2.0	.012	1.70	2.0	1068.	.000	-1.21	2000.	.025	31.46	-2.639	30.25
2.0	.012	1.70	2.0	1068.	.000	-1.21	2500.	.038	43.12	-2.498	41.91
2.0	.012	1.70	2.0	1068.	.000	-1.21	3000.	.053	54.55	-2.375	53.34
2.0	.012	1.70	2.0	2500.	.032	11.45	2000.	.025	31.46	2.806	42.91
2.0	.012	1.70	2.0	2500.	.032	11.45	2500.	.038	43.12	2.947	54.57
2.0	.012	1.70	2.0	2500.	.032	11.45	3000.	.053	54.55	3.070	66.00
2.0	.012	1.70	2.0	3000.	.045	15.54	2000.	.025	31.46	2.754	47.01
2.0	.012	1.70	2.0	3000.	.045	15.54	2500.	.038	43.12	2.894	58.67
2.0	.012	1.70	2.0	3000.	.045	15.54	3000.	.053	54.55	3.018	70.10

3.0	.005	1.30	1.0	1215.	.000	-7.02	2000.	.019	11.29	.936	4.27
3.0	.005	1.30	1.0	1215.	.000	-7.02	2500.	.032	20.54	.816	13.52
3.0	.005	1.30	1.0	1215.	.000	-7.02	3000.	.046	29.64	.815	22.62
3.0	.005	1.30	1.0	2500.	.029	15.11	2000.	.019	11.29	3.490	26.39
3.0	.005	1.30	1.0	2500.	.029	15.11	2500.	.032	20.54	3.370	35.65
3.0	.005	1.30	1.0	2500.	.029	15.11	3000.	.046	29.64	3.370	44.75
3.0	.005	1.30	1.0	3000.	.042	23.34	2000.	.019	11.29	3.311	34.63
3.0	.005	1.30	1.0	3000.	.042	23.34	2500.	.032	20.54	3.192	43.89
3.0	.005	1.30	1.0	3000.	.042	23.34	3000.	.046	29.64	3.191	52.99
3.0	.005	1.30	1.5	1193.	.000	-6.11	2000.	.019	13.55	1.391	7.44
3.0	.005	1.30	1.5	1193.	.000	-6.11	2500.	.032	24.65	1.248	18.54
3.0	.005	1.30	1.5	1193.	.000	-6.11	3000.	.046	35.57	1.247	29.46
3.0	.005	1.30	1.5	2500.	.029	11.80	2000.	.019	13.55	3.458	25.35
3.0	.005	1.30	1.5	2500.	.029	11.80	2500.	.032	24.65	3.314	36.45
3.0	.005	1.30	1.5	2500.	.029	11.80	3000.	.046	35.57	3.313	47.37
3.0	.005	1.30	1.5	3000.	.043	18.35	2000.	.019	13.55	3.295	31.89
3.0	.005	1.30	1.5	3000.	.043	18.35	2500.	.032	24.65	3.151	43.00
3.0	.005	1.30	1.5	3000.	.043	18.35	3000.	.046	35.57	3.150	53.92
3.0	.005	1.30	2.0	1170.	.000	-5.52	2000.	.019	15.05	1.691	9.53
3.0	.005	1.30	2.0	1170.	.000	-5.52	2500.	.032	27.39	1.532	21.87
3.0	.005	1.30	2.0	1170.	.000	-5.52	3000.	.046	39.52	1.531	34.00
3.0	.005	1.30	2.0	2500.	.030	9.57	2000.	.019	15.05	3.443	24.62
3.0	.005	1.30	2.0	2500.	.030	9.57	2500.	.032	27.39	3.283	36.96
3.0	.005	1.30	2.0	2500.	.030	9.57	3000.	.046	39.52	3.282	49.09
3.0	.005	1.30	2.0	3000.	.043	14.98	2000.	.019	15.05	3.288	30.04
3.0	.005	1.30	2.0	3000.	.043	14.98	2500.	.032	27.39	3.129	42.37
3.0	.005	1.30	2.0	3000.	.043	14.98	3000.	.046	39.52	3.128	54.51
3.0	.005	1.50	1.0	1189.	.000	-7.74	2000.	.018	11.36	.939	3.63
3.0	.005	1.50	1.0	1189.	.000	-7.74	2500.	.031	20.63	.840	12.89
3.0	.005	1.50	1.0	1189.	.000	-7.74	3000.	.045	29.74	.847	22.01
3.0	.005	1.50	1.0	2500.	.029	14.69	2000.	.018	11.36	3.528	26.06
3.0	.005	1.50	1.0	2500.	.029	14.69	2500.	.031	20.63	3.429	35.32
3.0	.005	1.50	1.0	2500.	.029	14.69	3000.	.045	29.74	3.436	44.44
3.0	.005	1.50	1.0	3000.	.043	22.87	2000.	.018	11.36	3.321	34.23
3.0	.005	1.50	1.0	3000.	.043	22.87	2500.	.031	20.63	3.222	43.50
3.0	.005	1.50	1.0	3000.	.043	22.87	3000.	.045	29.74	3.229	52.61
3.0	.005	1.50	1.5	1154.	.000	-7.01	2000.	.018	13.64	1.386	6.62
3.0	.005	1.50	1.5	1154.	.000	-7.01	2500.	.031	24.75	1.267	17.74
3.0	.005	1.50	1.5	1154.	.000	-7.01	3000.	.045	35.69	1.276	28.68
3.0	.005	1.50	1.5	2500.	.030	11.23	2000.	.018	13.64	3.522	24.86
3.0	.005	1.50	1.5	2500.	.030	11.23	2500.	.031	24.75	3.404	35.98
3.0	.005	1.50	1.5	2500.	.030	11.23	3000.	.045	35.69	3.412	46.92
3.0	.005	1.50	1.5	3000.	.043	17.68	2000.	.018	13.64	3.318	31.32
3.0	.005	1.50	1.5	3000.	.043	17.68	2500.	.031	24.75	3.199	42.44
3.0	.005	1.50	1.5	3000.	.043	17.68	3000.	.045	35.69	3.208	53.37
3.0	.005	1.50	2.0	1118.	.000	-6.58	2000.	.018	15.15	1.677	8.58
3.0	.005	1.50	2.0	1118.	.000	-6.58	2500.	.031	27.51	1.545	20.93
3.0	.005	1.50	2.0	1118.	.000	-6.58	3000.	.045	39.65	1.554	33.08
3.0	.005	1.50	2.0	2500.	.031	8.83	2000.	.018	15.15	3.544	23.98
3.0	.005	1.50	2.0	2500.	.031	8.83	2500.	.031	27.51	3.413	36.33
3.0	.005	1.50	2.0	2500.	.031	8.83	3000.	.045	39.65	3.422	48.48
3.0	.005	1.50	2.0	3000.	.044	14.12	2000.	.018	15.15	3.331	29.27
3.0	.005	1.50	2.0	3000.	.044	14.12	2500.	.031	27.51	3.199	41.62
3.0	.005	1.50	2.0	3000.	.044	14.12	3000.	.045	39.65	3.208	53.77

ALTITUDE 60000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.005	1.70	1.0	1166.	.000	-8.41	2000.	.018	11.42	.938	3.01
3.0	.005	1.70	1.0	1166.	.000	-8.41	2500.	.031	20.70	.857	12.28
3.0	.005	1.70	1.0	1166.	.000	-8.41	3000.	.045	29.82	.871	21.40
3.0	.005	1.70	1.0	2500.	.030	14.27	2000.	.018	11.42	3.576	25.69
3.0	.005	1.70	1.0	2500.	.030	14.27	2500.	.031	20.70	3.496	34.96
3.0	.005	1.70	1.0	2500.	.030	14.27	3000.	.045	29.82	3.509	44.09
3.0	.005	1.70	1.0	3000.	.043	22.37	2000.	.018	11.42	3.338	33.80
3.0	.005	1.70	1.0	3000.	.043	22.37	2500.	.031	20.70	3.258	43.07
3.0	.005	1.70	1.0	3000.	.043	22.37	3000.	.045	29.82	3.271	52.19
3.0	.005	1.70	1.5	1119.	.000	-7.89	2000.	.018	13.71	1.375	5.82
3.0	.005	1.70	1.5	1119.	.000	-7.89	2500.	.031	24.84	1.278	16.95
3.0	.005	1.70	1.5	1119.	.000	-7.89	3000.	.045	35.78	1.294	27.89
3.0	.005	1.70	1.5	2500.	.031	10.59	2000.	.018	13.71	3.615	24.30
3.0	.005	1.70	1.5	2500.	.031	10.59	2500.	.031	24.84	3.519	35.43
3.0	.005	1.70	1.5	2500.	.031	10.59	3000.	.045	35.78	3.535	46.37
3.0	.005	1.70	1.5	3000.	.044	16.94	2000.	.018	13.71	3.359	30.65
3.0	.005	1.70	1.5	3000.	.044	16.94	2500.	.031	24.84	3.263	41.78
3.0	.005	1.70	1.5	3000.	.044	16.94	3000.	.045	35.78	3.279	52.72
3.0	.005	1.70	2.0	1071.	.000	-7.64	2000.	.018	15.23	1.657	7.59
3.0	.005	1.70	2.0	1071.	.000	-7.64	2500.	.031	27.59	1.550	19.96
3.0	.005	1.70	2.0	1071.	.000	-7.64	3000.	.045	39.76	1.568	32.12
3.0	.005	1.70	2.0	2500.	.032	7.94	2000.	.018	15.23	3.712	23.17
3.0	.005	1.70	2.0	2500.	.032	7.94	2500.	.031	27.59	3.605	35.54
3.0	.005	1.70	2.0	2500.	.032	7.94	3000.	.045	39.76	3.622	47.70
3.0	.005	1.70	2.0	3000.	.045	13.09	2000.	.018	15.23	3.411	28.32
3.0	.005	1.70	2.0	3000.	.045	13.09	2500.	.031	27.59	3.304	40.68
3.0	.005	1.70	2.0	3000.	.045	13.09	3000.	.045	39.76	3.322	52.85

PHN	PHB	PPRSE	BPR	VO							
1.0	.017	1.30	1.0	1080.	.000	1.62	2000.	.032	21.59	11.072	23.21
1.0	.017	1.30	1.0	1080.	.000	1.62	2500.	.047	27.04	11.281	28.66
1.0	.017	1.30	1.0	1080.	.000	1.62	3000.	.063	32.33	11.468	33.95
1.0	.017	1.30	1.0	2500.	.029	11.37	2000.	.032	21.59	5.019	32.97
1.0	.017	1.30	1.0	2500.	.029	11.37	2500.	.047	27.04	5.228	38.42
1.0	.017	1.30	1.0	2500.	.029	11.37	3000.	.063	32.33	5.415	43.70
1.0	.017	1.30	1.0	3000.	.041	14.37	2000.	.032	21.59	5.028	35.96
1.0	.017	1.30	1.0	3000.	.041	14.37	2500.	.047	27.04	5.237	41.41
1.0	.017	1.30	1.0	3000.	.041	14.37	3000.	.063	32.33	5.424	46.69
1.0	.017	1.30	1.5	1054.	.000	-.16	2000.	.032	25.91	-62.291	25.75
1.0	.017	1.30	1.5	1054.	.000	-.16	2500.	.047	32.45	-62.040	32.29
1.0	.017	1.30	1.5	1054.	.000	-.16	3000.	.063	38.79	-61.816	38.63
1.0	.017	1.30	1.5	2500.	.029	7.03	2000.	.032	25.91	5.461	32.94
1.0	.017	1.30	1.5	2500.	.029	7.03	2500.	.047	32.45	5.712	39.48
1.0	.017	1.30	1.5	2500.	.029	7.03	3000.	.063	38.79	5.936	45.82
1.0	.017	1.30	1.5	3000.	.042	9.18	2000.	.032	25.91	5.336	35.09
1.0	.017	1.30	1.5	3000.	.042	9.18	2500.	.047	32.45	5.587	41.63
1.0	.017	1.30	1.5	3000.	.042	9.18	3000.	.063	38.79	5.811	47.97
1.0	.017	1.30	2.0	1027.	.000	-1.52	2000.	.032	28.79	-2.798	27.27
1.0	.017	1.30	2.0	1027.	.000	-1.52	2500.	.047	36.06	-2.519	34.54
1.0	.017	1.30	2.0	1027.	.000	-1.52	3000.	.063	43.10	-2.270	41.58
1.0	.017	1.30	2.0	2500.	.030	3.80	2000.	.032	28.79	6.782	32.59
1.0	.017	1.30	2.0	2500.	.030	3.80	2500.	.047	36.06	7.061	39.86
1.0	.017	1.30	2.0	2500.	.030	3.80	3000.	.063	43.10	7.310	46.90
1.0	.017	1.30	2.0	3000.	.042	5.36	2000.	.032	28.79	6.258	34.15
1.0	.017	1.30	2.0	3000.	.042	5.36	2500.	.047	36.06	6.537	41.42
1.0	.017	1.30	2.0	3000.	.042	5.36	3000.	.063	43.10	6.786	48.46
1.0	.017	1.50	1.0	1049.	.000	-.50	2000.	.032	24.90	-30.257	24.40
1.0	.017	1.50	1.0	1049.	.000	-.50	2500.	.046	31.02	-30.066	30.52
1.0	.017	1.50	1.0	1049.	.000	-.50	3000.	.062	36.97	-29.897	36.47
1.0	.017	1.50	1.0	2500.	.029	8.34	2000.	.032	24.90	6.214	33.24
1.0	.017	1.50	1.0	2500.	.029	8.34	2500.	.046	31.02	6.405	39.36
1.0	.017	1.50	1.0	2500.	.029	8.34	3000.	.062	36.97	6.574	45.31
1.0	.017	1.50	1.0	3000.	.042	10.98	2000.	.032	24.90	6.009	35.88
1.0	.017	1.50	1.0	3000.	.042	10.98	2500.	.046	31.02	6.201	42.00
1.0	.017	1.50	1.0	3000.	.042	10.98	3000.	.062	36.97	6.370	47.95
1.0	.017	1.50	1.5	1008.	.000	-3.25	2000.	.032	29.88	-1.713	26.63
1.0	.017	1.50	1.5	1008.	.000	-3.25	2500.	.046	37.22	-1.483	33.97
1.0	.017	1.50	1.5	1008.	.000	-3.25	3000.	.062	44.37	-1.280	41.12
1.0	.017	1.50	1.5	2500.	.030	2.38	2000.	.032	29.88	12.926	32.26
1.0	.017	1.50	1.5	2500.	.030	2.38	2500.	.046	37.22	13.156	39.60
1.0	.017	1.50	1.5	2500.	.030	2.38	3000.	.062	44.37	13.359	46.74
1.0	.017	1.50	1.5	3000.	.043	4.00	2000.	.032	29.88	10.030	33.88
1.0	.017	1.50	1.5	3000.	.043	4.00	2500.	.046	37.22	10.260	41.22
1.0	.017	1.50	1.5	3000.	.043	4.00	3000.	.062	44.37	10.463	48.37
1.0	.017	1.50	2.0	966.	.000	-6.43	2000.	.032	33.20	.454	26.77
1.0	.017	1.50	2.0	966.	.000	-6.43	2500.	.046	41.36	.709	34.93
1.0	.017	1.50	2.0	966.	.000	-6.43	3000.	.062	49.30	.935	42.86
1.0	.017	1.50	2.0	2500.	.031	-4.00	2000.	.032	33.20	-3.301	29.20
1.0	.017	1.50	2.0	2500.	.031	-4.00	2500.	.046	41.36	-3.045	37.36
1.0	.017	1.50	2.0	2500.	.031	-4.00	3000.	.062	49.30	-2.820	45.30
1.0	.017	1.50	2.0	3000.	.043	-3.32	2000.	.032	33.20	-5.783	29.88
1.0	.017	1.50	2.0	3000.	.043	-3.32	2500.	.046	41.36	-5.528	38.04
1.0	.017	1.50	2.0	3000.	.043	-3.32	3000.	.062	49.30	-5.302	45.97

PHN	PAMB	PPKSL	BPR	T6	PAAB	TST	PT0	PAPAB	TS2	SPC	VST
1.0	.017	1.70	1.0	1022.	.000	-2.75	2000.	.031	27.38	-4.681	24.63
1.0	.017	1.70	1.0	1022.	.000	-2.75	2500.	.046	34.00	-4.501	31.24
1.0	.017	1.70	1.0	1022.	.000	-2.75	3000.	.062	40.45	-4.342	37.70
1.0	.017	1.70	1.0	2500.	.030	4.98	2000.	.031	27.38	9.594	32.37
1.0	.017	1.70	1.0	2500.	.030	4.98	2500.	.046	34.00	9.775	38.98
1.0	.017	1.70	1.0	2500.	.030	4.98	3000.	.062	40.45	9.933	45.44
1.0	.017	1.70	1.0	3000.	.042	7.24	2000.	.031	27.38	8.465	34.62
1.0	.017	1.70	1.0	3000.	.042	7.24	2500.	.046	34.00	8.645	41.24
1.0	.017	1.70	1.0	3000.	.042	7.24	3000.	.062	40.45	8.804	47.69
1.0	.017	1.70	1.5	966.	.000	-7.71	2000.	.031	32.86	-.064	25.15
1.0	.017	1.70	1.5	966.	.000	-7.71	2500.	.046	40.80	.153	33.09
1.0	.017	1.70	1.5	966.	.000	-7.71	3000.	.062	48.54	.343	40.83
1.0	.017	1.70	1.5	2500.	.031	-4.78	2000.	.031	32.86	-4.588	28.08
1.0	.017	1.70	1.5	2500.	.031	-4.78	2500.	.046	40.80	-4.371	36.01
1.0	.017	1.70	1.5	2500.	.031	-4.78	3000.	.062	48.54	-4.181	43.76
1.0	.017	1.70	1.5	3000.	.043	-3.97	2000.	.031	32.86	-7.588	28.89
1.0	.017	1.70	1.5	3000.	.043	-3.97	2500.	.046	40.80	-7.371	36.83
1.0	.017	1.70	1.5	3000.	.043	-3.97	3000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	909.	.000	-3.97	2000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	909.	.000	-3.97	2500.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	909.	.000	-3.97	3000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	2500.	.032	-3.97	2000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	2500.	.032	-3.97	2500.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	2500.	.032	-3.97	3000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	3000.	.044	-3.97	2000.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	3000.	.044	-3.97	2500.	.062	48.54	-7.181	44.58
1.0	.017	1.70	2.0	3000.	.044	-3.97	3000.	.062	48.54	-7.181	44.58
2.0	.013	1.30	1.0	1179.	.000	1.74	2000.	.028	22.66	7.693	24.40
2.0	.013	1.30	1.0	1179.	.000	1.74	2500.	.042	31.34	7.794	33.08
2.0	.013	1.30	1.0	1179.	.000	1.74	3000.	.058	39.88	7.888	41.62
2.0	.013	1.30	1.0	2500.	.030	20.89	2000.	.028	22.66	2.964	43.55
2.0	.013	1.30	1.0	2500.	.030	20.89	2500.	.042	31.34	3.066	52.23
2.0	.013	1.30	1.0	2500.	.030	20.89	3000.	.058	39.88	3.159	60.77
2.0	.013	1.30	1.0	3000.	.044	27.78	2000.	.028	22.66	2.956	50.44
2.0	.013	1.30	1.0	3000.	.044	27.78	2500.	.042	31.34	3.057	59.12
2.0	.013	1.30	1.0	3000.	.044	27.78	3000.	.058	39.88	3.151	67.66
2.0	.013	1.30	1.5	1155.	.000	.66	2000.	.028	27.19	12.502	27.85
2.0	.013	1.30	1.5	1155.	.000	.66	2500.	.042	37.61	12.624	38.26
2.0	.013	1.30	1.5	1155.	.000	.66	3000.	.058	47.86	12.737	48.52
2.0	.013	1.30	1.5	2500.	.031	15.93	2000.	.028	27.19	2.906	43.12
2.0	.013	1.30	1.5	2500.	.031	15.93	2500.	.042	37.61	3.028	53.54
2.0	.013	1.30	1.5	2500.	.031	15.93	3000.	.058	47.86	3.140	63.79
2.0	.013	1.30	1.5	3000.	.045	21.31	2000.	.028	27.19	2.886	48.51
2.0	.013	1.30	1.5	3000.	.045	21.31	2500.	.042	37.61	3.007	58.92
2.0	.013	1.30	1.5	3000.	.045	21.31	3000.	.058	47.86	3.120	69.17
2.0	.013	1.30	2.0	1132.	.000	-.10	2000.	.028	30.21	-47.775	30.11
2.0	.013	1.30	2.0	1132.	.000	-.10	2500.	.042	41.78	-47.640	41.68
2.0	.013	1.30	2.0	1132.	.000	-.10	3000.	.058	53.18	-47.515	53.07
2.0	.013	1.30	2.0	2500.	.031	12.54	2000.	.028	30.21	2.884	42.76
2.0	.013	1.30	2.0	2500.	.031	12.54	2500.	.042	41.78	3.019	54.33
2.0	.013	1.30	2.0	2500.	.031	12.54	3000.	.058	53.18	3.144	65.72
2.0	.013	1.30	2.0	3000.	.045	16.91	2000.	.028	30.21	2.852	47.12
2.0	.013	1.30	2.0	3000.	.045	16.91	2500.	.042	41.78	2.987	58.69
2.0	.013	1.30	2.0	3000.	.045	16.91	3000.	.058	53.18	3.112	70.09

FMN	FAMB	FPRSL	BPR	T6	FAAB	TST	TTO	FMFAB	TS2	SFC	TST
2.0	.013	1.50	1.0	1152.	.000	.67	2000.	.027	23.27	18.098	23.94
2.0	.013	1.50	1.0	1152.	.000	.67	2500.	.042	32.07	18.206	32.74
2.0	.013	1.50	1.0	1152.	.000	.67	3000.	.057	40.74	18.303	41.41
2.0	.013	1.50	1.0	2500.	.031	19.75	2000.	.027	23.27	3.047	43.02
2.0	.013	1.50	1.0	2500.	.031	19.75	2500.	.042	32.07	3.155	51.82
2.0	.013	1.50	1.0	2500.	.031	19.75	3000.	.057	40.74	3.252	60.49
2.0	.013	1.50	1.0	3000.	.045	26.45	2000.	.027	23.27	3.019	49.73
2.0	.013	1.50	1.0	3000.	.045	26.45	2500.	.042	32.07	3.127	58.52
2.0	.013	1.50	1.0	3000.	.045	26.45	3000.	.057	40.74	3.223	67.19
2.0	.013	1.50	1.5	1115.	.000	-.73	2000.	.027	27.93	-8.798	27.20
2.0	.013	1.50	1.5	1115.	.000	-.73	2500.	.042	38.48	-8.669	37.76
2.0	.013	1.50	1.5	1115.	.000	-.73	3000.	.057	48.88	-8.553	48.16
2.0	.013	1.50	1.5	2500.	.032	14.34	2000.	.027	27.93	3.055	42.27
2.0	.013	1.50	1.5	2500.	.032	14.34	2500.	.042	38.48	3.185	52.82
2.0	.013	1.50	1.5	2500.	.032	14.34	3000.	.057	48.88	3.301	63.22
2.0	.013	1.50	1.5	3000.	.046	19.46	2000.	.027	27.93	3.000	47.39
2.0	.013	1.50	1.5	3000.	.046	19.46	2500.	.042	38.48	3.130	57.94
2.0	.013	1.50	1.5	3000.	.046	19.46	3000.	.057	48.88	3.246	68.34
2.0	.013	1.50	2.0	1077.	.000	-1.78	2000.	.027	31.03	-1.454	29.25
2.0	.013	1.50	2.0	1077.	.000	-1.78	2500.	.042	42.76	-1.310	40.99
2.0	.013	1.50	2.0	1077.	.000	-1.78	3000.	.057	54.32	-1.181	52.54
2.0	.013	1.50	2.0	2500.	.032	10.47	2000.	.027	31.03	3.139	41.50
2.0	.013	1.50	2.0	2500.	.032	10.47	2500.	.042	42.76	3.283	53.23
2.0	.013	1.50	2.0	2500.	.032	10.47	3000.	.057	54.32	3.411	64.79
2.0	.013	1.50	2.0	3000.	.046	14.50	2000.	.027	31.03	3.047	45.53
2.0	.013	1.50	2.0	3000.	.046	14.50	2500.	.042	42.76	3.191	57.26
2.0	.013	1.50	2.0	3000.	.046	14.50	3000.	.057	54.32	3.320	68.81
2.0	.013	1.70	1.0	1127.	.000	-.36	2000.	.027	23.75	-30.488	23.39
2.0	.013	1.70	1.0	1127.	.000	-.36	2500.	.041	32.65	-30.375	32.28
2.0	.013	1.70	1.0	1127.	.000	-.36	3000.	.057	41.41	-30.276	41.05
2.0	.013	1.70	1.0	2500.	.031	18.57	2000.	.027	23.75	3.159	42.33
2.0	.013	1.70	1.0	2500.	.031	18.57	2500.	.041	32.65	3.272	51.22
2.0	.013	1.70	1.0	2500.	.031	18.57	3000.	.057	41.41	3.371	59.98
2.0	.013	1.70	1.0	3000.	.045	25.08	2000.	.027	23.75	3.106	48.83
2.0	.013	1.70	1.0	3000.	.045	25.08	2500.	.041	32.65	3.219	57.73
2.0	.013	1.70	1.0	3000.	.045	25.08	3000.	.057	41.41	3.318	66.49
2.0	.013	1.70	1.5	1078.	.000	-2.13	2000.	.027	28.50	-2.220	26.38
2.0	.013	1.70	1.5	1078.	.000	-2.13	2500.	.041	39.17	-2.084	37.05
2.0	.013	1.70	1.5	1078.	.000	-2.13	3000.	.057	49.69	-1.965	47.56
2.0	.013	1.70	1.5	2500.	.032	12.57	2000.	.027	28.50	3.294	41.08
2.0	.013	1.70	1.5	2500.	.032	12.57	2500.	.041	39.17	3.430	51.75
2.0	.013	1.70	1.5	2500.	.032	12.57	3000.	.057	49.69	3.549	62.26
2.0	.013	1.70	1.5	3000.	.046	17.40	2000.	.027	28.50	3.184	45.90
2.0	.013	1.70	1.5	3000.	.046	17.40	2500.	.041	39.17	3.320	56.57
2.0	.013	1.70	1.5	3000.	.046	17.40	3000.	.057	49.69	3.439	67.09
2.0	.013	1.70	2.0	1028.	.000	-3.55	2000.	.027	31.67	-.072	28.12
2.0	.013	1.70	2.0	1028.	.000	-3.55	2500.	.041	43.53	.078	39.98
2.0	.013	1.70	2.0	1028.	.000	-3.55	3000.	.057	55.21	.211	51.66
2.0	.013	1.70	2.0	2500.	.033	7.99	2000.	.027	31.67	3.673	39.65
2.0	.013	1.70	2.0	2500.	.033	7.99	2500.	.041	43.53	3.823	51.52
2.0	.013	1.70	2.0	2500.	.033	7.99	3000.	.057	55.21	3.955	63.20
2.0	.013	1.70	2.0	3000.	.048	11.61	2000.	.027	31.67	3.438	43.28
2.0	.013	1.70	2.0	3000.	.048	11.61	2500.	.041	43.53	3.589	55.13
2.0	.013	1.70	2.0	3000.	.048	11.61	3000.	.057	55.21	3.721	66.82

3.0	.005	1.30	1.0	1192.	.000	-8.69	2000.	.020	11.42	1.102	2.73
3.0	.005	1.30	1.0	1192.	.000	-8.69	2500.	.034	20.82	.977	12.13
3.0	.005	1.30	1.0	1192.	.000	-8.69	3000.	.049	30.11	.978	21.42
3.0	.005	1.30	1.0	2500.	.030	13.26	2000.	.020	11.42	3.990	24.67
3.0	.005	1.30	1.0	2500.	.030	13.26	2500.	.034	20.82	3.865	34.07
3.0	.005	1.30	1.0	2500.	.030	13.26	3000.	.049	30.11	3.865	43.37
3.0	.005	1.30	1.0	3000.	.044	21.33	2000.	.020	11.42	3.682	32.75
3.0	.005	1.30	1.0	3000.	.044	21.33	2500.	.034	20.82	3.557	42.15
3.0	.005	1.30	1.0	3000.	.044	21.33	3000.	.049	30.11	3.557	51.44
3.0	.005	1.30	1.5	1170.	.000	-7.47	2000.	.020	13.70	1.550	6.24
3.0	.005	1.30	1.5	1170.	.000	-7.47	2500.	.034	24.98	1.400	17.51
3.0	.005	1.30	1.5	1170.	.000	-7.47	3000.	.049	36.13	1.400	28.67
3.0	.005	1.30	1.5	2500.	.031	10.28	2000.	.020	13.70	3.919	23.99
3.0	.005	1.30	1.5	2500.	.031	10.28	2500.	.034	24.98	3.770	35.26
3.0	.005	1.30	1.5	2500.	.031	10.28	3000.	.049	36.13	3.770	46.42
3.0	.005	1.30	1.5	3000.	.045	16.70	2000.	.020	13.70	3.641	30.40
3.0	.005	1.30	1.5	3000.	.045	16.70	2500.	.034	24.98	3.491	41.68
3.0	.005	1.30	1.5	3000.	.045	16.70	3000.	.049	36.13	3.491	52.83
3.0	.005	1.30	2.0	1147.	.000	-6.67	2000.	.020	15.22	1.846	8.56
3.0	.005	1.30	2.0	1147.	.000	-6.67	2500.	.034	27.76	1.680	21.09
3.0	.005	1.30	2.0	1147.	.000	-6.67	3000.	.049	40.15	1.680	33.48
3.0	.005	1.30	2.0	2500.	.031	8.27	2000.	.020	15.22	3.884	23.49
3.0	.005	1.30	2.0	2500.	.031	8.27	2500.	.034	27.76	3.718	36.02
3.0	.005	1.30	2.0	2500.	.031	8.27	3000.	.049	40.15	3.718	48.42
3.0	.005	1.30	2.0	3000.	.046	13.56	2000.	.020	15.22	3.620	28.79
3.0	.005	1.30	2.0	3000.	.046	13.56	2500.	.034	27.76	3.454	41.32
3.0	.005	1.30	2.0	3000.	.046	13.56	3000.	.049	40.15	3.454	53.71
3.0	.005	1.50	1.0	1166.	.000	-9.43	2000.	.020	11.49	1.089	2.06
3.0	.005	1.50	1.0	1166.	.000	-9.43	2500.	.034	20.90	.986	11.47
3.0	.005	1.50	1.0	1166.	.000	-9.43	3000.	.049	30.21	.995	20.77
3.0	.005	1.50	1.0	2500.	.031	12.79	2000.	.020	11.49	4.064	24.28
3.0	.005	1.50	1.0	2500.	.031	12.79	2500.	.034	20.90	3.962	33.69
3.0	.005	1.50	1.0	2500.	.031	12.79	3000.	.049	30.21	3.970	42.99
3.0	.005	1.50	1.0	3000.	.045	20.79	2000.	.020	11.49	3.709	32.28
3.0	.005	1.50	1.0	3000.	.045	20.79	2500.	.034	20.90	3.607	41.69
3.0	.005	1.50	1.0	3000.	.045	20.79	3000.	.049	30.21	3.615	51.00
3.0	.005	1.50	1.5	1130.	.000	-8.41	2000.	.020	13.79	1.528	5.38
3.0	.005	1.50	1.5	1130.	.000	-8.41	2500.	.034	25.08	1.405	16.67
3.0	.005	1.50	1.5	1130.	.000	-8.41	3000.	.049	36.25	1.415	27.84
3.0	.005	1.50	1.5	2500.	.032	9.63	2000.	.020	13.79	4.043	23.42
3.0	.005	1.50	1.5	2500.	.032	9.63	2500.	.034	25.08	3.920	34.71
3.0	.005	1.50	1.5	2500.	.032	9.63	3000.	.049	36.25	3.930	45.88
3.0	.005	1.50	1.5	3000.	.046	15.93	2000.	.020	13.79	3.692	29.72
3.0	.005	1.50	1.5	3000.	.046	15.93	2500.	.034	25.08	3.569	41.01
3.0	.005	1.50	1.5	3000.	.046	15.93	3000.	.049	36.25	3.579	52.18
3.0	.005	1.50	2.0	1093.	.000	-7.78	2000.	.020	15.32	1.817	7.54
3.0	.005	1.50	2.0	1093.	.000	-7.78	2500.	.034	27.87	1.680	20.09
3.0	.005	1.50	2.0	1093.	.000	-7.78	3000.	.049	40.27	1.691	32.50
3.0	.005	1.50	2.0	2500.	.032	7.41	2000.	.020	15.32	4.077	22.73
3.0	.005	1.50	2.0	2500.	.032	7.41	2500.	.034	27.87	3.941	35.28
3.0	.005	1.50	2.0	2500.	.032	7.41	3000.	.049	40.27	3.952	47.69
3.0	.005	1.50	2.0	3000.	.047	12.57	2000.	.020	15.32	3.705	27.89
3.0	.005	1.50	2.0	3000.	.047	12.57	2500.	.034	27.87	3.569	40.43
3.0	.005	1.50	2.0	3000.	.047	12.57	3000.	.049	40.27	3.580	52.84

ALTITUDE 70000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.005	1.70	1.0	1142.	.000	-10.14	2000.	.019	11.55	1.075	1.40
3.0	.005	1.70	1.0	1142.	.000	-10.14	2500.	.033	20.96	.992	10.82
3.0	.005	1.70	1.0	1142.	.000	-10.14	3000.	.048	30.28	1.007	20.13
3.0	.005	1.70	1.0	2500.	.031	12.30	2000.	.019	11.55	4.155	23.85
3.0	.005	1.70	1.0	2500.	.031	12.30	2500.	.033	20.96	4.072	33.27
3.0	.005	1.70	1.0	2500.	.031	12.30	3000.	.048	30.28	4.087	42.58
3.0	.005	1.70	1.0	3000.	.046	20.23	2000.	.019	11.55	3.748	31.77
3.0	.005	1.70	1.0	3000.	.046	20.23	2500.	.033	20.96	3.664	41.19
3.0	.005	1.70	1.0	3000.	.046	20.23	3000.	.048	30.28	3.680	50.51
3.0	.005	1.70	1.5	1093.	.000	-9.33	2000.	.019	13.86	1.506	4.52
3.0	.005	1.70	1.5	1093.	.000	-9.33	2500.	.033	25.16	1.406	15.82
3.0	.005	1.70	1.5	1093.	.000	-9.33	3000.	.048	36.33	1.424	27.00
3.0	.005	1.70	1.5	2500.	.032	8.90	2000.	.019	13.86	4.218	22.75
3.0	.005	1.70	1.5	2500.	.032	8.90	2500.	.033	25.16	4.118	34.05
3.0	.005	1.70	1.5	2500.	.032	8.90	3000.	.048	36.33	4.136	45.23
3.0	.005	1.70	1.5	3000.	.047	15.08	2000.	.019	13.86	3.772	28.93
3.0	.005	1.70	1.5	3000.	.047	15.08	2500.	.033	25.16	3.672	40.23
3.0	.005	1.70	1.5	3000.	.047	15.08	3000.	.048	36.33	3.690	51.41
3.0	.005	1.70	2.0	1045.	.000	-8.91	2000.	.019	15.39	1.787	6.49
3.0	.005	1.70	2.0	1045.	.000	-8.91	2500.	.033	27.95	1.676	19.04
3.0	.005	1.70	2.0	1045.	.000	-8.91	3000.	.048	40.37	1.697	31.47
3.0	.005	1.70	2.0	2500.	.033	6.38	2000.	.019	15.39	4.405	21.78
3.0	.005	1.70	2.0	2500.	.033	6.38	2500.	.033	27.95	4.294	34.33
3.0	.005	1.70	2.0	2500.	.033	6.38	3000.	.048	40.37	4.314	46.76
3.0	.005	1.70	2.0	3000.	.048	11.37	2000.	.019	15.39	3.855	26.76
3.0	.005	1.70	2.0	3000.	.048	11.37	2500.	.033	27.95	3.744	39.32
3.0	.005	1.70	2.0	3000.	.048	11.37	3000.	.048	40.37	3.764	51.74

PHN	PAMB	PPRSE	BPR	TO	PAMB	POV	PVO				
1.0	.017	1.30	1.0	897.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	897.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	897.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	2500.	.027	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	2500.	.027	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	2500.	.027	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	3000.	.037	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	3000.	.037	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.0	3000.	.037	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	865.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	865.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	865.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	2500.	.027	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	2500.	.027	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	2500.	.027	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	3000.	.037	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	3000.	.037	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	1.5	3000.	.037	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	833.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	833.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	833.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	2500.	.028	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	2500.	.028	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	2500.	.028	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	3000.	.038	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	3000.	.038	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.30	2.0	3000.	.038	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	860.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	860.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	860.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	2500.	.027	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	2500.	.027	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	2500.	.027	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	3000.	.037	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	3000.	.037	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.0	3000.	.037	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	809.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	809.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	809.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	2500.	.028	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	2500.	.028	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	2500.	.028	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	3000.	.038	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	3000.	.038	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	1.5	3000.	.038	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	758.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	758.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	758.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	2500.	.029	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	2500.	.029	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	2500.	.029	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	3000.	.039	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	3000.	.039	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.50	2.0	3000.	.039	11.37	3000.	.048	40.37	3.764	51.74

PRN	PAMB	PPRSE	BPR	T0	PAMB	T3T	PT0	PAMB	T3E	S/C	T3T
1.0	.017	1.70	1.0	826.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	826.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	826.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	2500.	.028	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	2500.	.028	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	2500.	.028	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	3000.	.038	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	3000.	.038	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.0	3000.	.038	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	758.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	758.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	758.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	2500.	.029	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	2500.	.029	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	2500.	.029	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	3000.	.039	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	3000.	.039	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	1.5	3000.	.039	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	690.	.000	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	690.	.000	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	690.	.000	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	2500.	.030	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	2500.	.030	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	2500.	.030	11.37	3000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	3000.	.040	11.37	2000.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	3000.	.040	11.37	2500.	.048	40.37	3.764	51.74
1.0	.017	1.70	2.0	3000.	.040	11.37	3000.	.048	40.37	3.764	51.74
2.0	.013	1.30	1.0	1114.	.000	-3.25	2000.	.028	22.66	-2.418	19.41
2.0	.013	1.30	1.0	1114.	.000	-3.25	2500.	.042	31.34	-2.316	28.09
2.0	.013	1.30	1.0	1114.	.000	-3.25	3000.	.058	39.88	-2.223	36.64
2.0	.013	1.30	1.0	2500.	.029	13.98	2000.	.028	22.66	3.810	36.44
2.0	.013	1.30	1.0	2500.	.029	13.98	2500.	.042	31.34	3.911	45.32
2.0	.013	1.30	1.0	2500.	.029	13.98	3000.	.058	39.88	4.005	53.87
2.0	.013	1.30	1.0	3000.	.042	19.80	2000.	.028	22.66	3.599	42.46
2.0	.013	1.30	1.0	3000.	.042	19.80	2500.	.042	31.34	3.701	51.14
2.0	.013	1.30	1.0	3000.	.042	19.80	3000.	.058	39.88	3.795	59.68
2.0	.013	1.30	1.5	1088.	.000	-3.49	2000.	.028	27.19	-.771	23.71
2.0	.013	1.30	1.5	1088.	.000	-3.49	2500.	.042	37.61	-.649	34.12
2.0	.013	1.30	1.5	1088.	.000	-3.49	3000.	.058	47.86	-.537	44.37
2.0	.013	1.30	1.5	2500.	.030	10.07	2000.	.028	27.19	3.759	37.26
2.0	.013	1.30	1.5	2500.	.030	10.07	2500.	.042	37.61	3.881	47.68
2.0	.013	1.30	1.5	2500.	.030	10.07	3000.	.058	47.86	3.993	57.93
2.0	.013	1.30	1.5	3000.	.043	14.54	2000.	.028	27.19	3.522	41.73
2.0	.013	1.30	1.5	3000.	.043	14.54	2500.	.042	37.61	3.643	52.15
2.0	.013	1.30	1.5	3000.	.043	14.54	3000.	.058	47.86	3.754	62.40
2.0	.013	1.30	2.0	1063.	.000	-3.70	2000.	.028	30.21	.105	26.51
2.0	.013	1.30	2.0	1063.	.000	-3.70	2500.	.042	41.78	.240	38.08
2.0	.013	1.30	2.0	1063.	.000	-3.70	3000.	.058	53.18	.365	49.48
2.0	.013	1.30	2.0	2500.	.030	7.33	2000.	.028	30.21	3.822	37.54
2.0	.013	1.30	2.0	2500.	.030	7.33	2500.	.042	41.78	3.958	49.11
2.0	.013	1.30	2.0	2500.	.030	7.33	3000.	.058	53.18	4.083	60.51
2.0	.013	1.30	2.0	3000.	.043	10.88	2000.	.028	30.21	3.530	41.09
2.0	.013	1.30	2.0	3000.	.043	10.88	2500.	.042	41.78	3.666	52.67
2.0	.013	1.30	2.0	3000.	.043	10.88	3000.	.058	53.18	3.791	64.06

2.0	.013	1.50	1.0	1084.	.000	-4.54	2000.	.027	23.27	-1.464	18.74
2.0	.013	1.50	1.0	1084.	.000	-4.54	2500.	.042	32.07	-1.356	27.53
2.0	.013	1.50	1.0	1084.	.000	-4.54	3000.	.057	40.74	-1.260	36.20
2.0	.013	1.50	1.0	2500.	.030	12.35	2000.	.027	23.27	4.157	35.63
2.0	.013	1.50	1.0	2500.	.030	12.35	2500.	.042	32.07	4.265	44.42
2.0	.013	1.50	1.0	2500.	.030	12.35	3000.	.057	40.74	4.362	53.09
2.0	.013	1.50	1.0	3000.	.043	17.90	2000.	.027	23.27	3.843	41.17
2.0	.013	1.50	1.0	3000.	.043	17.90	2500.	.042	32.07	3.951	49.97
2.0	.013	1.50	1.0	3000.	.043	17.90	3000.	.057	40.74	4.047	58.64
2.0	.013	1.50	1.5	1044.	.000	-5.19	2000.	.027	27.93	-.139	22.73
2.0	.013	1.50	1.5	1044.	.000	-5.19	2500.	.042	38.48	-.010	33.29
2.0	.013	1.50	1.5	1044.	.000	-5.19	3000.	.057	48.88	.106	43.69
2.0	.013	1.50	1.5	2500.	.031	7.74	2000.	.027	27.93	4.491	35.67
2.0	.013	1.50	1.5	2500.	.031	7.74	2500.	.042	38.48	4.620	46.23
2.0	.013	1.50	1.5	2500.	.031	7.74	3000.	.057	48.88	4.736	56.63
2.0	.013	1.50	1.5	3000.	.043	11.83	2000.	.027	27.93	4.005	39.76
2.0	.013	1.50	1.5	3000.	.043	11.83	2500.	.042	38.48	4.135	50.32
2.0	.013	1.50	1.5	3000.	.043	11.83	3000.	.057	48.88	4.251	60.72
2.0	.013	1.50	2.0	1004.	.000	-5.81	2000.	.027	31.03	.538	25.22
2.0	.013	1.50	2.0	1004.	.000	-5.81	2500.	.042	42.76	.682	36.95
2.0	.013	1.50	2.0	1004.	.000	-5.81	3000.	.057	54.32	.811	48.51
2.0	.013	1.50	2.0	2500.	.031	4.24	2000.	.027	31.03	5.569	35.27
2.0	.013	1.50	2.0	2500.	.031	4.24	2500.	.042	42.76	5.713	47.00
2.0	.013	1.50	2.0	2500.	.031	4.24	3000.	.057	54.32	5.841	58.56
2.0	.013	1.50	2.0	3000.	.044	7.29	2000.	.027	31.03	4.540	38.32
2.0	.013	1.50	2.0	3000.	.044	7.29	2500.	.042	42.76	4.683	50.05
2.0	.013	1.50	2.0	3000.	.044	7.29	3000.	.057	54.32	4.812	61.60
2.0	.013	1.70	1.0	1058.	.000	-5.81	2000.	.027	23.75	-.951	17.94
2.0	.013	1.70	1.0	1058.	.000	-5.81	2500.	.041	32.65	-.838	26.84
2.0	.013	1.70	1.0	1058.	.000	-5.81	3000.	.057	41.41	-.738	35.60
2.0	.013	1.70	1.0	2500.	.030	10.64	2000.	.027	23.75	4.660	34.39
2.0	.013	1.70	1.0	2500.	.030	10.64	2500.	.041	32.65	4.773	43.28
2.0	.013	1.70	1.0	2500.	.030	10.64	3000.	.057	41.41	4.872	52.05
2.0	.013	1.70	1.0	3000.	.043	15.91	2000.	.027	23.75	4.182	39.66
2.0	.013	1.70	1.0	3000.	.043	15.91	2500.	.041	32.65	4.295	48.55
2.0	.013	1.70	1.0	3000.	.043	15.91	3000.	.057	41.41	4.394	57.32
2.0	.013	1.70	1.5	1004.	.000	-6.97	2000.	.027	28.50	.173	21.53
2.0	.013	1.70	1.5	1004.	.000	-6.97	2500.	.041	39.17	.309	32.21
2.0	.013	1.70	1.5	1004.	.000	-6.97	3000.	.057	49.69	.428	42.72
2.0	.013	1.70	1.5	2500.	.031	5.09	2000.	.027	28.50	6.206	33.66
2.0	.013	1.70	1.5	2500.	.031	5.09	2500.	.041	39.17	6.342	44.27
2.0	.013	1.70	1.5	2500.	.031	5.09	3000.	.057	49.69	6.461	54.78
2.0	.013	1.70	1.5	3000.	.044	8.75	2000.	.027	28.50	4.973	37.25
2.0	.013	1.70	1.5	3000.	.044	8.75	2500.	.041	39.17	5.109	47.92
2.0	.013	1.70	1.5	3000.	.044	8.75	3000.	.057	49.69	5.228	58.44
2.0	.013	1.70	2.0	950.	.000	-8.15	2000.	.027	31.67	.737	23.52
2.0	.013	1.70	2.0	950.	.000	-8.15	2500.	.041	43.53	.887	35.38
2.0	.013	1.70	2.0	950.	.000	-8.15	3000.	.057	55.21	1.020	47.06
2.0	.013	1.70	2.0	2500.	.032	.39	2000.	.027	31.67	47.576	32.06
2.0	.013	1.70	2.0	2500.	.032	.39	2500.	.041	43.53	47.726	43.92
2.0	.013	1.70	2.0	2500.	.032	.39	3000.	.057	55.21	47.859	55.60
2.0	.013	1.70	2.0	3000.	.045	2.81	2000.	.027	31.67	9.621	34.48
2.0	.013	1.70	2.0	3000.	.045	2.81	2500.	.041	43.53	9.772	46.34
2.0	.013	1.70	2.0	3000.	.045	2.81	3000.	.057	55.21	9.904	58.02

FAN	FANB	FPRSL	BPR								
3.0	.005	1.30	1.0	1152.	.000	-11.51	2000.	.020	11.42	1.224	-.09
3.0	.005	1.30	1.0	1152.	.000	-11.51	2500.	.034	20.82	1.100	9.31
3.0	.005	1.30	1.0	1152.	.000	-11.51	3000.	.049	30.11	1.100	18.60
3.0	.005	1.30	1.0	2500.	.030	9.71	2000.	.020	11.42	4.796	21.12
3.0	.005	1.30	1.0	2500.	.030	9.71	2500.	.034	20.82	4.672	30.52
3.0	.005	1.30	1.0	2500.	.030	9.71	3000.	.049	30.11	4.672	39.82
3.0	.005	1.30	1.0	3000.	.043	17.23	2000.	.020	11.42	4.101	28.65
3.0	.005	1.30	1.0	3000.	.043	17.23	2500.	.034	20.82	3.977	38.05
3.0	.005	1.30	1.0	3000.	.043	17.23	3000.	.049	30.11	3.977	47.34
3.0	.005	1.30	1.5	1128.	.000	-9.76	2000.	.020	13.70	1.637	3.94
3.0	.005	1.30	1.5	1128.	.000	-9.76	2500.	.034	24.98	1.488	15.22
3.0	.005	1.30	1.5	1128.	.000	-9.76	3000.	.049	36.13	1.488	26.37
3.0	.005	1.30	1.5	2500.	.030	7.36	2000.	.020	13.70	4.656	21.06
3.0	.005	1.30	1.5	2500.	.030	7.36	2500.	.034	24.98	4.506	32.34
3.0	.005	1.30	1.5	2500.	.030	7.36	3000.	.049	36.13	4.507	43.49
3.0	.005	1.30	1.5	3000.	.044	13.31	2000.	.020	13.70	4.014	27.02
3.0	.005	1.30	1.5	3000.	.044	13.31	2500.	.034	24.98	3.864	38.29
3.0	.005	1.30	1.5	3000.	.044	13.31	3000.	.049	36.13	3.865	49.45
3.0	.005	1.30	2.0	1104.	.000	-8.62	2000.	.020	15.22	1.911	6.60
3.0	.005	1.30	2.0	1104.	.000	-8.62	2500.	.034	27.76	1.745	19.13
3.0	.005	1.30	2.0	1104.	.000	-8.62	3000.	.049	40.15	1.746	31.53
3.0	.005	1.30	2.0	2500.	.031	5.75	2000.	.020	15.22	4.599	20.98
3.0	.005	1.30	2.0	2500.	.031	5.75	2500.	.034	27.76	4.433	33.51
3.0	.005	1.30	2.0	2500.	.031	5.75	3000.	.049	40.15	4.433	45.90
3.0	.005	1.30	2.0	3000.	.044	10.65	2000.	.020	15.22	3.971	25.87
3.0	.005	1.30	2.0	3000.	.044	10.65	2500.	.034	27.76	3.804	38.41
3.0	.005	1.30	2.0	3000.	.044	10.65	3000.	.049	40.15	3.805	50.80
3.0	.005	1.50	1.0	1124.	.000	-12.31	2000.	.020	11.49	1.197	-.82
3.0	.005	1.50	1.0	1124.	.000	-12.31	2500.	.034	20.90	1.094	8.58
3.0	.005	1.50	1.0	1124.	.000	-12.31	3000.	.049	30.21	1.102	17.89
3.0	.005	1.50	1.0	2500.	.030	9.12	2000.	.020	11.49	5.006	20.61
3.0	.005	1.50	1.0	2500.	.030	9.12	2500.	.034	20.90	4.903	30.02
3.0	.005	1.50	1.0	2500.	.030	9.12	3000.	.049	30.21	4.911	39.32
3.0	.005	1.50	1.0	3000.	.044	16.54	2000.	.020	11.49	4.184	28.04
3.0	.005	1.50	1.0	3000.	.044	16.54	2500.	.034	20.90	4.082	37.44
3.0	.005	1.50	1.0	3000.	.044	16.54	3000.	.049	30.21	4.090	46.75
3.0	.005	1.50	1.5	1086.	.000	-10.79	2000.	.020	13.79	1.601	3.00
3.0	.005	1.50	1.5	1086.	.000	-10.79	2500.	.034	25.08	1.478	14.29
3.0	.005	1.50	1.5	1086.	.000	-10.79	3000.	.049	36.25	1.488	25.45
3.0	.005	1.50	1.5	2500.	.031	6.53	2000.	.020	13.79	5.017	20.31
3.0	.005	1.50	1.5	2500.	.031	6.53	2500.	.034	25.08	4.894	31.61
3.0	.005	1.50	1.5	2500.	.031	6.53	3000.	.049	36.25	4.904	42.77
3.0	.005	1.50	1.5	3000.	.044	12.34	2000.	.020	13.79	4.157	26.13
3.0	.005	1.50	1.5	3000.	.044	12.34	2500.	.034	25.08	4.034	37.42
3.0	.005	1.50	1.5	3000.	.044	12.34	3000.	.049	36.25	4.044	48.59
3.0	.005	1.50	2.0	1048.	.000	-9.85	2000.	.020	15.32	1.869	5.47
3.0	.005	1.50	2.0	1048.	.000	-9.85	2500.	.034	27.87	1.733	18.02
3.0	.005	1.50	2.0	1048.	.000	-9.85	3000.	.049	40.27	1.744	30.43
3.0	.005	1.50	2.0	2500.	.032	4.65	2000.	.020	15.32	5.210	19.97
3.0	.005	1.50	2.0	2500.	.032	4.65	2500.	.034	27.87	5.073	32.52
3.0	.005	1.50	2.0	2500.	.032	4.65	3000.	.049	40.27	5.084	44.92
3.0	.005	1.50	2.0	3000.	.045	9.37	2000.	.020	15.32	4.202	24.69
3.0	.005	1.50	2.0	3000.	.045	9.37	2500.	.034	27.87	4.065	37.23
3.0	.005	1.50	2.0	3000.	.045	9.37	3000.	.049	40.27	4.076	49.64

ALTITUDE 80000.0 PRSL = 16.

FMN	FAMB	FPRSL	BPR	T6	FAAB	TS1	T10	FAFAB	TS2	SFC	TST
3.0	.005	1.70	1.0	1099.	.000	-13.09	2000.	.019	11.55	1.171	-1.54
3.0	.005	1.70	1.0	1099.	.000	-13.09	2500.	.033	20.96	1.088	7.88
3.0	.005	1.70	1.0	1099.	.000	-13.09	3000.	.048	30.28	1.103	17.19
3.0	.005	1.70	1.0	2500.	.031	8.50	2000.	.019	11.55	5.265	20.05
3.0	.005	1.70	1.0	2500.	.031	8.50	2500.	.033	20.96	5.182	29.46
3.0	.005	1.70	1.0	2500.	.031	8.50	3000.	.048	30.28	5.197	38.78
3.0	.005	1.70	1.0	3000.	.044	15.83	2000.	.019	11.55	4.288	27.37
3.0	.005	1.70	1.0	3000.	.044	15.83	2500.	.033	20.96	4.205	36.79
3.0	.005	1.70	1.0	3000.	.044	15.83	3000.	.048	30.28	4.220	46.11
3.0	.005	1.70	1.5	1048.	.000	-11.82	2000.	.019	13.86	1.569	2.04
3.0	.005	1.70	1.5	1048.	.000	-11.82	2500.	.033	25.16	1.469	13.34
3.0	.005	1.70	1.5	1048.	.000	-11.82	3000.	.048	36.33	1.487	24.52
3.0	.005	1.70	1.5	2500.	.032	5.58	2000.	.019	13.86	5.576	19.44
3.0	.005	1.70	1.5	2500.	.032	5.58	2500.	.033	25.16	5.476	30.74
3.0	.005	1.70	1.5	2500.	.032	5.58	3000.	.048	36.33	5.494	41.92
3.0	.005	1.70	1.5	3000.	.045	11.24	2000.	.019	13.86	4.368	25.10
3.0	.005	1.70	1.5	3000.	.045	11.24	2500.	.033	25.16	4.268	36.40
3.0	.005	1.70	1.5	3000.	.045	11.24	3000.	.048	36.33	4.286	47.58
3.0	.005	1.70	2.0	997.	.000	-11.12	2000.	.019	15.39	1.830	4.28
3.0	.005	1.70	2.0	997.	.000	-11.12	2500.	.033	27.95	1.719	16.83
3.0	.005	1.70	2.0	997.	.000	-11.12	3000.	.048	40.37	1.740	29.25
3.0	.005	1.70	2.0	2500.	.033	3.30	2000.	.019	15.39	6.559	18.69
3.0	.005	1.70	2.0	2500.	.033	3.30	2500.	.033	27.95	6.448	31.25
3.0	.005	1.70	2.0	2500.	.033	3.30	3000.	.048	40.37	6.469	43.67
3.0	.005	1.70	2.0	3000.	.046	7.80	2000.	.019	15.39	4.627	23.19
3.0	.005	1.70	2.0	3000.	.046	7.80	2500.	.033	27.95	4.515	35.75
3.0	.005	1.70	2.0	3000.	.046	7.80	3000.	.048	40.37	4.536	48.17

GROSS SPECIFIC THRUST
CONV AND CONV-DIV NOZZLE COMPARISON
SUPERCRITICAL PRESSURE RATIOS
GAMMA = 1.33 FRICTIONLESS FLOW

PRESS RATIO	.54	.52	.50	.48	.46	.44	.42
CONV NOZZLE	.719	.739	.759	.779	.799	.819	.839
C-D NOZZLE	.719	.739	.759	.779	.799	.820	.840
PERCENT DIFF	.000	.001	.007	.021	.049	.093	.158

PRESS RATIO	.40	.38	.36	.34	.32	.30	.28
CONV NOZZLE	.859	.879	.899	.919	.939	.959	.979
C-D NOZZLE	.861	.882	.904	.925	.948	.970	.994
PERCENT DIFF	.247	.362	.509	.691	.911	1.174	1.486

PRESS RATIO	.26	.24	.22	.20	.18	.16	.14
CONV NOZZLE	.999	1.019	1.039	1.059	1.079	1.099	1.119
C-D NOZZLE	1.018	1.043	1.069	1.096	1.124	1.154	1.187
PERCENT DIFF	1.852	2.279	2.775	3.349	4.015	4.787	5.687

PRESS RATIO	.12	.10	.08	.06	.04	.02	.00
CONV NOZZLE	1.139	1.159	1.179	1.199	1.219	1.239	1.259
C-D NOZZLE	1.221	1.260	1.303	1.354	1.416	1.505	1.910
PERCENT DIFF	6.744	8.000	9.521	11.421	13.930	17.676	34.070

CONV NOZZLE EFFICIENCY = 100.0
C-D NOZZLE EFFICIENCY = 100.0

GROSS SPECIFIC THRUST
CONV AND CONV-DIV NOZZLE COMPARISON
SUPERCRITICAL PRESSURE RATIOS
GAMMA = 1.33 FLOW WITH FRICTION

PRESS RATIO	.54	.52	.50	.48	.46	.44	.42
CONV NOZZLE	.681	.701	.721	.741	.761	.781	.801
C-D NOZZLE	.680	.697	.713	.728	.744	.760	.776
PERCENT DIFF	-.031	-.591	-1.141	-1.676	-2.193	-2.687	-3.156

PRESS RATIO	.40	.38	.36	.34	.32	.30	.28
CONV NOZZLE	.821	.841	.861	.881	.901	.921	.941
C-D NOZZLE	.792	.808	.825	.841	.858	.875	.893
PERCENT DIFF	-3.594	-3.999	-4.366	-4.691	-4.968	-5.191	-5.356

PRESS RATIO	.26	.24	.22	.20	.18	.16	.14
CONV NOZZLE	.961	.981	1.001	1.021	1.041	1.061	1.081
C-D NOZZLE	.911	.930	.949	.970	.991	1.014	1.039
PERCENT DIFF	-5.454	-5.476	-5.413	-5.252	-4.976	-4.565	-3.993

PRESS RATIO	.12	.10	.08	.06	.04	.02	.00
CONV NOZZLE	1.101	1.121	1.141	1.161	1.181	1.201	1.221
C-D NOZZLE	1.066	1.097	1.131	1.172	1.225	1.303	1.731
PERCENT DIFF	-3.222	-2.198	-.836	1.009	3.628	7.822	29.479

CONV NOZZLE EFFICIENCY = 95.0
C-D NOZZLE EFFICIENCY = 95.0 TO 85.0

GROSS SPECIFIC THRUST
CONV AND CONV-DIV NOZZLE COMPARISON
SUPERCRITICAL PRESSURE RATIOS
GAMMA = 1.33 FLOW WITH FRICTION

PRESS RATIO	.54	.52	.50	.48	.46	.44	.42
CONV NOZZLE	.681	.701	.721	.741	.761	.781	.801
C-D NOZZLE	.680	.698	.716	.733	.751	.768	.786
PERCENT DIFF	-.031	-.381	-.719	-1.039	-1.340	-1.616	-1.865

PRESS RATIO	.40	.38	.36	.34	.32	.30	.28
CONV NOZZLE	.821	.841	.861	.881	.901	.921	.941
C-D NOZZLE	.804	.822	.840	.859	.878	.898	.918
PERCENT DIFF	-2.083	-2.267	-2.413	-2.516	-2.572	-2.576	-2.523

PRESS RATIO	.26	.24	.22	.20	.18	.16	.14
CONV NOZZLE	.961	.981	1.001	1.021	1.041	1.061	1.081
C-D NOZZLE	.938	.959	.982	1.005	1.029	1.055	1.083
PERCENT DIFF	-2.406	-2.216	-1.946	-1.583	-1.114	-.520	.224

PRESS RATIO	.12	.10	.08	.06	.04	.02	.00
CONV NOZZLE	1.101	1.121	1.141	1.161	1.181	1.201	1.221
C-D NOZZLE	1.113	1.147	1.185	1.231	1.287	1.370	1.791
PERCENT DIFF	1.150	2.308	3.775	5.681	8.293	12.337	31.849

CONV NOZZLE EFFICIENCY = 95.0
C-D NOZZLE EFFICIENCY = 95.0 TO 90.0

GROSS SPECIFIC THRUST
CONV AND CONV-DIV NOZZLE COMPARISON
SUPERCRITICAL PRESSURE RATIOS
GAMMA = 1.33 FLOW WITH FRICTION

PRESS RATIO	.54	.52	.50	.48	.46	.44	.42
CONV NOZZLE	.681	.701	.721	.741	.761	.781	.801
C-D NOZZLE	.680	.699	.717	.735	.754	.772	.791
PERCENT DIFF	-.031	-.276	-.508	-.723	-.918	-1.088	-1.231

PRESS RATIO	.40	.38	.36	.34	.32	.30	.28
CONV NOZZLE	.821	.841	.861	.881	.901	.921	.941
C-D NOZZLE	.810	.829	.848	.868	.888	.909	.930
PERCENT DIFF	-1.343	-1.421	-1.462	-1.460	-1.413	-1.315	-1.160

PRESS RATIO	.26	.24	.22	.20	.18	.16	.14
CONV NOZZLE	.961	.981	1.001	1.021	1.041	1.061	1.081
C-D NOZZLE	.952	.974	.998	1.022	1.048	1.076	1.105
PERCENT DIFF	-.944	-.658	-.294	.159	.715	1.390	2.208

PRESS RATIO	.12	.10	.08	.06	.04	.02	.00
CONV NOZZLE	1.101	1.121	1.141	1.161	1.181	1.201	1.221
C-D NOZZLE	1.137	1.172	1.212	1.260	1.318	1.403	1.821
PERCENT DIFF	3.201	4.416	5.924	7.853	10.454	14.423	32.966

CONV NOZZLE EFFICIENCY = 95.0
C-D NOZZLE EFFICIENCY = 95.0 TO 92.5