

AD-762 543

COLLAPSE ANALYSIS FOR SHELLS OF GENERAL SHAPE:
VOLUME II

USER'S MANUAL FOR THE STAGS-A COMPUTER CODE

LOCKHEED MISSILES AND SPACE COMPANY, INC.

PREPARED FOR
AIR FORCE FLIGHT DYNAMICS LABORATORY

MARCH 1973

Distributed By:

NTIS

National Technical Information Service
U. S. DEPARTMENT OF COMMERCE

AFFDL TR-71-8

COLLAPSE ANALYSIS FOR SHELLS OF GENERAL SHAPE

VOLUME II
USER'S MANUAL
FOR THE STAGS-A
COMPUTER CODE

B. O. ALMROTH
F. A. BROGAN
E. MELLER
F. ZELE
H. T. PETERSEN

LOCKHEED PALO ALTO RESEARCH LABORATORY
PALO ALTO, CALIFORNIA


TECHNICAL REPORT AFFDL TR-71-8

MARCH 1973

Reproduced by
**NATIONAL TECHNICAL
INFORMATION SERVICE**
U S Department of Commerce
Springfield VA 22151

Approved for public release; distribution unlimited.

AIR FORCE FLIGHT DYNAMICS LABORATORY
AIR FORCE SYSTEMS COMMAND
WRIGHT-PATTERSON AIR FORCE BASE, OHIO

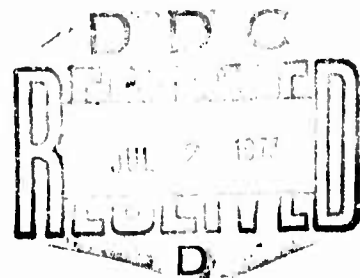

AD 762543

ACCESSION for	
NTIS	White Section ☒
DDC	Butt Section ☐
UNANNOUNCED	☐
JUSTIFICATION	
BY	
DISTRIBUTION AVAILABILITY CODES	
A	

NOTICE

When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Copies of this report should not be returned unless return is required by security considerations, contractual obligations, or notice on a specific document.

Unclassified

Security Classification

DOCUMENT CONTROL DATA - R & D

(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)

1. ORIGINATING ACTIVITY (Corporate author) Lockheed Palo Alto Research Laboratory 3251 Hanover Street Palo Alto, California 94304		2a. REPORT SECURITY CLASSIFICATION Unclassified	
		2b. GROUP N/A	
3. REPORT TITLE Collapse Analysis for Shells of General Shape: Volume II - User's Manual for the STAGS-A Computer Code			
4. DESCRIPTIVE NOTES (Type of report and inclusive dates) Final Report April 1969 - October 1972			
5. AUTHOR(S) (First name, middle initial, last name) Almroth, B. O. Meller, E. Petersen, H. T. Brogan, F. A. Zele, F.			
6. REPORT DATE March 1973		7a. TOTAL NO. OF PAGES 206 208	7b. NO. OF REFS 15
8a. CONTRACT OR GRANT NO. F33615-69-C-1523		8b. ORIGINATOR'S REPORT NUMBER(S) AFFDL-TR-71-8, Volume II	
b. PROJECT NO. 1467			
c.		9b. OTHER REPORT NO(S) (Any other numbers that may be assigned this report) N/A	
d.			
10. DISTRIBUTION STATEMENT Approved for public release; distribution unlimited			
11. SUPPLEMENTARY NOTES None		12. SPONSORING MILITARY ACTIVITY Air Force Flight Dynamics Laboratory Air Force Systems Command Wright-Patterson Air Force Base, Ohio 45433	
13. ABSTRACT This user's manual presents STAGS, a comprehensive computer code. STAGS is intended for the static analysis of arbitrary shells including the effects of nonlinearities caused by material behavior and finite deformations. Collapse loads based on nonlinear analysis can be computed as well as buckling loads based on classical bifurcation buckling theory with linear prestress. Arbitrary thermal and mechanical loadings can be specified. The manual provides instructions for use of the code and presents sample problems and solutions. The program is under development and the version presented here is expected to be updated in 1973.			

DD FORM 1473
1 NOV 65

Unclassified

Security Classification

1a

Unclassified

Security Classification

14 KEY WORDS	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT
Nonlinear Structural Analysis Finite Difference Methods Computer Code for Shell Analysis Plasticity Collapse of Shells Bifurcation Buckling of Shells Energy Methods Thermal Stresses						

Unclassified

Security Classification

COLLAPSE ANALYSIS FOR SHELLS OF GENERAL SHAPE

VOLUME II

USER'S MANUAL FOR THE STAGS-A COMPUTER CODE

*B. O. ALMROTH
F. A. BROGAN
E. MELLER
F. ZELE
H. T. PETERSEN*

Approved for public release; distribution unlimited.

FOREWORD

This user's manual includes new features of the STAGS Computer Code developed by the Lockheed Palo Alto Research Laboratory, Palo Alto, California under sponsorship of the Lockheed Independent Research Program, NASA-Langley Research Center (NASA/LRC) (Contract No. NAS1-10843) and the Air Force Flight Dynamics Laboratory (AFFDL) Contract No. F33615-69-C-1523). The AFFDL Contract was administered under the Structures Division, with Mr. T. N. Bernstein (AFFDL/FBR) as Project Engineer.

This report was completed in October 1972 and covers work performed between April 1969 and October 1972. The supervision of this project was provided by Mr. B. O. Almroth of the Structural Mechanics Laboratory, LMSC.

This technical report has been reviewed and is approved.



Francis J. Janik, Jr.
Chief, Solid Mechanics Branch
Air Force Flight Dynamics Laboratory

ABSTRACT

This user's manual presents STAGS, a comprehensive computer code. STAGS is intended for the static analysis of arbitrary shells including the effects of nonlinearities caused by material behavior and finite deformations. Collapse loads based on nonlinear analysis can be computed as well as buckling loads based on classical bifurcation buckling theory with linear prestress. Arbitrary thermal and mechanical loadings can be specified. The manual provides instructions for use of the code and presents sample problems and solutions. The theoretical basis for the program also is presented. The program is under development and the version presented here is expected to be updated in 1973.

CONTENTS

Section		Page
	FOREWORD	iii
	ABSTRACT	v
	NOMENCLATURE	ix
	INTRODUCTION	xiii
1	COLLAPSE OF SHELL STRUCTURES	1-1
2	SCOPE, LIMITATIONS, PITFALLS	2-1
3	ANALYSIS	3-1
	3.1 Basic Equations	3-1
	3.2 Solution Method	3-2
	3.3 Bifurcation	3-8
	3.4 Plasticity	3-11
	3.5 Finite Difference Approximations	3-15
	3.6 Shell Geometry	3-18
	3.7 Loading	3-24
	3.8 Constitutive Relations	3-25
4	STRATEGY	4-1
5	USER-WRITTEN SUBROUTINES	5-1
	5.1 Function WIMP (K,X, Y)	5-2
	5.2 Subroutine USRLD (X, Y, NROW, NCOL)	5-2
	5.3 Subroutine MATER (X, Y, IP, TDEG, EX, EY, U, G, A1, A2)	5-3
	5.4 Subroutine ORTH (PROP,X, Y)	5-4
	5.5 Subroutine UNORTH (PROP,X, Y)	5-4
	5.6 Subroutine TEMP (X, Y, T, AP1, AP2)	5-5
	5.7 Subroutine WALL (X, Y, CCC)	5-5
6	INPUT DESCRIPTION	6-1

Section		Page
7	USE OF STAGS PROGRAM	
	7.1 Sample Case 1 - Cylindrical Shell Segment	7-1
	7.2 Sample Case 2 - Cylindrical Shell With Elliptic Cross Section	7-13
	7.3 Sample Case 3 - Cylinder With Rectangular Cutout	7-22
	7.4 Sample Case 4 - Toroidal Shell	7-28
	7.5 Sample Case 5 - Corrugated Cylinder	7-34
	7.6 Sample Case 6 - Ellipsoid	7-41
	7.7 Sample Case 7 - Hyperboloid	7-48
	7.8 Sample Case 8 - Paraboloid	7-55
	7.9 Sample Case 9 - Fiberwound Cylinder	7-62
	7.10 Sample Case 10 - Thermal Loads (Cylinder)	7-69
	7.11 Sample Case 11 - Plasticity (Plate)	7-75
8	STAGS POST PROCESSOR	8-1
9	REFERENCES	9-1

NOMENCLATURE

A, B, C	Matrices, see Eqs. (14), (19)
A, B, C	Coefficients of first fundamental form
C_{ij}	Stiffness coefficients, see Eq. (59)
D, E, F	Coefficients of second fundamental form
D	Stiffnesses, see Eq. (4)
E	Young's modulus
F	Vector of external forces
H	Parameter, see Eq. (58)
L	Operator
L'	Frechet derivative of L , see Eq. (11)
M	Moment resultant
N	Stress resultant
S	Stress vector
U	Strain energy
V	Total potential energy
W	Work done by external forces
X, Y, Z	Surface and normal coordinates used in Sections 5 and 6
X, Y	Vectors of displacement components
X^*	Transpose of vector X
X_o	Vector of displacement components (linear solution)
Z	Strains or curvatures, see Eq. (4)
Z^*	Transpose of vector Z
a	Parameter, see Eq. (45)
a^i	Area of subregion of shell surface
$a, b, \bar{a}, \bar{b}, c$	Parameters for elliptic cone, see Eq. (51)
$a_{i,j}, b_{i,j}$	Sides in rectangular region

$a^{\alpha\beta}$	Geometric tensor
$b_{\alpha\beta}$	Coefficients of second fundamental form
f	Function, see Eq. (31)
f, g, h	Functions, see Eq. (39)
g	Function, see Eq. (9)
h, k	Grid spacing in rectangular ref, see Eq. (36)
k	Ellipse ratio for yield surface
n	Normal-to-shell surface (vector)
t	Shell thickness
u, v, w	Displacement components
u_{α}	Covariant displacement component
x_n	Parameter, see Eq. (9)
x, y, z	Orthogonal Cartesian coordinates, see Eq. (39)
x_i	Coordinate of grid point, see Eq. (29)
$\bar{x}_i$	Coordinate of center of region, see Eq. (32)
$\alpha_{\alpha\beta}$	Thermal expansion coefficients
β	Rotation of edge
$\beta_{\alpha}, \gamma_{\alpha\beta}$	Displacement gradients
γ	Shear strain
$\bar{\gamma}$	Shear strain at a reference surface
$\epsilon_{\alpha\beta}$	Strain tensor
ϵ	Inplane strain
$\bar{\epsilon}$	Inplane strain at a reference surface
$\Delta\epsilon_1, \Delta\epsilon_2, \Delta\gamma$	Strain increments

$\Delta\epsilon_1^P, \Delta\epsilon_2^P, \Delta\gamma^P$	Plastic strain increments
θ	Angle between coordinate lines
θ_i	Coordinate of grid point, see Eq. (29)
$\bar{\theta}_i$	Coordinate of center of region, see Eq. (32)
κ	Change of curvature
$\kappa_{\alpha\beta}$	Change of curvature tensor
λ	Multiplier, see Eq. (17)
ν	Poisson's ratio
ξ, η	Surface coordinates
σ, τ	Stresses
σ_1, σ_2, τ	Stresses at end of load step
$\bar{\sigma}_1, \bar{\sigma}_2, \bar{\tau}$	Stresses at beginning of load step
σ_T	Effective stress, see Eq. (25)
σ_Y	Yield strength for uniaxial tension
ϕ	Angular coordinate

INTRODUCTION

STAGS is a computer code developed to analyze the behavior of general shells under arbitrary static thermal and mechanical loading. Nonlinearities caused by material behavior and finite deformations are accounted for. The STAGS analysis is based on an energy formulation. Derivatives which appear in the energy expression are replaced by their two-dimensional finite difference approximations. When the energy is rendered stationary, the result is a system of nonlinear algebraic equations, which are solved by use of a modified Newton-Raphson method.

STAGS is an outgrowth of work on the buckling of cylindrical panels with nonuniform membrane stresses. This work was initiated at LMSC in 1963 under the sponsorship of NASA Marshall Space Flight Center (Ref. 1). The basic nonlinear computer program for cylindrical shells with cutouts (Ref. 2) and a linear version including analysis of free vibrations (Ref. 3) were developed under the LMSC Independent Research Program. Under contract with the Naval Ship Research and Development Center (NSRDC), the linear version of the code was developed to include shells of revolution with smooth but otherwise arbitrary cutouts (Ref. 4). This user's manual describes the latest version of STAGS which includes features developed during the last three years in separate studies performed under the sponsorship of the Air Force Flight Dynamics Laboratory (AFFDL), the Air Force Space and Missile Systems Organization (SAMSO), and the LMSC Independent Research Program. In the AFFDL effort, the nonlinear capability was extended to shells of more general shape and with cutouts of arbitrary contour. In addition, inelastic deformations were introduced and a capability to handle a finite difference grid with variable nodal point spacing was added. In a parallel effort sponsored under the LMSC Independent Research Program, the equations were generalized to include nonorthogonal coordinates (Ref. 5). Further expansion of STAGS was accomplished under the SAMSO sponsored study. Provisions were made to allow both

temperature and material properties to vary over the surface and through the thickness of the shell. A bifurcation buckling branch was added and parameter studies were made to evaluate the applicability of bifurcation buckling analysis for shells of general shape.

This user's manual describes features developed under each of these studies. For further information concerning the analyses and parameter studies, the reader is referred to final reports issued under these studies (Refs. 6 and 7).

This report begins with a discussion of collapse and bifurcation buckling. Then, a description of the scope and limitations of the code is given followed by details of the analysis. Next, the information necessary to use STAGS is presented.

Section 1

COLLAPSE OF SHELL STRUCTURES

A stress analyst usually defines the buckling load as the value of the load at which the fundamental branch of the load-displacement curve is intersected by a branch corresponding to a buckled equilibrium form. This definition is meaningful if the shell possesses a high degree of symmetry as in the case of axisymmetrically loaded shells of revolution. In reality, small deviations from the nominal geometry will destroy this symmetry. In this case, bifurcation in the equilibrium curve does not occur, and the classical concept of buckling exists only as an idealization.

It also may be noticed that the behavior exhibited by the shell as the buckling load is reached varies drastically from one case to another. As an example, buckling of a spherical cap under uniform pressure corresponds to a complete collapse of the shell. However, if the same spherical cap is subjected to a radial point force, buckling determined through a bifurcation analysis may correspond to a load level at which a gradual change in deformation pattern starts to develop. Loss of stability of the fundamental equilibrium configuration then corresponds only to an imperceptible change in the stiffness of the shell and is of no consequence to the designer.

In these cases, a nonlinear analysis of the axisymmetric prebuckling configuration is combined with a buckling analysis based on the assumption that the nonsymmetric displacements are infinitesimal. A two-dimensional nonlinear analysis gives a more complete description of the shell behavior but is much more expensive. Hence, for shells with a high degree of symmetry, the classical type of buckling analysis will remain an important instrument. Buckling in the classical sense means that the equilibrium of the fundamental branch becomes unstable relative to some deformation mode which is orthogonal to the prebuckling pattern. For a shell of a general shape, it can be expected that all deformation modes are present in the displacement pattern

corresponding to the fundamental branch. In this case, a complete nonlinear analysis is the only rigorous solution to the problem.

If a plane of symmetry exists with respect to loading as well as geometry, bifurcation is possible into modes which are antisymmetric relative to this plane. Thus, a nonlinear analysis which uses symmetry to reduce the amount of calculations should be supplemented by a bifurcation analysis with respect to antisymmetric displacements. Also, it is quite possible that a classical buckling analysis may give good estimates for the collapse load even in cases for which it is not strictly applicable. This would be the case if little change in load distribution or shell geometry occurs before a fatal type of buckling pattern starts to develop. For example, if a short cylinder is loaded by nonuniform external pressure, the bifurcation analysis may give a good approximation of the collapse load, but it may not represent an adequate solution for a longer cylinder.

Section 2

SCOPE, LIMITATIONS, PITFALLS

The computer program STAGS (Structural Analysis of General Shells) performs a non-linear analysis of shells by use of a two-dimensional finite difference approach. Displacement and stress histories are computed corresponding to a given history of applied load, displacement, or temperature. Two branches of STAGS are described in this manual. The first branch is restricted to elastic material behavior and includes three sub-branches: (1) nonlinear collapse analysis, (2) linear analysis, and (3) buckling analysis based on the classical bifurcation approach with a linear pre-buckling analysis. Collapse loads are found as limit points in the nonlinear load displacement curve. The program also is useful for postbuckling analysis of shells which behave according to classical buckling theory and for studies of the influence of imperfections.

The second branch is for inelastic material behavior but does not allow temperature or material properties to vary with any of the space coordinates. Only the nonlinear analysis sub-branch is included here.

STAGS applies to any shell for which a reference surface and a suitable set of gridlines can be mathematically defined. In general, the user of the program provides a subroutine describing the geometry, but several such routines for standard geometries are permanently included in the program (these are listed in Section 6). For the elastic branch the shell wall thickness can be varied, and elastic properties are allowed to vary with the shell coordinates and through the thickness. Cutouts in the shell wall and discrete eccentric stiffeners are included. The program is also general relative to boundary conditions and to loading. The loading can be applied in terms of variable surface tractions, point forces, or line loads. Displacements, such as uniform end shortening of a cylindrical shell, can be applied if desired rather than fixed loading, and provision is made for thermal loading.

The general equations on which the analysis is based are given in Section 3.1 "Basic Equations," 3.3 "Bifurcation," and 3.4 "Plasticity." The finite difference expressions, valid for a variable grid spacing, are discussed in Section 3.5. The introduction of the finite difference approximations into the energy expression leads to a nonlinear algebraic equation system. Section 3.2 discusses the method of solution of this system.

Stiffeners and cutout edges must follow coordinate lines, or rather, the coordinate lines must be chosen so that they follow boundaries, internal or external, and the direction of stiffeners. This is not a severe program limitation because the capability of handling nonorthogonal grids has been included. However, analysis of more complicated shells will require some user skill.

Torsional stiffness and the resistance against rotation are included in the stiffener strain energy, but the energy caused by change of curvature in the plane of the shell has been omitted. Note that shell stiffeners usually are of the type shown in Fig. 2-1; i. e., they are designed to minimize bending of the shell surface. Because of the bending flexibility of the thin web, the line of intersection between the frame web and the shell surface can twist and bend (in the shell plane) without much resistance from the stiffener. In such a case, it is recommended that corresponding stiffnesses (J and I_z) are read in as zero. Then, in the stress output, the very small stresses caused by the changes of curvature in the plane of the shell will be ignored. For accurate

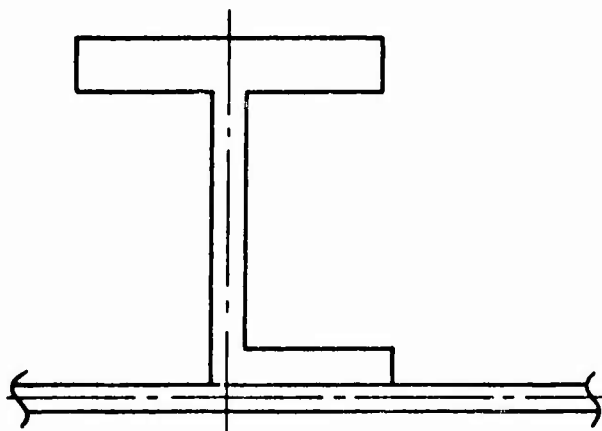


Fig. 2-1 Typical Stiffener

analysis of stiffeners whose cross-section is likely to distort, it would be necessary to consider such stiffeners as shell branches.

The input format requires that four shell edges be specified. For a shell that is closed in one direction, such as a complete shell of revolution, the program will assume that the shell is closed if appropriate boundary conditions are specified on opposite edges. For all

the special geometry routines presently in the program, the shells may be closed only in the η direction.

On each of the boundaries, the input parameters can be used to specify restraint on either of the three displacement components or on the rotation about the tangent to the edge. If displacement restraint is not specified for one or more of these quantities, the analysis will be based on appropriate natural boundary conditions (stress free). If more complicated boundary conditions are used, it will be necessary to modify the program in an area which is not easily accessible to the user. However, displacement restraints off the boundary lines can be introduced by using specified displacements in the load routine.

The most severe limitation of the program in practical analysis is dictated by computer economy. A large number of unknowns is generally unavoidable in a two dimensional numerical analysis regardless of the solution method used. Because of the coupling between the unknowns in two directions, the bandwidth of the resulting equation system is necessarily large in comparison to the bandwidth for one-dimensional problems. In addition, the nonlinearity of the formulation requires an iterative procedure in which the basic linear equation system is solved a number of times. Particularly if plasticity is included, the load step size must be small, and the convergence may be rather slow.

Two items are of special importance relative to the problem of computer runtime. One is the transformation of the structure into a model which is suitable for analysis; the other is the choice of strategy in the nonlinear analysis. Often, it is impossible to model the structure in a straightforward manner and considerable engineering skill may be needed. Eventually a few different models must be analyzed, all reflecting different types of local behavior. The strategy in the analysis involves choice of such items as stepsize and convergence criterion, and also involves the use of initial imperfections and the use of the results from the application of the bifurcation analysis. The choice of a proper strategy is very important for computer economy; this is discussed in detail in Section 4.

For maximum generality of the computer program it is necessary to introduce basic data (loads, temperature, thickness) through user-written subroutines. Such routines are discussed in Section 5. Usually, they are very easy to derive, but geometry routines may be complicated. Because of the importance of the strategy and of the modeling of the structure, it is concluded that considerable user skill is required to achieve the full potential of the STAGS program.

The basic problem dimensions (number of nodal points in each direction) are restricted only by the availability of mass storage. Some program limitations are imposed by dimension statements. In each direction, there can be as many as 80 stiffeners but only of 30 different types. The number of points for integration through the thickness must be an odd number and it may not exceed 9. In the plasticity analysis, as many as 10 material components may be used.

The unwary user may encounter pitfalls. For example, use of a too coarse grid may lead to inaccurate results. This problem is discussed in Section 4. Another problem arises when a buckling mode starts to develop, and its amplitude is small in comparison to the total displacement. The convergence criterion then may not be sufficiently sharp to catch the growth of this new deformation mode. This problem is discussed in Section 4. In particular, it is possible that the shell may buckle in a mode which is antisymmetric with respect to a plane about which symmetric behavior has been assumed. Such an occurrence probably will be revealed through an inspection of the buckling mode. In the bifurcation analysis, it is possible to use different boundary conditions for pre-buckling and incremental displacements.

There is also a possibility that the problem as defined by the program user is not well posed. Difficulties will arise if the boundary conditions allow rigid body displacements. This will make the system extremely ill conditioned; it would be singular except for the truncation errors in the finite difference expressions. The difficulty will occur only in analysis of a free body which is subjected to a self-equilibrating force system. Rigid body displacements can be restrained by specifying displacement constraints as discussed in Section 6 (input description, L-1 and L-2 cards). Because of the aforementioned

truncation error, a small force may develop at restrained points. Therefore, it is advisable to fix points at which the structure is relatively stiff. Results would be meaningless if a load is defined on an edge at which the displacements are restrained in the direction of the load. The same would be the case if a prescribed displacement is in conflict with displacement boundary conditions on an adjacent edge.

For a general shell shape, the bifurcation buckling branch of the program does not correspond to a rigorous application of stability theory. The results may or may not represent good approximations. This problem is discussed in Ref. 3.

Section 3 ANALYSIS

3.1 BASIC EQUATIONS

For shells of a more general shape than the shell of revolution, it is not possible to separate the governing differential equations. The analysis thus requires the use of two independent space variables, and the numerical analysis is drastically encumbered. In addition, if the collapse load of the shell is to be determined, a nonlinear analysis is encountered. The STAGS program is based on a discretization of the total potential energy by use of finite difference expressions.

The energy method was used because it simplifies the handling of shell cutouts and discrete stiffening. For a general shell, the surface coordinates are chosen for practical reasons to coincide with shell boundaries. In this case, they are not necessarily lines of curvature, and the basic equations must be written in terms of non-orthogonal coordinates. For brevity, the basic equations are given here in tensorial form, but a formulation in terms of physical components is available in Ref. 2.

The expression for the strain energy is

$$U = \frac{1}{2} \frac{E}{1 - \nu^2} \left[(1 - \nu) a^{\alpha\beta} a^{\beta\lambda} + \nu a^{\alpha\rho} a^{\beta\lambda} \right] \left[t \epsilon_{\alpha\rho} \epsilon_{\beta\lambda} + \frac{t^3}{12} \kappa_{\alpha\rho} \kappa_{\beta\lambda} \right] \quad (1)$$

The expressions for strains and curvature changes are

$$\begin{aligned} \epsilon_{\alpha\beta} &= \frac{1}{2} (\gamma_{\alpha\beta} + \gamma_{\beta\alpha}) + \frac{1}{2} \beta_{\alpha} \beta_{\beta} + \frac{1}{2} \gamma_{\rho\alpha} \gamma_{\cdot\beta}^{\rho} \\ \kappa_{\alpha\beta} &= \beta_{\beta| \alpha} + b_{\alpha}^{\rho} \gamma_{\rho\beta} - b_{\alpha\beta} \gamma_{\cdot\rho}^{\rho} \end{aligned} \quad (2)$$

where $\gamma_{\alpha\beta}$ and β_α are the displacement gradients defined by

$$\begin{aligned}\gamma_{\alpha\beta} &= u_\alpha|_\beta - b_{\alpha\beta} w \\ \beta_\alpha &= w,_{\alpha} + b_\alpha^\beta u_\beta\end{aligned}\tag{3}$$

and the curvature tensor $b_{\alpha\beta}$ and the normal displacement w are defined with respect to the inner shell normal vector. The curvature tensor differs from that by Sanders (Ref. 8) because it is valid for larger out-of-plane rotations. A complete derivation is given in Ref. 9.

3.2 SOLUTION METHOD

The numerical solution is based upon a two-dimensional finite difference approximation. The shell surface is covered with mesh lines parallel to the coordinate lines, and the freedoms of the system are the normal displacements, w , at the grid points and the tangential displacements, u and v , at points between adjacent gridpoints.

After replacement of the displacement functions and their derivatives in the governing equations by finite difference approximations (see Section 3.5), the strain energy density at mesh station i can be written in the form

$$\Delta U^i = \frac{1}{2} Z^{i*} D^i Z^i\tag{4}$$

where D^i is a 6×6 positive definite matrix of constants and Z^i is a column vector of strain and curvature changes at station i . D^i and Z^i are functions of the geometric parameters of the shell; in addition, D^i is dependent on the material properties. Z^i is a nonlinear (quadratic) function of the displacement unknowns and thus ΔU^i is a fourth-order polynomial. The vector of stress resultants S^i at station i is given by

$$S^i = D^i Z^i\tag{5}$$

The total potential energy, V , of the shell is obtained by combination of the strain energy and the work done by the external forces,

$$V = U - W \quad (6)$$

where

$$U = \sum_1^m \Delta U^i \cdot a^i$$

and

$$W = X^* \cdot F$$

Here X denotes the vector of displacement components, F is the vector of external forces and a_i is the area of the i^{th} subregion. A necessary condition for static equilibrium is that the total potential energy be stationary. This condition requires the vanishing of the first variation of V and leads to the equation

$$LX = F \quad (7)$$

where the operator L is defined by

$$LX = \text{Grad } U \quad (8)$$

L is thus a "stiffness" operator which relates displacement components and external forces and is nonlinear in the general case.

When only linear terms are included in the definition of the strains and changes in curvature, L is a linear operator which may be readily represented in matrix form [see Section 3.3 and Eqs. (22) and (23)]. In this case, the matrix is positive definite (with the choice of proper boundary conditions) and Eq. (7)

$$LX = F$$

may be solved by one of many direct or iterative methods. However, when geometric nonlinearities (i.e., rotations) are included, L becomes a polynomial operator of third degree and iterative methods must be employed for solution of the equations. For a general collapse analysis, it is necessary to solve the operator equation, Eq. (7) for a sequence of applied loads. In fact, the only practical method consists of a sequence of load steps chosen so that the initial solution is nearly linear and subsequent solutions change only moderately from one step to the next. Such a procedure is mandatory for two reasons: first, the feasibility of the iterative methods of solution depend on reasonably good initial approximations and second, a reliable detection of collapse requires such a stepwise procedure because of the non-uniqueness of solutions to nonlinear equation systems.

Thus, at the i^{th} load step in a collapse analysis, the operator equation

$$LX = F_i \quad (8)$$

must be solved where F_i is the vector of constants generated by the applied load (mechanical, thermal, plastic pseudo loads).

A brief description of Newton's method and the modified Newton method for the case of a function of one variable displays the principal features of the methods used for the solution of the nonlinear equation in STAGS.

Newton's method for the solution of the problem $g(x) = 0$ (see Fig. 3-1) is defined by

$$x_{n+1} = x_n - g(x_n)/g'(x_n) \quad (9)$$

The iteration converges quadratically to the solution provided that the initial estimate x_0 is sufficiently accurate. A geometric interpretation of Newton's method is well known; from any point on the curve $g(x)$, the next approximation is obtained by extending the tangent to the curve at the point to the x -axis. In Fig. 3-2, the "modified" Newton iteration is illustrated. The method is defined by the equation

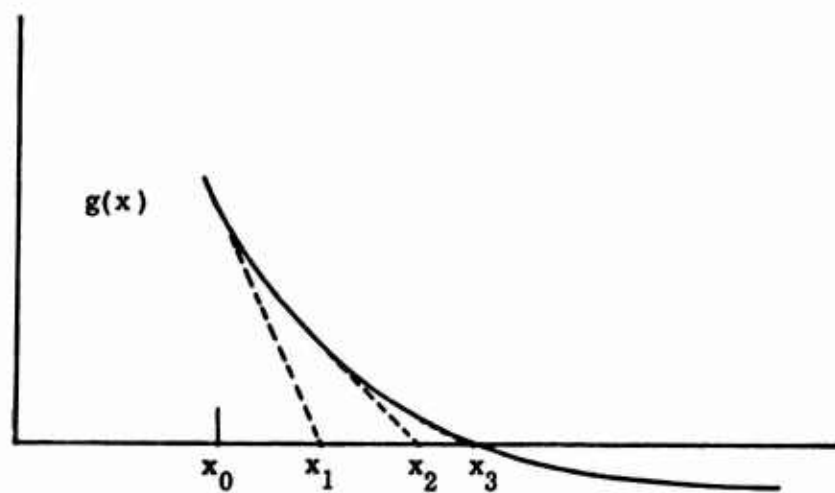


Fig. 3-1 Newton's Method

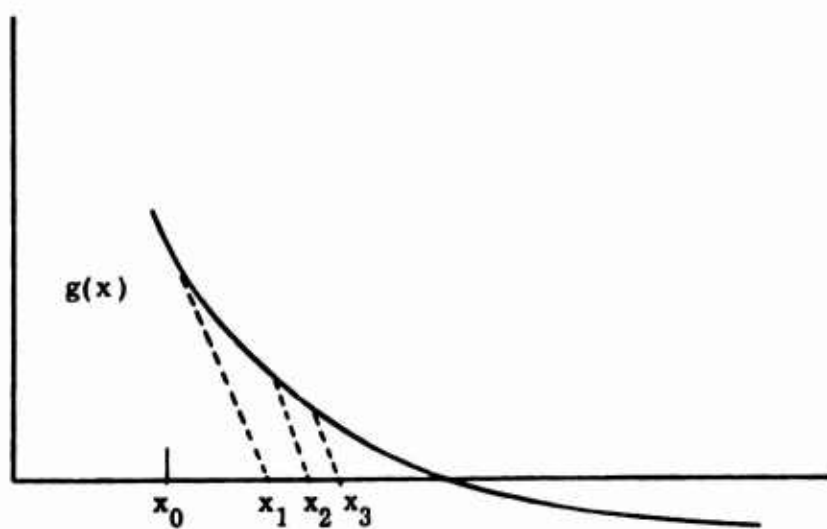


Fig. 3-2 Modified Newton Method

$$x_{n+1} = x_n - g(x_n)/g'(x_0) \quad (10)$$

Geometrically, this iteration corresponds to extending lines from the curve $g(x)$ to the axis which are all parallel to the tangent at x_0 . While the convergence of the modified Newton method obviously is slower than that of the standard Newton method, it avoids repeated computation of $g'(x)$. The most effective strategy usually calls for periodic recomputation of $g'(x)$.

Both Newton's method and the modified Newton method have been generalized to n -dimensional Euclidean space.

The treatment of the complete nonlinear solution of Eq. (7) as well as of bifurcation buckling is facilitated by introduction of the concept of the derivative L' of L (Ref. 6). In particular, for the operator L , the derivative L' (sometimes called the Frechet derivative of L) is an n by n matrix whose elements are

$$L'_{i,j} = \frac{\partial^2 U}{\partial X_{(i)} \partial X_{(j)}} \quad (11)$$

Most of the elementary properties of ordinary derivatives also hold for the Frechet derivatives L' of an operator L .

Because L' is a function of a particular displacement vector X (unless the nonlinear terms are dropped) the Frechet derivative will usually be denoted L'_X to indicate this dependence. With the use of the derivative L' of the operator L , Newton's method may be readily generalized to obtain a solution of Eq. (7). The iteration is defined by

$$L'_{X_k} (X_{k+1} - X_k) = F - LX_k \quad (12)$$

If X_0 is sufficiently close to a solution X and if L'_X is not a singular matrix, the iteration converges to X . Under these assumptions, it also can be shown that the converged solution is unique in some neighborhood of X (Ref. 10).

Similarly, with the aid of the derivative L'_X , the modified Newton method may be applied to the operator equation Eq. (8). The general form of the iteration then becomes

$$L'_{X_m} (X_{n+1} - X_n) = F_i - LX_n \quad (13)$$

This iteration formula contains, as special cases, the most commonly used iterative methods. For example, if $X_m \equiv 0$, L'_{X_m} is identical with the matrix A corresponding to the linearization of the operator L . If B denotes that part of the operator L obtained by variation of the 3rd and 4th degree terms of V , the iteration may be written

$$AX_{n+1} = F_i - BX_n \quad (14)$$

This iteration corresponds to repeated solution of the linear equation system which is obtained by substitution of the previous iterates for the unknowns in the nonlinear terms. The method is often effective in cases for which the effects of nonlinear terms are small. Unfortunately in practical cases (e.g., a cylinder with a cutout), the iteration often fails to converge well before the collapse load is reached. Furthermore, when the method is applicable, a bifurcation analysis would frequently be an even more effective choice.

If only one iteration of Eq. (13) is performed for each load step and if $m = 1$, the resulting method is equivalent to the frequently used "incremental analysis." Both this method, and the standard Newton method, require the recomputation of the derivative matrix and its factorization one or more times for each load step. For the "incremental analysis," the load steps must be chosen small enough to ensure accuracy, but the iteration does not itself provide the information necessary for such a determination.

In contrast to the iterative methods described above, the modified Newton method provides accurate solutions independent of the size of the load step (numerical error

does not accumulate) and at the same time avoids the necessity of frequent recomputation and factorization of the derivative matrix L' . This latter feature exploits a fundamental advantage of the finite difference treatment used here which permits extremely rapid evaluation of LX_n . Even when the best available methods of factorization are employed, the time required for a single evaluation of LX_n is many times less than the factorization time. The modified Newton method is employed in STAGS to combine rigorous results with the most economical computational effort. The effective use of the modified Newton method requires choices both as to the size of load steps and as to when the derivative L' should be recomputed and refactored. The STAGS program contains as much built-in decision making capability regarding these questions as appears feasible. However, it is still necessary for the user of the program to consider the best overall "strategy" relating to these choices (see Section 4).

3.3 BIFURCATION

Note that the mathematical characterization of bifurcation buckling also is provided by the generalized Newton method. Let X_0 be a solution of Eq. (7) under a given vector F of external forces. If every neighborhood of X_0 contains another vector Y which satisfies the equation

$$LY = F \quad (15)$$

then bifurcation is said to take place for the shell under the load F . From the previous remarks on the conditions for convergence of Newton's method to a unique solution, it follows that a necessary condition for bifurcation is that L'_{X_0} be a singular matrix,

$$\det (L'_{X_0}) = 0 \quad (16)$$

Classical bifurcation buckling theory may be obtained easily from Eq. (16). It is assumed that X_0 may be written

$$X_O = \lambda X_L \quad (17)$$

where X_L is the linear solution for a load vector F_L . Thus, Eq. (16) becomes

$$\det (L_{\lambda}^T X_L) = 0 \quad (18)$$

Equation (18) is an algebraic eigenvalue problem of the form

$$\det (A - \lambda B - \lambda^2 C) = 0 \quad (19)$$

In classical bifurcation theory, the C matrix, which arises from the prebuckling rotations, is often omitted and the eigenvalue problem

$$AX = \lambda BX \quad (20)$$

is obtained.

When bifurcation exists but the prebuckling displacements are not linear, the solution of Eq. (16) generally requires a stepwise procedure. One such method is given by the equations

$$\det (L_{\lambda_{k+1}}^T X_k) = 0 \quad (21)$$

$$X_{k+1} = \lambda_{k+1} X_k$$

where X_0 is the linear solution. A sequence of eigenvalue problems is solved and, if the method is successful, λ_k approaches one. A nonlinear bifurcation treatment, equivalent to Eq. (21) was presented in Ref. 11 and has been used successfully to study a large variety of problems. For the two-dimensional problems under consideration

here, it appears that such methods may be nearly as costly as the complete nonlinear analysis available in STAGS. Consequently, only a classical bifurcation buckling analysis is implemented in the STAGS program.

The formation of the A and B matrices of Eq. (19) will be considered briefly. The elements of the Frechet derivative matrix $L_{\lambda X_L}^1$ (which define the matrices A and B) are determined according to Eq. (11). The rules for computing derivatives of polynomials are easily programmed, and the formation of the A and B matrices therefore is well suited to automatic treatment on the computer. Thus, for example, if $X_{(i)}$ and $X_{(j)}$ are the i^{th} and j^{th} displacement components, by use of Eq. (4), (5) and (6) the following is obtained:

$$\frac{\partial^2 U}{\partial X_{(i)} \partial X_{(j)}} = \sum_{k=1}^m a^k \frac{\partial^2 \Delta U^k}{\partial X_{(i)} \partial X_{(j)}} \quad (22)$$

The k^{th} term of this sum is

$$\frac{\partial^2 \Delta U^k}{\partial X_{(i)} \partial X_{(j)}} = \frac{\partial^2 Z^{k*}}{\partial X_{(i)} \partial X_{(j)}} \lambda S_L^k + \frac{\partial Z^{k*}}{\partial X_{(i)}} D^k \frac{\partial Z^k}{\partial X_{(j)}} \quad (23)$$

In the first term on the right hand side of Eq. (23), note that S_L^k is the linear stress resultant vector at station k and that only the quadratic terms (rotations) need be considered in forming the partial derivatives

$$\frac{\partial^2 Z^{k*}}{\partial X_{(i)} \partial X_{(j)}} .$$

Contributions from this term go into the B matrix. Assuming the prebuckling rotations may be neglected for the classical theory, the last term of Eq. (23) generates additions only to the A matrix. The A matrix then is identical with the linear stiffness matrix.

If the prebuckling rotations are included to treat nonlinear bifurcation, the last term of Eq. (23) generates a C matrix and provides additional contributions to the B matrix. In this case, the prebuckling stress resultant vector S would also include nonlinear terms.

In conclusion, it should be noted that the use of operation notation can be (and often is) avoided. For example, a nonlinear equation system can be obtained by writing the displacements at step $n + 1$ as the sum of the known displacements at step n plus an increment of displacement. Newton's method can be derived for functions of many variables by considering Taylor series expansions (see Ref. 12). Bifurcation buckling theory may be based on the theory of adjacent equilibrium states. In all of these cases, the development is rather complicated and burdened with excessive detail. The use of operator methods, however, permits the immediate application of a well developed theory. The concise operator notation facilitates manipulation and programming for the computer. In particular, the definition and computation of the basic matrices of Eq. (19) are greatly simplified. The recipe is outlined in Eq. (22) and (23) and can be performed using straightforward algebraic procedures. Finally, the relations between a complete nonlinear analysis, linear (classical) and nonlinear bifurcation theory and Newton's method are clarified.

3.4 PLASTICITY

Introduction of inelastic behavior has been done within the framework of the energy principle on which the elastic analysis was based. Essentially, the plastic deformations are considered as load terms; they are completely analogous to thermal expansions except that they are not known in advance. A series of elastic problems are solved by use of the energy principles in which the "load terms" are gradually modified until they correspond to the computed state of stress and to specified nonlinear stress strain relations at all points over the shell surface and through the shell thickness.

The plasticity theory used has been proposed by Besseling (Ref. 13), and is based on a principle which originally was suggested by White. This theory is very promising

because it is rather simple in its application yet retains such features as strain hardening and the Bauschinger effect.

The White-Besseling theory, as applied here, assumes that the material consists of several components which have identical elastic properties and exhibit ideal plasticity (no strain hardening) but have different yield strength. As the strain is the same in all components, the stress-strain curve will experience a decrease in slope as the stress reaches the yield limit for any one of the components; the respective components then cease to take additional load. The composite thus exhibits strain hardening with a piecewise linear stress-strain relation. Use of only one component will, of course, result in application of ideal plasticity theory. If the stress is reversed after loading beyond the yield limit for one or more components, yield will occur in the reversed direction at an average stress in the composite which is lower than the stress for original yield. This is demonstrated in the uniaxial stress-strain curve shown in Fig. 3-3. Tension is first applied, OAB, beyond the yield limit and followed by strain reversal, BCD, into the zone of yield in compression. The yield ellipse for the weakest component and the loading history in this component are also shown in this figure. Clearly, yield in compression will occur when the total strain is $(\epsilon_1 - 2\epsilon_y)$, i. e., the yield in compression occurs at a much lower stress if the material previously has been subjected to tension stresses above the yield point. To introduce the Bauschinger effect this way is appealing because it reflects the microstress theory which now generally is accepted as the explanation of the Bauschinger effect.

The White-Besseling plasticity theory is implemented in the computer program in the following manner:

- (1) The inelastic behavior of the material is defined through specification of
 - The number of components
 - The relative volume of each component
 - The yield strength for each component

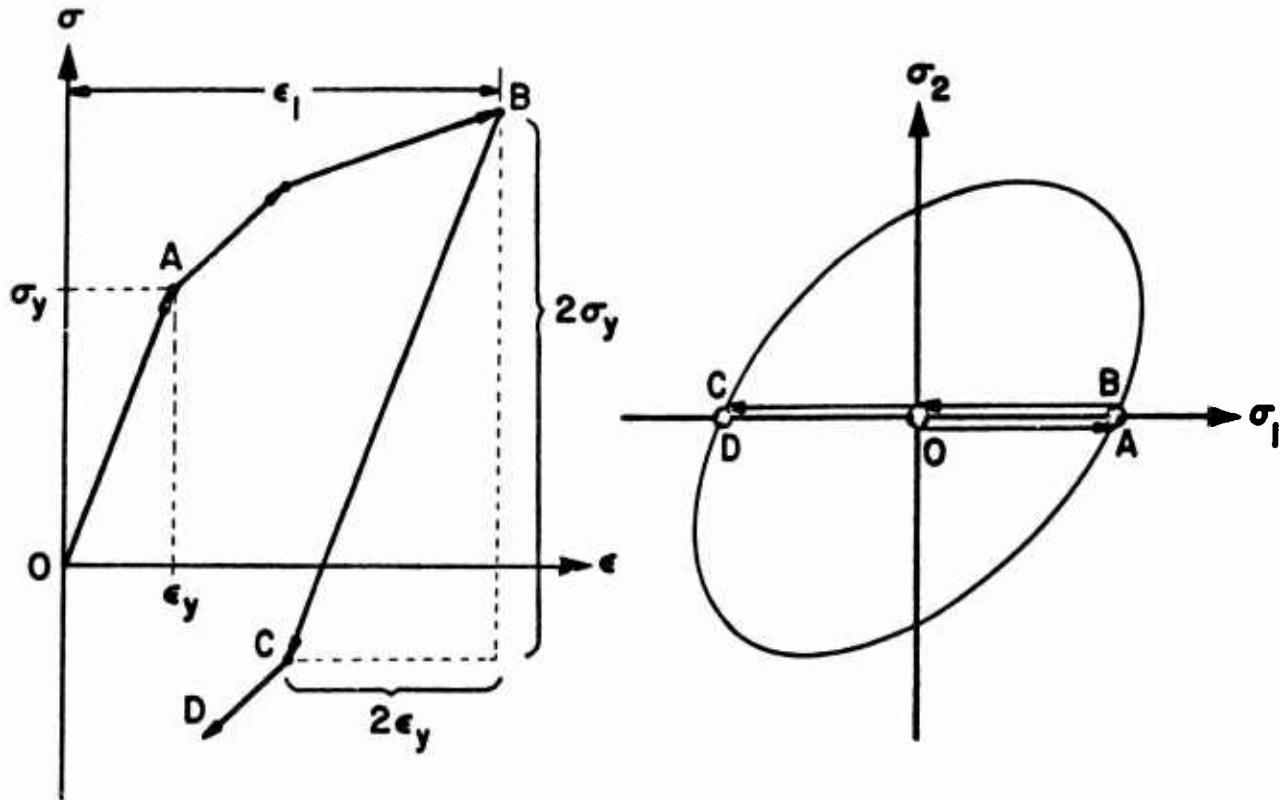


Fig. 3-3 Stress Strain Curve Showing Bauschinger Effect

- (2) The strains are estimated for all points in the shell over the shell coordinates and through the thickness. This generally is done through extrapolation from previous solutions.
- (3) A subroutine is called within which, for each of the material components, the stress corresponding to the assumed strains is determined. The total stress for the composite then is found.
- (4) Once total strains and stresses are known, the plastic part of the strain increment can be determined and added as a pseudo-load in an elastic analysis.
- (5) New strains are computed and used as estimates. The procedure is continued until the computed strains agree to within a given margin with the estimated strains.

The following operations are performed in the above-referenced subroutine:

- (1) Information about material properties is transferred into the routine together with the estimated strain increments ($\Delta\epsilon_1$, $\Delta\epsilon_2$, and $\Delta\gamma$) and stresses at the end of the previous load step ($\bar{\sigma}_1$, $\bar{\sigma}_2$, $\bar{\tau}$).
- (2) New stresses are computed under the assumption that the load step is elastic.

$$\begin{aligned}\sigma_1 &= \bar{\sigma}_1 + \frac{E}{1 - \nu^2} (\Delta\epsilon_1 + \nu\Delta\epsilon_2) \\ \sigma_2 &= \bar{\sigma}_2 + \frac{E}{1 - \nu^2} (\Delta\epsilon_2 + \nu\Delta\epsilon_1) \\ \tau &= \bar{\tau} + \Delta\gamma E / [2(1 + \nu)]\end{aligned}\tag{24}$$

$$(3) \text{ Set } \sigma_T^2 = \sigma_1^2 + \sigma_2^2 - \sigma_1\sigma_2 + k^2\tau^2\tag{25}$$

where k is the ellipse ratio for the assumed yield surface (usually $\sqrt{3}$).

- (4) If σ_T^2 is less than σ_Y^2 , the load step is elastic in this component (loading or unloading). If this is the case for all components, the calculations for the load step are concluded. There are no pseudo loads caused by plastic strain increments.
- (5) If σ_T^2 is larger than σ_Y^2 for some component, the step is at least partly inelastic for this component. As we have assumed ideal plasticity, the stresses can be computed from the conditions that

$$\sigma_1^2 + \sigma_2^2 - \sigma_1\sigma_2 + k^2\tau^2 = \sigma_Y^2\tag{26}$$

where

$$\begin{aligned}
 \sigma_1 &= \bar{\sigma}_1 + \frac{E}{1-\nu^2} \left[\Delta\epsilon_1 - \Delta\epsilon_1^p + \nu (\Delta\epsilon_2 - \Delta\epsilon_2^p) \right] \\
 \sigma_2 &= \bar{\sigma}_2 + \frac{E}{1-\nu^2} \left[\Delta\epsilon_2 - \Delta\epsilon_2^p + \nu (\Delta\epsilon_1 - \Delta\epsilon_1^p) \right] \\
 \tau &= \bar{\tau} + \frac{E}{2(1+\nu)} \left[\Delta\gamma - \Delta\gamma^p \right]
 \end{aligned} \tag{27}$$

and that the plastic flow is perpendicular to the yield surface

$$\frac{\Delta\epsilon_1^p}{\Delta\epsilon_2^p} = \frac{2\bar{\sigma}_1 - \bar{\sigma}_2}{2\bar{\sigma}_2 - \bar{\sigma}_1} \quad ; \quad \frac{\Delta\epsilon_1^p}{\Delta\gamma^p} = \frac{2\bar{\sigma}_1 - \bar{\sigma}_2}{2k^2 \bar{\tau}} \tag{28}$$

After the stresses have been determined in the components, the average stress in the composite is found readily. As the elastic constants are the same for all components, the plastic part of the strain increment (i.e., the pseudo loads), can easily be obtained.

3.5 FINITE DIFFERENCE APPROXIMATIONS

The STAGS program includes a capability of using grids with variable spacing. The discretization of functions and their derivatives in such nets has been handled in the following manner.

Suppose a shell panel has been covered with a system of mesh lines whose coordinates are given by

$$x_i \quad , \quad i = 1, m$$

and

$$\theta_j \quad , \quad j = 1, n$$

(29)

where x and θ are the axial and circumferential coordinates, respectively. Corresponding to each pair of values (i, j) a rectangular region $R_{i, j}$ is defined with sides of length

$$\begin{aligned} a_{i, j} &\equiv 1/2 |x_{i+1} - x_{i-1}| \\ b_{i, j} &\equiv 1/2 |\theta_{j+1} - \theta_{j-1}| \end{aligned} \quad (30)$$

The regions $R_{i, j}$ (and lengths $a_{i, j}$, $b_{i, j}$) are modified at boundaries of a shell by considering only those portions which would be within the panel. A double integral of a function f over the region R of the panel may then be approximated by

$$\iint_R f \, dx \, d\theta = \sum_{i=1}^m \sum_{j=1}^n f_{i, j} a_{i, j} b_{i, j} \quad (31)$$

The discretization is completed when the integrand functions $f_{i, j}$ are evaluated at the centroids of the regions $R_{i, j}$ in terms of the neighboring displacement components.

First, note that the tangential displacements u and v have been located at corners of the regions $R_{i, j}$. Furthermore, the energy expressions for a general shell include derivatives of u and v only up to the first order. Hence, even with arbitrary rectangular spacing, only central difference formulas for the u and v displacements are required. In contrast, the normal displacement w has been located at the mesh node points (x_i, θ_j) , and more general finite difference formulas must be developed.

The coordinates of the centroid of a region $R_{i, j}$ are given by

$$\begin{aligned} \bar{x}_i &= 1/4 (x_{i-1} + 2x_i + x_{i+1}) \\ \bar{\theta}_j &= 1/4 (\theta_{j-1} + 2\theta_j + \theta_{j+1}) \end{aligned} \quad (32)$$

Variable spacing is considered first with respect to a single coordinate x only. With the help of a Taylor's expansion (or equivalently by the use of interpolation formulas), the difference formulas for w , w_x and w_{xx} at $\bar{x}_i$ may be established as

$$\begin{aligned}(w)_i \equiv w|_{\bar{x}_i} &= w_{i-1}/16 \cdot [(h-k) \cdot (3k+h)/(h^2+hk)] \\ &+ w_i/16 \cdot [(h+3k) \cdot (3h+k)/(h+k)] \\ &+ w_{i+1}/16 \cdot [(k-h) \cdot (3h+k)/(hk+k^2)]\end{aligned}\quad (33)$$

$$\begin{aligned}(w_x)_i \equiv w_x|_{\bar{x}_i} &= -w_{i-1}/(2h) \\ &+ w_i [1/(2h) - 1/(2k)] \\ &+ w_{i+1}/(2k)\end{aligned}\quad (34)$$

$$\begin{aligned}(w_{xx})_i \equiv w_{xx}|_{\bar{x}_i} &= w_{i-1} \cdot 2/[h \cdot (h+k)] \\ &- w_i \cdot 2/(h \cdot k) \\ &+ w_{i+1} \cdot 2/[k \cdot (h+k)]\end{aligned}\quad (35)$$

where

$$\begin{aligned}h &= x_i - x_{i-1} \\ k &= x_{i+1} - x_i\end{aligned}\quad (36)$$


The corresponding formulas for the θ coordinate are obtained by appropriate substitutions and are denoted with superscripts

$$\begin{aligned}(w)^j &\equiv w|_{\bar{\theta}_j} \\ (w_\theta)^j &\equiv w_\theta|_{\bar{\theta}_j}\end{aligned}\quad (37)$$

$$(w_{\theta\theta})^j \equiv w_{\theta\theta}|_{\bar{\theta}_j}$$

The required two-dimensional difference formulas now are obtained by combining the formulas for both coordinate directions

$$\begin{aligned}
 \bar{w}_{i,j} &\equiv w|_{(\bar{x}_i, \bar{\theta}_j)} = ((w)_i)^j = ((w)^j)_i \\
 \overline{w, xx}_{i,j} &\equiv w, xx|_{(\bar{x}_i, \bar{\theta}_j)} = ((w, xx)_i)^j \\
 \overline{w, \theta\theta}_{i,j} &\equiv w, \theta\theta|_{(\bar{x}_i, \bar{\theta}_j)} = ((w, \theta\theta)_i)^j \\
 \overline{w, x\theta}_{i,j} &\equiv w, x\theta|_{(\bar{x}_i, \bar{\theta}_j)} = ((w, x)_i, \theta)^j
 \end{aligned} \tag{38}$$

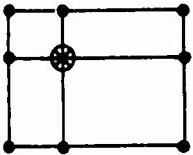

In general, these equations involve the 9 point "star" of neighboring values. However, it is easily seen that all of the formulas reduce to the standard central difference formulas when uniform rectangular spacing is used. All of the difference formulas are exact when the displacement function w behaves quadratically.

3.6 SHELL GEOMETRY

Geometry routines are included in the program for the following common shell types:

- | | |
|----------------------|---------------------|
| ● Plate | ● Ellipsoid |
| ● Cylinder | ● Paraboloid |
| ● Cone/Annular Plate | ● Hyperboloid |
| ● Sphere | ● Elliptic Cylinder |
| ● Torus | ● Elliptic Cone |

These are denoted by the parameter NSHELL = 1 through 10 as discussed in Section 6. In addition, two dummy routines (NSHELL = 11 and 12) are included that are used for shell geometries not listed above. These enable the user to provide his own geometry. The following are instructions for the generation of such routines.

A set of coordinates, the surface coordinates, are defined so that a pair of values (ξ, η) uniquely define the position of a point on the shell surface. ξ, η and the outward normal n should conform to the right-hand rule. For example, for a cylinder it is practical to choose the axial and the angular coordinates. In addition, a set of orthogonal Cartesian coordinates x, y, z is defined, and the coordinate values in this system for a point on the shell surface are expressed in terms of surface coordinates.

$$\begin{aligned}x &= f(\xi, \eta) \\y &= g(\xi, \eta) \\z &= h(\xi, \eta)\end{aligned}\tag{39}$$

These expressions are then used to generate the coefficients of the first and second fundamental forms [Eqs. (40,41)] of the shell surface and the normal to the surface [Eq. (42)].

$$I = A^2 d\xi^2 + 2C d\xi d\eta + B^2 d\eta^2\tag{40}$$

$$II = D d\xi^2 + 2E d\xi d\eta + F d\eta^2\tag{41}$$

$$n = (n_1, n_2, n_3) = \frac{1}{(A^2 B^2 - C^2)^{1/2}} \left[(g_{,\xi} h_{,\eta} - h_{,\xi} g_{,\eta}), (f_{,\eta} h_{,\xi} - h_{,\eta} f_{,\xi}), (f_{,\xi} g_{,\eta} - g_{,\xi} f_{,\eta}) \right]\tag{42}$$

where

$$\begin{aligned}A^2 &= f_{,\xi}^2 + g_{,\xi}^2 + h_{,\xi}^2 \\B^2 &= f_{,\eta}^2 + g_{,\eta}^2 + h_{,\eta}^2 \\C &= f_{,\xi} f_{,\eta} + g_{,\xi} g_{,\eta} + h_{,\xi} h_{,\eta} \\D &= n_1 \cdot f_{,\xi\xi} + n_2 \cdot g_{,\xi\xi} + n_3 \cdot h_{,\xi\xi} \\E &= n_1 \cdot f_{,\xi\eta} + n_2 \cdot g_{,\xi\eta} + n_3 \cdot h_{,\xi\eta} \\F &= n_1 \cdot f_{,\eta\eta} + n_2 \cdot g_{,\eta\eta} + n_3 \cdot h_{,\eta\eta}\end{aligned}\tag{43a-f}$$

The derivatives of these coefficients with respect to the surface coordinates, ξ, η , are also required. These are written

$$\begin{aligned} AX &= \partial A / \partial \xi, \quad BX = \partial B / \partial \xi, \quad \dots, \quad FX = \partial F / \partial \xi \\ AY &= \partial A / \partial \eta, \quad BY = \partial B / \partial \eta, \quad \dots, \quad FY = \partial F / \partial \eta \end{aligned} \quad (44)$$

If the surface coordinates ξ, η are nonorthogonal, NSHELL is set equal to 12 and the user provides a subroutine UNORTH (see Section 5.5). If the coordinates are orthogonal, the procedure is simplified since $C = E = 0$. In that case NSHELL should be set equal to 11 and the user provides a subroutine ORTH (see Section 5.4). Examples of the subroutines ORTH and UNORTH are presented below.

Consider the development of the subroutine ORTH for a paraboloidal shell with meridian defined by

$$x = ar^2 \quad (45)$$

A cylindrical system with the axial coordinate ξ and the angular coordinate η can be chosen as surface coordinates. The Cartesian coordinates are expressed in terms of the surface coordinates:

$$\begin{aligned} x &= f(\xi, \eta) = \xi \\ y &= g(\xi, \eta) = (\xi/a)^{1/2} \sin \eta \\ z &= h(\xi, \eta) = (\xi/a)^{1/2} \cos \eta \end{aligned} \quad (46)$$

Hence

$$\begin{aligned} f, \xi &= 1 & f, \xi\xi &= 0 \\ g, \xi &= \sin \eta / (2 \sqrt{\xi a}) & g, \xi\xi &= -\sin \eta / (4\xi \sqrt{\xi a}) \\ h, \xi &= \cos \eta / (2 \sqrt{\xi a}) & h, \xi\xi &= -\cos \eta / (4\xi \sqrt{\xi a}) \end{aligned}$$

$$\begin{aligned}
f, \eta &= 0 & f, \eta\eta &= 0 \\
g, \eta &= (\xi/a)^{1/2} \cos \eta & g, \eta\eta &= -(\xi/a)^{1/2} \sin \eta \\
h, \eta &= -(\xi/a)^{1/2} \sin \eta & h, \eta\eta &= -(\xi/a)^{1/2} \cos \eta
\end{aligned} \tag{47}$$

The components of the normal are

$$\begin{aligned}
n_1 &= -\left(\sin \eta / (2 \sqrt{a\xi}) \cdot \sin \eta \sqrt{\xi/a} \right. \\
&\quad \left. + \cos \eta / (2 \sqrt{a\xi}) \cdot \cos \eta \sqrt{\xi/a} \right) \frac{1}{AB} = -\frac{0.5}{a} \frac{1}{B} \\
n_2 &= \left(\sin \eta \cdot \sqrt{\xi/a} \right) \frac{1}{AB} \\
n_3 &= \left(\cos \eta \cdot \sqrt{\xi/a} \right) \frac{1}{AB}
\end{aligned} \tag{48}$$

Substitution of equations (47 and 48) into (43a-f, 44) yields


$$\begin{aligned}
A &= \left[1 + \frac{1}{4} \frac{\sin^2 \eta}{\xi a} + \frac{1}{4} \frac{\cos^2 \eta}{\xi a} \right]^{1/2} = \sqrt{1 + 1/(4a\xi)} \\
B &= \left[\frac{\xi}{a} \cos^2 \eta + \frac{\xi}{a} \sin^2 \eta \right]^{1/2} = \sqrt{\xi/a} \\
C &= 0 \\
AX &= \frac{1}{2} [1 + 1/(4a\xi)]^{1/2} \frac{1}{4a} \left(-\frac{1}{\xi^2} \right) = -1/[4\xi \sqrt{a\xi} (1 + 4a\xi)] \\
BX &= 1/(2 \sqrt{a\xi}) \\
AY &= BY = 0 = CX = CY \\
D &= \frac{1}{AB} \left(-\frac{1}{4} \sin^2 \eta \cdot \frac{1}{a} \cdot \xi^{1/2} \cdot \xi^{-3/2} - \frac{1}{4} \cos^2 \eta \cdot \frac{1}{a} \cdot \frac{1}{\xi} \right) = -1/(4aAB\xi) \\
F &= \frac{1}{AB} \left(-\sin^2 \eta \cdot \frac{\xi}{a} - \cos^2 \eta \cdot \frac{\xi}{a} \right) = -\xi/(aAB) \\
DX &= \frac{1}{4a} \frac{(AX \cdot B + BX \cdot A)\xi + AB}{(AB \cdot \xi)^2} & FX &= -\frac{1}{a} \frac{A \cdot B - (AX \cdot B + BX \cdot A)\xi}{(AB)^2} \\
DY &= 0 & FY &= 0
\end{aligned} \tag{49}$$

$$E = 0$$

Table 4 (Section 5) shows the corresponding subroutine ORTH for this example.

As an example of a shell with nonorthogonal coordinates, the development of the Subroutine UNORTH for an elliptical cone is given here.

The following sketch provides the geometry of an elliptical cone. The shell surface and its boundaries are defined by the distances $\bar{a}$, $\bar{b}$, and c . The geometrical constants occurring in the kinematic relations can most conveniently be determined if an elliptical coordinate system is used in the definition of the shell midsurface. Hence with

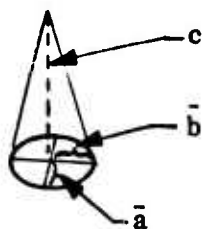

$$a = \bar{a}/c \quad \text{semi-major axis}$$

$$b = \bar{b}/c \quad \text{semi-minor axis} \quad (51)$$

the coordinates in a Cartesian system x, y, z can be written

$$x = a\xi \cos \eta$$

$$y = b\xi \sin \eta \quad (52)$$

$$z = \xi$$

The surface coordinate ξ represents the distance from the apex of the cone and η can be expressed in terms of the angular coordinate ϕ through

$$\eta = \arctan \left(\frac{a}{b} \tan \phi \right) \quad (53)$$

The coordinate lines intersect one another in an angle

$$\theta = \arccos [C/(AB)] \quad (54)$$

The coefficients in the first fundamental form becomes

$$\begin{aligned} A &= (1 + a^2 \cos^2 \eta + b^2 \sin^2 \eta)^{1/2} \\ C &= -\xi (a^2 - b^2) \sin \eta \cos \eta \\ B &= \xi (a^2 \sin^2 \eta + b^2 \cos^2 \eta)^{1/2} \end{aligned} \quad (55)$$

The derivatives of these coefficients are

$$\begin{aligned} AX &= 0 \\ CX &= C/\xi \\ BX &= B/\xi \\ AY &= - (a^2 - b^2) \sin \eta \cos \eta / A \\ CY &= - \xi (a^2 - b^2) (\cos^2 \eta - \sin^2 \eta) \\ BY &= \xi^2 \sin \eta \cos \eta (a^2 - b^2) / B \end{aligned} \quad (56)$$

The coefficients of the second fundamental form and their derivatives are

$$\begin{aligned} D &= E = 0 \\ DX &= EX = 0 \\ DY &= EY = 0 \end{aligned}$$

$$\begin{aligned}
F &= + ab\xi^2/H \\
FX &= F/\xi \\
FY &= -ab\xi (\xi/H)^3 \sin \eta \cos \eta (a^2 - b^2)
\end{aligned} \tag{57}$$

where

$$H = \xi (a^2 \sin^2 \eta + b^2 \cos^2 \eta + a^2 b^2)^{1/2} \tag{58}$$

Table 5 (Section 5) shows the subroutine UNORTH for an elliptical cone. Note: in this example the location of columns in the output will be in η coordinate rather than in angular coordinate ϕ .

3.7 LOADING

The program will accept input defining two independent load systems. During one run, the loads in the two systems may both be proportionally increased, or either one can be restrained by use of the "Maximum Load" input. The collapse analysis for a shell may consist of several runs, the restarting capability is an essential feature of the computer program. This restarting capability also allows the user to change the relation between the increments of the two load systems at any given level of loading. This makes it (for example) possible to apply a fixed external pressure and, in subsequent runs, to keep the pressure constant while an axial shortening is applied until collapse occurs. The loading can be either a prescribed load or a prescribed displacement at any of the grid points. In the bifurcation analysis, the critical loading is defined as the initial load for system B + eigenvalue times the initial load for system A. Consequently if we want to find the critical axial load of a shell with a fixed internal pressure we can represent the internal pressure by load system B and the axial compression by load system A.

The load systems can contain uniform surface tractions or line loads in any direction. The line loads can be applied in the form of a specified load or a specified displacement along any of the boundary lines. Point loads or w displacements can be defined at any

grid point. In addition, the user has the option to add a subroutine which specifies non-uniform pressure or line loads as functions of the shell coordinates. Such nonuniform loads are internally converted into point forces at the grid points.

3.8 CONSTITUTIVE RELATIONS

The constitutive equations are here used in the following form.

$$\begin{Bmatrix} N_1 \\ N_2 \\ N_{12} \\ M_1 \\ M_2 \\ M_{12} \end{Bmatrix} = [C_{ij}] \begin{Bmatrix} \epsilon_1 \\ \epsilon_2 \\ \gamma_{12} \\ \kappa_1 \\ \kappa_2 \\ 2\kappa_{12} \end{Bmatrix}$$

The stiffness coefficients, C_{ij} , can be computed from the elastic and geometric properties of the shell wall. Special subroutines in which these properties are read and the stiffness coefficients computed are provided for

1. Monocoque orthotropic shells
2. Shells with skew stiffeners (waffle pattern)
3. Fiber reinforced
4. Layered shells (orthotropic layers)
5. Shells with corrugated skin
6. Shells with one corrugated and one smooth skin
7. Shells in which the elastic properties vary gradually through the thickness

In addition, a subroutine is provided in which the stiffness coefficients are modified to include the effects of "smeared" stiffeners.

For generality, an option is provided in which the user writes his own wall property routine (WALL). Instructions are given here for the derivation of such subroutines;

subsequent text provides an example. This option provides the only method for introducing variable wall properties (except variable elastic properties in monocoque shells; see input preparation section under card M-1 for IWALL = 8 or 9). The derivation of the user-written wall property routine (WALL), has been facilitated because standard subroutines for shell types listed above can be called from WALL.

For example, in his routine the user can define such properties as moduli, shell thicknesses, and stiffener data as functions of the surface coordinate, and call the appropriate shell wall subroutine which will return the corresponding stiffness coefficients. The user-written subroutine will automatically be called whenever stiffness coefficients are needed if the parameter IWALL (M-1 card) is set equal to one. More than one of the special routines may be called from the user written routine if the shell wall is of different type in different areas.

For a case in which the shell wall is of a type not included among the standard types, stiffness coefficients (C_{ij} matrix) may be read directly in WALL. The coefficients may be derived as described in the following. The strain energy, U , is expressed in terms of strains and changes of curvature. If a subscript following a comma indicates differentiation with respect to one of the strains and changes of curvature such that for $i = 1, 2, 3, 4, 5, 6$ derivatives are taken with respect to $\epsilon_1, \epsilon_2, \gamma_{12}, \kappa_1, \kappa_2, 2\kappa_{12}$, respectively, then

$$C_{ij} = U_{,ij} \quad (59)$$

Stiffness coefficients for the standard wall types are given in Ref. 14 which also gives as an example the detailed derivation for one case, the fiber reinforced shell. As a somewhat simpler example we will demonstrate here, how the coefficients are obtained for a shell with rectangular stiffeners in one direction. It is assumed that the effects of torsional stiffness and resistance to rotation of the stiffener can be neglected.

If

$$\bar{\epsilon}_x, \bar{\epsilon}_y, \text{ and } \bar{\gamma}_{xy}$$

denote strains at the reference surface (here the midsurface of the skin) and

$$\kappa_x, \kappa_y, \text{ and } \kappa_{xy}$$

are the changes of curvature, then the strains at any point off the reference surface can be obtained from

$$\begin{aligned}\epsilon_x &= \bar{\epsilon}_x + \kappa_x Z && \text{in skin and stringer} \\ \epsilon_y &= \begin{cases} \bar{\epsilon}_y + \kappa_y Z & \text{in skin} \\ 0 & \text{in stringer} \end{cases} \\ \gamma_{xy} &= \begin{cases} \bar{\gamma}_{xy} + 2\kappa_{xy} Z & \text{in skin} \\ \text{irrelevant} & \text{in stringer} \end{cases}\end{aligned}$$

The geometric properties of the shell wall are shown in Fig. 3-4.

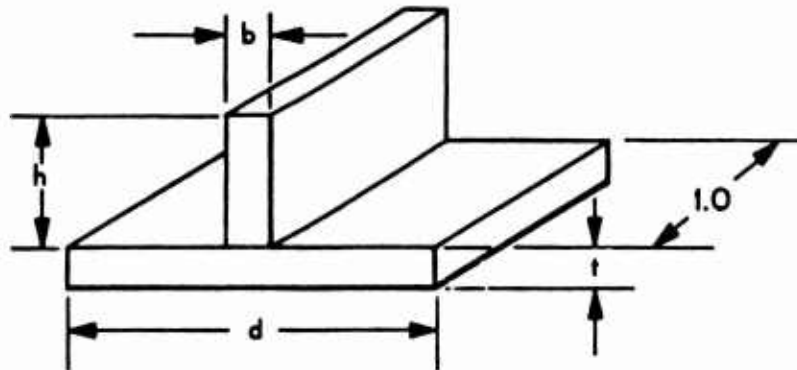


Fig. 3-4

The strain energy per unit area of the shell wall is

$$U = \frac{1}{2d} \int_v (\sigma_x \epsilon_x + \sigma_y \epsilon_y + \tau_{xy} \gamma_{xy}) dv \quad (60)$$

The contribution from the skin is

$$U = \frac{Et}{2(1-\nu^2)} \left(\bar{\epsilon}_x^2 + \bar{\epsilon}_y^2 + 2\nu\bar{\epsilon}_x\bar{\epsilon}_y + \frac{1-\nu}{2}\bar{\gamma}_{xy}^2 \right) + \frac{Et^3}{24(1-\nu^2)} \left[\kappa_x^2 + \kappa_y^2 + 2\nu\kappa_x\kappa_y + 2(1-\nu)\kappa_{xy}^2 \right] \quad (61)$$

For the stringer we have

$$U_{STR} = \frac{Eb}{2d} \int_{t/2}^{h+t/2} (\bar{\epsilon}_x + Z\kappa_x)^2 dZ = \frac{Eb}{2d} \left[h\bar{\epsilon}_x^2 + (h^2 + ht)\bar{\epsilon}_x\kappa_x + \left(\frac{h^3}{3} + \frac{h^2t}{2} + \frac{ht^2}{4} \right) \kappa_x^2 \right] \quad (62)$$

or with

$$\begin{aligned} A &= bh = \text{stringer area} \\ I &= bh^3/12 = \text{stringer moment of inertia} \\ e &= (h+t)/2 = \text{stringer eccentricity} \end{aligned}$$

$$U_{STR} = \frac{E}{2d} \left[A\bar{\epsilon}_x^2 + 2Ae\bar{\epsilon}_x\kappa_x + (I + Ae^2)\kappa_x^2 \right] \quad (63)$$

Then by use of Eq. (59) we find

$$\begin{aligned}
C_{11} &= \frac{Et}{1 - \nu^2} + \frac{EA}{d} & C_{22} &= \frac{Et}{1 - \nu^2} \\
C_{12} &= \frac{\nu Et}{1 - \nu^2} & C_{33} &= \frac{Et}{2(1 + \nu)} \\
C_{14} &= \frac{EAe}{d} \\
C_{44} &= \frac{Et^3}{12(1 - \nu^2)} + \frac{E(I + Ae^2)}{d} & C_{55} &= \frac{Et^3}{12(1 - \nu^2)} \\
C_{45} &= \frac{\nu Et^3}{12(1 - \nu^2)} & C_{66} &= \frac{Et^3}{24(1 + \nu)} \quad (64)
\end{aligned}$$

If a user written shell wall property routine is used, certain rules must be followed. Thus the list of variables under the subroutine name (WALL) is (X,Y,CCC) which represent the shell surface coordinates and stiffness coefficients. The X and Y dimensions must correspond to those shown in Section 5, page 5-1.

If any of the other routines are called from WALL the list in the call statement must be (N). Any number of the routines listed in Table 7 may be called from WALL. The table also shows the required common statements corresponding to each of the sub-routines. As there are no cards to be read in the routines called from WALL it is necessary to provide in WALL the size of the quantities in these common statements. They are defined on the cards M-2B through N-4B in the input description. If smeared stiffeners data are provided in WALL the user must CALL STIFF in subroutine WALL to generate the stiffeners coefficients.

As an example we will consider here a shell which is composed of a spherical segment and a cylindrical part as shown in Fig. 3-5.

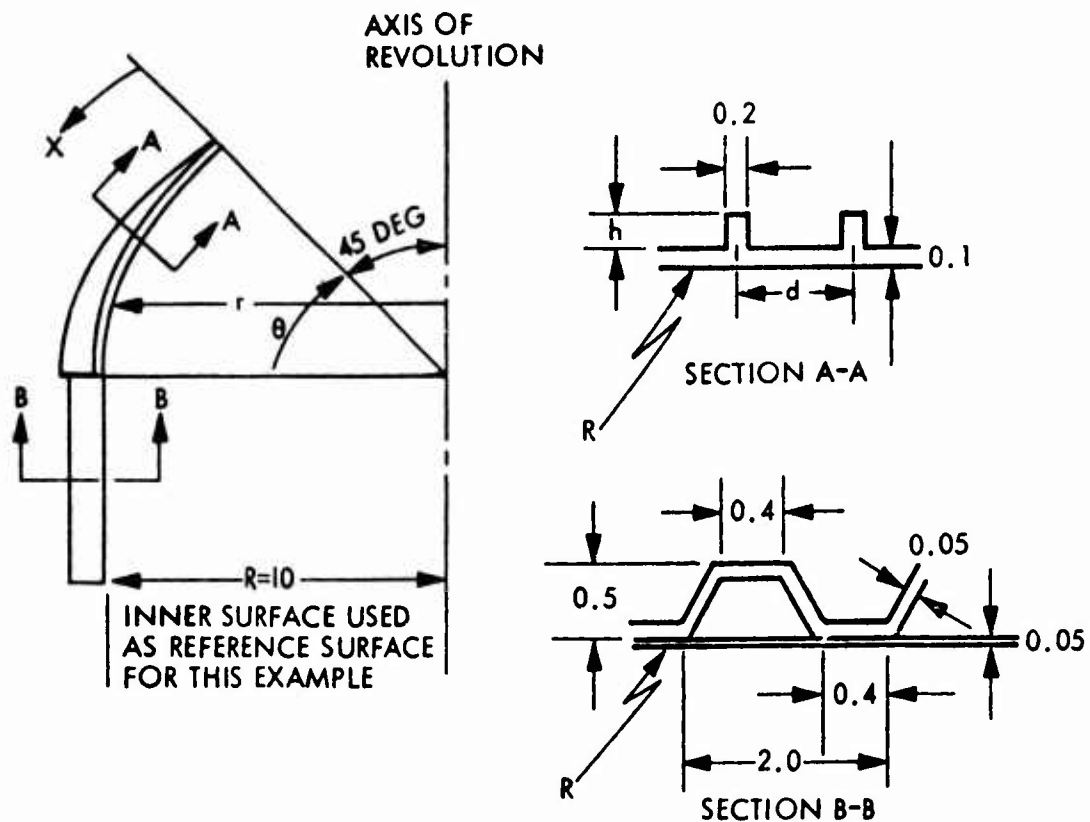


Fig. 3-5

The user written geometry which is needed for this case we will assume uses as X coordinate the arc-length from the upper edge. Hence the local radius

$$r = 10 \cdot \cos \left(\frac{\pi}{4} - \frac{X}{10} \right)$$

if there are 40 stringers around the circumference we have

$$d = \frac{2\pi \cdot r}{40} = \frac{\pi \cdot r}{20}$$

We assume that it is specified that the stringer height varies linearly from zero at the shell edge to 0.6 inch at the interface between the spherical and cylindrical shells.

$$h = \frac{X \cdot 0.6}{(\pi/4)} = \frac{2.4 \cdot X}{\pi}$$

The material for both parts of the shell is isotropic with $E = 10^7$ and $\nu = 0.3$.
The routine WALL corresponding to this shell is listed as an example in Table 5-7.

Section 4 STRATEGY

The preceding paragraphs have described the scope and limitations of the STAGS computer program. The following text discusses the choice of certain control parameters; and an effort is made to convey to the user some of the experience that has been gained through extensive program use.

There are essentially two areas within which the user is required to use his own judgment. The first of these is the modeling of a structure so that it becomes amenable for analysis. This will include the choice of a suitable grid. The second area is the choice of certain parameters, such as the initial load step and the convergence criterion, which will govern the flow of computations in the nonlinear analysis.

The modeling of the structure is generally considered to be outside of the scope of this manual. It is assumed that the user has decided about the shell geometry and material properties, about boundary conditions and loading, and about what to include in terms of stiffeners and cutouts. The next step would be to determine which type of analysis to apply. If the interest is in the stress distribution for loads which are known to be small in comparison to the collapse load of the shell a purely linear analysis can be used. If it can be safely assumed that changes in geometry or stress distribution are negligible at loads only slightly below collapse, the branch for bifurcation buckling can be used for establishment of the stability limit.

In case there is some uncertainty about this, the following procedure might help the user to avoid an expensive complete nonlinear analysis. The design load is used as both initial and maximum load. The linear analysis then will be obtained, and an attempt will be made at solution of the nonlinear equations at this load step. If the linear analysis represents a good approximation, convergence will be obtained within

a few iterations and, as no additional factoring is required, this will add very little to the computer time. If convergence is not obtained, this will serve as a warning that a nonlinear analysis may be needed. It is recommended, therefore, that the nonlinear option be used unless similar cases previously analyzed clearly indicate that a linear analysis is satisfactory. Also, note that a slight increase in load beyond the design load may lead to a considerable increase in the influence of nonlinear terms. Such behavior would be revealed by a bifurcation analysis. If results from the nonlinear analysis at the design load differ little from results from a linear analysis and the bifurcation load is well above the design load, shell collapse is not a problem. In choosing the type of analysis, it may be useful for the program user to know that a nonlinear analysis, if it converges at the first step only requires about 25 percent more computer time than a linear analysis, and that a bifurcation buckling analysis could take from two to three times as much computer time as a linear analysis, when multiple eigenvalues exist in the neighborhood of the lowest eigenvalue.

If the shell is subjected to such load as to make instability a possibility, and if the shell dimensions are not determined by other – nonstructural – requirements, efficient design can be achieved only if a collapse analysis is performed. In this case, the bifurcation buckling analysis should be used only if the analysis of similar cases clearly indicates its adequacy.

The next step is to determine the size of the grid. For economy, it is necessary to take advantage, whenever possible, of the capability of using nets with variable spacing. If similar cases have not been run before, it is essential that a convergence study be made. Often this may be done by use of a linear analysis or a bifurcation buckling analysis. Note, however, that sometimes a good estimate of the collapse load can be obtained with a more coarse grid than is required for an accurate estimate of pre-buckling stress distribution. Also, sometimes, the coarseness of a net which is satisfactory for linear analysis, will result in spurious buckling modes.

The user can reasonably well determine the computer time for a linear stress analysis or bifurcation buckling analysis from Fig. 4-1. For a nonlinear analysis, it is difficult to predict how many refactorings are needed and how big the local steps may be. Depending upon how drastic the changes in geometry or stress distribution are in the

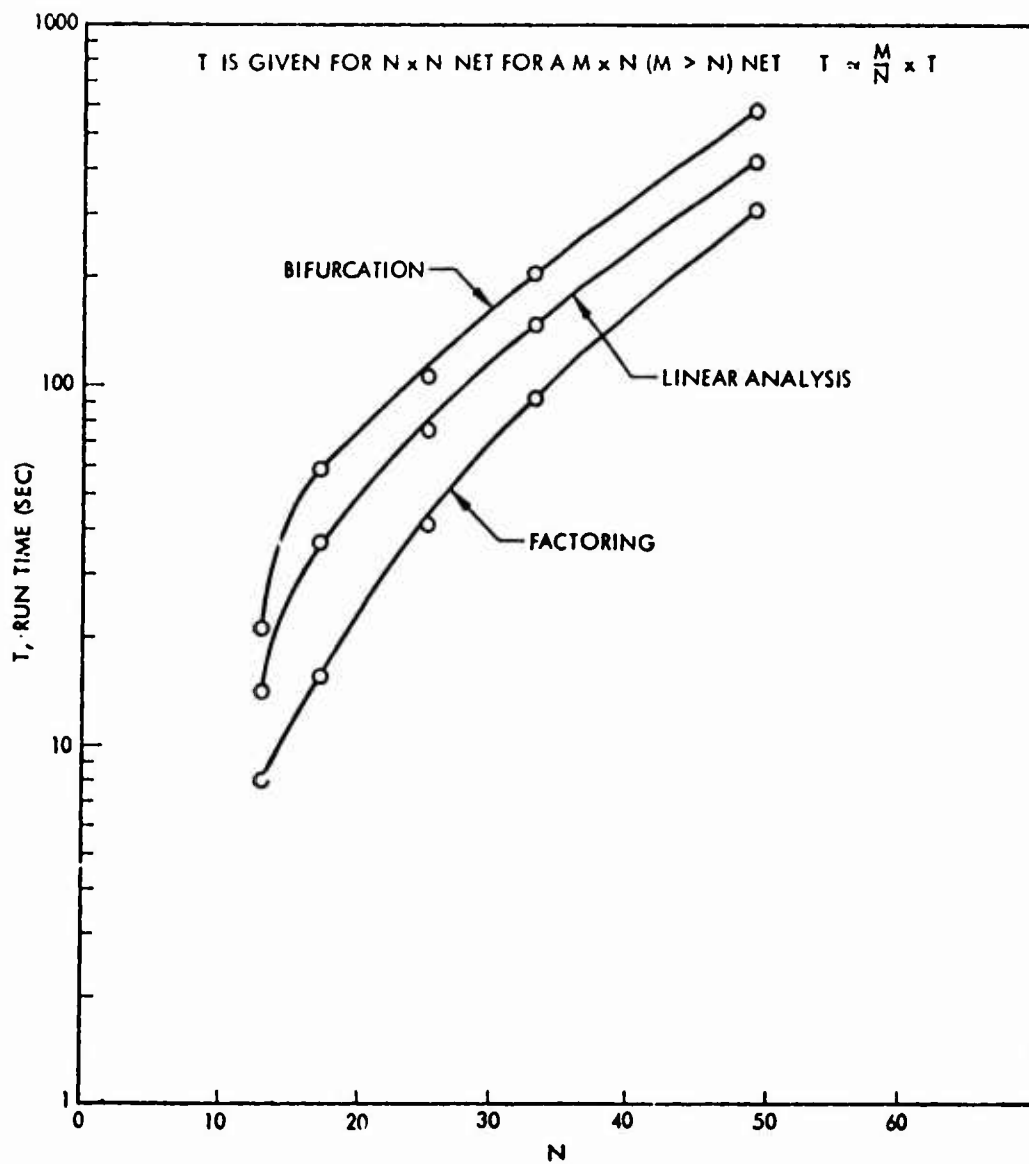


Fig. 4-1 CDC 6600 Computer Time for Bifurcation and Linear Stress Analysis

critical range, the computer time for a collapse analysis varies from, for example, 10 to 100 times the time for a linear analysis.

Once the structural model (including the grid) has been chosen, the linear analysis is straightforward; for a nonlinear analysis additional decisions must be made. The user must choose the initial load step and other control parameters and also may elect to override built-in values for the iteration convergence criterion and the over- or under-relaxation factor. An effort has been made to make automatic as much as possible of the computation strategy. Thus, for example, if convergence is slow, an over- or under-relaxation factor is automatically applied depending on whether the convergence is uniform or oscillating. The user generally leaves blank fields for convergence parameter and relaxation factor. This means that the convergence parameter is set to 10^{-4} , and the relaxation parameter is chosen as indicated above. The user may loosen this convergence criterion if it is indicated from the results that round-off errors make convergence difficult or even impossible. The criterion also may be tightened as discussed below. The relaxation factor should be determined by the user only if the user has considerable experience in the use of the program. If the relaxation factor is given any value on the input card (including 1.0), this factor will be used throughout the analysis.

The linear solution is always computed and used as a first estimate for the unknowns. Later, estimates are obtained through extrapolation (quadratic when two or more previous solutions are available). Therefore, the initial load must be chosen so that the solution for this load level is not too far from the linear solution. A bifurcation analysis to guide in the choice of initial stepsize, although expensive, is possible if there is no other basis for a reasonable guess. If convergence is obtained easily within one or two iterations, the load-step will be automatically increased by a factor of 1.5. This increase will be repeated any number of times, and thus the penalty for a poor initial load step guess will be alleviated. This feature in the program also is useful for many cases in which a proper guess is made for starting values. For example, for a shell of revolution with nonuniform load, convergence is usually slow at the first couple of load steps; after previous solutions are available for extrapolation, the convergence is faster and the load step can be increased.

The choice of initial load and of initial size of the load step for maximum efficiency is case dependent. A user who is experienced in nonlinear analysis can choose these parameters to suit his particular case. To a user who has no experience on which to base such a decision, one might recommend that initial load and initial step be chosen at about one tenth of the anticipated collapse load. If the structure is expected to behave almost linearly until the critical load is closely approached, the initial load may be large and the initial step much smaller.

If convergence is not obtained in the first load step, it is probably because the initial loads are too big, and the nonlinear solution differs too much from the linear solution. However, there are other possibilities such as simple mistakes in input quantities. The user also is advised to check whether the boundary conditions allow rigid body motions – translations, rotations, or combinations of these. It also is possible that the boundary conditions allow deformation in a mode in which the shell is very weak, e.g. an inextensional deformation mode. For such cases, it is possible that the system is so ill conditioned that the problem cannot be solved with single precision accuracy. If this deformation mode is not essential to the solution of the problem, it can be restrained and subsequently a successful analysis can be executed. The cases in which such difficulties occur are quite rare.

If the convergence was not obtained because the initial load step was too large, then this step must be reduced. If the iteration diverges, the load may be cut by as much as a factor of 10, whereas a lesser reduction may be successful if the iteration converges too slowly. After initial convergence has been obtained, the program continues with the input load step until a load level is reached at which the program fails to converge within prescribed limits. The program then either cuts the load increment in half or makes a standard Newton iteration step by recomputing $L'(X_m)$ where X_m is the displacement vector solution obtained for the previous load step. The choice between these two alternatives is based on strategy parameters input by the user:

ICUT – Total number of times load increment may be cut in half

INEWT – Number of times the matrix $L'(X_m)$ may be recomputed

ISTRAT – Number of times load increment is cut between recomputation of $L'(X_m)$.

Thus, if $ISTRAT = 1$, the program alternates between cutting the load increment and recomputing the matrix when convergence difficulties are encountered. When the program has already cut the step size $ICUT$ times, additional "Newton" steps (recomputation and factorization of $L'(X_m)$) are permitted until the total exceeds $INEWT$. Of course the reverse situation also may occur in which the program is only permitted to cut the step size but not to take additional "Newton" steps. If neither strategy is allowed, the program stops as soon as convergence difficulties arise.

In view of the highly unpredictable nature of nonlinear behavior, it is very difficult to prescribe the best values for the strategy parameters in advance. As an initial choice for an unfamiliar type of shell, the values

$ICUT=2$
 $INEWT=2$
 $ISTRAT=1$

are suggested. By observing the convergence behavior in previous computer runs, a more effective set of values may be selected for continuation. Thus, if for example, the last five load steps converge in one iteration each, a larger load increment may be desirable. Conversely, as a collapse load is approached, it will be necessary to cut the load increment frequently (e.g., $ISTRAT=2$ or $ISTRAT=3$). Sometimes a shell exhibits substantial redistribution of stresses at loads well below the collapse load. In such regions, the most economical strategy may be to take "Newton" steps (which take into account the stress redistribution) more frequently than cutting the step size. Such a strategy could be achieved by

$ICUT=1$
 $INEWT=6$
 $ISTRAT=1$

In general, it has been found advisable to restrict each computer run to 5 to 10 times the computer time for factoring so that the convergence behavior can guide the selection of strategy.

The STAGS program is, of course, not an appropriate tool for analysis of the buckling or collapse of shells of revolution under axisymmetric loading. For such problems, simpler tools are available, such as the BOSOR4 program (Ref. 15). Axisymmetric cases have been analyzed for verification of the validity of the STAGS program.

Theoretically, as the critical load is reached, the round-off errors should trigger a deformation in the buckling mode. In practical application, it is generally found that in the early stage of buckling the amplitude of the buckling mode is so small in comparison to the prebuckling displacement that its growth, although in a relative sense large, will not violate the specified convergence criterion. This difficulty is avoided by the specification of initial imperfections in the shell geometry which are small enough not to appreciably affect the buckling load but large enough to trigger the new deformation pattern. The program, therefore, has been equipped with an option to add a subroutine which describes an initial lateral displacement pattern.

It has been found during use of the program that the imperfections may be useful as triggers also in other cases than those with perfect axial symmetry. For example, in the analysis of an elliptical cylinder with an aspect ratio of 1.5, it was found that without trigger it was necessary to use a very severe convergence criterion ($\epsilon = 10^{-5}$) but if a small imperfection is added, the same collapse load may be computed in about half the run time with a less severe convergence criterion ($\epsilon = 10^{-3}$). If the elliptical cylinder has a significantly smaller aspect ratio, it is likely that the amplitude of the buckling pattern which is present in the prebuckling displacement is too small to act as a trigger. In this case, the computation of a collapse load must include the use of a small imperfection. The choice of imperfection mode may often be aided by knowledge of the bifurcation buckling mode.

If difficulties like these do occur, they will be discovered when attempted refactoring at a load level above the collapse load leads to a coefficient matrix for the linear system which is not positive definite. In such a case, the user must either sharpen his convergence criterion or introduce an imperfection.

The run may often be saved if a new run is restarted from an earlier solution; i. e. , ISTART is chosen to be 1 or 2 rather than 3, which is the value chosen under normal conditions. There also may be other reasons to suspect that an inaccurate solution has been accepted in which case restart from file 1 or file 2 on the data tape is advisable.

Note that through use of additional analysis with various degree of imperfections, the user of the program can get some notion of the degree of imperfection sensitivity of the collapse load.

The input card with strategy parameters (P-1B card) also includes a parameter ISEC. Occasionally, during computations, a check is made of whether the elapsed computer time exceeds ISEC; in this case, intermediate results are saved on data tape. ISEC should first be chosen to be a minute or so less than the time estimate at which the operator aborts the run. Before each refactoring, the program also checks that sufficient time is available to make refactoring meaningful. To refactor at the end of a run would be wasteful because a restarted run begins with factoring.

In the bifurcation analysis, inverse power iteration is used to obtain the critical value closest (in absolute value) to the initial shift point. The rate of convergence to the critical mode may be very slow unless a shift of the eigenvalue spectrum is used. If the parameter ISHIFT is set greater than zero, the program automatically performs up to a maximum of ISHIFT eigenvalue shifts to expedite convergence. It is proposed that if the user has no special reason to do otherwise, ISHIFT is set to 2 and ITERAT (the maximum number of iterations between shifts) is set to 20.

Whenever the critical load is reasonably well known, it is probably desirable to use a value somewhat below the expected buckling load as initial shift. In general, it should be noted that increased convergence rates are obtained at the cost of a complete matrix factorization for each eigenvalue shift. An initial shift may sometimes be necessary to obtain a physically meaningful critical value which does not correspond to the lowest mathematical eigenvalue. For example, when a load system results in tension somewhere in the structure, there will usually be negative eigenvalues which may not be of interest. Also, it may not be convenient to eliminate rigid body motion by means of boundary conditions in which case there will be eigenvalues approximately or exactly zero. In these cases, the physically meaningful buckling load can be obtained by an initial shift which is sufficiently close to the desired critical value.

Section 5

USER-WRITTEN SUBROUTINES

To extend the applicability of the STAGS computer program, the option of several user-written subroutines was provided. These subroutines make it possible for the user to communicate to the system functional relationships which would be difficult, if not impossible, to define through regular data card input. Do not read input cards in any of these routines.

Some of the information defined in the user-written subroutines may, in effect, override data read in on regular input cards, but none of the user-written routines suppresses the reading of any of these cards.

Instructions and examples of user-written subroutines are given here except for the geometry routines (ORTH and UNORTH) and routine WALL which are discussed in Section 3.

The coordinates X and Y used in the user-written subroutines must correspond to the coordinates used for the description of the shell geometry (NSHELL) as follows:

<u>NSHELL</u>	<u>GEOMETRY</u>	<u>X</u>	<u>Y</u>
1	Cylinder	Length	Degrees
2	Cone/Annular Plate	Length	Degrees
3	Plate	Length	Length
4	Sphere	Degrees	Degrees
5	Paraboloid	Length	Degrees
6	Elliptic Cylinder	Length	Degrees
7	Ellipsoid	Degrees	Degrees
8	Torus	Degrees	Degrees
9	Hyperboloid	Degrees	Degrees
10	Elliptic Cone	Length	Degrees
11	ORTH }	As specified by user in geometry routine	
12	UNORTH }		

If trigonometric terms are used in a user-written subroutine, the arguments must be in radians. That is, if X and/or Y are in degrees, they must be converted to radians in the user-written subroutine (see Section 5.1 and Table 1 for example).

The portion of the user-written subroutine that must be added to the program file is clearly marked with an asterisk (*) for particular examples, in Tables 1 to 7. The subroutines names, dimensions, comments, common statements, and the return and end cards are part of the permanent program file and appear in it in consecutive order.

5.1 FUNCTION WIMP (K,X,Y)

This routine defines initial imperfection, if any, of the shell surface.

The computer program uses only the first derivatives of the imperfection with respect to the two space variables. If, when the subroutine is entered, the parameter in the list (K) is equal to 2, the derivative with respect to Y is requested (Y is zero on boundary line 4). Otherwise, the subroutine should return only the derivative with respect to X (X is zero on boundary line 1).

Table 1 gives an example using this routine for a cylinder with $L = 10$ and $W_0 = 0.00001 \sin (X\pi/2L) \cos (6Y)$.

5.2 SUBROUTINE USRLD (X, Y, NROW, NCOL)

This subroutine serves to define a functional relationship between the external loading and the X, Y mesh coordinates and is called only if LFLG = 1 on the L-1 type input card. Additional loads can be defined by use of the L-2 cards.

X(I) = X coordinate of mesh point I
Y(I) = Y coordinate of mesh point I
NROW = Number of rows
NCOL = Number of columns

In the process of coding the USRLD subroutine, the user has to define the external load P at any or all mesh points and then issue a call statement

CALL FORCE (L, M, N, P, I)

where

L = Row number of mesh point where P is acting
 M = Column number of mesh point where P is acting
 N = Direction of P
 1 - Normal (Z)
 2 - Tangential (Y)
 3 - Tangential (X)
 P = External load
 I = Load type
 -1 - Displacement
 1 - Point force
 2 - Line load along rows
 3 - Line load along columns
 4 - Pressure test
 5 - Line pressure load (uniform pressure only)

The positive load is applied in the direction of positive displacement.

Table 2 provides an example using this routine for internal pressure that varies along the Y coordinate according to $P = 10 [\cos (2Y) + 1]$.

5.3 SUBROUTINE MATER (X, Y, IP, TDEG, EX, EY, U, G, A1, A2)

This subroutine defines the temperature and wall properties at every mesh point and point through the thickness in the shell and is called by the program only if $IWALL = 8$ on the M-1 type input card.

X = X coordinate of mesh point
 Y = Y coordinate of mesh point
 IP = Number of points across the wall (numbered inner to outer)
 $TDEG$ = Wall temperature

EX = Modulus of elasticity in X direction
 EY = Modulus of elasticity in Y direction
 U = Poisson's ratio (μ_{xy})
 G = Shear modulus
 A1 = Coefficient of thermal expansion in X direction
 A2 = Coefficient of thermal expansion in Y direction

An example using this routine for material properties as function of a parameter C is given in Table 3, where

C = 1.0 - 0.4 cos (Y) for Y < 90
 C = 1.0 for Y ≥ 90

5.4 SUBROUTINE ORTH (PROP,X, Y)

This subroutine defines shell geometries described by a set of orthogonal surface coordinate lines. It must be provided by the program user when the parameter NSHELL (see Section 6, Card G-2 is set equal to 11. If a 3D plot of geometry (NCHK.GT.0) is requested, the user must provide the orthogonal cartesian coordinates XG, YG, and ZG as shown in Table 4.

An example of a paraboloid is described in Section 3.6 and the resulting subroutine shown in Table 4.

5.5 SUBROUTINE UNORTH (PROP, X,Y)

This subroutine defines shell geometries described by a set of nonorthogonal surface coordinate lines. It must be provided by the program user when the parameter NSHELL (see Section 6, Card G-2) is set equal to 12, and can be used only in conjunction of IWALL equal 1 or 2. (IWALL = 1 requires user written subroutine for shell wall properties.) If a 3D plot of geometry (NCHK. GT.0) is requested, the user must provide the orthogonal cartesian coordinates, XG, YG, and ZG as shown in Table 5.

Example of an elliptical cone is described in Section 3.6 and the resulting subroutine is shown in Table 5.

5.6 SUBROUTINE TEMP (X, Y, T, AP1, AP2)

The user has the option of entering the thermal loading in conjunction with load Pattern A by means of this subroutine. Subroutine TEMP is called for each mesh point of the shell and normally returns a temperature value of zero unless the user specifies otherwise. X and Y are the shell coordinates of the surface. AP1 and AP2 are the coefficient of thermal expansion in X and Y direction, respectively.

Table 6 shows an example of the use of this routine for temperature variation given by $T = 50 [1 - 0.4 \cos(Y)]$ where Y is given in degrees.

5.7 SUBROUTINE WALL (X, Y, CCC)

Subroutine WALL makes it possible for the user to vary the stiffness matrix or the material properties which influence the calculation of the stiffness matrix at various mesh-points. The common variables related to the various types of wall constructions are available by means of FORTRAN COMMON statements.

The subroutine is called at each mesh-point if IWALL is set to 1 on the M-1 type input card. The user may calculate the CCC stiffness matrix (6 x 6) directly or just set the appropriate wall properties to the desired value and call subroutine CFB(N) to perform the stiffness matrix computations according to wall construction type N (see Input description for the available wall construction options).

For a simple example, see the description in Section 3.8 and resulting subroutine in Table 7.

Table 1
FUNCTION WIMP

```

FUNCTION WIMP(K,X,Y)
WIMP = 0.0
P = 0.00001
PI2 = 3.14159 / 20.0
Y1 = Y * 3.14159 / 100.0
IF (K .EQ. 2) GO TO 20
WIMP = P * PI2 * COS(PI2 * X) * COS(6.0 * Y1)
RETURN
20 WIMP = -P * 6.0 * SIN(PI2 * X) * SIN(6.0 * Y1)
RETURN
END

```

Table 2
SUBROUTINE USRLD

```

SUBROUTINE USRLD (X, Y, NROW, NCOL)
DIMENSION X(NROW), Y(NCOL)
DO 10 L = 1, NROW
DO 10 M = 1, NCOL
T = Y(M) * 3.14159 / 100.0
P = 10.0 * (COS(2.) * T) + 1.0)
10 CALL FORCE (L, M, 1, P, 4)
RETURN
END

```

Table 3
SUBROUTINE MATER

```

SUBROUTINE MATER (X, Y, IP, TDEG, EX, EY, U, G, A1, A2)
DIMENSION TDEG(IP), EX(IP), EY(IP), U(IP), G(IP), A1(IP), A2(IP)
COMMON /OFST/ TO, Z
C TO AND Z MUST BE SET BY THE USER
C TO = TOTAL THICKNESS OF SHELL (TO=4T)
C Z = DISTANCE FROM REFERENCE SURFACE TO MIDSURFACE OF SHELL WALL
TO = 0.1
Z = 0.
C = 1.0
IF (Y .LT. 90.0) C = 1.0 - 0.4 * COS(Y * 3.14159 / 180.0)
DO 1 L = 1, IP
TDEG(L) = 0.0
EX(L) = C * 1000000.0
EY(L) = 0.4 * C * 1000000.0
U(L) = 0.1
G(L) = 0.2 * C * 1000000.0
A1(L) = 0.0
A2(L) = 0.0
1 CONTINUE
RETURN
END

```

Table 4

SUBROUTINE ORTH

```

SUBROUTINE ORTH (PROP, X, Y)
  DIMENSION PROP(3)
C   PROP(1) = X COORDINATE OF BOUNDARY LINE 1
C   PROP(2) = X COORDINATE OF BOUNDARY LINE 3
C   PROP(3) = Y COORDINATE OF BOUNDARY LINE 4
C   PROP(4) = Y COORDINATE OF BOUNDARY LINE 2
  COMMON / FQA / NSHELL, A, B, AX, AY, BX, BY, XG, YG, ZG
  COMMON / FQB / C, CX, CY, D, DX, DY, E, EX, EY, F, FX, FY
  *****
C   PARABOLOID
C   *****
C   X = S * Y * Y EQUATION OF PARABOLIC MERIDIAN
C   S=1.0/(4.0*R) WHERE R IS THE DISTANCE FROM VERTEX TO FOCUS
C   PROP(5) = R INPUT ON CARD G-2
C   PROP(3) AND PROP(4) ARE IN RADIANs FOR THIS EXAMPLE
  S = 1.0 / (4.0 * PROP(5))
  X = X + PROP(1)
  Y = Y + PROP(3)
  XG = X
  YG = SQRT(X/S) * SIN(Y)
  ZG = SQRT(X/S) * COS(Y)
  T = 0.25 / (X * S)
  A = SQRT(1.0 + T)
  B = SQRT(X / S)
  A1 = SQRT(S * X * (1.0 + 4.0 * S * X))
  AX = -0.25 / (X * A1)
  BX = 0.5 / SQRT(S * X)
  D = -T / (A * B)
  F = -X / (S * A * B)
  DX = ((AX * B + BX * A) * X + A * B) / (4.0 * S * A * A *
1      B * B * X * X)
  FX = -(A * B - (AX * B + BX * A) * X) / (S * A * A * B * B)
  RETURN
END

```

Table 5

SUBROUTINE UNORTH

```

SUBROUTINE UNORTH (PROP, X, Y)
  DIMENSION PROP(3)
  PROP(1) = X COORDINATE OF BOUNDARY LINE 1
  PROP(2) = X COORDINATE OF BOUNDARY LINE 3
  PROP(3) = Y COORDINATE OF BOUNDARY LINE 4
  PROP(4) = Y COORDINATE OF BOUNDARY LINE 2
  COMMON / FQA / NSHELL, A, B, AX, AY, BX, BY, XG, YG, ZG
  COMMON / FQB / C, CX, CY, D, DX, DY, E, EX, EY, F, FX, FY
  *****
  ELLIPTICAL CONE
  *****
  X = W * S * COS(T), Y = V * S * SIN(T), Z = S
  W = PROP(5), SEMI-MAJOR AXIS WHEN S = 1, INPUT ON CARD G-2
  V = PROP(6), SEMI-MINOR AXIS WHEN S = 1, INPUT ON CARD G-2
  T IS ANGLE IN ELLIPTICAL COORDINATES, RADIANS
  PROP(3) AND PROP(4) ARE IN RADIANS FOR THIS EXAMPLE

  X = X + PROP(1)
  Y1 = Y + PROP(3)
  XG = W * X * COS(Y1)
  YG = V * X * SIN(Y1)
  ZG = X
  T1 = ATAN((PROP(5) / PROP(6)) * TAN(Y1))
  W2 = PROP(5) * PROP(5)
  V2 = PROP(6) * PROP(6)
  WV = PROP(5) * PROP(6)
  SH = SIN(T1)
  CH = COS(T1)
  SH2 = SH * SH
  CH2 = CH * CH
  A = SQRT(1.0 + W2 * CH2 + V2 * SH2)
  B = X * SQRT(W2 * SH2 + V2 * CH2)
  C = -X * (W2 - V2) * SH * CH
  AY = -(W2 - V2) * SH * CH / A
  BX = B / X
  BY = X * X * SH * CH * (W2 - V2) / B
  CX = C / X
  CY = -X * (W2 - V2) * (CH2 - SH2)
  H = X * SQRT(W2 * SH2 + V2 * CH2 + W2 * V2)
  F = WV * X * X / H
  FX = F / X
  FY = -WV * X * SH * CH * (W2 - V2) * (X / H)**3
  RETURN
  END

```

Table 6

SUBROUTINE TEMP

```

SUBROUTINE TEMP (X,Y,T,AP1,AP2)
T=0.0
* { T=50.*(1.-.4*COS(Y*3.14159/130.))
  AP1=.00001
  AP2=.10001
  RETURN
END

```

Table 7
SUBROUTINE WALL

```

SUBROUTINE WALL (X, Y, CCC)
DIMENSION CCC(6,6)
COMMON / OFST / TD, Z

Z = DISTANCE FROM REFERENCE SURFACE TO MID SURFACE OF SHELL
WALL

TD = TOTAL THICKNESS OF SHELL WALL

      C F B 2
COMMON / MONO / AT, EX1, XN1, EY1, G

      C F B 3
COMMON / SKEW / E3, U3, T3, TH, A, B, M3, AK3

      C F B 4
COMMON / FIBR / EF, EM, UF, UM, LAYERS, TT(20), XX(20), BE(20), O(20)

      C F B 5
COMMON / LAYD1 / TL(20), EX5(20), EY5(20), UXY(20), G5(20), LAYS

      C F B 6
COMMON / CORR / CT6, E6, U6, CC6, CM6, CD6, CB6

      C F B 7
COMMON / CORS / CT7, E7, U7, CC7, CH7, CD7, CB7, ES, US, TS, PHI, ANG

      OPTION A
      GENERATES A 6*6 MATRIX CCC ACCORDING TO SHELL WALL
CONSTRUCTION. SET Z AND COMMON VARIABLES FOR CFBN. THEN
CALL CFB(N).

      OPTION B
      SET Z, TD, AND THE 6*6 MATRIX CCC.

```

Table 7 (Cont.)

```


C      SMEARED STIFFENERS
C      COMMON /SHEAR/ E1,U1,OI1,O1,AK1,T1,H1,A1,SI1,S1,EX11,
1      E2,U2,OI2,D2,AK2,T2,H2,A2,SI2,S2,EX22
C
C      WHEN INALL=1, SMEARED STIFFENERS MAY NOT BE SPECIFIED
C      BY INPUT CARDS (NSTRI AND NRING MUST BE ZERO ON M-1 CARD).
C      HOWEVER, SMEARED STIFFENERS MAY BE SPECIFIED AFTER USE OF
C      EITHER OPTION A OR OPTION B IN SUBROUTINE WALL. SET
C      VARIABLES IN COMMON BLOCK /SHEAR/ (SEE N-1 TO N-48 CARDS
C      IN SECTION 6), THEN CALL STIFF (STIFF ADDS STIFFNESS OF
C      SMEARED STIFFENERS TO CCC MATRIX).
C
C      * { EXAMPLE UTILIZING OPTION A.
C
C      PI = 3.14159
C      IF (X .LT. PI / 4.0) GO TO 10
C      CT7 = 0.05
C      E7 = 10000000.0
C      U7 = 0.3
C      CC7 = 0.4
C      CM7 = 0.5
C      CD7 = 0.4
C      CB7 = 2.0
C      Z = 0.275
C      TS = 0.05
C      ES = 10000000.0
C      JS = 0.3
C      PHI = 0.5
C      ANC = 1.0
C      CALL CF8(7)
C      GO TO 20
C 10  AT = 0.1
C      EX1 = 10000000.0
C      XN1 = 0.3
C      Z = 0.05
C      EY1 = 10000000.0
C      G = EX1 / (2.0 * (1.0 + XN1))
C      E1 = 10000000.0
C      U1 = 0.3
C      OI1 = 0.0
C      F = PI / 4.0 - X / 10.0
C      R1 = 10.0 * COS(F)
C      D1 = PI * R1 / 20.0
C      AK1 = 1.0
C      T1 = 0.2
C      H1 = 2.4 * X / PI
C      CALL CF8(2)
C      CALL STIFF
C 20  CONTINUE
C      RETURN
C      END

```

Section 6

INPUT DESCRIPTION

There are two main branches of the program, one with and one without plasticity. The plasticity branch cannot be used with variable material properties and is restricted to isotropic wall construction. Figure 6-1 shows the data deck format. Table 8 is a minimanual summarizing the input cards. Figure 6-2 shows the sign convention for stress and moment resultants.

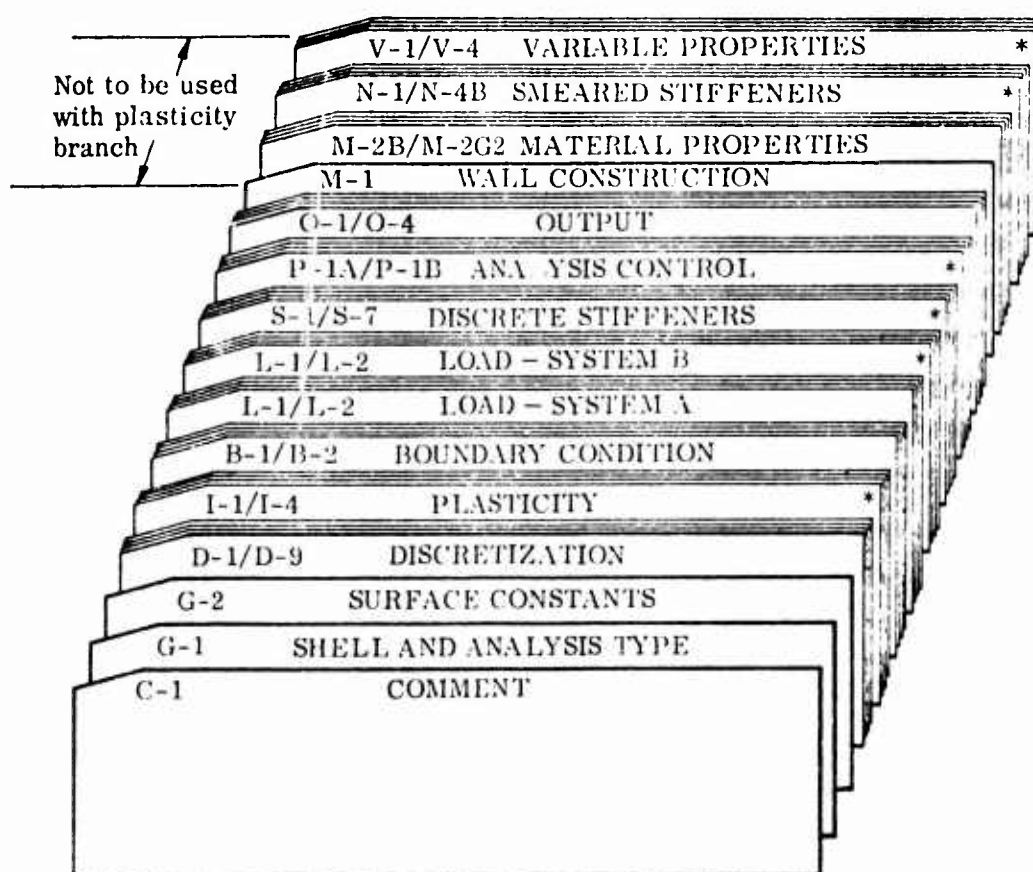

*Not always required

Fig. 6-1 STAGS Program - Data Deck Format

Table 8

STAGS PROGRAM MINIMANUAL

INPUT DESCRIPTION

Item	Symbol	Format
C-1	COMENT (I), I=1, 12	12A6
G-1	NSHELL, INDIC, NLOAD, NCHK	4I5
G-2	PROP(I), I=1, 8	8E10.6
D-1	NR, NC, NRW1, NRW2, NCL1, NSTFF (INCLUDE ITEMS D-2 TO D-4 ONLY IF NR.EQ.0)	6I5
D-2	NNX	I5
D-3	SEGLX(I), I=1, NNX	8E10.6
D-4	NSEGX(I), I=1, NNX (INCLUDE ITEMS D-5 TO D-7 ONLY IF NC.EQ.0)	16I5
D-5	NNY	I5
D-6	SEGLY(J), J=1, NNY	8E10.6
D-7	NSEGY(J), J=1, NNY (INCLUDE ITEM D-8 ONLY IF NR.LT.0)	16I5
D-8	X(I), I=1, NR (INCLUDE ITEM D-9 ONLY IF NC.LT.0)	8E10.6
D-9	Y(J), J=1, NC (INCLUDE ITEMS I-1 TO I-4 ONLY IF INDIC.EQ.3)	8E10.6
I-1	AE, XNU, AT, AK2	4 E10.6
I-2	NL, IC	2I5
I-3	S(I), I=1, IC	8E10.6
I-4	E(I), I=1, IC	8E10.6
B-1	IBLN(I), I=1, 4 (INCLUDE ITEM B-2 ONLY IF IBLN(I).EQ.0)	4I5
B-2	ICOND(I), I=1, 4	4I5
L-1	NN(K), LFLG(K), STLD(K), LSTP(K), MXL(K)	2I5, 3E10.6
L-2	PZ, PY, PX, JZ, JY, JX, L, M (REPEAT ITEM L-2 NN TIMES) (REPEAT ITEMS L-1 AND L-2 FOR K=1, 2) (IF NO DISCRETE STIFFENERS ARE PRESENT, GO TO P-1A CARD FOR BIFURCATION, P-1B CARD FOR NONLINEAR, AND O-1 CARD FOR LINEAR STRESS ANALYSIS)	3E10.6, 5I5
S-1	IRGS, ITRN, IRSO, ISTR, ITSN, ISSO (INCLUDE ITEMS S-2 TO S-4 ONLY IF IRGS.GT.0)	6I5
S-2	IRN(I), IRTP(I), IRNA(I), IRNB(I), XRN(I), Y1RN(I), Y2RN(I) (REPEAT ITEM S-2 FOR I=1, IRGS)	4I5, 3E10.6
S-3	ERN(J), ZARN(J), ZIXRN(J), ZIZRN(J), ZJRN(J), EZRN(J), ZK1 (REPEAT ITEM S-3 FOR J=1, ITRN) (INCLUDE ITEM S-4 ONLY IF IRSO.GT.0)	7E10.6
S-4	Z1, X1, Z2, X2, Z3, X3, Z4, X4 (REPEAT ITEM S-4 FOR J=1, ITRN) (INCLUDE ITEMS S-5 TO S-7 ONLY IF ISTR.GT.0)	8E10.6

Table 8 (Cont.)

Item	Symbol	Format
S-5	ISN(I), ISTR(I), ISTA(I), ISTB(I), YSN(I), X1SN(I), X2SN(I) (REPEAT ITEM S-5 FOR I=1, ISTR)	4I5, 3E10.6
S-6	ESN(J), XASN(J), XIYSN(J), XIZSN(J), XJSN(J), EZSN(J), XK1 (REPEAT ITEM S-6 FOR J=1, ITSN) (INCLUDE ITEM S-7 ONLY IF ISSO.GT.0)	7E10.6
S-7	Z1, Y1, Z2, Y2, Z3, Y3, Z4, Y4 (REPEAT ITEM S-7 FOR J=1, ITSN) (INCLUDE ITEMS P-1A TO P-1A2 ONLY FOR BIFURCATION ANALYSIS)	8E10.6
P-1A	DELBI, SHIFT, IBOND, ISHIFT, ITERAT (INCLUDE ITEM P-1A1 ONLY IF IBOND.EQ.1)	2E10.6, 3I5
P-1A1	JBLN(I), I=1, 4	4I5
P-1A2	JCOND(I), I=1, 4 (INCLUDE ITEM P-1B ONLY FOR NONLINEAR ANALYSIS)	4I5
P-1B	DELX, WUND, ISTART, ISEC, ICUT, INEWT, ISTRAT	2E10.6, 5I5
O-1	IPR1, IPR2, IPR3, IPX, IPY, IPRD, IPRS, IPLOT, IHIST (INCLUDE ITEM O-2 ONLY IF IPX.GT.0)	9I5
O-2	XPL(I), I=1, IPX (INCLUDE ITEM O-3 ONLY IF IPY.GT.0)	8E10.6
O-3	YPL(I), I=1, IPY (INCLUDE ITEM O-4 ONLY IF IHIST. GT.0)	8E10.6
O-4	X1, Y1, X2, Y2, X3, Y3, X4, Y4 (IF INDIC. EQ. 3 NO MORE CARDS ARE REQUIRED)	8E10.6
M-1	IWALL, NSTRI, NRING, IP, IM, JM (INCLUDE ITEM M-2B ONLY IF IWALL.EQ.2)	6I5
M-2B	AT, EX1, XNU, Z, EY1, G (INCLUDE ITEMS M-2C1 AND M-2C2 ONLY IF IWALL.EQ.3)	6E10.6
M-2C1	T3, E3, U3, TH, A, B, H3, AK3	8E10.6
M-2C2	Z (INCLUDE ITEMS M-2D1 AND M-2D2 ONLY IF IWALL.EQ.4)	E10.6
M-2D1	EF, EM, UF, UM, Z, LAYERS	5E10.6, I5
M-2D2	TT(J), XX(J), BE(J), O(J) (REPEAT ITEM M-2D2 FOR J=1, LAYERS) (INCLUDE ITEMS M-2E1 AND M-2E2 ONLY IF IWALL.EQ.5)	4E10.6
M-2E1	Z, LAYS	E10.6, I5
M-2E2	TL(J), EX5(J), EY5(J), UXY(J), G5(J) (REPEAT ITEM M-2E2 FOR J=1, LAYS) (INCLUDE ITEM M-2F ONLY IF IWALL.EQ.6)	5E10.6
M-2F	CT6, E6, U6, CC6, CH6, CD6, CB6, Z (INCLUDE ITEMS M-2G1 AND M-2G2 ONLY IF IWALL.EQ.7)	8E10.6
M-2G1	CT7, E7, U7, CC7, CH7, CD7, CB7, Z	8E10.6

Table 8 (Cont.)

Item	Symbol	Format
M-2G2	TS, ES, US, PHI, ANC (INCLUDE ITEMS N-1 TO N-2B ONLY IF NSTRI. EQ. 1)	5E10.6
N-1	E1, U1, OI1, D1, AK1 (INCLUDE ITEM N-2A ONLY IF OI1. EQ. 0)	5E10.6
N-2A	T1, H1 (INCLUDE ITEM N-2B ONLY IF OI1. EQ. 1)	2E10.6
N-2B	A1, SI1, XI1, S1, EZ1, H1 (INCLUDE ITEMS N-3 TO N-4B ONLY IF NRING. EQ. 1)	6E10.6
N-3	E2, U2, OI2, D2, AK2 (INCLUDE ITEM N-4A ONLY IF OI2. EQ. 0)	5E10.6
N-4A	T2, H2 (INCLUDE ITEM N-4B ONLY IF OI2. EQ. 1)	2E10.6
N-4B	A2, SI2, XI2, S2, EZ2, H2 (INCLUDE ITEMS V-1 TO V-4 ONLY IF IWALL. EQ. 9)	6E10.6
V-1	TD, Z	2E10.6
V-2	XM(I), I=1, IM	8E10.6
V-3	YM(J), J=1, JM	8E10.6
V-4	((TDEG(L, M, N), EX(L, M, N), EY(L, M, N), U(L, M, N), G(L, M, N,), A1(L, M, N), A2(L, M, N), L=1, IP), M=1, MSTA) WHERE MSTA=IM IF NC.GT.NR, ELSE MSTA=JM. (REPEAT ITEM V-4 FOR N=1, NSTA, WHERE NSTA=JM IF NC.GT.NR, ELSE NSTA=IM)	7E10.6

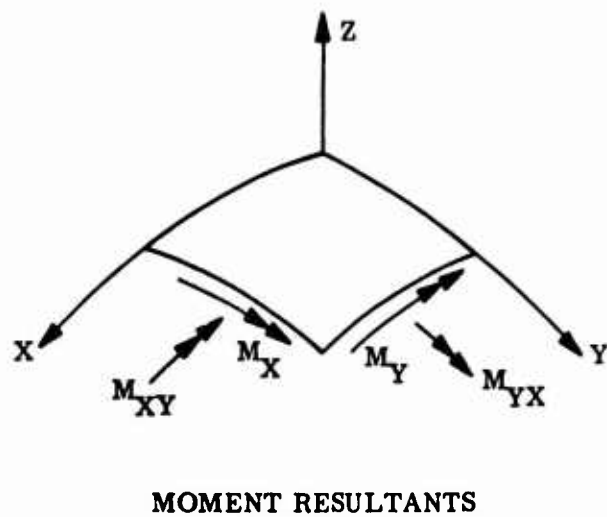
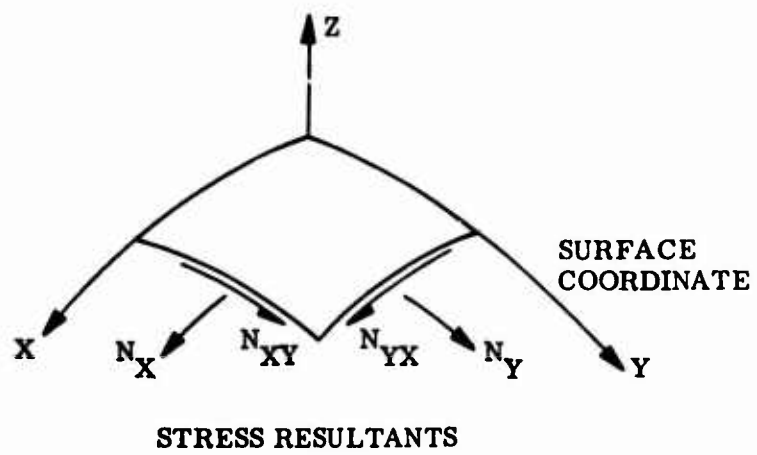


Fig. 6-2 Sign Convention for Stress and Moment Resultants

C-1 Comment Card

The Comment or Case Title card may contain any Hollerith Text. This comment is printed at the beginning of the output for the case.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
COMENT	12A6	1-72	Case Title

GEOMETRY

G-1 Shell and Analysis Type Definition Card

The card is used to define the surface type of the shell by a single integer entry. It also serves to indicate the type of analysis desired.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NSHELL	I5	1-5	Shell type may vary from 1 through N as described under G-2 card. NSHELL = 1, Cylinder 2, Cone/Annular Plate 3, Plate 4, Sphere 5, Paraboloid 6, Elliptic Cylinder 7, Ellipsoid 8, Torus 9, Hyperboloid 10, Elliptic Cone 11, 12, User written subroutine
INDIC	I5	6-10	0 - Linear solution only 1 - Bifurcation analysis 2 - Nonlinear analysis (elastic) 3 - Nonlinear analysis (plastic)
NLOAD	I5	11-15	Number of load systems to be applied independently (presently NLOAD is restricted to 1 or 2) (Section 3.7, Loading). Note: Load cards for system B omitted if NLOAD = 1.
NCHK	I5	16-20	0 - Execute (no 3D plot) 1 - Do not execute. Provide input data check and 3D plot 2 - Execute and provide 3D plot

G-2 Surface Constants Card

This card will contain the various measurements related to the particular type of surface defined by the NSHELL integer on the G-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
PROP (I)	8E 10.6	1-80	Surface properties depending on NSHELL (Fig. 6-3). All angles in degrees for NSHELL less than 11. See Table 4, p. 5-7, for definition of PROP (I) when NSHELL greater than 10.

Note: X- ξ and Y- η coordinates designation are synonymous for all shell types.


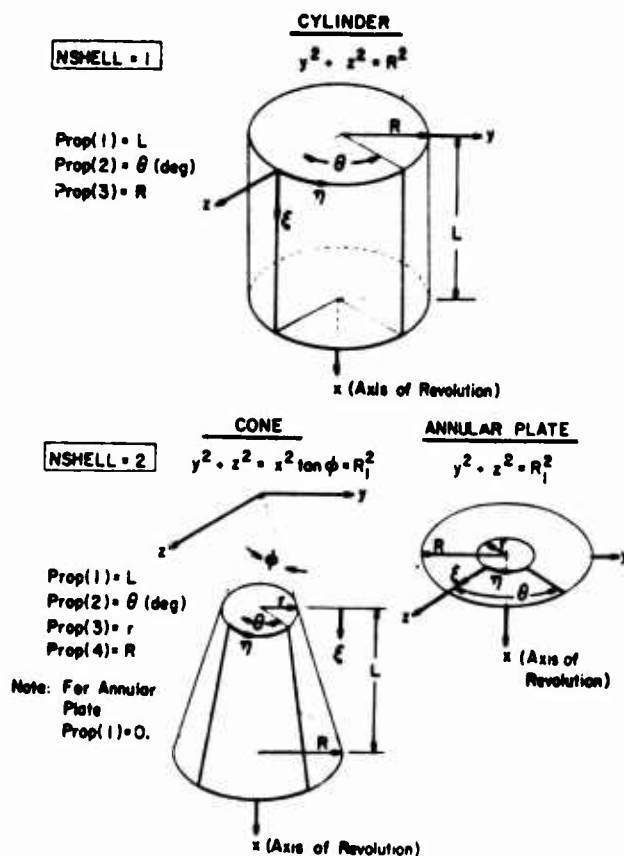


Fig. 6-3 Types of Shell Surfaces Defined by NSHELL Integer

NSHELL = 3

Prop(1) = L
Prop(2) = w

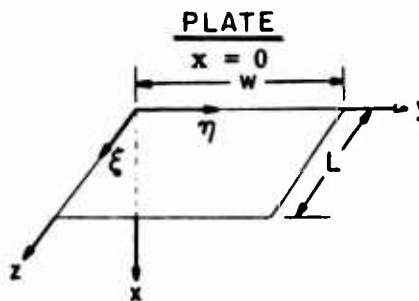


Note: x-y and X-Y are not synonymous. (See Nomenclature.)

SPHERE

NSHELL = 4

Prop(1) = ξ_L (deg)
Prop(2) = ξ_U (deg)
Prop(3) = θ (deg)
Prop(4) = R

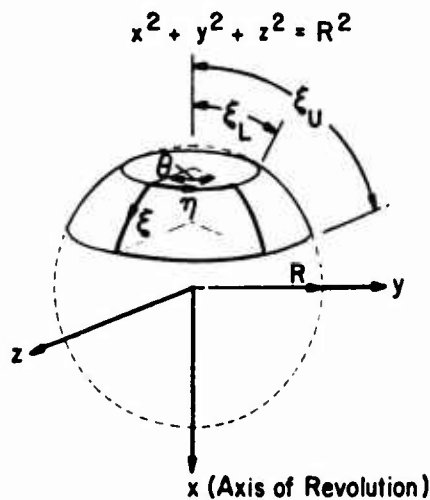

PARABLOID

NSHELL = 5

Prop(1) = L
Prop(2) = θ (deg)
Prop(3) = R
Prop(4) = R_1

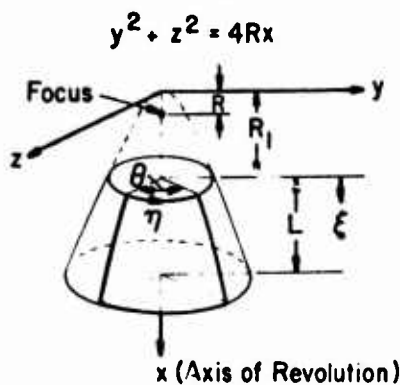



Fig. 6-3 (Cont.)

ELLIPTIC CYLINDER

NSHELL = 6

$$\frac{y^2}{R_y^2} + \frac{z^2}{R_z^2} = 1$$

- Prop(1) = L
- Prop(2) = θ_L (deg)
- Prop(3) = θ_U (deg)
- Prop(4) = R_z
- Prop(5) = R_y

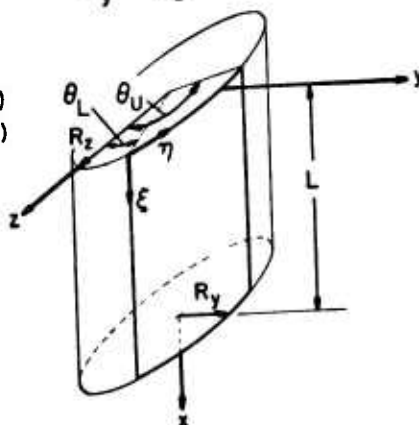


ELLIPSOID

NSHELL = 7

$$\frac{x^2}{R_x^2} + \frac{y^2}{R_y^2} + \frac{z^2}{R_z^2} = 1$$

- Prop(1) = ξ_L (deg)
- Prop(2) = ξ_U (deg)
- Prop(3) = θ (deg)
- Prop(4) = R_y
- Prop(5) = R_x

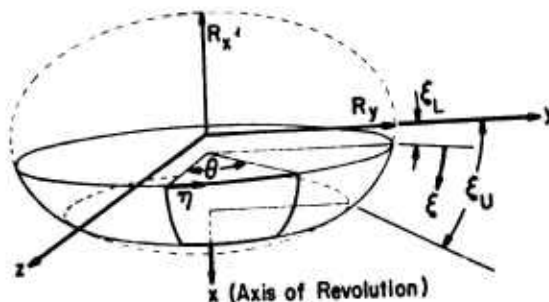

TORUS

NSHELL = 8

- Prop(1) = ξ_L (deg)
- Prop(2) = ξ_U (deg)
- Prop(3) = θ (deg)
- Prop(4) = R
- Prop(5) = R_1

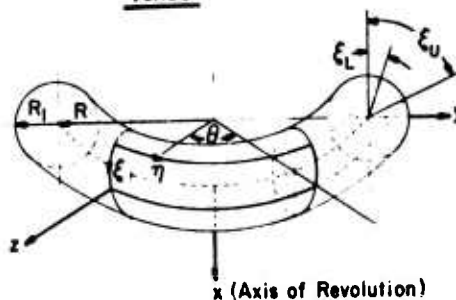



Fig. 6-3 (Cont.)

NSHELL = 9

HYPERBOLOID

$$-\frac{x^2}{R_1^2} + \frac{y^2}{R^2} + \frac{z^2}{R^2} = 1$$

Prop(1) = ξ_L (deg)
 Prop(2) = ξ_U (deg)
 Prop(3) = θ (deg)
 Prop(4) = R
 Prop(5) = R_1

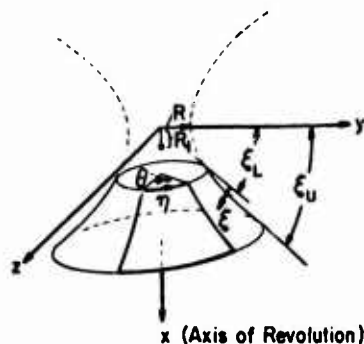

ELLIPTIC CONE

NSHELL = 10

Prop(1) = L
 Prop(2) = L_0
 Prop(3) = θ_L (deg)
 Prop(4) = θ_U (deg)
 Prop(5) = R_z
 Prop(6) = R_y

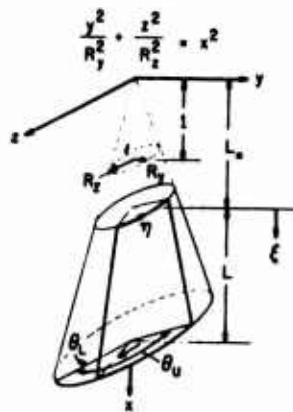


Fig. 6-3 (Cont.)


NSHELL = 11

User supplied subroutine (ORTH) for shells described by orthogonal surface coordinate lines and not included in NSHELL = 1 through 10 (see Section 5.4).

NSHELL = 12

User supplied subroutine (UNORTH) for shells described by nonorthogonal surface coordinate lines and not included in NSHELL = 1 through 10 (see Section 5.5).

DISCRETIZATION

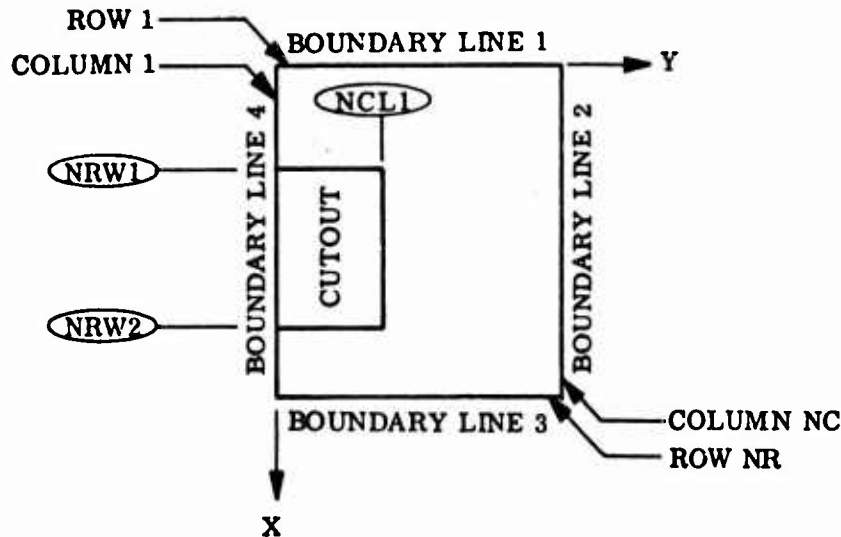

D-1 Mesh Definition Card

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NR	I5	1-5	Number of rows (Stations along the X coordinate). If NR negative, spacing is variable, read in X coordinates on Card D-8. If NR = 0, spacing is constant within each of a number of segments but varies from one segment to another (see D-2 card).
NC	I5	6-10	Number of columns (Stations along the Y coordinate). If NC negative, spacing is variable, read in Y coordinates on Card D-9. If NC = 0, spacing is constant within each of a number of segments but varies from one segment to another. (See D-5 card.)
NRW1	I5	11-15	Row number of one edge of cutout.
NRW2	I5	16-20	Row number of other edge of cutout.
NCL1	I5	21-25	Column number of edge of cutout.
NSTFF	I5	26-30	0 - No discrete stiffeners 1 - Discrete stiffeners (input data on S-1 card)

(This card continued next page.)

Note:

NRW1, NRW2, and NCL1 define a rectangular cutout adjacent to boundary line 4. In the case of no cutout, NRW1, NRW2, and NCL1 should be blank. Additional cutouts or cutouts of more general shape can be included through specification of a zero modulus of elasticity in the appropriate area (use IWALL = 1 on M-1 card).

If NR and NC are positive numbers, omit cards D-2 through D-9.

D-2 X-Segment Card

This card should be included only if NR is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NNX	I5	1-5	Number of segments in X direction with constant spacing.

D-3 X-Segment Length Definition Cards

These cards should be included only if NR is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
SEGLX(I) I = 1, NNX	8E 10.6	1-80	"Length" of Segment I, (i.e., difference between extreme values of X coordinate).

D-4 X-Segment Spacing Definition Cards

These cards should be included only if NR is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NSEGX(I) I = 1, NNX	16 I5	1-80	Number of mesh spaces within Segment I.

D-5 Y-Segment Card

This card should be included only if NC is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NNY	I5	1-5	Number of segments in Y direction with constant spacing.

D-6 Y-Segment Length Definition Cards

These cards should be included only if NC is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
SEGLY(J) J = 1, NNY	8E 10.6	1-80	"Length" of Segment J (i. e., difference between extreme values of Y coordinate).

D-7 Y-Segment Spacing Definition Cards

These cards should be included only if NC is zero on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NSEGY(J) J = 1, NNY	16 I5	1-80	Number of mesh spaces within Segment J.

Unless NR or NC is negative, omit D-8 and D-9 cards.

D-8 X-Coordinate Cards

These cards should be included only if NR is negative on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
X(I) (I = 1, NR)	8E 10.6	1-80	X coordinate for Row I (Must be monotonically increasing)

D-9 Y-Coordinate Cards

These cards should be included only if NC is negative on the D-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
Y(J) (J = 1, NC)	8E 10.6	1-80	Y coordinate for Column J (Must be monotonically increasing)

Note:

Unless the plasticity branch is used, omit cards I-1 through I-4, and go to the B-1 card.

PLASTICITY

Cards I-1 through I-4 are used only for the plasticity branch, i. e., INDIC = 3 on the G-1 card. For the elastic branch, go to the B-1 card.

I-1 Plasticity Definition Card-1

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
AE	E 10. 6	1-10	Young's Modulus
XNU	E 10. 6	11-20	Poisson's Ratio
AT	E 10. 6	21-30	Shell Thickness
AK2	E 10. 6	31-40	Square of the ellipse-ratio of yield surface. Usually AK2 = 3.0

If the elastic branch is used, corresponding information is read at a different place.

I-2 Plasticity Definition Card-2

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	
NL	I5	1-5	Number of points across wall thickness. Must be odd number and not less than 3 or more than 9.
IC	I5	6-10	Number of material components (Number of points defined on the stress-strain curve). (Fig. 6-4) $IC \leq 10$

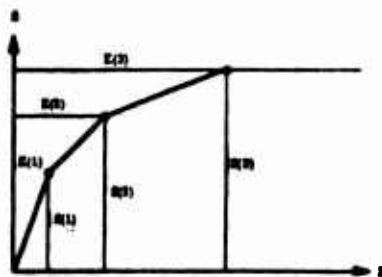


Fig. 6-4 Stress-Strain Curve

I-3 Plasticity Definition Card-3

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
S(I) I = 1, IC	E 10. 6	1-80	Stress values on the stress-strain curve. See Fig. 6-4.

I-4 Plasticity Definition Card-4

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
E(I) I = 1, IC	E 10. 6	1-80	Corresponding strain values on the stress-strain curve. See Fig. 6-4.

Note: E(1) need not be punched. It will be computed by the program as

$$E(1) = S(1)/AE$$


BOUNDARY CONDITION

B-1 Boundary Condition Card-1

Do not specify loads and displacements which are in conflict, such as simple support and specified tangential displacement.

For bifurcation buckling (INDIC = 1), the conditions defined here will apply to the pre-buckling displacements. If the boundary conditions for incremental displacement are different, they will be specified on the P-1A, P-1A1, and P-1A2 cards below.

Boundary lines are numbered 1 through 4 according to the following convention:

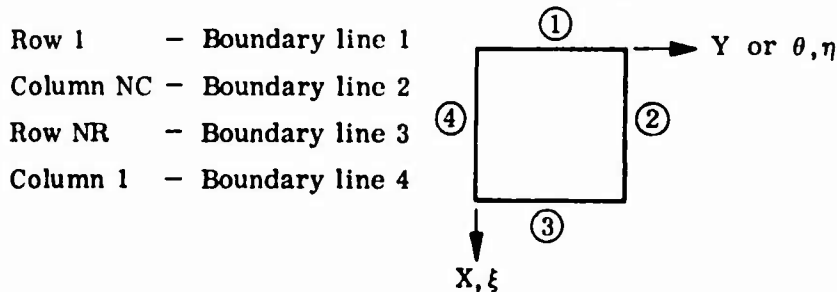

Note: Side 1 $X = 0$, Side 4 $Y = 0$.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IBLN(I) I = 1, 4	4 I5	1-20	Boundary code for Line I. 0 - Specified on B-2 cards 1 - Simple support (defined below) 2 - Clamped (defined below) 3 - Unrestrained 4 - Symmetry (defined below) 5 - Anti-symmetry (defined below) 6 - Closed shell in the η direction (see comment below and pages 2-2 and 2-3).

Here simple support means $w = v = 0$ on lines 1 and 3
 $w = u = 0$ on lines 2 and 4

(This card continued next page.)

clamped means that all displacements and rotations are restrained and cannot be used for loaded edge


Symmetry implies $u = \beta = 0$ on lines 1 and 3
 $v = \beta = 0$ on lines 2 and 4

Antisymmetry implies $v = w = u_{,x} = 0$ on lines 1 and 3
 $u = w = v_{,y} = 0$ on lines 2 and 4

The option $IBLN = 6$ indicates a closed shell. In that case, set $IBLN(2) = IBLN(4) = 6$. Do not set $IBLN(1)$ and $IBLN(3)$ equal to six. Boundary lines of zero length (e.g., apex) have not been incorporated in the program.

B-2 Boundary Condition Cards. Use only if $IBLN(I) = 0$ on the B-1 card. One B-2 card for each I with $IBLN = 0$. The cards refer to boundary lines with increasing numbers.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
ICOND(J) J = 1, 4	4 I5	1 - 20	Freedom of movement of Line I in regard to the w, v, u, and β displacements, where w, v, and u are displacements in the direction of the coordinates Z, Y, and X, respectively, and β is the rotation around a tangent to the edge 1 - Free to move 0 - No movement

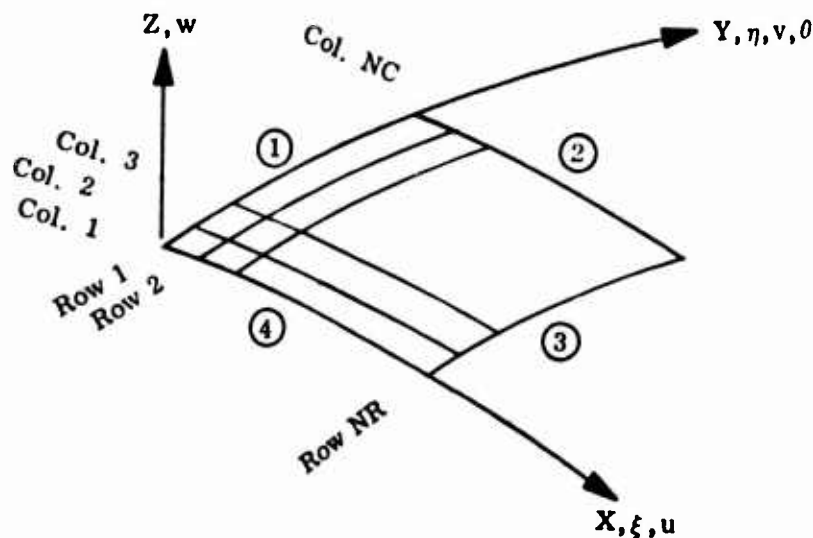

LOADS

A Load System is defined by an L-1 card followed by the appropriate L-2 cards. If NLOAD on the G-1 card is 2, two Load Systems are required - one for Load System A and another for Load System B. The input data cards for Load System A must be completed before the input data cards for Load System B begin. The use of Load System B in bifurcation analysis is explained in Section 3.7, Loading.

A base load for each Load System is defined by the set of L-2 cards together with any loads that may be introduced by a user-written subroutine (USRLD). STLD, LSTP, and MXL refer to the base load of the system.

L-1 Card

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NN	I5	1 - 5	Number of L-2 cards required to describe the Load System.
LFLG	I5	6 - 10	User-Load Flag. 0 - User does not have own subroutine to define Load System. 1 - User has own subroutine to define Load System.
STLD	E 10.6	11 - 20	Starting Load Factor. (The initial load is STLD times the base load.) For nonlinear analysis, STLD is the current starting Load Factor. (See sample case 1 Second Run, Page 7-10). For linear analysis, the total load equals the initial load. For bifurcation analysis, the critical load is the eigenvalue times the initial load.
LSTP	E 10.6	21 - 30	Load Step Increment. (The load increment is LSTP times the base load.) Meaningful only for nonlinear analysis.
MXL	E 10.6	31 - 40	Maximum Load. (The maximum load is MXL times the base load.) Meaningful only for nonlinear analysis. May be used to freeze either Load System A or Load System B.

L-2 Cards

Do not prescribe loads and displacements on the same L-2 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
PZ, PY, PX	3 E 10.6	1 - 30	Load Element. (Positive outward and toward increasing X and Y.)
JZ, JY, JX	3 I5	31 - 45	Refer to PZ, PY, and PX, respectively -1 - Displacement 0 - Omit 1 - Point Force 2 - Line Load along Row 3 - Line Load along Column 4 - Pressure Load 5 - Live Pressure Load (Use only for $L = M = 0$.)
L, M	2 I5	46 - 55	Row and Column number of the mesh-point where the particular load element is applied.

Note:

When the row number is entered as zero, the load element is assumed to act at every mesh-point on the column indicated by the column number. If the column number is entered as zero, the load element is assumed to act at every mesh-point on the row indicated by the row number. If both row and column numbers are zero, then the load element is assumed to act at each mesh-point.

For inplane displacements, only uniform displacement of one of the four boundary lines may be prescribed. That is, either L or M must be zero.

The energy method on which the program is based assumes that loads and structure comprise a conservative system. Because there is some controversy about the requirements for a system with variable load to be conservative, the live load option is internally suppressed unless the pressure is uniform.

Here follows L-1 and L-2 cards for Load System B if NLOAD (G-1 card) is equal to 2.

DISCRETE STIFFENERS

S-1 Discrete Stiffener Definition Card (Ring is defined as a stiffener on constant X-coordinate; stringer is defined as a stiffener on constant Y-coordinate.) Note that "smeared" stiffener can be defined in lieu of or in addition to the discrete stiffeners (N-1 through N-4B cards below).

Note:

If no discrete stiffeners are present, NSTFF equal zero on D-1 card; go to the P-1A card for bifurcation analysis, to P-1B card for nonlinear analysis, and to the O-1 card for linear stress analysis.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IRGS	I5	1-5	Number of rings, $IRGS \leq 80$
ITRN	I5	6-10	Number of distinct type of rings. $ITRN \leq 30$
IRSO	I5	11-15	Stress output will be given at IRSO points in the ring cross-section. $IRSO \leq 4$
ISTR	I5	16-20	Number of stringers. $ISTR \leq 80$
ITSN	I5	21-25	Number of distinct type of stringers. $ITSN \leq 30$
ISSO	I5	26-30	Stress output will be given at ISSO points in the stringer cross-section. $ISSO \leq 4$

If there are no rings ($IRGS = 0$), go to the S-5 card.

S-2 Ring Delimiter Cards

Include these cards only if IRGS on Card S-1 is not 0.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IRN(I)	I5	1-5	Row number of ring
IRTP(I)	I5	6-10	Ring type
IRNA(I)	I5	11-15	Starting column of ring

(This card continued next page.)


<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IRNB(I)	I5	16-20	Ending column of ring. (If IRN, IRNA, and IRNB are set equal to zero, the position of the ring is given by coordinate values rather than by row and column numbers)
XRN(I)	E 10.6	21-30	X coordinate of ring
Y1RN(I)	E 10.6	31-40	Y coordinate of start of ring
Y2RN(I)	E 10.6	41-50	Y coordinate of end of ring

Notes:

1. XRN, Y1RN, and Y2RN are optional data elements and will be used to define ring location only if IRN, IRNA, and IRNB are zero, respectively.
2. If XRN, Y1RN, and Y2RN do not coincide with a grid line, the ring will be placed (by the program) at the closest grid line.
3. Repeat this card for $I = 1, \text{IRGS}$.

S-3 Ring Description Cards

Include these cards only if IRGS card S-1 is not zero. Card format is 8E 10.6. One card is required for each ring type (ITRN cards).

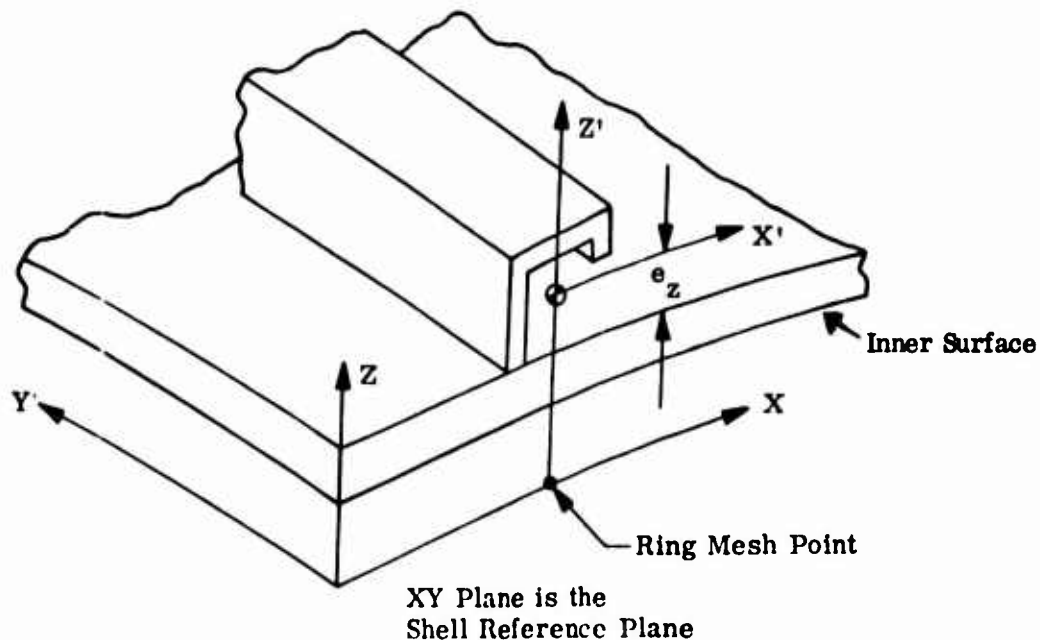

(This card continued next page.)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
ERN(J)	E 10.6	1-10	Young's Modulus for ring type J.
ZARN(J)	E 10.6	11-20	Cross-Section Area for ring type J.
ZIXRN(J)	E 10.6	21-30	Moment of Inertia about X'-axis for ring type J.
ZIZRN(J)	E 10.6	31-40	Moment of Inertia about Z'-axis for ring type J.
ZJRN(J)	E 10.6	41-50	Torsional stiffness GJ for ring type J
EZRN(J)	E 10.6	51-60	Eccentricity in Z' direction for ring type J. Outside ring - distance from outer shell surface to ring centroid (positive in + Z direction). Inside ring - distance from inner shell surface to centroid (positive in - Z direction).
ZK1	E 10.6	61 - 70	0. - internal rings 1. - external rings

Note:

Repeat above data for J = 1, ITRN.

S-4 Ring Stress Output Card

Include these cards only if IRSO on Card S-1 is not 0.

<u>Variable</u>	<u>Format</u>	<u>Column</u>	<u>Description</u>
Z1	E 10.6	1-10	Z-coordinate for the first point with stress output.
X1	E 10.6	11-20	X'-coordinate for the same point.
Z2	E 10.6	21-30	Same information for other points with stress output. Read as many pairs of coordinates as indicated by IRSO on the S-1 card.
X2	E 10.6	31-40	
Z3	E 10.6	41-50	
X3	E 10.6	51-60	
Z4	E 10.6	61-70	
X4	E 10.6	71-80	

Note:

Repeat above data for each ring type, J = 1, ITRN.


S-5 Stringer Delimiter Cards

If there are no stringers ($ISTR = 0$), go to the P-1A card for bifurcation analysis, P-1B for nonlinear analysis and to the O-1 card for linear stress analysis.

Include these cards only if $ISTR$ on card S-1 is not 0.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
ISN(I)	I5	1-5	Column number of stringer
ISTP(I)	I5	6-10	Stringer type
ISTA(I)	I5	11-15	Starting row of stringer
ISTB(I)	I5	16-20	Ending row of stringer. (If ISN, ISTA, and ISTB are set equal to zero, the position of the stringer is given by coordinate values rather than by column and row numbers).
YSN(I)	E 10.6	21-30	Y coordinate of stringer
X1SN(I)	E 10.6	31-40	X coordinate of start of stringer
X2SN(I)	E 10.6	41-50	X coordinate of end of stringer

- NOTES:
1. YSN, X1SN, and X2SN are optional data elements and will be used to define stringer location only if ISN, ISTA, and ISTB are zero, respectively.
 2. If YSN, X1SN, and X2SN do not coincide with a grid line, the stringer will be placed (by the program) at the closest grid line.
 3. Repeat this card for $I = 1, ISTR$.

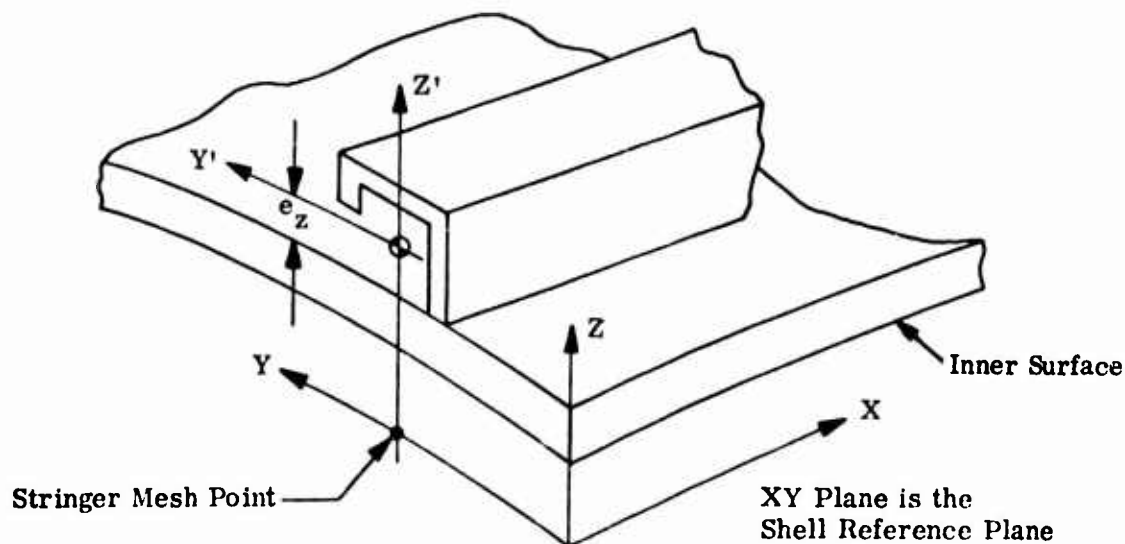

S-6 Stringer Description Cards

Include these cards only if ISTR on card S-1 is not zero. Card format is 8E10.6.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
ESN(J)	E 10.6	1-10	Young's Modulus for stringer type J.
XASN(J)	E 10.6	11-20	Cross-section Area for stringer type J.
XIYSN(J)	E 10.6	21-30	Moment of Inertia about Y'-axis for stringer type J.
XIZSN(J)	E 10.6	31-40	Moment of Inertia about Z'-axis for stringer type J.
XJSN(J)	E 10.6	41-50	Torsional stiffness GJ for stringer type J
EZSN(J)	E 10.6	51-60	Eccentricity in Z' direction for stringer type J. Outside stringer - distance from outer shell surface to stringer centroid (positive in +Z direction). Inside stringer - distance from inner shell surface to centroid (positive in -Z direction).
XK1	E 10.6	61-70	0. - internal stringers 1. - external stringers

Note:

Repeat above data for J = 1, ITSN.

S-7 Stringer Stress Output Card

Include these cards only if ISSO on card S-1 is not 0.

<u>Variable</u>	<u>Format</u>	<u>Column</u>	<u>Description</u>
Z1	E 10.6	1-10	Z-coordinate for the first point with stress output.
Y1	E 10.6	11-20	Y'-coordinate for the same point.

(This card continued next page.)

<u>Variable</u>	<u>Format</u>	<u>Column</u>	<u>Description</u>
Z2	E 10.6	21-30	Same information for other points with stress output. Read as many pairs of coordinates as indicated by ISSO on the S-1 card.
Y2	E 10.6	31-40	
Z3	E 10.6	41-50	
Y3	E 10.6	51-60	
Z4	E 10.6	61-70	
Y4	E 10.6	71-80	

Note:

Repeat above data for each stringer type, $J = 1$, ITSN.

For nonlinear analysis, go to the P-1B card; for linear stress analysis, go to the O-1 card.

ANALYSIS CONTROL

P-1A Parameter Card: Used for bifurcation analysis, INDIC = 1 on G-1 card.


<u>Variable</u>	<u>Format</u>	<u>Column</u>	<u>Description</u>
DELBIF	E 10.6	1-10	Error tolerance in power-iteration for eigenvalue. If DELBIF is zero or blank, the error tolerance .0001 is used.
SHIFT	E 10.6	11-20	Initial eigenvalue shift, if any.
IBOND	I5	21-25	1 - The boundary conditions for incremental displacements are different from the prebuckling displacements. 0 - The boundary conditions are the same for incremental and prebuckling displacements.
ISHIFT	I5	26-30	Number of eigenvalue shifts permitted.
ITERAT	I5	31-35	Number of inverse power iterations permitted between shifts.

If IBOND = 0, go the O-1 card.

P-1A1 Parameter Card: Incremental displacement boundary condition. Used for bifurcation analysis with different boundary conditions for incremental and prebuckling displacement (INDIC = 1 on G-1 card and IBOND = 1 on P-1A card).

Boundary lines are numbered 1 through 4 according to the following convention:

- Row 1 - Boundary line 1
- Column NC - Boundary line 2
- Row NR - Boundary line 3
- Column 1 - Boundary line 4

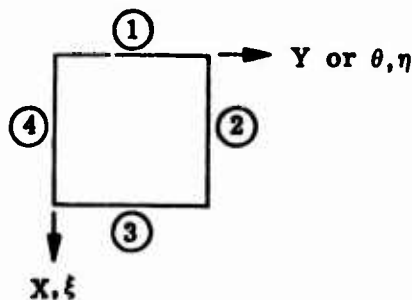


(This card continued next page.)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
JBLN(I) I = 1, 4	4 I5	1-20	Boundary code for Line I. 0 - Specified on P-1A2 cards 1 - Simple support 2 - Clamped 3 - Unrestrained 4 - Symmetry 5 - Anti-symmetry 6 - Closed shell

Note: See discussion of B-1 card. JBLN(I) = 6 only if IBLN(I) = 6.

P-1A2 Parameter Cards: Used only if JBLN(I) = 0 on the P-1A1 card. One P-1A2 card for each I with JBLN = 0. The cards refer to boundary lines with increasing numbers.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
JCOND(I) I = 1, 4	4 I5	1-20	Freedom of movement of Line I in regard to the w, v, u, and β displacements, where w, v, and u are displacements in the direction of the coordinates Z, Y, and X, respectively and β is the rotation around a tangent to the edge. 1 - Free to move 0 - No movement

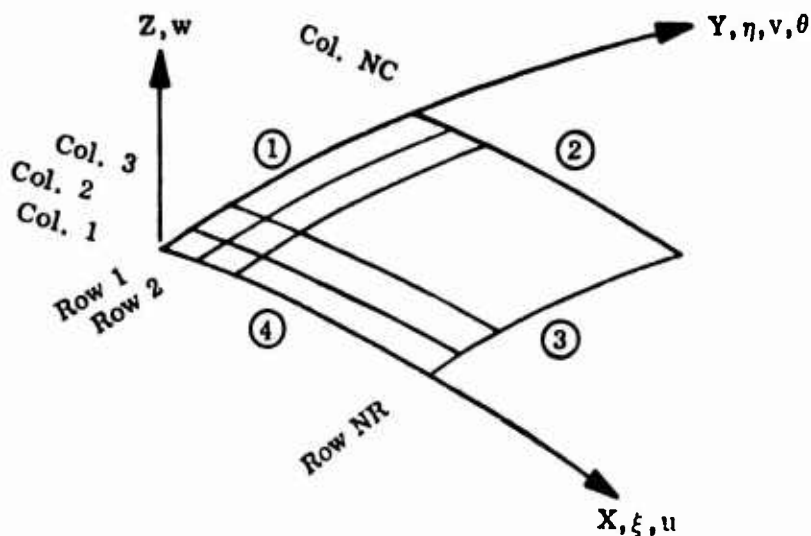

Go to the O-1 card.

P-1B Parameter Card; Used for nonlinear analysis, INDIC = 2 or 3 on G-1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
DELX	E 10.6	1-10	Error tolerance.
WUND	F 10.6	11-20	Underrelaxation factor.

Note: If DELX is zero or blank, the error tolerance .0001 is used. If WUND is zero or blank, the relaxation factor of 1.0 is used initially. The relaxation factor is increased internally if convergence is monotonic but slow, and it is decreased internally if convergence is highly oscillatory. If WUND $\neq$ 0, the input value remains unchanged regardless of convergence.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
ISTART	I5	21-25	Starting Code: (see also Section 7.1) 0 - Begin new case. 1 - Restart case from 1st record. 2 - Restart case from 2nd record. 3 - Restart from 3rd record Last load step. Note: For plasticity (INDIC=3) ISTART is either 0 or 3. ISTART 1 or 2 cannot be used.
ISEC	I5	26-30	Number of CPU seconds of run time at which run should be terminated and data saved on restart tape. (See Strategy, Section 4)
ICUT	I5	31-35	Total number of times step size may be cut. (See Strategy, Section 4).
INEWT	I5	36-40	Number of Newton steps which may be taken. (See Strategy, Section 4)
ISTRAT	I5	41-45	Number of times step size is cut between Newton steps. (See Strategy, Section 4)

OUTPUT

O-1 Output Definition Card

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IPR1	I5	1-5	Print displacement solutions every IPR1 load step. *
IPR2	I5	6-10	Print stress resultants every IPR2 load step. *
IPR3	I5	11-15	Print stresses every IPR3 load step. *

*Note: With IPR1, IPR2, or IPR3 equal zero corresponding output is suppressed. This option can be used also in the linear or bifurcation buckling case if one wants to suppress all regular output in favor of the selected output defined by IPX, IPY.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IPX	I5	16-20	Number of selected rows along which displacements and/or stress resultant solutions will be printed. $IPX \leq 50$
IPY	I5	21-25	Number of selected columns along which displacements and/or stress resultant solutions will be printed. $IPY \leq 50$
IPRD	I5	26-30	Print selected displacement solutions every IPRD load step.
IPRS	I5	31-35	Print selected stress resultant solutions every IPRS load step.
IPLOT	I5	36-40	See Section 8 for details. 0 - No plots. 1 - Plot and print special output (see notes below). Plot selected output (if any). 2 - Plot special output. Plot selected output (if any).
IHIST	I5	41-45	See Section 8 for details. The number of selected points for which history plots are required. If no history plots are required, set IHIST=0. $IHIST \leq 4$.

(This card continued next page.)

- Notes:**
1. Plot means data will be saved on special tape for use with postprocessor.
 2. Special output;
 If INDIC=0 (on the G-1 card) - All displacements and stress resultants.
 If INDIC=1 - All prebuckling displacements and stress resultants and all displacements in the buckling mode.
 If INDIC=2 or 3 - All displacements and stress resultants for the last load-step and the difference between the last two displacement solutions (collapse mode).
 3. For IPLOT=1 or 2 and INDIC=2 or 3, a history plot for the maximum displacement is provided in addition to IHIST plots.
 4. An effort was made to eliminate duplication of output printing.

O-2 Selected Output Along Rows

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
XPL(I) I = 1, IPX	8E 10.6	1-80	X coordinates of rows along which selected output is desired.

Note: Include these cards only if IPX on card O-1 greater than zero (selected output is requested). Card format is 8E 10.6, therefore more than one O-2 card might be necessary to input all X coordinates.

O-3 Selected Output Along Columns

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
YPL(I) I = 1, IPY	8E 10.6	1-80	Y coordinates of columns along which selected output is desired.

Note: Include these cards only if IPY on card O-1 greater than zero (selected output is requested). Card format is 8E 10.6, therefore more than one O-3 card might be necessary to input all Y coordinates.

O-4 Selected Points for History Plot

This card should be included only if IHIST on card O-1 is greater than zero.

The number of entries on this card will be equal to $2 \times \text{IHIST}$.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
X1	E10.6	1-10	X - Coordinate for first mesh point at which history data are saved.
Y1	E10.6	11-20	Y - Coordinate for first mesh point at which history data are saved.
X2	E10.6	21-30	
Y2	E10.6	31-40	
X3	E10.6	41-50	
Y3	E10.6	51-60	
X4	E10.6	61-70	
Y4	E10.6	71-80	

If the plasticity branch is used there are no additional cards to be read.

WALL CONSTRUCTION

M-1 Wall Type Card

Cards on which data are to be read for the different types of shell wall are given in parentheses.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IWALL	I5	1-5	1-A user-written subroutine, WALL, is going to be provided. (Except for the options under IWALL = 8 or 9, this is the only way to introduce variable properties). Notice that the subroutines corresponding to IWALL = 2 through 7 may be called from WALL. Input is complete. 2-Monocoque shell (may be orthotropic). (M-2B) 3-Skew-stiffened shell. (M-2C1, M-2C2) 4-Layered, fiber-wound shell. (M-2D1, M-2D2) 5-Layered shells, layers may be orthotropic. (M-2E1, M-2E2) 6-Corrugated shell. (M-2F) 7-Corrugated shell with smooth skin. (M-2G1, M-2G2) 8-Orthotropic shell. (Temperature and wall properties are defined by user written MATER subroutine and may vary through the thickness as well as with shell coordinates.) No more cards to read unless NSTRI or NRING below equals 1. 9-Orthotropic shell. (Temperature and wall properties are read at selected mesh points and may vary through the thickness as well as with shell coordinates.)(V-1, V-2, V-3, V-4)

(This card continued next page.)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NSTRI	I5	6-10	0 - No smeared stringers. 1 - Smeared stringers (input data on card N-1).
NRING	I5	11-15	0 - No smeared rings 1 - Smeared rings (input data on card N-3).

Unless IWALL is 8 or 9, this card is complete.

Discrete stiffeners can be added as desired above (S-1 through S-7).

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IP	I5	16-20	Number of points across wall thickness. Must be odd number and not less than 3 or more than 9. Omit unless IWALL = 8 or 9.
IM	I5	21-25	Number of rows selected for input of temperature or properties. Omit unless IWALL = 9. $IM \geq 2$.
JM	I5	26-30	Number of columns selected for input of temperature or properties. Omit unless IWALL = 9. $JM \geq 2$.

MATERIAL PROPERTIES

M-2B (IWALL = 2, Monocoque Shell)

Note: If shell is isotropic, punch only the first four fields on this card.
For an orthotropic shell with $EY1 = 0$, punch a small but nonzero value for $EY1$.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
AT	E 10.6	1-10	Wall thickness.
EX1	E 10.6	11-20	Young's Modulus in X-direction.
XNU	E 10.6	21-30	Poisson's Ratio - μ_{xy} , ($\mu_{xy} E_x = \mu_{yx} E_y$)
Z	E 10.6	31-40	Distance from reference surface to shell midsurface (positive if the mid-surface is outside of the reference surface, i. e., Z coordinate for mid-surface is positive).
EY1	E 10.6	41-50	Young's Modulus in Y-direction (however shell is assumed isotropic if $EY1 = 0$).
G	E 10.6	51-60	Shear Modulus.

M-2C1 (IWALL = 3, skew-stiffened shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
T3	E 10.6	1-10	Wall thickness
E3	E 10.6	11-20	Young's modulus
U3	E 10.6	21-30	Poisson's ratio
TH	E 10.6	31-40	Angle (deg) between stiffeners and X-coordinate lines
A	E 10.6	41-50	Stiffener spacing (along Y-coordinate lines)
B	E 10.6	51-60	Stiffener thickness
H3	E 10.6	61-70	Stiffener height
AK3	E 10.6	71-80	0.- inside stiffening 1.- outside stiffening



M-2C2 (IWALL = 3, skew-stiffened shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
Z	E 10.6	1-10	Distance from reference surface to skin midsurface (positive if the midsurface is outside the reference surface, i.e., at positive Z-coordinate).

M-2D1 (IWALL = 4, layered, fiber-wound shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
EF	E 10.6	1-10	Young's modulus of fibers
EM	E 10.6	11-20	Young's modulus of matrix
UF	E 10.6	21-30	Poisson's ratio of fibers
UM	E 10.6	31-40	Poisson's ratio of matrix
Z	E 10.6	41-50	Distance from reference surface to shell midsurface (positive if midsurface is outside the reference surface; i.e., at a positive Z coordinate)
LAYERS	I5	51-55	Number of layers. LAYERS $\leq$ 20.

M-2D2 (IWALL = 4, layered, fiber-wound shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
TT(J)	E 10.6	1-10	Thickness of layer (inner layer has index 1, outer layer has index LAYERS)
XX(J)	E 10.6	11-20	Matrix content (by volume) in percent/100
BE(J)	E 10.6	21-30	Winding angle
$\emptyset$ (J)	E 10.6	31-40	Contiguity factor

Note: Repeat Card M-2D2 for J = 1, LAYERS.

M-2E1 (IWALL = 5, layered orthotropic shells)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
Z	E 10.6	1-10	Distance from reference surface to shell midsurface (positive if midsurface is outside of reference surface, i.e., at a positive Z coordinate).
LAYS	I5	11-15	Number of layers. LAYS $\leq$ 20.


M-2E2 (IWALL = 5, layered orthotropic shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
TL(J)	E 10.6	1-10	Layer thickness (inner layer No. 1, outer layer No. LAYS)
EX5(J)	E 10.6	11-20	Modulus of elasticity in x direction
EY5(J)	E 10.6	21-30	Modulus of elasticity in y direction
UXY(J)	E 10.6	31-40	Poisson's ratio - μ_{xy} , ($\mu_{xy} E_x = \mu_{yx} E_y$)
G5(J)	E 10.6	41-50	Shear modulus

Note: Repeat Card M-2E2 for J = 1, LAYS.

M-2F (IWALL = 6, Corrugated Shell)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
CT6	E 10.6	1-10	Thickness of corrugated sheet
E6	E 10.6	11-20	Young's modulus
U6	E 10.6	21-30	Poisson's ratio
CC6	E 10.6	31-40	See figure
CH6	E 10.6	41-50	
CD6	E 10.6	51-60	
CB6	E 10.6	61-70	Centerline-to-centerline spacing of corrugations

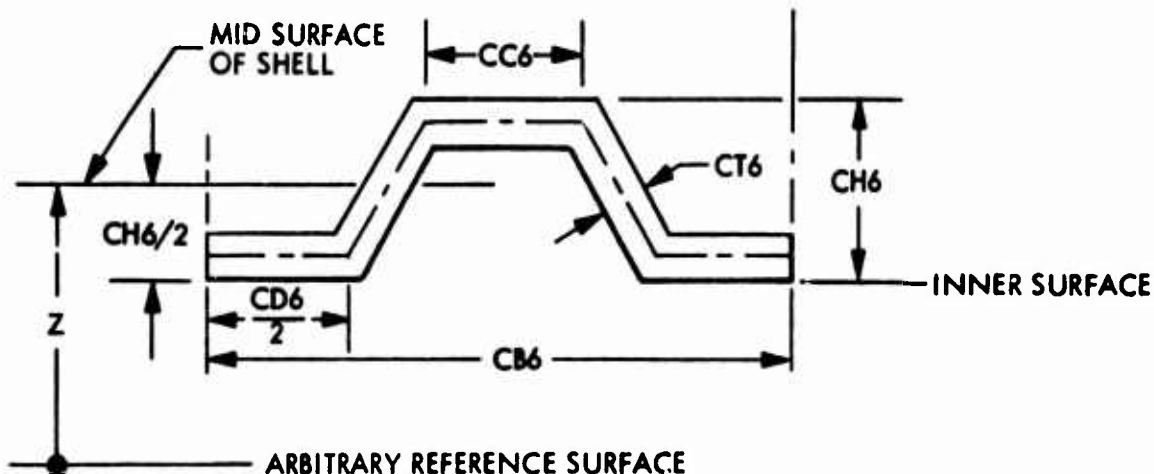


(This card continued next page.)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
Z	E 10.6	71-80	Distance from reference surface to shell midsurface (positive if midsurface of shell is outside the reference surface, i.e., at a positive Z coordinate)

M-2G1 (IWALL = 7, Corrugated Shell with one smooth skin)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
CT7	E 10.6	1-10	Thickness of corrugated sheet
E7	E 10.6	11-20	Young's modulus
U7	E 10.6	21-30	Poisson's ratio
CC7	E 10.6	31-40	See figure
CH7	E 10.6	41-50	
CD7	E 10.6	51-60	
CB7	E 10.6	61-70	Centerline-to-centerline spacing of corrugations
Z	E 10.6	71-80	Distance from reference surface to mid-surface of shell (positive if midsurface is outside of reference surface; at positive Z coordinate).

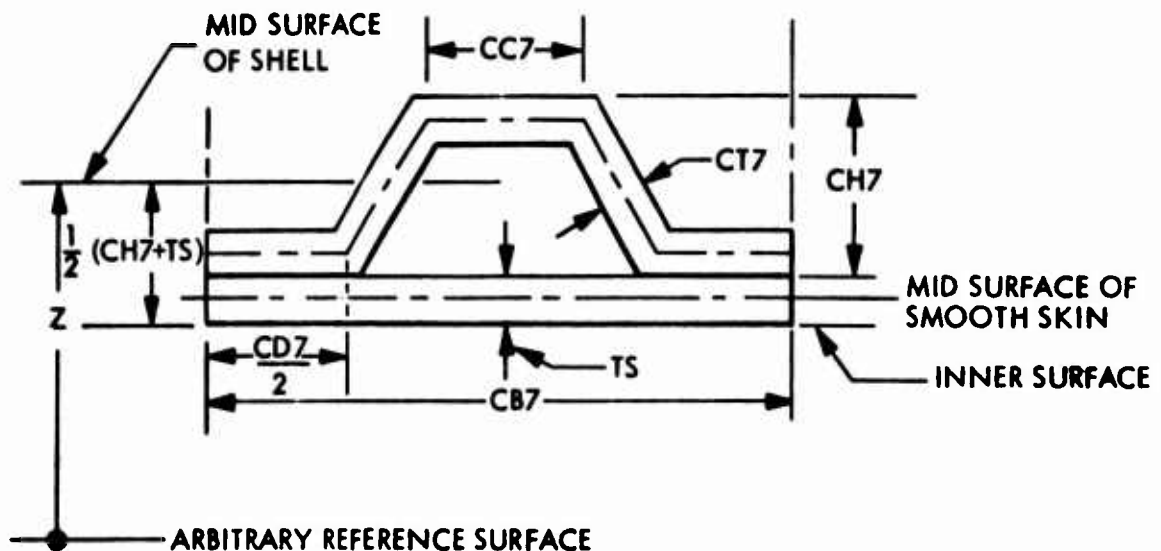

M-2G2 (IWALL = 7, Corrugated Shell with one smooth skin)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
TS	E 10.6	1-10	Thickness of smooth skin
ES	E 10.6	11-20	Young's modulus of skin
US	E 10.6	21-30	Poisson's ratio of skin
PHI	E 10.6	31-40	Reduction factor for torsional stiffness
ANC	E 10.6	41-50	0.- Inside corrugation 1.- Outside corrugation

SMEARED STIFFENERS

Note: For smeared rectangular stiffeners, GJ is computed by the program as $H \times T^3/3$ when $H \geq T$ (somewhat unconservative for $H \approx T$).

N-1 Smeared Stringers

Read only if NSTRI = 1 on Card M-1.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
E1	E 10.6	1-10	Young's modulus
U1	E 10.6	11-20	Poisson's ratio
ØI1	E 10.6	21-30	0.- Rectangular stringers 1.- Arbitrary stringers
D1	E 10.6	31-40	Stringer spacing (arc length)
AK1	E 10.6	41-50	0.- Internal stringers 1.- External stringers

N-2A Smeared Rectangular Stringers

Read only if ØI1 = 0 on Card N-1.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
T1	E 10.6	1-10	Stringer thickness
H1	E 10.6	11-20	Stringer height

N-2B Smeared Arbitrary Stringers

Read only if ØI1 = 1 on Card N-1.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
A1	E 10.6	1-10	Area of stringer
SI1	E 10.6	11-20	Moment of inertia of stringer about Y'-axis
XI1	E 10.6	21-30	Moment of inertia of stringer about Z'-axis
S1	E 10.6	31-40	Torsional stiffness of stringer, GJ
EZ1	E 10.6	41-50	Eccentricity of stringer. (See figure for discrete stringers.)
H1	E 10.6	51-60	Stringer Height

N-3 Smeared Rings

Read only if NRING = 1 on Card M-1.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
E2	E 10. 6	1-10	Young's Modulus
U2	E 10. 6	11-20	Poisson's Ratio
ØI2	E 10. 6	21-30	0.- Rectangular rings 1.- Arbitrary rings
D2	E 10. 6	31-40	Ring spacing (arc length)
AK2	E 10. 6	41-50	0.- Internal rings 1.- External rings

N-4A Smeared Rectangular Rings

Read only if ØI2 = 0 on Card N-3.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
T2	E 10. 6	1-10	Ring Thickness
H2	E 10. 6	11-20	Ring Height

N-4B Smeared Arbitrary Rings

Read only if ØI2 = 1 on Card N-3.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
A2	E 10. 6	1-10	Area of ring
SI2	E 10. 6	11-20	Moment of inertia of ring about X'-axis
XI2	E 10. 6	21-30	Moment of inertia of ring about Z'-axis
S2	E 10. 6	31-40	Torsional stiffness of ring, GJ
EZ2	E 10. 6	41-50	Eccentricity of ring (See figure for discrete rings)
H2	E 10. 6	51-60	Ring Height

Note: Stringers run parallel with X and rings parallel with Y coordinate axis.
The remaining cards are to be read only if IWALL = 9.

VARIABLE WALL PROPERTIES

V-1 (For Orthotropic Shell with variable properties - IWALL = 9)

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
TD	E 10.6	1-10	Wall thickness
Z	E 10.6	11-20	Distance from reference surface to mid-surface of shell (positive if midsurface is outside of reference surface, i.e., at a positive Z coordinate)

V-2 X-Coarse Grid Cards

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
XM(I) I = 1, IM	8E 10.6	1-80	X-coordinates of selected mesh (for IM, see M-1 card)

Note: Card format is 8E 10.6; therefore, more than one V-2 card might be necessary to input all X coordinates.

V-3 Y-Coarse Grid Cards

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
YM(J) J = 1, JM	8E 10.6	1-80	Y-coordinates of selected mesh (for JM, see M-1 card)

Note: Card format is 8E 10.6; therefore, more than one V-3 card might be necessary to input all Y coordinates.

The following cards are read in a loop over the selected mesh points. They are read either by row or by column, depending on which direction has the largest number of original gridpoints. With NR (the number of points in the X-direction), NC (the number of points in the Y-direction - see Card D-1), and IM and JM (the number of selected points in these directions)

for NC ≤ NR	MSTA = JM NSTA = IM
for NC > NR	MSTA = IM NSTA = JM

The data card is repeated for L=1, IP (number of points, numbered inner to outer, see M-1 card)

M = 1, MSTA
N = 1, NSTA

Note that L is the inner loop, M is the middle loop, and N is the outer loop.

V-4 Variable Properties Cards

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
TDEG(L, M, N)	E 10.6	1-10	Wall temperature
EX(L, M, N)	E 10.6	11-20	Modulus of elasticity in X direction
EY(L, M, N)	E 10.6	21-30	Modulus of elasticity in Y direction
U(L, M, N)	E 10.6	31-40	Poisson's ratio - μ_{xy} , ($\mu_{xy} E_x = \mu_{yx} E_y$)
G(L, M, N)	E 10.6	41-50	Shear modulus
A1(L, M, N)	E 10.6	51-60	Coefficient of thermal expansion in X direction
A2(L, M, N)	E 10.6	61-70	Coefficient of thermal expansion in Y direction

Note: Card format is 7E 10.6, therefore many V-4 cards will be necessary to input all wall properties.

END OF INPUT

Section 7 USE OF STAGS PROGRAM

This section illustrates the use of the STAGS computer program to solve some typical examples. It also illustrates the form and the interpretation of STAGS-generated output. To conserve space, only representative portions of the output are shown. Cases have been chosen which are deemed suitable for program checkout. Hence, together they cover most of the branches of the program, and they are relatively inexpensive to run. It is not intended to demonstrate the capability of the program; many of the cases can be solved by simpler means.

7.1 SAMPLE CASE 1 - CYLINDRICAL SHELL SEGMENT

Consider a circular cylindrical shell panel subjected to a radial load at the center (Fig. 7-1). The panel is simply supported along its curved boundaries and free along its straight boundaries. Because of the symmetrical arrangement, only one quarter of the panel need be analyzed. This is indicated in the figure; the boundaries are identified as shown. Figure 7-2 shows the input cards associated with this case; Fig. 7-3 shows portions of the output.

Computer output begins with a page containing pertinent input data and stiffness coefficients followed by the determinant of the system of equations and an indication of the elapsed time. The linear solution is printed in five segments (according to the O-1 type input card): first, the displacement field; second, the moment and stress resultants field; third, the stress field; fourth, selected displacements; fifth, selected moment and stress resultants. For cases in which the shell is loaded by a fixed displacement (unit end shortening), it is of interest to find the applied load. Therefore, the stress resultants are integrated at the NR-1 row and the result is given as output. In this particular case, the axial load, near zero, is of no interest.

After the linear solution, the program begins to compute the nonlinear displacements for successively increasing load factors as specified by means of the load increment parameter. Only the selected output related to load steps 1, 2, and 6 is shown. For each load step, the load factors PA and PB for load system A and load system B are printed. The load factor PA for this last step was 6.0, and the solution required 1 iteration. For each iteration, the following information is displayed: maximum displacement change, displacement component, location, relative error, and relaxation factor.

The nonlinear solution is displayed either in its entirety as in the linear solution or only at selected mesh points as requested by the user on the O-1 type of input card.

When program termination occurs because of an internal input card parameter (see L-1 and P-1B input cards), a statement describing the reason for termination will appear in the output and the last three successive solutions will be saved on tape 18 (output tape). A second run may start from any of these three records, provided changes are made to the input data, such as starting load factor (L-1 type input card) and restart command (P-1B type input card).

A display of input cards and selected output for the second run follows the first run (Figs. 7-3a and 7-3b).

Note that the load step increment may be cut or increased automatically based on an internal criteria.

The analysis may be continued until the collapse load has been determined, or convergence difficulties for small load increments are encountered.

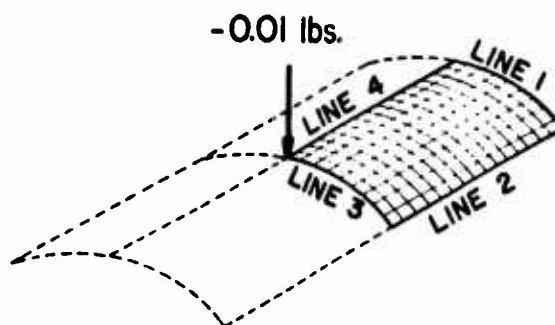


Fig. 7-1 Sample Case 1 - Cylindrical Shell Panel

SAMPLE CASE 1
FIRST RUN - INPUT

SAMPLE CASE 1 - CYLINDRICAL SHELL PANEL																
1	2	1														C-1
3.0		22.5		2.5												G-1
10	8															G-2
5	3	4	4													D-1
1	0	1.		1.		6.										B-1
-0.01		0.		0.			1	0	0	10	1					L-1
.001					0	24	4	2	1							L-2
0	0	10	1	1	1	1	2									P-1B
3.0																O-1
0.0																O-2
2																O-3
0.01		100 00000.	0.3													M-1
																M-2B

Fig. 7-2 Display of Input Cards for Sample Case 1, First Run

SAMPLE CASE 1 FIRST RUN - OUTPUT

```

SAMPLE CASE 1 - CYLINDRICAL SHELL PANEL
NON-LINEAR COLLAPSE ANALYSIS.
1 LOAD PATTERNS.
TYPE OF SURFACE IS CYLINDER
SURFACE CONSTANTS = 3.800000E+00, 2.250000E+01, 2.500000E+00.
SLANK COMMON ARRAY WORKING SPACE= 19000
FINITE DIFFERENCE MESH. 10 ROWS. 8 COLUMNS. MESH SPACING. M= .3333, K= 3.2143
MQU1= -0. MQU2= -0. MQU3= -0
BOUNDARY CONDITION AT LINE 1 IS ANTI-SYMMETRIC
BOUNDARY CONDITION AT LINE 2 IS UNRESTRAINED
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
LOAD A DATA
CARD COUNT = 1
USER-LOAD FLAG = 0. STARTING LOAD FACTOR = 1.000000E+00. LOAD STEP = 1.000000E+00. MAXIMUM LOAD = 6.000000E+00
-1.000000E-02 0. 0. PX JZ JY JX ROW COL
PZ 1 0 0 0 10 1
ERROR TOLERANCE = 1.000000E-03 UNDERRELAXATION = -0.
1STAY 1SEC ICUT 1WENT 1STRAT
0 24 2 1
IPX= 1 IPY= 1 IPZ= 1 IPR= 2 IPLOT= -0
IMALL= 2. NSTAY= -0. MRING= -0. IP= -0. IN= -0. JM= -0
AT = 1.000000E-02 EX1 = 1.000000E+07 XNU = 3.000000E-01
Z = -0. EY1 = 1.000000E+07 C = 3.846153E+06
THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE GFR2
CCC(1,1) CCC(1,2) CCC(1,3) CCC(1,4) CCC(1,5) CCC(1,6)
1.898901E+05 0. 0. 0. 0. 0.
3.296703E+04 1.000001E+05 0. 0. 0. 0.
0. 0. 3.846154E+04 0. 0. 0.
0. 0. 0. 9.157509E-01 0. 0.
0. 0. 0. 2.747233E-01 9.157509E-01 0.
0. 0. 0. 0. 0. 3.205120E-01

```

Fig. 7-3 Excerpt of Output for Sample Case 1, First Run.

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECTIONS= 1.157. NR OF IO REQUESTS (TAPE2)= 11. WORDS USED (TAPE2)= 20532. WORDS TRANSFERRED (TAPE2)= 30508
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECTIONS= 2.224. NR OF IO REQUESTS (TAPE2)= 23. WORDS USED (TAPE2)= 49291. WORDS TRANSFERRED (TAPE2)= 74166
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECTIONS= 2.595. NR OF IO REQUESTS (TAPE2)= 29. WORDS USED (TAPE2)= 63301. WORDS TRANSFERRED (TAPE2)= 108915
 DETERMINANT OF STIFFNESS MATRIX= 1.5754282E+09*10.** 458. NUMBER OF NEGATIVE ROOTS = 0
 80 NODES 360 EQUATIONS. MAXIMUM BAND WIDTH = 66
 MATRIX DECOMPOSITION COMPLETED.
 CP SECTIONS= 3.758. NR OF IO REQUESTS (TAPE2)= 35. WORDS USED (TAPE2)= 63301. WORDS TRANSFERRED (TAPE2)= 137959

LINEAR SOLUTION. PA= 1.000000E+00. PB= 0.
 ROW 9. X= 2.667. AXIAL LOAD= -5.146594E-13. BENDING MOMENT= 0.

ROW	1.	X=	0.0000	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
	X	Y	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU				
0.000	0.000	0.000	3.5814E-14	1.1938E-13	0.	3.5671E-14	1.1890E-13	0.	3.5129E+00			
0.000	3.214	7.3097E-13	6.5624E-13	1.0033E+00	0.8109E-13	7.3840E-13	6.5433E-13	5.9524E+00				
0.000	6.429	0.8223E-13	1.1338E-12	1.1128E+00	1.6803E-13	0.8109E-13	1.1300E-12	9.2542E+00				
0.000	9.643	1.4489E-13	4.4679E-14	2.5591E+00	1.6803E-13	0.8109E-13	4.4679E-14	1.0594E+01				
0.000	12.857	0.	0.	2.5339E+00	0.9572E-13	0.	0.	1.1185E+01				
0.000	16.071	-5.9572E-13	-1.7871E-13	2.2624E+00	-5.9572E-13	-1.7871E-13	-1.7871E-13	9.4733E+00				
0.000	19.286	0.	0.	2.7480E+00	0.	0.	0.	7.8407E+00				
0.000	22.500	-2.3322E-12	-7.1486E-13	-1.2860E+00	-2.3322E-12	-7.1486E-13	-7.1486E-13					

ROW	2.	X=	-3333	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
	X	Y	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU				
-333	0.000	-5.9329E+00	-4.1225E+00	0.	-3.5174E+00	-3.5174E+00	3.8902E+00	0.	3.1231E+00			
-333	3.214	-6.1041E+00	-4.0073E+00	3.2184E-01	-3.3670E+00	-3.3670E+00	4.2259E+00	6.9601E+00				
-333	6.429	-5.8501E+00	-3.5045E+00	1.6302E+00	-2.0577E+00	-2.0577E+00	2.6306E+00	8.9617E+00				
-333	9.643	-4.9305E+00	-2.7793E+00	2.4678E+00	-1.3942E-01	-1.3942E-01	2.1728E+00	1.1238E+01				
-333	12.857	-3.4352E+00	-2.0492E+00	1.9225E+00	3.4426E+00	3.4426E+00	1.1617E+00	1.1523E+01				
-333	16.071	-4.5932E-02	-1.2710E+00	-1.7245E-01	9.2429E+00	9.2429E+00	5.4902E-01	9.7606E+00				
-333	19.286	5.3671E+00	-5.8245E-01	-1.6204E+00	1.7932E+01	1.7932E+01	3.1005E-01	8.2548E+00				
-333	22.500	1.3415E+01	-2.7714E-01	-1.6204E+00								

ROW	3.	X=	.6667	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
	X	Y	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU				
.667	0.000	-1.2787E+01	-9.2043E+00	0.	-6.6988E+00	-6.6988E+00	1.0003E+01	0.	4.1407E+00			
.667	3.214	-1.2210E+01	-8.7310E+00	6.0288E-01	-6.6470E+00	-6.6470E+00	8.4513E+00	6.9151E+00				
.667	6.429	-1.1658E+01	-7.6018E+00	1.7223E-01	-5.8011E+00	-5.8011E+00	7.6457E+00	1.0550E+01				
.667	9.643	-1.0489E+01	-6.6436E+00	1.3994E+00	-4.1615E+00	-4.1615E+00	6.3185E+00	1.2059E+01				
.667	12.857	-5.3991E+00	-4.1744E+00	1.2645E+00	-1.2646E-01	-1.2646E-01	3.7600E+00	1.2529E+01				
.667	16.071	-5.3325E-02	-2.5909E+00	0.0936E-01	6.9840E+00	6.9840E+00	2.6134E+00	1.0814E+01				
.667	19.286	1.0691E+01	-1.2422E+00	-1.1990E+00	1.8402E+01	1.8402E+01	1.2209E+00	9.1982E+00				
.667	22.500	2.6009E+01	-5.8901E-01	-2.7236E+00	3.5554E+01	3.5554E+01	4.0862E-01					

Fig. 7-3 (Cont.)

ROW	8.	X =	2.3333	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
2.333	0.000	-6.1421E+01	-7.0500E+01	0.	-1.0020E+01	-2.1033E+01	7.5612E+01	0.	1.1948E+01	0.	1.1948E+01	0.	1.1948E+01	0.	
2.333	3.214	-6.5828E+01	-7.2058E+01	-1.3685E+00	-5.3685E+00	-1.6795E+01	7.9124E+01	-1.6795E+01	2.3587E+01	-1.6795E+01	2.3587E+01	2.3587E+01	2.3587E+01	2.3587E+01	
2.333	6.429	-6.7390E+01	-5.4150E+01	-2.4450E+00	-2.2100E+00	-1.0005E+01	5.9989E+01	-1.0005E+01	2.2090E+01	-1.0005E+01	2.2090E+01	2.2090E+01	2.2090E+01	2.2090E+01	
2.333	9.643	-6.7815E+01	-4.5735E+00	-4.5735E+00	2.2110E+00	5.2278E+00	-1.7406E+01	5.2278E+00	-1.7406E+01	5.2278E+00	-1.7406E+01	5.2278E+00	5.2278E+00	5.2278E+00	
2.333	12.857	-6.7332E+00	-2.9254E+00	-2.9254E+00	-1.0925E+00	2.7431E+01	-6.7814E+01	-1.0925E+00	-6.7814E+01	-1.0925E+00	-6.7814E+01	-1.0925E+00	-6.7814E+01	-1.0925E+00	
2.333	16.071	-6.7332E+00	2.9254E+00	2.9254E+00	-5.2167E+00	5.1935E+01	-4.5992E+00	-5.2167E+00	-4.5992E+00	-5.2167E+00	-4.5992E+00	-5.2167E+00	-4.5992E+00	-5.2167E+00	
2.333	19.286	6.0277E+01	2.6836E+00	2.6836E+00	-7.0775E+00	7.1314E+01	-1.7269E+00	-7.0775E+00	-1.7269E+00	-7.0775E+00	-1.7269E+00	-7.0775E+00	-1.7269E+00	-7.0775E+00	
2.333	22.500	6.3334E+01	1.5534E+00	1.5534E+00	0.	0.	0.	0.	0.	0.	0.	0.	0.	0.	
ROW	9.	X =	2.6567	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
2.657	0.000	-1.0547E+02	-1.3640E+02	0.	-3.1412E+00	-2.3873E+01	1.7123E+02	0.	3.8225E+01	0.	3.8225E+01	0.	3.8225E+01	0.	
2.657	3.214	-9.4966E+01	-3.9608E+01	-3.9608E+01	4.5053E+00	-2.4695E+01	1.1048E+02	-2.4695E+01	1.1048E+02	-2.4695E+01	1.1048E+02	-2.4695E+01	1.1048E+02	1.1048E+02	
2.657	6.429	-9.4966E+01	-4.1301E+01	-4.1301E+01	6.7766E+00	-2.7161E+01	2.7786E+01	-2.7161E+01	2.7786E+01	-2.7161E+01	2.7786E+01	-2.7161E+01	2.7786E+01	2.7786E+01	
2.657	9.643	-1.5710E+01	-4.4069E+00	-4.4069E+00	6.7766E+00	-1.3712E+01	-7.4583E+00	-1.3712E+01	-7.4583E+00	-1.3712E+01	-7.4583E+00	-1.3712E+01	-7.4583E+00	-7.4583E+00	
2.657	12.857	-1.9665E+01	7.6911E+00	7.6911E+00	-4.0110E+00	8.7638E+00	-1.3084E+01	8.7638E+00	-1.3084E+01	8.7638E+00	-1.3084E+01	8.7638E+00	-1.3084E+01	8.7638E+00	
2.657	16.071	6.7332E+01	3.2336E+00	3.2336E+00	-4.3708E+02	3.3857E+01	-8.0907E+00	-4.3708E+02	-8.0907E+00	-4.3708E+02	-8.0907E+00	-4.3708E+02	-8.0907E+00	-8.0907E+00	
2.657	19.286	6.7803E+01	3.2336E+00	3.2336E+00	-2.4637E+00	5.4211E+01	-2.8287E+00	-2.4637E+00	-2.8287E+00	-2.4637E+00	-2.8287E+00	-2.4637E+00	-2.8287E+00	-2.8287E+00	
2.657	22.500	6.3316E+01	1.4034E+00	1.4034E+00	-3.0893E+00	6.5017E+01	-1.1486E+00	-3.0893E+00	-1.1486E+00	-3.0893E+00	-1.1486E+00	-3.0893E+00	-1.1486E+00	-1.1486E+00	
ROW	10.	X =	3.0000	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
3.000	0.000	-2.6897E+02	-4.5446E+02	0.	0.	7.9131E+01	3.2235E+02	0.	0.	7.9131E+01	3.2235E+02	0.	0.	0.	
3.000	3.214	-1.1783E+02	-1.1865E+02	-1.1865E+02	5.4619E+01	-2.8743E+01	2.4769E+01	-1.1865E+02	2.4769E+01	-1.1865E+02	2.4769E+01	-1.1865E+02	2.4769E+01	2.4769E+01	
3.000	6.429	-1.3556E+01	-4.5910E+00	-4.5910E+00	1.7026E+01	-1.8459E+01	-2.9233E+01	-4.5910E+00	-2.9233E+01	-4.5910E+00	-2.9233E+01	-4.5910E+00	-2.9233E+01	-2.9233E+01	
3.000	9.643	6.6657E+00	1.7261E+01	1.7261E+01	3.5979E+01	1.1550E+01	-1.3980E+01	1.7261E+01	-1.3980E+01	1.7261E+01	-1.3980E+01	1.7261E+01	-1.3980E+01	1.7261E+01	
3.000	12.857	3.1721E+01	1.7794E+01	1.7794E+01	1.7547E+01	3.7199E+01	-5.4632E+00	1.7794E+01	-5.4632E+00	1.7794E+01	-5.4632E+00	1.7794E+01	-5.4632E+00	1.7794E+01	
3.000	16.071	5.2344E+01	6.7233E+00	6.7233E+00	3.5028E+01	5.5086E+01	-1.8112E+00	6.7233E+00	-1.8112E+00	6.7233E+00	-1.8112E+00	6.7233E+00	-1.8112E+00	6.7233E+00	
3.000	19.286	6.8740E+01	2.5972E+00	2.5972E+00	-2.4637E+00	6.3630E+01	-6.6532E+01	-2.4637E+00	-6.6532E+01	-2.4637E+00	-6.6532E+01	-2.4637E+00	-6.6532E+01	-6.6532E+01	
3.000	22.500	7.7924E+01	1.1715E+00	1.1715E+00	4.0032E+01	6.3630E+01	-6.6532E+01	1.1715E+00	-6.6532E+01	1.1715E+00	-6.6532E+01	1.1715E+00	-6.6532E+01	-6.6532E+01	
CP	SECTIONS	4,512.	NO OF IO REQUESTS (TAPE2)=	54.											
ROW	11.	X =	3.0000	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
3.000	0.000	-4.5224E+02	0.	0.	-1.6940E+02	7.9131E+01	3.2235E+02	0.	0.	7.9131E+01	3.2235E+02	0.	0.	0.	
3.000	3.214	-3.9547E+02	2.3610E+02	2.3610E+02	5.4619E+01	-2.8743E+01	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.4769E+01	
3.000	6.429	-3.0435E+02	4.3315E+02	4.3315E+02	5.4619E+01	-4.0471E+01	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	
3.000	9.643	-1.3806E+02	5.7576E+02	5.7576E+02	1.7026E+01	-1.8459E+01	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	
3.000	12.857	-1.3806E+02	6.7478E+02	6.7478E+02	3.5979E+01	1.1550E+01	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	
3.000	16.071	-6.2147E+02	7.2957E+02	7.2957E+02	1.7547E+01	3.7199E+01	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	
3.000	19.286	1.2442E+03	7.4134E+02	7.4134E+02	-2.4637E+00	6.3630E+01	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	
3.000	22.500	3.6925E+02	7.1072E+02	7.1072E+02	4.0032E+01	6.3630E+01	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	
ROW	12.	X =	3.0000	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
3.000	0.000	-4.5224E+02	0.	0.	-1.6940E+02	7.9131E+01	3.2235E+02	0.	0.	7.9131E+01	3.2235E+02	0.	0.	0.	
3.000	3.214	-3.9547E+02	2.3610E+02	2.3610E+02	5.4619E+01	-2.8743E+01	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.4769E+01	
3.000	6.429	-3.0435E+02	4.3315E+02	4.3315E+02	5.4619E+01	-4.0471E+01	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	
3.000	9.643	-1.3806E+02	5.7576E+02	5.7576E+02	1.7026E+01	-1.8459E+01	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	
3.000	12.857	-1.3806E+02	6.7478E+02	6.7478E+02	3.5979E+01	1.1550E+01	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	
3.000	16.071	-6.2147E+02	7.2957E+02	7.2957E+02	1.7547E+01	3.7199E+01	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	
3.000	19.286	1.2442E+03	7.4134E+02	7.4134E+02	-2.4637E+00	6.3630E+01	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	
3.000	22.500	3.6925E+02	7.1072E+02	7.1072E+02	4.0032E+01	6.3630E+01	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	-6.6532E+01	7.1072E+02	
ROW	13.	X =	3.0000	OUTER SURFACE				INNER SURFACE				SIGMA (RING)			
				SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMAX	SIGMAY	TAU	SIGMA (STRNGR)	SIGMA (RING)	
3.000	0.000	-4.5224E+02	0.	0.	-1.6940E+02	7.9131E+01	3.2235E+02	0.	0.	7.9131E+01	3.2235E+02	0.	0.	0.	
3.000	3.214	-3.9547E+02	2.3610E+02	2.3610E+02	5.4619E+01	-2.8743E+01	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.3610E+02	2.4769E+01	2.4769E+01	
3.000	6.429	-3.0435E+02	4.3315E+02	4.3315E+02	5.4619E+01	-4.0471E+01	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	-3.3034E+01	4.3315E+02	
3.000	9.643	-1.3806E+02	5.7576E+02	5.7576E+02	1.7026E+01	-1.8459E+01	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	-2.9233E+01	5.7576E+02	
3.000	12.857	-1.3806E+02	6.7478E+02	6.7478E+02	3.5979E+01	1.1550E+01	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	-1.3980E+01	6.7478E+02	
3.000	16.071	-6.2147E+02	7.2957E+02	7.2957E+02	1.7547E+01	3.7199E+01	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	-5.4632E+00	7.2957E+02	
3.000	19.286	1.2442E+03	7.4134E+02	7.4134E+02	-2.4637E+00	6.3630E+01	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	-6.6532E+01	7.4134E+02	
3.000	22.500	3.6925E+02													

ROW	10.	X=	3.0000	MX	MY	MXV	MX	MY	MXV
COL		Y							
1	0.0000	-9.492106E-01	-6.689277E-01	0.	-2.900070E-03	-2.900070E-03	-6.673370E-03	0.	2.700006E-20
2	3.2143	-7.37050E-01	-4.693025E-01	0.	-7.421290E-04	-7.421290E-04	-1.19519E-03	0.	2.700006E-20
3	6.4256	-1.716370E-01	-1.911235E-01	0.	5.824580E-14	5.824580E-14	2.420232E-04	0.	2.700006E-20
4	9.6429	-5.09540E-02	-5.99580E-02	0.	1.699270E-14	1.699270E-14	3.876214E-04	0.	2.700006E-20
5	12.8571	-2.16854E-02	-3.474569E-03	0.	3.377707E-14	3.377707E-14	2.272165E-04	0.	2.700006E-20
6	16.0714	-4.47917E-03	6.330448E-03	0.	1.751404E-14	1.751404E-14	1.016037E-04	0.	2.700006E-20
7	19.2857	6.19334E-01	3.930393E-03	0.	3.356007E-14	3.356007E-14	3.673371E-04	0.	2.700006E-20
8	22.5000	7.076229E-01	2.531126E-03	0.	0.	0.	1.530718E-05	0.	6.672013E-19
COL		Y=							
1	0.0000	3.574293E-16	1.191031E-15	0.	1.191431E-21	1.191431E-21	3.971437E-21	0.	0.
2	3.3333	-4.725050E-02	-1.161191E-02	0.	-2.012836E-05	-2.012836E-05	-6.677226E-05	0.	0.
3	6.6667	-9.743151E-02	-3.593326E-03	0.	-5.073009E-05	-5.073009E-05	-1.607260E-04	0.	0.
4	1.0000	-1.44327E-01	-2.826934E-03	0.	-7.002759E-05	-7.002759E-05	-2.601046E-04	0.	0.
5	1.3333	-2.059427E-01	1.202593E-02	0.	-1.433099E-04	-1.433099E-04	-4.485415E-04	0.	0.
6	1.6667	-2.59227E-01	-4.917893E-03	0.	-1.887745E-04	-1.887745E-04	-6.202251E-04	0.	0.
7	2.0000	-3.50927E-01	3.520229E-02	0.	-3.251270E-04	-3.251270E-04	-1.003404E-03	0.	0.
8	2.3333	-4.12273E-01	-1.440811E-02	0.	-3.365633E-04	-3.365633E-04	-1.286433E-03	0.	0.
9	2.6667	-4.66970E-01	1.741729E-01	0.	-6.795540E-04	-6.795540E-04	-2.563571E-03	0.	0.
10	3.0000	-4.492106E-01	-6.689277E-01	0.	-2.900070E-03	-2.900070E-03	-6.673370E-03	0.	0.

BEGIN NON-LINEAR ITERATION FOR LOAD STEP 1, PA= 1.0000E+00, PB= 0.

ITERATION	MAXIMUM DISPLACEMENT CHANGE	COMPONENT	ROW	COL	REL ERROR	RELAXATION FACTOR
1	1.575974E-06	M	10	1	3.397038E-03	1.0000
2	-1.619192E-06	M	10	9	3.400766E-03	1.0000
3	1.895951E-06	M	10	9	4.004052E-05	1.0000

LOAD STEP 1, PA=1.0000E+00, PB=0.

364167

CP SECONDS= 5.715, NR OF 10 REQUESTS (TAPE2)= 0, WORDS USED (TAPE2)= 63013, WORDS TRANSFERRED (TAPE2)= 364167

ROW	10.	X=	3.0000	M	V	U	BETAX	BETAY
COL		Y=						
1	0.0000	-4.641173E-04	0.	2.370422E-05	-1.694066E-21	0.	0.	0.
2	3.2143	-3.976401E-04	0.	4.319561E-05	-2.541099E-21	0.	5.558051E-04	0.
3	6.4286	-3.055323E-04	0.	9.774242E-05	-1.694066E-21	0.	6.194722E-04	0.
4	9.6429	-2.184369E-04	0.	6.765367E-05	-2.117582E-22	0.	5.726215E-04	0.
5	12.8571	-1.343337E-04	0.	7.312891E-05	0.470329E-22	0.	5.297091E-04	0.
6	16.0714	-6.226275E-05	0.	7.312891E-05	1.694066E-21	0.	5.898040E-04	0.
7	19.2857	1.256635E-05	0.	7.312891E-05	1.694066E-21	0.	5.898040E-04	0.
8	22.5000	0.722644E-05	0.	7.312891E-05	3.388132E-21	0.	5.898040E-04	0.
COL		Y=						
1	0.0000	0.	0.	0.	0.	0.	0.	0.
2	3.3333	-5.11875E-05	0.	0.	0.	0.	0.	0.
3	6.6667	-1.023798E-04	0.	0.	0.	0.	0.	0.
4	1.0000	-1.529279E-04	0.	0.	0.	0.	0.	0.
5	1.3333	-2.039320E-04	0.	0.	0.	0.	0.	0.
6	1.6667	-2.52636E-04	0.	0.	0.	0.	0.	0.
7	2.0000	-3.010363E-04	0.	0.	0.	0.	0.	0.
8	2.3333	-3.475169E-04	0.	0.	0.	0.	0.	0.
9	2.6667	-3.909335E-04	0.	0.	0.	0.	0.	0.
10	3.0000	-4.641173E-04	0.	0.	0.	0.	0.	0.

Fig. 7-3 (Cont.)

BEGIN NON-LINEAR ITERATION FOR LOAD STEP 2. PA= 2.0000E+00, PB= 0.

ITERATION	MAXIMUM DISPLACEMENT CHANGE	COMPONENT	ROW	COL	REL ERROR	RELAXATION FACTOR
0	5.46661E-06	M	10	9	5.85133E-03	1.0000
1	-6.66229E-06	M	10	9	7.16941E-03	1.0000
2	3.58132E-07	M	10	9	3.86263E-04	.0000

LOAD STEP 2. PA=2.0000E+00, PB=0.
 CP SECONDS= 6.911. NR OF IO REQUESTS (TAPE2)= 114. WORDS USED (TAPE2)= 66325. WORDS TRANSFERRED (TAPE2)= 520581
 ROW 9. X= 2.567. AXIAL LOAD= 3.385475E-05. BENDING MOMENT= 0.

ROW	10.	X	Y	3.0000	M	V	U	BETAX	BETAY
COL	1.	Y							
1	0.0000	-9.320394E-04	0.	0.	0.	0.	-3.308132E-21	0.	0.
2	3.2143	-7.97450E-04	0.	0.	0.	0.	-3.308132E-21	0.	1.116927E-03
3	6.4286	-6.13633E-04	0.	0.	0.	0.	-1.694066E-21	0.	1.245568E-03
4	9.6429	-4.383092E-04	0.	0.	0.	0.	-4.235165E-22	0.	1.150759E-03
5	12.8571	-2.77620E-04	0.	0.	0.	0.	1.694066E-21	0.	1.063546E-03
6	16.0714	-1.247641E-04	0.	0.	0.	0.	1.694066E-21	0.	1.021213E-03
7	19.2857	2.527839E-05	0.	0.	0.	0.	0.776264E-21	0.	1.009221E-03
8	22.5000	1.750260E-04	0.	0.	0.	0.	3.308132E-21	0.	1.011970E-03

COL	1.	Y	X	0.0000	M	V	U	BETAX	BETAY
ROW	1.								
1	0.0000	0.	0.	0.	0.	0.	1.749807E-05	-3.000361E-04	0.
2	3.2143	-1.026787E-04	0.	0.	0.	0.	1.733957E-05	-3.079486E-04	0.
3	6.4286	-2.052337E-04	0.	0.	0.	0.	1.682631E-05	-3.066958E-04	0.
4	9.6429	-3.077181E-04	0.	0.	0.	0.	1.599726E-05	-3.051100E-04	0.
5	12.8571	-4.088780E-04	0.	0.	0.	0.	1.479754E-05	-3.007773E-04	0.
6	16.0714	-5.076599E-04	0.	0.	0.	0.	1.321924E-05	-2.958093E-04	0.
7	19.2857	-6.059361E-04	0.	0.	0.	0.	1.113587E-05	-2.948248E-04	0.
8	22.5000	-6.97531E-04	0.	0.	0.	0.	8.594802E-06	-2.952507E-04	0.
9	25.7143	-7.827434E-04	0.	0.	0.	0.	4.847869E-06	-3.517444E-04	0.
10	3.0000	-9.320394E-04	0.	0.	0.	0.	-3.308132E-21	0.	0.

ROW	10.	X	Y	3.0000	M	V	U	BETAX	BETAY
COL	1.								
1	0.0000	-1.983391E+00	0.	0.	0.	0.	5.807410E-14	-5.051944E-03	0.
2	3.2143	-1.679394E+00	0.	0.	0.	0.	6.713713E-14	-1.514759E-03	0.
3	6.4286	-1.293265E+01	0.	0.	0.	0.	3.419407E-14	1.079558E-04	0.
4	9.6429	-4.292655E+01	0.	0.	0.	0.	3.419407E-14	4.293809E-04	0.
5	12.8571	8.973742E+01	0.	0.	0.	0.	3.419407E-14	3.395736E-04	0.
6	16.0714	1.244490E+00	0.	0.	0.	0.	3.336037E-14	2.542636E-04	0.
7	19.2857	1.244490E+00	0.	0.	0.	0.	3.336037E-14	2.298736E-04	0.
8	22.5000	1.244490E+00	0.	0.	0.	0.	3.336037E-14	2.335959E-04	0.

ROW	10.	X	Y	3.0000	M	V	U	BETAX	BETAY
COL	1.								
1	0.0000	5.213331E-03	0.	0.	0.	0.	0.	0.	0.
2	3.2143	-9.523337E-02	0.	0.	0.	0.	0.	0.	0.
3	6.4286	-1.963298E-01	0.	0.	0.	0.	0.	0.	0.
4	9.6429	-2.912113E-01	0.	0.	0.	0.	0.	0.	0.
5	12.8571	-4.17737E-01	0.	0.	0.	0.	0.	0.	0.
6	16.0714	-5.199301E-01	0.	0.	0.	0.	0.	0.	0.
7	19.2857	-7.032398E-01	0.	0.	0.	0.	0.	0.	0.
8	22.5000	-8.242366E-01	0.	0.	0.	0.	0.	0.	0.
9	25.7143	-1.293331E+00	0.	0.	0.	0.	0.	0.	0.
10	3.0000	-1.983391E+00	0.	0.	0.	0.	0.	0.	0.

Fig. 7-3 (Cont.)

The second nonlinear run is a continuation of the first run, which terminated (because the maximum load was obtained) at load step 6 with PA equal 6.0. Because the run was started with the 3rd record, i.e. ISTART equal 3 (see p-1B type input card), the starting load factor must be changed accordingly. Hence, STLD is set equal 6.0 (see L-1 type input card).

SAMPLE CASE 1 SECOND RUN - INPUT

SAMPLE CASE 1 - CYLINDRICAL SHELL PANEL															
1	2	1													C-1
3.0		22.5	2.5												G-1
10	8														G-2
5	3	4	4												D-1
1	0	6.	1.		8.										B-1
-0.01	0.		0.			1	0	0	10	1					L-1
.001				3	24	4	2	1							L-2
0	0	10	1	1	1	2									P-1B
3.0															O-1
0.0															O-2
															O-3
2															M-1
0.01		10000000.	0.3												M-2B

Fig. 7-3a Display of Input Cards for Sample Case 1, Second Run

**SAMPLE CASE 1 - CYLINDRICAL SHELL PANEL
NON-LINEAR COLLAPSE ANALYSIS. 1 LOAD PATTERNS.**

TYPE OF SURFACE IS CYLINDER

SURFACE CONSTANTS = 3.000000E+00, 2.250000E+01, 2.500000E+00.

BLANK COMMON ARRAY WORKING SPACE= 15000

FINITE DIFFERENCE MESH. 10 ROWS, 3 COLUMNS. MESH SPACING. M= .333, N= 3.2143

```

      RMW1 = -3, RMW2 = -3, MCL1 = -6
      BOUNDARY CONDITION AT LINE 1 IS ANIS-METRIC
      BOUNDARY CONDITION AT LINE 2 IS UNRESTRAINED
      BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
      BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC

```

07007 00000

CARD COUNT - 1

USER-LOAD FLAG = 0, STARTING LOAD FACTOR = 6.000000E+00, LOAD STEP = 1.000000E+00, MAXIMUM LOAD = 6.000000E+00

PZ	PY	PX	JZ	JY	JX	ROW	COL
-1.00CJ93E-02 C.	0.		1	0	0	10	1

ERROR TOLERANCE = 1.00000E-03 UNDERRELAXATION = -.0.

DATE	TIME	LOCATION	REMARKS
1	2	4	24
1	2	4	24

```
IPX= 1 IPY= 1 IPR= 1 IPRS= 2 IPLT= -0
```

INALL=	2,	NSTR=	-0,	NRING=	-0,	IP=	-0,	IM=	-0,	JM=	-1
--------	----	-------	-----	--------	-----	-----	-----	-----	-----	-----	----

$$\begin{aligned} \lambda_7 &= 1.000000\text{E-}02 & EX1 &= 1.000000\text{E+}07 & XMU &= 3.0300000\text{E-}01 \\ Z &= -0. & EX1 &= 1.000000\text{E+}07 & S &= 3.0461538\text{E+}06 \end{aligned}$$

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CFS2

CCC(I,1)	CCC(I,2)	CCC(I,3)
CCC(I,1)	CCC(I,2)	CCC(I,3)

CCCI, 1.1)

[illegible]

Fig. 7-3b Excerpt of Output for Sample Case 1, Second Run

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECONDS= 1.181. NR OF IO REQUESTS (TAPE2)= 11. WORDS USED (TAPE2)= 28932. WORDS TRANSFERRED (TAPE2)= 38988
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECONDS= 2.939. NR OF IO REQUESTS (TAPE2)= 27. WORDS USED (TAPE2)= 98827. WORDS TRANSFERRED (TAPE2)= 76196
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 3.273. NR OF IO REQUESTS (TAPE2)= 33. WORDS USED (TAPE2)= 64837. WORDS TRANSFERRED (TAPE2)= 118963

DETERMINANT OF STIFFNESS MATRIX= 1.4921789E+0919.00. 698. NUMBER OF NEGATIVE ROOTS = 0
 66
 6C MODES. 360 EQUATIONS. MAXIMUM BAND WIDTH =
 MATRIX DECOMPOSITION COMPLETED.
 CP SECONDS= 4.426. NR OF IO REQUESTS (TAPE2)= 39. WORDS USED (TAPE2)= 64537. WORDS TRANSFERRED (TAPE2)= 148887

BEGIN NON-LINEAR ITERATION FOR LOAD STEP 7. PA= 7.888E+88. PB= 0.

ITERATION MAXIMUM DISPLACEMENT CHANGE COMPONENT ROW COL REL ERROR RELAXATION FACTOR
 3 -9.619306E-07 W 10 9 2.78598E-84 1.0888

LOAD STEP 7. PA=7.888E+88. PB=8. 1 ITERATIONS. RELATIVE ERROR= 2.78598E-84
 CP SECONDS= 4.806. NR OF IO REQUESTS (TAPE2)= 54. WORDS USED (TAPE2)= 65349. WORDS TRANSFERRED (TAPE2)= 189877
 POW 9. X= 2.667. AXIAL LOAD= 1.942881E-05. BENDING MOMENT= 0.

ROW	13.	X=	Y=	3.0880	V	U	BETAX	BETAY
COL 1	0.000	-3.33349E-03	0.	0.	0.	0.	0.	0.
2	3.213	-2.45335E-03	1.69814E-04	-6.77626E-21	0.	0.	4.885437E-03	4.885437E-03
3	0.426	-2.19336E-03	3.09391E-04	0.	0.	0.	4.884489E-03	4.884489E-03
4	0.848	-1.56465E-03	4.11722E-04	-1.69486E-21	0.	0.	4.134066E-03	4.134066E-03
5	12.8921	-9.85171E-04	4.81479E-04	6.77526E-21	0.	0.	3.884722E-03	3.884722E-03
6	16.0716	-4.39039E-04	5.194927E-04	6.77626E-21	0.	0.	3.640681E-03	3.640681E-03
7	19.2897	9.44254E-05	5.26711E-04	1.35523E-20	0.	0.	3.591397E-03	3.591397E-03
8	22.5923	6.26972E-04	5.835979E-04	2.71890E-20	0.	0.	3.598779E-03	3.598779E-03

ROW	1.	Y=	X=	3.0880	V	U	BETAX	BETAY
COL 1	0.000	0.	0.	0.	0.	0.	0.	0.
2	-3.333	-3.67746E-04	0.	6.27114E-05	-1.10323E-03	0.	0.	0.
3	0.667	-7.34741E-04	0.	6.27114E-05	-1.10246E-03	0.	0.	0.
4	1.000	-1.07369E-03	0.	6.81330E-05	-1.09642E-03	0.	0.	0.
5	1.333	-1.46371E-03	0.	5.76397E-05	-1.08860E-03	0.	0.	0.
6	1.667	-1.91271E-03	0.	5.261327E-05	-1.071827E-03	0.	0.	0.
7	2.000	-2.16236E-03	0.	4.69036E-05	-1.052684E-03	0.	0.	0.
8	2.333	-2.16236E-03	0.	3.94338E-05	-1.013397E-03	0.	0.	0.
9	2.667	-2.56730E-03	0.	3.82483E-05	-1.057467E-03	0.	0.	0.
10	3.000	-3.33349E-03	0.	1.710803E-05	-1.267322E-03	0.	0.	0.

Fig. 7-3b (Cont.)

7.2 SAMPLE CASE 2 – CYLINDRICAL SHELL WITH ELLIPTIC CROSS SECTION

This case demonstrates calculation of the buckling load, according to bifurcation theory, for a cylinder with elliptic cross section (Fig. 7-4) and subjected to the combined effects of a line load along boundary line 1 (load pattern A) and uniform internal pressure (load pattern B). Here will be determined the critical axial load corresponding to an internal pressure of 20 psi. Because of symmetry, only one eighth of the cylinder needs to be analyzed. In the prebuckling analysis, the restricting assumption is made that the buckling pattern also is symmetric about the same two planes. The input cards associated with this case are illustrated in Fig. 7-5. Portions of the output are displayed in Fig. 7-6.

After displaying the input parameters, stiffness coefficients, and the determinant of the system, the linear solution is given as in the previous example, followed by the determinant of the system based on the new boundary conditions (if the incremental and prebuckling displacement boundary conditions are different) and an initial shift if any. The eigenvalue (buckling load) is computed by a series of iterations displaying: iteration count, Rayleigh quotient and the accelerated estimate of the eigenvalue. To reduce the number of iterations required for convergence an initial shift (lower than the expected solution) was utilized.

As a final result, the normalized buckling mode is printed in the same format as the linear solution.

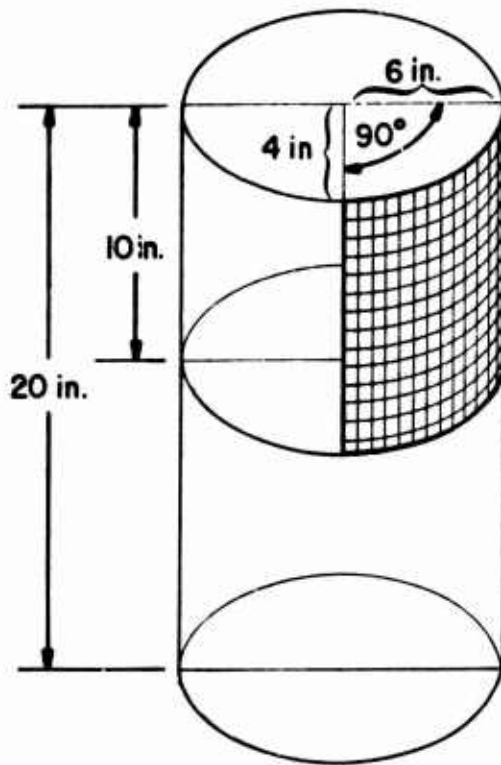


Fig. 7-4 Sample Case 2 - Elliptic Cylinder

SAMPLE CASE 2 INPUT

SAMPLE CASE 2 - ELLIPTIC CYLINDER										
10.	6	1	2							C-1
15	15	0.	90.	6.	4.					G-1
0	4	4	4							G-2
0	0	1	0							D-1
1	0	1.								B-1
0.	0.		200.	0	0	2	1	0		B-2
1	0	1.								L-1 } System A
20.	0.		0.	4	0	0	0	0		L-2 } System B
	7.0			1	20					P-1A
0	0	0	2	1	1	1				O-1
5.	10.									O-2
6.										O-3
	2									M-1
.05	1	+ 5	.25							M-2B

Fig. 7-5 Display of Input Cards for Sample Case 2

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SEC0435= 3.718. NR OF IO REQUESTS (TAPE2)= 24. WORDS USED (TAPE2)= 93312. 99456
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SEC0435= 12.543. NR OF IO REQUESTS (TAPE2)= 49. WORDS USED (TAPE2)= 136448. 219084
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SEC0435= 13.720. NR OF IO REQUESTS (TAPE2)= 75. WORDS USED (TAPE2)= 199672. 375426
 DETERMINANT OF STIFFNESS MATRIX= 1.2599971E+08*18.00 1948. NUMBER OF NEGATIVE ROOTS = 8
 225 MODES, 867 EQUATIONS. MAXIMUM BAND WIDTH = 188
 MATRIX DECOMPOSITION COMPLETED.
 CP SEC0435= 19.056. NR OF IO REQUESTS (TAPE2)= 113. WORDS USED (TAPE2)= 188672. 612688

LINEAR SOLUTION. PA= 1.388080E+08, PB= 0.
 ROW 14, X= 9.206, AXIAL LOAD= -1.58731E+03, REMOING MOMENT= 0.

ROW	COL	U	V	W	BETAX	BETAY
1	1	1.998129E-03	0.58358E-07	2.689805E-04	4.28282E-07	0.
2	2	1.998154E-03	-0.58358E-07	2.689805E-04	5.26190E-07	4.031963E-05
3	3	1.998330E-03	-2.33178E-06	3.29453E-04	7.30769E-07	5.33517E-05
4	4	1.998361E-03	-6.39137E-06	3.96233E-04	1.05512E-06	1.067820E-04
5	5	1.998388E-03	-6.49963E-06	4.68847E-04	1.18132E-06	1.173550E-04
6	6	1.998437E-03	-8.18127E-06	5.46537E-04	1.84225E-06	1.18124E-04
7	7	1.998479E-03	-9.38860E-06	6.15254E-04	1.99976E-06	1.12275E-04
8	8	1.998537E-03	-9.24937E-06	6.77635E-04	2.23804E-06	1.12275E-04
9	9	2.000279E-03	-9.32049E-06	7.30437E-04	-2.59489E-09	1.82272E-04
10	10	2.001184E-03	-1.91381E-05	7.73726E-04	-7.46235E-07	9.37868E-05
11	11	2.001557E-03	-6.68155E-06	8.07892E-04	-1.49508E-06	7.58782E-05
12	12	2.001557E-03	-5.17353E-06	8.33413E-04	-2.17835E-06	6.11831E-05
13	13	2.002164E-03	-3.52431E-06	8.51195E-04	-2.74733E-06	4.89335E-05
14	14	2.002164E-03	-1.78377E-06	8.61058E-04	-3.16965E-06	3.07895E-05
15	15	2.002289E-03	0.	8.65199E-04	-3.42850E-06	1.54090E-05
16	16	2.002289E-03	0.	0.	-3.51571E-06	0.

ROW	COL	U	V	W	BETAX	BETAY
1	1	-2.168404E-19	0.	2.78237E-04	0.	0.
2	2	-4.336039E-19	-1.193239E-06	2.86380E-04	0.779261E-19	4.094730E-05
3	3	0.	-3.04731E-06	3.31423E-04	-7.53941E-19	5.43394E-05
4	4	-2.168404E-19	-5.52536E-06	3.76680E-04	-8.05998E-19	1.07660E-04
5	5	-4.336039E-19	-8.42831E-06	4.71578E-04	-6.77265E-19	1.17813E-04
6	6	-2.168404E-19	-1.01167E-05	5.46956E-04	-8.05998E-19	1.17414E-04
7	7	-4.336039E-19	-1.11492E-05	6.16633E-04	-3.11798E-19	1.10523E-04
8	8	0.	-1.16699E-05	6.77593E-04	-9.46676E-19	9.96583E-05
9	9	-1.091293E-05	-1.091293E-05	7.28636E-04	-2.07313E-19	8.66446E-05
10	10	-5.81976E-06	-5.81976E-06	7.73309E-04	-2.46656E-19	7.25858E-05
11	11	-8.26939E-06	-8.26939E-06	8.02343E-04	-5.53641E-19	5.91893E-05
12	12	-6.45439E-06	-6.45439E-06	8.26473E-04	-7.37618E-19	4.35212E-05
13	13	-4.31594E-06	-4.31594E-06	8.43159E-04	-1.60813E-19	2.89562E-05
14	14	-2.28595E-06	-2.28595E-06	8.52921E-04	-2.74438E-19	1.44587E-05
15	15	0.	0.	0.561185E-04	0.	0.

Fig. 7-6 (Cont.)

LINEAR SOLUTION. PB= 0. -3.26393E-01, BENDING MOMENT= 0.									
ROW 14, X= 9.286, AXIAL LOAD= -3.26393E-01, BENDING MOMENT= 0.									
ROW	0.	X=	Y	M	V	U	BETAX	BETAY	
COL									
1	0.0000	-2.99292E-02	5.524327E-03	5.524327E-03	5.524327E-03	5.524327E-03	-1.52418E-03	0.	0.
2	6.4286	-2.72772E-02	5.224395E-03	5.224395E-03	5.224395E-03	5.224395E-03	-1.52418E-03	5.030865E-03	0.
3	12.8571	-1.99549E-02	4.804409E-03	4.804409E-03	4.804409E-03	4.804409E-03	-1.045428E-03	0.998497E-03	0.
4	19.2857	-1.00049E-02	3.253105E-03	3.253105E-03	3.253105E-03	3.253105E-03	-1.586795E-03	1.121711E-02	0.
5	25.7143	4.836702E-04	1.933083E-03	1.933083E-03	1.933083E-03	1.933083E-03	-1.015057E-03	1.168337E-02	0.
6	32.1429	1.805594E-02	1.647316E-02	1.647316E-02	1.647316E-02	1.647316E-02	1.347024E-03	1.885400E-02	0.
7	38.5714	1.805302E-02	1.513446E-02	1.513446E-02	1.513446E-02	1.513446E-02	2.496773E-03	9.312187E-03	0.
8	45.0000	2.401125E-02	1.335876E-02	1.335876E-02	1.335876E-02	1.335876E-02	3.378212E-03	7.536599E-03	0.
9	51.4286	2.996633E-02	1.162561E-02	1.162561E-02	1.162561E-02	1.162561E-02	4.201102E-03	5.929335E-03	0.
10	57.8571	3.337444E-02	9.413211E-03	9.413211E-03	9.413211E-03	9.413211E-03	4.460702E-03	4.337723E-03	0.
11	64.2857	3.657740E-02	7.445861E-03	7.445861E-03	7.445861E-03	7.445861E-03	4.774308E-03	3.100327E-03	0.
12	70.7143	3.829751E-02	5.525975E-03	5.525975E-03	5.525975E-03	5.525975E-03	4.973527E-03	2.102086E-03	0.
13	77.1429	3.731891E-02	3.653586E-03	3.653586E-03	3.653586E-03	3.653586E-03	5.096417E-03	1.293127E-03	0.
14	83.5714	3.739444E-02	1.912375E-03	1.912375E-03	1.912375E-03	1.912375E-03	5.162721E-03	6.138846E-04	0.
15	90.0000	3.636534E-02	0.	0.	0.	0.	5.183616E-03	0.	0.
ROW 15, X= 10.0000									
COL									
1	0.0000	-4.166132E-02	0.	0.	0.	0.	0.	0.	0.
2	6.4286	-3.789930E-02	1.002963E-02	1.002963E-02	1.002963E-02	1.002963E-02	9.237403E-17	6.950795E-03	0.
3	12.8571	-2.780795E-02	1.724337E-12	1.724337E-12	1.724337E-12	1.724337E-12	1.444157E-16	1.241461E-02	0.
4	19.2857	-1.412558E-02	2.20376E-02	2.20376E-02	2.20376E-02	2.20376E-02	5.61404E-17	1.547025E-02	0.
5	25.7143	3.084401E-04	2.30379E-02	2.30379E-02	2.30379E-02	2.30379E-02	-6.67317E-19	1.603974E-02	0.
6	32.1429	1.355223E-02	2.286826E-02	2.286826E-02	2.286826E-02	2.286826E-02	-2.50073E-17	1.490059E-02	0.
7	38.5714	2.453679E-02	2.095866E-02	2.095866E-02	2.095866E-02	2.095866E-02	-1.682682E-16	1.271737E-02	0.
8	45.0000	3.237403E-02	1.851769E-02	1.851769E-02	1.851769E-02	1.851769E-02	-7.97972E-17	1.821613E-02	0.
9	51.4286	3.940324E-02	1.580475E-02	1.580475E-02	1.580475E-02	1.580475E-02	-1.021460E-16	7.825762E-03	0.
10	57.8571	4.593393E-02	1.303949E-02	1.303949E-02	1.303949E-02	1.303949E-02	-2.35333E-17	5.754715E-03	0.
11	64.2857	4.704145E-02	1.031114E-02	1.031114E-02	1.031114E-02	1.031114E-02	-2.68821E-16	4.061195E-03	0.
12	70.7143	4.912255E-02	7.655566E-03	7.655566E-03	7.655566E-03	7.655566E-03	-2.65417E-16	2.717299E-03	0.
13	77.1429	5.052733E-02	5.052733E-03	5.052733E-03	5.052733E-03	5.052733E-03	-1.184425E-16	1.952483E-03	0.
14	83.5714	5.126133E-02	2.515174E-03	2.515174E-03	2.515174E-03	2.515174E-03	-1.912533E-16	7.752399E-04	0.
15	90.0000	5.149535E-02	0.	0.	0.	0.	0.	0.	0.
ROW 16, X= 0.0000									
COL									
1	0.0000	0.	0.	0.	0.	0.	0.	0.	0.
2	6.4286	-4.629975E-03	0.	0.	0.	0.	0.	0.	0.
3	12.8571	-9.517399E-03	0.	0.	0.	0.	0.	0.	0.
4	19.2857	-1.41742E-02	0.	0.	0.	0.	0.	0.	0.
5	25.7143	-1.050476E-02	0.	0.	0.	0.	0.	0.	0.
6	32.1429	-2.70673E-02	0.	0.	0.	0.	0.	0.	0.
7	38.5714	-2.551099E-02	0.	0.	0.	0.	0.	0.	0.
8	45.0000	-2.99292E-02	0.	0.	0.	0.	0.	0.	0.
9	51.4286	-3.557494E-02	0.	0.	0.	0.	0.	0.	0.
10	57.8571	-3.774137E-02	0.	0.	0.	0.	0.	0.	0.
11	64.2857	-3.644010E-02	0.	0.	0.	0.	0.	0.	0.
12	70.7143	-4.067338E-02	0.	0.	0.	0.	0.	0.	0.
13	77.1429	-4.141338E-02	0.	0.	0.	0.	0.	0.	0.
14	83.5714	-4.166132E-02	0.	0.	0.	0.	0.	0.	0.
15	90.0000	-4.166132E-02	0.	0.	0.	0.	0.	0.	0.

Fig. 7-6 (Cont.)

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
CP SECONDS= 34.630. NR OF IO REQUESTS (TAPE2)= 289. WORDS USED (TAPE2)= 190728. WORDS TRANSFERRED (TAPE2)= 1471872

DETERMINANT OF STIFFNESS MATRIX= 7.3297253E+03*10.00 1548. NUMBER OF NEGATIVE ROOTS = 8
225 MODES. 867 EQUATIONS. MAXIMUM BAND WIDTH = 108
MATRIX DECOMPOSITION COMPLETED.
CP SECONDS= 39.379. NR OF IO REQUESTS (TAPE2)= 319. WORDS USED (TAPE2)= 190728. WORDS TRANSFERRED (TAPE2)= 1789328

EIGENVALUE SHIFT= 7.930000E+00. NUMBER OF NEGATIVE ROOTS= 8

ITERATION	EIGENVALUE (RAYLEIGH QUOTIENT)	EIGENVALUE (ACCELERATED ESTIMATE)
0	8.615603E+00	7.030000E+00
1	1.997210E+01	6.731189E+00
2	1.639246E+01	1.721382E+01
3	1.528276E+01	1.428053E+01
4	1.449944E+01	1.314835E+01
5	1.415895E+01	1.307864E+01
6	1.401332E+01	1.307762E+01
7	1.394125E+01	1.306970E+01
8	1.391184E+01	1.305172E+01
9	1.387426E+01	1.301803E+01
10	1.385130E+01	1.374197E+01
11	1.380716E+01	1.345036E+01
12	1.381963E+01	9.316459E+00
13	1.373350E+01	2.409952E+01
14	1.376751E+01	1.056933E+01
15	1.374695E+01	1.261393E+01

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
CP SECONDS= 59.326. NR OF IO REQUESTS (TAPE2)= 765. WORDS USED (TAPE2)= 238912. WORDS TRANSFERRED (TAPE2)= 4452488

DETERMINANT OF STIFFNESS MATRIX= 2.1192429E+08*13.00 1539. NUMBER OF NEGATIVE ROOTS = 8
225 MODES. 867 EQUATIONS. MAXIMUM BAND WIDTH = 108
MATRIX DECOMPOSITION COMPLETED.
CP SECONDS= 64.726. NR OF IO REQUESTS (TAPE2)= 893. WORDS USED (TAPE2)= 238912. WORDS TRANSFERRED (TAPE2)= 4689336

EIGENVALUE SHIFT= 1.1722826E+01. NUMBER OF NEGATIVE ROOTS= 8

ITERATION	EIGENVALUE (RAYLEIGH QUOTIENT)	EIGENVALUE (ACCELERATED ESTIMATE)
0	1.370480E+01	1.379874E+01
1	1.364771E+01	1.331674E+01
2	1.354253E+01	1.302459E+01
3	1.346259E+01	1.306827E+01
4	1.349938E+01	1.323891E+01
5	1.346314E+01	1.329271E+01
6	1.343515E+01	1.333648E+01
7	1.341455E+01	1.335637E+01
8	1.339374E+01	1.336548E+01
9	1.339172E+01	1.335903E+01
10	1.338312E+01	1.337289E+01
11	1.337936E+01	1.337371E+01
12	1.337934E+01	1.337423E+01
13	1.337627E+01	1.337479E+01
14	1.337564E+01	1.337508E+01

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 1.337581E+01 TIMES THE STARTING LOAD.

Fig. 7-6 (Cont.)

ROW	COL	0.	X=	5.0000	M	V	U	DETAX	DETAY
1	1	0.0000		4.321592E-02		0.	-7.000706E-03	9.015740E-02	0.
2	2	16.4236		-3.754991E-02		-1.15658E-03	-2.236617E-03	4.639423E-02	-1.170621E-01
3	3	1.9551		-1.151036E-01		1.52250E-02	6.764375E-03	-9.58467E-02	5.918444E-02
4	4	12.2137		2.759321E-02		2.50392E-02	8.632317E-03	-1.030846E-01	2.085529E-01
5	5	2.7113		2.734324E-01		2.55358E-03	-5.352837E-04	-1.416835E-02	1.415650E-01
6	6	3.1143		2.42355E-01		-5.16213E-02	-1.122562E-02	2.972331E-01	-2.37303E-01
7	7	3.7714		-7.114637E-02		-4.39597E-02	-1.237037E-02	3.588460E-01	-5.060297E-01
8	8	3.3233		-3.71623E-01		-2.51500E-02	-3.310245E-03	8.327463E-02	-3.05957E-01
9	9	51.4236		-4.400720E-01		5.174501E-03	0.071806E-03	-1.66259E-01	0.910656E-02
10	10	57.8571		-2.935994E-01		2.96433E-02	1.425761E-02	-5.52339E-01	3.755365E-01
11	11	54.2937		-5.72717E-02		4.37233E-02	1.269735E-02	-9.97335E-01	4.364108E-01
12	12	7.7143		1.42442E-01		3.86276E-02	5.301445E-03	-1.91549E-01	3.340404E-01
13	13	7.7143		2.66112E-01		2.05324E-02	-4.004313E-03	2.46235E-01	1.870567E-01
14	14	93.5714		3.203262E-01		1.48977E-02	-1.136551E-02	5.25335E-01	7.327494E-02
15	15	90.0000		3.547771E-01		0.	-1.412590E-02	6.456703E-01	0.

ROW	COL	15.	X=	10.3300	M	V	U	DETAX	DETAY
1	1	4.0000		-7.023973E-02		0.	-1.734723E-18	0.	0.
2	2	16.4236		-1.665225E-03		9.216305E-03	0.	-2.561251E-17	1.419264E-01
3	3	12.8521		1.233975E-01		-3.581240E-02	3.469447E-18	-2.567391E-16	6.812003E-02
4	4	1.2357		9.638355E-02		-2.527400E-02	1.084202E-18	-2.914335E-16	-2.208665E-01
5	5	2.7113		-1.644328E-01		-2.285580E-02	-3.469447E-19	4.302114E-16	-3.700270E-01
6	6	3.1143		-3.647425E-01		1.26193E-02	0.	9.326673E-16	-6.977699E-02
7	7	3.7714		-2.776139E-01		4.962286E-02	0.	1.214735E-15	4.791106E-01
8	8	45.0000		1.617935E-01		5.65323E-02	0.	-7.494405E-16	7.810281E-01
9	9	51.4236		6.162306E-01		2.87115E-02	6.93894E-18	-2.053915E-15	5.678401E-01
10	10	57.8571		7.963441E-01		-1.861337E-02	1.387779E-17	-8.326673E-16	-3.212141E-02
11	11	54.2937		6.043164E-01		6.933994E-13	6.933994E-13	-8.510231E-16	-6.808720E-01
12	12	7.7143		1.356619E-01		-8.240505E-02	2.602085E-18	-6.106227E-16	-1.069355E-00
13	13	7.7143		-4.136172E-01		-7.586635E-02	-6.938994E-18	9.506285E-16	-1.046041E-00
14	14	83.5714		-2.404526E-01		-4.474047E-02	0.	1.353004E-15	-6.374716E-01
15	15	92.0000		-1.030300E+00		0.	0.	0.	0.

COL	ROW	1.	X=	0.0000	M	V	U	DETAX	DETAY
1	1	0.0000		0.		0.	5.082564E-03	0.	0.
2	2	7.7143		-7.975553E-02		0.	6.44937E-03	-1.131766E-01	0.
3	3	1.4236		-1.61600E-01		0.	6.028812E-03	-0.860778E-02	0.
4	4	2.1429		-2.063421E-01		0.	3.858973E-03	-2.224949E-02	0.
5	5	2.8571		-1.934658E-01		0.	1.583649E-04	5.347089E-02	0.
6	6	3.5714		-1.239551E-01		0.	-3.703292E-03	1.066974E-01	0.
7	7	4.2957		-4.17497E-02		0.	-5.357132E-03	1.212197E-01	0.
8	8	5.0000		4.321592E-02		0.	-7.000706E-03	9.015740E-02	0.
9	9	5.7143		9.918383E-02		0.	-5.776354E-03	5.056740E-02	0.
10	10	6.4286		1.154443E-01		0.	-3.148426E-03	-9.92028E-03	0.
11	11	7.1429		9.349300E-02		0.	-2.510307E-04	-8.92555E-02	0.
12	12	7.9571		4.57435E-02		0.	1.874169E-03	-7.265212E-02	0.
13	13	8.5714		-1.025345E-02		0.	2.561735E-03	-6.950052E-02	0.
14	14	9.2957		-5.357812E-02		0.	1.751844E-03	-4.20002E-02	0.
15	15	10.0000		-7.023973E-02		0.	-1.734723E-18	0.	0.

676902

WORDS TRANSFERRED (TAPE2)=

230912.

WORDS USED (TAPE2)=

1126.

REQUESTS (TAPE2)=

70.758.

NR OF IO

Fig. 7-6 (Cont.)

7.3 SAMPLE CASE 3 - CYLINDER WITH RECTANGULAR CUTOUT

This case demonstrates calculation of the buckling load, according to bifurcation theory, for a cylinder with rectangular cutout (Fig. 7-7) and subjected to a uniform line load applied on boundary line 1. Because of symmetry, only one eighth of the shell needs to be analyzed. The input cards associated with this case are illustrated in Fig. 7-8. Portions of the output are presented in Fig. 7-9. The output is the same as in Sample Case 2.

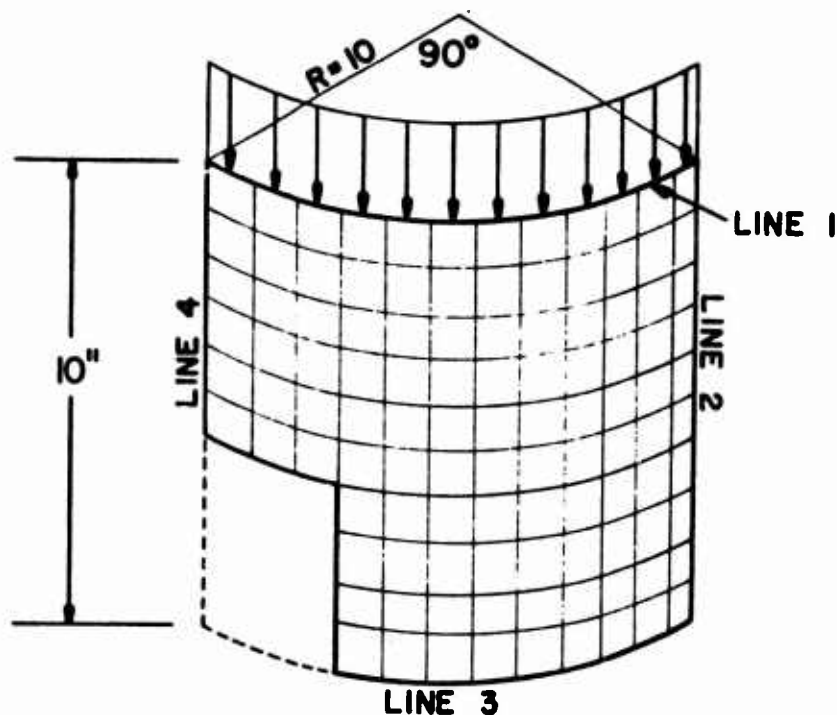


Fig. 7-7 Sample Case 3 - Cylinder With Rectangular Cutout

SAMPLE CASE 3 INPUT

SAMPLE CASE 3 - CYLINDER WITH RECTANGULAR CUTOUT										
1	1	1								C-1
10.0		90.0		10.0						G-1
11	13	7	11	4						G-2
1	4	4	4							D-1
1	0	1.								B-1
0.	0.		1.		0	0	2	1	0	L-1
0.0	0.0		0	0	20					L-2
0	0	0	1	2	1	1				P-1A
10.										O-1
22.5	90.									O-2
2										O-3
0.1	100 00000 . 0.3		0.							M-1
										M-2B

Fig. 7-8 Display of Input Cards for Sample Case 3

SAMPLE CASE 3 - OUTPUT

```

SAMPLE CASE 3 - CYLINDER WITH RECTANGULAR CUTOUT
BUCKLING ANALYSIS.
1 LOAD PATTERNS.
TYPE OF SURFACE IS CYLINDER
SURFACE CONSTANTS = 1.000000E+01, 9.000000E+01, 1.000000E+01,
BLANK COMMON ARRAY WORKING SPACE= 19888
FINITE DIFFERENCE MESH. 11 ROWS, 13 COLUMNS. MESH SPACING. M= 1.0000, N= 7.5000
NRM1= 7, NRM2= 11, NCL1= 4
BOUNDARY CONDITION AT LINE 1 IS SIMPLESUPRT.
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
LOAD A DATA
CAPD COUNT = 1
USER-LOAD FLAG = 0. STARTING LOAD FACTOR = 1.000000E+00, LOAD STEP = -0.
, MAXIMUM LOAD = 1.000000E+00
PZ 0. PY PX JZ JY JX ROW COL
1.000000E+00 0 0 2 1 0
ISWIFT ITERAT SWIFT
0 20 3.
IPX= 1 IPY= 2 IPZ= 1 IPQS= 1 IPLOT= -0
INALL= 2. NSTR1= -0. NSTR2= -0. IP= -0. IM= -0. JN= 20
AT = 1.000000E-01 EX1 = 1.000000E+07 XNU = 3.000000E-01
Z = 0. EY1 = 1.000000E+07 G = 3.000000E+06
THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CPO2
CCC(I,1) CCC(I,2) CCC(I,3) CCC(I,4) CCC(I,5) CCC(I,6)
1.000001E+06 0. 0. 0. 0. 0.
3.296703E+05 1.000001E+06 0. 0. 0. 0.
0. 0. 3.000150E+05 0. 0. 0.
0. 0. 0. 9.157500E+02 0. 0.
0. 0. 0. 2.747253E+02 9.157500E+02 3.205120E+02

```

Fig. 7-9 Excerpt of Output for Sample Case 3

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECTIONS= 1.753. NR OF IO REQUESTS (TAPE2)= 12. WORDS USED (TAPE2)= 33072. WORDS TRANSFERRED (TAPE2)= 33960
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECTIONS= 3.464. NR OF IO REQUESTS (TAPE2)= 26. WORDS USED (TAPE2)= 59536. WORDS TRANSFERRED (TAPE2)= 93392
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECTIONS= 4.058. NR OF IO REQUESTS (TAPE2)= 34. WORDS USED (TAPE2)= 79552. WORDS TRANSFERRED (TAPE2)= 139072
 DETERMINANT OF STIFFNESS MATRIX= 5.234592E+08*10.00 950. NUMBER OF NEGATIVE ROOTS = 0
 143 MODES. 545 EQUATIONS. MAXIMUM BAND WIDTH = 84
 MATRIX RECOMPOSITION COMPLETED.
 CP SECTIONS= 6.352. NR OF IO REQUESTS (TAPE2)= 42. WORDS USED (TAPE2)= 79552. WORDS TRANSFERRED (TAPE2)= 101192

LINEAR SOLUTION. PA= 1.000000E+00. PB= 0.
 ROW 10. X= 9.000. AXIAL LOAD= -1.570796E+01. BENDING MOMENT= 0.

ROW	10.	X	Y	U	V	BETAX	BETAY
1	0.0000	2.191537E-04	9.327852E-05	0.	0.	0.	-1.435874E-06
2	0.0000	2.256704E-04	6.589299E-05	-2.541099E-21	0.	0.	-1.118126E-05
3	0.0000	2.071320E-04	3.829360E-05	-1.690861E-21	0.	0.	-2.937141E-05
4	0.0000	1.580799E-04	1.668096E-05	-1.588187E-22	0.	0.	-6.449649E-05
5	0.0000	9.440079E-05	-1.724786E-06	-4.235165E-24	0.	0.	-6.650813E-05
6	0.0000	3.608724E-05	-1.007722E-05	-2.117582E-22	0.	0.	-3.678242E-05
7	0.0000	-4.455557E-06	-1.185187E-05	-6.470329E-22	0.	0.	-2.252948E-05
8	0.0000	-2.590575E-05	-9.464011E-06	-8.470329E-22	0.	0.	-1.034077E-05
9	0.0000	-3.400117E-05	-5.070356E-06	-8.470329E-22	0.	0.	-3.228146E-06
10	0.0000	-3.577502E-05	0.	-8.470329E-22	0.	0.	0.
11	0.0000	0.	0.	0.	0.	0.	0.
12	0.0000	0.	0.	0.	0.	0.	0.
13	0.0000	0.	0.	0.	0.	0.	0.
14	0.0000	0.	0.	0.	0.	0.	0.
15	0.0000	0.	0.	0.	0.	0.	0.
16	0.0000	0.	0.	0.	0.	0.	0.
17	0.0000	0.	0.	0.	0.	0.	0.
18	0.0000	0.	0.	0.	0.	0.	0.
19	0.0000	0.	0.	0.	0.	0.	0.
20	0.0000	0.	0.	0.	0.	0.	0.
21	0.0000	0.	0.	0.	0.	0.	0.
22	0.0000	0.	0.	0.	0.	0.	0.
23	0.0000	0.	0.	0.	0.	0.	0.
24	0.0000	0.	0.	0.	0.	0.	0.
25	0.0000	0.	0.	0.	0.	0.	0.
26	0.0000	0.	0.	0.	0.	0.	0.
27	0.0000	0.	0.	0.	0.	0.	0.
28	0.0000	0.	0.	0.	0.	0.	0.
29	0.0000	0.	0.	0.	0.	0.	0.
30	0.0000	0.	0.	0.	0.	0.	0.
31	0.0000	0.	0.	0.	0.	0.	0.
32	0.0000	0.	0.	0.	0.	0.	0.
33	0.0000	0.	0.	0.	0.	0.	0.
34	0.0000	0.	0.	0.	0.	0.	0.
35	0.0000	0.	0.	0.	0.	0.	0.
36	0.0000	0.	0.	0.	0.	0.	0.
37	0.0000	0.	0.	0.	0.	0.	0.
38	0.0000	0.	0.	0.	0.	0.	0.
39	0.0000	0.	0.	0.	0.	0.	0.
40	0.0000	0.	0.	0.	0.	0.	0.
41	0.0000	0.	0.	0.	0.	0.	0.
42	0.0000	0.	0.	0.	0.	0.	0.
43	0.0000	0.	0.	0.	0.	0.	0.
44	0.0000	0.	0.	0.	0.	0.	0.
45	0.0000	0.	0.	0.	0.	0.	0.
46	0.0000	0.	0.	0.	0.	0.	0.
47	0.0000	0.	0.	0.	0.	0.	0.
48	0.0000	0.	0.	0.	0.	0.	0.
49	0.0000	0.	0.	0.	0.	0.	0.
50	0.0000	0.	0.	0.	0.	0.	0.
51	0.0000	0.	0.	0.	0.	0.	0.
52	0.0000	0.	0.	0.	0.	0.	0.
53	0.0000	0.	0.	0.	0.	0.	0.
54	0.0000	0.	0.	0.	0.	0.	0.
55	0.0000	0.	0.	0.	0.	0.	0.
56	0.0000	0.	0.	0.	0.	0.	0.
57	0.0000	0.	0.	0.	0.	0.	0.
58	0.0000	0.	0.	0.	0.	0.	0.
59	0.0000	0.	0.	0.	0.	0.	0.
60	0.0000	0.	0.	0.	0.	0.	0.
61	0.0000	0.	0.	0.	0.	0.	0.
62	0.0000	0.	0.	0.	0.	0.	0.
63	0.0000	0.	0.	0.	0.	0.	0.
64	0.0000	0.	0.	0.	0.	0.	0.
65	0.0000	0.	0.	0.	0.	0.	0.
66	0.0000	0.	0.	0.	0.	0.	0.
67	0.0000	0.	0.	0.	0.	0.	0.
68	0.0000	0.	0.	0.	0.	0.	0.
69	0.0000	0.	0.	0.	0.	0.	0.
70	0.0000	0.	0.	0.	0.	0.	0.
71	0.0000	0.	0.	0.	0.	0.	0.
72	0.0000	0.	0.	0.	0.	0.	0.
73	0.0000	0.	0.	0.	0.	0.	0.
74	0.0000	0.	0.	0.	0.	0.	0.
75	0.0000	0.	0.	0.	0.	0.	0.
76	0.0000	0.	0.	0.	0.	0.	0.
77	0.0000	0.	0.	0.	0.	0.	0.
78	0.0000	0.	0.	0.	0.	0.	0.
79	0.0000	0.	0.	0.	0.	0.	0.
80	0.0000	0.	0.	0.	0.	0.	0.
81	0.0000	0.	0.	0.	0.	0.	0.
82	0.0000	0.	0.	0.	0.	0.	0.
83	0.0000	0.	0.	0.	0.	0.	0.
84	0.0000	0.	0.	0.	0.	0.	0.
85	0.0000	0.	0.	0.	0.	0.	0.
86	0.0000	0.	0.	0.	0.	0.	0.
87	0.0000	0.	0.	0.	0.	0.	0.
88	0.0000	0.	0.	0.	0.	0.	0.
89	0.0000	0.	0.	0.	0.	0.	0.
90	0.0000	0.	0.	0.	0.	0.	0.
91	0.0000	0.	0.	0.	0.	0.	0.
92	0.0000	0.	0.	0.	0.	0.	0.
93	0.0000	0.	0.	0.	0.	0.	0.
94	0.0000	0.	0.	0.	0.	0.	0.
95	0.0000	0.	0.	0.	0.	0.	0.
96	0.0000	0.	0.	0.	0.	0.	0.
97	0.0000	0.	0.	0.	0.	0.	0.
98	0.0000	0.	0.	0.	0.	0.	0.
99	0.0000	0.	0.	0.	0.	0.	0.
100	0.0000	0.	0.	0.	0.	0.	0.

Fig. 7-9 (Cont.)

7.4 SAMPLE CASE 4 - TOROIDAL SHELL

The critical axial load according to bifurcation theory is to be determined for a toroidal shell segment simply supported at circular edges and stiffened with internal stringers. Because this is a shell of revolution with axially symmetrical loading, it could be analyzed with a one dimensional computer program. Such cases are included here because they provide an opportunity to check the program. The geometry of the shell is shown in Fig. 7-10.

It is assumed here that the critical axial load is obtained for a mode with 36 circumferential waves. Therefore, a shell covering one half the length and $1/144$ of the circumference can be analyzed. That is, the shell segment is expected to buckle with one quarter of a sine wave in the circumferential direction. Thus, on the sides formed by the generators (2 and 4), symmetry will be used for both in the prebuckling analysis and symmetry for one and antisymmetry for the other in the buckling analysis. The input cards associated with this case are displayed in Fig. 7-11. Portions of the output are presented in Fig. 7-12.

For zero initial eigenvalue shift, the buckling load obtained was -1780 lb/in. (i. e. tension). To obtain a compressive buckling load, a run was performed with an initial eigenvalue shift of $+1780$, but the results were again -1780 lb/in. This indicates that the compressive buckling load must be greater than 5340 . Therefore, an initial eigenvalue shift of 5340 was tried leading to a bifurcation load of 6390 lb/in.

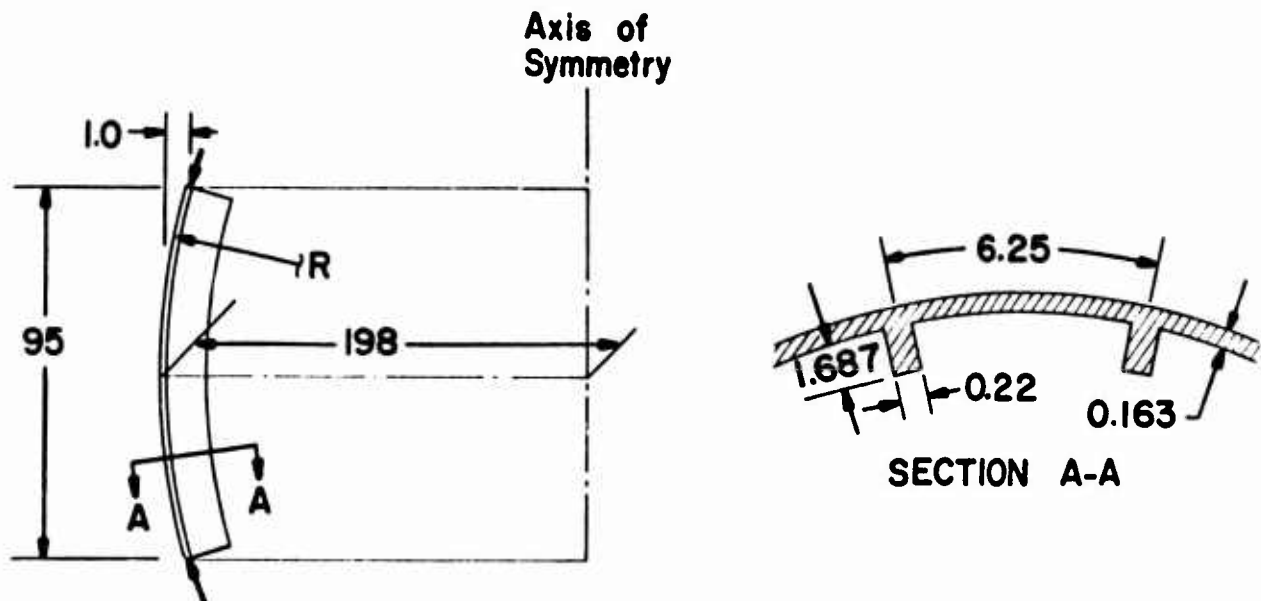


Fig. 7-10 Sample Case 4 - Toroidal Shell

SAMPLE CASE 4
INPUT

SAMPLE CASE 4 - TORUS										
8	1	1								C-1
87.59		90.0	2.5		-930.625	1128.625				G-1
9	7									G-2
1	4	4	4							D-1
1	0	1.								B-1
0.		0.	1.		0	0	2	1	0	L-1
		5340.0		1	1	16				L-2
1	4	4	5							P-1A
0	0	1	3	0	1	1				P-1A1
0.		0.9037	2.41							O-1
2	1									O-2
.163		10000000.	.3		0.0					M-1
10000000.	.3		0.		6.25	0.				M-2B
.22		1.687								N-1
										N-2A

Fig. 7-11 Display of Input Cards for Sample Case 4

SAMPLE CASE 4 - OUTPUT

```

SAMPLE CASE 4 - TORUS
BUCKLING ANALYSIS.
1 LOAD PATTERNS.
TYPE OF SURFACE IS TORUS
SURFACE CONSTANTS = 0.750000E+01, 9.000000E+01, 2.500000E+00, -9.3062500E+02, 1.1206250E+03,
SLANK COMMON ARRAY WORKING SPACE= 15008
FINITE DIFFERENCE MESM. 9 ROWS, 7 COLUMNS. MESM SPACING. M= .3012, K= .4167
NRMS= -0, NRM2= -0, NCL1= -0
BOUNDARY CONDITION AT LINE 1 IS SIMPLESUPRT.
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
LOAD & DATA
CARD COUNT = 1
USER-LOAD FLAG = 0, STARTING LOAD FACTOR = 1.000000E+00, LOAD STEP = -0, MAXIMUM LOAD = 1.00000000E+00
0. PZ 0. PY PX 1.000000E+00 JZ JY JX ROW COL
1 1 1 1 1 1 1 1 1 1
BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS
BOUNDARY CONDITION AT LINE 1 IS SIMPLESUPRT.
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS ANTI-METRIC
ISUFT ITERAT SHIFT
1 15 5.34000E+03
1PXS= 3 IPY= 0 IPQS= 1 IPAS= 1 IPLOT= -0
14ALL= 2, NSTRI= 1, NMING= -0, IP= -0, IM= -0, JM= -0
AT = 1.630000E-01 EX1 = 1.000000E+07 XNU = 3.0000000E-01
Z = 1. EY1 = 1.000000E+07 G = 3.0461530E+06
THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CF82
CCCC(1,1) CCCC(1,2) CCCC(1,3) CCCC(1,4) CCCC(1,5) CCCC(1,6)
1.791209E+06 0. 0. 0. 0. 0.
5.373526E+05 1.791209E+06 0. 0. 0. 0.
0. 0. 6.269231E+05 0. 0. 0.
0. 0. 0. 3.965806E+03 0. 0.
0. 0. 0. 1.189766E+03 0. 0.
0. 0. 0. 0. 1.380060E+03 0.
ANALYSIS IS FOR A SHELL STIFFENED BY STRINGERS ONLY.
INTERNAL STRINGERS.
MODULUS OF ELASTICITY = 1.60000000E+07 POISSON RATIO = 3.0000000E-01 STRINGER SPACING = 6.25000000E+00
RECTANGULAR STIFFENER (STRINGER) DATA.
STRINGER THICKNESS = 2.2000000E-01 STRINGER HEIGHT = 1.60700000E+00

```

Fig. 7-12 Excerpt of Output for Sample Case 4

```

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE STIFF
CCC(I,1) CCC(I,2) CCC(I,3) CCC(I,4) CCC(I,5) CCC(I,6)
2.395031E+04 0. 0. 0. 0. 0.
5.373626E+05 1.791200E+06 0. 0. 0. 0.
0. 0. 6.269231E+05 0. 0. 0.
-5.692072E+05 0. 0. 6.520903E+05 0. 0.
0. 0. 0. 1.109706E+03 0. 2.309240E+03
0. 0. 0. 0. 0. 0.

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
CP SECCOVS= 1.117. NR OF IO REQUESTS (TAPE2)= 11. WORDS USED (TAPE2)= 20560. WORDS TRANSFERRED (TAPE2)= 30600
FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
CP SECCOVS= 6.246. NR OF IO REQUESTS (TAPE2)= 22. WORDS USED (TAPE2)= 62504. WORDS TRANSFERRED (TAPE2)= 87600
ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
CP SECCOVS= 6.512. NR OF IO REQUESTS (TAPE2)= 26. WORDS USED (TAPE2)= 69596. WORDS TRANSFERRED (TAPE2)= 88496

DETERMINANT OF STIFFNESS MATRIX= 1.6490677E+01*10.** 490. NUMBER OF NEGATIVE ROOTS = 0
53 NOTES. 297 EQUATIONS. MAXIMUM BAND WIDTH = 60
MATRIX DECOMPOSITION COMPLETED.
CP SECCOVS= 5.287. NR OF IO REQUESTS (TAPE2)= 30. WORDS USED (TAPE2)= 69596. WORDS TRANSFERRED (TAPE2)= 103540

LINEAR SOLUTION. PA= 1.800000E+00. PB= 0.
ROW 8. X= 2.109. AXIAL LOAD= -0.599771E+00. BENDING MOMENT= 0.

ROW 1. X= 0.3000
X Y SIGMAX SIGMAY SIGMAX SIGMAY TAU SIGMA (STRNGR) SIGMA (RING)
0.000 0.000 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 -4.17 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 -933 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 1.250 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 1.667 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 2.003 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.
0.000 2.500 -4.6059E+00 -1.3310E+00 -4.6062E+00 -1.3351E+00 0. 0. 0.

ROW 9. X= 2.4100
X Y SIGMAX SIGMAY SIGMAX SIGMAY TAU SIGMA (STRNGR) SIGMA (RING)
2.410 0.000 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 -4.17 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 -833 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 1.250 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 1.667 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 2.003 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
2.410 2.500 -4.6064E+00 1.2225E+00 -4.6062E+00 1.1994E+00 0. 0. 0.
CP SECCOVS= 0.115. NR OF IO REQUESTS (TAPE2)= 50. WORDS USED (TAPE2)= 50100. WORDS TRANSFERRED (TAPE2)= 170400

```

Fig. 7-12 (Cont.)

ROW COL	1. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	0.3800	0.	2.265681E-05	9.127910E-07	0.
2	.4167	0.	0.	0.	2.265681E-05	9.127910E-07	0.
3	.8333	0.	0.	0.	2.265681E-05	9.127910E-07	0.
4	1.2500	0.	0.	0.	2.265681E-05	9.127910E-07	0.
5	1.6667	0.	0.	0.	2.265681E-05	9.127910E-07	1.953312E-36
6	2.0833	0.	0.	0.	2.265681E-05	9.127910E-07	0.
7	2.5000	0.	0.	-3.051060E-34	2.265681E-05	9.127910E-07	0.

ROW COL	4. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	-9037	0.	1.457937E-05	1.679694E-06	0.
2	.4167	0.	2.766562E-05	-4.361086E-20	1.457937E-05	1.679694E-06	-1.482307E-19
3	.8333	0.	2.766562E-05	-5.085992E-20	1.457937E-05	1.679694E-06	-2.806149E-19
4	1.2500	0.	2.766562E-05	-5.081594E-20	1.457937E-05	1.679694E-06	-6.775545E-19
5	1.6667	0.	2.766562E-05	-5.053377E-20	1.457937E-05	1.679694E-06	-1.193583E-18
6	2.0833	0.	2.766562E-05	-4.632256E-20	1.457937E-05	1.679694E-06	-1.263887E-18
7	2.5000	0.	2.766562E-05	0.	1.457937E-05	1.679694E-06	0.

ROW COL	9. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	2.4100	0.	-1.694066E-21	1.501000E-24	0.
2	.4167	0.	4.947361E-05	-6.034701E-20	-1.694066E-21	1.501000E-24	-7.706834E-19
3	.8333	0.	4.947361E-05	-1.837580E-19	-3.388132E-21	3.002000E-24	-1.471363E-18
4	1.2500	0.	4.947361E-05	-1.372480E-19	-1.694066E-21	1.501000E-24	-2.526331E-18
5	1.6667	0.	4.947361E-05	-1.257030E-19	-3.388132E-21	3.002000E-24	-2.873048E-18
6	2.0833	0.	4.947361E-05	-5.655299E-20	0.	0.	-2.242589E-18
7	2.5000	0.	4.947361E-05	0.	0.	0.	0.

ROW COL	1. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	0.0000	0.	0.	2.307871E-01	0.
2	.4167	0.	-1.000342E+00	-2.173530E-01	0.	2.307871E-01	7.238550E-06
3	.8333	0.	-1.000342E+00	-2.173530E-01	6.66697E-14	2.307871E-01	7.238550E-06
4	1.2500	0.	-1.000342E+00	-2.173530E-01	2.589962E-15	2.307871E-01	7.238550E-06
5	1.6667	0.	-1.000342E+00	-2.173530E-01	6.012893E-15	2.307871E-01	7.238550E-06
6	2.0833	0.	-1.000342E+00	-2.173530E-01	2.196639E-14	2.307871E-01	7.238550E-06
7	2.5000	0.	-1.000342E+00	-2.173530E-01	-4.190884E-15	2.307871E-01	7.238550E-06

ROW COL	4. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	-9037	0.	0.	2.793657E-01	0.
2	.4167	0.	-9.975970E-01	1.975268E-02	0.	2.793657E-01	8.031298E-05
3	.8333	0.	-9.975970E-01	1.975268E-02	4.082477E-14	2.793657E-01	8.031298E-05
4	1.2500	0.	-9.975970E-01	1.975268E-02	2.822526E-14	2.793657E-01	8.031298E-05
5	1.6667	0.	-9.975970E-01	1.975268E-02	9.754309E-14	2.793657E-01	8.031298E-05
6	2.0833	0.	-9.975970E-01	1.975268E-02	1.833653E-14	2.793657E-01	8.031298E-05
7	2.5000	0.	-9.975970E-01	1.975268E-02	8.033192E-14	2.793657E-01	8.031298E-05


ROW COL	9. X	Y	M	V	U	BETAX	BETAY
1	0.0000	0.	2.4100	0.	0.	2.786256E-01	0.
2	.4167	0.	-9.953384E-01	1.973810E-01	0.	2.786256E-01	5.103531E-05
3	.8333	0.	-9.953384E-01	1.973810E-01	6.943357E-24	2.786256E-01	5.103531E-05
4	1.2500	0.	-9.953384E-01	1.973810E-01	1.537333E-23	2.786256E-01	5.103531E-05
5	1.6667	0.	-9.953384E-01	1.973810E-01	2.033545E-23	2.786256E-01	5.103531E-05
6	2.0833	0.	-9.953384E-01	1.973810E-01	1.8662488E-23	2.786256E-01	5.103531E-05
7	2.5000	0.	-9.953384E-01	1.973810E-01	8.379195E-24	2.786256E-01	5.103531E-05

Fig. 7-12 (Cont.)

7.5 SAMPLE CASE 5 - CORRUGATED CYLINDER

The critical axial line load according to bifurcation theory is to be determined for a simply supported corrugated circular cylindrical shell stiffened with internal rings. Because this is a shell of revolution with axially symmetrical loading, it could be analyzed with the BOSOR4 computer program (Ref. 15) leading to a critical axial line load of 952 lb/in. for a mode with 7 circumferential waves. Therefore, a shell segment covering one half the length and $1/28$ of the circumference can be analyzed. That is, the shell segment is expected to buckle with one quarter of a sine wave in the circumferential direction. Thus, the boundary condition on lines 2 and 4 is identical to that of Sample Case 4 both for the prebuckling and for the buckling analysis. The geometry of the shell is shown in Fig. 7-13. The input cards associated with this case are displayed in Fig. 7-14. Portions of the output are presented in Fig. 7-15.

To check the branch for arbitrary stiffeners, the rectangular rings with 4.0-in. spacing were described in the input as arbitrary rings, and to reduce the number of iterations, an initial eigenvalue shift at 1000.0 was utilized. The critical axial line load determined here is 987 lb/in.



SAMPLE CASE 5
INPUT

Fig. 7-14 Display of Input Cards for Sample Case 5

SAMPLE CASE 5 - OUTPUT

```

SAMPLE CASE 5 - CORRUGATED CYLINDER
BUCKLING ANALYSIS.
1 LOAD PATTERNS.
TYPE OF SURFACE IS CYLINDER
SURFACE CONSTANTS = 5.000000E+01, 1.2057000E+01, 1.0000000E+02,
BLANK COMMON ARRAY WORKING SPACE= 19000
FINITE DIFFERENCE MESH. 31 ROWS, 7 COLUMNS. MESH SPACING. M= 1.0007, K= 2.1020
NPM1= -0. NPM2= -0. NCL1= -0
BOUNDARY CONDITION AT LINE 1 IS SIMPLESUPRT.
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
LOAD A DATA
CAPD COUNT = 1
USER-LOAD FLAG = 0. STARTING LOAD FACTOR = 1.000000E+00. LOAD STEP = -0. , MAXIMUM LOAD = 1.0000000E+00
0. PZ 0. PY PX 1.000000E+00 JZ JY JX ROW COL
1 1 1 1 1 1 1 1 1
BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS
BOUNDARY CONDITION AT LINE 1 IS SIMPLESUPRT.
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
IShift ITERAT Shift
2 20 1.00000E+03
IPX= 3 1.0 0 IPRO= 1 IPRS= 1 IPLOT= -0
IWALL= 6. NSTRI= 0. NRING= 1. IP= -0. IM= -0. JM= -0
ANALYSIS IS FOR A SHELL WITH CORRUGATED SKIN.
MODULUS OF ELASTICITY = 1.0000000E+07 POISSON RATIO = 3.0000000E-01
C = 4.0000000E-01 M = 6.0000000E-01 D = 7.0000000E-01 Y = 2.0000000E-02 B = 1.0000000E+00
Z = 0.
THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CF06
CCC(1,1) CCC(1,2) CCC(1,3) CCC(1,4) CCC(1,5) CCC(1,6)
2.733278E+05 0. 0. 0. 0. 0.
0. 0. 0. 0. 0. 0.
-1.197026E+04 0. 0. 0. 0. 0.
0. 0. 0. -3.371061E+03 0. 0.
ANALYSIS IS FOR A SHELL STIFFENED BY RINGS ONLY.
INTERNAL RINGS.
MODULUS OF ELASTICITY = 1.0000000E+07 POISSON RATIO = 3.0000000E-01 RING SPACING = 4.0000000E+00

```

Fig. 7-15 Excerpt of Output for Sample Case 5

ARBITRARY STIFFNESS (RING) DATA.

CROSS-SECTION	MOMENT OF INERTIA, IX	MOMENT OF INERTIA, IZ	TORSIONAL STIFFNESS	ECCENTRICITY	RING WEIGHT
5.00000E-01	4.10000E-02	0.	1.976923E+05	5.00000E-01	1.00000E+00

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE STIFF

CCC(I,1)	CCC(I,2)	CCC(I,3)	CCC(I,4)	CCC(I,5)	CCC(I,6)
2.733273E+05	0.	0.	0.	0.	0.
0.	1.230000E+06	0.	0.	0.	0.
0.	0.	0.626631E+04	0.	0.	0.
-1.197826E+04	0.	0.	1.406740E+04	0.	0.
0.	-1.000000E+06	0.	0.	9.025034E+05	0.
0.	0.	-3.371061E+03	0.	0.	1.005860E+04

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.

CP SECONDS= 2.616. NR OF 10 REQUESTS (TAPE2)= 15. WORDS USED (TAPE2)= 51464. WORDS TRANSFERRED (TAPE2)= 55560

FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.

CP SECONDS= 5.619. NR OF 10 REQUESTS (TAPE2)= 35. WORDS USED (TAPE2)= 94831. WORDS TRANSFERRED (TAPE2)= 148390

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.

CP SECONDS= 6.445. NR OF 10 REQUESTS (TAPE2)= 49. WORDS USED (TAPE2)= 121075. WORDS TRANSFERRED (TAPE2)= 220099

DETERMINANT OF STIFFNESS MATRIX= 1.763338E+01*10⁻⁶. 1928. NUMBER OF NEGATIVE ROOTS = 8

ZIP NOTES. 891 EQUATIONS. MAXIMUM BAND WIDTH = 60

MATRIX DECOMPOSITION COMPLETED.

CP SECONDS= 9.155. NR OF 10 REQUESTS (TAPE2)= 59. WORDS USED (TAPE2)= 121075. WORDS TRANSFERRED (TAPE2)= 282639

LINEAR SOLUTION. PA= 1.00000E+00. PB= 0.

PDW 19. X= 48.333. AXIAL LOAD= -2.243970E+01. BENDING MOMENTS. 0.

AXIAL STRESS		INNER SURFACE		SIGMA (STANGR)		SIGMA (RING)	
X	Y	OUTER SURFACE	INNER SURFACE	SIGMA (STANGR)	SIGMA (RING)	SIGMA (STANGR)	SIGMA (RING)
0.000	0.000	-3.6586E+01	-3.6586E+01	0.	-1.9722E-26	0.	0.
0.000	2.143	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.
0.000	4.286	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.
0.000	6.428	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.
0.000	8.571	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.
0.000	10.714	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.
0.000	12.857	-3.6586E+01	-3.6586E+01	0.	0.	0.	0.

AXIAL STRESS		INNER SURFACE		SIGMA (STANGR)		SIGMA (RING)	
X	Y	OUTER SURFACE	INNER SURFACE	SIGMA (STANGR)	SIGMA (RING)	SIGMA (STANGR)	SIGMA (RING)
15.000	0.000	-3.6109E+01	-3.6082E+01	0.	7.0161E-03	0.	7.0161E-03
15.000	2.143	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03
15.000	4.286	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03
15.000	6.428	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03
15.000	8.571	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03
15.000	10.714	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03
15.000	12.857	-3.6109E+01	-3.6082E+01	0.	0.	0.	7.0161E-03

AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
41.657	0.000	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	2.143	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	4.286	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	6.428	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	8.571	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	10.714	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
41.657	12.857	-3.6585E+01	-3.6585E+01	0.	-1.8209E-04		
AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
43.333	0.000	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	2.143	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	4.286	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	6.428	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	8.571	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	10.714	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
43.333	12.857	-3.6585E+01	-3.6585E+01	0.	-3.6110E-05		
AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
45.000	0.000	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	2.143	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	4.286	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	6.428	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	8.571	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	10.714	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
45.000	12.857	-3.6585E+01	-3.6585E+01	0.	4.7910E-05		
AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
46.667	0.000	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	2.143	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	4.286	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	6.428	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	8.571	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	10.714	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
46.667	12.857	-3.6585E+01	-3.6585E+01	0.	9.0360E-05		
AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
48.333	0.000	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	2.143	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	4.286	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	6.428	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	8.571	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	10.714	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
48.333	12.857	-3.6585E+01	-3.6585E+01	0.	1.0841E-04		
AXIAL STRESS		INNER SURFACE		SIGMA(STRNGR)		SIGMA(ING)	
CUTER SURFACE							
X	Y						
50.000	0.000	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	2.143	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	4.286	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	6.428	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	8.571	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	10.714	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
50.000	12.857	-3.6585E+01	-3.6585E+01	0.	1.1316E-04		
CP D10003= 11.482, NR OF 10 REQUESTS (TAPE2)= 97.						WORDS TRANSFERRED (TAPE2)= 489831	

Fig. 7-15 (Cont.)

ROW	COL	1.	X=	0.0000	W	V	U	BETAX	BETAY
1	1	0.0000		0.		0.	1.031390E-04	-6.757824E-06	0.
2	2	2.1628		0.		0.	1.031390E-04	-6.757824E-06	0.
3	3	6.2957		0.		0.	1.031390E-04	-6.757824E-06	0.
4	4	6.4285		0.		0.	1.031390E-04	-6.757824E-06	0.
5	5	8.5713		0.		0.	1.031390E-04	-6.757824E-06	0.
6	6	10.7142		0.		0.	1.031390E-04	-6.757824E-06	0.
7	7	12.0570		0.		0.	1.031390E-04	-6.757824E-06	0.
ROW	COL	10.	X=	15.0000	W	V	U	BETAX	BETAY
1	1	0.0000		7.016111E-08		0.	1.280000E-04	2.593953E-07	0.
2	2	2.1628		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
3	3	6.2957		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
4	4	6.4285		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
5	5	8.5713		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
6	6	10.7142		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
7	7	12.0570		7.016111E-08		-1.000000E-10	1.280000E-04	2.593953E-07	0.
ROW	COL	16.	X=	25.0000	W	V	U	BETAX	BETAY
1	1	0.0000		1.128260E-07		0.	9.146709E-05	-6.191380E-08	0.
2	2	2.1628		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
3	3	6.2957		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
4	4	6.4285		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
5	5	8.5713		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
6	6	10.7142		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
7	7	12.0570		1.128260E-07		-1.000000E-10	9.146709E-05	-6.191380E-08	0.
ROW	COL	1.	X=	0.0000	MX	MY	MXV	MYV	MXV
1	1	0.0000		-1.000000E+00		-2.445069E-27	0.	1.954353E-27	0.
2	2	2.1628		-1.000000E+00		0.	0.382379E-02	0.	-6.236400E-10
3	3	6.2957		-1.000000E+00		-1.222734E-27	0.608077E-10	0.771707E-20	-1.093034E-10
4	4	6.4285		-1.000000E+00		2.445069E-27	-3.146170E-13	-1.954353E-27	3.215533E-10
5	5	8.5713		-1.000000E+00		-4.895938E-27	-7.218241E-13	3.908707E-27	2.679819E-10
6	6	10.7142		-1.000000E+00		0.	-6.093700E-13	0.	5.085909E-10
7	7	12.0570		-1.000000E+00		0.	0.	0.	0.
ROW	COL	10.	X=	15.0000	MX	MY	MXV	MYV	MXV
1	1	0.0000		-1.000000E+00		0.	0.	0.	0.
2	2	2.1628		-1.000000E+00		0.778139E-04	0.202027E-13	-7.016111E-06	-3.202900E-10
3	3	6.2957		-1.000000E+00		0.778139E-04	1.669499E-10	-7.016111E-06	-9.858847E-10
4	4	6.4285		-1.000000E+00		0.778139E-04	-3.276811E-13	-7.016111E-06	2.375910E-10
5	5	8.5713		-1.000000E+00		0.778139E-04	-8.206365E-13	-7.016111E-06	6.098800E-10
6	6	10.7142		-1.000000E+00		0.778139E-04	-6.126667E-12	-7.016111E-06	6.395800E-10
7	7	12.0570		-1.000000E+00		0.778139E-04	0.	-7.016111E-06	0.
ROW	COL	16.	X=	25.0000	MX	MY	MXV	MYV	MXV
1	1	0.0000		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	0.
2	2	2.1628		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	-7.150350E-10
3	3	6.2957		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	1.090040E-10
4	4	6.4285		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	1.085490E-10
5	5	8.5713		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	3.115070E-10
6	6	10.7142		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	4.473370E-10
7	7	12.0570		-1.000000E+00		1.410300E-03	0.	-1.120400E-03	0.

Fig. 7-15 (Cont.)

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE STIFF
 CCC(1,1) CCC(1,2) CCC(1,3) CCC(1,4) CCC(1,5) CCC(1,6)
 2.73270E+09 0.250000E+06 0. 0. 0. 0.
 0. 1.250000E+06 0. 0. 0. 0.
 0. 5.070031E+04 0. 0. 0. 0.
 -1.197026E+04 0. 0. 1.660740E+04 0. 0.
 0. -1.000000E+06 0. 0. 0. 0. 0.
 0. 0. -3.371061E+03 0. 0. 1.005000E+04

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 10.437. NR OF IO REQUESTS (TAPE2)= 147. WORDS USED (TAPE2)= 123123. WORDS TRANSFERRED (TAPE2)= 705004

DETERMINANT OF STIFFNESS MATRIX= -4.514004E+07*10.00 1430. NUMBER OF NEGATIVE ROOTS = 1
 217 MODS. 891 EQUATIONS. MAXIMUM BAND WIDTH = 60
 MATRIX DECOMPOSITION COMPLETED.
 CP SECONDS= 20.966. NR OF IO REQUESTS (TAPE2)= 157. WORDS USED (TAPE2)= 123123. WORDS TRANSFERRED (TAPE2)= 759540

EIGENVALUE SHIFT= 1.000000E+03. NUMBER OF NEGATIVE ROOTS= 1
 ITERATION EIGENVALUE (ACCELERATED ESTIMATE)
 0 9.970230E+02 1.000000E+03
 1 9.951071E+02 1.001819E+03
 2 9.809629E+02 9.869512E+02
 3 9.264380E+02 9.865102E+02
 4 9.365391E+02 9.865762E+02
 5 9.865876E+02 9.866109E+02

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 9.066911E+02 TIMES THE STARTING LOAD.

ROW	1.	X=	0.0000	W	U	BETAX	BETAY
COL 1	0.0000	0.	0.930004E-10	0.	0.641020E-02	-6.930004E-20	
2	2.1420	0.	1.30779E-17	0.	9.102000E-02	-1.30779E-19	
3	6.2357	0.	6.930004E-10	0.	7.215402E-02	-6.930004E-20	
4	6.4285	0.	6.930004E-10	0.	8.37020E-02	-6.930004E-20	
5	8.5713	0.	3.46447E-10	0.	9.05642E-02	-3.46447E-20	
6	13.7142	0.	0.	0.	9.05642E-02	0.	
7	12.6570	0.	0.	0.	1.02041E-01	0.	

ROW	13.	X=	15.0000	W	U	BETAX	BETAY
COL 1	0.0000	0.	0.070934E-02	0.	0.700141E-03	0.070934E-02	
2	2.1420	0.	7.79705E-02	0.	3.29074E-03	0.070934E-02	
3	6.2357	0.	0.99130E-02	0.	4.66072E-03	0.070934E-02	
4	6.4285	0.	5.70742E-02	0.	9.71559E-03	0.070934E-02	
5	8.5713	0.	4.03647E-02	0.	1.099379E-02	0.070934E-02	
6	13.7142	0.	2.009620E-02	0.	1.099379E-02	0.070934E-02	
7	12.6570	0.	0.	0.	1.02041E-01	0.	

ROW	16.	X=	25.0000	W	U	BETAX	BETAY
COL 1	0.0000	0.	5.27000E-02	0.	0.93371E-03	0.070934E-02	
2	2.1420	0.	9.09033E-02	0.	1.00449E-02	0.070934E-02	
3	6.2357	0.	3.73275E-02	0.	3.01723E-02	0.070934E-02	
4	6.4285	0.	4.57585E-02	0.	3.116750E-02	0.070934E-02	
5	8.5713	0.	2.63433E-02	0.	2.203475E-02	0.070934E-02	
6	13.7142	0.	1.36625E-02	0.	1.140010E-02	0.070934E-02	
7	12.6570	0.	0.	0.	0.97203E-02	0.070934E-02	

CP SECONDS= 25.335. NR OF IO REQUESTS (TAPE2)= 259. WORDS USED (TAPE2)= 143030. WORDS TRANSFERRED (TAPE2)= 1333419

Fig. 7-15 (Cont.)

7.6 SAMPLE CASE 6 – ELLIPSOID

The critical external pressure according to bifurcation theory is to be determined for an orthotropic ellipsoid shell with clamped circular boundaries. The geometry of the shell is shown in Fig. 7-16.

Analysis with BOSOR4 (Ref. 15) shows that for this shell the critical external pressure is 4327 psi for a mode with 2 circumferential waves. Therefore, a shell covering $1/8$ of the circumference can be analyzed.

The meridional boundary conditions are the same as for Case 4. The input cards associated with this case are displayed in Fig. 7-17. Portions of the output are presented in Fig. 7-18.

The critical external pressure determined here is 4741 psi. The discrepancy in critical external pressure is due to the coarseness of the grid used here.

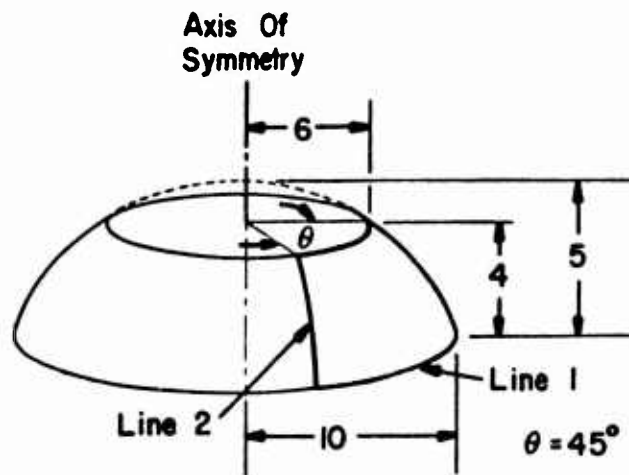


Fig. 7-16 Sample Case 6 - Orthotropic Ellipsoid

SAMPLE CASE 6 INPUT

SAMPLE CASE 6 - ELLIPSOID ORTHOTROPIC										
7	1	1								C-1
0.0		33.667		45.0		10.0		5.0		G-1
16	6									G-2
2	4	2	4							D-1
1	0	1.								B-1
-1.	0.		0.			4	0	0	0	L-1
				1	2	20				L-2
2	4	2	5							P-1A
0	0	1	4	0	1	1				P-1A1
0.		11.		22.		33.				O-1
5										O-2
0.0		1								M-1
0.2		100 00000.	50 00000.	0.1		20 00000.				M-2E1
										M-2E2

Fig. 7-17 Display of Input Cards for Sample Case 6

SAMPLE CASE 6 - OUTPUT

```

SAMPLE CASE 6 - ELLIPSOID ORTHOTROPIC
BUCKLING ANALYSIS.      1 LOAD PATTERNS.
TYPE OF SURFACE IS ELLIPSOID
SURFACE CONSTANTS = 0.      . 3.3667000E+01, 4.5000000E+01, 1.0000000E+01, 5.0000000E+00.
BLANK COMMON ARRAY WORKING SPACE= 19900
FINITE DIFFERENCE MESH. 16 ROWS. 6 COLUMNS. MESH SPACING. M= 2.2445, K= 9.0000
NRM1= -0. NRM2= -0. MCL1= -0
BOUNDARY CONDITION AT LINE 1 IS CLAMPED
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS CLAMPED
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC
LOAD A DATA
CARD COUNT = 1
USER-LOAD FLAG = 0. STARTING LOAD FACTOR = 1.0000000E+00. LOAD STEP = -0.      . MAXIMUM LOAD = 1.0000000E+00
PZ      PY      PX      JZ      JY      JX      ROW      COL
-1.0000000E+00 0.      0.      0.      0      0      0      0
BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS
BOUNDARY CONDITION AT LINE 1 IS CLAMPED
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS CLAMPED
BOUNDARY CONDITION AT LINE 4 IS ANTI-METRIC
:SHIFT  ITERAT  SHIFT
2      20      -0.
IPX= 4 IPY= 0 IPRO= 1 IPRS= 1 IPLOT= -0 ~
IWALL= 5, NSTRI= -0, NRING= -0, IPE= -0, IM= -0, JM= -0
ANALYSIS IS FOR A LAYERFO SHELL.
THERE ARE 1 LAYERS Z = 0.
      LAYER  THICKNESS  SHEAR  YOUNGS  YOUNGS  POISSON
      1      2.0000000E-01 2.0000000E+06 1.0000000E+07 5.0000000E+06 1.0000000E-01
THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CPBS
      CCC(I,1)      CCC(I,2)      CCC(I,3)      CCC(I,4)      CCC(I,5)      CCC(I,6)
      2.040016E+06      0.      0.      0.      0.      0.
      2.040016E+05      1.020400E+06      0.      0.      0.      0.
      0.      0.      4.000000E+05      0.      0.      0.
      0.      0.      0.      6.02721E+03      0.      0.
      0.      0.      0.      6.02721E+02      1.401361E+03      0.
      0.      0.      0.      0.      0.      1.333333E+03

```

Fig. 7-18 Excerpt of Output for Sample Case 6

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECCOS= 1.736. NR OF IO REQUESTS (TAPE2)= 14. WORDS USED (TAPE2)= 48457. WORDS TRANSFERRED (TAPE2)= 59505

FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECCOS= 6.982. NR OF IO REQUESTS (TAPE2)= 28. WORDS USED (TAPE2)= 69078. WORDS TRANSFERRED (TAPE2)= 107201

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECCOS= 7.319. NR OF IO REQUESTS (TAPE2)= 36. WORDS USED (TAPE2)= 82996. WORDS TRANSFERRED (TAPE2)= 159146

DISPLACEMENT COMPONENT Y X= 3.2545E+01 Y= 4.8508E+01. WAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 1.896444E+06. THE FINAL VALUE = 2.4018633E-06

DETERMINANT OF STIFFNESS MATRIX 1.1829817E+037.0. 708. NUMBER OF NEGATIVE ROOTS = 0
 % MODES. 432 EQUATIONS. MAXIMUM BAND WIDTH = 54

MATRIX DECOMPOSITION COMPLETED.
 CP SECCOS= 8.330. NR OF IO REQUESTS (TAPE2)= 42. WORDS USED (TAPE2)= 82996. WORDS TRANSFERRED (TAPE2)= 104806

LINEAR SOLUTION. PA= 1.000000E+00. PB= 0.
 ROW 15. X= 31.423. AXIAL LOAD= -2.563758E+01. BENDING MOMENT= 0. SIGMA (STRESS) SIGMA (RING)

X	Y	LAYER	SIGMAX	SIGMAY	TAU
0.002	0.000	1	0.8641E+00	7.9197E-01	0.
0.002	0.000	1	-4.7411E+01	-4.6667E+00	0.
0.002	0.000	1	0.8641E+00	7.9197E-01	-8.6662E-13
0.002	0.000	1	-4.7411E+01	-4.6667E+00	-9.0190E-13
0.002	0.000	1	0.8641E+00	7.9197E-01	-4.7219E-13
0.002	0.000	1	-4.7411E+01	-4.6667E+00	-4.9147E-13
0.002	0.000	1	0.8641E+00	7.9197E-01	2.0395E-13
0.002	0.000	1	-4.7411E+01	-4.6667E+00	2.7471E-13
0.002	0.000	1	0.8641E+00	7.9197E-01	9.2445E-13
0.002	0.000	1	-4.7411E+01	-4.6667E+00	9.6210E-13
0.002	0.000	1	0.8641E+00	7.9197E-01	0.
0.002	0.000	1	-4.7411E+01	-4.6667E+00	0.

X	Y	LAYER	SIGMAX	SIGMAY	TAU	SIGMA (STRESS)	SIGMA (RING)
33.667	0.000	1	-1.0680E+02	-1.0758E+01	0.		
33.667	0.000	1	5.2482E+01	5.3261E+00	0.		
33.667	0.000	1	-1.0680E+02	-1.0758E+01	-3.5586E-16		
33.667	0.000	1	5.2482E+01	5.3261E+00	-3.6429E-16		
33.667	0.000	1	-1.0680E+02	-1.0758E+01	-3.0795E-13		
33.667	0.000	1	5.2482E+01	5.3261E+00	-3.1525E-13		
33.667	0.000	1	-1.0680E+02	-1.0758E+01	5.9277E-13		
33.667	0.000	1	5.2482E+01	5.3261E+00	6.0681E-13		
33.667	0.000	1	-1.0680E+02	-1.0758E+01	-1.0014E-13		
33.667	0.000	1	5.2482E+01	5.3261E+00	-1.0465E-13		
33.667	0.000	1	-1.0680E+02	-1.0758E+01	0.		
33.667	0.000	1	5.2482E+01	5.3261E+00	0.		
CP SECCOS=	9.721.	NR OF IO REQUESTS (TAPE2)=	70.	WORDS USED (TAPE2)=	83508.	WORDS TRANSFERRED (TAPE2)=	310940

Fig. 7-18 (Cont.)

ROW	COL	11.	X	22.4467	MX	MY	MXV	MX	MY	MXV	MX	MY	MXV
1	0.000	-4.58672E+00	-3.09162E+00	0.	-1.907623E-01	-1.907623E-02	0.	-1.907623E-01	-1.907623E-02	0.	-1.907623E-01	-1.907623E-02	0.
2	9.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
3	1.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
4	27.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
5	36.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
6	45.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CP05

ROW	COL	11.	X	22.4467	MX	MY	MXV	MX	MY	MXV	MX	MY	MXV
1	0.000	-4.58672E+00	-3.09162E+00	0.	-1.907623E-01	-1.907623E-02	0.	-1.907623E-01	-1.907623E-02	0.	-1.907623E-01	-1.907623E-02	0.
2	9.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
3	1.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
4	27.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
5	36.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01
6	45.000	-4.58672E+00	-3.09162E+00	-5.43166E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01	-1.907623E-01	-1.907623E-02	5.309384E-01

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.

CP SECOND= 17.894. NR OF IO REQUESTS (TAPE2)= 106. WORDS USED (TAPE2)= 83500. WORDS TRANSFERRED (TAPE2)= 490458

DETERMINANT OF STIFFNESS MATRIX= 3.263847E+06*10** 668. NUMBER OF NEGATIVE ROOTS = 0
 94 NCES. 432 EQUATIONS. MAXIMUM BAND WIDTH = 54
 MATRIX DECOMPOSITION COMPLETED.

CP SECOND= 18.064. NR OF IO REQUESTS (TAPE2)= 112. WORDS USED (TAPE2)= 83500. WORDS TRANSFERRED (TAPE2)= 519318

ITERATION	EIGENVALUE (RAYLEIGH QUOTIENT)	EIGENVALUE (ACCELERATED ESTIMATE)	NUMBER OF NEGATIVE ROOTS
0	1.597176E+03	7.275957E+12	0
1	8.942580E+03	-8.545332E+02	0
2	6.059184E+03	7.271278E+03	0
3	6.537885E+03	6.426077E+03	0
4	6.443783E+03	6.398637E+03	0
5	6.378140E+03	6.288107E+03	0
6	6.296899E+03	6.178448E+03	0
7	6.178470E+03	6.556715E+03	0
8	6.012751E+03	6.593325E+03	0
9	5.900927E+03	6.774317E+03	0
10	5.561728E+03	7.654423E+03	0
11	5.353330E+03	-4.218612E+03	0
12	5.131350E+03	4.867161E+03	0
13	4.946587E+03	4.596770E+03	0
14	4.889213E+03	4.675899E+03	0
15	4.821992E+03	4.711784E+03	0

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.

CP SECOND= 27.582. NR OF IO REQUESTS (TAPE2)= 247. WORDS USED (TAPE2)= 98458. WORDS TRANSFERRED (TAPE2)= 1298952

Fig. 7-18 (Cont.)

DETERMINANT OF STIFFNESS MATRIX= 2.1776930E+04-10.00. NUMBER OF NEGATIVE ROOTS = 0
 NO MODES. 43E EQUATIONS. MAXIMUM BAND WIDTH = 54
 MATRIX DECOMPOSITION COMPLETED.
 CP SECCO3= 20.980. NR OF IO REQUESTS (TAPE2)= 293. WORDS USED (TAPE2)= 90450. WORDS TRANSFERRED (TAPE2)= 1319012

EIGENVALUE SHIFT= 3.375394E+03. NUMBER OF NEGATIVE ROOTS= 0

ITERATION	EIGENVALUE (RAYLEIGH QUOTIENT)	(ACCELERATED ESTIMATE)
0	6.770911E+03	6.555691E+03
1	6.745060E+03	6.702171E+03
2	6.736097E+03	6.735703E+03
3	6.737215E+03	6.737102E+03
4	6.738508E+03	6.736324E+03
5	6.739520E+03	6.744020E+03
6	6.740251E+03	6.741663E+03
7	6.740606E+03	6.741403E+03
8	6.740942E+03	6.741345E+03

THE SUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 4.741345E+03 TIMES THE STARTING LOAD.

ROW	1.	X=	0.0000	W	V	U	BETAX	BETAY
COL	1	0.0000	0.	1.004202E-19	0.	9.421011E-20	0.	-1.004202E-20
	2	9.0000	0.	2.160004E-19	0.	-2.160004E-20	0.	-2.160004E-20
	3	18.0000	0.	0.	1.004202E-19	-4.336009E-20	0.	0.
	4	27.0000	0.	5.421011E-20	1.004202E-19	-4.336009E-20	-5.421011E-21	0.
	5	36.0000	0.	0.	1.004202E-19	-4.336009E-20	0.	0.
	6	45.0000	0.	0.	1.004202E-19	-4.336009E-20	0.	0.

ROW	6.	X=	11.2223	W	V	U	BETAX	BETAY
COL	1	0.0000	0.	9.074107E-03	0.	9.100612E-02	0.	9.203555E-02
	2	9.0000	1.32912E-01	5.776352E-03	-9.100612E-02	-0.416573E-02	0.	0.416709E-02
	3	18.0000	2.50701E-01	4.911994E-03	-9.081907E-02	-1.590001E-01	7.453690E-02	0.
	4	27.0000	3.53152E-01	3.567436E-03	-1.346697E-01	-2.194575E-01	5.378373E-02	0.
	5	36.0000	4.166320E-01	1.074940E-03	-1.500030E-01	-2.570590E-01	2.011011E-02	0.
	6	45.0000	4.377210E-01	0.	-1.601205E-01	-2.709040E-01	0.	0.

ROW	11.	X=	22.4447	W	V	U	BETAX	BETAY
COL	1	0.0000	0.	2.604425E-03	0.	0.	0.	-2.377030E-01
	2	9.0000	-3.110942E-01	2.571939E-03	-2.960129E-02	0.627672E-04	0.	-2.444743E-01
	3	18.0000	-5.916073E-01	2.224941E-03	-5.639479E-02	1.290999E-03	-2.065095E-01	0.
	4	27.0000	-8.110420E-01	1.650010E-03	-7.76610E-02	1.63572E-03	-1.000617E-01	0.
	5	36.0000	-9.519330E-01	0.077902E-04	-9.090807E-02	2.241040E-03	-7.773569E-02	0.
	6	45.0000	-9.599040E-01	0.	-9.556933E-02	2.302950E-03	0.	0.

ROW	16.	X=	33.6670	W	V	U	BETAX	BETAY
COL	1	0.0000	0.	0.	0.	0.	0.	0.
	2	9.0000	0.	0.073617E-19	-0.673617E-19	0.	0.	-0.076900E-20
	3	18.0000	0.	1.734723E-18	-0.673617E-19	0.957331E-20	-0.957331E-20	-1.015300E-19
	4	27.0000	0.	4.336009E-19	-1.736723E-18	0.391506E-19	0.	-2.330450E-20
	5	36.0000	0.	1.004202E-19	0.	0.	0.	-0.366124E-21
	6	45.0000	0.	0.	-1.736723E-18	1.391506E-19	0.	0.

CP SECCO3= 20.990. NR OF IO REQUESTS (TAPE2)= 303. WORDS USED (TAPE2)= 90450. WORDS TRANSFERRED (TAPE2)= 1640933

Fig. 7-18 (Cont.)


7.7 SAMPLE CASE 7 - HYPERBOLOID

The critical axial line load according to bifurcation theory is to be determined for a hyperboloid shell segment clamped at the large circular edge and constraint in all but the axial direction at the other edge. The geometry of the shell is shown in Fig. 7-22.

Analysis with BOSOR4 (Ref. 15) shows that for this shell the critical axial line load is 1740 lb/in. for a mode with 6 circumferential waves. Therefore, a shell covering 1/24 of the circumference can be analyzed.

The meridional boundary conditions are the same as for Sample Case 4. The input cards associated with this case are displayed in Fig. 7-23. Portions of the output are presented in Fig. 7-24.

The critical axial line load determined here is 1927 lb/in. The discrepancy in the critical load is due to the coarseness of the grid in the longitudinal direction, selected here to reduce the run time.

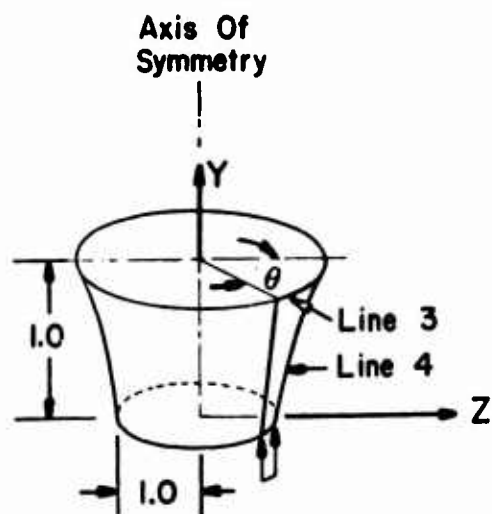

The Equation Of The Generator Is:

$$\frac{Z^2}{R^2} - \frac{Y^2}{R_1^2} = 1$$

And $R = R_1 = 1.0$
 $\theta = 15^\circ$

Fig. 7-19 Sample Case 7 - Hyperboloid

SAMPLE CASE 7 INPUT

SAMPLE CASE 7 - HYPERBOLOID										
0.0	9	1	1	35.267	15.0	1.0	1.0			C-1
	9	9								G-1
	0	4	2	4						G-2
	0	0	1	0						D-1
	1	0	1.							B-1
0.		0.		1.		0	0	2	1	B-2
0.0		1700.0			1	1	20			L-1
	0	4	2	5						L-2
	0	0	1	0						P-1A
	0	0	1	4	0	1	1			P-1A1
0.		17.		25.		35.				P-1A2
	2									O-1
0.025		10000000.	0.3		0.0					O-2
										M-1
										M-2B

Fig. 7-20 Display of Input Cards for Sample Case 7

**SAMPLE CASE 7 - HYPERBOLIC
BUCKLING ANALYSIS.**

TYPE OF SURFACE IS HYPERBOLOID

SURFACE CONSTANTS = 0.
 , 3.526700E+01, 1.500000E+01, 1.000000E+00, 1.000000E+00,

BLANK COMMON ARRAY WORKING SPACE=	15000
1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30
31	31
32	32
33	33
34	34
35	35
36	36
37	37
38	38
39	39
40	40
41	41
42	42
43	43
44	44
45	45
46	46
47	47
48	48
49	49
50	50
51	51
52	52
53	53
54	54
55	55
56	56
57	57
58	58
59	59
60	60
61	61
62	62
63	63
64	64
65	65
66	66
67	67
68	68
69	69
70	70
71	71
72	72
73	73
74	74
75	75
76	76
77	77
78	78
79	79
80	80
81	81
82	82
83	83
84	84
85	85
86	86
87	87
88	88
89	89
90	90
91	91
92	92
93	93
94	94
95	95
96	96
97	97
98	98
99	99
100	100
101	101
102	102
103	103
104	104
105	105
106	106
107	107
108	108
109	109
110	110
111	111
112	112
113	113
114	114
115	115
116	116
117	117
118	118
119	119
120	120
121	121
122	122
123	123
124	124
125	125
126	126
127	127
128	128
129	129
130	130
131	131
132	132
133	133
134	134
135	135
136	136
137	137
138	138
139	139
140	140
141	141
142	142
143	143
144	144
145	145
146	146
147	147
148	148
149	149
150	150
151	151
152	152
153	153
154	154
155	155
156	156
157	157
158	158
159	159
160	160
161	161
162	162
163	163
164	164
165	165
166	166
167	167
168	168
169	169
170	170
171	

FINITE DIFFERENCE MESH. 9 ROWS, 9 COLUMNS. MESH SPACING. M= 4.4084, K= 1.8750

NR41 = -3, NR42 = -0, NCL1 = -0

BOUNDARY CONDITION AT LINE 1 IS SET BY IFREE . IFREE = 0, 0, 1, 0,

BOJ-CARY CONDITION AT LINE 2 IS SYMMETRIC

BOUNDARY CONDITION AT LINE 3 IS CLAMPED

BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC

LCAG : 057A

CARD COUNT = 1

```

USER-LOAD FLAG = 0, STARTING LOAD FACTOR = 1.000000E+00, LOAD STEP = -0,
MAXIMUM LOAD = 1.000000E+00

```

PZ	PY	PX	JZ	JY	JX	ROW	COL
0.	0.	1.000000E+00	0	0	2	1	0

BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS

BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS
 EQUATION OF MOTION AT LINE 1 IS SET BY IFREE = 0. 0. 1. 0.

[illegible]

BACKUP CONDITION AT LINE 2 IS SYNCHRONIC CLAMPED
BEUNEAPY CONDITION AT LINE 3 IS CLAMPED

BOUNDARY CONDITION AT LINE 3 IS CLAMPED
BOUNDARY CONDITION AT LINE 4 IS ANTI-METRIC

ISWIFT	1	ISWIFT	1	ISWIFT	1
PERAT	23	PERAT	23	PERAT	23
SHIFT	1.70000E+03	SHIFT	1.70000E+03	SHIFT	1.70000E+03

```

IPX=      6 IPY=      0 IPZO=      1 IPRS=      1 IPLOT=      0

```

```
INALL= 2, NSTRI= -0, NRI= -0, IP= -0, IM= -0, JM= -0
```

AT = 2.502000E-02 EX1 = 1.000000E+07 YMU = 3.000000E-01

Z	=	0.
EY	=	1.000000E+07
C	=	6
3.046194E+06		

```

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CFB2
      CCC(1,1)      CCC(1,2)      CCC(1,3)

```

[illegible]

Fig. 7-21 Excerpt of Output Sample Core 7

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECONDS= 1.046. NR OF IO REQUESTS (TAPE2)= 13. WORDS USED (TAPE2)= 63990
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECONDS= 5.975. NR OF IO REQUESTS (TAPE2)= 26. WORDS USED (TAPE2)= 94133
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 6.345. NR OF IO REQUESTS (TAPE2)= 32. WORDS USED (TAPE2)= 128802

DISPLACEMENT COMPONENT Y X= 3.3803E+01 Y= 1.4062E+01. HAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 1.248893E+06. THE FINAL VALUE = 1.095253E+06

DETERMINANT OF STIFFNESS MATRIX= 4.077049E+09*10.00 510. NUMBER OF NEGATIVE ROOTS = 0
 41 NDCES. 363 EQUATIONS. MAXIMUM BAND WIDTH = 72
 MATRIX COMPOSITION COMPLETED.
 CP SECONDS= 7.516. NR OF IO REQUESTS (TAPE2)= 38. WORDS USED (TAPE2)= 157786

LINEAR SOLUTION. PA= 1.000000E+00. PO= 0.
 ROW 8. X= 38.055. AXIAL LOAD= -3.841080E-01. BENDING MOMENT= 0.

ROW	1.	X=	0.0000	OUTER SURFACE				INNER SURFACE			
				SIGMAX	SIGMA Y	TAU	SIGMAX	SIGMA Y	TAU	SIGMA (STRNGR)	SIGMA (RING)
0.000	0.000	0.000	9.054E+00	3.108E+00	0.000E+00	0.000E+00	-0.4522E+01	-2.7009E+01	0.000E+00	0.000E+00	0.000E+00
0.000	1.475	9.054E+00	3.108E+00	3.108E+00	0.000E+00	2.240E-12	-0.4522E+01	-2.7009E+01	2.6132E-12	2.6132E-12	2.6132E-12
0.000	3.750	9.054E+00	3.108E+00	3.108E+00	0.000E+00	1.3378E-12	-0.4522E+01	-2.7009E+01	1.7314E-12	1.7314E-12	1.7314E-12
0.000	5.625	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-5.4666E-12	-0.4522E+01	-2.7009E+01	-5.6802E-12	-5.6802E-12	-5.6802E-12
0.000	7.500	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.2071E-12	-0.4522E+01	-2.7009E+01	-2.3167E-13	-2.3167E-13	-2.3167E-13
0.000	9.375	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-7.9645E-12	-0.4522E+01	-2.7009E+01	-2.0124E-12	-2.0124E-12	-2.0124E-12
0.000	11.250	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.3951E-12	-0.4522E+01	-2.7009E+01	-7.0343E-12	-7.0343E-12	-7.0343E-12
0.000	13.125	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.6618E-13	-0.4522E+01	-2.7009E+01	-4.0353E-13	-4.0353E-13	-4.0353E-13
0.000	15.000	9.054E+00	3.108E+00	3.108E+00	0.000E+00	0.000E+00	-0.4522E+01	-2.7009E+01	0.000E+00	0.000E+00	0.000E+00

ROW 9. X= 35.2670

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECONDS= 1.046. NR OF IO REQUESTS (TAPE2)= 13. WORDS USED (TAPE2)= 63990
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECONDS= 5.975. NR OF IO REQUESTS (TAPE2)= 26. WORDS USED (TAPE2)= 94133
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 6.345. NR OF IO REQUESTS (TAPE2)= 32. WORDS USED (TAPE2)= 128802

DISPLACEMENT COMPONENT Y X= 3.3803E+01 Y= 1.4062E+01. HAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 1.248893E+06. THE FINAL VALUE = 1.095253E+06

DETERMINANT OF STIFFNESS MATRIX= 4.077049E+09*10.00 510. NUMBER OF NEGATIVE ROOTS = 0
 41 NDCES. 363 EQUATIONS. MAXIMUM BAND WIDTH = 72
 MATRIX COMPOSITION COMPLETED.
 CP SECONDS= 7.516. NR OF IO REQUESTS (TAPE2)= 38. WORDS USED (TAPE2)= 157786

ROW	1.	X=	0.0000	OUTER SURFACE				INNER SURFACE			
				SIGMAX	SIGMA Y	TAU	SIGMAX	SIGMA Y	TAU	SIGMA (STRNGR)	SIGMA (RING)
0.000	0.000	0.000	9.054E+00	3.108E+00	0.000E+00	0.000E+00	-0.4522E+01	-2.7009E+01	0.000E+00	0.000E+00	0.000E+00
0.000	1.475	9.054E+00	3.108E+00	3.108E+00	0.000E+00	2.240E-12	-0.4522E+01	-2.7009E+01	2.6132E-12	2.6132E-12	2.6132E-12
0.000	3.750	9.054E+00	3.108E+00	3.108E+00	0.000E+00	1.3378E-12	-0.4522E+01	-2.7009E+01	1.7314E-12	1.7314E-12	1.7314E-12
0.000	5.625	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-5.4666E-12	-0.4522E+01	-2.7009E+01	-5.6802E-12	-5.6802E-12	-5.6802E-12
0.000	7.500	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.2071E-12	-0.4522E+01	-2.7009E+01	-2.3167E-13	-2.3167E-13	-2.3167E-13
0.000	9.375	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-7.9645E-12	-0.4522E+01	-2.7009E+01	-2.0124E-12	-2.0124E-12	-2.0124E-12
0.000	11.250	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.3951E-12	-0.4522E+01	-2.7009E+01	-7.0343E-12	-7.0343E-12	-7.0343E-12
0.000	13.125	9.054E+00	3.108E+00	3.108E+00	0.000E+00	-1.6618E-13	-0.4522E+01	-2.7009E+01	-4.0353E-13	-4.0353E-13	-4.0353E-13
0.000	15.000	9.054E+00	3.108E+00	3.108E+00	0.000E+00	0.000E+00	-0.4522E+01	-2.7009E+01	0.000E+00	0.000E+00	0.000E+00

Fig. 7-21 (Cont.)

ROW	COL	S.	X	Y	17.6335	M	V	U	BETAX	BETAY	BETAY
1	1	0.0000	-3.300050E-06				0.	3.033000E-06	2.605267E-06		0.
2	2	1.0750	-3.300050E-06				2.212240E-20	3.033000E-06	2.605267E-06		7.036020E-10
3	3	3.7500	-3.300050E-06				3.600090E-20	3.033000E-06	2.605267E-06		1.030910E-17
4	4	9.6250	-3.300050E-06				3.996740E-20	3.033000E-06	2.605267E-06		0.967471E-10
5	5	7.5000	-3.300050E-06				3.913240E-20	3.033000E-06	2.605267E-06		0.616020E-10
6	6	9.3750	-3.300050E-06				3.303290E-20	3.033000E-06	2.605267E-06		3.574441E-10
7	7	11.2500	-3.300050E-06				2.078050E-20	3.033000E-06	2.605267E-06		1.934366E-10
8	8	13.1250	-3.300050E-06				1.277992E-20	3.033000E-06	2.605267E-06		-2.171422E-19
9	9	15.0000	-3.300050E-06				0.	3.033000E-06	2.605267E-06		0.
ROW	COL	S.	X	Y	26.4502	M	V	U	BETAX	BETAY	BETAY
1	1	0.0000	-2.615731E-06				0.	1.765594E-06	5.222612E-06		0.
2	2	1.0750	-2.615731E-06				2.030070E-20	1.765594E-06	5.222612E-06		1.022300E-10
3	3	3.7500	-2.615731E-06				5.400350E-20	1.765594E-06	5.222612E-06		5.715720E-10
4	4	9.6250	-2.615731E-06				0.140360E-19	1.765594E-06	5.222612E-06		1.260020E-17
5	5	7.5000	-2.615731E-06				1.01054E-19	1.765594E-06	5.222612E-06		1.063406E-17
6	6	9.3750	-2.615731E-06				1.073290E-19	1.765594E-06	5.222612E-06		2.63402E-17
7	7	11.2500	-2.615731E-06				9.262643E-20	1.765594E-06	5.222612E-06		2.42971E-17
8	8	13.1250	-2.615731E-06				5.005013E-20	1.765594E-06	5.222612E-06		1.332775E-17
9	9	15.0000	-2.615731E-06				0.	1.765594E-06	5.222612E-06		0.
ROW	COL	S.	X	Y	35.2678	M	V	U	BETAX	BETAY	BETAY
1	1	0.0000	0.				0.	-0.470329E-22	-1.629406E-22		0.
2	2	1.0750	0.				0.	-0.470329E-22	-1.629406E-22		0.
3	3	3.7500	0.				0.	-1.064066E-21	-3.258972E-22		0.
4	4	9.6250	0.				0.	-0.470329E-22	-1.629406E-22		0.
5	5	7.5000	0.				0.	-0.470329E-22	-1.629406E-22		0.
6	6	9.3750	0.				0.	-0.470329E-22	-1.629406E-22		0.
7	7	11.2500	0.				0.	-0.470329E-22	-1.629406E-22		0.
8	8	13.1250	0.				0.	-1.064066E-21	-3.258972E-22		0.
9	9	15.0000	0.				0.	0.	0.		0.
ROW	COL	S.	X	Y	0.0000	NK	MY	MX	MY	MX	MY
1	1	0.0000	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		0.
2	2	1.0750	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		-1.975101E-17
3	3	3.7500	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		-2.210620E-17
4	4	9.6250	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		1.198010E-17
5	5	7.5000	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		-4.559750E-17
6	6	9.3750	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		3.553500E-10
7	7	11.2500	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		-1.078020E-17
8	8	13.1250	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		1.652900E-17
9	9	15.0000	-9.933601E-01				-2.980030E-01	5.002167E-03	1.571725E-03		0.
ROW	COL	S.	X	Y	17.6335	NK	MY	MX	MY	MX	MY
1	1	0.0000	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		0.
2	2	1.0750	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-9.132400E-10
3	3	3.7500	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-1.646042E-15
4	4	9.6250	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-1.930227E-15
5	5	7.5000	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-1.749291E-15
6	6	9.3750	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-1.075001E-15
7	7	11.2500	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		-3.632107E-10
8	8	13.1250	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		1.214707E-10
9	9	15.0000	-9.991397E-01				-0.245513E-01	-5.062795E-04	-1.250637E-04		0.

Fig. 7-21 (Cont.)

```

ROW 7. X= 26.6502
COL Y
1 0.0000 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
2 1.0750 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
3 3.7500 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
4 5.6250 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
5 7.5000 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
6 9.3750 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
7 11.2500 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
8 13.1250 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00
9 15.0000 -9.651799E-01 -5.080540E-01 -1.912620E-06 -1.912620E-06 -1.912620E-06 0.000000E+00

ROW 9. X= 35.2670
COL Y
1 0.0000 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
2 1.0750 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
3 3.7500 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
4 5.6250 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
5 7.5000 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
6 9.3750 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
7 11.2500 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
8 13.1250 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00
9 15.0000 -8.42533E-01 -2.520760E-01 -1.60289E-04 -1.60289E-04 -1.60289E-04 0.000000E+00

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CPO2
CCC(1,1) CCC(1,2) CCC(1,3) CCC(1,4) CCC(1,5) CCC(1,6)
2.747293E+05 0.000000E+00 2.747293E+05 0.000000E+00 0.000000E+00 0.000000E+00
0.000000E+00 2.747293E+05 0.000000E+00 0.000000E+00 0.000000E+00 0.000000E+00
0.000000E+00 0.000000E+00 9.615308E+04 0.000000E+00 0.000000E+00 0.000000E+00
0.000000E+00 0.000000E+00 0.000000E+00 1.430861E+01 0.000000E+00 0.000000E+00
0.000000E+00 0.000000E+00 0.000000E+00 4.292682E+00 0.000000E+00 5.000013E+00

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
CP SECCNOS= 15.309. NR OF IO REQUESTS (TAPE2)= 98. WORDS USED (TAPE2)= 77683. WORDS TRANSFERRED (TAPE2)= 419795

DETERMINANT OF STIFFNESS MATRIX= 7.1132379E+02*10.** 988. NUMBER OF NEGATIVE ROOTS = 0
A1 NCSES= 363 EQUATIONS. MAXIMUM BAND WIDTH = 72
MATRIX DECOMPOSITION COMPLETED.
CP SECCNOS= 18.512. NR OF IO REQUESTS (TAPE2)= 184. WORDS USED (TAPE2)= 77683. WORDS TRANSFERRED (TAPE2)= 448759

EIGENVALUE SHIFT= 1.7000000E+03. NUMBER OF NEGATIVE ROOTS= 0
ITERATION EIGENVALUE (RAYLEIGH QUOTIENT) (ACCELERATED ESTIMATE)
0 1.7520007E+03 1.7000000E+03
1 1.9449135E+03 1.6002292E+03
2 1.9291201E+03 1.9303275E+03
3 1.9271140E+03 1.9268194E+03
4 1.9267213E+03 1.9266252E+03
5 1.9266275E+03 1.9265981E+03

```

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 1.926598E+03 TIMES THE STARTING LOAD.

Fig. 7-21 (Cont.)

7.8 SAMPLE CASE 8 - PARABOLOID

The critical external pressure according to bifurcation theory is to be determined for a paraboloid shell with clamped circular edges. The geometry of the shell is shown in Fig. 7-22.

Analysis with BOSOR4 (Ref. 15) shows that for this shell, the critical external pressure is 714 psi for a mode with 10 circumferential waves. Therefore, a shell covering 1/40 of the circumference can be analyzed.

The meridional boundary conditions are the same as for Sample Case 4. The input cards associated with this case are displayed in Fig. 7-23. Portions of the output are presented in Fig. 7-24.

The critical external pressure determined here is 703 psi.

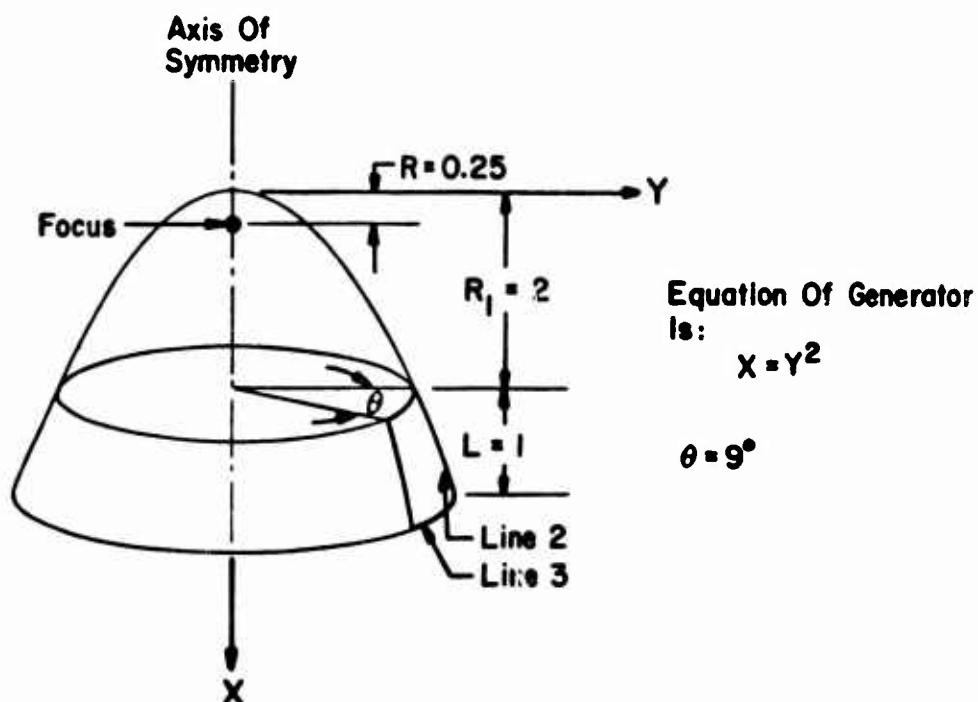


Fig. 7-22 Sample Case 8 - Paraboloid

SAMPLE CASE 8
INPUT

SAMPLE CASE 8 - PARABOLOID										C-1
5	1	1								G-1
1.		9.		.25		2.				G-2
11	7									D-1
2	4	2	4							B-1
1	0	1.	1.	1.						L-1
-1.	0.		0.			5	0	0	0	L-2
				1	2	20				P-1A
2	4	2	5							P-1A1
0	0	1	4	0	1	1				O-1
0.	.5		.8		1.					O-2
2										M-1
.025	10000000.	.3		0.						M-2B

Fig. 7-23 Display of Input Cards for Sample Case 8

SAMPLE CASE 8 - OUTPUT

```

SAMPLE CASE 8 - PARABOLOID
BUCKLING ANALYSIS.      1 LOAD PATTERNS.

TYPE OF SURFACE IS PARABOLOID

SURFACE CONSTANTS = 1.000000E+00, 9.000000E+00, 2.500000E-01, 2.000000E+00.

BLANK COMMON ARRAY WORKING SPACE= 15000

FINITE DIFFERENCE MESH. 11 ROWS, 7 COLUMNS. MESH SPACING. H= .1000, K= 1.5000

NRM1= -0. NRM2= -0. MCL1= -0
BOUNDARY CONDITION AT LINE 1 IS CLAMPED
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS CLAMPED
BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC

LOAD & DATA

CARD COUNT = 1

USER-LOAD FLAG = 0, STARTING LOAD FACTOR = 1.000000E+00, LOAD STEP = 1.000000E+00, MAXIMUM LOAD = 1.000000E+00

PX PY JZ JY JX ROW COL
-1.000000E+00 0. 0. 5 0 0 0 0

BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS
BOUNDARY CONDITION AT LINE 1 IS CLAMPED
BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC
BOUNDARY CONDITION AT LINE 3 IS CLAMPED
BOUNDARY CONDITION AT LINE 4 IS ANTI-METRIC

IShift ITERAT Shift
2 -0.

IPX 4 IPY= 0 IPRO= 1 IPRS= 1 IPLOT= -0
IALL= 2. ASTRI= -0. MRING= -0. IP= -0. IM= -0. JM= -0

AT = 2.500000E-02 EX1 = 1.000000E+07 XNU = 3.000000E-01
Z = 0. EY1 = 1.000000E+07 C = 3.0461538E+06

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CFB2
CCC(1,1) CCC(1,2) CCC(1,3) CCC(1,4) CCC(1,5) CCC(1,6)
2.747253E+09 0. 0. 0. 0. 0.
8.241758E+04 2.747253E+09 0. 0. 0. 0.
0. 0. 9.615385E+04 1.430861E+01 0. 0.
0. 0. 0. 4.292582E+00 1.430861E+01 0.
0. 0. 0. 0. 0. 5.000013E+00

```

Fig. 7-24 Excerpt of Output for Sample Case 8

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECCOVS= 1.379. NR OF IO REQUESTS (TAPE2)= 13. WORDS USED (TAPE2)= 63970
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECCOVS= 5.034. NR OF IO REQUESTS (TAPE2)= 26. WORDS USED (TAPE2)= 94159
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECCOVS= 5.389. NR OF IO REQUESTS (TAPE2)= 32. WORDS USED (TAPE2)= 128030

DISPLACEMENT COMPONENT V X= 9.5000E-01 Y= 0.2500E+00. WAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 5.4273012E+05. THE FINAL VALUE = 0.1211329E-07

DETERMINANT OF STIFFNESS MATRIX= 3.4664726E+01*10.** 470. NUMBER OF NEGATIVE ROOTS = 0
 77 NCSES. 351 EQUATIONS. MAXIMUM BAND WIDTH = 60

MATRIX DECOMPOSITION COMPLETED.
 CP SECCOVS= 6.293. NR OF IO REQUESTS (TAPE2)= 38. WORDS USED (TAPE2)= 157810

LINEAR SOLUTION. PA= 1.000000E+00. PB= 0.
 ROW 10. X= .930. AXIAL LOAD= -1.425870E-01. BENDING MOMENT= 0.

ROW	1.	X=	0.0300	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
				SIGMAX	SIGMAY		SIGMAX	SIGMAY				
0.300	0.000	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.	0.5965E-13			
0.300	1.500	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.	2.8434E-12			
0.000	3.000	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.	1.5876E-12			
0.000	4.500	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.	2.3427E-12			
0.000	6.000	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.	4.0947E-13			
0.300	7.500	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.				
0.000	9.000	6.5975E+01	1.9908E+01	1.9908E+01	0.	-9.8397E+01	-2.9035E+01	0.				

ROW	2.	X=	.1800	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
				SIGMAX	SIGMAY		SIGMAX	SIGMAY				
1.00	0.000	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	0.			
1.00	1.500	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	5.3028E-12			
1.00	3.000	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	1.2020E-11			
1.00	4.500	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	2.2519E-11			
1.00	6.000	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	2.5930E-11			
1.00	7.500	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.	2.1870E-11			
1.00	9.000	-1.3127E+01	-2.4003E+01	-2.4003E+01	0.	-1.7268E+01	-2.8046E+01	0.				

ROW	3.	X=	.5000	OUTER SURFACE			INNER SURFACE			TAU	SIGMA (STRNGR)	SIGMA (RING)
				SIGMAX	SIGMAY		SIGMAX	SIGMAY				
1.00	0.000	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	0.			
1.00	1.500	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	1.2303E-12			
1.00	3.000	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	4.7201E-12			
1.00	4.500	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	1.1442E-11			
1.00	6.000	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	1.7015E-11			
1.00	7.500	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.	1.2580E-11			
1.00	9.000	-2.4003E+01	-7.0201E+01	-7.0201E+01	0.	-1.3116E+01	-6.7046E+01	0.				

Fig. 7-24 (Cont.)

ROW	9.	X=	.0000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
.000	0.000		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.	-1.3170E-11			
.000	1.500		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.	-1.3177E-11			
.000	3.000		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.	-1.7682E-11			
.020	4.500		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.	-9.9782E-12			
.040	6.000		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.	-8.2019E-12			
.060	7.500		-4.249E+01	-5.610E+01		0.	-4.146E+01	-6.211E+01		0.				
ROW 10.	X=	.9000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)	
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
.000	0.000		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.	1.5752E-12			
.020	1.500		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.	5.2487E-12			
.040	3.000		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.	9.8076E-12			
.060	4.500		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.	9.5631E-12			
.080	6.000		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.	6.3743E-13			
.100	7.500		-1.6966E+01	-2.5731E+01		0.	-2.5657E+01	-2.7023E+01		0.				
ROW 11.	X=	1.0000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)	
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
1.000	0.000		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
1.200	1.500		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
1.400	3.000		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
1.600	4.500		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
1.800	6.000		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
2.000	7.500		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
2.200	9.000		7.0025E+01	2.1141E+01		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
CP SECTORS=	7.320.	NR OF 10 REQUESTS (TAPE2)=	63.	WORDS USED (TAPE2)=				WORDS TRANSFERRED (TAPE2)=				264663		
ROW 1.	X=	0.0000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)	
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
1	0.000		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
2	1.500		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
3	3.000		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
4	4.500		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
5	6.000		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
6	7.500		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
7	9.000		0.	0.		0.	-1.1231E+02	-3.3825E+01		0.	1.4237E-12			
ROW 6.	X=	.5000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)	
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
1	0.000		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
2	1.500		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
3	3.000		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
4	4.500		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
5	6.000		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
6	7.500		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
7	9.000		-1.049105E-05	0.		0.	-1.049105E-05	0.		0.	1.4237E-12			
ROW 9.	X=	.0000	OUTER SURFACE				INNER SURFACE				TAU	SIGMA (STRNGR)	SIGMA (RING)	
	X	Y	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMAX	SIGMAY	SIGMAZ	TAU	SIGMA (STRNGR)	SIGMA (RING)		
1	0.000		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
2	1.500		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
3	3.000		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
4	4.500		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
5	6.000		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
6	7.500		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			
7	9.000		-7.552051E-06	0.		0.	-7.552051E-06	0.		0.	1.4237E-12			

Fig. 7-24 (Cont.)

[illegible]

Fig. 7-24 (Cont.)

DETERMINANT OF STIFFNESS MATRIX= 7.9086280E+02*10.00 450. NUMBER OF NEGATIVE ROOTS = 0
 77 MODES. 351 EQUATIONS. MAXIMUM BAND WIDTH = 60
 MATRIX DECOMPOSITION COMPLETED.
 CP SECONDS= 13.678. NR OF IO REQUESTS (TAPE2)= 193. WORDS USED (TAPE2)= 77113. WORDS TRANSFERRED (TAPE2)= 468811

EIGENVALUE SHIFT= -0. NUMBER OF NEGATIVE ROOTS= 0
 ITERATION EIGENVALUE (RALEIGH QUOTIENT) (ACCELERATED ESTIMATE)
 0 9.5553416E+01
 1 7.1947007E+02
 2 7.0432725E+02
 3 7.0281230E+02
 4 7.047223E+02
 5 7.0265532E+02
 6 7.0265300E+02
 7 7.0265300E+02

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 7.026530E+02 TIMES THE STARTING LOAD.

ROW COL	1. X	Y	0.0000	W	V	U	BETAX	BETAY
1	0.0000	0.	0.	0.	0.	0.	0.	0.
2	1.5300	0.	0.	0.	0.	0.	0.	0.
3	3.0000	0.	0.	0.	0.	0.	0.	0.
4	4.5000	0.	0.	0.	0.	0.	0.	0.
5	6.0000	0.	0.	0.	0.	0.	0.	0.
6	7.5000	0.	0.	0.	0.	0.	0.	0.
7	9.0000	0.	0.	0.	0.	0.	0.	0.

ROW COL	6. X	Y	-5.0000	W	V	U	BETAX	BETAY
1	0.0000	0.	0.	0.	0.	0.	0.	0.
2	1.5300	0.	0.	0.	0.	0.	0.	0.
3	3.0000	0.	0.	0.	0.	0.	0.	0.
4	4.5000	0.	0.	0.	0.	0.	0.	0.
5	6.0000	0.	0.	0.	0.	0.	0.	0.
6	7.5000	0.	0.	0.	0.	0.	0.	0.
7	9.0000	0.	0.	0.	0.	0.	0.	0.

ROW COL	9. X	Y	-8.0000	W	V	U	BETAX	BETAY
1	0.0000	0.	0.	0.	0.	0.	0.	0.
2	1.5300	0.	0.	0.	0.	0.	0.	0.
3	3.0000	0.	0.	0.	0.	0.	0.	0.
4	4.5000	0.	0.	0.	0.	0.	0.	0.
5	6.0000	0.	0.	0.	0.	0.	0.	0.
6	7.5000	0.	0.	0.	0.	0.	0.	0.
7	9.0000	0.	0.	0.	0.	0.	0.	0.

ROW COL	11. X	Y	1.0000	W	V	U	BETAX	BETAY
1	0.0000	0.	0.	0.	0.	0.	0.	0.
2	1.5300	0.	0.	0.	0.	0.	0.	0.
3	3.0000	0.	0.	0.	0.	0.	0.	0.
4	4.5000	0.	0.	0.	0.	0.	0.	0.
5	6.0000	0.	0.	0.	0.	0.	0.	0.
6	7.5000	0.	0.	0.	0.	0.	0.	0.
7	9.0000	0.	0.	0.	0.	0.	0.	0.

CP SECONDS= 15.594. NR OF IO REQUESTS (TAPE2)= 155. WORDS USED (TAPE2)= 84612. WORDS TRANSFERRED (TAPE2)= 723038

Fig. 7-24 (Cont.)

7.9 SAMPLE CASE 9 – FIBERWOUND CYLINDER

The critical axial line load according to bifurcation theory is to be determined for a circular cylindrical shell built up from 3 fiber-wound layers and clamped at both ends. The geometry of the shell is shown in Fig. 7-25.

Analysis with BOSOR4 (Ref. 15) shows that for this shell, the critical axial line load is 500 lb/in. for a mode with 11 circumferential waves. Therefore, a shell covering one half the length and 1/44 of the circumference can be analyzed.

The meridional boundary conditions are the same as for Sample Case 4. The input cards associated with this case are displayed in Fig. 7-26. Portions of the output are presented in Fig. 7-27.

The critical axial line load determined here is 609 lb/in. Note that the discrepancy in the solution is due to the coarseness of the grid in the longitudinal direction, selected here to reduce the run time.

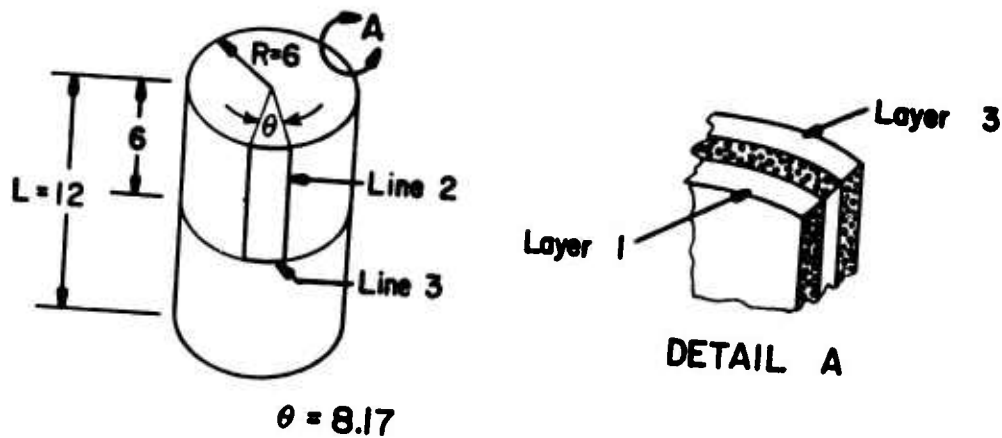


Fig. 7-25 Sample Case 9 - Fiberwound Cylinder

SAMPLE CASE 9 INPUT

SAMPLE CASE 9 - CYLINDER FIBERWOUND										
1	1	1								C-1
6.0		8.17		6.0						G-1
19	9									G-2
0	4	4		4						D-1
0	0	1		0						B-1
1	0	1.		1.		1.				B-2
0.		0.		1.						L-1
		500.0			1	2	0	0	2	L-2
	2	4	4	5		20			1	P-1A
	0	0	1	4	0	1	1			P-1A1
0.		2.		4.		6.				O-1
	4									O-2
12400000.	500000.0		0.22		0.35		0.0			M-1
0.0115	.32		90.0		0.3			3		M-2D1
0.013	.32		0.0		0.3					M-2D2
0.0115	.32		90.0		0.3					

Fig. 7-26 Display of Input Cards for Sample Case 9

SAMPLE CASE 9 - OUTPUT

SAMPLE CASE 9 - CYLINDER FIBERWOUND
BUCKLING ANALYSIS.
1 LOAD PATTERNS.

TYPE OF SURFACE IS CYLINDER

SURFACE CONSTANTS = 6.000000E+00, 0.170000E+00, 6.000000E+00, 6.000000E+00.

BLANK CANNON ARRAY WORKING SPACE= 15000

FINITE DIFFERENCE MESH, 19 ROWS, 9 COLUMNS. MESH SPACING, M= .3333, K= 1.0212

NR01= -0. NR02= -0. NR03= -0

BOUNDARY CONDITION AT LINE 1 IS SET BY IFREE = 0. 0. 1. 0.

BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC

BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC

BOUNDARY CONDITION AT LINE 4 IS SYMMETRIC

LOAD A DATA

CARD COUNT = 1

USER-LOAD FLAG = 0. STARTING LOAD FACTOR = 1.000000E+00. LOAD STEP = 1.000000E+00. MAXIMUM LOAD = 1.000000E+00

PZ	C.	PY	PX	JZ	JY	JX	ROW	COL
3.			1.000000E+00	0	0	2	1	0

BOUNDARY CONDITIONS FOR BUCKLING DISPLACEMENTS

BOUNDARY CONDITION AT LINE 1 IS CLAMPED

BOUNDARY CONDITION AT LINE 2 IS SYMMETRIC

BOUNDARY CONDITION AT LINE 3 IS SYMMETRIC

BOUNDARY CONDITION AT LINE 4 IS ANTI-METRIC

IS-IT ITERAT SHIFT

2	20	5.00J00L+02
IP= 4	IPV= 0	IPED= 1
IPRS= 1	IPRS= 1	IPLOT= -0
IPALL= 4.	IPSTR= -0.	NRING= -0.
IP= -0.	IP= -0.	IM= -0.
JM= -0		

ANALYSIS IS FOR A FIBER REINFORCED SHELL.

FIBER MODULUS= 1.24J0000E+07 FIBER POISSON RATIO= 2.2900000E-01

MATRIX MODULUS= 5.00J0000E+05 MATRIX POISSON RATIO= 3.5000000E-01

LAYER	THICKNESS	MATRIX CONTENT	WINDING ANGLE	CONTIGUITY FACTOR
1	1.1500000E-02	3.2000000E-01	9.0000000E+01	3.0000000E-01
2	1.1000000E-02	3.2000000E-01	0.	3.0000000E-01
3	1.1500000E-02	3.2000000E-01	9.0000000E+01	3.0000000E-01

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CPM4

CCCC(1,1)	CCCC(1,2)	CCCC(1,3)	CCCC(1,4)	CCCC(1,5)	CCCC(1,6)
1.759966E+05	0.	0.	0.	0.	0.
2.451240E+04	2.371700E+05	0.	0.	0.	0.
3.349317E-05	2.179142E-06	5.042475E+04	0.	0.	0.
2.112444E-11	3.132315E-12	3.130132E-21	1.176095E+01	0.	0.
3.143231E-12	2.913345E-11	2.032074E-20	2.647302E+00	3.298104E+01	0.
3.349132E-21	7.032074E-20	6.366463E-12	4.911942E-09	3.510259E-00	5.445873E+00

Fig. 7-27 Excerpt of Output for Sample Case 9

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECTIONS= 2.605. NR OF IC REQUESTS (TAPE2)= 13. WORDS USED (TAPE2)= 39850. WORDS TRANSFERRED (TAPE2)= 43954
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECTIONS= 6.751. NR OF IC REQUESTS (TAPE2)= 29. WORDS USED (TAPE2)= 71537. WORDS TRANSFERRED (TAPE2)= 111400
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECTIONS= 7.512. NR OF IC REQUESTS (TAPE2)= 43. WORDS USED (TAPE2)= 98109. WORDS TRANSFERRED (TAPE2)= 194103

DETERMINANT OF STIFFNESS MATRIX= 3.4417076E+05*10.** 1120. NUMBER OF NEGATIVE ROOTS = 0
 171 NODS, 593 EQUATIONS. MAXIMUM BAND WIDTH = 72
 MATRIX COMPOSITION COMPLETED.
 CP SECTIONS= 10.272. NR OF IC REQUESTS (TAPE2)= 53. WORDS USED (TAPE2)= 98109. WORDS TRANSFERRED (TAPE2)= 249375

LINEAR SOLUTION. PA= 1.00000E+00. PB= 0.0. BENDING MOMENT= 0.
 PC= 10. X= 5.637. AXIAL LOAD= -8.555604E-01.

ROW	COL	1.	X	Y	U	V	BETAX	BETAY
1	1	0.056	0.	0.	3.437020E-05	0.	0.	0.
2	2	0.056	0.	0.	3.437020E-05	0.	0.	-1.643460E-12
3	3	1.6219	0.	9.650761E-32	3.437020E-05	0.	0.	-3.286920E-12
4	4	2.5531	0.	1.972152E-31	3.437020E-05	0.	0.	-3.286920E-12
5	5	3.5744	0.	1.972152E-31	3.437020E-05	0.	0.	-3.286920E-12
6	6	4.5956	0.	1.972152E-31	3.437020E-05	0.	0.	-3.286920E-12
7	7	5.6169	0.	9.650761E-32	3.437020E-05	0.	0.	-1.643460E-12
8	8	6.6381	0.	9.650761E-32	3.437020E-05	0.	0.	-1.643460E-12
9	9	7.6594	0.	0.	3.437020E-05	0.	0.	0.

ROW	COL	7.	X	Y	U	V	BETAX	BETAY
1	1	0.056	0.	0.	2.292744E-05	0.	0.	0.
2	2	0.056	0.	0.	2.292744E-05	0.	0.	-3.998728E-09
3	3	1.5319	0.	-1.130220E-18	2.292744E-05	0.	0.	-3.998728E-09
4	4	2.5531	0.	-1.091868E-18	2.292744E-05	0.	0.	-3.998728E-09
5	5	3.5744	0.	-2.289151E-18	2.292744E-05	0.	0.	-3.998728E-09
6	6	4.5956	0.	-2.422170E-18	2.292744E-05	0.	0.	-3.998728E-09
7	7	5.6169	0.	-2.253588E-18	2.292744E-05	0.	0.	-3.998728E-09
8	8	6.6381	0.	-1.827553E-18	2.292744E-05	0.	0.	-3.998728E-09
9	9	7.6594	0.	-1.059773E-18	2.292744E-05	0.	0.	-3.998728E-09

ROW	COL	13.	X	Y	U	V	BETAX	BETAY
1	1	0.056	0.	0.	1.146375E-05	0.	0.	0.
2	2	0.056	0.	0.	1.146375E-05	0.	0.	-4.967574E-12
3	3	1.5319	0.	-7.514093E-19	1.146375E-05	0.	0.	-4.967574E-12
4	4	2.5531	0.	-1.270713E-18	1.146375E-05	0.	0.	-4.967574E-12
5	5	3.5744	0.	-1.571942E-18	1.146375E-05	0.	0.	-4.967574E-12
6	6	4.5956	0.	-1.672805E-18	1.146375E-05	0.	0.	-4.967574E-12
7	7	5.6169	0.	-1.555324E-18	1.146375E-05	0.	0.	-4.967574E-12
8	8	6.6381	0.	-2.295568E-18	1.146375E-05	0.	0.	-4.967574E-12
9	9	7.6594	0.	-7.072619E-19	1.146375E-05	0.	0.	-4.967574E-12

Fig. 7-27 (Cont.)

ROW	COL	19.	X =	Y	6.0000	M	V	U	BEYAX	BEYAY	
1	1	0.0356			3.554520E-06	0.	1.720661E-17	-1.694066E-21	0.	0.	0.
2	2	0.7559			3.554520E-06	3.102964E-17	0.	-3.08133E-21	0.	6.746878E-16	0.
3	3	1.5319			3.554520E-06	4.126751E-17	0.	-1.694066E-21	0.	1.28709E-15	0.
4	4	2.3031			3.554520E-06	4.550049E-17	0.	-1.694066E-21	0.	1.609740E-15	0.
5	5	3.0744			3.554520E-06	4.127759E-17	0.	-3.08133E-21	0.	1.738008E-15	0.
6	6	3.8456			3.554520E-06	3.104066E-17	0.	-1.694066E-21	0.	1.610461E-15	0.
7	7	4.6169			3.554520E-06	1.730847E-17	0.	-1.694066E-21	0.	1.240658E-15	0.
8	8	5.3881			3.554520E-06	0.	-1.694066E-21	0.	0.	6.760427E-16	0.
9	9	6.1594			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
10	10	6.9306			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
11	11	7.7019			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
12	12	8.4731			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
13	13	9.2444			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
14	14	10.0156			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
15	15	10.7869			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
16	16	11.5581			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
17	17	12.3294			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
18	18	13.1006			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
19	19	13.8719			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
20	20	14.6431			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
21	21	15.4144			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
22	22	16.1856			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
23	23	16.9569			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
24	24	17.7281			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
25	25	18.5000			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
26	26	19.2713			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
27	27	20.0426			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
28	28	20.8139			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
29	29	21.5851			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
30	30	22.3564			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
31	31	23.1277			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
32	32	23.8989			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
33	33	24.6702			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
34	34	25.4415			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
35	35	26.2128			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
36	36	26.9841			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
37	37	27.7554			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
38	38	28.5267			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
39	39	29.2979			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
40	40	30.0692			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
41	41	30.8405			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
42	42	31.6118			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
43	43	32.3831			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
44	44	33.1544			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
45	45	33.9257			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
46	46	34.6969			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
47	47	35.4682			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
48	48	36.2395			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
49	49	37.0108			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
50	50	37.7821			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
51	51	38.5534			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
52	52	39.3247			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
53	53	40.0959			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
54	54	40.8672			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
55	55	41.6385			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
56	56	42.4098			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
57	57	43.1811			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
58	58	43.9524			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
59	59	44.7237			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
60	60	45.4950			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
61	61	46.2663			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
62	62	47.0376			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
63	63	47.8089			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
64	64	48.5802			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
65	65	49.3515			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
66	66	50.1228			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
67	67	50.8941			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
68	68	51.6654			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
69	69	52.4367			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
70	70	53.2080			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
71	71	53.9793			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
72	72	54.7506			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
73	73	55.5219			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
74	74	56.2932			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
75	75	57.0645			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
76	76	57.8358			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
77	77	58.6071			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
78	78	59.3784			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
79	79	60.1497			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
80	80	60.9210			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
81	81	61.6923			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
82	82	62.4636			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
83	83	63.2349			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
84	84	64.0062			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
85	85	64.7775			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
86	86	65.5488			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
87	87	66.3201			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
88	88	67.0914			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
89	89	67.8627			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
90	90	68.6340			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
91	91	69.4053			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
92	92	70.1766			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
93	93	70.9479			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
94	94	71.7192			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
95	95	72.4905			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
96	96	73.2618			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
97	97	74.0331			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
98	98	74.8044			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
99	99	75.5757			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.
100	100	76.3470			3.554520E-06	0.	-1.694066E-21	0.	0.	0.	0.

Fig. 7-27 (Cont.)

THE FOLLOWING STIFFNESS COEFFICIENTS ARE CALCULATED IN SUBROUTINE CFSN

CCCC(1,1)	CCCC(1,2)	CCCC(1,3)	CCCC(1,4)	CCCC(1,5)	CCCC(1,6)
1.70868E+05	0.	0.	0.	0.	0.
2.40125E+04	2.37170E+09	0.	0.	0.	0.
3.00417E+05	2.17910E+04	0.	0.	0.	0.
2.00049E+11	3.18331E-12	3.04247E+04	0.	0.	0.
1.14111E-12	2.91033E+11	3.18613E-21	1.17689E+01	0.	0.
1.39411E-21	2.03207E-20	2.03787E-20	2.64738E+00	3.29610E+01	0.
		6.36646E-12	6.91194E-09	3.51024E-08	5.44507E+00

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 14.230. NR OF 10 REQUESTS (TAPE2)= 122. WORDS USED (TAPE2)= 100157. WORDS TRANSFERRED (TAPE2)= 360909

DETERMINANT OF STIFFNESS MATRIX= 6.41296E+06*10** 1050. NUMBER OF NEGATIVE ROOTS = 0
 171 WORDS. MATRIX DECOMPOSITION COMPLETED. MAXIMUM BAND WIDTH = 72

CP SECONDS= 21.647. NR OF 10 REQUESTS (TAPE2)= 132. WORDS USED (TAPE2)= 100157. WORDS TRANSFERRED (TAPE2)= 619777

EIGENVALUE SHIFT= 5.000000E+02. NUMBER OF NEGATIVE ROOTS= 0

ITERATION	EIGENVALUE (RAYLEIGH QUOTIENT)	EIGENVALUE (ACCELERATED ESTIMATE)
0	5.65954E+02	5.000000E+02
1	7.17204E+02	4.515548E+02
2	6.17177E+02	6.592349E+02
3	6.11097E+02	6.105959E+02
4	6.10711E+02	6.104640E+02
5	6.10333E+02	6.099302E+02
6	6.09904E+02	6.062203E+02
7	6.07662E+02	6.042110E+02
8	6.03582E+02	6.065594E+02
9	6.04632E+02	6.047624E+02
10	6.07110E+02	6.047914E+02
11	6.07211E+02	6.047970E+02
12	6.07123E+02	6.047948E+02
13	6.07067E+02	6.047903E+02
14	6.04615E+02	6.047853E+02
15	6.03972E+02	6.047803E+02
16	6.03937E+02	6.047785E+02
17	6.04000E+02	6.047730E+02
18	6.04461E+02	6.047702E+02
19	6.04642E+02	6.047679E+02
20	6.04677E+02	6.047661E+02

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 33.440. NR OF 10 REQUESTS (TAPE2)= 416. WORDS USED (TAPE2)= 121119. WORDS TRANSFERRED (TAPE2)= 2303824

Fig. 7-27 (Cont.)

DETERMINANT OF STIFFNESS MATRIX = 2.687631E+09*10.00 1060. NUMBER OF NEGATIVE ROOTS = 0
 171. NODES. 133 EQUATIONS. MAXIMUM BAND WIDTH = 72
 ANALYSIS TERMINATION COMPLETED.
 CP SEQUENCE 36.25%. NR OF IO REQUESTS (TAPE2) = 420. WORDS USED (TAPE2) = 121110. WORDS TRANSFERRED (TAPE2) = 2358816
 EIGENVALUE SHIFT = 6.923235E+02. NUMBER OF NEGATIVE ROOTS = 0
 EIGENVALUE (EIGENVALUE (ACCELERATED ESTIMATE)
 0 6.000000E+02 6.000000E+02
 1 6.000000E+02 6.000000E+02
 2 6.000000E+02 6.000000E+02
 3 6.000000E+02 6.000000E+02

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 6.007601E+02 TIMES THE STARTING LOAD.

ROW	1.	2.	3.	4.	5.	6.	7.	8.	9.
COL	1.	2.	3.	4.	5.	6.	7.	8.	9.
1	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
2	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
3	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
4	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
5	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
6	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
7	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
8	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
9	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

ROW	1.	2.	3.	4.	5.	6.	7.	8.	9.
COL	1.	2.	3.	4.	5.	6.	7.	8.	9.
1	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
2	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
3	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
4	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
5	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
6	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
7	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
8	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
9	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

ROW	1.	2.	3.	4.	5.	6.	7.	8.	9.
COL	1.	2.	3.	4.	5.	6.	7.	8.	9.
1	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
2	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
3	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
4	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
5	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
6	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
7	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
8	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
9	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

ROW	1.	2.	3.	4.	5.	6.	7.	8.	9.
COL	1.	2.	3.	4.	5.	6.	7.	8.	9.
1	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
2	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
3	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
4	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
5	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
6	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
7	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
8	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
9	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

Fig. 7-27 (Cont.)

7.10 SAMPLE CASE 10 – THERMAL LOADS

The critical load combination according to bifurcation theory will be determined for a simply supported circular cylindrical shell loaded with axial compressive line load and subjected to temperature distribution that varies linearly along the length and is constant circumferentially.

Analysis with BOSOR4 (Re 15) shows that for this shell, the lowest eigenvalue of 3.156 occurs in conjunction with 26 circumferential waves. Therefore, a shell covering one half the length and 1/52 of the circumference can be analyzed.

User-written subroutine MATER is used here to introduce the material properties and the temperature distribution. However, this particular example could be solved using user-written subroutine TEMP and input card M-2B. The geometry and temperature variation of the shell are shown in Fig. 7-28. Subroutine MATER and the input cards associated with this case are shown in Fig. 7-29 and Fig. 7-30, respectively. Portions of the output are presented in Fig. 7-31. The critical load for this case is the eigenvalue times (STLD*PP), where PP is the base load composed of the axial line load (1 lb/in.) plus the thermal loads due to the temperature distribution as shown in Fig. 7-28. The lowest eigenvalue determined here is 3.269.

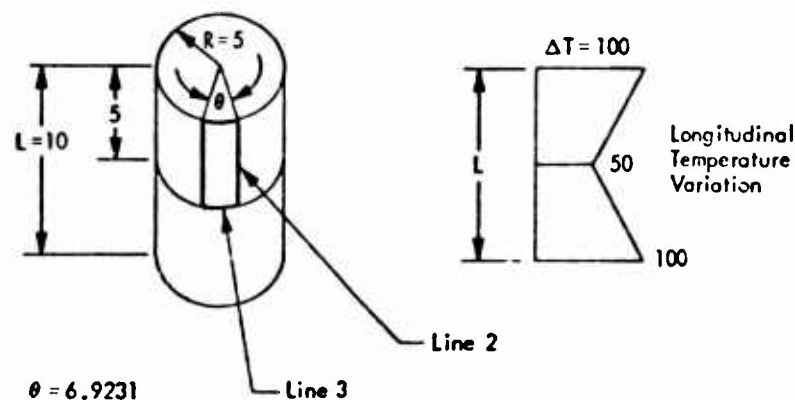


Fig. 7-28 Sample Case 10 – Thermal Loading

```

SUBROUTINE MATER (X,Y,IP,TDEG,EX,EY,U,G,A1,A2)
DIMENSION TDEG(IP),EX(IP),EY(IP),U(IP),G(IP),A1(IP),A2(IP)
COMMON /OFST/ TD,Z
C   TD AND Z MUST BE SET BY THE USER
C   TD = TOTAL THICKNESS OF SHELL (TD = AT)
C   Z = DISTANCE FROM REFERENCE SURFACE TO MIDSURFACE OF SHELL WALL
AT=0.03
Z=0.
TD=AT
DO 1 L=1,IP
C=1.
TDEG(L)=50.*(2.-X/10.)
EX(L)=C*10000000.
EY(L)=C*10000000.
U(L)=0.3
G(L)=C*4000000.
A1(L)=0.0001
A2(L)=0.0001
1 CONTINUE
RETURN
END

```

Fig. 7-29 Subroutine MATER for Sample Case 10

SAMPLE CASE 10 INPUT

SAMPLE CASE 10 - THERMAL LOADS (IWALL=8)										
	1	1	1							C-1
5.		6.9231	5.							G-1
	0	6								G-2
	3									D-1
1.		3.	1.							D-2
	10	10	10							D-3
	1	4	4	4						D-4
	1	0	1.							B-1
C.		0.	1.		0	0	2	1	0	L-1
					1	16				L-2
	0	0	1	4	0	1	1			P-1A
.3		1.9	3.4	5.						O-1
	8	0	0	3						O-2
										M-1

Fig. 7-30 Display of Input Cards for Sample Case 10

SAMPLE CASE 10 - OUTPUT

SAMPLE CASE 13 - THERMAL LOADS (IMMEDIATE)
:C: ANALYSIS.

TYPE OF SURFACE IS CYLINDER

SURFACE CONSTANTS = 5.000000E+00, 6.921000E+00, 5.000000E+00,

STATION NO. COORDINATE

[illegible]

0968
0967
0966

0965
0964
0963
0962
0961
0960
0959
0958
0957
0956
0955
0954
0953
0952
0951
0950
0949
0948
0947
0946
0945
0944
0943
0942
0941
0940
0939
0938
0937
0936
0935
0934
0933
0932
0931
0930
0929
0928
0927
0926
0925
0924
0923
0922
0921
0920
0919
0918
0917
0916
0915
0914
0913
0912
0911
0910
0909
0908
0907
0906
0905
0904
0903
0902
0901
0900
0899
0898
0897
0896
0895
0894
0893
0892
0891
0890
0889
0888
0887
0886
0885
0884
0883
0882
0881
0880
0879
0878
0877
0876
0875
0874
0873
0872
0871
0870
0869
0868
0867
0866
0865
0864
0863
0862
0861
0860
0859
0858
0857
0856
0855
0854
0853
0852
0851
0850
0849
0848
0847
0846
0845
0844
0843
0842
0841
0840
0839
0838
0837
0836
0835
0834
0833
0832
0831
0830
0829
0828
0827
0826
0825
0824
0823
0822
0821
0820
0819
0818
0817
0816
0815
0814
0813
0812
0811
0810
0809
0808
0807
0806
0805
0804
0803
0802
0801
0800
0799
0798
0797
0796
0795
0794
0793
0792
0791
0790
0789
0788
0787
0786
0785
0784
0783
0782
0781
0780
0779
0778
0777
0776
0775
0774
0773
0772
0771
0770
0769
0768
0767
0766
0765
0764
0763
0762
0761
0760
0759
0758
0757
0756
0755
0754
0753
0752
0751
0750
0749
0748
0747
0746
0745
0744
0743
0742
0741
0740
0739
0738
0737
0736
0735
0734
0733
0732
0731
0730
0729
0728
0727
0726
0725
0724
0723
0722
0721
0720
0719
0718
0717
0716
0715
0714
0713
0712
0711
0710
0709
0708
0707
0706
0705
0704
0703
0702
0701
0700
0699
0698
0697
0696
0695
0694
0693
0692
0691
0690
0689
0688
0687
0686
0685
0684
0683
0682
0681
0680
0679
0678
0677
0676
0675
0674
0673
0672
0671
0670
0669
0668
0667
0666
0665
0664
0663
0662
0661
0660
0659
0658
0657
0656
0655
0654
0653
0652
0651
0650
0649
0648
0647
0646
0645
0644
0643
0642
0641
0640
0639
0638
0637
0636
0635
0634
0633
0632
0631
0630
0629
0628
0627
0626
0625
0624
0623
0622
0621
0620
0619
0618
0617
0616
0615
0614
0613
0612
0611
0610
0609
0608
0607
0606
0605
0604
0603
0602
0601
0600
0599
0598
0597
0596
0595
0594
0593
0592
0591
0590
0589
0588
0587
0586
0585
0584
0583
0582
0581
0580
0579
0578
0577
0576
0575
0574
0573
0572
0571
0570
0569
0568
0567
0566
0565
0564
0563
0562
0561
0560
0559
0558
0557
0556
0555
0554
0553
0552
0551
0550
0549
0548
0547
0546
0545
0544
0543
0542
0541
0540
0539
0538
0537
0536
0535
0534
0533
0532
0531
0530
0529
0528
0527
0526
0525
0524
0523
0522
0521
0520
0519
0518
0517
0516
0515
0514
0513
0512
0511
0510
0509
0508
0507
0506
0505
0504
0503
0502
0501
0500
0499
0498
0497
0496
0495
0494
0493
0492
0491
0490
0489
0488
0487
0486
0485
0484
0483
0482
0481
0480
0479
0478
0477
0476
0475
0474
0473
0472
0471
0470
0469
0468
0467
0466
0465
0464
0463
0462
0461
0460
0459
0458
0457
0456
0455
0454
0453
0452
0451
0450
0449
0448
0447
0446
0445
0444
0443
0442
0441
0440
0439
0438
0437
0436
0435
0434
0433
0432
0431
0430
0429
0428
0427
0426
0425
0424
0423
0422
0421
0420
0419
0418
0417
0416
0415
0414
0413
0412
0411
0410
0409
0408
0407
0406
0405
0404
0403
0402
0401
0400
0399
0398
0397
0396
0395
0394
0393
0392
0391
0390
0389
0388
0387
0386
0385
0384
0383
0382
0381
0380
0379
0378
0377
0376
0375
0374
0373
0372
0371
0370
0369
0368
0367
0366
0365
0364
0363
0362
0361
0360
0359
0358
0357
0356
0355
0354
0353
0352
0351
0350
0349
0348
0347
0346
0345
0344
0343
0342
0341
0340
0339
0338
0337
0336
0335
0334
0333
0332
0331
0330
0329
0328
0327
0326
0325
0324
0323
0322
0321
0320
0319
0318
0317
0316
0315
0314
0313
0312
0311
0310
0309
0308
0307
0306
0305
0304
0303
0302
0301
0300
0299
0298
0297
0296
0295
0294
0293
0292
0291
0290
0289
0288
0287

1000

[illegible]

2
6
JFJG
-3000

.7030

[illegible]

THE

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100 101 102 103 104 105 106 107 108 109 110 111 112 113 114 115 116 117 118 119 120 121 122 123 124 125 126 127 128 129 130 131 132 133 134 135 136 137 138 139 140 141 142 143 144 145 146 147 148 149 150 151 152 153 154 155 156 157 158 159 160 161 162 163 164 165 166 167 168 169 170 171 172 173 174 175 176 177 178 179 180 181 182 183 184 185 186 187 188 189 190 191 192 193 194 195 196 197 198 199 200 201 202 203 204 205 206 207 208 209 210 211 212 213 214 215 216 217 218 219 220 221 222 223 224 225 226 227 228 229 230 231 232 233 234 235 236 237 238 239 240 241 242 243 244 245 246 247 248 249 250 251 252 253 254 255 256 257 258 259 260 261 262 263 264 265 266 267 268 269 270 271 272 273 274 275 276 277 278 279 280 281 282 283 284 285 286 287 288 289 290 291 292 293 294 295 296 297 298 299 300 301 302 303 304 305 306 307 308 309 310 311 312 313 314 315 316 317 318 319 320 321 322 323 324 325 326 327 328 329 330 331 332 333 334 335 336 337 338 339 340 341 342 343 344 345 346 347 348 349 350 351 352 353 354 355 356 357 358 359 360 361 362 363 364 365 366 367 368 369 370 371 372 373 374 375 376 377 378 379 380 381 382 383 384 385 386 387 388 389 390 391 392 393 394 395 396 397 398 399 400 401 402 403 404 405 406 407 408 409 410 411 412 413 414 415 416 417 418 419 420 421 422 423 424 425 426 427 428 429 430 431 432 433 434 435 436 437 438 439 440 441 442 443 444 445 446 447 448 449 450 451 452 453 454 455 456 457 458 459 460 461 462 463 464 465 466 467 468 469 470 471 472 473 474 475 476 477 478 479 480 481 482 483 484 485 486 487 488 489 490 491 492 493 494 495 496 497 498 499 500 501 502 503 504 505 506 507 508 509 510 511 512 513 514 515 516 517 518 519 520 521 522 523 524 525 526 527 528 529 530 531 532 533 534 535 536 537 538 539 540 541 542 543 544 545 546 547 548 549 550 551 552 553 554 555 556 557 558 559 560 561 562 563 564 565 566 567 568 569 570 571 572 573 574 575 576 577 578 579 580 581 582 583 584 585 586 587 588 589 590 591 592 593 594 595 596 597 598 599 600 601 602 603 604 605 606 607 608 609 610 611 612 613 614 615 616 617 618 619 620 621 622 623 624 625 626 627 628 629 630 631 632 633 634 635 636 637 638 639 640 641 642 643 644 645 646 647 648 649 650 651 652 653 654 655 656 657 658 659 660 661 662 663 664 665 666 667 668 669 670 671 672 673 674 675 676 677 678 679 680 681 682 683 684 685 686 687 688 689 690 691 692 693 694 695 696 697 698 699 700 701 702 703 704 705 706 707 708 709 710 711 712 713 714 715 716 717 718 719 720 721 722 723 724 725 726 727 728 729 730 731 732 733 734 735 736 737 738 739 740 741 742 743 744 745 746 747 748 749 750 751 752 753 754 755 756 757 758 759 760 761 762 763 764 765 766 767 768 769 770 771 772 773 774 775 776 777 778 779 780 781 782 783 784 785 786 787 788 789 790 791 792 793 794 795 796 797 798 799 800 801 802 803 804 805 806 807 808 809 810 811 812 813 814 815 816 817 818 819 820 821 822 823 824 825 826 827 828 829 830 831 832 833 834 835 836 837 838 839 840 841 842 843 844 845 846 847 848 849 850 851 852 853 854 855 856 857 858 859 860 861 862 863 864 865 866 867 868 869 870 871 872 873 874 875 876 877 878 879 880 881 882 883 884 885 886 887 888 889 890 891 892 893 894 895 896 897 898 899 900 901 902 903 904 905 906 907 908 909 910 911 912 913 914 915 916 917 918 919 920 921 922 923 924 925 926 927 928 929 930 931 932 933 934 935 936 937 938 939 940 941 942 943 944 945 946 947 948 949 950 951 952 953 954 955 956 957 958 959 960 961 962 963 964 965 966 967 968 969 970 971 972 973 974 975 976 977 978 979 980 981 982 983 984 985 986 987 988 989 990 991 992 993 994 995 996 997 998 999 1000 1001 1002 1003 1004 1005 1006 1007 1008 1009 1010 1011 1012 1013 1014 1015 1016 1017 1018 1019 1020 1021 1022 1023 1024 1025 1026 1027 1028 1029 1030 1031 1032 1033 1034 1035 1036 1037 1038 1039 1040 1

13
1-6559[illegible]

1961
1962
1963
1964
1965
1966
1967
1968
1969
1970
1971
1972
1973
1974
1975
1976
1977
1978
1979
1980
1981
1982
1983
1984
1985
1986
1987
1988
1989
1990
1991
1992
1993
1994
1995
1996
1997
1998
1999
2000
2001
2002
2003
2004
2005
2006
2007
2008
2009
2010
2011
2012
2013
2014
2015
2016
2017
2018
2019
2020
2021
2022
2023
2024
2025
2026
2027
2028
2029
2030
2031
2032
2033
2034
2035
2036
2037
2038
2039
2040
2041
2042
2043
2044
2045
2046
2047
2048
2049
2050
2051
2052
2053
2054
2055
2056
2057
2058
2059
2060
2061
2062
2063
2064
2065
2066
2067
2068
2069
2070
2071
2072
2073
2074
2075
2076
2077
2078
2079
2080
2081
2082
2083
2084
2085
2086
2087
2088
2089
2090
2091
2092
2093
2094
2095
2096
2097
2098
2099
2100
2101
2102
2103
2104
2105
2106
2107
2108
2109
2110
2111
2112
2113
2114
2115
2116
2117
2118
2119
2120
2121
2122
2123
2124
2125
2126
2127
2128
2129
2130
2131
2132
2133
2134
2135
2136
2137
2138
2139
2140
2141
2142
2143
2144
2145
2146
2147
2148
2149
2150
2151
2152
2153
2154
2155
2156
2157
2158
2159
2160
2161
2162
2163
2164
2165
2166
2167
2168
2169
2170
2171
2172
2173
2174
2175
2176
2177
2178
2179
2180
2181
2182
2183
2184
2185
2186
2187
2188
2189
2190
2191
2192
2193
2194
2195
2196
2197
2198
2199
2200
2201
2202
2203
2204
2205
2206
2207
2208
2209
2210
2211
2212
2213
2214
2215
2216
2217
2218
2219
2220
2221
2222
2223
2224
2225
2226
2227
2228
2229
2230
2231
2232
2233
2234
2235
2236
2237
2238
2239
2240
2241
2242
2243
2244
2245
2246
2247
2248
2249
2250
2251
2252
2253
2254
2255
2256
2257
2258
2259
2260
2261
2262
2263
2264
2265
2266
2267
2268
2269
2270
2271
2272
2273
2274
2275
2276
2277
2278
2279
2280
2281
2282
2283
2284
2285
2286
2287
2288
2289
2290
2291
2292
2293
2294
2295
2296
2297
2298
2299
2300
2301
2302
2303
2304
2305
2306
2307
2308
2309
2310
2311
2312
2313
2314
2315
2316
2317
2318
2319
2320
2321
2322
2323
2324
2325
2326
2327
2328
2329
2330
2331
2332
2333
2334
2335
2336
2337
2338
2339
2340
2341
2342
2343
2344
2345
2346
2347
2348
2349
2350
2351
2352
2353
2354
2355
2356
2357
2358
2359
2360
2361
2362
2363
2364
2365
2366
2367
2368
2369
2370
2371
2372
2373
2374
2375
2376
2377
2378
2379
2380
2381
2382
2383
2384
2385
2386
2387
2388
2389
2390
2391
2392
2393
2394
2395
2396
2397
2398
2399
2400
2401
2402
2403
2404
2405
2406
2407
2408
2409
2410
2411
2412
2413
2414
2415
2416
2417
2418
2419
2420
2421
2422
2423
2424
2425
2426
2427
2428
2429
2430
2431
2432
2433
2434
2435
2436
2437
2438
2439
2440
2441
2442
2443
2444
2445
2446
2447
2448
2449
2450
2451
2452
2453
2454
2455
2456
2457
2458
2459
2460
2461
2462
2463
2464
2465
2466
2467
2468
2469
2470
2471
2472
2473
2474
2475
2476
2477
2478
2479
2480
2481
2482
2483
2484
2485
2486
2487
2488
2489
2490
2491
2492
2493
2494
2495
2496
2497
2498
2499
2500
2501
2502
2503
2504
2505
2506
2507
2508
2509
2510
2511
2512
2513
2514
2515
2516
2517
2518
2519
2520
2521
2522
2523
2524
2525
2526
2527
2528
2529
2530
2531
2532
2533
2534
2535
2536
2537
2538
2539
2540
2541
2542
2543
2544
2545
2546
2547
2548
2549
2550
2551
2552
2553
2554
2555
2556
2557
2558
2559
2560
2561
2562
2563
2564
2565
2566
2567
2568
2569
2570
2571
2572
2573
2574
2575
2576
2577
2578
2579
2580
2581
2582
2583
2584
2585
2586
2587
2588
2589
2590
2591
2592
2593
2594
2595
2596
2597
2598
2599
2600
2601
2602
2603
2604
2605
2606
2607
2608
2609
2610
2611
2612
2613
2614
2615
2616
2617
2618
2619
2620
2621
2622
2623
2624
2625
2626
2627
2628
2629
2630
2631
2632
2633
2634
2635
2636
2637
2638
2639
2640
2641
2642
26

2-0350
2-0370

[illegible]

22 3.7509

2-2
4-1033
4-1033
4-1033

0302.9
222

22

Year	1990	1991	1992	1993	1994	1995	1996	1997	1998	1999	2000	2001	2002	2003	2004	2005	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055	2056	2057	2058	2059	2060	2061	2062	2063	2064	2065	2066	2067	2068	2069	2070	2071	2072	2073	2074	2075	2076	2077	2078	2079	2080	2081	2082	2083	2084	2085	2086	2087	2088	2089	2090	2091	2092	2093	2094	2095	2096	2097	2098	2099	2100
1990	1991	1992	1993	1994	1995	1996	1997	1998	1999	2000	2001	2002	2003	2004	2005	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055	2056	2057	2058	2059	2060	2061	2062	2063	2064	2065	2066	2067	2068	2069	2070	2071	2072	2073	2074	2075	2076	2077	2078	2079	2080	2081	2082	2083	2084	2085	2086	2087	2088	2089	2090	2091	2092	2093	2094	2095	2096	2097	2098	2099	2100	

0369
7-8368

23
207

62
6-1500

0105-4
0108-4
0122-2

5.69.5

2. ANY COMMON ARRAY WORKING SPACE= 15080

```
BLANK COMMON DATA SETS  
*****  
***** DIFFERENCE MESH. 31 ROWS,  
6 COLUMNS. MESH SPACING. H= 0.000, K= 1.3000
```

NEW2 = -3, NCL1 = -9
CONNECTION AT LINE 1 IS SIMPLESUPPORT.

CONCITON AT LINE 2 IS SYMMETRIC

SUBJECT **CONDITION** **AT LINE 3 IS** **SYMMETRIC**

00-000000 **CONVOLUTION** **AT LINE 3 IS** **SYMMETRIC**

00-000000 **CONVOLUTION** **AT LINE 4 IS** **SYMMETRIC**

SECRET

LOAD DATA

CARO COUNT = 1

LOAD STEP = -0.

USER-2047 FLAG = 0, STARTING LONG PULSION = 2000000000

PZ
PX
JZ
JY
JX
KOW
COL

30

1345
1780
1800

ISMAIL

1. Plot 1

191: 197: 198: 199: 200: 201: 202: 203: 204: 205: 206: 207: 208: 209: 210: 211: 212: 213: 214: 215: 216: 217: 218: 219: 220: 221: 222: 223: 224: 225: 226: 227: 228: 229: 230: 231: 232: 233: 234: 235: 236: 237: 238: 239: 240: 241: 242: 243: 244: 245: 246: 247: 248: 249: 250: 251: 252: 253: 254: 255: 256: 257: 258: 259: 260: 261: 262: 263: 264: 265: 266: 267: 268: 269: 270: 271: 272: 273: 274: 275: 276: 277: 278: 279: 280: 281: 282: 283: 284: 285: 286: 287: 288: 289: 290: 291: 292: 293: 294: 295: 296: 297: 298: 299: 300: 301: 302: 303: 304: 305: 306: 307: 308: 309: 310: 311: 312: 313: 314: 315: 316: 317: 318: 319: 320: 321: 322: 323: 324: 325: 326: 327: 328: 329: 330: 331: 332: 333: 334: 335: 336: 337: 338: 339: 340: 341: 342: 343: 344: 345: 346: 347: 348: 349: 350: 351: 352: 353: 354: 355: 356: 357: 358: 359: 360: 361: 362: 363: 364: 365: 366: 367: 368: 369: 370: 371: 372: 373: 374: 375: 376: 377: 378: 379: 380: 381: 382: 383: 384: 385: 386: 387: 388: 389: 390: 391: 392: 393: 394: 395: 396: 397: 398: 399: 400: 401: 402: 403: 404: 405: 406: 407: 408: 409: 410: 411: 412: 413: 414: 415: 416: 417: 418: 419: 420: 421: 422: 423: 424: 425: 426: 427: 428: 429: 430: 431: 432: 433: 434: 435: 436: 437: 438: 439: 440: 441: 442: 443: 444: 445: 446: 447: 448: 449: 450: 451: 452: 453: 454: 455: 456: 457: 458: 459: 460: 461: 462: 463: 464: 465: 466: 467: 468: 469: 470: 471: 472: 473: 474: 475: 476: 477: 478: 479: 480: 481: 482: 483: 484: 485: 486: 487: 488: 489: 490: 491: 492: 493: 494: 495: 496: 497: 498: 499: 500: 501: 502: 503: 504: 505: 506: 507: 508: 509: 510: 511: 512: 513: 514: 515: 516: 517: 518: 519: 520: 521: 522: 523: 524: 525: 526: 527: 528: 529: 530: 531: 532: 533: 534: 535: 536: 537: 538: 539: 540: 541: 542: 543: 544: 545: 546: 547: 548: 549: 550: 551: 552: 553: 554: 555: 556: 557: 558: 559: 560: 561: 562: 563: 564: 565: 566: 567: 568: 569: 570: 571: 572: 573: 574: 575: 576: 577: 578: 579: 580: 581: 582: 583: 584: 585: 586: 587: 588: 589: 590: 591: 592: 593: 594: 595: 596: 597: 598: 599: 600: 601: 602: 603: 604: 605: 606: 607: 608: 609: 610: 611: 612: 613: 614: 615: 616: 617: 618: 619: 620: 621: 622: 623: 624: 625: 626: 627: 628: 629: 630: 631: 632: 633: 634: 635: 636: 637: 638: 639: 640: 641: 642: 643: 644: 645: 646: 647: 648: 649: 650: 651: 652: 653: 654: 655: 656: 657: 658: 659: 660: 661: 662: 663: 664: 665: 666: 667: 668: 669: 670: 671: 672: 673: 674: 675: 676: 677: 678: 679: 680: 681: 682: 683: 684: 685: 686: 687: 688: 689: 690: 691: 692: 693: 694: 695: 696: 697: 698: 699: 700: 701: 702: 703: 704: 705: 706: 707: 708: 709: 710: 711: 712: 713: 714: 715: 716: 717: 718: 719: 720: 721: 722: 723: 724: 725: 726: 727: 728: 729: 730: 731: 732: 733: 734: 735: 736: 737: 738: 739: 740: 741: 742: 743: 744: 745: 746: 747: 748: 749: 750: 751: 752: 753: 754: 755: 756: 757: 758: 759: 760: 761: 762: 763: 764: 765: 766: 767: 768: 769: 770: 771: 772: 773: 774: 775: 776: 777: 778: 779: 780: 781: 782: 783: 784: 785: 786: 787: 788: 789: 790: 791: 792: 793: 794: 795: 796: 797: 798: 799: 800: 801: 802: 803: 804: 805: 806: 807: 808: 809: 810: 811: 812: 813: 814: 815: 816: 817: 818: 819: 820: 821: 822: 823: 824: 825: 826: 827: 828: 829: 830: 831: 832: 833: 834: 835: 836: 837: 838: 839: 840: 841: 842: 843: 844: 845: 846: 847: 848: 849: 850: 851: 852: 853: 854: 855: 856: 857: 858: 859: 860: 861: 862: 863: 864: 865: 866: 867: 868: 869: 870: 871: 872: 873: 874: 875: 876: 877: 878: 879: 880: 881: 882: 883: 884: 885: 886: 887: 888: 889: 890: 891: 892: 893: 894: 895: 896: 897: 898: 899: 900: 901: 902: 903: 904: 905: 906: 907: 908: 909: 910: 911: 912: 913: 914: 915: 916: 917: 918: 919: 920: 921: 922: 923: 924: 925: 926: 927: 928: 929: 930: 931: 932: 933: 934: 935: 936: 937: 938: 939: 940: 941: 942: 943: 944: 945: 946: 947: 948: 949: 950: 951: 952: 953: 954: 955: 956: 957: 958: 959: 960: 961: 962: 963: 964: 965: 966: 967: 968: 969: 970: 971: 972: 973: 974: 975: 976: 977: 978: 979: 980: 981: 982: 983: 984: 985: 986: 987: 988: 989: 990: 991: 992: 993: 994: 995: 996: 997: 998: 999: 1000: 1001: 1002: 1003: 1004: 1005: 1006: 1007: 1008: 1009: 1010: 1011: 10

A. WSTAY= 0, WRVSE= 0, IP= 3, IM= -9, JN= -9.

FIG. 7-31 Excerpt of Output for Sample Case 10

CALCULATION OF FINITE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECONDS= 2.418. NR OF IO REQUESTS (TAPE2)= 16. WORDS USED (TAPE2)= 45723. WORDS TRANSFERRED (TAPE2)= 49819
 FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED. WORDS USED (TAPE2)= 83385. WORDS TRANSFERRED (TAPE2)= 129879
 CP SECONDS= 4.650. NR OF IO REQUESTS (TAPE2)= 32. WORDS USED (TAPE2)= 103120. WORDS TRANSFERRED (TAPE2)= 198662
 ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECONDS= 5.636. NR OF IO REQUESTS (TAPE2)= 44. WORDS USED (TAPE2)= 103120. WORDS TRANSFERRED (TAPE2)= 198662

DETERMINANT OF STIFFNESS MATRIX= 1.2559249E+09*19.00 1218. NUMBER OF NEGATIVE ROOTS = 0
 136 NODES, 792 EQUATIONS. MAXIMUM BAND WIDTH = 54
 MATRIX DECOMPOSITION COMPLETED.
 CP SECONDS= 7.671. NR OF IO REQUESTS (TAPE2)= 52. WORDS USED (TAPE2)= 103120. WORDS TRANSFERRED (TAPE2)= 248348

LIVER SOLUTION. PAM 1.00000E+08. PB= 0.
 ROW 30. X= 4.980. AXIAL LOAD= -6.841549E-01. BENDING MOMENT= 0.

ROW	1.	X=	0.000	OUTER SURFACE			INNER SURFACE			TAU	SIGMA(STRNGR)	SIGMA(RING)
				SIGMAX	SIGMAY	SIGMAZ	SIGMAX	SIGMAY	SIGMAZ			
0.00	0.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
1.00	1.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
2.00	2.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
3.00	3.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
4.00	4.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
5.00	5.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
6.00	6.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
7.00	7.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			
8.00	8.00			-3.3333E+01	-1.0001E+05	0.	-3.3333E+01	-1.0001E+05	0.			

ROW	1.	X=	-3800	OUTER SURFACE			INNER SURFACE			TAU	SIGMA(STRNGR)	SIGMA(RING)
				SIGMAX	SIGMAY	SIGMAZ	SIGMAX	SIGMAY	SIGMAZ			
0.00	0.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
1.00	1.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
2.00	2.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
3.00	3.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
4.00	4.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
5.00	5.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
6.00	6.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
7.00	7.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			
8.00	8.00			-5.5448E+04	-3.5771E+03	0.	-5.5448E+04	-3.5771E+03	0.			

ROW	31.	X=	5.0000	OUTER SURFACE			INNER SURFACE			TAU	SIGMA(STRNGR)	SIGMA(RING)
				SIGMAX	SIGMAY	SIGMAZ	SIGMAX	SIGMAY	SIGMAZ			
0.00	0.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
1.00	1.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
2.00	2.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
3.00	3.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
4.00	4.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
5.00	5.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
6.00	6.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
7.00	7.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			
8.00	8.00			-1.4310E+03	3.1900E+02	0.	-1.4310E+03	3.1900E+02	0.			

CP SECONDS= 9.941. NR OF IO REQUESTS (TAPE2)= 89. WORDS USED (TAPE2)= 184146. WORDS TRANSFERRED (TAPE2)= 393279

ROW	COL	X=	.3300	U	V	W	RETA	RETB
1	0.00			-0.071632E-02	0.	0.226293E-02	0.	0.
2	1.00			-0.071632E-02	-1.174303E-16	0.226293E-02	-2.697714E-14	-2.697714E-14
3	2.00			-0.071632E-02	-1.653770E-16	0.226293E-02	-5.183654E-14	-5.183654E-14
4	3.00			-0.071632E-02	-2.512160E-16	0.226293E-02	-6.531959E-14	-6.531959E-14
5	4.00			-0.071632E-02	-3.371632E-16	0.226293E-02	-7.881261E-14	-7.881261E-14
6	5.00			-0.071632E-02	-4.231104E-16	0.226293E-02	-9.230563E-14	-9.230563E-14

Fig. 7-31 (Cont.)

ROW	14	X	1.9000	M	V	U	DETAX	DETAY
COL	1	0.3200	4.51774E-02	0.	0.	-2.584316E-02	-2.358049E-03	0.
	2	1.3346	4.51774E-02	2.68331E-17	-2.584316E-02	-2.584316E-02	-2.358049E-03	1.065292E-14
	3	2.7692	4.51774E-02	1.753163E-17	-2.584316E-02	-2.584316E-02	-2.358049E-03	1.065463E-14
	4	4.1539	4.51774E-02	6.677561E-18	-2.584316E-02	-2.584316E-02	-2.358049E-03	-5.885277E-15
	5	5.5395	4.51774E-02	-9.230975E-18	-2.584316E-02	-2.584316E-02	-2.358049E-03	-1.563300E-14
	6	6.9231	4.51774E-02	0.	-2.584316E-02	-2.584316E-02	-2.358049E-03	0.
ROW	19	X	3.4000	M	V	U	DETAX	DETAY
COL	1	0.3200	4.150339E-02	0.	-1.263470E-02	-1.263470E-02	-2.537533E-03	0.
	2	1.3346	4.150339E-02	9.102901E-17	-1.263470E-02	-1.263470E-02	-2.537533E-03	2.200462E-14
	3	2.7692	4.150339E-02	1.424931E-16	-1.263470E-02	-1.263470E-02	-2.537533E-03	3.052465E-14
	4	4.1539	4.150339E-02	1.22217E-16	-1.263470E-02	-1.263470E-02	-2.537533E-03	1.631804E-14
	5	5.5395	4.150339E-02	6.677567E-17	-1.263470E-02	-1.263470E-02	-2.537533E-03	-7.230979E-16
	6	6.9231	4.150339E-02	0.	-1.263470E-02	-1.263470E-02	-2.537533E-03	0.
ROW	31	X	5.0000	M	V	U	DETAX	DETAY
COL	1	0.3200	4.787426E-02	0.	4.337460E-19	4.337460E-19	0.	0.
	2	1.3346	4.787426E-02	3.060516E-16	4.337460E-19	4.337460E-19	0.	3.630918E-14
	3	2.7692	4.787426E-02	4.934659E-16	4.337460E-19	4.337460E-19	0.	6.117855E-14
	4	4.1539	4.787426E-02	2.950624E-16	4.337460E-19	4.337460E-19	0.	6.314041E-14
	5	5.5395	4.787426E-02	0.	4.337460E-19	4.337460E-19	0.	3.617867E-14
	6	6.9231	4.787426E-02	0.	4.337460E-19	4.337460E-19	0.	0.
ROW	41	X	3.0000	M	V	U	DETAX	DETAY
COL	1	0.3200	-1.000000E+00	-6.063410E+02	-6.063410E+02	0.	0.	0.
	2	1.3346	-1.000000E+00	-4.653439E+00	-4.653439E+00	-1.952351E-09	0.	2.493646E+00
	3	2.7692	-1.000000E+00	-4.653439E+00	-4.653439E+00	-2.215799E-09	0.	2.493646E+00
	4	4.1539	-1.000000E+00	-4.653439E+00	-4.653439E+00	1.322825E-10	0.	2.493646E+00
	5	5.5395	-1.000000E+00	-4.653439E+00	-4.653439E+00	6.26218E-10	0.	2.493646E+00
	6	6.9231	-1.000000E+00	-4.653439E+00	-4.653439E+00	0.	0.	2.493646E+00
ROW	14	X	1.9000	M	V	U	DETAX	DETAY
COL	1	0.3200	-1.000000E+00	-4.653439E+00	-4.653439E+00	0.	0.	0.
	2	1.3346	-1.000000E+00	-4.653439E+00	-4.653439E+00	-2.134919E-11	-7.932087E-03	-2.379626E-03
	3	2.7692	-1.000000E+00	-4.653439E+00	-4.653439E+00	-4.041339E-11	-7.932087E-03	-2.379626E-03
	4	4.1539	-1.000000E+00	-4.653439E+00	-4.653439E+00	-5.054908E-11	-7.932087E-03	-2.379626E-03
	5	5.5395	-1.000000E+00	-4.653439E+00	-4.653439E+00	-7.264472E-11	-7.932087E-03	-2.379626E-03
	6	6.9231	-1.000000E+00	-4.653439E+00	-4.653439E+00	0.	-7.932087E-03	-2.379626E-03
ROW	19	X	3.4000	M	V	U	DETAX	DETAY
COL	1	0.3200	-1.000000E+00	-9.663914E+02	-9.663914E+02	0.	0.	0.
	2	1.3346	-1.000000E+00	-9.663914E+02	-9.663914E+02	-1.182151E-11	3.800708E-03	1.140212E-03
	3	2.7692	-1.000000E+00	-9.663914E+02	-9.663914E+02	-1.026219E-11	3.800708E-03	1.140212E-03
	4	4.1539	-1.000000E+00	-9.663914E+02	-9.663914E+02	-1.161621E-11	3.800708E-03	1.140212E-03
	5	5.5395	-1.000000E+00	-9.663914E+02	-9.663914E+02	3.132555E-11	3.800708E-03	1.140212E-03
	6	6.9231	-1.000000E+00	-9.663914E+02	-9.663914E+02	0.	3.800708E-03	1.140212E-03
ROW	31	X	5.0000	M	V	U	DETAX	DETAY
COL	1	0.3200	-1.000000E+00	2.215531E+01	2.215531E+01	0.	-2.697633E-01	-6.292929E-02
	2	1.3346	-1.000000E+00	2.215531E+01	2.215531E+01	1.514613E-24	-2.697633E-01	-6.292929E-02
	3	2.7692	-1.000000E+00	2.215531E+01	2.215531E+01	0.	-2.697633E-01	-6.292929E-02
	4	4.1539	-1.000000E+00	2.215531E+01	2.215531E+01	0.	-2.697633E-01	-6.292929E-02
	5	5.5395	-1.000000E+00	2.215531E+01	2.215531E+01	0.	-2.697633E-01	-6.292929E-02
	6	6.9231	-1.000000E+00	2.215531E+01	2.215531E+01	0.	-2.697633E-01	-6.292929E-02

Fig. 7-31 (Cont.)

EIGENVALUE SWIFT= -0. NUMBER OF NEGATIVE ROOTS= 0

ITERATION	RAY(EIGEN QUOTIENT)	EIGENVALUE (ACCELERATED ESTIMATE)
1	3.6721658E+01	2.2737368E-13
2	4.3337555E+00	1.9540659E+01
3	3.3584231E+00	3.8458995E+00
4	3.3197333E+00	-3.6630331E+00
5	3.3101135E+00	3.3492956E+00
6	3.2734275E+00	3.3282121E+00
7	3.2738411E+00	3.2791476E+00
8	3.2785681E+00	3.2758752E+00
9	3.2692036E+00	3.2704639E+00
10	3.2693593E+00	3.2699786E+00
11	3.2691893E+00	3.2693511E+00
		3.2692826E+00

THE BUCKLING LOAD BASED ON LINEAR BIFURCATION THEORY IS 3.269283E+00 TIMES THE STARTING LOAD.

ROW	COL	X	Y	M	V	U	BETAX	BETAY
1	0.000	9.946693E-01	0.	-4.772973E-03	-4.923363E-01	0.	0.	0.
2	1.3346	4.060373E-01	-1.910220E-02	3.859737E-03	-5.037700E-01	-4.733751E-03	-1.109979E-03	-2.027907E+00
3	2.7692	3.103495E-01	-3.095241E-02	-1.471174E-03	-1.436000E-01	-3.833784E-03	-1.454475E-03	-4.595591E+00
4	4.1539	-3.065723E-01	-3.100735E-02	1.476610E-03	1.472341E-01	-4.251847E-05	1.484330E-03	-4.820240E+00
5	5.5385	-8.076344E-01	-1.919191E-02	3.857863E-03	4.100251E-01	-1.113058E-03	3.833650E-03	-2.867790E+00
6	6.9231	-1.000000E+00	0.	4.766254E-03	5.130735E-01	-1.375329E-04	4.733966E-03	0.

ROW	COL	X	Y	M	V	U	BETAX	BETAY
1	0.000	3.853122E-04	0.	1.375787E-04	-4.733751E-03	0.	0.	0.
2	1.3346	3.117205E-04	4.107060E-05	1.113346E-04	-3.833784E-03	-4.733751E-03	-1.109979E-03	-1.790008E-03
3	2.7692	1.190782E-04	6.845813E-05	4.251847E-05	-1.436000E-01	-3.833784E-03	-1.454475E-03	-1.796040E-03
4	4.1539	-1.147625E-04	6.845813E-05	-4.251847E-05	1.436000E-01	-4.251847E-05	1.484330E-03	-1.110030E-03
5	5.5385	-3.111744E-04	4.107060E-05	-1.113346E-04	3.833650E-03	-1.113058E-03	3.833650E-03	0.
6	6.9231	-3.353392E-04	0.	-1.375329E-04	4.733966E-03	-1.375329E-04	4.733966E-03	0.

ROW	COL	X	Y	M	V	U	BETAX	BETAY
1	0.000	-2.429373E-06	0.	-1.064808E-07	1.068629E-05	0.	0.	0.
2	1.3346	-1.965177E-06	4.458242E-09	-3.614776E-03	0.645510E-06	-3.614776E-03	0.936272E-06	1.122307E-05
3	2.7692	-7.535535E-07	7.212363E-08	-3.291111E-08	-3.328285E-06	-3.291111E-08	1.122307E-05	1.122307E-05
4	4.1539	7.535535E-07	7.212363E-08	3.291111E-08	-3.328285E-06	3.291111E-08	1.122307E-05	1.122307E-05
5	5.5385	1.965177E-06	4.458242E-09	0.645510E-06	-3.614776E-03	0.645510E-06	0.936272E-06	1.122307E-05
6	6.9231	2.429373E-06	0.	1.064808E-07	-1.068629E-05	-1.064808E-07	-1.068629E-05	0.

ROW	COL	X	Y	M	V	U	BETAX	BETAY
1	0.000	-3.259796E-11	0.	2.867952E-25	0.	0.	0.	0.
2	1.3346	-2.637269E-11	-2.341546E-10	5.169379E-25	0.	0.	0.	1.400325E-10
3	2.7692	-1.007472E-11	-3.788701E-10	0.828596E-26	0.	0.	0.	2.265768E-10
4	4.1539	1.007472E-11	-3.788701E-10	-0.828596E-26	0.	0.	0.	2.265768E-10
5	5.5385	2.637269E-11	-2.341546E-10	0.	0.	0.	0.	1.400325E-10
6	6.9231	3.259796E-11	0.	2.867952E-25	0.	0.	0.	0.

CP SECONDS= 15.432. NR OF IO REQUESTS (TAPE2)= 223. WORDS USED (TAPE2)= 124983. WORDS TRANSFERRED (TAPE2)= 1283697

Fig. 7-31 (Cont.)

7.11 SAMPLE CASE 11 - PLASTICITY

The stress distribution in the interior of a square plate subjected to concentrated shear force at one edge is to be determined using the plasticity branch of the STAGS computer program. The geometry and boundary conditions are shown in Fig. 7-32.

The stress-strain curve is described in the input data utilizing five distinct points (material components). The equivalent White-Besseling material components are shown in the output. Since the stresses are uniform across the thickness in this problem, only three points are used for the numerical integration through the thickness of the plate.

Points at which the effective stress is in the inelastic range are designated with an asterisk as shown in the output. To continue a nonlinear plasticity run, only the last record can be used for a restart (ISTART=3), because the strains for records 1 and 2 are not saved.

The input cards associated with this case are displayed in Fig. 7-33. Portions of the output are presented in Fig. 7-34.

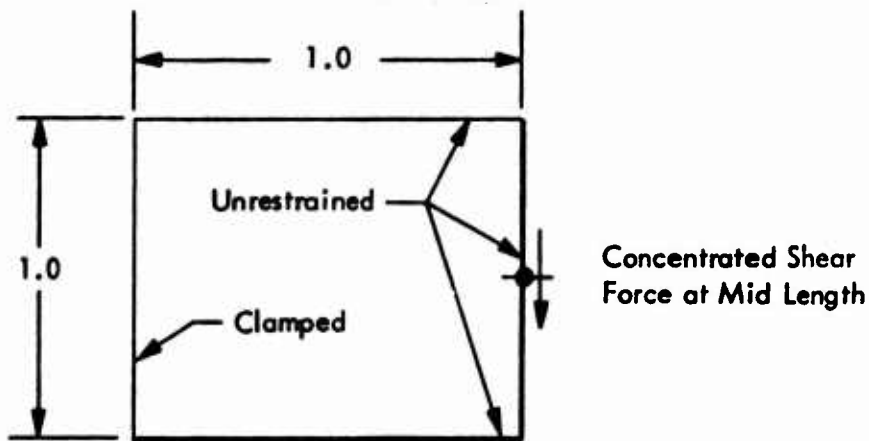


Fig. 7-32 Sample Case 11 - Plasticity (Plate)

SAMPLE CASE 11 INPUT

SAMPLE CASE 11 - PLASTICITY										
3	3	1								C-1
1.		1.								G-1
-7	-7									G-2
0.	0.05	0.25	0.5	0.75	0.95	1.0				D-1
0.	0.05	0.25	0.5	0.75	0.95	1.				D-8
10000000.	0.3	0.05	3.							D-9
3	5									I-1
25000.	37500.	45000.	49000.	50000.						I-2
0.0025	0.0044	0.0078	0.0113	0.0140						I-3
2	3	3	3							I-4
1	0 1.	.5	3.							B-1
0.	100.	0.	0	1	0	7	4			L-1
		0	60	4	2	1				L-2
1	1	1								P-1B
										O-1

Fig. 7-33 Display of Input Card for Sample Case 11

7-77

Fig. 7-34 Excerpt of Output for . p e 11

CALCULATION OF STATE DIFFERENCE FORMULAS AND GEOMETRIC CONSTANTS COMPLETED.
 CP SECTIONS= .776. NR OF IO REQUESTS (TAPE2)= 9. WORDS USED (TAPE2)= 14894. WORDS TRANSFERRED (TAPE2)= 16942

FORMATION OF STIFFNESS MATRICES FOR ALL SUBREGIONS COMPLETED.
 CP SECTIONS= 1.544. NR OF IO REQUESTS (TAPE2)= 19. WORDS USED (TAPE2)= 28764. WORDS TRANSFERRED (TAPE2)= 46738

ASSEMBLY OF TOTAL STIFFNESS MATRIX COMPLETED.
 CP SECTIONS= 1.773. NR OF IO REQUESTS (TAPE2)= 23. WORDS USED (TAPE2)= 35699. WORDS TRANSFERRED (TAPE2)= 67535

DISPLACEMENT COMPONENT V X= 1.0250E+00 Y= 1.0250E+00. HAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 4.6359898E+04. THE FINAL VALUE = 3.7020072E-07
 DISPLACEMENT COMPONENT U X= 1.0250E+00 Y= 1.0250E+00. HAS BEEN ELIMINATED
 THE INITIAL MAIN DIAGONAL VALUE = 4.6359898E+04. THE FINAL VALUE = 6.9104135E-07

DETERMINANT OF STIFFNESS MATRIX= 1.170462E+06*10.00 448. NUMBER OF NEGATIVE ROOTS = 0
 34 NOTES. 243 EQUATIONS. MAXIMUM BAND WIDTH = 60
 MATRIX RECOMPOSITION COMPLETED.
 CP SECTIONS= 2.507. NR OF IO REQUESTS (TAPE2)= 27. WORDS USED (TAPE2)= 35699. WORDS TRANSFERRED (TAPE2)= 82429

LINEAR SOLUTION. FA= 1.000000E+00. PB= 0.

COL	TWE TA	M	ROM 1, V	X= 0.0000 U
1	0.0000	0.	0.	0.
2	0.0000	0.	0.	0.
3	0.0000	0.	0.	0.
4	0.0000	0.	0.	0.
5	0.0000	0.	0.	0.
6	0.0000	0.	0.	0.
7	0.0000	0.	0.	0.

COL	TWE TA	M	ROM 7, V	X= 1.0000 U
1	0.0000	0.	1.31216E-03	5.99940E-04
2	0.0000	0.	1.30666E-03	4.92953E-04
3	0.0000	0.	1.37427E-03	2.98990E-04
4	0.0000	0.	1.44758E-03	6.59195E-17
5	0.0000	0.	1.37427E-03	-2.98990E-04
6	0.0000	0.	1.30666E-03	4.92953E-04
7	0.0000	0.	1.31216E-03	-5.99940E-04

CP SECTIONS= 2.904. NR OF IO REQUESTS (TAPE2)= 38. WORDS USED (TAPE2)= 42957. WORDS TRANSFERRED (TAPE2)= 113052

STRESS AND MOMENT RESULTANTS COMPUTED ASSUMING TOTAL STRAINS ARE ELASTIC

ROW	1, E	0.0000	MX	MY	MX	MY	MX
1	0.0000	4.68375E+02	2.605127E+02	1.549034E+02	0.	0.	0.
2	0.0000	4.71119E+02	1.494505E+02	1.210192E+02	0.	0.	0.
3	0.0000	2.244633E+02	6.453898E+01	8.690503E+01	0.	0.	0.
4	0.0000	9.74374E+01	3.004312E+01	9.075507E+01	0.	0.	0.
5	0.0000	-2.244633E+02	-6.453898E+01	8.690503E+01	0.	0.	0.
6	0.0000	-4.71119E+02	-1.494505E+02	1.210192E+02	0.	0.	0.
7	0.0000	-4.68375E+02	-2.605127E+02	1.549034E+02	0.	0.	0.

Fig. 7-34 (Cont.)

LOAD STEP 1. 041.000E+00. P05C. 2 ITERATIONS. RELATIVE ERROR= 3.062427E-11 18988L
 CP SECTIONS= 4.350. NR OF 10 REQUESTS (TAPE2)= 56. WORDS USED (TAPE2)= 42957. WORDS TRANSFERRED (TAPE2)=

COL	TIME	W	ROW 1. X=	ROW 1. Y=	ROW 1. Z=
1	0.0000	0.	0.	0.	0.
2	0.0000	0.	0.	0.	0.
3	0.0000	0.	0.	0.	0.
4	0.0000	0.	0.	0.	0.
5	0.0000	0.	0.	0.	0.
6	0.0000	0.	0.	0.	0.
7	0.0000	0.	0.	0.	0.

COL	TIME	W	ROW 7. X=	ROW 7. Y=	ROW 7. Z=
1	0.0000	1.13007E-30	1.31216E-03	5.99999E-04	0.
2	0.0000	1.04303E-30	1.30666E-03	6.92953E-04	0.
3	0.0000	6.22300E-31	1.37427E-03	2.98999E-04	0.
4	0.0000	-1.76051E-32	1.64758E-03	1.38136E-10	0.
5	0.0000	-6.70954E-31	1.37427E-03	-2.98999E-04	0.
6	0.0000	-1.07377E-30	1.30666E-03	-6.92953E-04	0.
7	0.0000	-1.16589E-30	1.31216E-03	-5.99999E-04	0.

STRESS AND MOMENT RESULTANTS COMPUTED ASSUMING TOTAL STRAINS ARE ELASTIC

ROW 1. X=	ROW 1. Y=	ROW 1. Z=	ROW 7. X=	ROW 7. Y=	ROW 7. Z=
1	0.0000	0.0000	1.50934E+02	1.50934E+02	1.50934E+02
2	0.0000	0.0000	1.21819E+02	1.21819E+02	1.21819E+02
3	0.0000	0.0000	0.69058E+01	0.69058E+01	0.69058E+01
4	0.0000	0.0000	9.07558E+01	9.07558E+01	9.07558E+01
5	0.0000	0.0000	0.69058E+01	0.69058E+01	0.69058E+01
6	0.0000	0.0000	1.21819E+02	1.21819E+02	1.21819E+02
7	0.0000	0.0000	1.50934E+02	1.50934E+02	1.50934E+02

ROW 7. X=	ROW 7. Y=	ROW 7. Z=	ROW 1. X=	ROW 1. Y=	ROW 1. Z=
1	0.0000	0.0000	1.50934E+02	1.50934E+02	1.50934E+02
2	0.0000	0.0000	1.21819E+02	1.21819E+02	1.21819E+02
3	0.0000	0.0000	0.69058E+01	0.69058E+01	0.69058E+01
4	0.0000	0.0000	9.07558E+01	9.07558E+01	9.07558E+01
5	0.0000	0.0000	0.69058E+01	0.69058E+01	0.69058E+01
6	0.0000	0.0000	1.21819E+02	1.21819E+02	1.21819E+02
7	0.0000	0.0000	1.50934E+02	1.50934E+02	1.50934E+02

Fig. 7-34 (Cont.)

LOAD STEP 6. PA=3.000E+08. PB=0. 6 ITERATIONS. RELATIVE ERROR= 6.692723E-05 1034002
 C0 SEC=0.75= 26.011. NR OF IO REQUESTS (TAPE2)= 484. WORDS USED (TAPE2)= 44493. WORDS TRANSFERRED (TAPE2)= 1034002

MAXIMUM LOAD VALUE ATTAINED

NONLINEAR COLLAPSE ANALYSIS DISCONTINUED

COL	ITERA	M	ROW	1. X=	Y	0.0000	U
1	J.0000	0.	0.	0.	0.	0.	0.
2	.0000	0.	0.	0.	0.	0.	0.
3	.0000	0.	0.	0.	0.	0.	0.
4	.0000	0.	0.	0.	0.	0.	0.
5	.0000	0.	0.	0.	0.	0.	0.
6	.0000	0.	0.	0.	0.	0.	0.
7	.0000	0.	0.	0.	0.	0.	0.

COL	ITERA	M	ROW	7. X=	Y	1.0000	U
1	J.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
2	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
3	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
4	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
5	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
6	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03
7	.0000	-2.35018E-17	4.03971E-03	1.016961E+03	1.84853E-03	1.84853E-03	1.84853E-03

STRESS AND MOMENT RESULTS COMPUTED ASSUMING TOTAL STRAINS ARE ELASTIC

PA	1. X=	Y	NY	MX	MY	MX	MY	MX	MY
COL	1. X=	Y	NY	MX	MY	MX	MY	MX	MY
1	J.0000	3.39955E+03	1.016961E+03	6.746613E+02	1.203559E-13	1.203559E-13	3.610677E-14	0.	0.
2	.0000	1.67948E+03	5.33683E+02	3.794439E+02	5.857351E-14	5.857351E-14	1.697209E-14	0.	0.
3	.0000	7.26052E+02	2.184157E+02	2.794102E+02	-6.844991E-15	-6.844991E-15	-1.993497E-15	1.148151E-29	1.148151E-29
4	.0000	-2.34654E+02	-4.270009E+11	-2.779602E+02	5.505999E-15	5.505999E-15	1.651708E-15	1.481495E-30	1.481495E-30
5	.0000	-7.24172E+02	-2.184157E+02	2.794102E+02	-1.704403E-14	-1.704403E-14	-5.114550E-15	1.233951E-29	1.233951E-29
6	.0000	-1.67948E+03	-5.33683E+02	3.794439E+02	-3.022704E-14	-3.022704E-14	-9.068112E-15	3.160500E-29	3.160500E-29
7	.0000	-3.39955E+03	-1.016961E+03	6.746613E+02	-1.869723E-13	-1.869723E-13	-5.609160E-14	6.321001E-29	6.321001E-29

ROW	7. X=	Y	NY	MX	MY	MX	MY	MX	MY
COL	7. X=	Y	NY	MX	MY	MX	MY	MX	MY
1	J.0000	1.036766E+01	1.036766E+01	1.036766E+01	2.265654E-15	2.265654E-15	-9.149860E-16	1.911254E-16	1.911254E-16
2	.0000	-3.044033E+01	-3.044033E+01	-3.044033E+01	1.33197E-15	1.33197E-15	-1.911763E-15	1.886016E-15	1.886016E-15
3	.0000	4.71511E+01	4.71511E+01	4.71511E+01	-1.72302E-14	-1.72302E-14	-4.85939E-15	-4.89069E-15	-4.89069E-15
4	.0000	6.10027E+11	6.10027E+11	6.10027E+11	1.18852E-17	1.18852E-17	4.49753E-15	-1.331700E-15	-1.331700E-15
5	.0000	-9.71231E+01	-9.71231E+01	-9.71231E+01	-1.185188E-14	-1.185188E-14	-2.302120E-14	-7.877809E-15	-7.877809E-15
6	.0000	3.044033E+01	3.044033E+01	3.044033E+01	1.717251E-15	1.717251E-15	3.789920E-14	9.657352E-16	9.657352E-16
7	.0000	-1.036766E+01	-1.036766E+01	-1.036766E+01	5.856938E-15	5.856938E-15	-5.911476E-15	1.911048E-16	1.911048E-16

DISPLACEMENT SOLUTION FOR PA=2.62500E+08. PB=0.
 DISPLACEMENT SOLUTION FOR PA=2.62500E+08. PB=0.
 DISPLACEMENT SOLUTION FOR PA=3.00000E+08. PB=0.
 CP 10000000 26.017. NR OF IO REQUESTS (TAPE2)= 412. WORDS USED (TAPE2)= 44493. WORDS TRANSFERRED (TAPE2)= 1034002

Fig. 7-34 (Cont.)

Section 8

STAGS POST PROCESSOR

8.1 INTRODUCTION

The STAGS Post Processor (STAGPP) is designed to be used with the STAGS program. The function of the STAGS Post Processor is to present the calculated and stored data of STAGS in a two dimensional or contour plot output. The STAGS Post Processor takes the data stored on tape 19 by the STAGS program and creates a printer plot, a CAL-COMP pen plot, or both depending on the requirements of the user. The STAGS Post Processor is designed to plot selected output and/or contour plots of displacements (w , v , u , β_x , β_y), and stress resultants (N_x , N_y , N_{xy} , M_x , M_y , M_{xy}). Also, the load displacement history and collapse mode plots are included in the post processor's capabilities.

This version of the STAGS Post Processor was written for the CDC 6600 computer utilizing a model 763, zip mode 10" drum CAL-COMP pen plotter. The user must supply the appropriate computer system controls when a CAL-COMP plot is requested.

There are two main branches of the STAGS Post Processor. The first branch allows for two dimensional plots of displacements, stress resultants and load displacement history and the second branch does only the contour plots of displacements, stress resultants, and the collapse mode. Figure 8-1 shows a typical data deck format. Table 8-1 is a summary of the input cards.

Fig. 8-1 STAGS Post Processor Sample Data Input (Sample Case 3, Page 7-22)

Table 8-1
STAGS POST PROCESSOR

SUMMARY OF INPUT CARDS

<u>Card</u>	<u>Symbol</u>	<u>Format</u>
P1	IPLT, IPLTSW	16I5
Include Card P2 only if $0 \leq \text{IPLT} \leq 3$ or $\text{IPLT} = 7$ or 8 . If $4 \leq \text{IPLT} \leq 6$ go to the P7 card.		
P2	IAXIAL, IOUT, IEDIT, IHST	16I5
Include cards P3 through P6 only if $\text{IEDIT} = 1$ on the P2 card.		
P3	NSTEP, NXYEDT	16I5
P4	JSTEP(I), I=1, NSTEP	16I5
P5	XYEDIT(I), I=1, NXYEDT	8F10.5
P6	IVAR(I), I=1, NXYEDT	8F10.5
P6	IVAR(I), I=1,6	16I5
Include cards P7 through P10 only if $4 \leq \text{IPLT} \leq 6$ on the P1 card.		
P7	NROW, NCOL, NPB, NCTOUT, NRW1, NRW2, NCL1	16I5
P8	NB(I), I=1, NPB	16I5
P9	IVAR(I), I=1,6	16I5
P10	HEAD(I), I=1,3	3A10
Include as many P10 cards as there are $\text{IVAR(I)} = 1$ on the P9 card.		

8.2 INPUT DESCRIPTION

P1 Plot Data Card

This card is used to select how and which stored data is to be plotted.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IPLT	I5	1-5	IPLT selects from a file created by STAGS the data which is to be plotted. IPLT=0 Plot linear solution. IPLT=1 Plot selected displacements. IPLT=2 Plot selected stress resultants. IPLT=3 Plot load displacement history (nonlinear analysis only) IPLT=4 Plot collapse mode (nonlinear only) IPLT=5 Displacements contour plot (special output see Page 6-33) IPLT=6 Stress resultants contour plot (special output). IPLT=7 Displacements plot (special output). IPLT=8 Stress resultants plot (special output). IPLT=999 Normal terminator for STAGS Post Processor.
IPLTSW	I5	6-10	IPLTSW=1 Do both printer and CAL-COMP pen plots. IPLTSW=2 Do only printer plots. IPLTSW=3 Do only CAL-COMP pen plots. IPLTSW=999 Normal terminator for STAGS Post Processor.

NOTE: If $4 \leq \text{IPLT} \leq 6$ go to the P7 card.

P2 Select Data Card

The select data card allows the user to exercise certain options concerning which load to select, print output, editing capability and load displacement history.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>	
IAXIAL	I5	1-5 0	IAXIAL=0	Plot load factor, PA.
			IAXIAL=1	Plot load factor, PB.
IOUT	I5	6-10	IOUT=0	Do not print plotted data.
			IOUT=1	Print plotted data.
IEDIT	I5	11-15	IEDIT=0	Plot everything requested on the P1 card. No more cards are needed.
			IEDIT=1	Plot only selected or special output requested on the P3 to P6 cards.
IHST	I5	16-20	IHST=0	Do not plot a load displacement history.
			IHST=1	If IPLT=3 do a CAL-COMP load displacement history pen plot.

P3 Edit Control Card

Used only if IEDIT=1 on the P2 card. The edit control card states how many load steps and/or rows or columns to select for plotting.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NSTEP	I5	1-5	NSTEP is the number of load steps requested. If no load steps are requested set NSTEP=1 and see card P4.
NXYEDT	I5	6-10	NXYEDT is the number of rows or columns requested. If no rows or columns are requested set NXYEDT=1 and see card P5.

P4 Select Individual Step Card

Used only if IEDIT=1 on the P2 card. This card specifies the individual load step requested for plotting.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
JSTEP(I) I=1, NSTEP	16I5	1-80	Actual load step.
		JSTEP(I)=777	No editing by load step performed (use for linear and bifurcation analysis).
		JSTEP(I)=	Actual load step requested (use for nonlinear analysis only).

P5 Select Row or Column Card

Used only if IEDIT=1 on the P2 card. This card specifies the individual rows and columns requested for plotting.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
XYEDIT(I) I=1, NXYEDT	8F10.5	1-80	Actual rows or columns.
		XYEDIT(1)=777.0	No editing by rows or columns performed.
		XYEDIT(I)=	Actual coordinate of rows or columns requested.

P6 Select Displacement or Stress Resultant Card

Used only if IEDIT=1 on the P2 card. This card reads data into an array which indicates which displacements or stress resultants are required. Displacements are requested if IPLT=1 or 7 on the P1 card. Stress resultants are requested if IPLT=2 or 8 on the P1 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IVAR(I) I=1,6	6I5	1-30	IVAR(I)=0 Do not plot IVAR(I)=1 Plot
		I=1	W displacement or NX stress resultant
		I=2	V displacement or NY stress resultant
		I=3	U displacement or NXY stress resultant
		I=4	BX displacement or MX stress resultant
		I=5	BY displacement or MY stress resultant
		I=6	MTY stress resultant

NOTE: Include cards P7 through P10 only if $4 \leq \text{IPLT} \leq 6$ on the P1 card.

P7 Contour Control Card

The contour control card allows the user to define the grid for contour plots. NROW and NCOLS (NR and NC in STAGS) define the grid and NPB is the number of points defining the plot boundaries stored in the array NB. The NROW and NCOL define the NB grid points where $1 \leq I \leq \text{NROW}$ and $1 \leq J \leq \text{NCOL}$. Then $\text{NB} = (\text{I}-1)*\text{NCOL} + \text{J}$ (see Fig. 8-2). If a cutout is present NB will not include the grid points of the cutout (see Fig. 8-3). Once the NB array has been established the user can select a section of the total shell by choosing the proper NB values. Fig. 8-2 where $(\text{NB}(\text{I}), \text{I}=1, \text{NPB}) = 7, 9, 14, 12, 7$ will create a contour plot of the center portion of the flat plate only.

If $\text{IPLT}=6$ on the P1 card and $\text{NCOL} > \text{NROW}$ on the P7 card, refer to Figs. 8-4 and 8-5 as examples of NCTOUT, NRW1, NRW2, and NCL1.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
NROW	I5	1-5	Number of rows (stations along the X coordinate).
NCOL	I5	6-10	Number of columns (stations along the Y coordinate).
NPB	I5	11-15	Number of points stored in array NB which define the plot boundary.
NCTOUT	I5	16-20	Number of grid points of the cutout to be excluded (see Fig. 8-3).
NRW1	I5	21-25	Row number of one edge of cutout (same as in the STAGS program).
NRW2	I5	26-30	Row number of other edge of cutout (same as in the STAGS program).
NCL1	I5	31-35	Column number of edge of cutout (same as in the STAGS program)

P8 Plot Grid Card

This card reads the NB numbers which specify the contour plot boundary. Successive pairs of points listed in NB will be joined by a straight line. Note the first point in NB should be repeated as the last point in NB in order to close the contour plot.

<u>Variable</u>	<u>Format</u>	<u>Column</u>	<u>Description</u>
NB(I) I=1, NPB	10I5	1-10	The actual NB points which define the plot boundary (see Figs. 8-2 through 8-5).

P9 Select Displacement or Stress Resultant Card


This card reads data into an array which indicates which displacements or stress resultants are required. If IPLT=5 on the P1 card, we have a contour plot of displacement. If IPLT=6 on the P1 card, we have a contour plot of stress resultant.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
IVAR(I) I=1,6	6I5	1-30	IVAR(I)=0 Do not plot IVAR(I)=1 Plot
			I=1 W displacement or NX stress resultant.
			I=2 V displacement or NY stress resultant.
			I=3 U displacement or NXY stress resultant.
			I=4 MX stress resultant.
			I=5 MY stress resultant.
			I=6 MXY stress resultant.

P10 Plot Heading Card


The user must read individual titles for each contour plot. There are as many P10 cards as there are IVAR(I) requested on the P9 card.

<u>Variable</u>	<u>Format</u>	<u>Columns</u>	<u>Description</u>
HEAD(I) I=1,3	3A10	1-50	User supplied heading for contour plot.

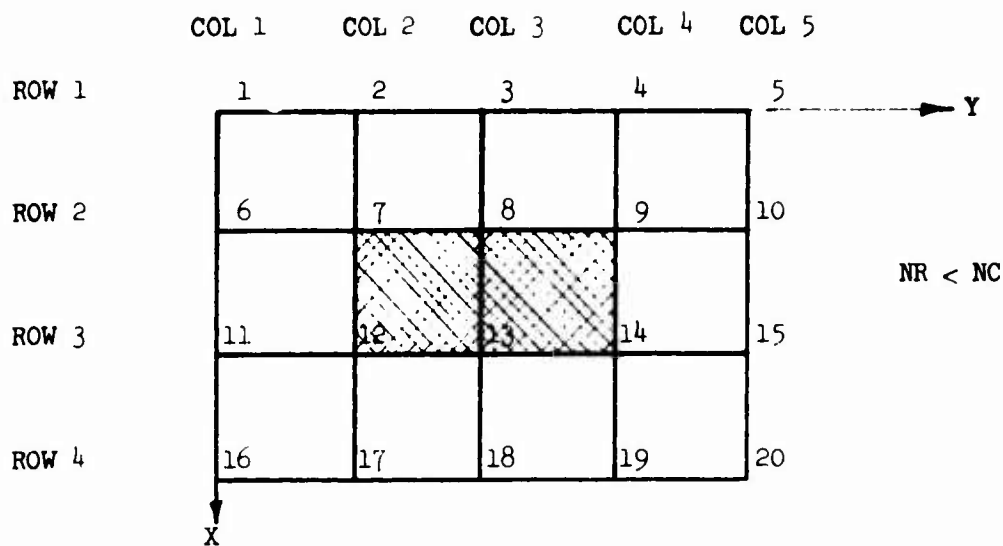


NROW=4, NCOL=5, NPB=5, NCTOUT=0, NRW1=0, NRW2=0, NCL1=0, (NB(I),I=1,NPB) = {NB:1,5,20,16,1}

Fig. 8-2 Flat Plate Contour Control Card Setup

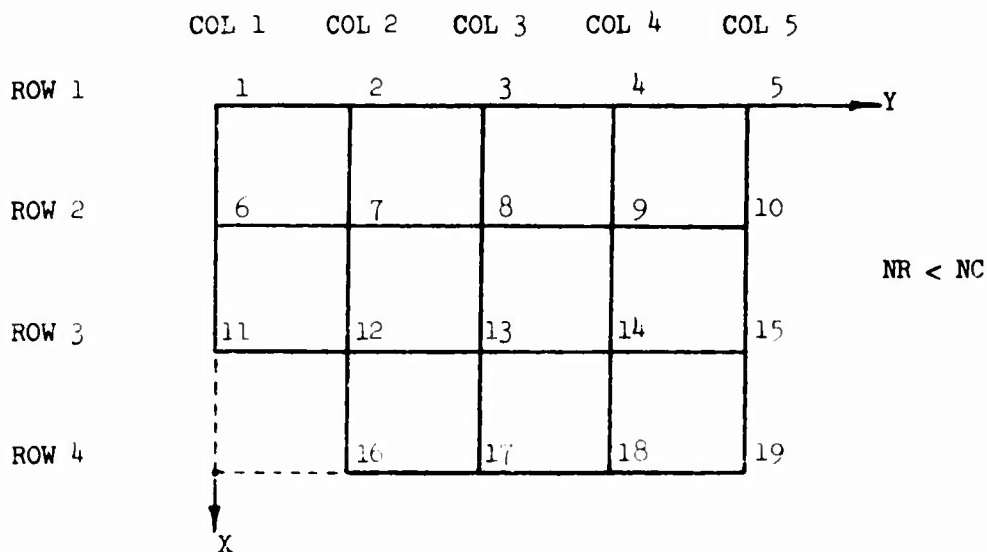


NROW=4, NCOL=5, NPB=7, NCTOUT=1, NRW1=3, NRW2=4, NCL1=2, (NB(I),I=1,NPB) = {NB:1,5,19,16,12,11,1}

Fig. 8-3 Flat Plate with Cutout Contour Control Card Setup

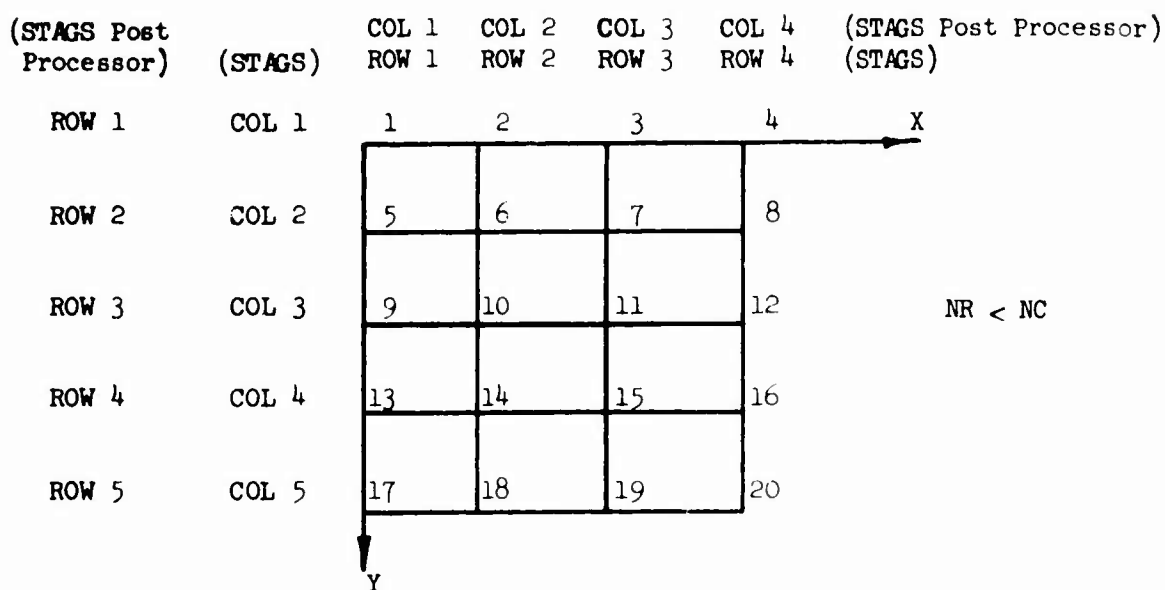

NROW=4, NCOL=5, NPB=5, NCTOUT=0, NRW1=0, NRW2=0, NCL1=0, (NB(I),I=1,NPB)
{NB:1,4,20,17,1}

Fig. 8-4 Flat Plate Contour Control Card Setup When NCOL Greater Than NROW (Stress Resultants Only)

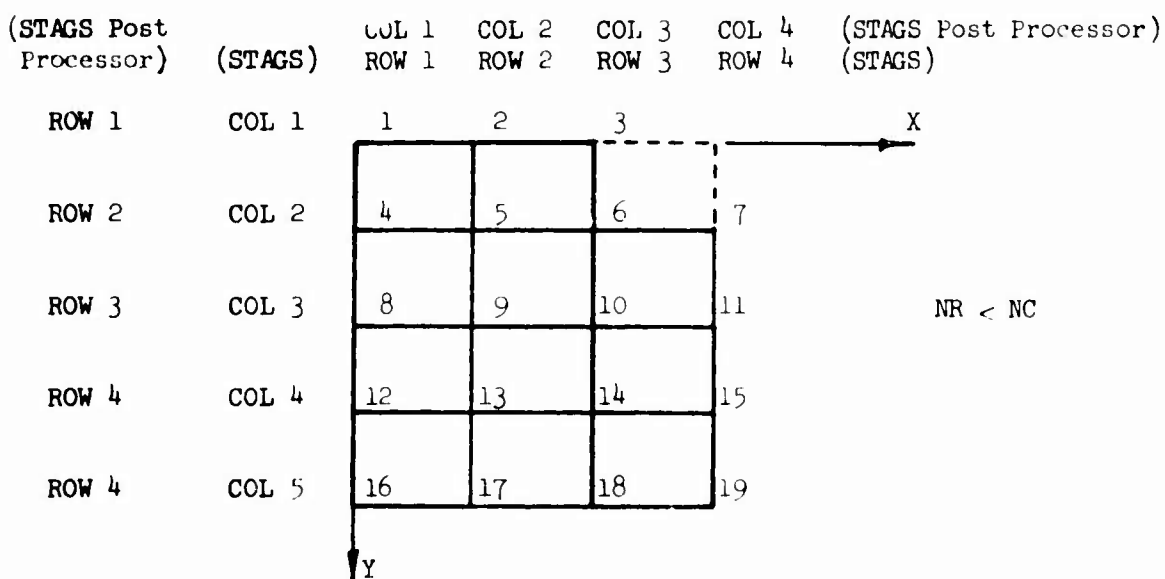

NOTE: NRW1, NRW2, NCL1 are in the STAGS Post Processor Notation
NROW=4, NCOL=5, NPB=7, NCTOUT=1, NRW1=1, NRW2=2, NCL1=3, (NB(I),I=1,(NPB)) =
{MB:1,3,6,7,19,16,1}

Fig. 8-5 Flat Plate with Cutout Contour Control Card Setup When NCOL Greater Than NROW (Stress Resultants Only)

Section 9

REFERENCES

1. Lockheed Missiles & Space Company, Buckling Analysis of Segmental Orthotropic Cylinders Under Nonuniform Stress Distribution, by B. O. Almroth, F. A. Brogan, and E. V. Pittner, Sunnyvale, Calif., Report M-77-65-4, Vol. VIII, Jul 1965
2. F. A. Brogan and B. O. Almroth, "Buckling of Cylinders with Cutouts," AIAA J., Vol. 8, No. 2, Feb 1970, pp. 236-241
3. F. A. Brogan, K. Forsberg, and S. Smith, "Experimental and Analytical Investigation of the Dynamic Behavior of a Cylinder with a Cutout," AIAA Paper No. 68-318, AIAA/ASME 9th Structures, Structural Dynamics, and Materials Conference, April 1968
4. Lockheed Missiles & Space Company, Analysis of Stiffened Shells with Cutouts, by F. A. Brogan and P. Stern, Report N-3M-69-1, Sunnyvale, Calif., 1969
5. B. O. Almroth, F. A. Brogan, and M. B. Marlowe, "Collapse Analysis for Elliptic Cones," AIAA J., Vol. 9, No. 1, Jan 1971, pp. 32-37
6. Air Force Flight Dynamics Laboratory, Collapse Analysis for Shells of General Shape, Vol. 1, "Analysis," by B. O. Almroth, F. A. Brogan, and M. B. Marlowe, Technical Report AFFDL TR-71-8
7. Space and Missile System Organization, Buckling Analysis of General Shells, by B. O. Almroth and F. A. Brogan, SAMSO TR-71-165.
8. J. L. Sanders, Jr., "Nonlinear Theories for Thin Shells," Quarterly of Applied Mathematics, Vol. 21, No. 1, 1963
9. Lockheed Missiles & Space Company, Some New Developments in the Foundations of Shell Theory, by M. B. Marlowe and W. Flugge, LMSC 6-78-68-13, May 1968, Sunnyvale, Calif.
10. L. Collatz, Functional Analysis and Numerical Mathematics, Academic Press, New York, 1966

11. D. Bushnell, "Analysis of Buckling and Vibration of Ring-Stiffened Segmented Shells of Revolution," Int. J. of Solids and Structures, Vol. 6, 1970, pp 157-181
12. F. B. Hildebrand, Introduction to Numerical Analysis, McGraw Hill Book Company, Inc., New York 1956
13. J. F. Besseling, A Theory of Elastic, Plastic, and Creep Deformation of an Initially Isotropic Material, SUDAER Report No. 78, Dept. of Aero Engineering, Stanford University, 1958
14. NASA, Buckling of Shells of Revolution With Various Wall Constructions, Vol. 2, "Basic Equations and Method of Solution," by D. Bushnell, B. O. Almroth, and L. H. Sobel, NASA CR-1050, May 1968
15. Lockheed Missiles & Space Company, Stress, Stability, and Vibration of Complex Branched Shells of Revolution: Analysis and User's Manual for BOSOR4, by D. Bushnell, LMSC-D243605, March 1972, Sunnyvale, Calif.