


UNCLASSIFIED

AD NUMBER
AD878569
NEW LIMITATION CHANGE
TO Approved for public release, distribution unlimited
FROM Distribution: Further dissemination only as directed by U.S. Aviation Systems Test Activity, Edwards AFB, CA 93523, Oct 1970, or higher DoD authority.
AUTHORITY
USAAVSCOM ltr, 12 Nov 1973

THIS PAGE IS UNCLASSIFIED

AD-878569

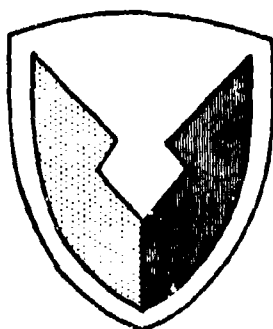

AD
RDTE PROJECT NO.
USAAVSOM PROJECT NO. 68-30
USAASTA PROJECT NO. 68-30

AIRWORTHINESS AND FLIGHT CHARACTERISTICS TEST

PRODUCTION OH-58A HELICOPTER UNARMED AND ARMED WITH XM27E1 ARMAMENT SUBSYSTEM

STABILITY AND CONTROL

FINAL REPORT

WILLIAM A. GRAHAM, JR.
LTC, TC
US ARMY
PROJECT OFFICER/PILOT

EMMETT J. LAING
PROJECT ENGINEER

PAUL G. STRINGER
MAJ, CE
US ARMY
PROJECT PILOT

OCTOBER 1970

~~This document may be further distributed by any holder only with specific prior approval of the SC, USAAVSOM, ATTN: AMSAV-R-F PO Box 289, St. Louis, Missouri 63166.~~

US ARMY AVIATION SYSTEMS TEST ACTIVITY
EDWARDS AIR FORCE BASE, CALIFORNIA 93523

This document has been approved
for public release and sale; its
distribution is unlimited.

DISCLAIMER NOTICE

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

DDC AVAILABILITY NOTICE

US military agencies may obtain copies of this report directly from DDC. Other qualified users shall request through the Commanding General, US Army Aviation Systems Command (USAAVSCOM), ATTN: AMSAV-R-F, PO Box 209, St. Louis, Missouri 63166.

REPRODUCTION LIMITATIONS

Reproduction of this document in whole or in part is prohibited except with permission obtained through the Commanding General, USAAVSCOM, ATTN: AMSAV-R-F, PO Box 209, St. Louis, Missouri 63166. DDC is authorized to reproduce the document for United States Government purposes.

DISPOSITION INSTRUCTIONS

Destroy this report when it is no longer needed. Do not return it to the originator.

TRADE NAMES

The use of trade names in this report does not constitute an official endorsement or approval of the use of the commercial hardware and software.

RDTE PROJECT NO.
USAAVSCOM PROJECT NO. 68-30
USAASTA PROJECT NO. 68-30

AIRWORTHINESS AND FLIGHT CHARACTERISTICS TEST

PRODUCTION OH-58A HELICOPTER
UNARMED AND ARMED WITH XM27E1 ARMAMENT SUBSYSTEM

STABILITY AND CONTROL

FINAL REPORT

WILLIAM A. GRAHAM, JR.
LTC, TC
US ARMY
PROJECT OFFICER/PILOT

EMMETT J. LAING
PROJECT ENGINEER

PAUL G. STRINGER
MAJ, CE
US ARMY
PROJECT PILOT

OCTOBER 1970

~~This document may be further distributed by any holder only with
specific prior approval of the CG, USAAVSCOM, ATTN: AMSAV-R-P,
PO Box 209, St. Louis, Missouri 63168.~~

US ARMY AVIATION SYSTEMS TEST ACTIVITY
EDWARDS AIR FORCE BASE, CALIFORNIA 93523



ABSTRACT

Stability and control tests were conducted on a production model OH-58A helicopter to evaluate its flying qualities in the unarmed configuration and in an armed configuration with the XM27E1 weapon system. Limited testing was also performed to evaluate the helicopter slope landing capabilities and flying qualities with skis installed. Human factors and maintainability characteristics were noted throughout the evaluation. Testing was performed by the US Army Aviation Systems Test Activity, Edwards Air Force Base, California, between 6 October 1969 and 16 February 1970. The testing consisted of 89 flights which totaled 85.3 hours of productive flight testing. There were no deficiencies recorded. Eighteen shortcomings are reported. Difficulty in maintaining precise directional control during hovering flight is a shortcoming which warrants improvement on a priority basis. This shortcoming requires excessive pilot effort and degrades the accuracy in firing of the XM27E1 armament subsystem. It is recommended that a caution note be placed in the operator's manual warning against hovering in a tail wind in excess of 30 knots. The capability of landing on a 10-degree slope was marginal but is not considered to be a shortcoming. Flying qualities of the aircraft with skis installed were satisfactory. Maintainability of the helicopter was excellent throughout the test program.

FOREWORD

Throughout the OH-58A stability and control testing, technical support was provided under contract by the airframe manufacturer, Bell Helicopter Company, Fort Worth, Texas, and the engine manufacturer, Allison Division of General Motors Corporation, Indianapolis, Indiana. Instrument calibration, emergency fire fighting, scientific photography and medical support were provided by the US Air Force Flight Test Center, Edwards Air Force Base, California.

TABLE OF CONTENTS

	<u>Page</u>
INTRODUCTION	
Background	1
Test Objectives	1
Description	2
Scope of Test	2
Method of Test	3
Chronology	3
RESULTS AND DISCUSSION	
Static Longitudinal Stability	4
Collective-Fixed Characteristics	5
Static Longitudinal Trim Characteristics	6
Static Lateral-Directional Stability	8
Dynamic Stability	13
Control Response and Sensitivity	14
General	14
Longitudinal	15
Lateral	16
Directional	17
Maneuvering Stability	18
Sideward and Rearward Flight	21
Autorotational Entry	25
Hovering Stability	27
Armament Firing	27
Flight Control System	31
Vibration	34
Slope Landing	36
Ski Installation	36
Human Factors	38
Maintenance Characteristics	39
Favorable	39
Unfavorable	40
CONCLUSIONS	
General	41
Deficiencies and Shortcomings Affecting Mission Accomplishment	41
RECOMMENDATIONS	43

APPENDIXES

I.	References.	44
II.	Test Instrumentation.	45
III.	Handling Qualities Rating Scale	50
IV.	Test Data	53
V.	Specification Noncompliance Table	147
VI.	Distribution.	148

This page left blank intentionally.

INTRODUCTION

BACKGROUND

1. A limited engineering flight test of the Bell Model 206A helicopter (JetRanger) was conducted during the US Army Light Observation Helicopter (LOH) procurement competition from September through December 1967. The Bell Helicopter Company (BHC) of Fort Worth, Texas, was subsequently awarded a production contract to build a modified version of the Model 206A with the military designation OH-58A.
2. During the period from 26 June 1969 through 9 July 1969, the Army Preliminary Evaluation (APE) of the OH-58A was conducted at the BHC facility. This APE consisted of limited quantitative and qualitative stability and control testing with the OH-58A in the armed scout configuration, as defined in the detail specification (ref 1, app I). Thirteen test flights were performed, totaling 9.1 productive hours.
3. On 7 August 1968, the US Army Aviation Test Activity (USAAVNTA), now the US Army Aviation Systems Test Activity (USAASTA), was directed (ref 2, app I) by the US Army Aviation Systems Command (USAAVSCOM) to conduct Airworthiness and Flight Characteristics (A&FC) testing on the OH-58A helicopter. The testing was divided into two phases: Performance, and Stability and Control, with separate reports required for each phase. Performance testing was completed in January 1970, and the final report was published in 1970 (ref 3). This report contains the final results of the stability and control testing.

TEST OBJECTIVES

4. The objectives of the OH-58A stability and control tests were to determine the capability of the helicopter to perform its intended mission and to verify compliance with the requirements of the military specification (mil spec) MIL-H-8501A as amended by deviation 19 of the detail specification (ref 4, app I). Special tests were conducted to evaluate the aircraft's handling qualities during firing of the XM27E1 armament subsystem and under various conditions with skis fastened to the skid landing gear. A qualitative analysis was performed to determine the slope-landing capability of the OH-58A, maintenance characteristics and human factors relating to the helicopter. Specification compliance was determined both with the XM27E1 armament subsystem installed and removed.

DESCRIPTION

5. The OH-58A light observation helicopter has a single main rotor, and an antitorque tail rotor which are two-bladed, semirigid and teetering. The tail rotor also has a delta three hinge. The cockpit provides side-by-side seating for a crew of two (pilot and copilot/observer), and the cargo compartment has seats for two passengers. Dual flight controls are provided. The cyclic and collective controls are hydraulically boosted and irreversible, while the antitorque tailrotor control is unboosted. The main landing gear consists of fixed, energy-absorbing skids. The helicopter is powered by an Allison T63-A-700 free gas turbine engine with a takeoff power rating of 317 shaft horsepower (shp) under sea-level (SL), standard-day uninstalled conditions. The main transmission has a rating of 270 shp for continuous operation with a takeoff power limit of 317 shp (5-minute rating). More detailed aircraft information may be found in reference 5, appendix I.

6. The XM27E1 armament subsystem consists of one XM134 high rate 7.62 millimeter (mm) (GAU-2B/A) with mount, feed system and ammunition boxes, and one XM70E1 weapon sight. The armament subsystem is mounted on the left side of the helicopter near the longitudinal center of gravity (cg). The XM134 gun is adjustable in elevation from 5 degrees above to 20 degrees below waterline (WL) zero and is operated by either the pilot or copilot/observer. It will fire at either 2000 or 4000 rounds per minute (rds/min). The ammunition capacity is 2000 rounds.

SCOPE OF TEST

7. Stability and control tests on the OH-58A were conducted at forward flight speeds ranging from 30 to 129 knots calibrated airspeed (KCAS). Hover and sideward and rearward flight testing was also performed. Approximate gross weights (grwt) ranged from 2245 to 2990 pounds at density altitudes from sea level to 15,000 feet. The longitudinal center of gravity (cg) was varied from full forward to full aft.

8. Testing was conducted in the armed configuration and with the XM27E1 armament subsystem removed. The flying qualities of the helicopter with the pilot door and the two passenger doors removed were evaluated and compared with the doors-on configuration.

9. Testing was conducted in California at Bishop (elevation 4112 feet), Coyote Flats (elevation 9500 feet), Shafter (elevation 420 feet), and Edwards Air Force Base (elevation 2302 feet). The test program was conducted from October 1969 to February 1970 and consisted of 89 flights totaling 85.3 productive flight hours.

METHOD OF TEST

10. The test methods utilized are outlined in the test plan (ref 6, app I) and are discussed further in the Results and Discussion section of this report. All tests were conducted under nonturbulent atmospheric conditions to preclude uncontrolled disturbances from influencing the test data.

11. An OH-58A helicopter (S/N 68-16706) was equipped with sensitive calibrated instruments. A detailed list of the recorded parameters is presented in appendix II. The pilot's comments were used to aid in the analysis of data and to assist in the overall qualitative assessment of the flying qualities of the OH-58A. The Handling Qualities Rating Scale (HQRS) is included as appendix III.

CHRONOLOGY

12. The chronology of this test:

Test directive issued	7 August	1968
Test plan published	May	1969
Test helicopter received	7 August	1969
First stability and control test flight	6 October	1969
A&FC testing completed	16 February	1970
Draft report submitted	June	1970

RESULTS AND DISCUSSION

STATIC LONGITUDINAL STABILITY

13. Static longitudinal collective-fixed stability and static trim characteristics tests were performed. The static longitudinal stability of the helicopter was evaluated in level flight and climb by varying the airspeed in increments of approximately 7 knots using the longitudinal cyclic control while maintaining the collective fixed at the trim position. Control positions were recorded while the helicopter was stabilized at each incremental airspeed above and below the trim airspeed. Summary plots of the collective-fixed curves are presented in figure 1, appendix IV, and show the effects of changes in density altitude (H_D), gross weight (gr wt), helicopter configuration, flight condition and cg. Detailed data plots showing the results of the collective-fixed tests are presented in figures 2 through 9. The level-flight conditions are listed in table 1. Collective-fixed tests were also conducted in climbs.

Table 1. Static Longitudinal Collective-Fixed
Stability Flight Test Conditions.

Configuration	Density Altitude (ft)	Gross Weight (lb)	Center of Gravity (in.)
Armed ¹	880	2,660	105.8 (fwd)
Armed ¹	6,360	2,660	106.7 (fwd)
Armed ¹	15,030	2,665	106.7 (fwd)
Armed ¹	5,960	2,900	106.1 (fwd)
Armed ¹	6,290	2,950	112.1 (aft)
Armed ²	6,090	2,680	106.4 (fwd)
Clean ¹	5,990	2,620	106.2 (fwd)
Clean ¹	6,040	2,340	111.0 (mid)

¹Doors on.

²Doors off.

14. Static longitudinal trim characteristics were investigated by measuring control displacement at trim conditions in level flight, autorotation and climb. Airspeed was varied in increments of approximately 10 knots by changing power. These data are summarized in figure 10, appendix IV, and presented in detail in figures 11 through 18. Flight conditions and helicopter configurations for the tests were approximately the same as those listed in table 1.

Collective-Fixed Characteristics

15. The longitudinal control position gradient with airspeed was stable (negative) for all flight conditions during the collective-fixed testing although the position gradient was weak (shallow slope) for the 2340-pound grwt, mid cg condition at a level-flight trim speed of 59 KCAS (fig. 1, app IV). A shallow position gradient results in a lack of control displacement cue as airspeed changes; however, in this case, it was not of such a reduced magnitude as to be objectionable to the pilot (HQRS 3). Since a linear relationship exists between the longitudinal control force and the control position when the force trim is turned ON, the control force gradient was also negative for all force-trim ON flight conditions.


16. No clearly defined trend was exhibited by the effects of density altitude on the collective-fixed static longitudinal stability. At the lowest test altitude (880-ft H_D), as shown in figure 1, appendix IV, there was a more negative position gradient than for the 6360-foot H_D . At airspeeds above 65 KCAS, however, the highest test density altitude (15,030 ft) also resulted in a gradient which reflected more static stability than at the 6360-foot H_D condition.

17. The effects of center of gravity on the collective-fixed static longitudinal stability in level flight were well defined. The stability was less with aft cg locations. The helicopter exhibited more negative gradients with increasing gross weights. Removal of the doors had no noticeable affect on static longitudinal stability. Removal of the weapons system, however, resulted in a more negative gradient (fig. 1, app IV). The combined effects of changing the individual parameters discussed above are shown in figure A. In this figure, the least negative stability gradient (2340-lb grwt and mid cg) is compared with the most stable configuration tested (2620-lb grwt and fwd cg).

18. For several flight conditions, as shown in figure 1, appendix IV, the longitudinal stability gradient for climb was greater than that for level flight. For all flight conditions, the climb gradient was at least equal to the level-flight gradient.

FIGURE A
COLLECTIVE FIXED LONGITUDINAL STABILITY

CURVE NUMBER	CG ~IN	GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FT	CONFIGURATION
1	106.2(FWD)	2620	5990	CLEAN (DOORS ON)
2	111.0(MID)	2340	6040	CLEAN (DOORS ON)

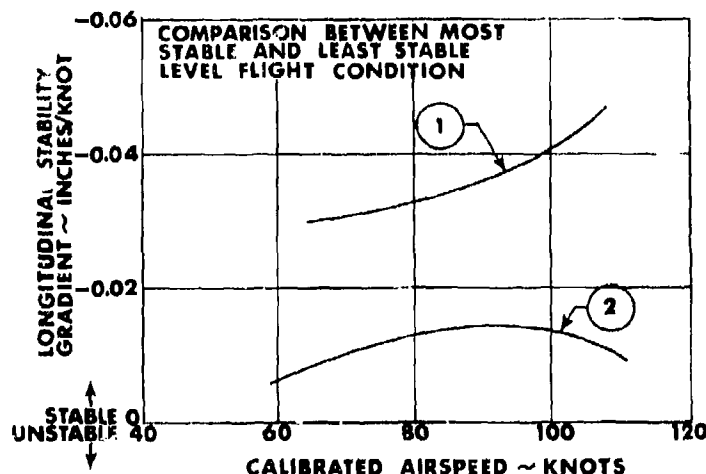


Static Longitudinal Trim Characteristics

19. Figure 10, appendix IV, is a summary plot which shows the results of the tests that determined the control positions in forward level flight, climb and autorotation. A comparison of the weakest control position gradient with the most negative gradient is shown in figure B.

20. In the static trim characteristics tests, as in the collective-fixed test, the control position gradients became less negative as the cg was moved aft or gross weight was decreased (fig. 10, app IV). The weakest gradient for each configuration was evident in autorotation. The difference between climb and level flight was negligible. Varying the helicopter configuration from the clean to the armed configuration or by removing the doors had a negligible effect upon the static longitudinal trim characteristics. For all configurations tested, the longitudinal control position gradient approached zero between 20 and 30 KCAS. Positive gradients were found to exist at lower forward speeds (see discussion on low-speed forward flight under the heading: Sideward and Rearward Flight, paragraph 58). All control margins were adequate and met the requirement of the mil spec at the forward cg; however, at two conditions (figs. 15 and 17), at a mid and an aft cg, the mil spec forward longitudinal control margin requirement of 10 percent remaining was reached at 120 KCAS. The data indicate that this control margin could not be achieved at light grwt, full aft cg conditions.

FIGURE B
LONGITUDINAL CONTROL GRADIENTS

CURVE NUMBER	CG ~IN	GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FT	CONFIGURATION
1	105.9(FWD)	2695	6040	CLEAN (DOORS ON)
2	111.1(MID)	2360	6030	CLEAN (DOORS ON)

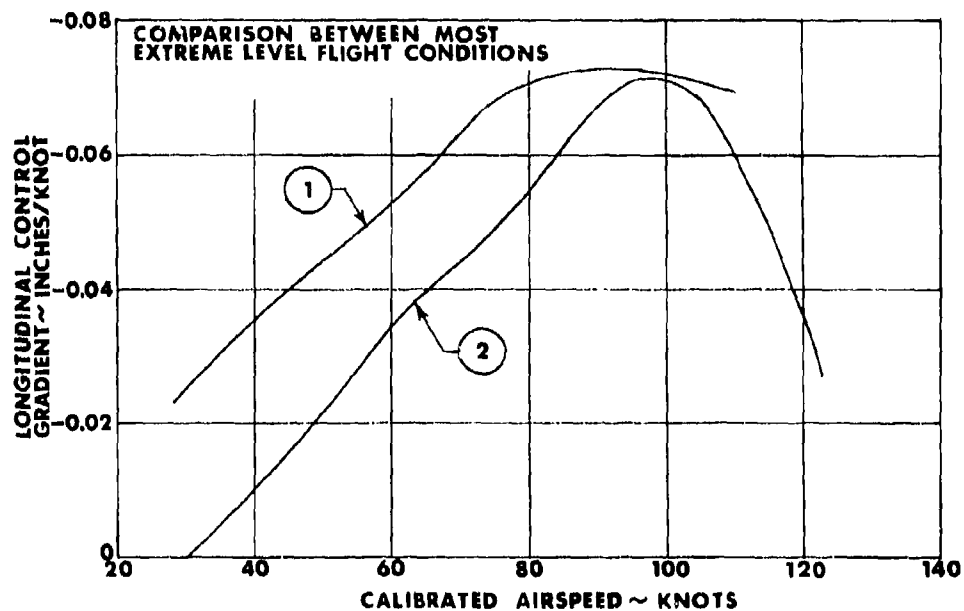

21. At the highest airspeed tested (approximately 90 KCAS), autorotations required 2 to 3 inches more aft cyclic stick displacement than did climbs. The longitudinal cyclic deviation between autorotation and climb exceeded the 3-inch limit (para 3.2.10.2 of the mil spec for three test conditions at 90 KCAS (figs. 12, 17 and 18, app IV). Since the helicopter configuration, cg, and gross weight were different for each of the three instances, no consistent trend could be defined. It was noted that for several other conditions tested, the longitudinal cyclic deviation between climb and autorotation approached the limit of the mil spec at the highest airspeed tested. Qualitatively, however, this deviation was not objectionable to the pilot during flight.

22. There was generally less than 1 inch of lateral cyclic variation between climb and autorotation. Pedal displacement between climb and autorotation varied from 1 to 2 inches. Variations in the lateral cyclic movement and pedal travel with changes in airspeed were insignificant. The mil spec requirements (para 3.3.17) for the lateral cyclic travel were satisfied.


23. A few minor problems were encountered during the static longitudinal stability testing. It was difficult to maintain precise rotor rpm control during autorotation, *ie*, small variations in pitch attitude or sideslip angle would cause large fluctuations in rotor speed (± 20 rpm). This condition should not pose a problem for normal mission accomplishment. Control of rotor speed in autorotation was considerably easier at a 15,000-foot H_D than at 6000 feet. Also, it was easier to stabilize on level-flight points at the higher altitude. During the low-speed testing (below 40 knots indicated airspeed (KIAS)), stabilized flight was relatively difficult to maintain because of the apparent influence of the aircraft long-period mode and a slight Dutch-roll oscillation which occurred occasionally (discussed more fully under the heading: Static Lateral-Directional Stability).

24. For all flight conditions, cyclic control forces could be easily reduced to zero by the use of the force trim system. "Stick jump" (an unwanted control motion resulting from pressing the force trim button while a force is being held against the cyclic control) was negligible during the flight testing. There was no evidence of cross-coupling between the cyclic and the collective controls during flight with the boost ON. Notwithstanding the mil spec noncompliances mentioned in paragraph 21, the static longitudinal collective-fixed and trim characteristics of the helicopter were satisfactory for all conditions tested (HQRS 2).

STATIC LATERAL-DIRECTIONAL STABILITY

25. Static lateral-directional stability was tested under the flight conditions listed in table 2. The tests were conducted by establishing a trim airspeed with zero sideslip and varying the sideslip angles while maintaining constant airspeed and ground track. The boom-mounted, pitot-static swivel probe used during the stability and control testing, eliminated sideslip-induced errors in the indicated airspeed. Control positions were recorded for each steady-heading sideslip. The results of the static lateral-directional stability tests are summarized in figure 19, appendix IV, and presented in detail in figures 20 through 29. A comparison between the most stable (2670-lb grwt, fwd cg) and the least stable (2360-lb grwt, mid cg) lateral and directional control position gradients is presented in figure C.

FIGURE C
STATIC LATERAL DIRECTIONAL STABILITY GRADIENTS

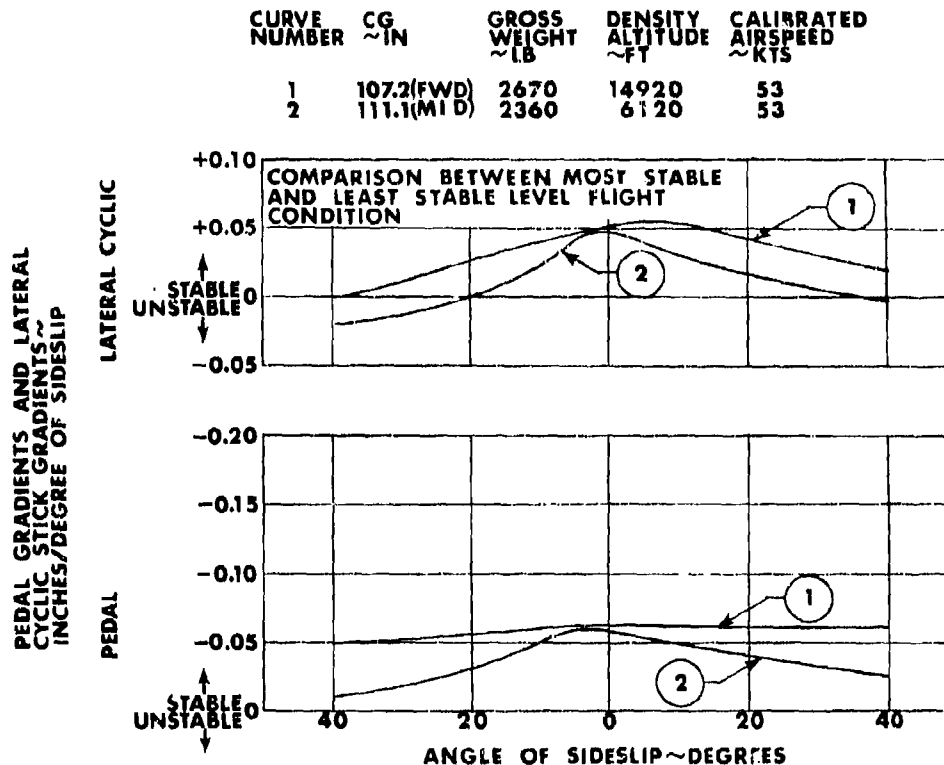

26. The directional control pedal position versus sideslip gradient was stable (negative) for all level flight and climb flight conditions and aircraft configurations (fig. 19, app IV). The pedal position gradients decreased with decreasing gross weights and aft cg movement. Pedal position gradients increased with increasing airspeed for all flight conditions. Density altitude variations showed no clearly defined trend. The effect of other test condition variables was negligible (*ie*, doors and armament subsystem configurations) upon the level-flight, static lateral-directional stability.

27. Bank-angle gradients were essentially linear which indicates that there were positive side force characteristics for all level-flight and climb conditions tested. Side force increased with increasing airspeeds and provided strong cues as to the directional stability of the helicopter.

Table 2. Static Lateral-Directional Test Conditions.

Configuration	Altitude (ft)	Gross Weight (lb)	Center of Gravity (lb)	Flight Mode
Armed ¹	1,660	2,735	105.9 (fwd)	Level
Armed ¹	5,980	2,570	106.9 (fwd)	Level
Armed ¹	5,790	2,620	107.0 (fwd)	Climb, autorotation
Armed ¹	14,920	2,670	107.2 (fwd)	Level
Armed ¹	6,020	2,840	105.6 (fwd)	Level
Armed ¹	5,930	2,960	112.1 (aft)	Level
Armed ²	5,990	2,655	106.5 (fwd)	Level
Clean ¹	5,970	2,650	105.7 (fwd)	Level
Clean ¹	6,120	2,360	111.1 (mid)	Level

¹Doors on.

²Doors off.


28. Lateral cyclic control position gradients approached zero at 53 KCAS in level flight and 49 KCAS in climb at sideslip angles greater than 30 degrees both right and left (fig. 21, app IV). Although effective dihedral was weak at the high-sideslip angle flight conditions, it was not an objectionable characteristic for normal, operational flying at low-sideslip angles. The effective dihedral was found to increase with increasing gross weights and increasing airspeeds. The effect of varying the cg was negligible (fig. 19).

29. In autorotation at 49 KCAS, the pedal-position gradient (fig. 22, app IV) was essentially neutral at the zero-sideslip point. For the same flight condition, the lateral stick-position gradient and the dihedral effect were unstable (negative) for sideslip angles greater than 25 degrees left, slightly stable (positive) between 25 degrees left and 30 degrees right, and neutral above a 30-degree right sideslip. In autorotation at 85 KCAS, a reversal (from positive to negative) in the slope of the lateral control occurred at sideslip angles of approximately 15 degrees both right and left (fig. 23). Qualitatively, this gradient reversal would not be objectionable to the pilot during normal mission flying. Bank-angle gradients found during autorotation indicated the presence of a linear side force characteristic which increased in magnitude with airspeed. The operational pilot could fly the helicopter inadvertently in a small degree of sideslip in either direction, while performing a low airspeed autorotation, because of the combination of a weak positive dihedral effect and a weak pedal-position gradient (HQRS 3). This condition should not adversely affect mission accomplishment.

30. During the static lateral-directional stability testing, a significant Dutch-roll oscillation was encountered at left sideslip angles of approximately 5 degrees. Typical time histories of the oscillation are shown in figure D and also in figure 30, appendix IV. The oscillation was moderately damped at lower airspeeds, but the damping effect decreased as airspeed was increased. At the higher airspeeds the Dutch-roll oscillation was neutrally damped. Damping increased when the doors were removed and when the armament subsystem was not installed. The oscillation is not likely to occur during the normal operations (when the helicopter is in a zero-sideslip or slight right-sideslip condition) except during very turbulent conditions, but would be extremely objectionable during firing if the pilot inadvertently placed the helicopter in a slight left sideslip (HQRS 4). In such a situation the firing accuracy would be significantly degraded. Correction of this shortcoming is desirable.

**FIGURE D
DUTCH ROLL**

CALIBRATED AIRSPEED ~ KTS	CG ~ IN	GROSS WEIGHT ~ LB	DENSITY ALTITUDE ~ FT	CONFIGURATION
93	105.7(FWD)	2740	2950	ARMED(DOORS ON)

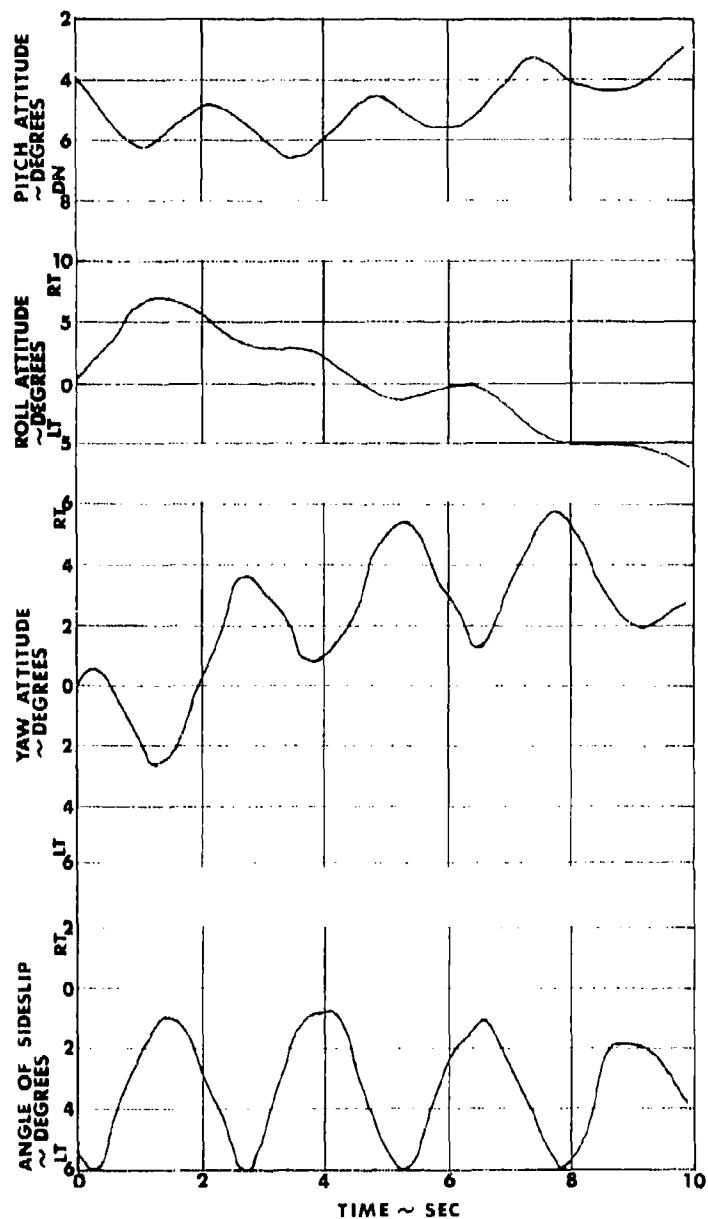

31. At right-sideslip angles greater than 15 degrees with airspeed at 80 KCAS or greater, a high-frequency (21.5 Hertz) vibration was evident in the helicopter. The source of the vibration was observed to be a small amplitude, lateral vibration about the longitudinal axis of the upper vertical stabilizer. A photographic record was made of this vibration. The condition would normally not be encountered during an operational situation where sideslip angles seldom reach this magnitude and is not considered a problem.

32. In general, overall static lateral-directional flying qualities of the OH-58A were acceptable (HQRS 4). The requirements of paragraph 3.3.9 of the mil spec were not met in autorotation at 85 KCAS for the lateral stick and pedal gradients (fig. 23, app IV), in that the gradients were not approximately linear. Also, some gradients were slightly unstable (figs. 22, 23, and 29) at various airspeeds. These characteristics were not objectionable in flight; however, the previously discussed shortcoming accounted for the relatively low pilot rating of the OH-58A in static lateral-directional stability.

DYNAMIC STABILITY

33. Longitudinal, lateral, and directional dynamic stability characteristics of the helicopter were tested at approximately the same conditions as listed in table 3. Representative results are presented as time histories in figures 31 through 36, appendix IV.

34. The longitudinal, long-period dynamic stability characteristics were evaluated by stabilizing the helicopter at trim airspeed and then increasing and decreasing the airspeed by desired increments using only the cyclic control. The controls were then returned to the trim position, and the helicopter response was observed by the pilot and recorded on an oscillograph. The long-period oscillatory mode was convergent for all level-flight conditions, the damping increased with increasing airspeed. In a maximum-power climb, the long-period mode was divergent at 35 and 49 KCAS, and damped at 80 KCAS. The period of the oscillation was approximately 20 seconds for all flight conditions. Damping was well within the limits of paragraph 3.2.11 of the mil spec. There was no control coupling present, nor was rotor overspeed a problem. The long-period mode was easily excited at low airspeeds (below 40 KIAS) during level-flight tests (para 23); however, this characteristic should not be detrimental to mission accomplishment.

35. The longitudinal gust response characteristics of the helicopter were tested by applying cyclic pulse inputs to excite the aircraft short-period mode. The test results are presented in figures 31 and 32, appendix IV. For all conditions tested, the short-period mode was heavily damped, and the requirements of paragraph 3.2.11 of the mil spec were met. The longitudinal dynamic stability of the helicopter was satisfactory (HQRS 2).

36. Lateral gust response characteristics were tested by applying lateral pulse inputs to the cyclic control (figs. 33 and 34, app IV). The spiral stability characteristics (ability of the helicopter to return to level flight after a disturbance in the roll axis) indicated a neutral mode. This was most evident during turbulent flight conditions where constant, small lateral control corrections were necessary. Neutral spiral stability was acceptable for the tasks tested (HQRS 3), although it would be objectionable if the helicopter were to be flown under instrument flight conditions.

37. Pedal pulse inputs resulted in lightly to moderately damped yaw oscillations (figs. 35 and 36, app IV). Yaw damping varied directly with airspeed and varied inversely with altitude. At a 3,000-foot H_D , the yaw axis damping ratio, determined by the transient peak ratio method, was 0.15 at 63 KCAS and increased to 0.30 at 108 KCAS. A directional disturbance usually resulted in a slight nose-down pitching of the helicopter. This characteristic was acceptable for the tasks being evaluated. A lightly damped, Dutch-roll oscillation was occasionally generated by the pedal pulses. This oscillation was also encountered during the static, lateral-directional testing as discussed in paragraph 30. The dynamic lateral and directional flying qualities were satisfactory for the tasks tested (HQRS 3).

CONTROL RESPONSE AND SENSITIVITY

General

38. The longitudinal, lateral and directional control response (maximum angular rate per inch of control input) and sensitivity (maximum angular acceleration per inch of input) of the helicopter were tested at the flight conditions listed in table 3. The step input method was used for these tests. Each control was rapidly displaced and then held firmly against a rigid fixture until the maximum rate was reached or until recovery became necessary. Resultant attitudes, rates and accelerations were recorded on an oscillograph. The results are presented in figures 37 through 58, appendix IV. The helicopter responded in the proper direction

in all axes complying with the requirements of paragraphs 3.3.16 and 3.2.9 of the mil spec. The control power (helicopter angular displacement per inch of control input per second) for all axes met the minimum requirements of the mil spec.

Table 3. Control Response and Sensitivity Test Conditions.

Configuration	Density Altitude (ft)	Gross Weight (lb)	Center of Gravity (in.)	Flight Condition
Armed ¹	-30	2,655	106.1 (fwd)	Hover OGE ²
Armed ¹	3,910	2,685	106.2 (fwd)	Hover OGE
Armed ¹	10,530	2,510	109.1 (mid)	Hover OGE
Armed ^{1,3}	270	2,960	106.0 (fwd)	Hover OGE
Armed ^{1,3}	-930	2,810	111.9 (aft)	Hover OGE
Armed ¹	5,960	2,700	107.0 (fwd)	LF ⁴ , C ⁵ , A ⁶
Armed ¹	6,320	2,865	105.6 (fwd)	LF, C ³ , C ³
Armed ¹	6,140	2,830	112.0 (aft)	LF, C ³ , A ³
Armed ¹	14,900	2,660	106.9 (fwd)	LF
Armed ^{1,3}	3,150	2,680	106.1 (fwd)	LF
Clean ^{1,3}	5,720	2,675	105.2 (fwd)	LF, C, A
Armed ^{3,7}	5,950	2,620	106.4 (fwd)	LF, C, A

¹Doors on.

²Out of ground effect.

³This condition was tested, but the data are not presented.

⁴Level flight.

⁵Climb.

⁶Autorotation.

⁷Doors off.

Longitudinal

39. The maximum longitudinal control response could not be measured in hover. Recovery inputs were required prior to reaching the maximum pitch rate in order to avoid extreme aircraft attitudes. Therefore, longitudinal control response in hover was measured 1 second after the step input was initiated. The pitch rate decreased as airspeed increased and ranged from 10 deg/sec/in. (up and down) in hover at a 3910-foot H_p to 5.5 deg/sec/in. (up) and 4.5 deg/sec/in.

(down) at a 5960-foot H_D and 115 KCAS. The effects of different gross weights, cg's, density altitudes and flight conditions (climb and autorotation) were negligible (figs. 37 and 38, app IV). The pitch-axis rate damping met the requirements of paragraph 3.2.14 of the mil spec. An Iyy of 1947 slugs/ft², supplied by Bell Helicopter Company, was used to determine this specification compliance.

40. Airspeed significantly affected the downward pitching sensitivity which ranged from 15 deg/sec²/in. in hover to 10 deg/sec²/in. at 115 KCAS. The upward pitching acceleration remained essentially constant. Moving the location of the cg had no noticeable effect on the longitudinal sensitivity. The effects of different density altitudes and flight conditions were also negligible. Increasing the gross weight from 2690 to 2980 pounds increased the sensitivity by approximately 2 deg/sec²/in. The longitudinal control response and sensitivity were satisfactory (HQRS 2).

Lateral

41. The maximum lateral control response in hover was 24 deg/sec/in. at a minus 30-foot H_D and exceeded the 20-deg/sec/in. limitation of paragraph 3.3.15 of the mil spec (figs. 39 and 40, app IV). This limitation was exceeded at several other flight conditions but was not considered to be objectionable. At a 3910-foot H_D , it was 20 deg/sec/in. (both right and left). Lateral control response decreased at 49 KCAS to approximately 14 deg/sec/in. (both right and left) but increased with additional increases in airspeed and measured 22 deg/sec/in. (right) at 115 KCAS. In forward flight, the effects of different helicopter configurations, altitudes, gross weights and cg's were insignificant. In a hover, however, the lateral response decreased as density altitude increased. Changing the flight condition at a constant airspeed resulted in the most significant variation in lateral control response. At 49 KCAS, the rate varied from 10 deg/sec/in. (both right and left) in autorotation to 20 deg/sec/in. (both right and left) in climb. Level-flight response at 49 KCAS was 13 to 14 deg/sec/in. These variations are assumed to have resulted from the changes in rotor thrust. The control response increased as thrust increased. At greater airspeeds, the lateral response also varied more between right and left step inputs. The differences between the inputs ranged from zero in hover to 4 deg/sec/in. at 115 KCAS. Although the lateral rate damping did not meet the minimum requirement of paragraph 3.3.19 of the mil spec, it did comply with deviation 19 of the detail specification (ref 1, app I).

42. The lateral sensitivity increased slightly with increasing airspeed and ranged from 30 deg/sec²/in. (left) in hover to 34 deg/sec²/in. (both right and left) at 115 KCAS. At 49 KCAS, the acceleration varied from 20 deg/sec²/in. (both right and left) in

autorotation to 32 deg/sec²/in. (right) in climbs. Level-flight sensitivity at 49 KCAS was 26 deg/sec²/in. (right) and 24 deg/sec²/in. (left). This nonlinear variation with airspeed (which is similar to the lateral response variation) was not objectionable to the pilot. Moving the cg aft increased the lateral sensitivity by approximately 4 deg/sec²/in. Gross weight, density altitude, and helicopter configuration effects were negligible. The lateral control response and sensitivity are considered to be satisfactory (HQRS 2).

Directional

43. The maximum directional control response in hover could not be measured since the rate increased steadily with time, indicating a lack of yaw rate damping (figs. 57 and 58, app IV). This characteristic is an undesirable shortcoming (HQRS 5), and correction is recommended. Yaw rate should reach a maximum value quickly, dependent only upon the magnitude of the control displacement and not upon the duration of the input. As a result of the lack of yaw rate damping, the time to reach a maximum yaw rate could not be measured as aircraft recovery was necessary before the maximum rate was attained. Using the "time constant" method of determining first order rate damping,

$$\text{where: Damping} = \frac{\text{Moment of Inertia}}{\text{Time to 0.63 Max Rate}}$$

the rate damping approached zero since time to reach the maximum rate was excessive. Therefore, the minimum yaw rate damping requirement of paragraph 3.3.19 of the mil spec was not met. An I_{zz} of 1534 slugs/ft² supplied by Bell Helicopter Company was used to determine this specification noncompliance. The response in hover was measured 1 second after the step input. The maximum directional control response measured occurred in hovering flight and reached a value of 49 deg/sec/in. for the right pedal step input at a 30-foot H_p (figs. 41 and 42, app IV). The minimum directional control response was 11.0 deg/sec/in. to the right and occurred during forward flight at 66 KCAS and at a 14,900-foot H_p . Airspeed was the most significant variable which affected directional control response and sensitivity at airspeeds of less than 38 KCAS. Both rates and accelerations increased as airspeed decreased. The maximum control sensitivity was 68 deg/sec²/in. (both right and left) which also occurred in hover at the same flight conditions as the maximum control response. The minimum sensitivity was 33.5 deg/sec²/in. (both right and left) and occurred at the same flight conditions as the minimum response described above.

44. In level flight, the rates and accelerations decreased significantly as density altitude increased. The effects of different

gross weights, cg's or helicopter configurations were insignificant, and there was no appreciable variation between level flight, climb and autorotation.

45. Longitudinal and lateral couplings were evident during directional-control response testing. A slight downward pitching motion and a roll in the direction of the yaw resulted from the pedal step inputs. This coupling would not adversely affect mission accomplishment.

MANEUVERING STABILITY

46. The maneuvering stability characteristics of the helicopter were tested for the flight conditions listed in table 4. The symmetrical pull-up was the primary test technique used during the testing. For this test, the helicopter was trimmed in level flight at the desired airspeed after which a cyclic pull-up to a slightly higher altitude was initiated. A dive was then established, and the helicopter was accelerated to near trim airspeed. A symmetrical pull-up was executed so as to pass through the required trim airspeed, altitude, pitch attitude and the desired load factor, simultaneously. Longitudinal stick force and normal acceleration were recorded at each test point. The results are summarized in figure 59, appendix IV, and presented in detail in figures 60 through 62. The maneuvering stability characteristics were spot-checked during turns at the 2700-pound grwt and forward cg. The results are compared with corresponding data obtained in pull-up maneuvers shown in figure 60.


Table 4. Maneuvering Stability Flight Conditions.

Configuration	Density Altitude (ft)	Gross Weight (lb)	Center of Gravity (in.)	Hydraulic Boost System
Armed ¹	5,230	2,705	107.1 (fwd)	On
Armed ¹	10,950	2,675	107.0 (fwd)	On
Armed ¹	4,950	2,990	106.2 (fwd)	On
Armed ¹	5,350	2,970	112.2 (aft)	On
Armed ¹	5,390	2,630	106.9 (fwd)	Off
Armed ²	5,080	2,680	106.4 (fwd)	On
Clean ¹	5,200	2,650	106.0 (fwd)	On

¹Doors on. ²Doors off.


47. The boost-ON stick force gradient relative to the acceleration (F_s/g) was positive for all conditions tested, *ie*, a greater aft cyclic force was required for an increased load factor. The force gradient depends entirely on the spring effect of the force trim system. The gradients became more positive with increased gross weight (increasing from 4.43 lb/g at 2705 pounds to 5.83 lb/g at 2990 pounds). The gradients also increased as the cg was moved forward (fig. E). Changing the airspeed, altitude or helicopter configuration had no significant effect on the stick force gradients.

**FIGURE E
MANEUVERING STABILITY**

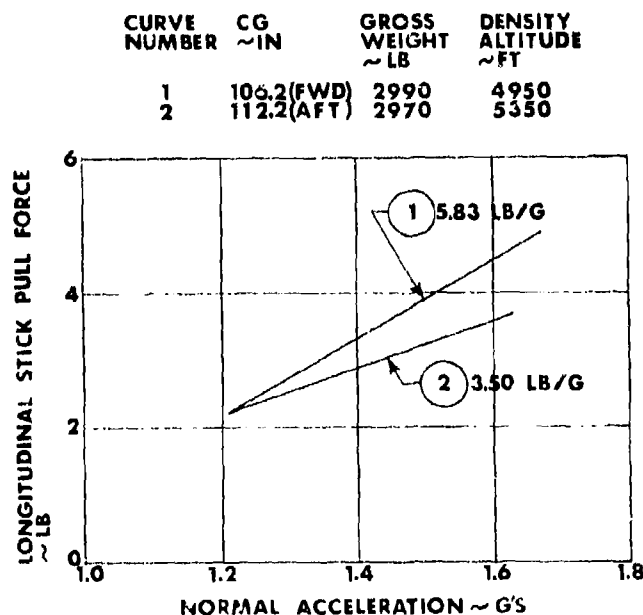

48. The maximum normal acceleration recorded was 1.9 g's at a 2650-pound grwt. It was not possible to reach the limit load factor of 2.8 g's. Although stick-force-per-g gradients are light, it is not likely that the helicopter will be overstressed during normal operation because of the large pitch attitudes required. The helicopter did not tend to roll in either direction during symmetrical pull-ups, nor was any rotor overspeed encountered. At the highest airspeed tested (100 KCAS), blade stall was experienced (as evidenced by a severe 2-per-rev vertical vibration during pull-ups from dives). This vibration was not transmitted through the control system, and adequate warning was provided. The effect was not a problem at the conditions tested.

49. Typical time history plots of normal acceleration during symmetrical pull-ups are shown in figure F and also in figure 61, appendix IV. Although the normal acceleration decayed slightly after an initial rise, it then continued to build and became concave downward within 2 seconds following the start of the maneuver. It then remained concave until maximum acceleration was attained. This characteristic met the requirements of paragraph 3.2.11.1 of the mil spec. The helicopter stick-force-per-g characteristics (boost ON) were satisfactory (HQRS 3).

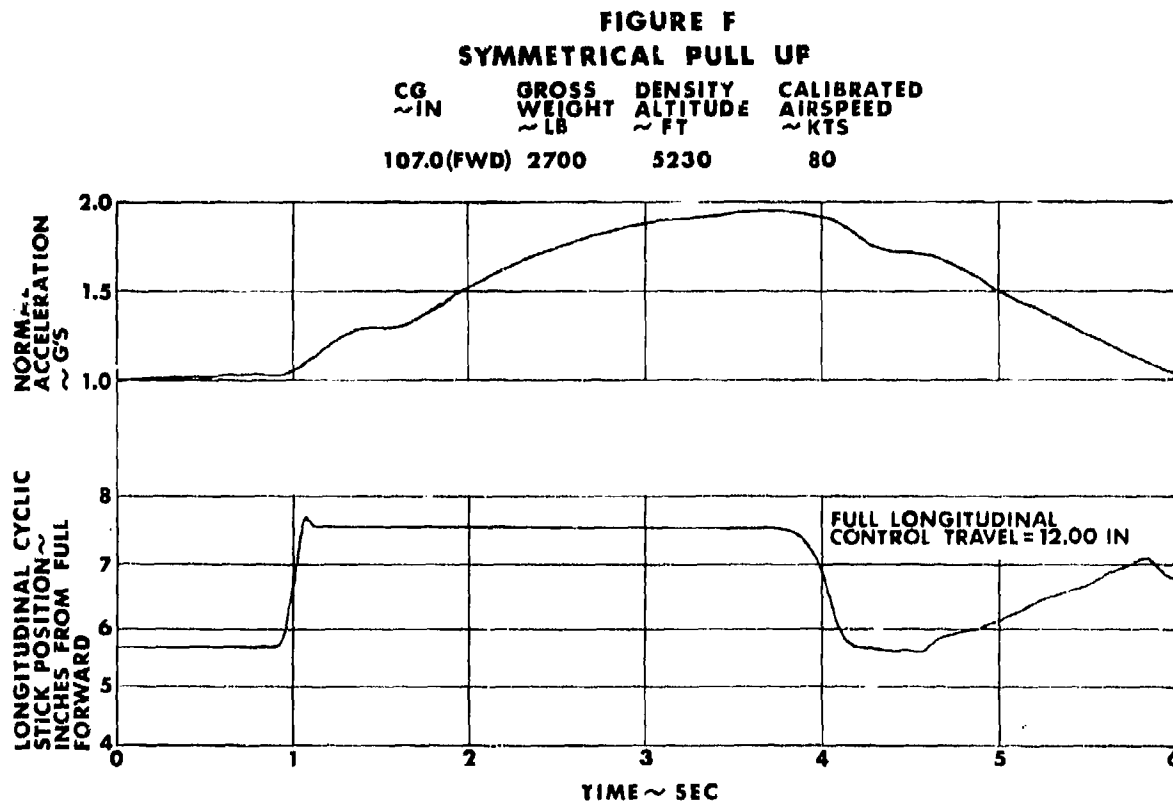

50. The maneuvering stability of the helicopter was tested with the boost OFF at a 2650-pound grwt, a 5390-foot H_p and a forward cg configuration (fig. 62, app IV). Control coupling existed between the longitudinal cyclic stick and the collective pitch, *ie*, raising the collective transmitted a pull force to the cyclic while lowering the collective resulted in a cyclic push force. A qualitative evaluation of the test results showed that positive aft cyclic forces were required to obtain positive load factors; however, there was no consistency in the stick force gradient. Because of the excessive

collective and cyclic control forces, the boost-OFF maneuvering characteristics of the helicopter are considered to be satisfactory for emergency operations only (HQRS 6). The correction of this shortcoming is recommended.

SIDEWARD AND REARWARD FLIGHT

51. Sideward, rearward and forward flight tests were conducted to determine the hovering capability in ground effect (IGE) of the helicopter in winds of various speeds and azimuths. Azimuths were varied in 30-degree increments measured clockwise from the nose of the helicopter. The test conditions are listed in table 5. Sideward flights were performed at airspeeds up to 35 knots true airspeed (KTAS), and rearward flights were performed at airspeeds up to 30 KTAS (as limited by ref 1, app 1). Gross weight was varied from 2490 to 2980 pounds, and density altitude was varied from minus 1600 to 10,530 feet. The results of the tests are presented in figures 63 through 76, appendix IV.

Table 5. Sideward and Rearward Flight Test Configurations.

Configuration ¹	Gross Weight (lb)	Density Altitude (ft)	Center of Gravity (in.)
Armed ²	2,630	3,770	106.9 (fwd)
Armed ²	2,680	-10	106.5 (fwd)
Armed ³	2,490	10,530	108.7 (mid)
Armed ³	2,980	150	107.5 (fwd)
Armed ³	2,960	-1,600	106.2 (fwd) -2.4 (left lat)
Clean ³	2,675	-970	106.4 (fwd)

¹Doors on.


²Azimuth sweep (30-degree increments).

³Sideward, rearward and forward (90-degree increments).

52. The capability of hovering in crosswinds of various speeds and azimuths was adequate for most of the conditions tested. However, in left sideward flight at speeds from 15 to 25 KTAS and wind azimuths of 240 and 270 degrees, the helicopter was directionally unstable

necessitating large pedal force inputs to maintain a steady heading (HQRS 6). Time histories of left sideward flight at 15 KTAS are shown in figure G and also in figure 76, appendix IV. At airspeeds greater than 25 KTAS, the instability was not evident. All control margins were adequate for both right and left sideward flight up to 35 KTAS and complied with the requirements of the mil spec (as amended by ref 1, app I). The requirement of paragraph 3.3.5 of the mil spec (to execute a complete turn in each direction in a 35-knot wind) was not checked because of the unavailability of a 35-knot wind. However, the sideward and rearward flight data indicate that the aircraft does comply with this requirement. The directional instability in left sideward flight at 15 to 25 KTAS is a shortcoming, and correction is desirable.

FIGURE G
LEFT SIDEWARD FLIGHT AT 15 KTAS

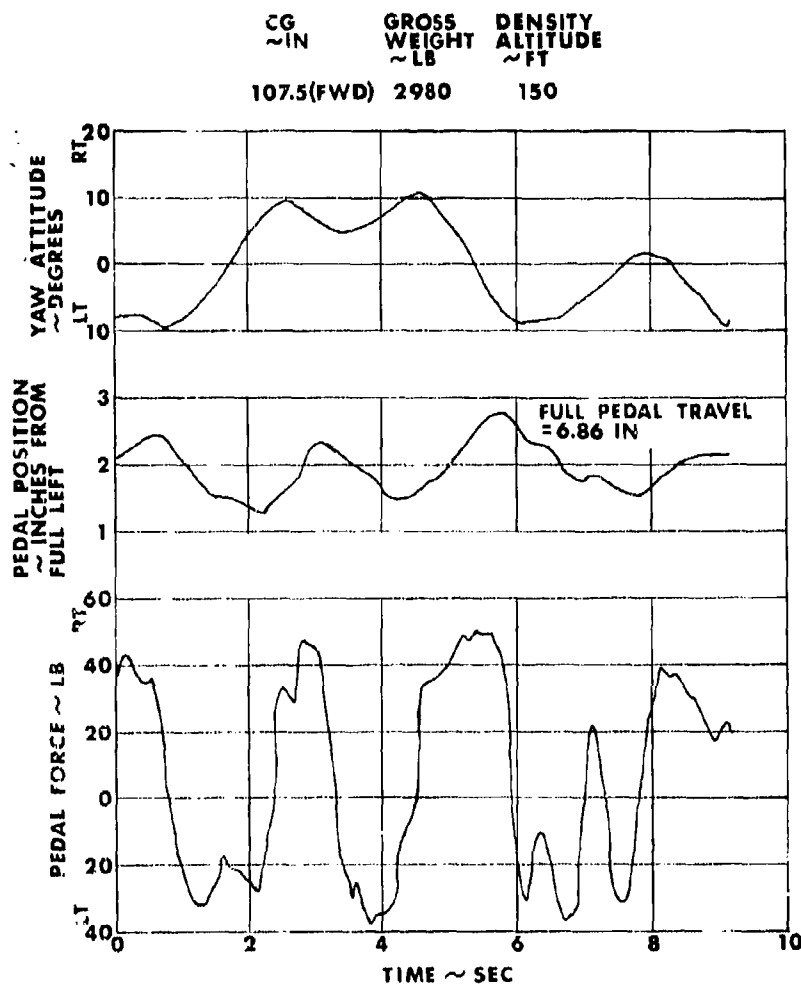

53. The position of the cyclic control was uncomfortably aft at the higher rearward flight speeds. At 30 KTAS with the doors on, the cyclic came in contact with the aft control stop several times while the pilot was correcting for minor longitudinal disturbances. The average margin of aft longitudinal control remaining reached the amended specification limit (ref 1, app I) of 5 percent at 30 KTAS, forward cg but never exceeded the limit (fig. 75, app IV). It is doubtful that the helicopter could hover in a forward cg doors-on configuration with a tail wind that exceeds 30 KTAS and still have the control margin required to overcome possible nose-down pitching. Hovering at such conditions is, therefore, not recommended. It is recommended that a caution note be placed in the operator's manual (ref 5) warning against hovering in a tail wind in excess of 30 knots.

54. There was no resultant change of any control margin caused by the removal of the gun. For all conditions tested, the only effect of moving the lateral cg to the full left location was that the cyclic control had to be moved 1.7 inches farther to the right than during the mid lateral cg location testing.

55. The effects of gross weight and density altitude changes were determined by varying the thrust coefficient (C_T). At the greatest C_T tested (0.00343), an additional 0.7 inch of left pedal displacement was required for all flight conditions as compared with the lowest C_T of 0.00260. At 35 KTAS in right sideward flight at a C_T of 0.00343, the left pedal control margin reached 5 percent (fig. 72, app IV). At a greater C_T (increased grwt or higher H_D), it would probably be impossible for the aircraft to comply with mil spec control margin requirements for right sideward flight at 35 KTAS. The right sideward flying qualities are satisfactory for normal operation.

56. The wind azimuths at which the control margins reached their lowest points are listed in table 6. The critical azimuths (headings of the helicopter relative to the wind which provided the minimum control margins) were identical for all test configurations listed in table 5. Typical results are shown for one configuration in figures 63 through 69, appendix IV.

Table 6. Critical Azimuths.

Control	Flight Condition	Critical Azimuth (deg)	Control Margin Remaining (%)	True Airspeed (kt)
Left pedal	Right sideward	90	5	35
Aft cyclic	Rearward	180	5	30

57. Figures H and J show the pedal and longitudinal stick positions at the critical azimuth conditions where the control margins reached the amended specification limit of 5 percent (ref 1, app I). These margins were encountered only during the most critical conditions tested (cg, grwt, H_p , and aircraft configuration).

**FIGURE H
SIDEWARD FLIGHT**


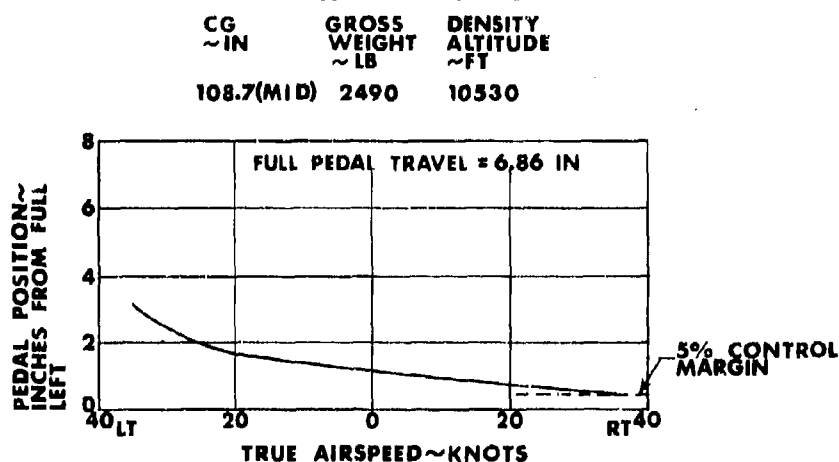


**FIGURE J
REARWARD AND FORWARD FLIGHT**

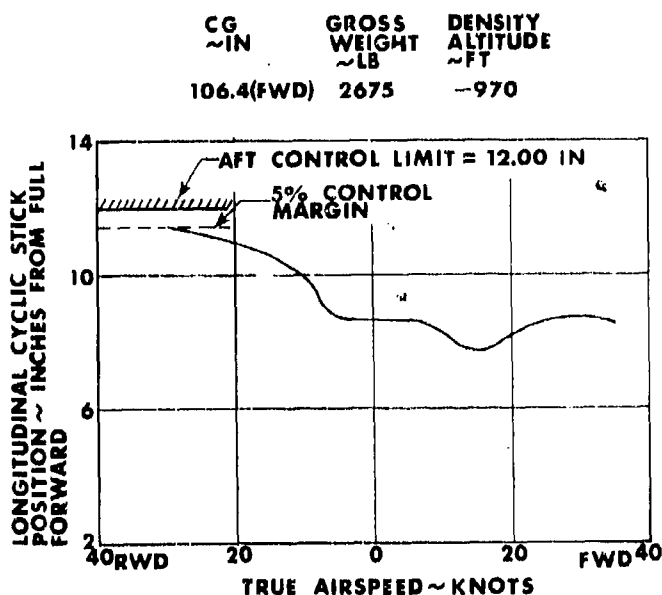

58. A longitudinal stick reversal, which indicates a lack of static longitudinal trim stability, occurred from 20 to 30 KTAS in low-speed forward flight. The longitudinal stick position shifted aft 0.6 to 0.9 inch, depending on the configuration, as airspeed was increased. The longitudinal stick-position gradient changed sharply from nearly neutral at airspeeds between 5 KTAS rearward to highly negative (-0.43 in./kt) at airspeeds between 5 and 10 KTAS rearward. At rearward airspeeds exceeding 10 KTAS, the gradient was slightly negative (-0.037 in./kt). These discontinuities were not objectionable to the pilot and are not considered to be shortcomings.

AUTOROTATIONAL ENTRY

59. Simulated engine-failure tests (throttle chops) were conducted in level flight and during maximum-power climbs and maximum-power dives up to the never exceed airspeed (VNE) in the armed, doors-on configuration. The helicopter was trimmed at a given flight condition, and the throttle was abruptly closed to the flight idle position to simulate a sudden engine failure. The flight controls were held fixed as long as possible (up to a maximum of 2 seconds) to simulate the normal delay in pilot reaction time following an actual engine failure. The resultant maximum pitch, roll and yaw rates were recorded and plotted, as were the rotor decay rate and the time delay. The results of these tests, which include a time history plot, are presented in figures 77 through 80, appendix IV. The flight conditions tested are listed in table 7.

Table 7. Autorotational Entry Test Conditions.

Center of Gravity (in.)	Gross Weight (lb)	Density Altitude (ft)	Calibrated Airspeed Range (kt)
106.3 (fwd)	2720	3150	35 to 129
112.0 (aft)	2920	2250	35 to 129
112.4 (aft)	2920	9850	35 to 128

60. Generally, the reaction of the helicopter following a throttle chop was characterized by a slight nose-up pitch during the first second followed by a substantial nose-down pitching motion. The initial upward pitching motion was hardly noticeable in flight and did not exist at the highest airspeed (129 KCAS), forward cg condition. The secondary downward pitching was more pronounced, particularly at the greater airspeeds.

61. The reaction of the helicopter following the throttle chops was also characterized by a left yaw and left roll in all instances. The roll rates increased with increasing airspeed, while the yaw rates decreased as airspeed was increased. Yaw rates at the lower airspeeds (during climb and level-flight testing) were high and exceeded 20 deg/sec at the lower altitudes. Control effectiveness in recovery was adequate in all instances.

62. It was seldom possible to wait for a full 2-second delay between "rolling off" the throttle and lowering the collective control because of the rapid rate of rotor decay. In all instances, the collective was held fixed until it became necessary to lower it in order to arrest the rotor decay rate at or just above the minimum safe transient rotor speed of 304 rpm. The time required to fully reduce the collective averaged 0.5 second during which an additional 10 rpm were lost. This time is not included in the delay times as presented in this report. At a 2250-foot H_p (the lowest test altitude), the maximum acceptable time delay before application of control was 1.86 seconds (fig. 78, app IV). The minimum time delay was recorded at a 2250-foot H_p and was 1.16 seconds (fig. 78) during a maximum-power climb at 49 KCAS. At the 2250-foot H_p and at a 3150-foot H_p , the 2-second time delay requirement of paragraph 3.5.5 of the mil spec could not be met. At a 9850-foot H_p , the mil spec requirement (para 3.5.5) was met only for level-flight speeds of less than 80 KCAS.

63. At all altitudes, the low-airspeed (approximately 49 KCAS) maximum-power climbs resulted in the highest rate of rotor decay after the throttle chop and required rapid corrective action by the pilot. Maximum delay time at this flight condition was 1.63 seconds at a 9850-foot H_p (fig. 79, app IV). After the minimum rpm was reached, the rotor speed recovery rate (rotor speed build-up to obtain a normal rate after the collective is lowered) was slower from climb throttle chops than from the level-flight and/or dive conditions. In level flight, the rotor speed decay rate increased as airspeed increased, but the pilot response time was not as critical as it was during climb.

64. Warning of engine failures was adequate for all conditions tested. There was a distinct decrease in sound level as the throttle was closed which was accompanied by an instantaneous yaw to the left. The slight instantaneous pitching motion did not provide an adequate cue. There were no side forces or normal acceleration forces (positive or negative) of sufficient magnitude to be objectionable. Collective coupling was not observed. The average delay time for all conditions tested was acceptable, but rapid pilot compensation was required in climb. Rotor speed response to variations in collective setting and airspeed was sensitive and required constant monitoring. Rotor speed fluctuations were not large, however, and an inexperienced pilot in an actual emergency would probably have no difficulty keeping

the rotor speed within limits. Although considerably more aft cyclic was required in autorotation than in level flight (para 21), control margins were ample. The overall autorotational entry characteristics of the OH-58A are satisfactory (HQRS 3).

HOVERING STABILITY

65. The stability of the OH-58A helicopter in a hover was satisfactory for the pitch and roll axes but was unsatisfactory in yaw. Excessive pilot effort was required to maintain precise directional control and to make heading changes. Control inputs which were required to compensate for heading disturbances often resulted in moderate pilot-induced oscillations (PIO). The severity of the PIO was directly related to the heading accuracy required. The lack of yaw-rate damping (para 43) required the pilot to make control inputs to compensate for any yaw disturbance. The pilot's task in maintaining a heading was complicated by a high pedal breakout force of 10 to 15 pounds (measured in flight) which is significantly out of proportion to the breakout force in the lateral and longitudinal control systems (0.5 lb). In addition to the large breakout force, the pilot encountered a transient pedal force gradient which was present only while the pedals were moving. This transient force gradient reached values on the order of 100 lb/in. These factors combine to complicate the pilot's task of holding the helicopter steady while in a hover and during landing. The net pedal forces were measured by strain gauges and recorded on the oscillograph (figs. 76 and 90, app IV).

66. Landing in confined areas, such as revetments and unimproved landing zones, requires precise directional control. Excessive pilot effort required to accomplish this basic task detracts from the helicopter ability to perform operational missions. The shortcoming in directional control during hover (HQRS 5) also detracts from the helicopter accuracy during firing of the armament subsystem and could adversely affect mission accomplishment. Correction is recommended on a priority basis.

ARMAMENT FIRING

67. The XM27E1 armament subsystem was fired at representative conditions of flight to determine its effect on the stability and control of the helicopter. The results are presented in figures 81 through 84, appendix IV. Reaction to firing the weapon resulted in attitude changes in pitch, roll and yaw. These attitude excursions and the imprecise helicopter response to pilot efforts in correcting the alignment of the weapon with the target degraded the capability of the helicopter to maintain impact in the target area.

68. Firing was conducted in two phases. During Phase I, the flight controls were held fixed while firing 3-second bursts. These data are presented in figure 81, appendix IV. In Phase II, corrections were applied in an attempt to maintain accurate target impact. Time histories of this firing are presented in figures 82 through 84. Qualitative evaluations of pilot effort, noise and vibration level were made. Time histories of control positions, helicopter attitudes and rates were recorded on an oscillograph. The duration of the firing burst was restricted to 3 seconds by a limiter built into the firing circuit.

69. Firing runs were made from a low level (approximately 50 feet) and during dives from 1500 feet above ground level (AGL). Each firing run was followed by a steep climbing turn to the right. The right turn was considered to be the most critical condition for control-margin evaluation. Firing conditions are presented in table 8.

70. Firing from a hover caused the most problems for the pilot. Precise aiming was extremely difficult because of a tendency to overshoot the desired point when attempting to make small heading corrections. This problem was compounded during firing by the large reaction in the pitch, roll and yaw axes resulting from weapon firing. When corrections were not applied to hold the aircraft attitude, the heading changed 47 degrees (to the left), and the nose pitched down 17 degrees at the end of a 3-second burst at the maximum rate of fire (4000 rds/min) with the weapon horizontally aligned (fig. 81, app IV). The helicopter had adequate control power available to maintain control and to correct the target alignment, but the high yaw rate (reaching a maximum of 24 deg/sec to the left), resulting from the firing, and the difficulty encountered in maintaining precise directional control prevented hitting the target consistently (fig. 84). Correction caused the hits to "walk" across the target, and the hits could not be held within the target area consistently.

71. Targets were engaged in forward flight at representative airspeeds at low altitudes and also during dives from 1500 feet AGL. Each target attack run was followed by a steep climbing turn up to bank angles of 60 degrees. Despite the roll that resulted from firing, adequate control margin was available for executing evasive maneuvers.

Table 8. Firing Test Conditions.

Phase 1 (Controls Fixed)

Calibrated Airspeed (kt)	Flight Condition	Height Above Ground (ft)	Weapon Position	Rate of Fire (rd/min)
0	Hover IGE	10	Full up, horizontal, full down	2000
0	Hover IGE	10	Horizontal	4000
0	Hover OGE	50	Full up, horizontal, full down	2000
0	Hover OGE	50	Horizontal	4000
49	Level flight	1500	Horizontal	2000 and 4000
80	Level flight	1500	Full up, horizontal, full down	2000 and 4000
80	5, 10 and 25 degrees (left and right sidelip)	1500	Horizontal	2000
80	Accelerated flight at 1.4 g's	1500	Full up, horizontal, full down	2000
80	Accelerated flight at 1.4 g's	1500	Horizontal	4000
80	Accelerated flight at 1.8 g's	1500	Full up, horizontal, full down	2000
80	Accelerated flight at 1.8 g's	1500	Horizontal	4000
105	Level flight	1500	Horizontal	2000 and 4000
117	Dive	1500 to 500	Horizontal	2000 and 4000
122	Dive	1500 to 500	Horizontal	2000 and 4000

Phase II (Controls Applied)

Calibrated Airspeed (kt)	Flight Condition	Height Above Ground (ft)	Weapon Position	Rate of Fire (rd/min)
0	Hover IGE	10	Horizontal	2000 and 4000
0	Hover IGE	10	Full down	2000
0	Hover OGE	50	Full down, horizontal	2000 and 4000
33	Low level	50	Horizontal	2000 and 4000
49	Low level	50	Horizontal	2000 and 4000
85	Low level	50	Horizontal	2000 and 4000
101	Dive	1500 to 500	Horizontal	2000 and 4000
125	Dive	1500 to 500	Horizontal	2000 and 4000
125	Dive	1500 to 500	Full down	4000
10 to 30	Takeoff	5	Horizontal	2000 and 4000
10 to 30	Takeoff	5	Full up	2000
30 to 10	Landing	5	Horizontal	2000 and 4000
30 to 10	Landing	5	Full down	2000
15	Left sideward	10	Horizontal	2000 and 4000
15	Right sideward	10	Horizontal	2000 and 4000
15	Rearward	10	Horizontal	2000 and 4000

72. Difficulty was encountered in establishing precise aim before firing because of excessive vertical vibration of the sight reticle (HQRS 5) and the difficulty in making small directional corrections. Use of the lateral cyclic control alone to make directional corrections was not suitable because of the excessive lapsed time before the turn could be completed (approximately 2 seconds). Attempts to coordinate pedal and cyclic control required excessive pilot effort in order to maintain balanced flight because of the disharmony

of the control forces (disproportionate pedal forces). The use of the pedals alone resulted in excessive sideslip. The difficulty in holding precise headings makes the consistency of achieving first round hits on a target very poor. Sight reticle vibration is a shortcoming which would adversely affect mission accomplishment, and correction is recommended.

73. Attitude excursions which resulted from firing during forward flight were not large but did cause significant dispersion of hits (figs. 82 and 83, app IV). Control power was adequate for control of the helicopter and to correct for attitude disturbances, but it was impossible to maintain impact on a point target.

74. Noise and vibration levels were evaluated qualitatively based on their effects on the pilot's ability to perform the mission. During firing, the increase in the vibration level was moderate and did not seriously affect the flying qualities of the helicopter (HQRS 3). The increase in noise level was high during firing, particularly in the doors-off configuration. Excessive noise in the intercom made conversation difficult to understand over the intercom and would make radio transmission difficult during a combat situation. Correction of this shortcoming is recommended.

75. Changes in helicopter attitude which resulted from firing were related to airspeed, rate of fire and weapons position (relative to the horizontal axis) as shown in figure 81, appendix IV. The magnitude of the changes decreased with increasing airspeed and was less at the reduced rates of fire. Firing of the weapon in the horizontal or elevated positions resulted in a left yaw, left roll, and a nose-down pitch attitude. Firing of the weapon in the depressed position resulted in a left yaw, right roll, and nose-down pitch attitude.

76. Adequate control power was available to correct for the attitude changes observed in all flight conditions tested, and no change in the stability characteristics was noted; however, excessive pilot effort was required to correct the point of impact back to the target. In addition, a high level of pilot effort was required to make minor directional aiming corrections prior to initiating firing (HQRS 5). Correction of the difficulty in making precise heading corrections is recommended to improve service suitability.

FLIGHT CONTROL SYSTEM

77. The flight control system was evaluated to determine the control breakout forces (total force, including friction, required to initiate control movement), force gradients and maximum flight

control forces, and also to determine compliance with the requirements of the mil spec. The system was tested with and without the hydraulic boost system in operation. The breakout forces and force gradients were measured on the ground with the helicopter rotor stationary using hydraulic pressure applied from an external source. Although the mil spec breakout force requirements are specified in terms of in-flight conditions, common test procedure has been to consider ground measurements valid. The boost-OFF forces were also measured during normal flight maneuvers (see time histories of symmetrical pull-up, left sideward flight and landing, figs. 62, 76 and 90, app IV). The results are presented in figures 85 through 90.

78. The boost-ON longitudinal breakout forces (fig. 86, app IV) were measured with the force trim switch both ON and OFF and with the cyclic friction OFF. The force-trim-ON, friction-OFF breakout force was 1.7 pounds (pull force) which slightly exceeded the 1.5-pound limit imposed by paragraph 3.2.7 of the mil spec. Longitudinal breakout forces in flight were not objectionable and allowed small, smooth, precise control displacements from trim. All longitudinal force gradients (force trim ON) were positive. With cyclic friction applied during a normal flight adjustment, the force-trim-ON stick force gradient was smooth, and there were no discontinuities recorded.

79. The lateral breakout forces (boost ON) were measured (fig. 87, app IV) with the force trim both ON and OFF using a normal flight application of cyclic friction (force trim ON). The maximum lateral breakout force (force trim ON, friction OFF) was 0.8 pound and complied with the requirements of paragraph 3.3.13 of the mil spec. The force gradient was positive at all times, and the requirements of paragraph 3.3.11 of the mil spec were met. No undesirable discontinuities in the lateral force gradient were observed during flight. There was no binding in the system with cyclic friction applied.

80. The maximum pedal breakout force (fig. 85, app IV) measured on the ground was approximately 9 pounds (right) and exceeded the 7-pound limitation of paragraph 3.3.13 of the mil spec. The directional control force gradient was nonlinear over the entire trim range and was negative to the right of the trim position. These results do not meet the requirements of paragraph 3.3.11 of the mil spec.

81. Pedal breakout forces varied with the flight condition. They were approximately the same in level flight as those measured on the ground, whereas the forces were considerably greater during hovering flight as can be seen in a time history of a typical landing approach (fig. 90, app IV). The pedal forces reached a maximum transient value of 49 pounds during left sideward flight at 15 KTAS (fig. 76). This force is considered to be excessive and, therefore, did not meet the

qualitative requirements of deviation 19 of the detail specification. The 15-pound directional control force limitation of paragraph 3.3.12 of the mil spec was not met.

82. Pedal free play (pedal travel necessary to cause a deflection of the tail-rotor control surface) was measured on the ground and was found to be ± 0.1 inch which meets the requirements of paragraph 3.5.10 of the mil spec. However, the total effect of this free play in conjunction with the excessive pedal breakout forces was considered to be a contributing factor to the directional control in a hover (discussed in para 65).

83. The maximum collective breakout force (fig. 88, app IV) (boost ON, friction OFF) measured at a typical collective setting of 5 inches was approximately 4.3 pounds (pull). Although this exceeded the requirements of paragraph 3.4.2 of the mil spec by 1.3 pounds, the boost-ON collective breakout force was not considered to be objectionable in flight.

84. Some control coupling (boost ON) existed between the collective and the longitudinal control (fig. 89, app IV). When the collective was moved upward, a 0.5-pound forward force was transmitted to the cyclic control. Although this force coupling did not meet the requirements of paragraph 3.4.3 of the mil spec, it was not objectionable to the pilot because the use of a small amount of cyclic friction eliminated the effect.

85. The longitudinal force gradient was approximately 1.42 lb/in. as compared with a lateral gradient of 0.88 lb/in. (boost ON, friction OFF). The gradients did not change when cyclic friction was applied. Control harmony among the lateral, longitudinal and collective controls was satisfactory except in those instances in which high pedal forces were encountered.

86. The longitudinal control free play (boost OFF) was measured and found to be ± 0.53 inch, and the lateral free play (boost OFF) was found to be ± 0.91 inch. These free-play measurements exceeded the limitations of paragraph 3.5.10 of the mil spec by 0.33 inch and 0.71 inch, respectively.

87. Excessive coupling between the cyclic and collective controls existed with the boost OFF (fig. 89, app IV). Raising the collective control caused a maximum pull force of 6 pounds to be transmitted to the cyclic control which exceeded the 1-pound maximum limitation of paragraph 3.4.3 of the mil spec. Lowering of the collective caused a push force of 4.2 pounds to be transmitted to the cyclic control.

88. All of the maximum breakout forces (boost OFF) were found to be excessive (fig. 85, app IV). The maximum longitudinal force was measured at 14.5 pounds (pull); the maximum lateral force was 13 pounds (left from neutral); and the maximum collective force was 38 pounds (up from the 5-inch collective setting). These forces are shown in time history plots of the data which were measured in flight (figs. 62 and 90), and each exceeded the limits of paragraphs 3.2.7, 3.3.13 and 3.4.2 of the mil spec. The boost-OFF lateral, longitudinal and collective breakout forces were considered acceptable for emergency use only (HQRS 6).

VIBRATION

89. Vibrations in the helicopter were measured at the various flight conditions listed in table 9. Accelerometers were installed at the pilot seat and the passenger seat to measure lateral and vertical vibrations. Vibration frequencies were analyzed at multiples of one-, two-, four-, six- and eight-per-rotor-revolution. Single-amplitude vibration and acceleration levels were plotted as a function of airspeed and are presented in figures 91 through 95, appendix IV. Maximum recorded vibration levels are listed in table 9.

90. All lateral vibration levels were insignificant (0.11 g or less) and complied with the requirements of the mil-spec. The predominant vertical vibration was the two-per-revolution which increased significantly with increasing airspeed at airspeeds greater than 50 KCAS. The vibration level at this frequency, as well as the six-per-revolution vibration, exceeded the limit of paragraph 3.7.1(b) of the mil spec for several conditions listed in table 9. The two-per-revolution vibration became severe as V_{NE} was approached. Although this provided an ample cue to warn the pilot of impending blade stall, the vibration level near V_{NE} was uncomfortable and degraded the target tracking task (HQRS 4). Correction of this shortcoming is recommended for improved service use. Increasing the maximum level-flight speed capability of the OH-58A to speeds more closely approaching V_{NE} would probably increase the vibrations to a level which would be unacceptable for sustained level-flight operations. At airspeeds of 100 KCAS and less, the vibration levels were satisfactory (HQRS 3). Varying the flight conditions or removing the armament subsystem did not significantly affect the vibration levels. Vibration levels in climb and autorotation did not vary significantly from those recorded during level flight.

Table 9. Flight Conditions and Maximum Vibration Levels.

Gross Weight (lb)	Center of Gravity (in.)	Density Altitude (ft)	Calibrated Airspeed (kt)	Configuration ¹	Vertical Vibration				
					Pilot Seat	Passenger Seat		Military Specification Limit ² (g)	
						2/rev (g)	6/rev (g)		
2,750	107.6 (fwd)	5,780	³ 119.0	Clean	0.22	0.14	0.29	0.18	0.20
2,710	107.0 (fwd)	5,000	³ 125.0	Armed	0.25	0.12	0.26	0.15	0.20
2,985	106.3 (fwd)	4,580	³ 115.0	Armed	0.19	0.16	0.20	0.22	0.20
2,995	112.2 (aft)	4,830	³ 115.0	Armed	0.26	0.13	0.17	0.23	0.20
2,730	107.1 (fwd)	10,950	⁴ 105.0	Armed	0.21	0.12	0.21	0.16	0.20
2,750	107.6 (fwd)	5,780	⁵ 85.0	Clean	0.09	0.04	0.10	0.19	0.15
2,710	107.0 (fwd)	5,000	⁵ 85.0	Armed	0.10	0.06	0.09	0.14	0.15

¹Doors on.²MIL-E-8501A.³Dive.⁴Level flight.⁵Autototation.

SLOPE LANDING

91. An evaluation was conducted to investigate the slope-landing characteristics of the OH-58A. It was impossible to land safely on a 10-degree slope (measured with an inclinometer) with the left skid uphill. The helicopter could be landed safely with the nose, tail and right skid uphill on a 10-degree slope, although the latter orientation required the application of full right cyclic control. It is doubtful that the maneuver would be acceptable to the average pilot who would probably abort the landing when full lateral travel of the cyclic had been reached. When the left skid was uphill, the maximum slope capability was approximately 9 degrees.

92. The landing surface at the test site consisted of a dry, well-graded, firmly compacted, clay/sand desert soil with an approximate California bearing ratio of 1C and a 25-degree angle of repose. Surface winds during the test were steady at 10 to 15 knots and provided a head-wind condition when the left side of the helicopter was "upslope." The method of test was to perform landings on progressively steeper slopes using cyclic control as required to hold the aircraft against the slope while the collective pitch was lowered smoothly and gradually. When the skids were firmly set on the ground with no tendency to slip, the collective control was placed in the full down position, and the cyclic control was centered. The reverse sequence was used to lift off and return to a hover. In the left-skid-uphill test, the left skid tended to slide down the 10-degree slope despite the use of full left lateral cyclic and the lowering of the collective control to the point where the downhill (right) skid was still 4 to 5 inches from the ground.

93. The requirements of paragraph 3.8.1 of the detail specification were not met in that the helicopter could not land safely on a 10-degree slope from all directions. It should be noted, however, that several possible variables could have affected the slope-landing capabilities: soil type and condition, wind, and pilot technique. Since these variables are not defined in the detail specification, the results of the test are not conclusive evidence that the requirements cannot be met.

SKI INSTALLATION

94. A brief qualitative evaluation was conducted to determine the OH-58A flying qualities with Airglas Corporation skis (model no. L2700-206) installed. The ski installation is shown in photo 1. The following tests were conducted at the maximum airspeed for level flight (V_H) in the armed configuration: static and dynamic longitudinal, lateral and directional stability, maneuvering stability

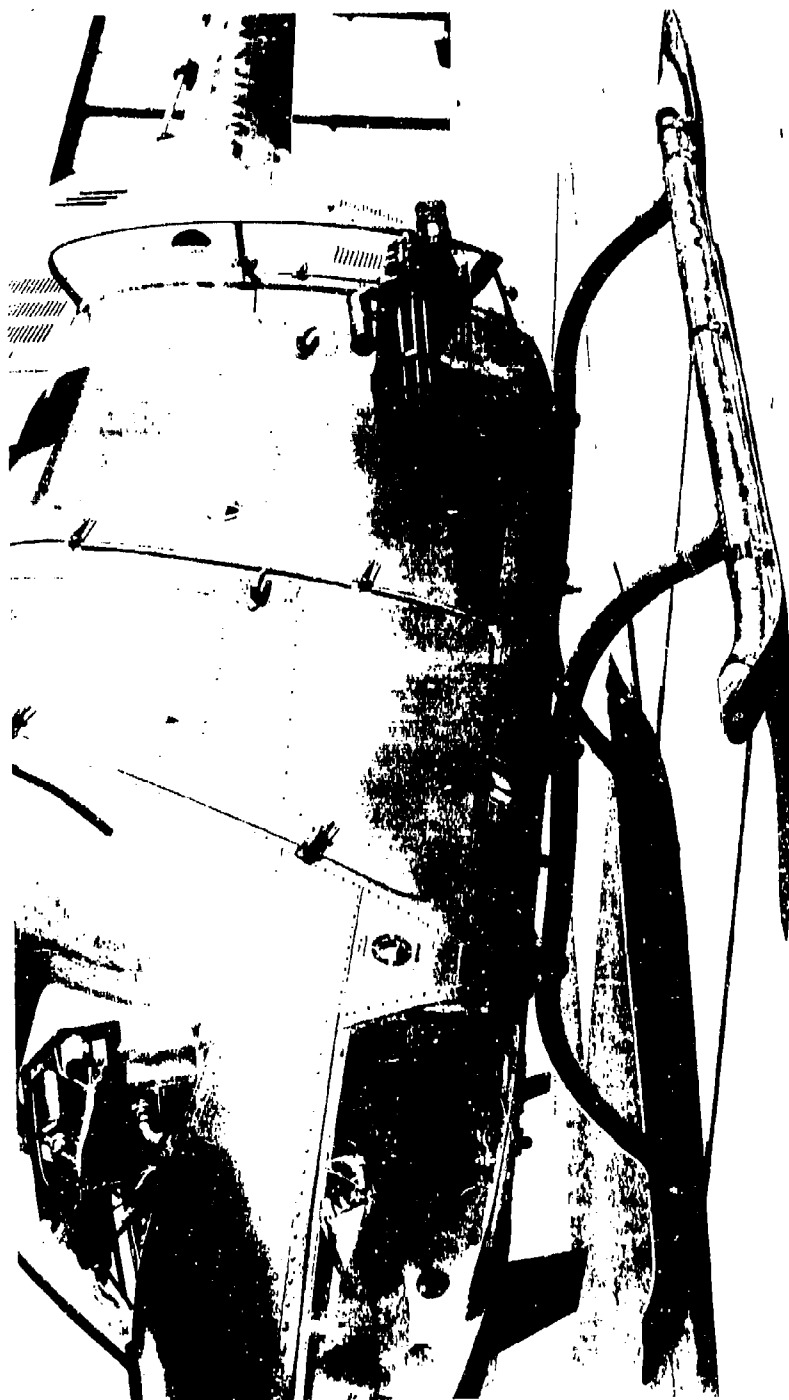


Photo 1. Ski Installation.

and autorotational entry. A slight two-per-revolution vibration was observed in the skis, particularly the left one. This vibration had no discernible effect on the flying qualities or safety of the helicopter, and the evaluation confirmed the ability of the OH-58A to fly safely with skis installed.

HUMAN FACTORS

95. There were no hand holds installed on the helicopter to assist the crew members in entering and leaving the cockpit. Equipment improvement recommendation (EIR) number 619269 was submitted on 5 March 1970 regarding this problem. Ingress and egress were difficult, particularly for a tall individual, because of the size and shape of the door. Correction of this shortcoming is recommended to facilitate crew ingress and egress.

96. Ingress and egress were further impeded by the lack of hooks inside the cockpit on which to hang the pilot's and copilot's helmets. The pilot and copilot must place their helmets either directly in the way on the seat or floor, or depend upon another individual outside the helicopter for assistance. Correction of this shortcoming is recommended.

97. All four doors had jettison releases. The handles were marked adequately and could be operated easily. During a firing run, the left front door came off at the emergency release points, and the cause was not determined. EIR number 143940 and EIR number 54574 were submitted regarding this problem on 13 January and 17 February 1970, respectively. The emergency door release was satisfactory for emergency egress.

98. The mechanism designed to hold the doors in place when opened during ground operation was unsatisfactory. It was usually impossible to keep the doors open without physically holding them. Correction of this shortcoming is recommended.

99. The pilot and copilot seats were comfortable when parachutes were not worn. No seat adjustment was provided; therefore, when parachutes were worn, it was necessary to remove the back of the seat. In these cases, the pilot and copilot were still seated farther forward than the normal position. A tall pilot wearing a parachute had difficulty obtaining full right cyclic deflection because the door post restricted the movement of his right knee to the extent that his right leg was in the path of the cyclic control. Since parachutes are seldom worn during normal operation, the crew seats are satisfactory for mission accomplishment.

100. The antitorque pedals are adjustable by turning a knob located on the floor just aft of the pedals. The pedal adjustment knob was easy to turn by the pilot using his foot and permitted a satisfactory range of pedal travel for most pilots. The adjustment was adequate for mission accomplishment which is an important consideration because the seat is not adjustable.

101. The force trim button is located on the top right-hand corner of the cyclic stick grip (looking forward). Activation of the button required placement of the pilot's right thumb in an awkward position and resulted in a momentary reduction of control authority. It is recommended that this shortcoming be corrected by relocating the force trim button in accordance with the position of the standardized cyclic grip, MS87017.

102. The cyclic and collective friction adjustments were satisfactory. The throttle friction was excessive and was not adjustable. When recovering from practice autorotations, it was possible to inadvertently fail to apply full power because of the excessive friction. A throttle friction adjustment device is recommended to correct this shortcoming.

103. There is no map storage compartment in the front (pilot) cockpit. This is unsatisfactory in a warm weather environment where the helicopter is flown with the doors removed. Installation of a cockpit map storage compartment is recommended to correct this shortcoming.

104. The ventilation system, consisting of two snap vents in each of the four doors, was inadequate for warm weather operation with the doors installed. Based on crew observation, there were no engine fumes present in the cockpit during ground or air operations; however, the pilot would probably become fatigued because of the heat. Correction of this shortcoming is recommended.

MAINTENANCE CHARACTERISTICS

Favorable

105. In general, the maintainability of the helicopter was excellent throughout the test. "Down time," because of maintenance problems, was almost nonexistent. A total of 183 flight hours was accumulated on the test helicopter without the occurrence of a serious maintenance problem.

Unfavorable

106. Several unfavorable characteristics were noted; these are as follows:

- a. The ground handling wheels were inadequate. EIR Number 619268 was submitted on 5 March 1970 regarding this problem. A full fuel load would cause the wheels to spread out, and the tires would become almost flat despite a 10-psi overpressure. Correction of this shortcoming is recommended.
- b. Ground handling was impeded by the lack of handling points on the helicopter both on the tail section and on the fuselage intermediate or forward section. Correction of this shortcoming is recommended.
- c. During the high-altitude testing (15,000-foot H_D), oil leaked through the outboard ends of the main rotor blade grips. Leakage was not excessive, but correction is recommended in order to preclude future problems during high-altitude operation. EIR Number 457831 was submitted on 15 October 1969 regarding this problem.
- d. The fuel quantity gauge indicated FULL when the VHF transmitter was keyed or when the force trim button was actuated. Correction of this shortcoming is recommended.
- e. The rubber bumper located next to the static stop on the tail-rotor assembly was replaced four times during the evaluation. This was a result of the static lateral-directional testing in which large sideslip angles were encountered and is not considered to be a shortcoming for the normal mission.

CONCLUSIONS

GENERAL

107. The following conclusions were reached as a result of the stability and control testing on the OH-58A helicopter:

- a. The overall flying qualities of the helicopter are satisfactory.
- b. There are 19 items of specification noncompliance. These are listed in appendix V.

DEFICIENCIES AND SHORTCOMINGS AFFECTING MISSION ACCOMPLISHMENT

108. There were no deficiencies noted during the testing.

109. Correction of the following shortcomings is desirable for improved operation and mission capabilities:

- a. Dutch-roll tendency when the helicopter is in a slight left sideslip (para 30).
- b. Lack of yaw rate damping when the helicopter is in a hover (para 43).
- c. High boost-OFF collective and cyclic control forces (paras 50 and 88).
- d. Directional instability in left sideward flight at airspeeds between 15 and 25 KIAS (para 52).
- e. Difficulty in maintaining precise directional control in hover (para 66).
- f. Excessive vertical vibration of the sight reticle in the armament subsystem (para 72).
- g. Excessive noise in the intercom during firing (para 74).
- h. Difficulty in making precise directional control corrections in forward flight while aiming and firing the weapon system (para 76).
- i. Severe two-per-revolution vertical vibrations at speeds near VNE (para 90).

- j. Lack of hand holds on door frames (para 95).
- k. Lack of hooks in the cockpit on which to hang helmets (para 96).
- l. Difficulty in keeping doors open during ground operations (para 98).
- m. Awkward location of force trim button (para 101).
- n. Excessive friction of the throttle and no adjustment (para 102).
- o. Lack of a cockpit map storage compartment (para 103).
- p. Inadequate cockpit ventilation (para 104).
- q. Inadequate ground handling wheels (para 106a).
- r. Lack of ground handling points (para 106b).
- s. Oil leakage through main rotor blade grips at high altitude (para 106c).
- t. Fuel quantity gauge indicated FULL when the UHF transmitter was keyed or the force trim button was actuated (para 106d).

RECOMMENDATIONS

110. The shortcomings, correction of which is desirable for the improvement of the helicopter mission capabilities, should be corrected as soon as possible.

111. The directional instability in hover should be improved on a priority basis.

112. A caution note should be placed in the operator's manual warning against hovering in tail winds in excess of 30 knots.

APPENDIX I. REFERENCES

1. Detail Specification, Bell Helicopter Company, 206-947-031, *Light Observation Helicopter*, Revision No. R-3, 15 January 1968.
2. Letter, AMCPM-LH-T, HQ, USAAVSCOM, subject: Test Directive, OH-58A Light Observation Helicopter Flight Test ATA Project No. 68-30, 7 August 1968.
3. Final Report, USAASTA, Project No. 68-30, *Airworthiness and Flight Qualification Test, Production OH-58A Helicopter, Unarmed and Armed with XM27E1 Weapon System, Performance*, June 1970.
4. Military Specification, MIL-H-8501A, *Helicopter Flying and Ground Handling Qualities; General Requirements For*, 7 September 1961, with Amendment 1, 3 April 1962.
5. Operator's Manual, TM 55-1520-228-10, *Army Model OH-58A Helicopter*, 30 June 1969, changed 1 November 1969.
6. Test Plan, USAASTA, Project No. 68-30, *Engineering Flight Test of the Production OH-58A Helicopter, Unarmed and Armed with XM27E1 Weapon Subsystem*, May 1969.

APPENDIX II. TEST INSTRUMENTATION

Sensitive instruments were installed in the test helicopter and were maintained by the Instrumentation Branch of USAASTA. The following parameters were recorded:

Pilot and Engineer Panels

Airspeed (boom system)
Altitude (boom system)
Angle of sideslip
Rotor speed
CG normal acceleration
Free air temperature
Longitudinal cyclic stick position
Lateral cyclic stick position
Collective stick position
Rudder pedal position
Total fuel used
Oscillograph coordination counter

Oscillograph

Longitudinal cyclic stick force
Lateral cyclic stick force
Collective stick force
Rudder pedal force
Longitudinal cyclic stick position
Lateral cyclic stick position
Collective stick position
Rudder pedal position
Pitch attitude
Roll attitude
Yaw attitude
Pitch rate
Roll rate
Yaw rate
Pitch angular acceleration
Roll angular acceleration
Yaw angular acceleration
CG normal acceleration
Angle of attack
Angle of sideslip
Linear rotor speed
Rotor blip
Torque pressure

Throttle position
Engineer event
Pilot event
Pilot vertical vibration
 (FS = 73 in., WL = 29 in., butt line (BL) = 15 in.)
Pilot lateral vibration
 (FS = 73 in., WL = 29 in., BL = 15 in.)
Passenger vertical vibration
 (FS = 108 in., WL = 32 in., BL = 0 in.)
Passenger lateral vibration
 (FS = 108 in., WL = 32 in., BL = 0 in.)
Gun position
Rate of fire

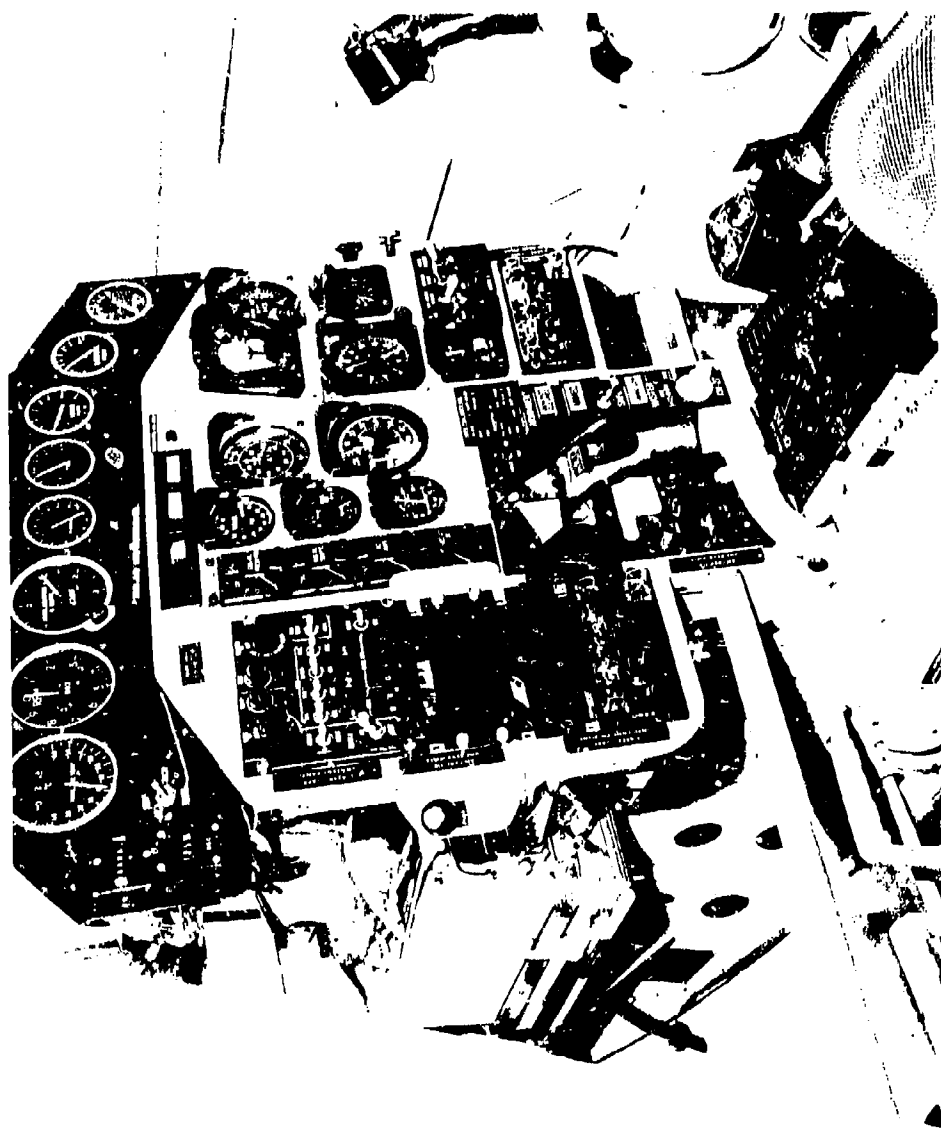


Photo A. Instrument Panel.

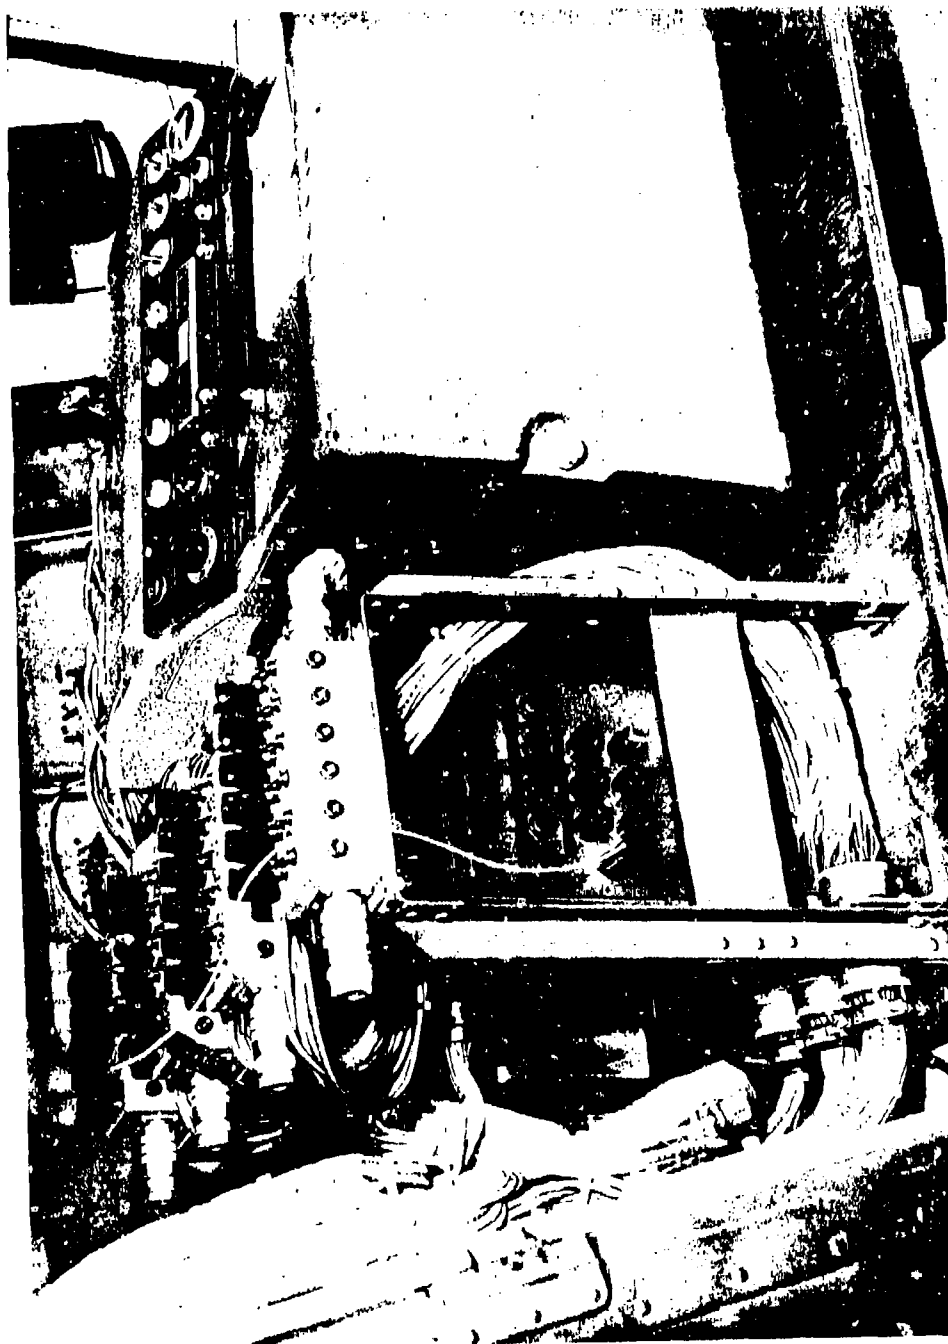


Photo B. Oscillograph Installation.


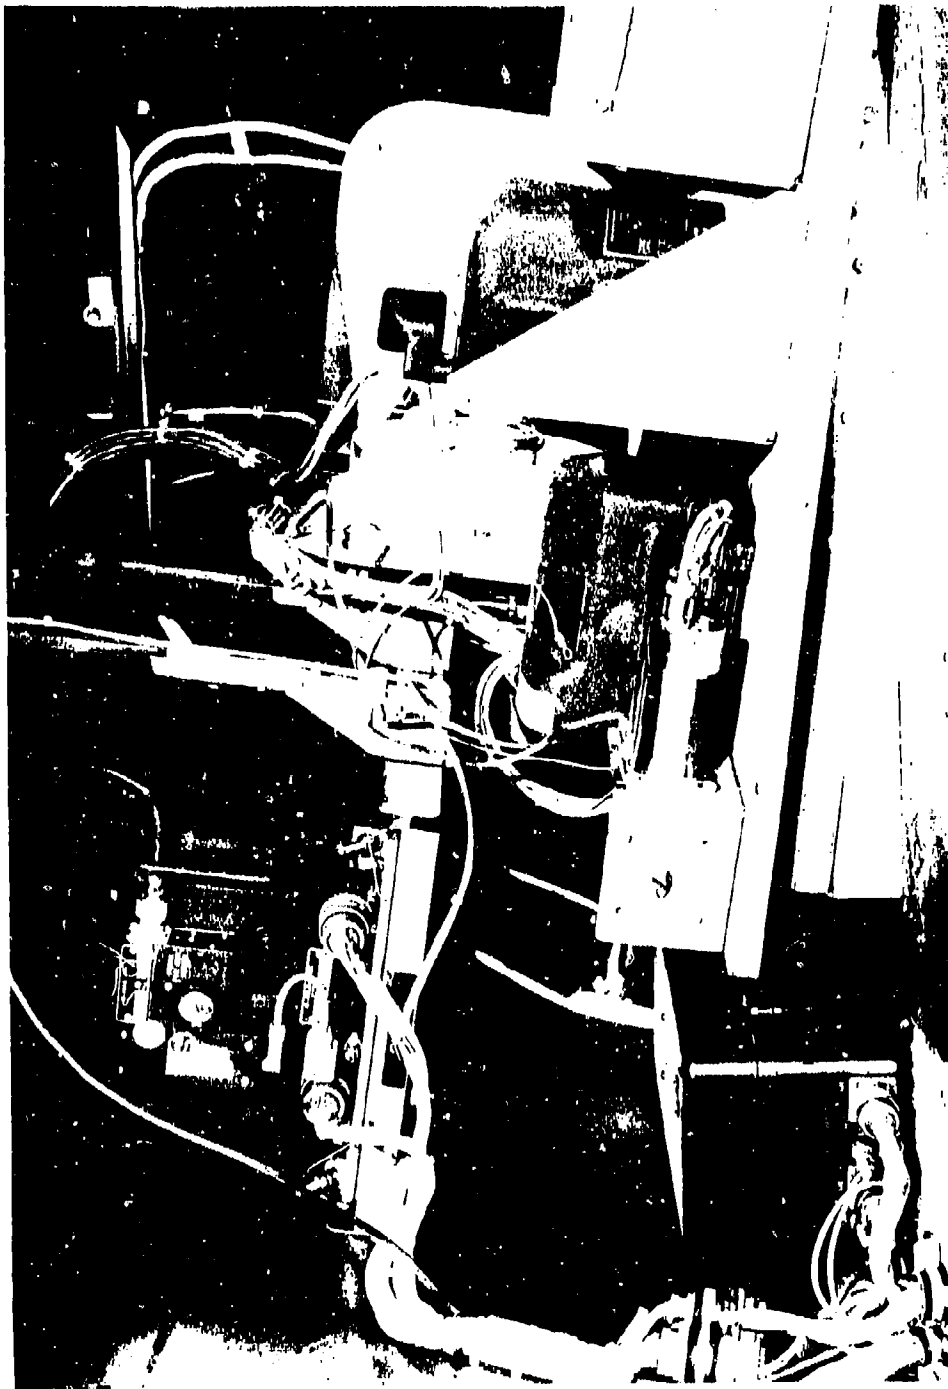


Photo C. Attitude Gyros, Rate Gyros and Angular Accelerometers.

APPENDIX III. HANDLING QUALITIES RATING SCALE

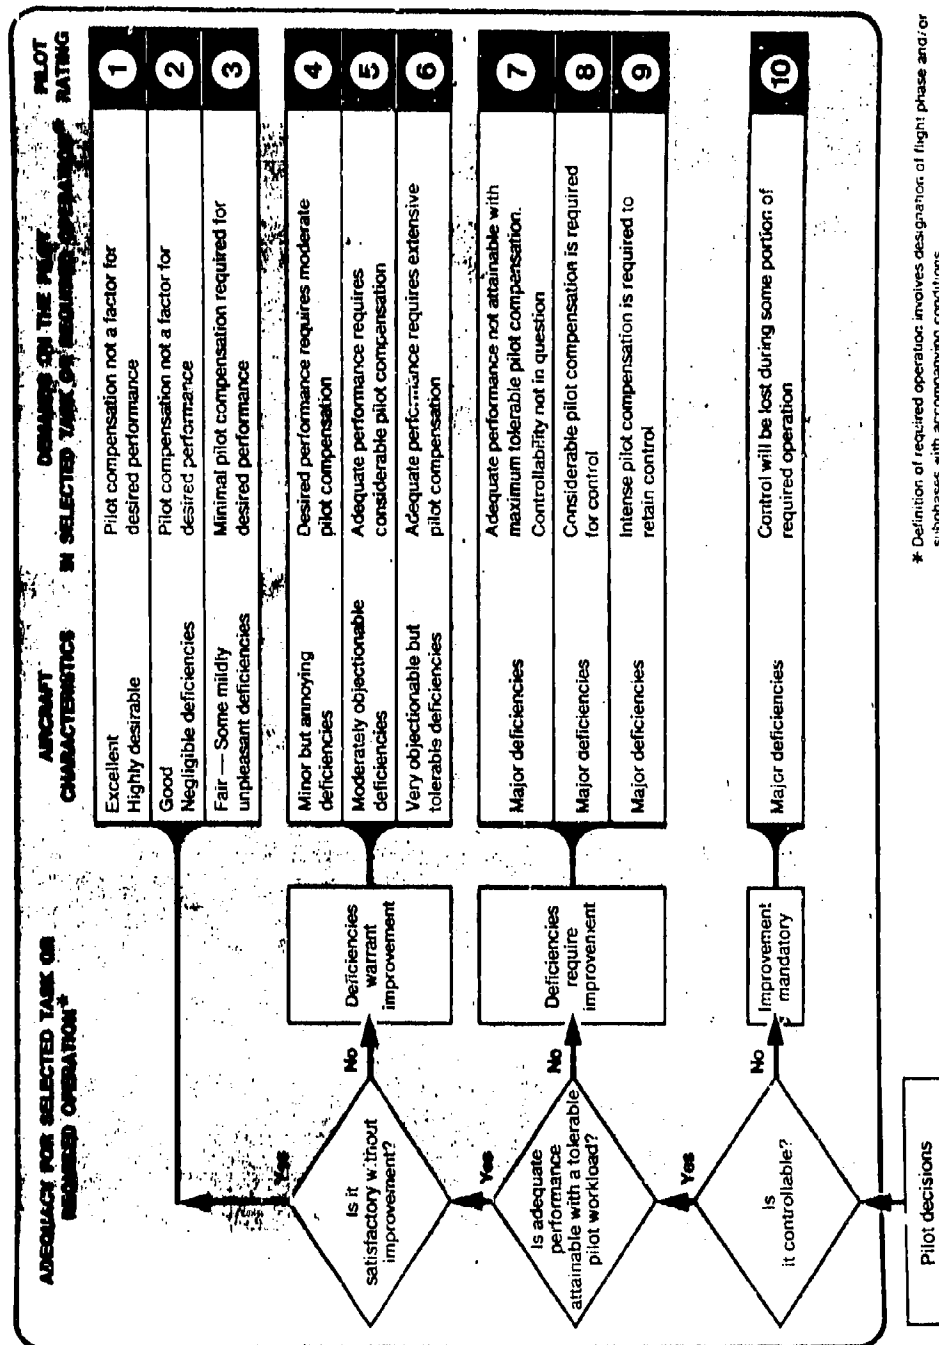

APPENDIX IV. TEST DATA

11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525
 526
 527
 528
 529
 530
 531
 532
 533

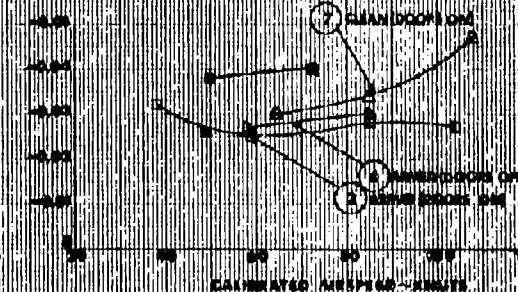
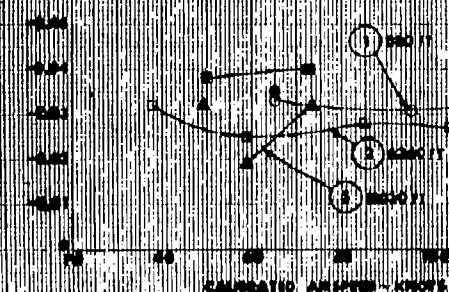
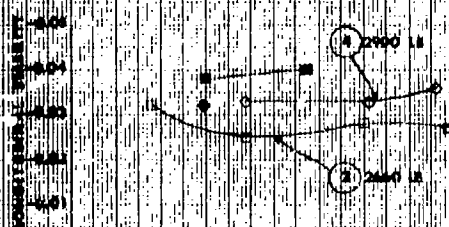
[illegible]

FIGURE 2
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

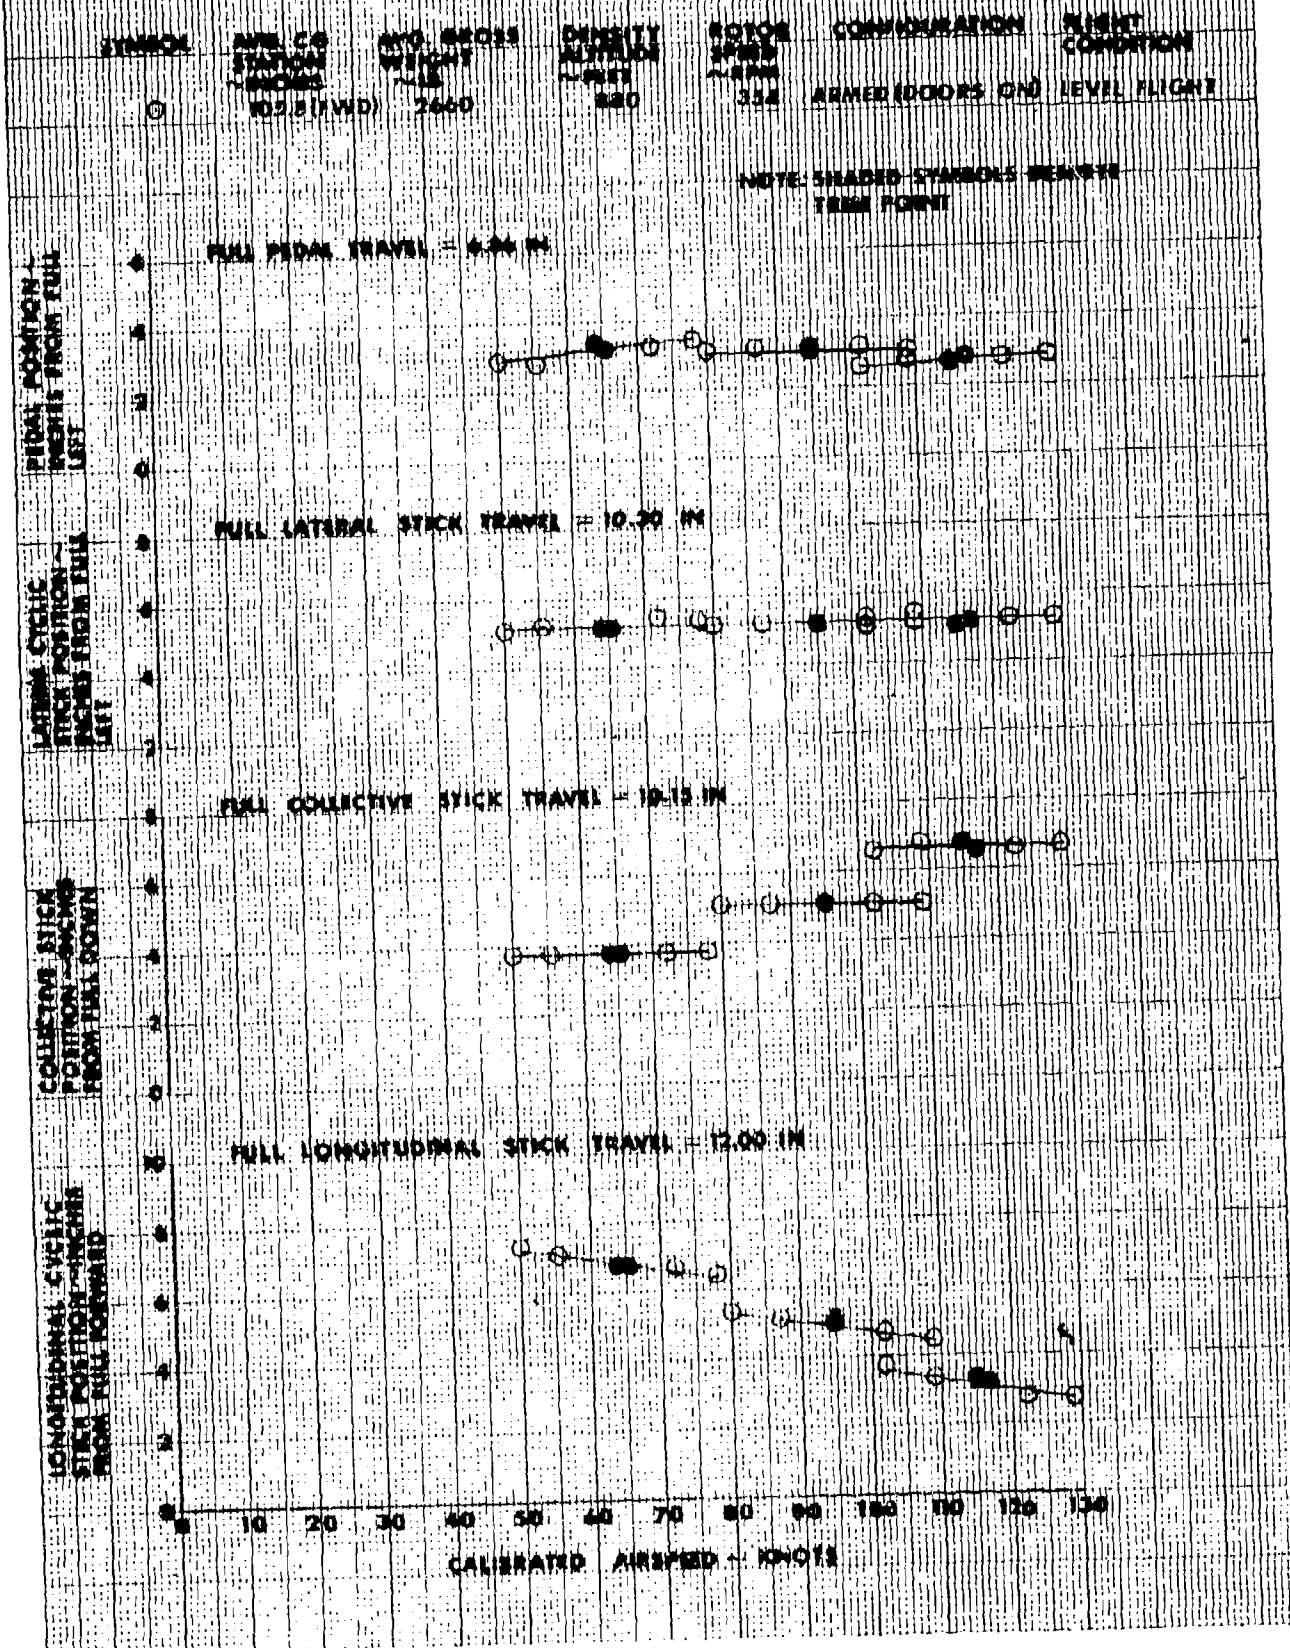


FIGURE 3
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-55A USA S/N 48-14704

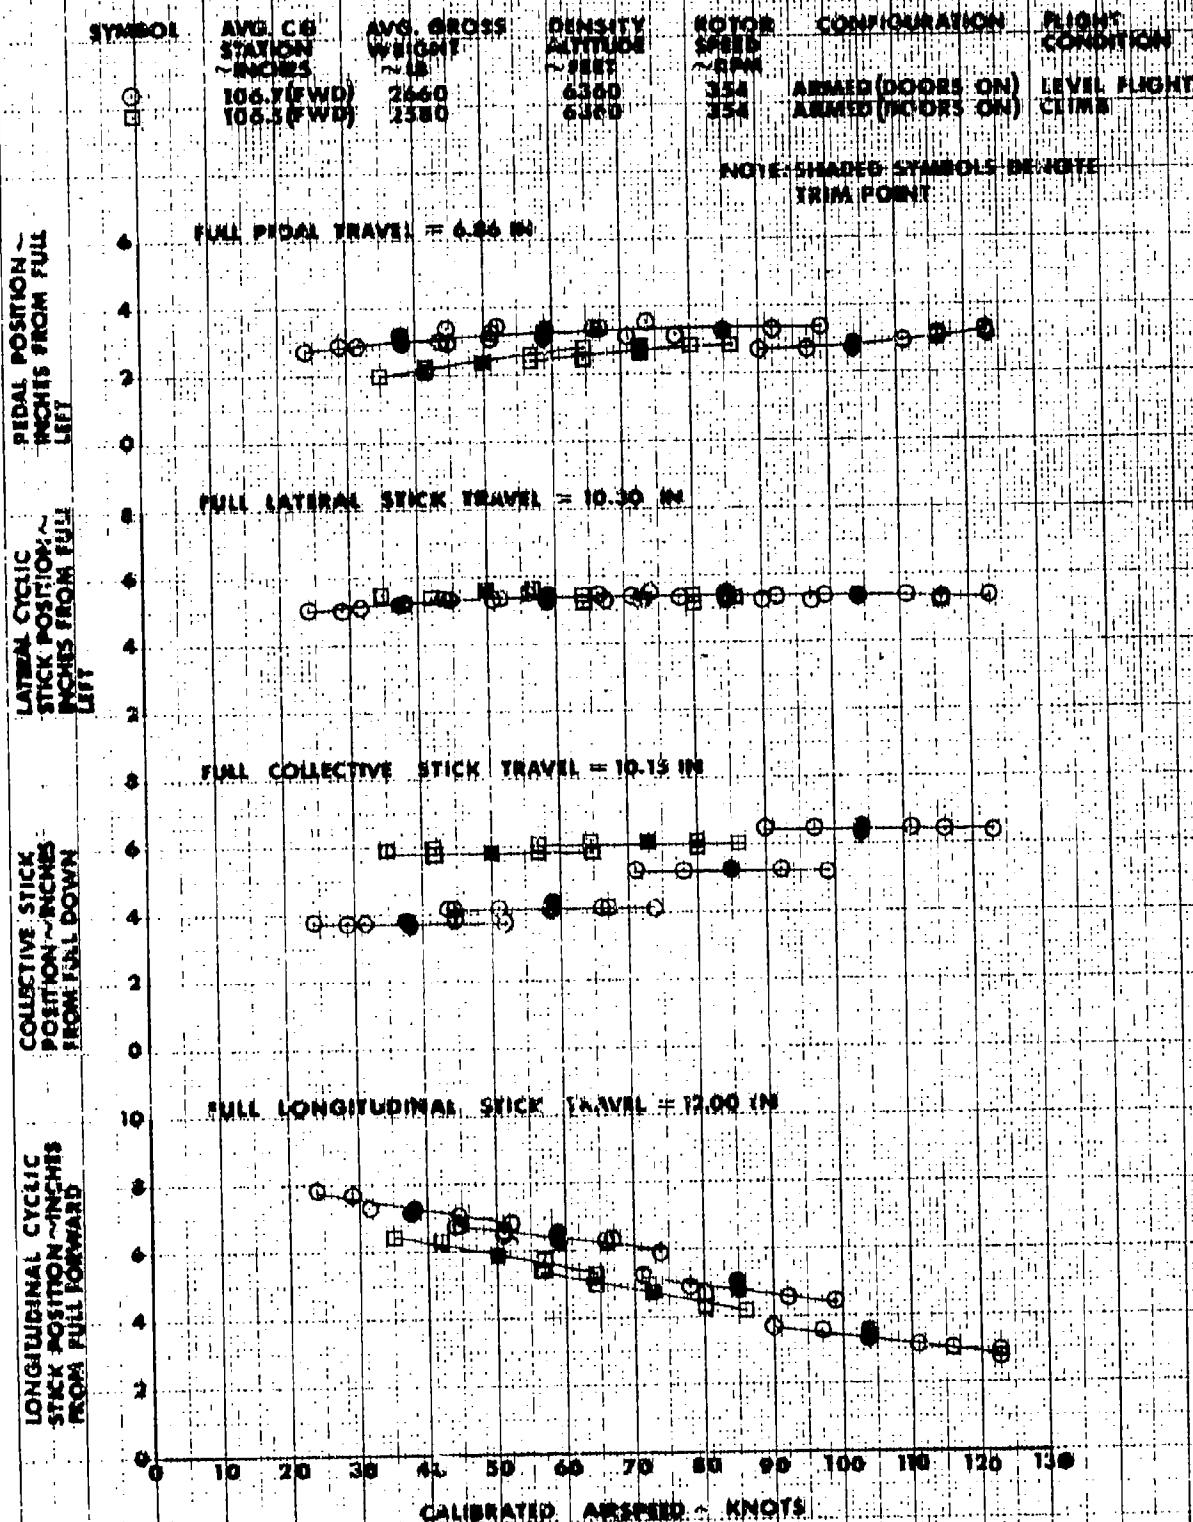


FIGURE 4
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

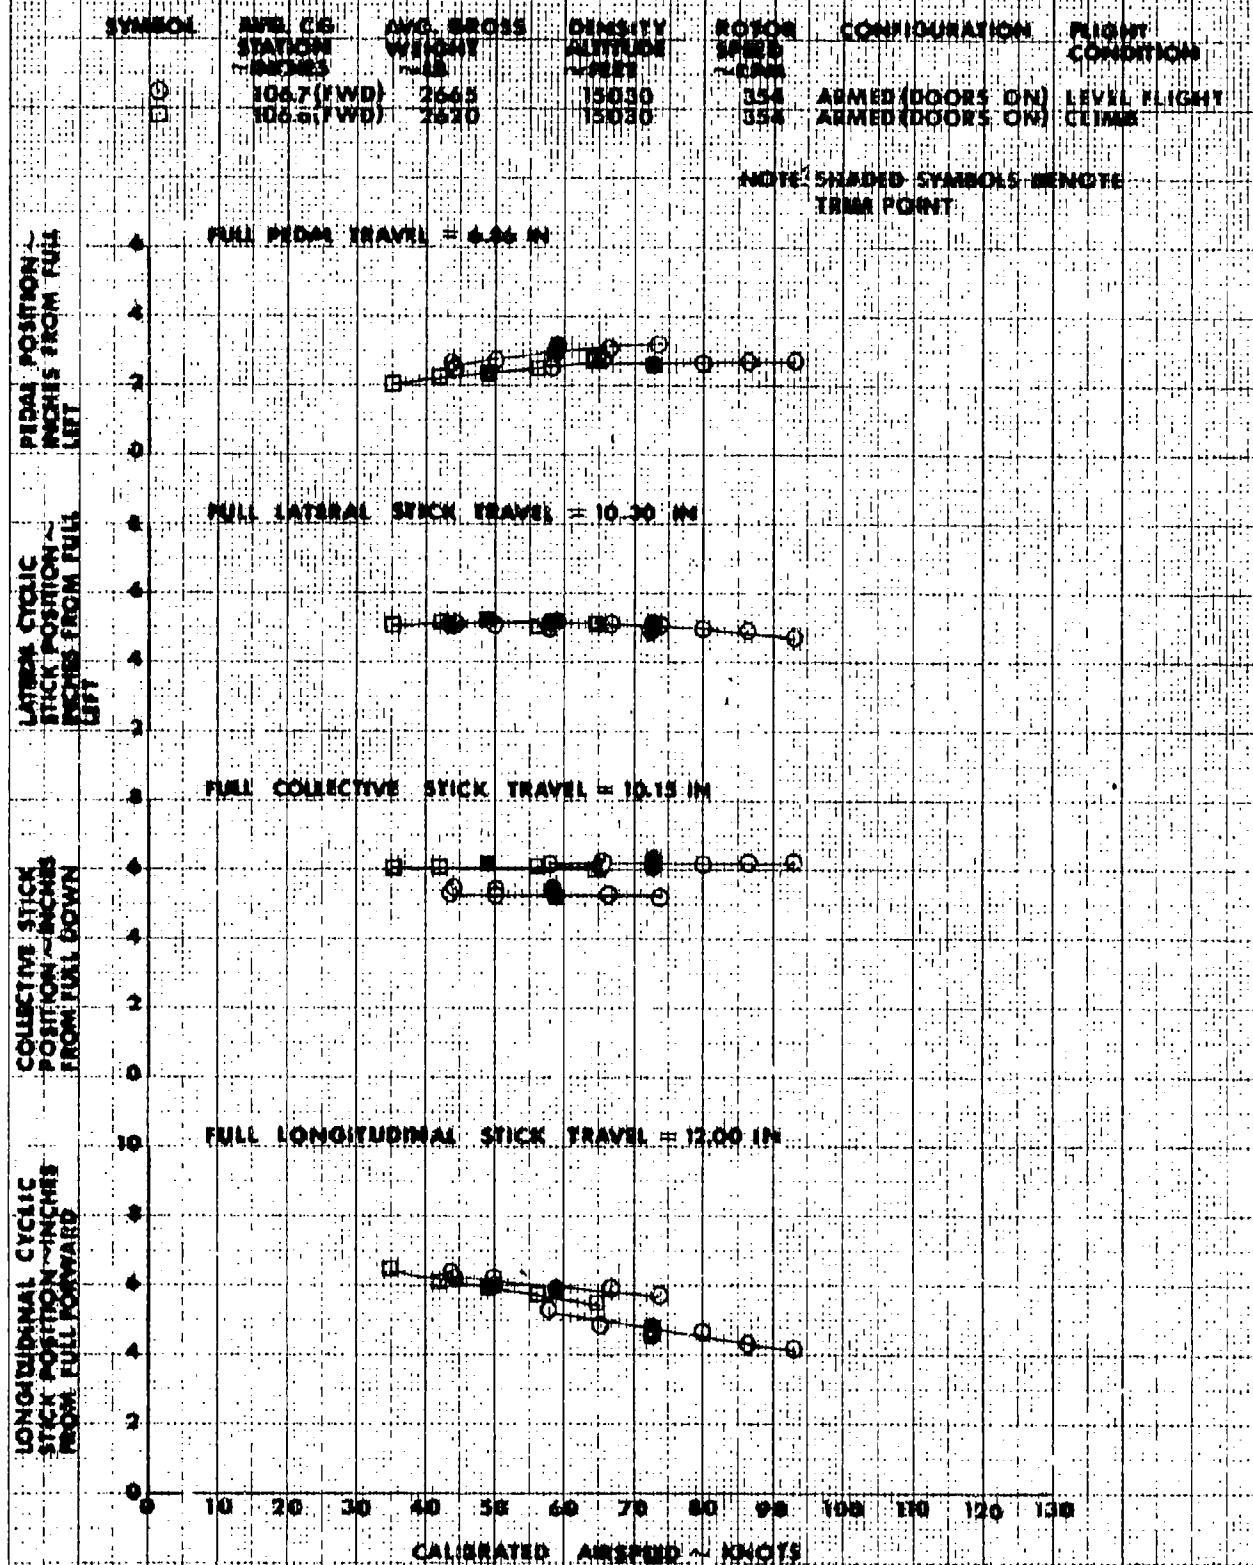


FIGURE 5
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

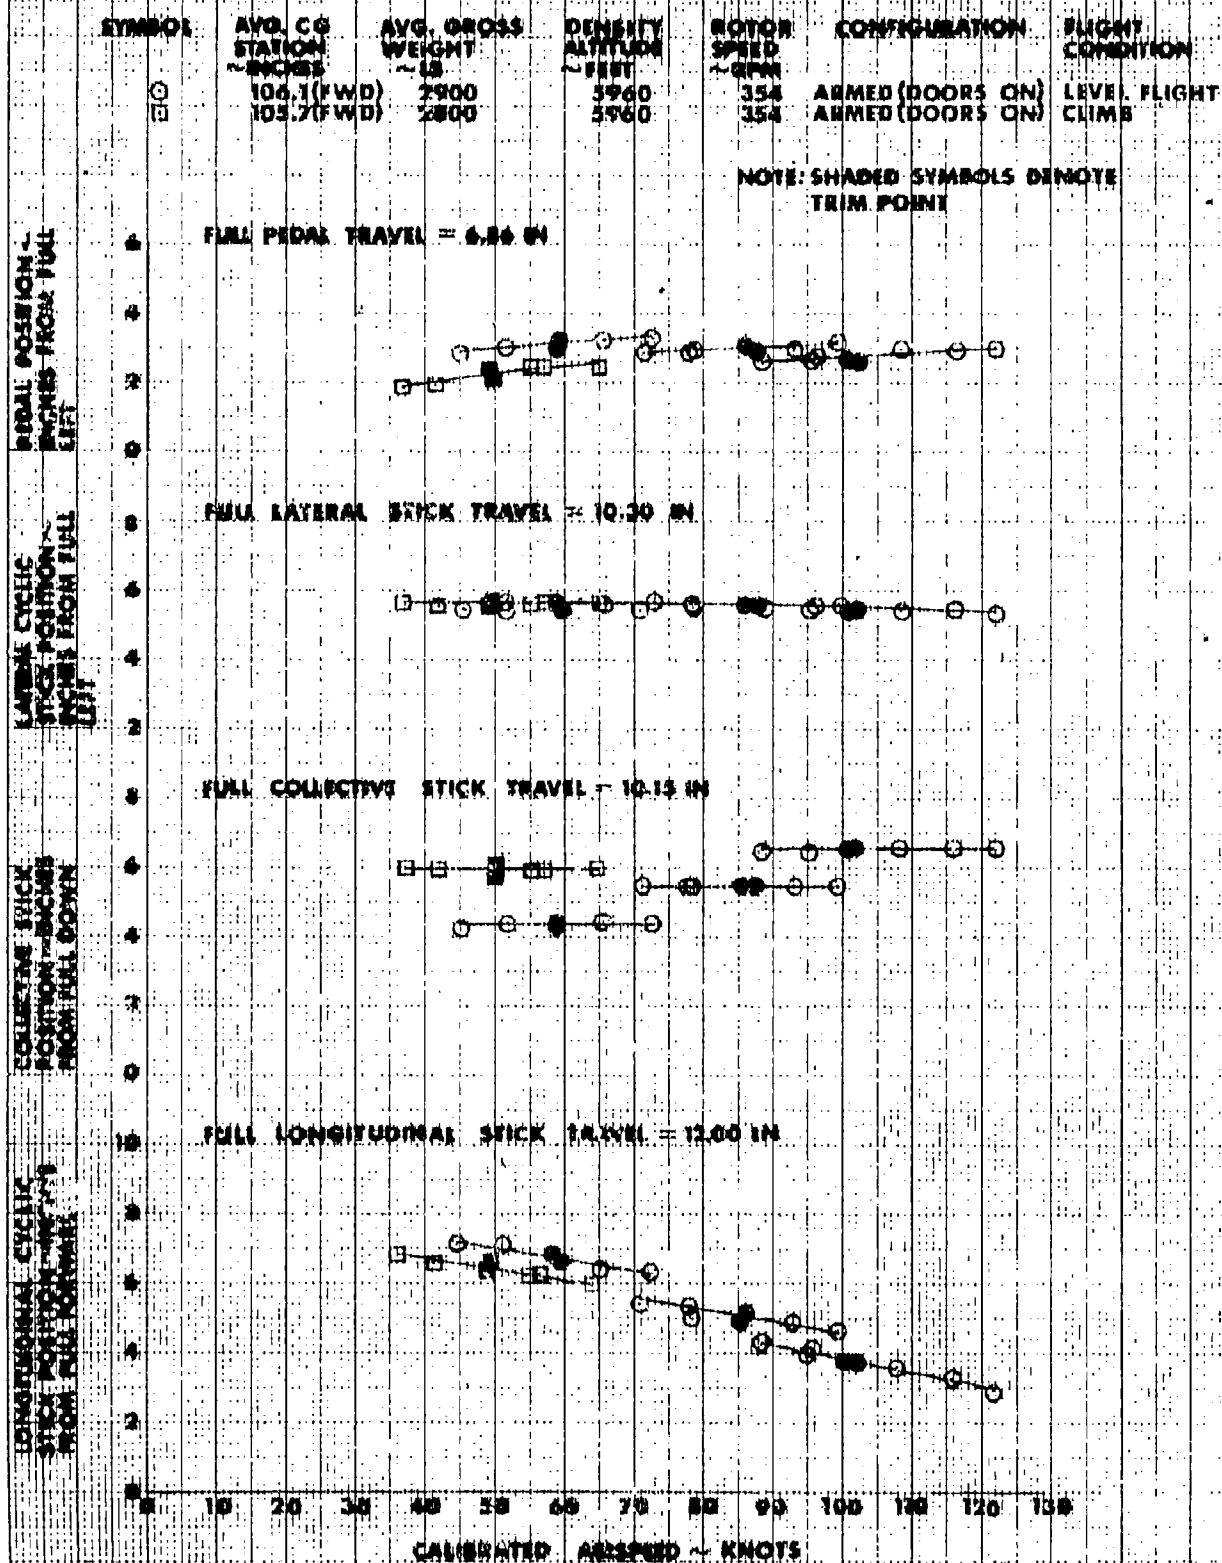


FIGURE 6
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

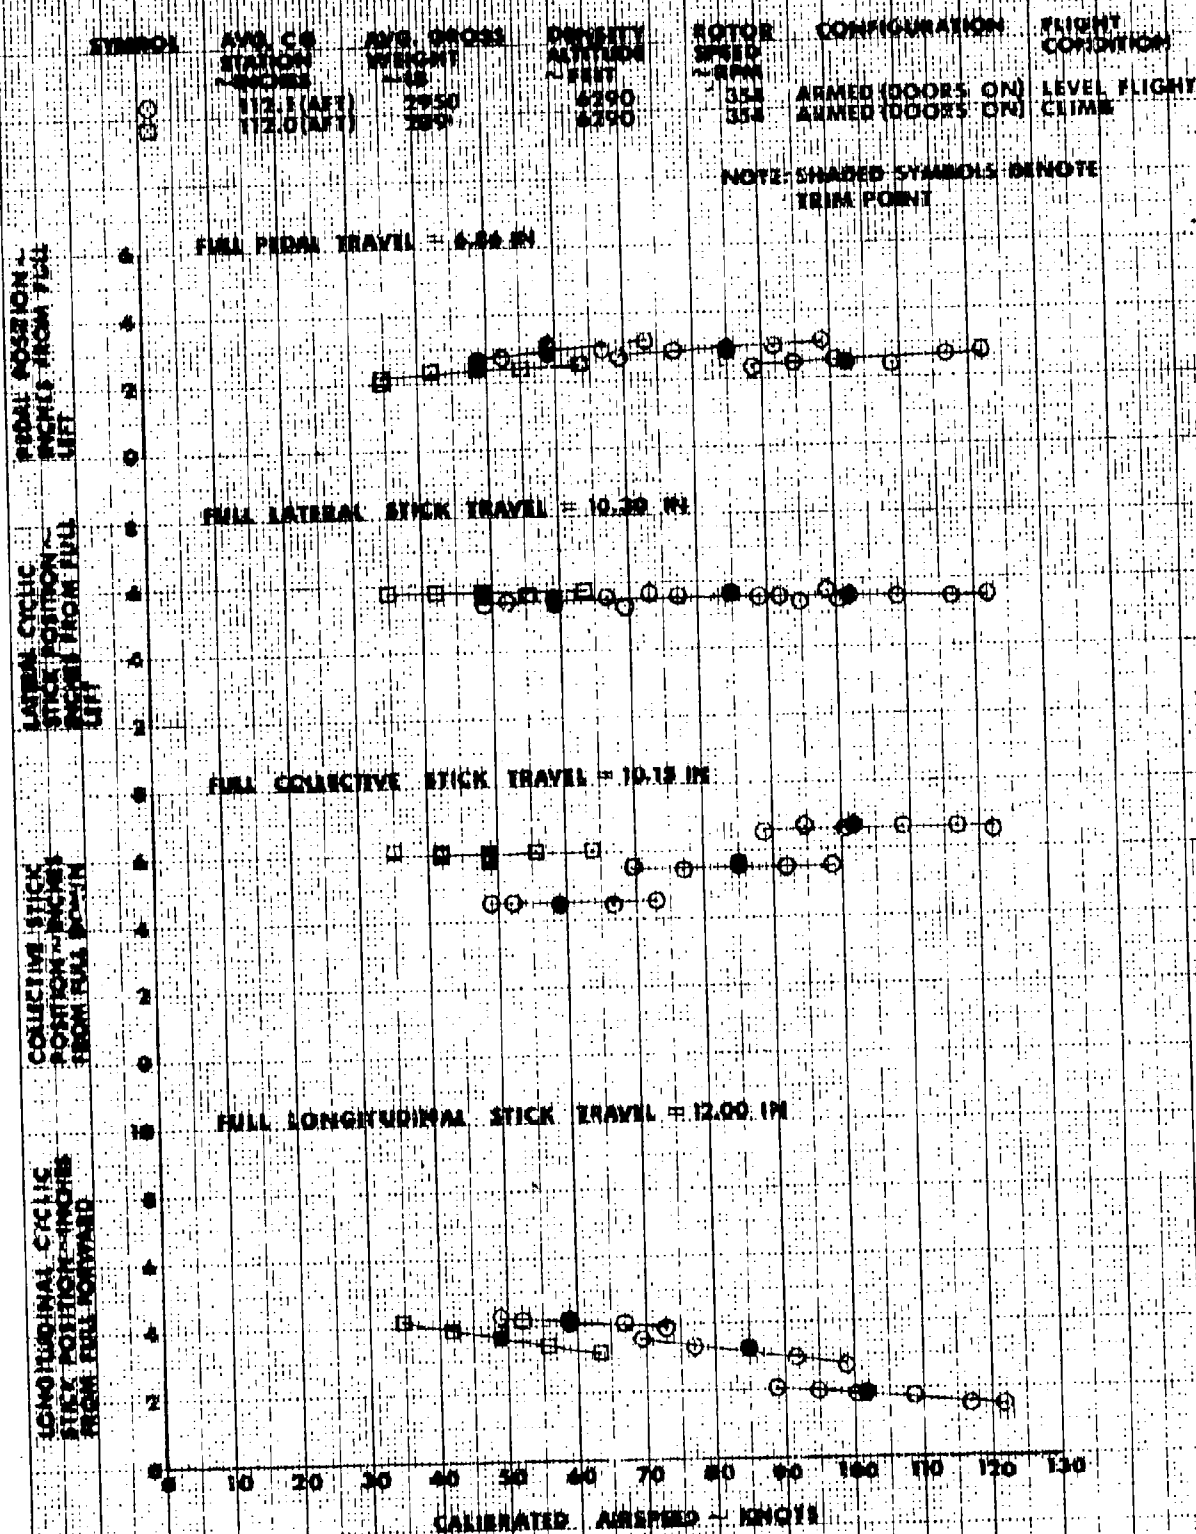


FIGURE 7
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

SYMBOL	AVG. CG STATION ~INCHES	AVG. GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FEET	ROTOR SPEED ~RPM	CONFIGURATION	FLIGHT CONDITION
□	308.2 (FWD)	2680	6090	354	ARMED (DOORS OFF)	LEVEL FLIGHT
●	305.4 (FWD)	2630	6090	354	ARMED (DOORS OFF)	CLIMB

NOTE: SHADED SYMBOLS DENOTE TRIM POINT

PEDAL POSITION -
INCHES FROM FULL
LEFT

FULL PEDAL TRAVEL = 6.86 IN

LARSEN CYCLIC
STICK POSITION -
INCHES FROM FULL
LEFT

FULL LATERAL STICK TRAVEL = 10.30 IN

COLLECTIVE STICK
POSITION - INCHES
FROM FULL DOWN

FULL COLLECTIVE STICK TRAVEL = 10.15 IN

LONGITUDINAL CYCLIC
STICK POSITION - INCHES
FROM FULL FORWARD

FULL LONGITUDINAL STICK TRAVEL = 12.00 IN

CALIBRATED AIRSPEED - KNOTS

FIGURE 8
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

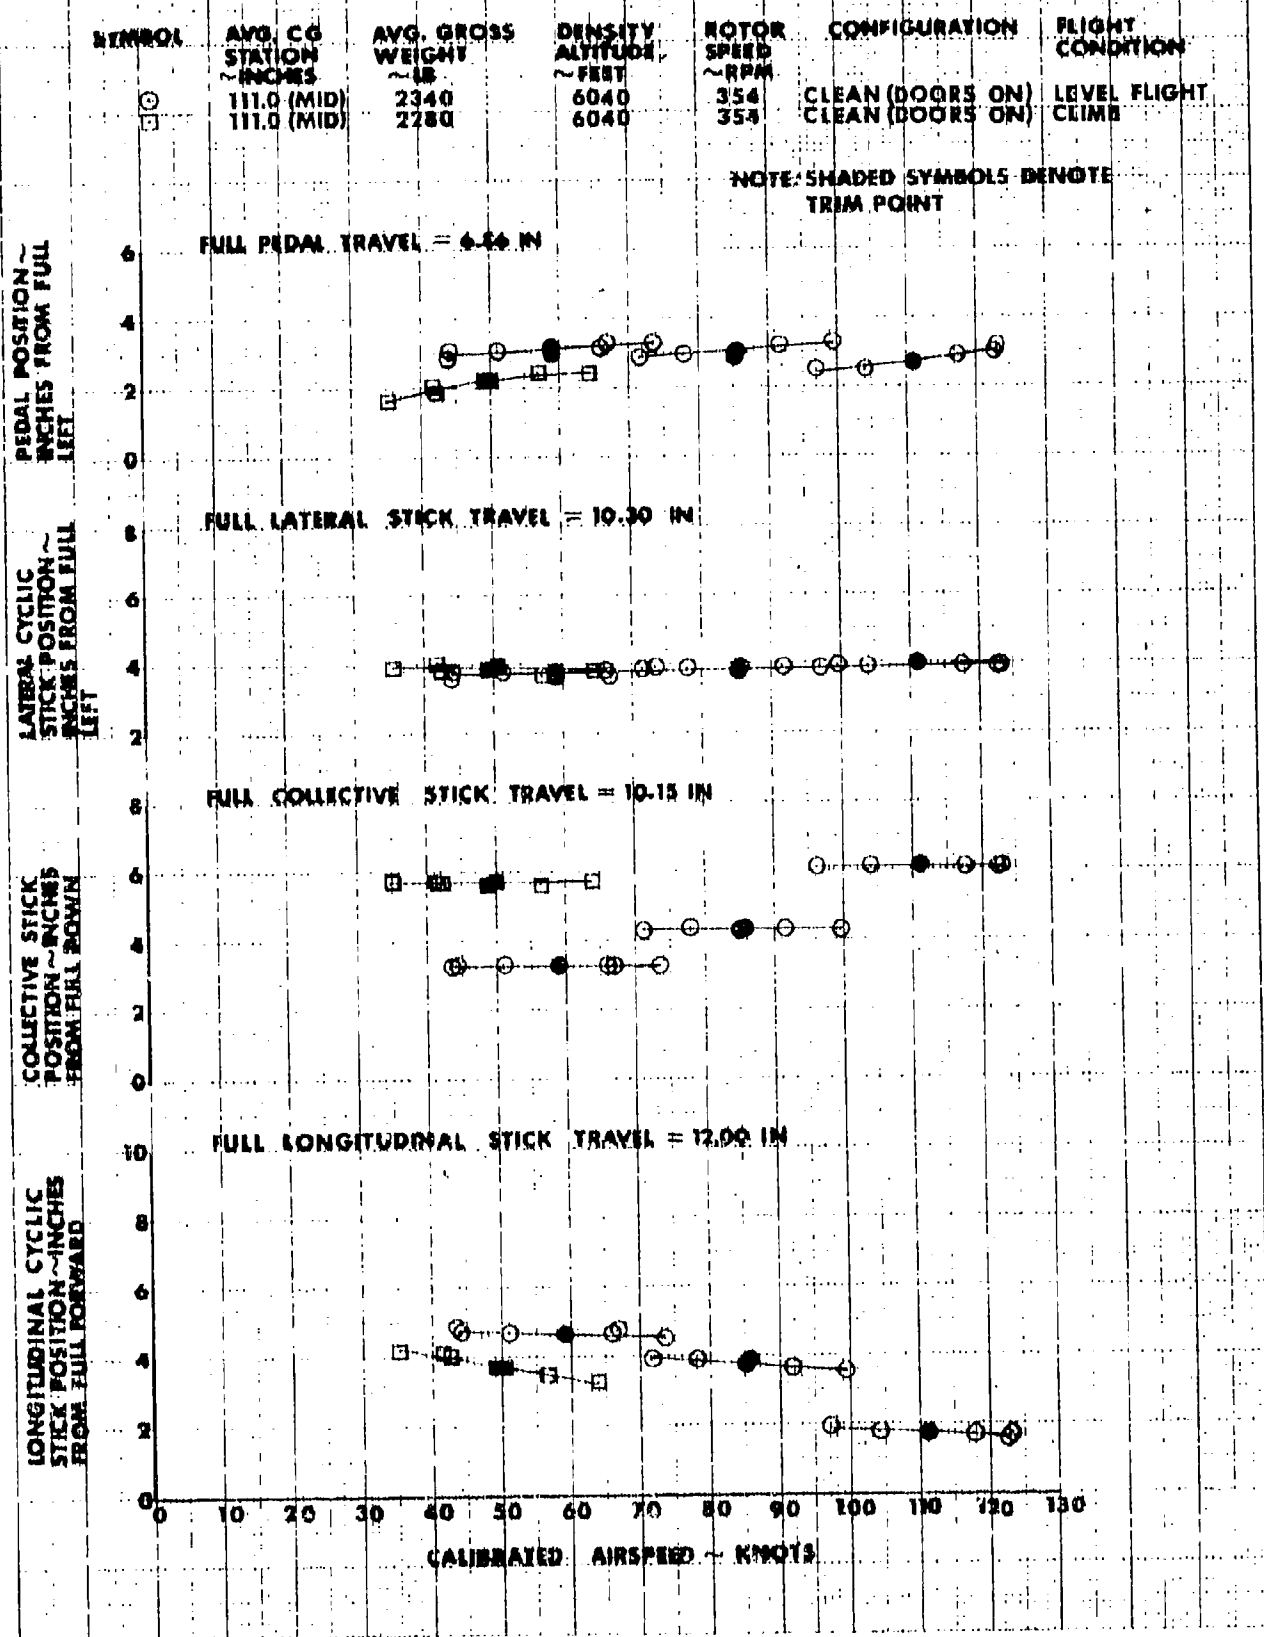


FIGURE 9
STATIC LONGITUDINAL COLLECTIVE FIXED STABILITY
OH-58A USA S/N 68-16706

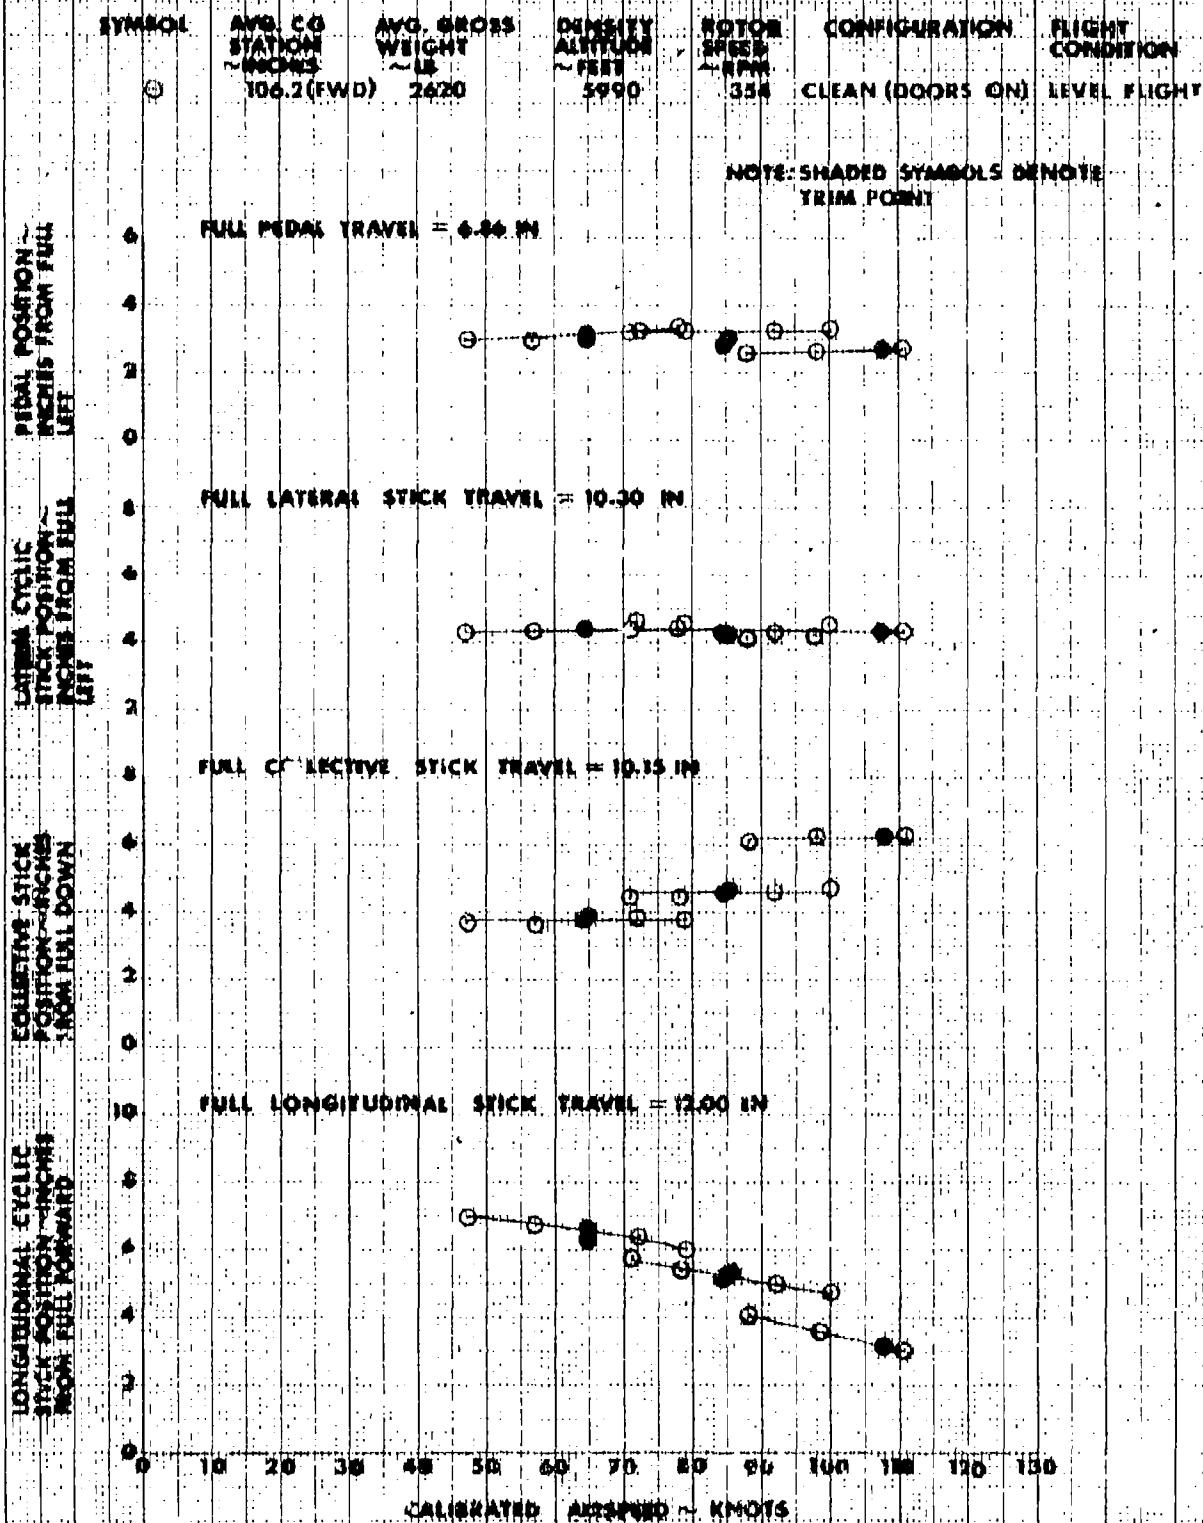


FIGURE 10 SUMMARY LONGITUDINAL CONTROL GRADIENTS ON 244 ULR FOR 10-10-10-10

CASE NUMBER	STATION NUMBER	STATION NAME	WEIGHT (LBS)	HEIGHT (FT)	CONFIGURATION	FLIGHT CONDITION
1	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
2	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
3	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
4	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
5	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
6	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
7	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
8	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
9	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
10	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
11	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
12	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
13	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
14	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
15	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
16	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
17	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
18	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
19	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
20	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
21	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
22	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
23	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
24	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
25	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
26	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
27	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
28	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
29	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
30	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
31	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
32	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
33	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
34	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
35	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
36	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
37	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
38	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
39	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
40	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
41	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
42	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
43	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
44	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
45	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
46	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
47	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
48	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
49	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
50	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
51	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
52	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
53	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
54	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
55	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
56	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
57	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
58	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
59	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
60	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
61	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
62	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
63	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
64	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
65	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
66	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
67	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
68	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
69	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
70	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
71	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
72	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
73	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
74	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
75	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
76	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
77	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
78	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
79	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
80	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
81	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
82	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
83	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
84	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
85	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
86	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
87	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
88	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
89	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
90	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
91	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
92	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
93	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
94	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
95	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
96	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
97	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
98	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
99	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT
100	100	100	100	100	ARMED (DOORS ON)	LEVEL FLIGHT

NOTE: CURVES DERIVED FROM FIGURE 11 THROUGH 14
2. NEGATIVE GRADIENTS INDICATE FORWARD STICK MOVEMENT WITH INCREASING AIRSPEED

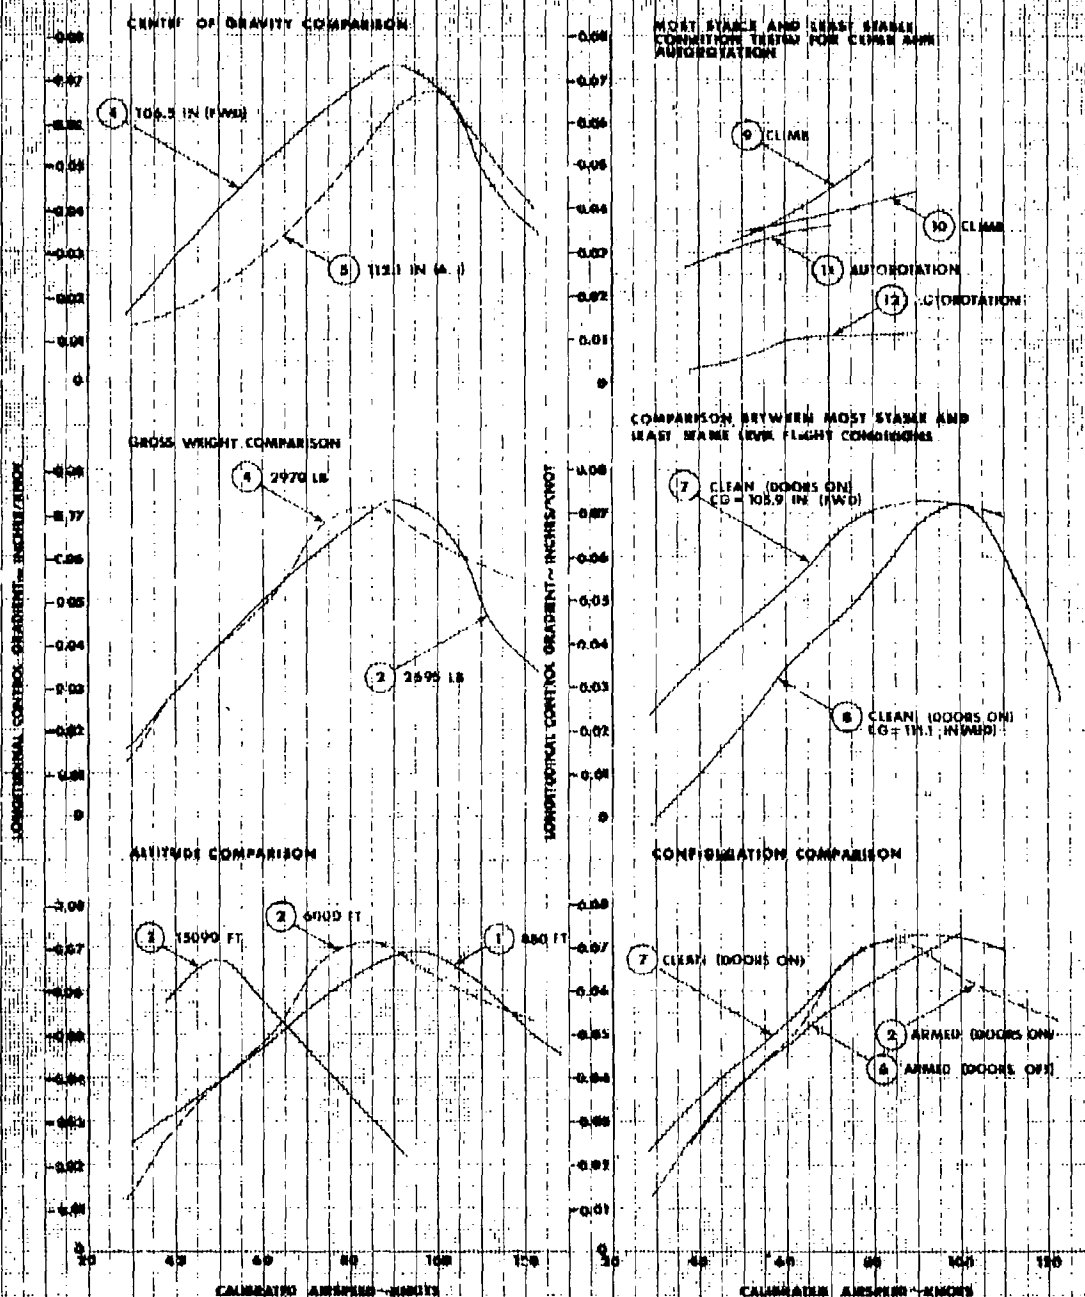


FIGURE 11
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 68-16706

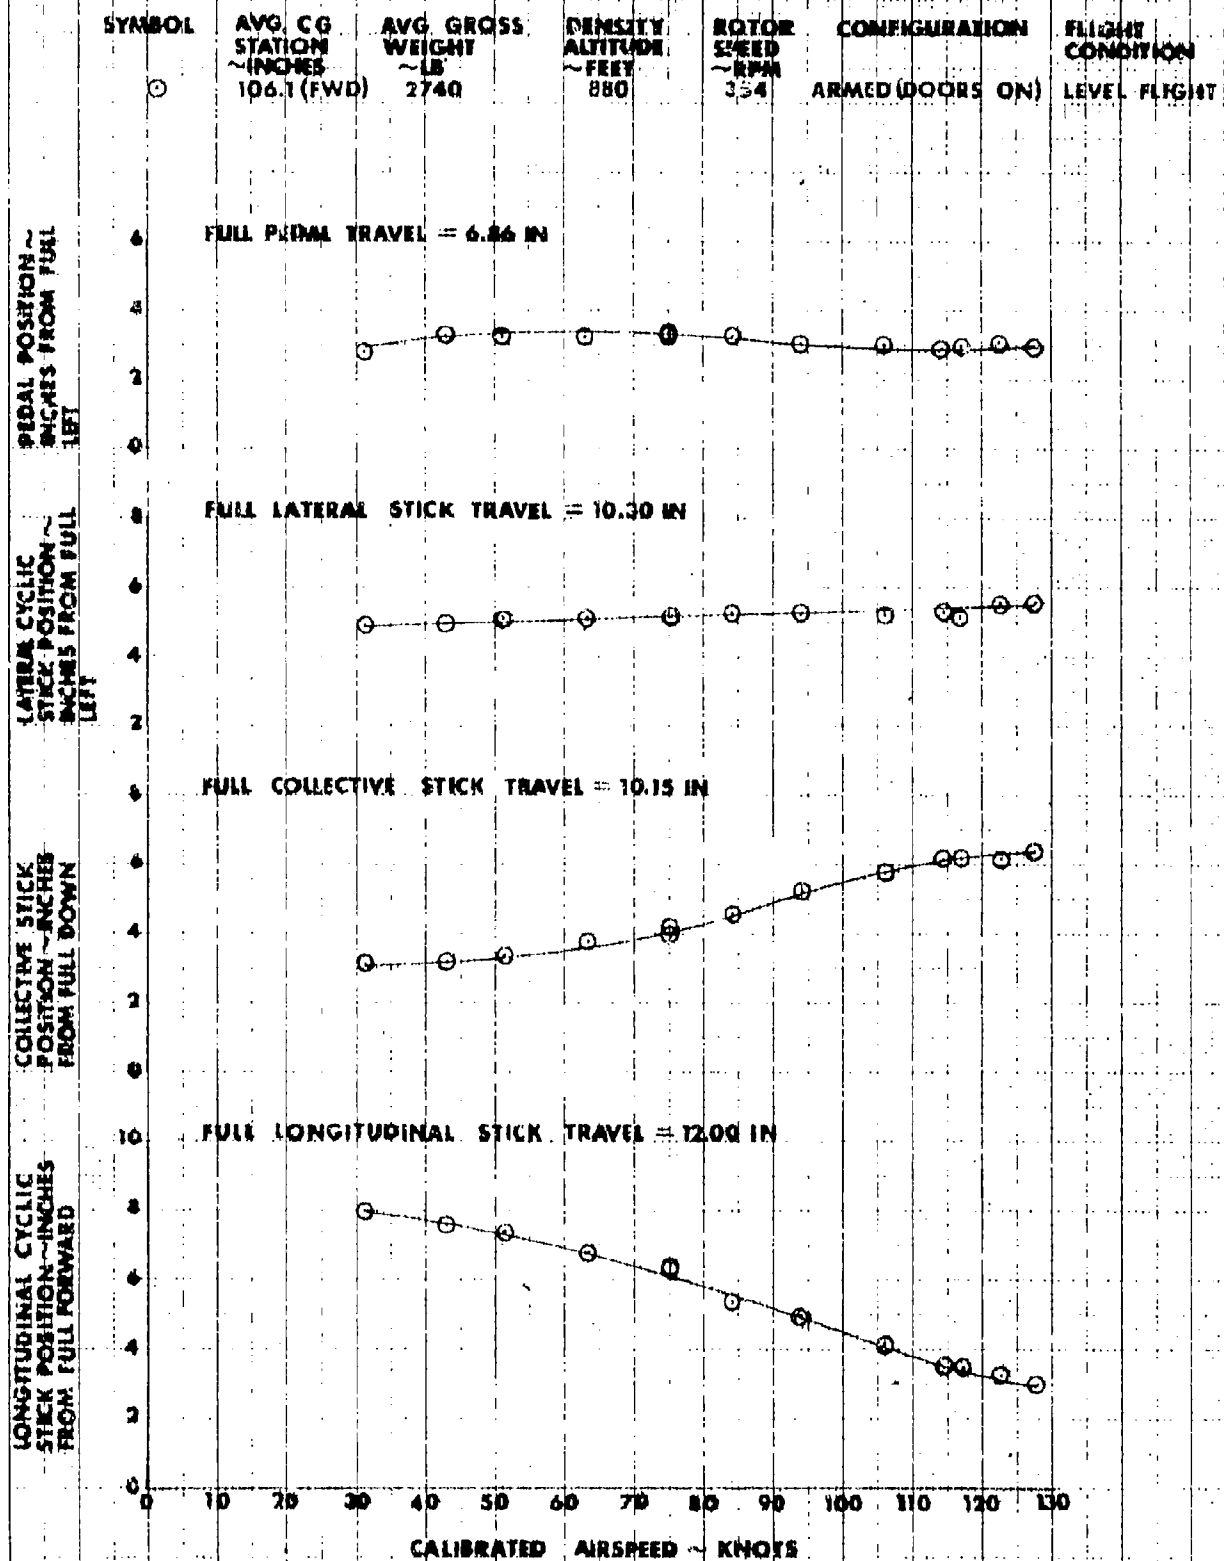


FIGURE 12
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 45-16706

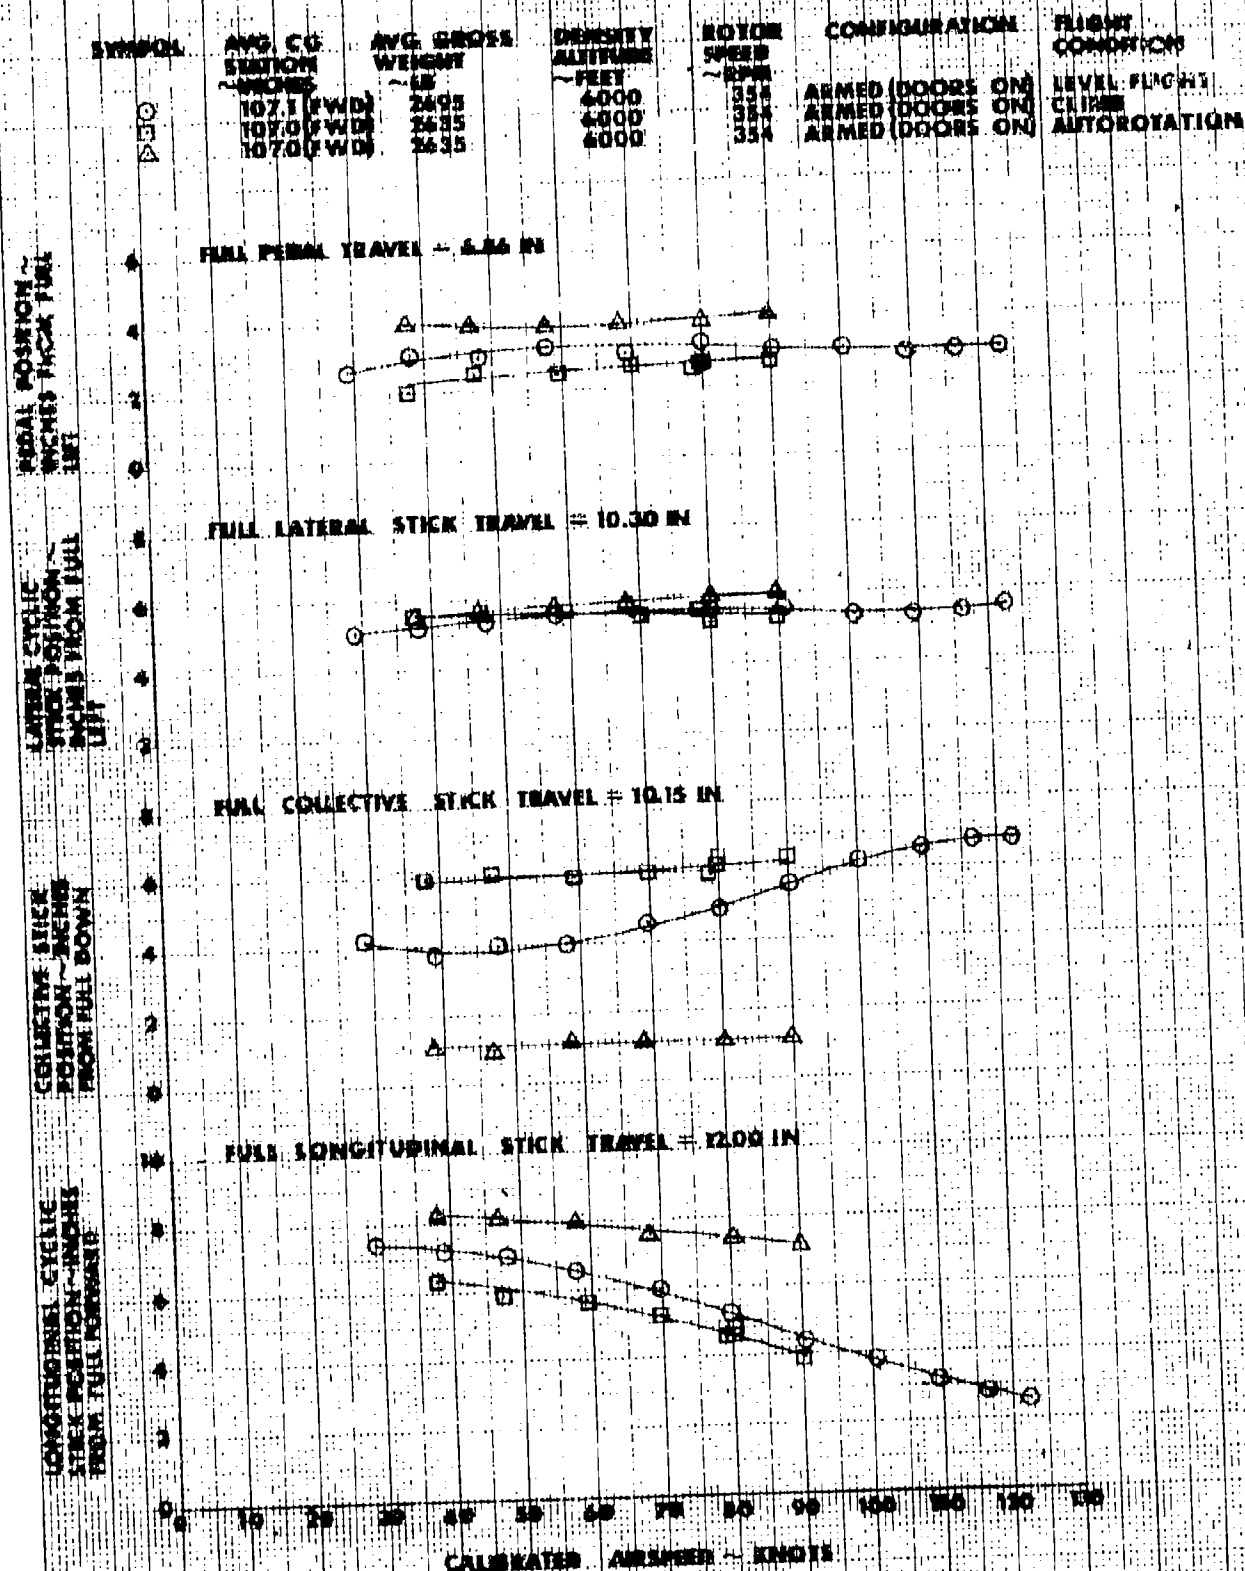


FIGURE 13
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 68-16706

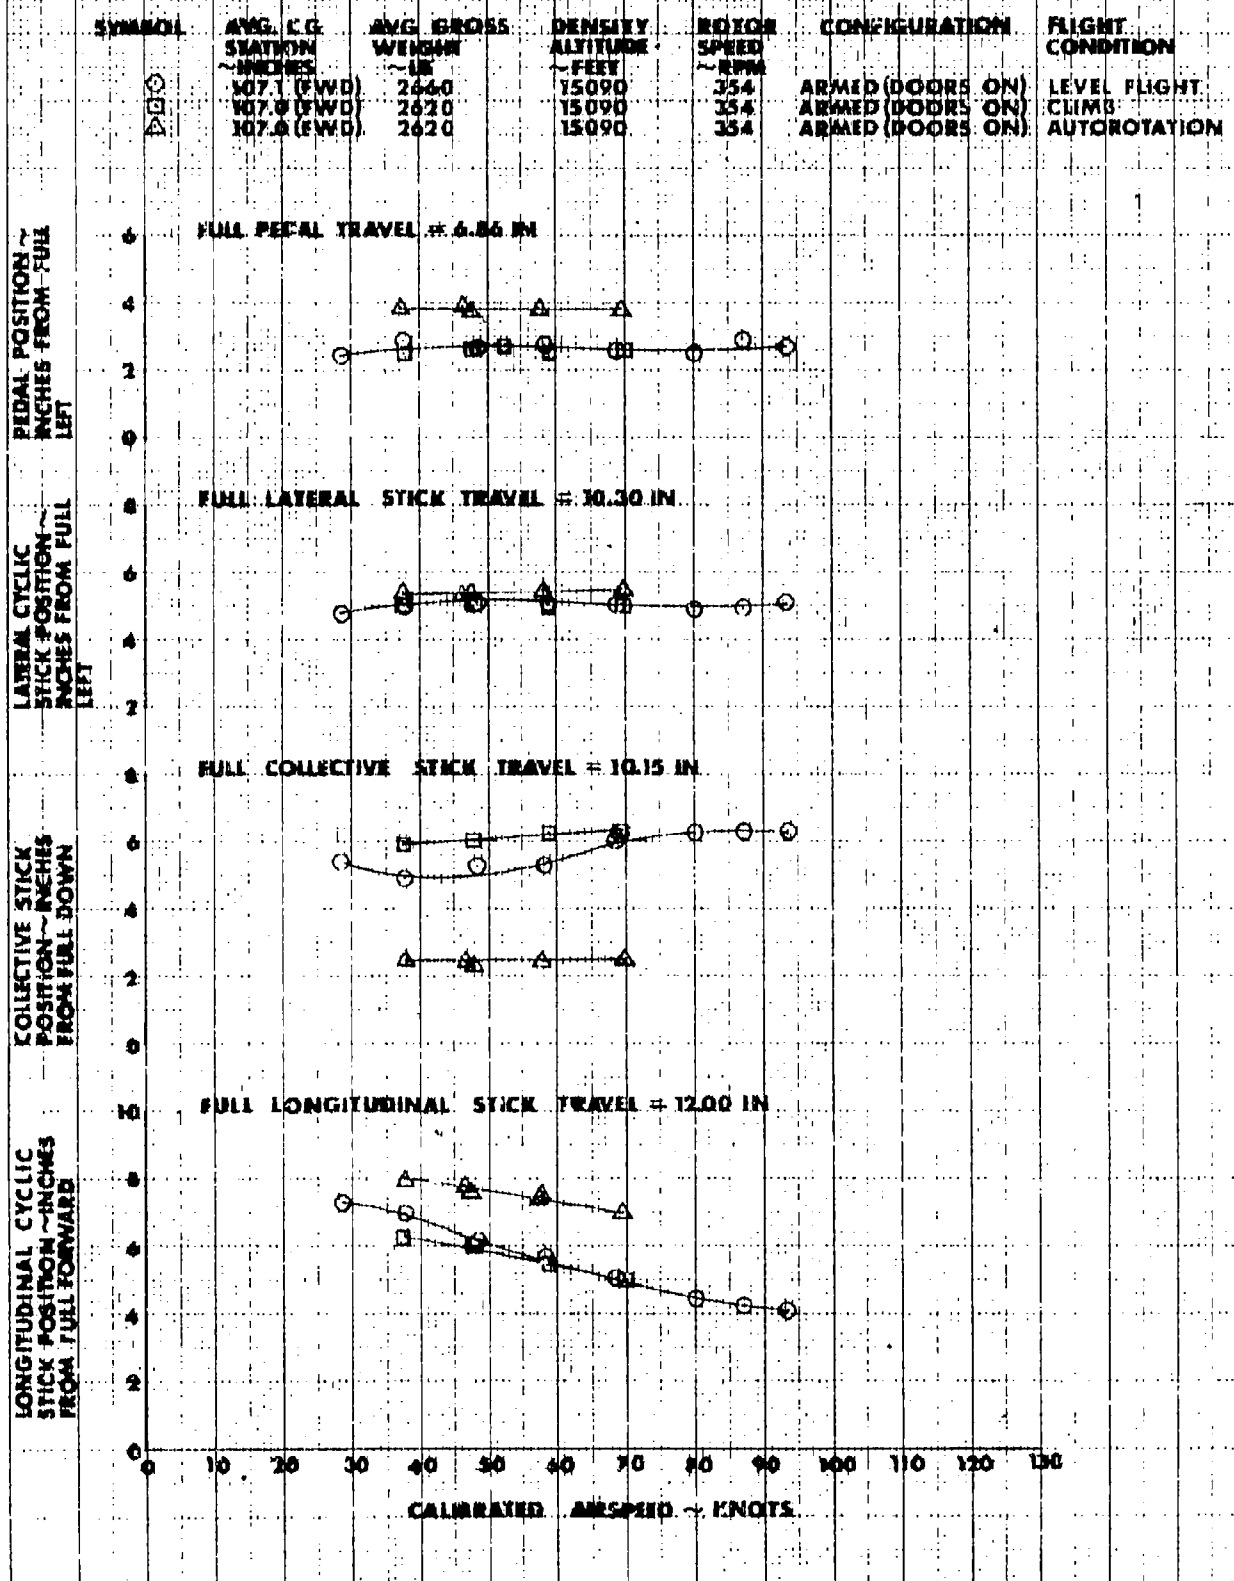


FIGURE 14
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 68-16704

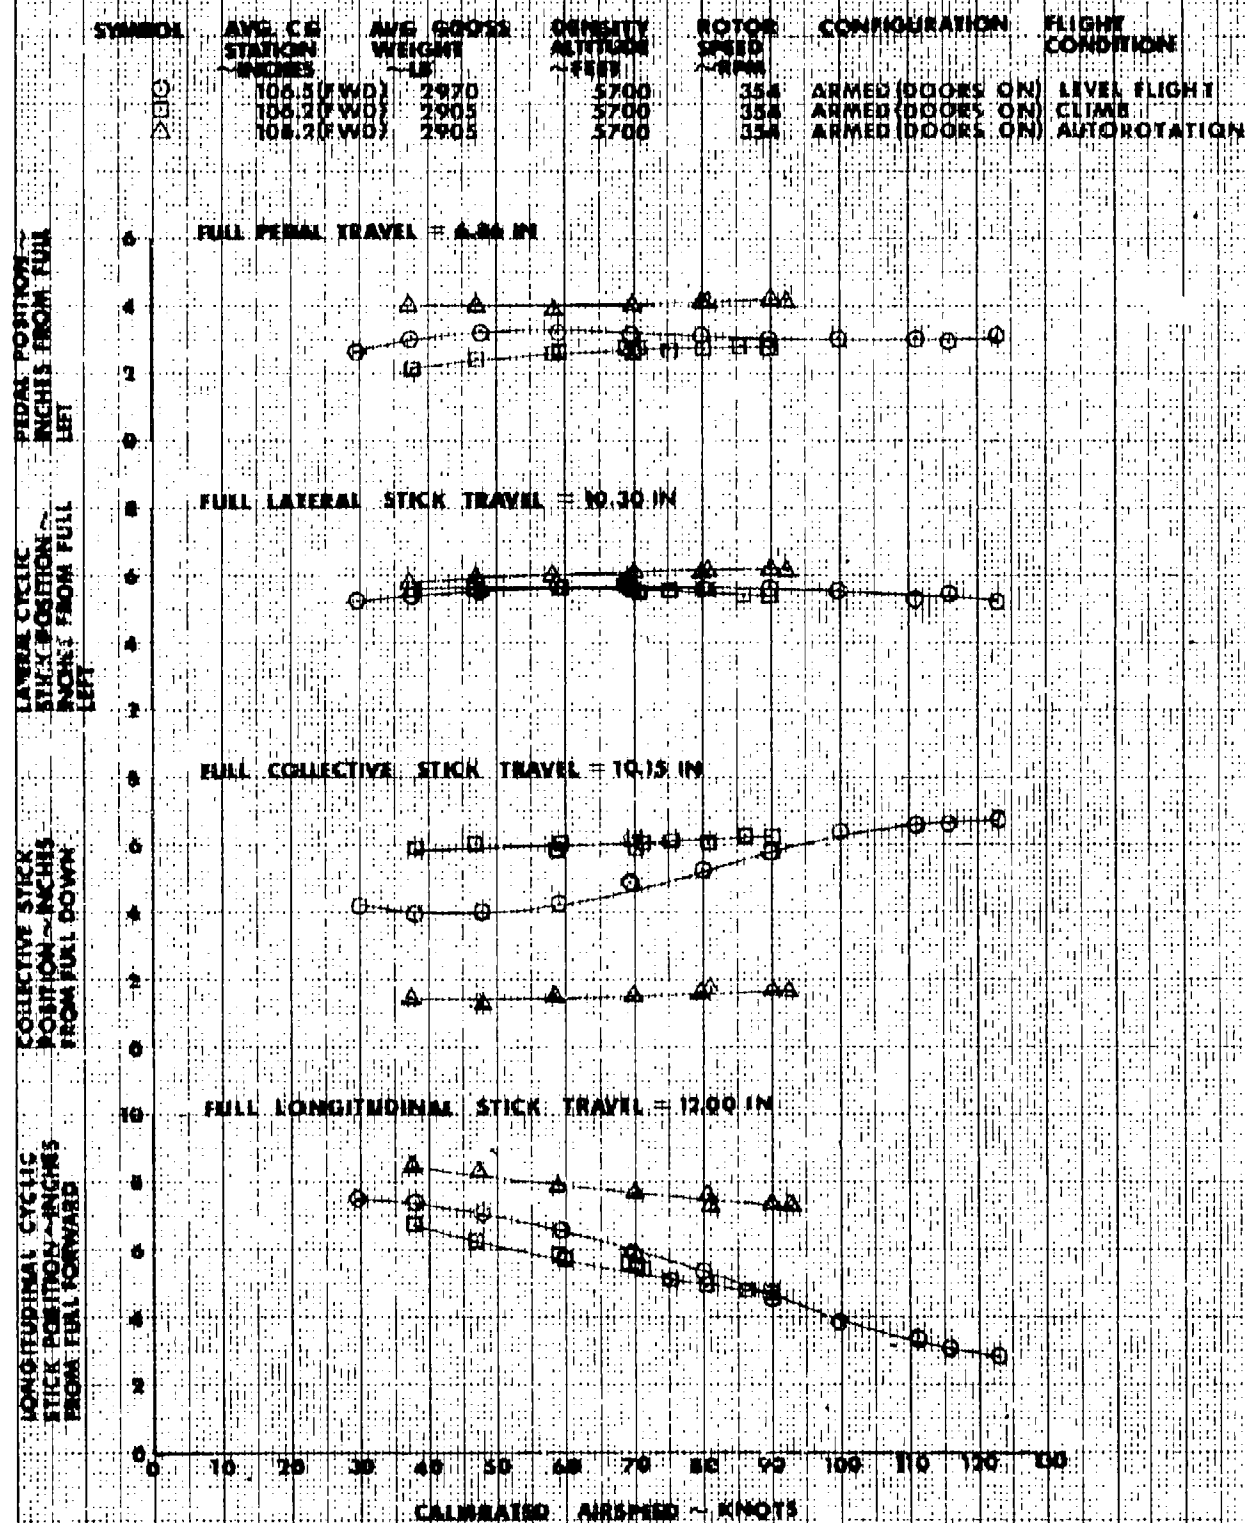


FIGURE 12
CONTROL POSITIONS IN POWERED FLIGHT
 G4-58A USA 574 68-16766

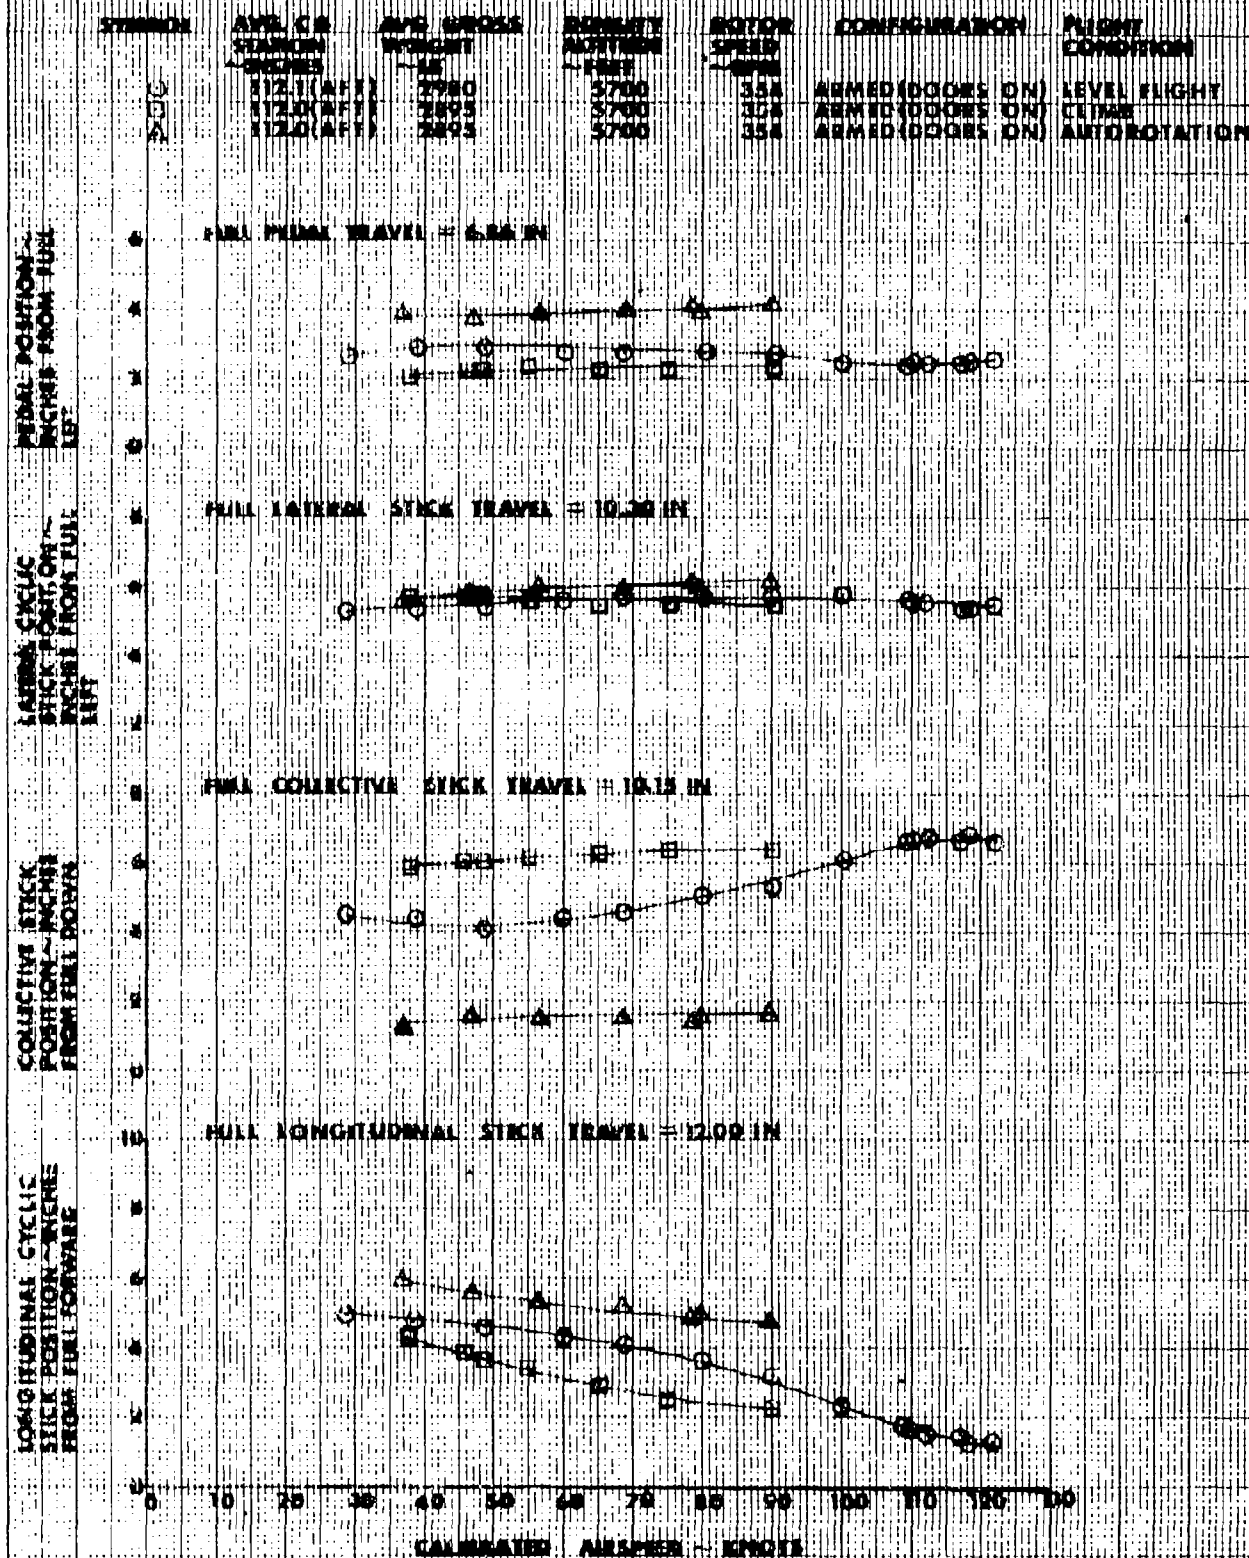


FIGURE 16
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 68-16706

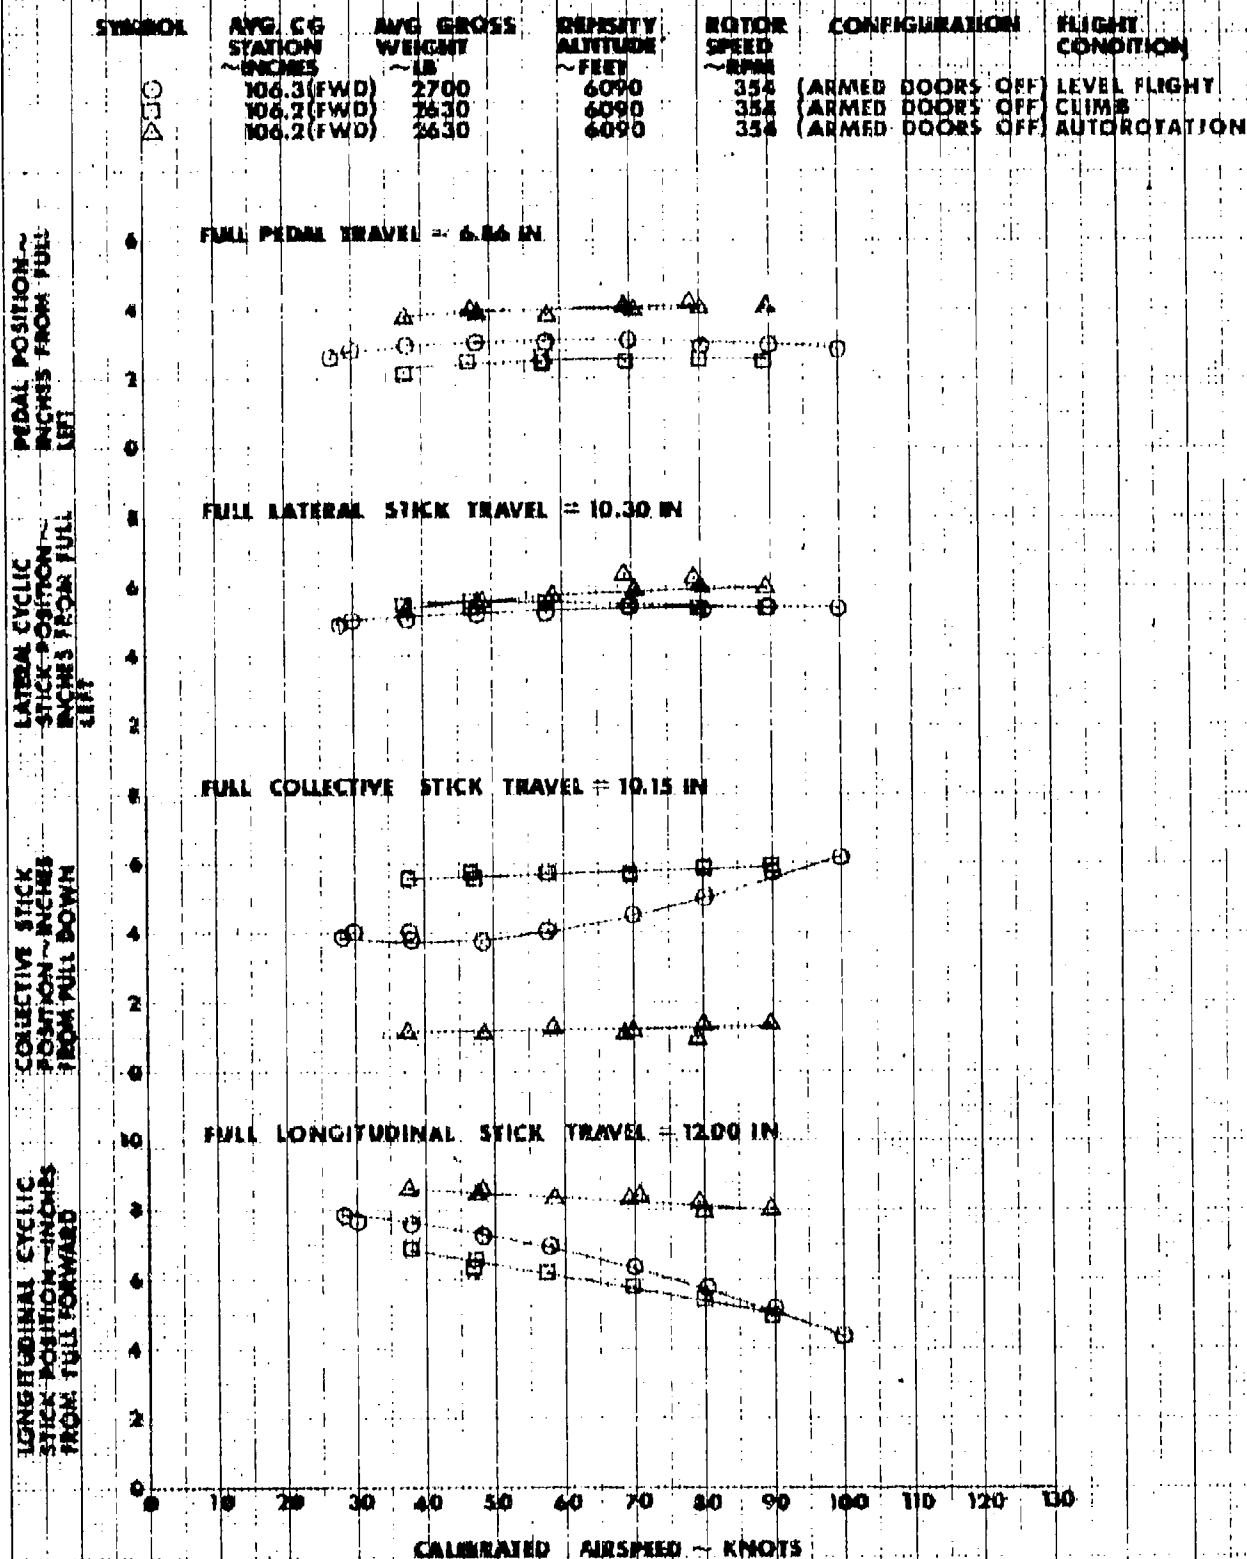


FIGURE 17
CONTROL POSITIONS IN FORWARD FLIGHT
OH-58A USA S/N 68-16706

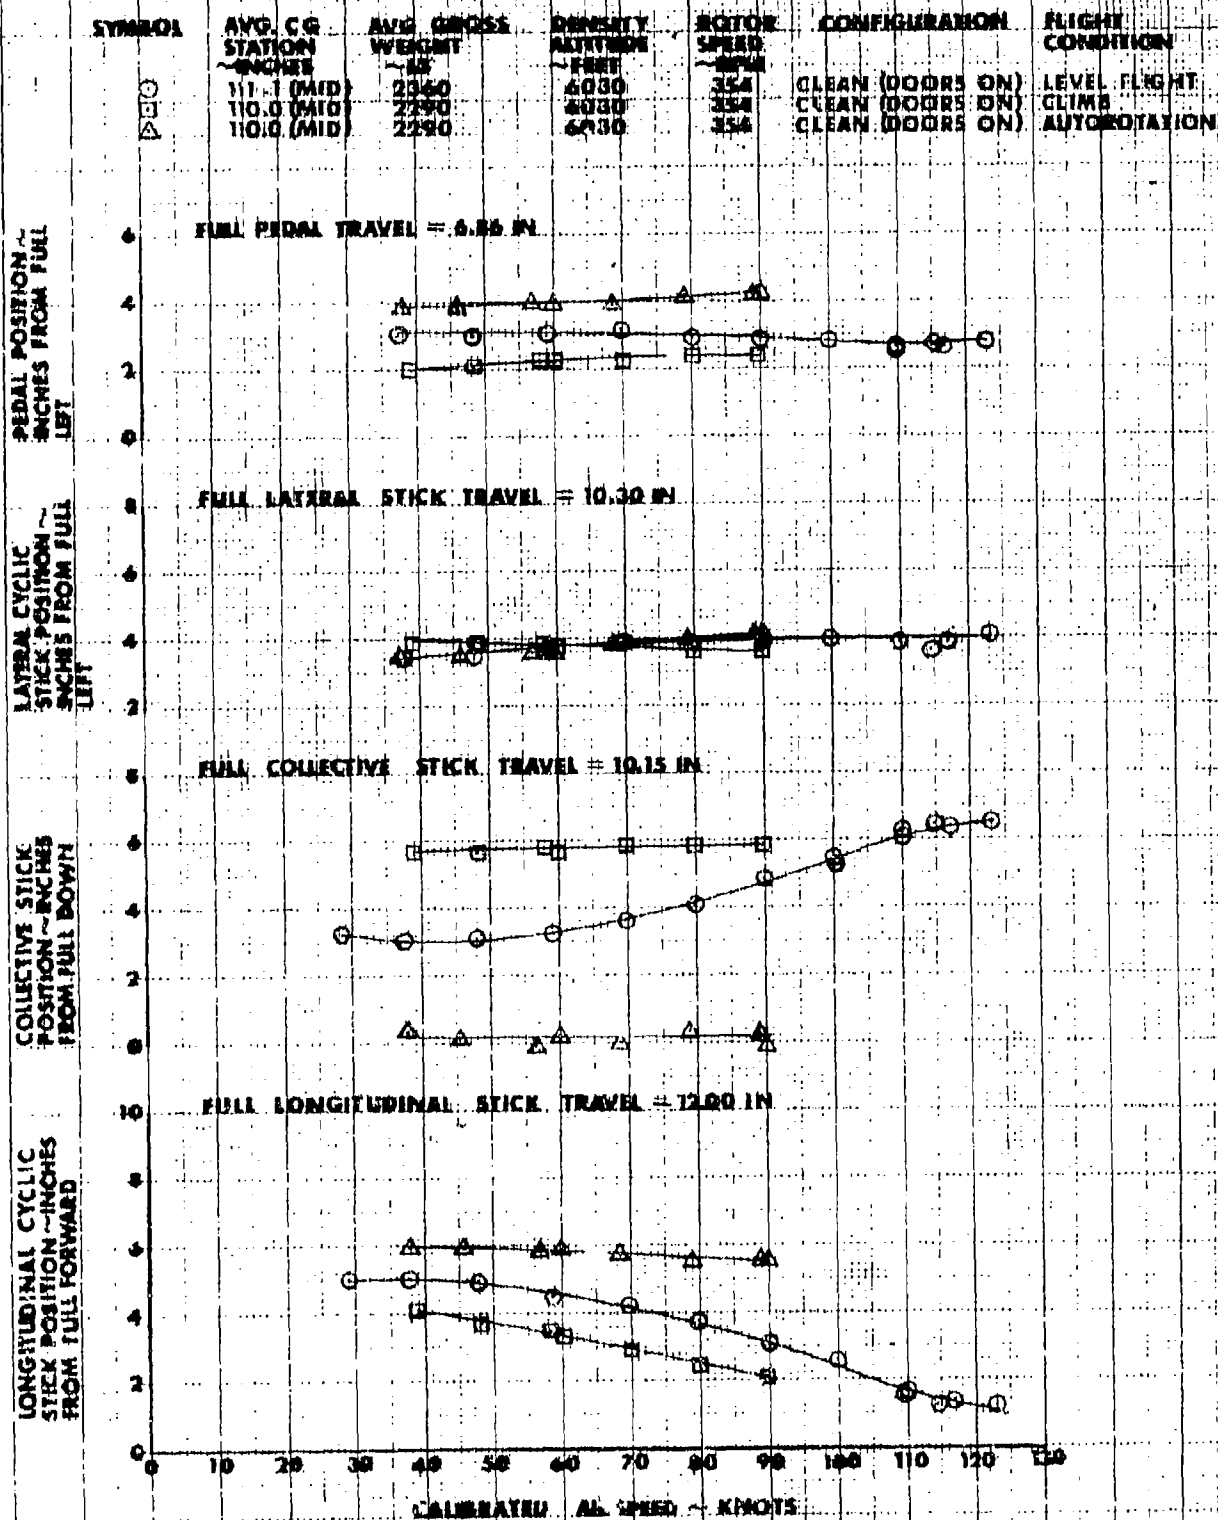


FIGURE 18
CONTROL POSITIONS IN FORWARD FLIGHT
OH-5A USA S/N 68-16704

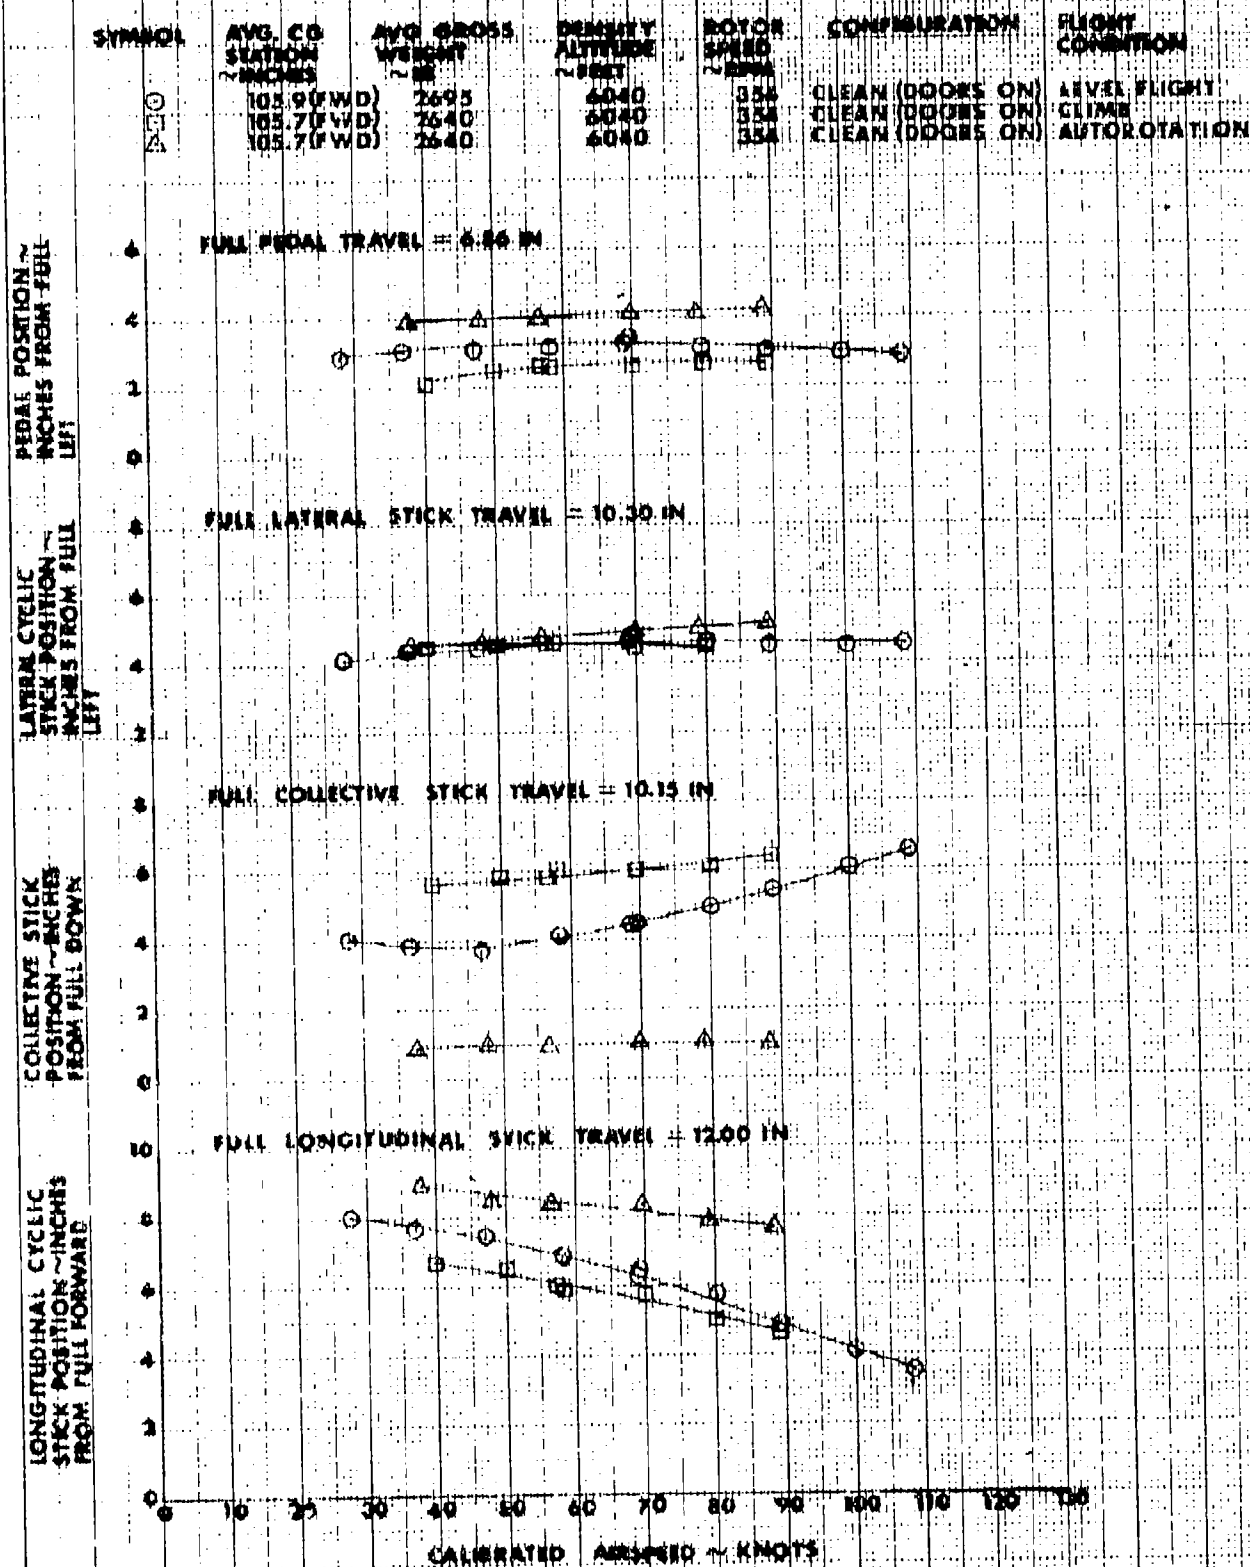


FIGURE 10 STATIC LATERAL-DIRECTIONAL STABILITY GRADIENT SUMMARY ON SEA USA S/N 68-1708

CURVE NUMBER	GROSS WEIGHT ~LB	CG STATION ~IN	DENSITY ALTITUDE ~FT	NOTOR SPEED ~RPM	CONFIGURATION	FLIGHT CONDITION	CALIBRATED AIRSPEED ~KTS
1	2570	104.9 (FWD)	3980	354	ARMED DOORS ON	LEVEL FLIGHT	83
2	2670	107.2 (FWD)	3920	354	ARMED DOORS ON	LEVEL FLIGHT	83
3	2840	104.4 (FWD)	4020	354	ARMED DOORS ON	LEVEL FLIGHT	83
4	2670	107.1 (FWD)	3980	354	ARMED DOORS ON	LEVEL FLIGHT	100
5	2540	113.1 (AFT)	3930	354	ARMED DOORS ON	LEVEL FLIGHT	83
6	2630	104.3 (FWD)	3990	354	ARMED DOORS OFF	LEVEL FLIGHT	83
7	2630	108.7 (FWD)	3970	354	CLEAN DOORS ON	LEVEL FLIGHT	83
8	2360	111.1 (MID)	4120	354	CLEAN DOORS ON	LEVEL FLIGHT	83
9	2620	107.0 (FWD)	3780	354	CLIMB	CLIMB	89
10	2620	107.0 (FWD)	3790	354	ARMED DOORS ON	AUTOROTATION	89

NOTE:
1. CURVES DERIVED FROM FIGURES 20 THROUGH 22 AND FIGURES 24 THROUGH 29
2. POSITIVE LATERAL CYCLIC GRADIENTS ARE STABLE
3. NEGATIVE PEDAL GRADIENTS ARE STABLE

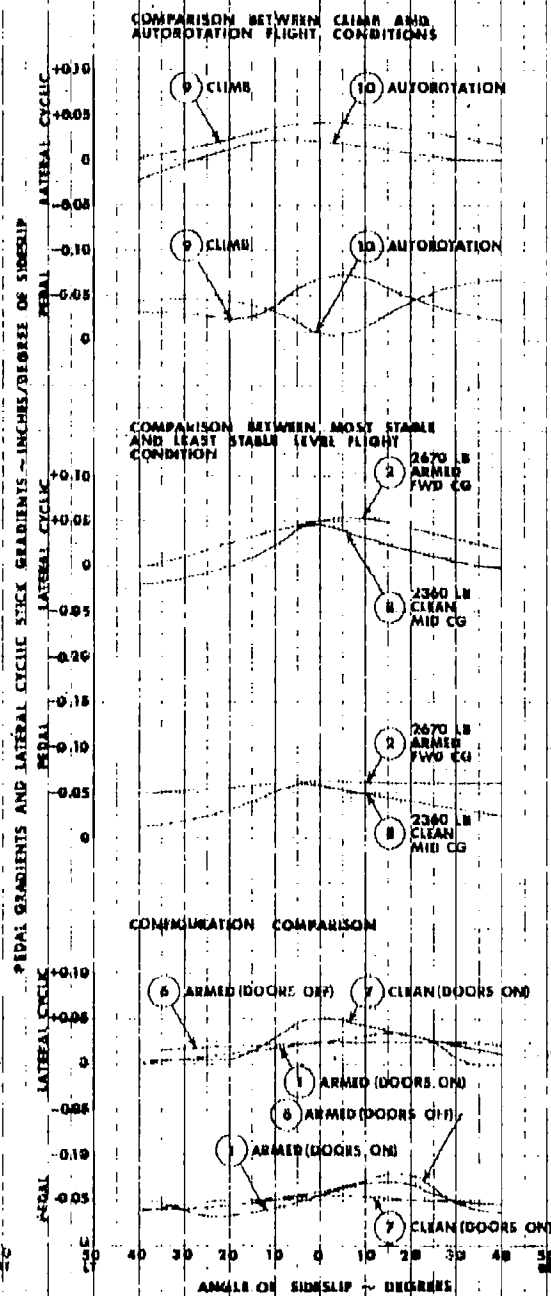
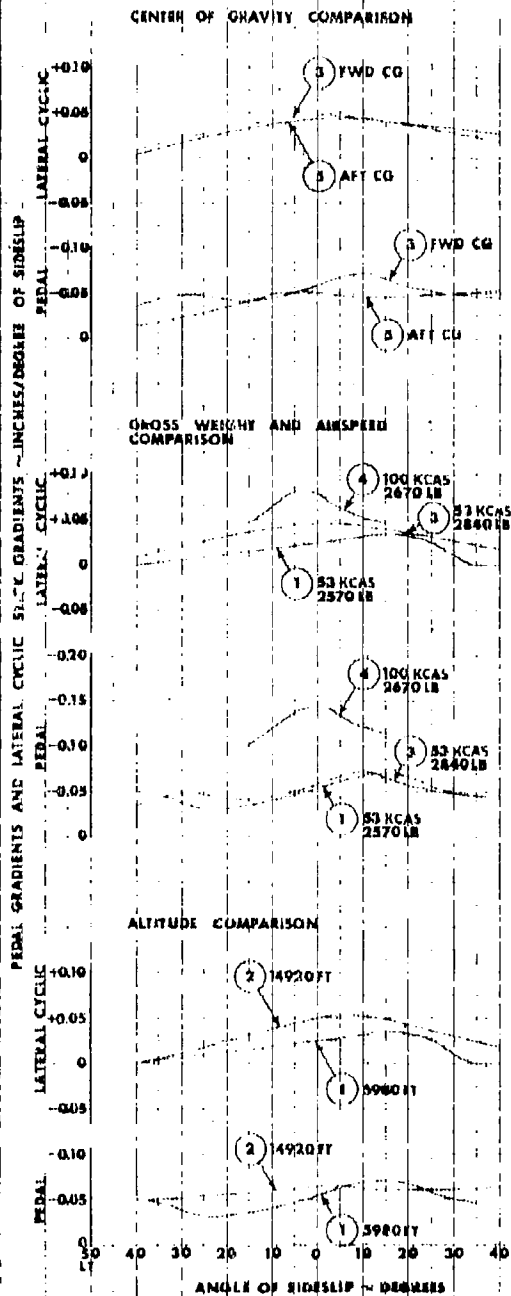


FIGURE 20
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16704

SYMBOL	AVG. C.G. STATION ~ INCHES	AVG. GROSS WEIGHT ~ LB.	DENSITY ALTITUDE ~ FEET	ROTOR SPEED ~ RPM	CONFIGURATION	FLIGHT COND.	CALIB. A/S ~ KNOTS
○	105.8 (FWD)	1645	1660	354	ARMED (DOORS ON)	LEVEL FLIGHT	60
△	105.9 (FWD)	2735	1660	354	ARMED (DOORS ON)	LEVEL FLIGHT	93
■	105.5 (FWD)	2585	1660	354	ARMED (DOORS ON)	LEVEL FLIGHT	113

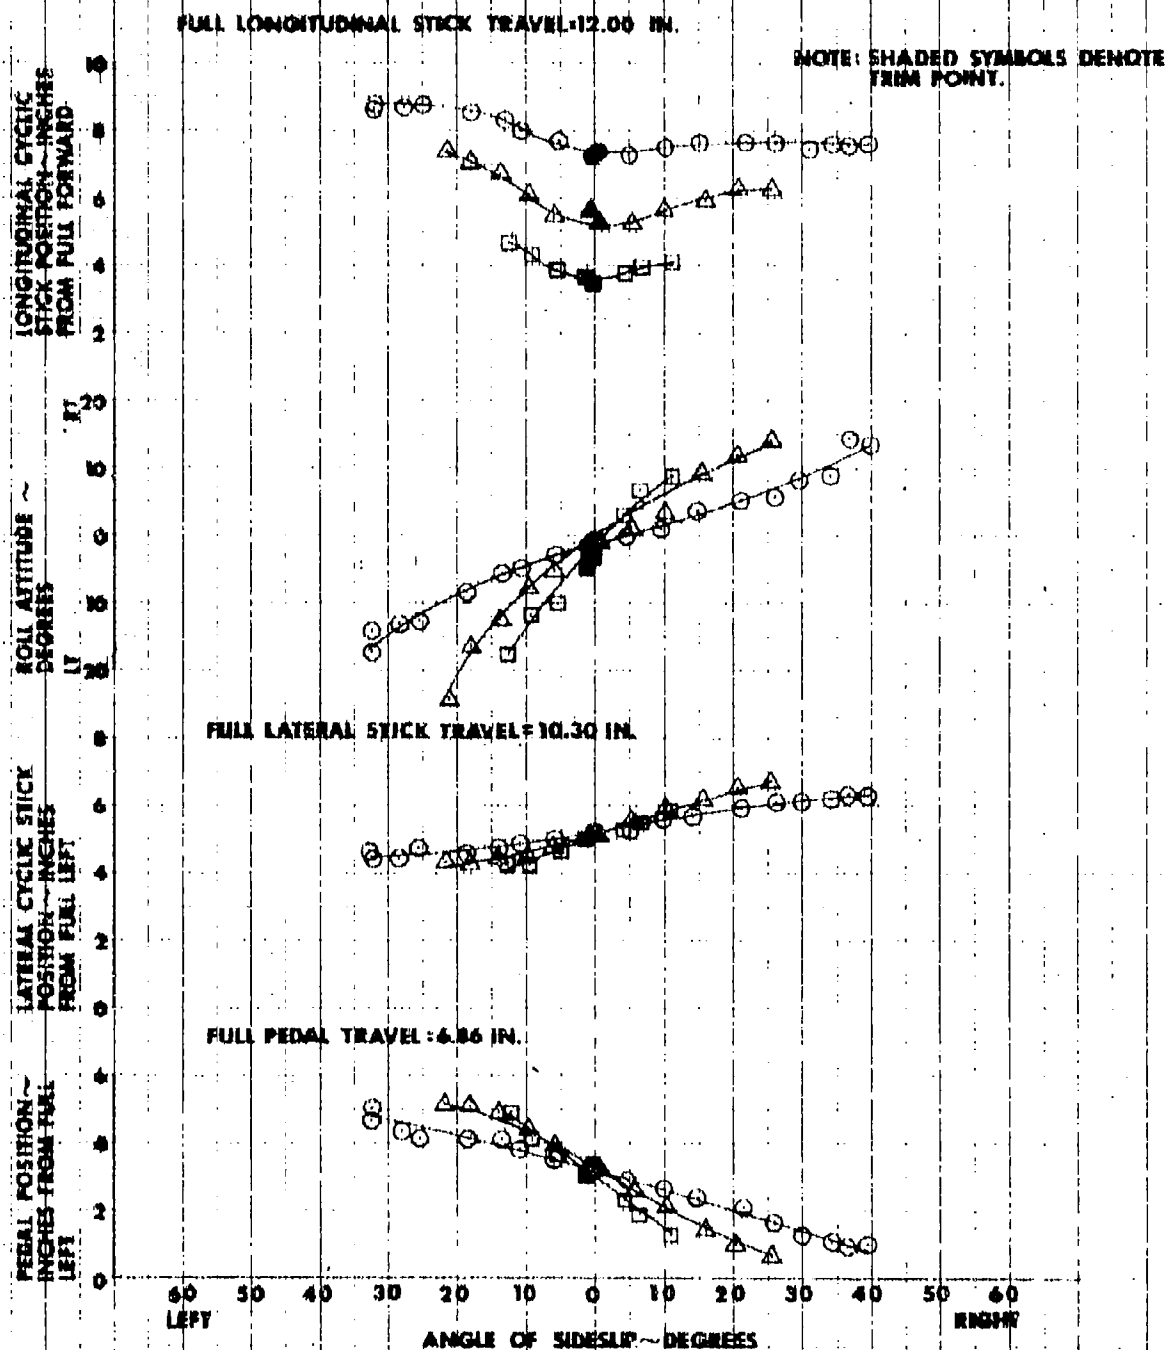


FIGURE 21
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16706

SYMBOL	AVG. C.G. STATION ~ INCHES	AVG. GROSS WEIGHT ~ LB	DENSITY ALTITUDE ~ FEET	ENGINE SPEED ~ RPM	CONFIGURATION	FLIGHT COND	CALIB. A/S ~ KNOTS
○	106.9 (FWD)	2570	5980	354	ARMED (DOORS ON)	LEVEL FLIGHT	53
△	107.0 (FWD)	2625	5980	354	ARMED (DOORS ON)	LEVEL FLIGHT	85
□	107.1 (FWD)	2670	5980	354	ARMED (DOORS ON)	LEVEL FLIGHT	100

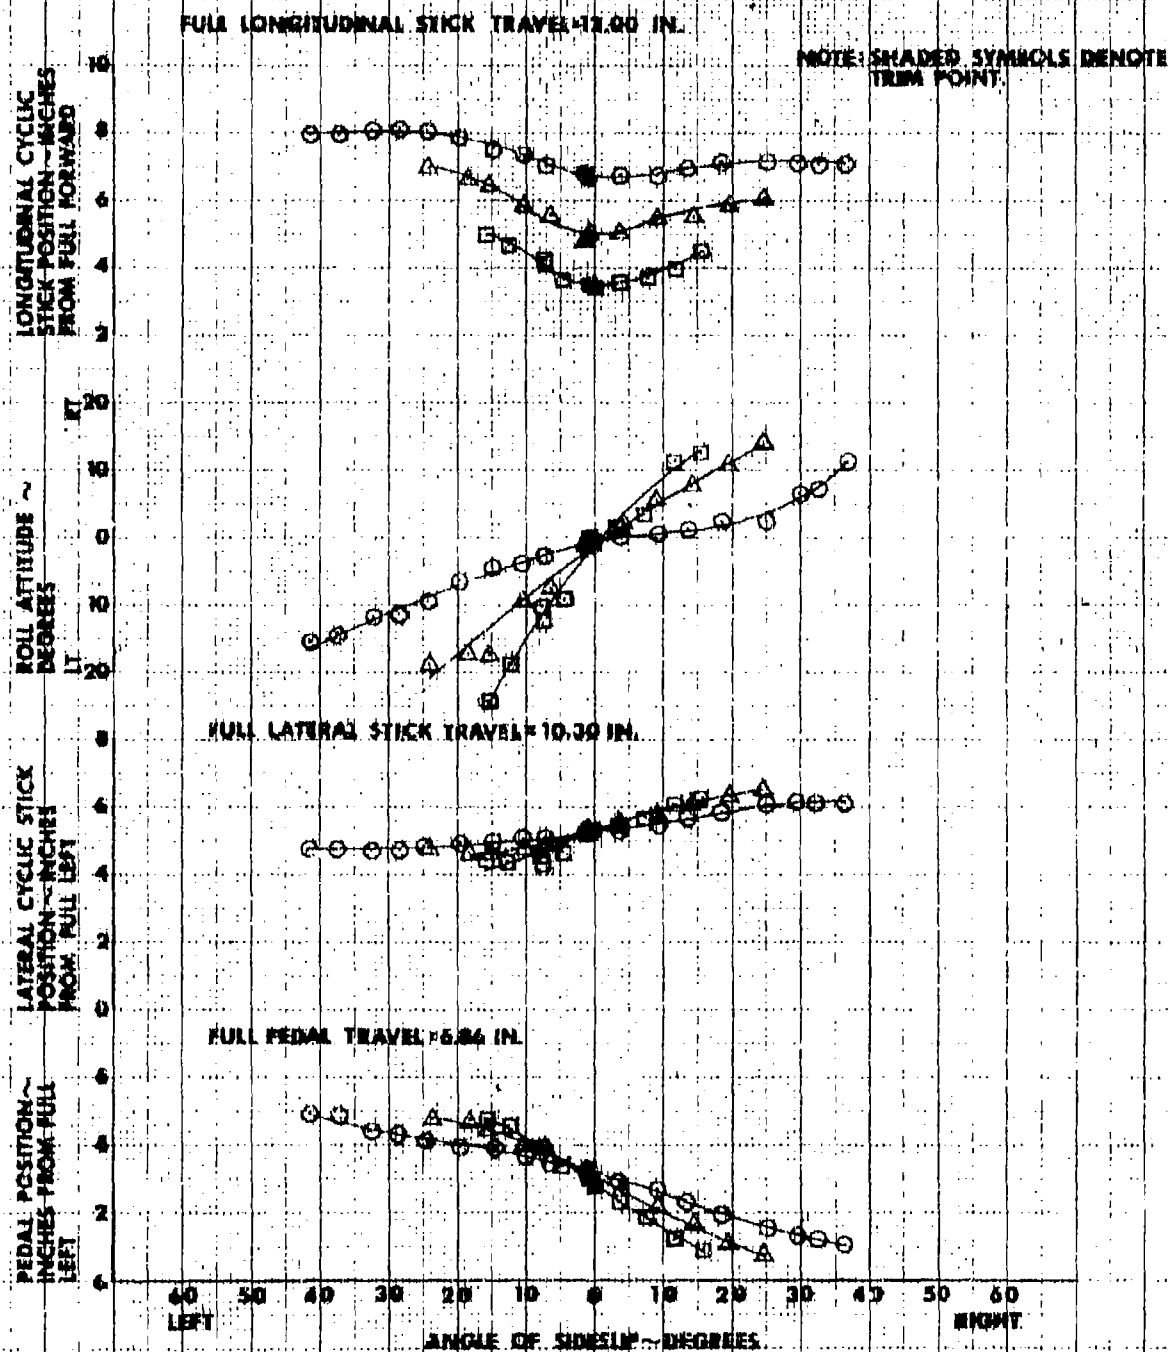


FIGURE 22
STATIC LATERAL DIRECTIONAL STABILITY
OH-58, USA S/N 68-16706

SYMBOL	AVG CG STATION ~ INCHES	AVG GROSS WEIGHT ~ LB	DENSITY ALTITUDE ~ FEET	ROTOR SPEED ~ RPM	CONFIGURATION	FLIGHT COND.	CALIB. A/S ~ KNOTS
△	107.0 (FWD)	2620	5790	354	ARMED (DOORS ON)	AUTO CLIMB	49
○	107.0 (FWD)	2620	5790	354	ARMED (DOORS ON)	AUTO CLIMB	49


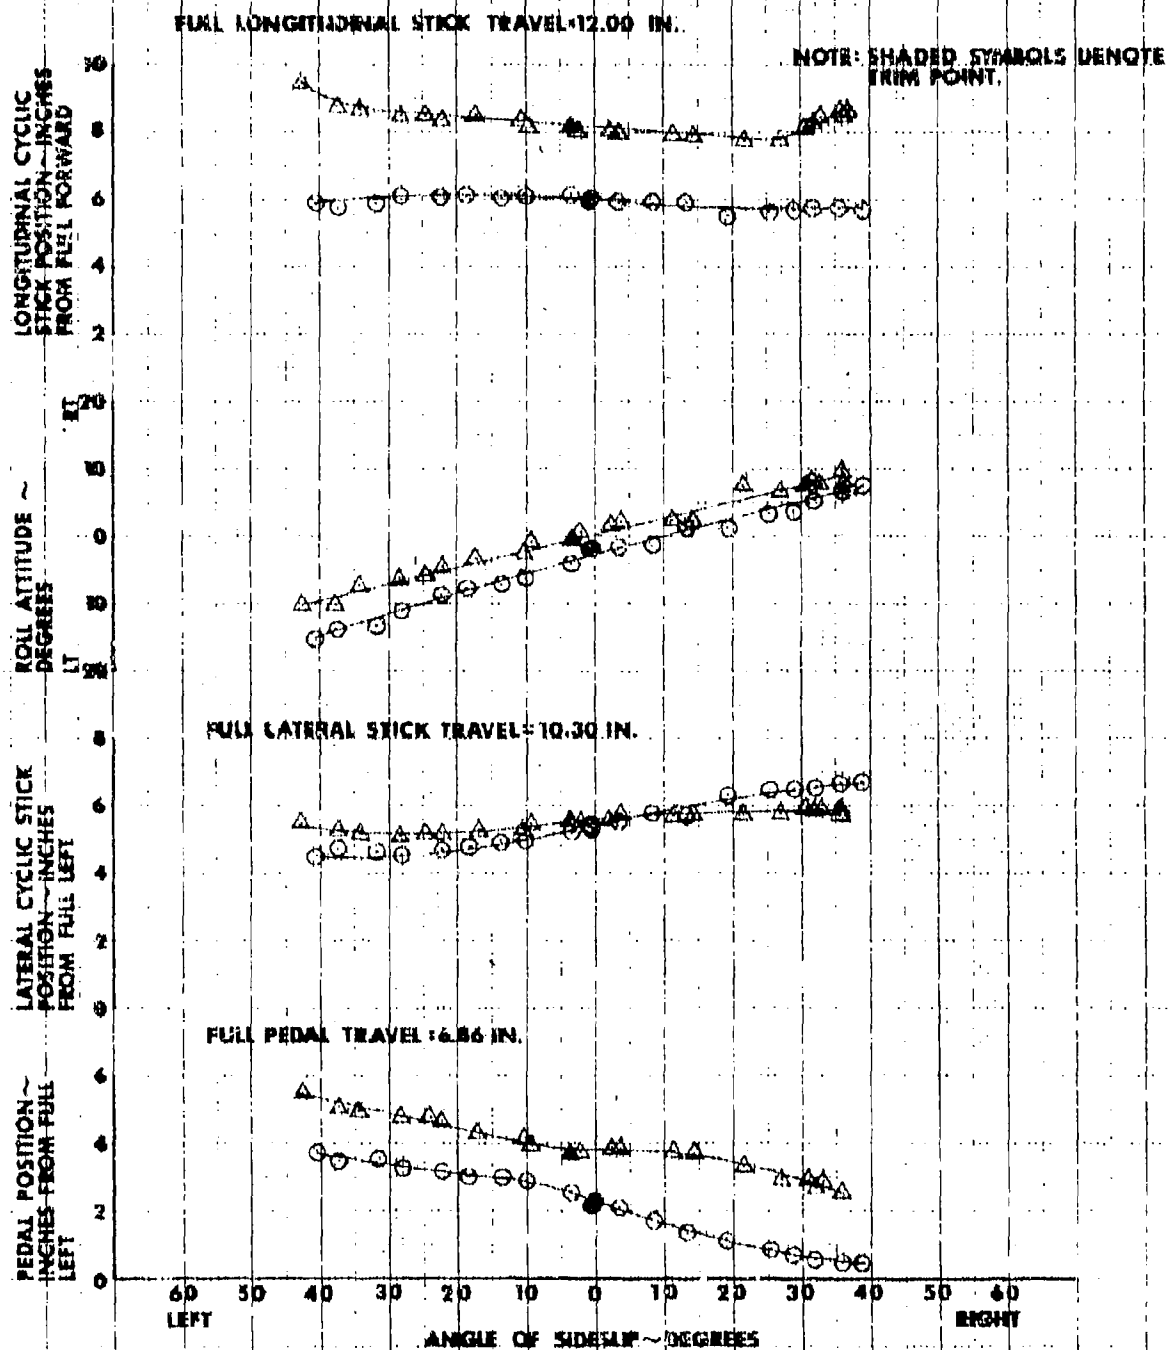


FIGURE 23
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16706

SYMBOL	AVG. CG STATION ~ INCHES	AVG. GROSS WEIGHT ~ LB	DENSITY ALTITUDE ~ FEET	ROTOR SPEED ~ RPM	CONFIGURATION	FLIGHT COND	CALIB A/S ~ KNOTS
○	106.9 (FWD)	2668	5998	354	ARMED (DOORS ON)	CLIMB	85
△	106.7 (FWD)	2590	5798	354	ARMED (DOORS ON)	AUTO	85

FULL LONGITUDINAL STICK TRAVEL = 2.00 IN.

NOTE: SHADED SYMBOLS DENOTE
TRIM POINT

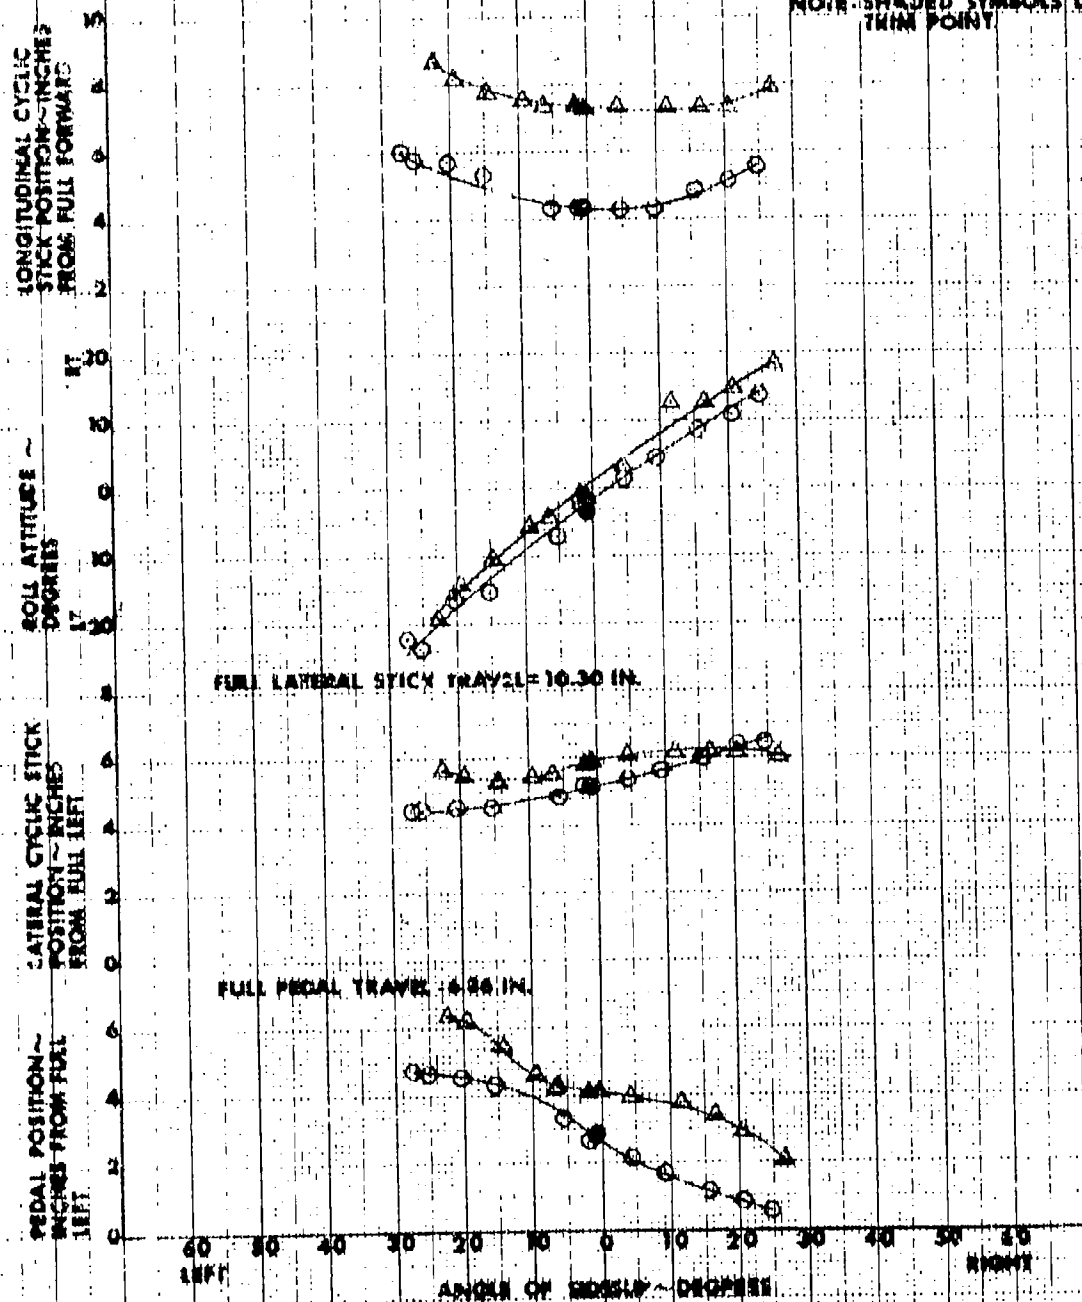

FULL LATERAL STICK TRAVEL = 10.30 IN.

FULL PEDAL TRAVEL = 6.86 IN.

FIGURE 24
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16703

SYMBOL	AVG CG STATION ~INCHES	AVG GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FEET	WIND SPEED ~KPH	CONFIGURATION	FLIGHT COND	CALC A/S ~KNOTS
○	107.2 (FWD)	2670	14920	354	ARMED (DOORS ON)	LEVEL FLIGHT	53
□	107.0 (FWD)	2620	14920	354	ARMED (DOORS ON)	LEVEL FLIGHT	74

FULL LONGITUDINAL STICK TRAVEL=12.00 IN.

NOTE: SHARED SYMBOLS DENOTE TRIM POINT.

LONGITUDINAL CYCLIC
STICK POSITION ~ INCHES
FROM FULL FORWARD

ROLL ATTITUDE ~
DEGREES

LATERAL CYCLIC STICK
POSITION ~ INCHES
FROM FULL LEFT

PEDAL POSITION ~
INCHES FROM FULL
LEFT

FULL LATERAL STICK TRAVEL=10.30 IN.

FULL PEDAL TRAVEL=4.86 IN.

ANGLE OF SIDESLIP ~ DEGREE

FIGURE 25
STATIC LATERAL DIRECTIONAL STABILITY
OH-35A USA S/N 68-16706

SYMBOL	AVG CG STATION ~INCHES	AVG GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FEET	ROTOR SPEED ~RPM	CONFIGURATION	FLIGHT COND	CALIB. A/S ~KNOTS
○	105.6 (FWD)	2840	6020	354	ARMED (DOORS ON)	LEVEL FLIGHT	53
△	105.9 (FWD)	2910	6020	354	ARMED (DOORS ON)	LEVEL FLIGHT	85
□	106.2 (FWD)	2970	6020	354	ARMED (DOORS ON)	LEVEL FLIGHT	100

FULL LONGITUDINAL STICK TRAVEL=12.00 IN.

NOTE: SHADED SYMBOLS DENOTE
 TURN POINT.

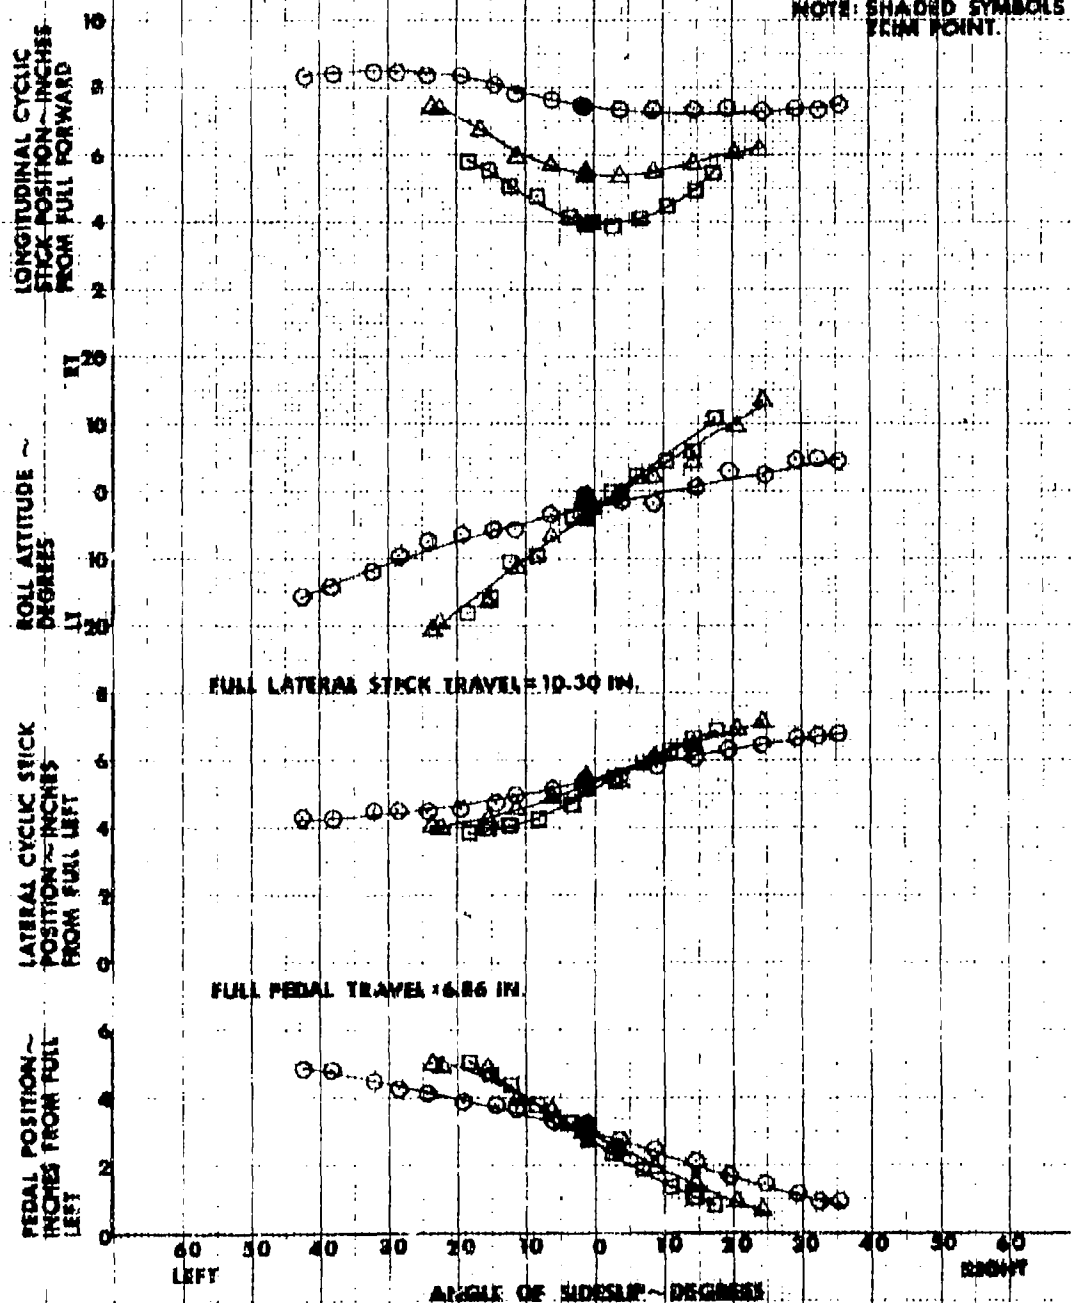


FIGURE 25
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16786

SYMBOL	AVG. C.G. STATION ~ INCHES	AVG. GROSS WEIGHT ~ LB.	DENSITY ALTITUDE ~ FEET	ROTOR SPEED ~ RPM	CONFIGURATION	FLIGHT COND.	CALC. A/S ~ KNOTS
○	112.1 (AFT)	2860	5930	354	ARMED (DOORS ON)	LEVEL FLIGHT	53
△	112.0 (AFT)	2890	5930	354	ARMED (DOORS ON)	LEVEL FLIGHT	85
□	112.0 (AFT)	2890	5930	354	ARMED (DOORS ON)	LEVEL FLIGHT	103

FULL LONGITUDINAL STICK TRAVEL=12.0 IN.

NOTE: SHADED SYMBOLS DENOTE TRIM POINT.

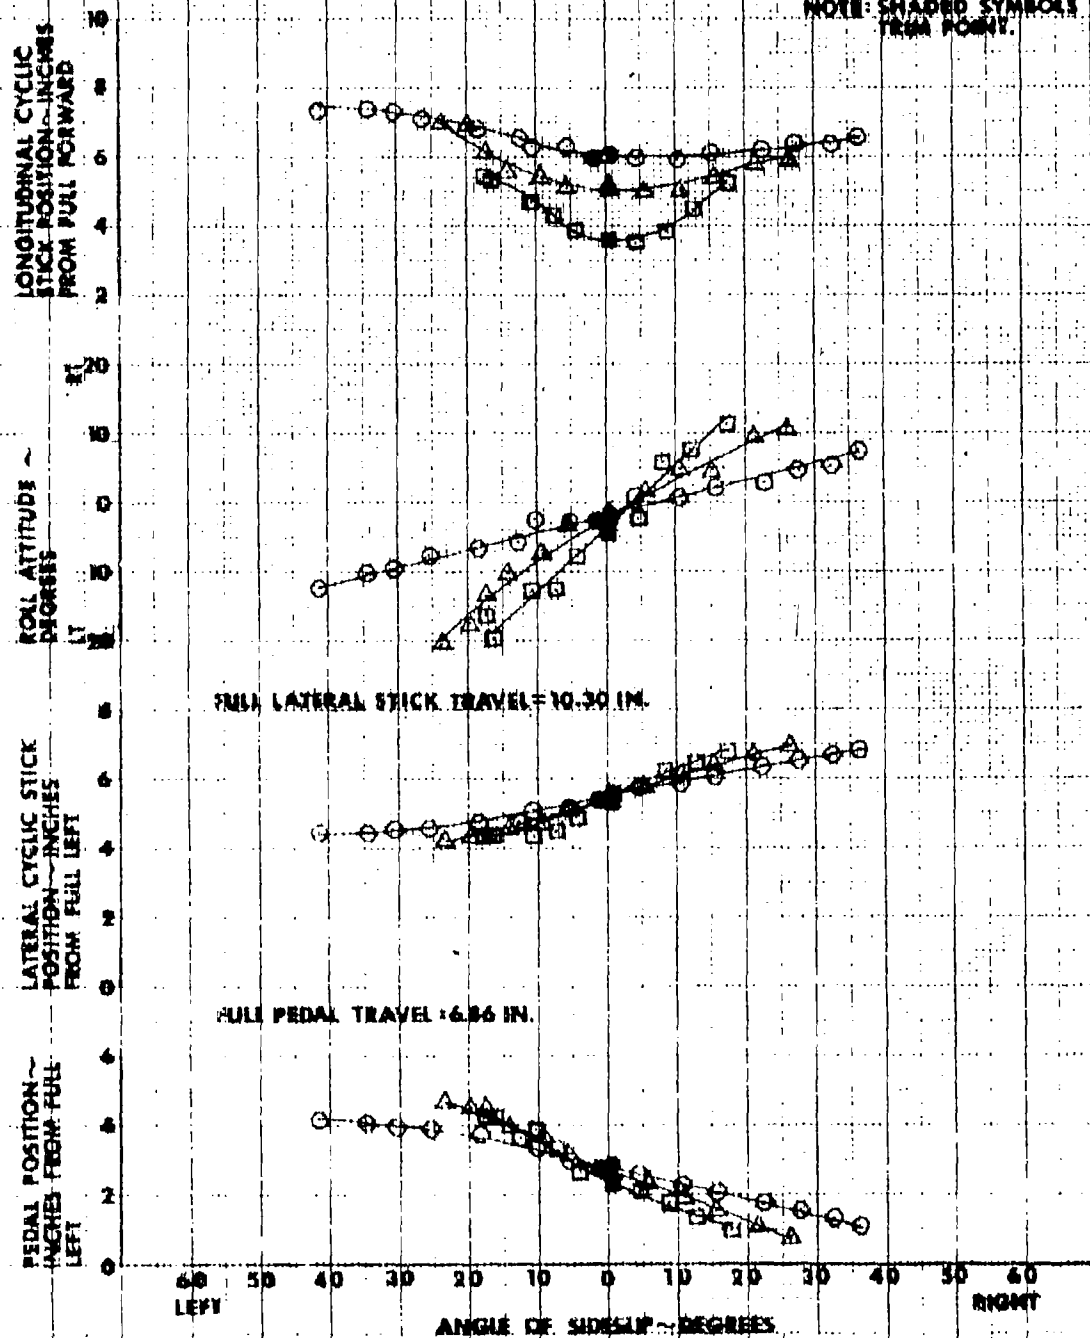


FIGURE 27
STATIC LATERAL DIRECTIONAL STABILITY
OH-35A USA S/N 88-18706

SYMBOL	AVG. C.G. STATION ~INCHES	AVG. GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FEET	YTON ~RPM	CONFIGURATION	FLIGHT COND	CALIB. A/S ~KNOTS
○	106.5 (FWD)	2655	5990	354	ARMED(DOORS OFF)	LEVEL FLIGHT	83
△	106.3 (FWD)	2590	5990	354	ARMED(DOORS OFF)	LEVEL FLIGHT	85
□	106.2 (FWD)	2540	5990	354	ARMED(DOORS OFF)	LEVEL FLIGHT	100

FULL LONGITUDINAL STICK TRAVEL=12.00 IN.

NOTE: SHADED SYMBOLS DENOTE TRIM POINT.

LONGITUDINAL CYCLIC
STICK POSITION~INCHES
FROM FULL FORWARD

ROLL ATTITUDE ~
DEGREES
RT
LT

LATERAL CYCLIC STICK
POSITION~INCHES
FROM FULL LEFT

PEDAL POSITION~
INCHES FROM FULL
LEFT

FULL LATERAL STICK TRAVEL=10.30 IN.

FULL PEDAL TRAVEL=6.86 IN.

60
50
40
30
20
10
0
LEFT

ANGLE OF SIDESLIP ~ DEGREES



RIGHT
10
20
30
40
50
60

FIGURE 28
STATIC LATERAL DIRECTIONAL STABILITY
OH-58A USA S/N 68-16706


SYMBOL	AVG. CG. STATION ~ INCHES	AVG. GROSS WEIGHT ~ LB	DENSITY ALTITUDE ~ FEET	ROTOR SPEED ~ RPM	CONFIGURATION	FLIGHT COND	CALC. A/S ~ KNOTS
○	105.7 (FWD)	2650	5970	354	CLEAN (DOORS ON)	LEVEL FLIGHT	83
△	105.6 (FWD)	2600	5970	354	CLEAN (DOORS ON)	LEVEL FLIGHT	85
□	105.4 (FWD)	2560	5970	354	CLEAN (DOORS ON)	LEVEL FLIGHT	113

FULL LONGITUDINAL STICK TRAVEL=12.00 IN.

NOTE: SHADED SYMBOLS DENOTE TRIM POINT.

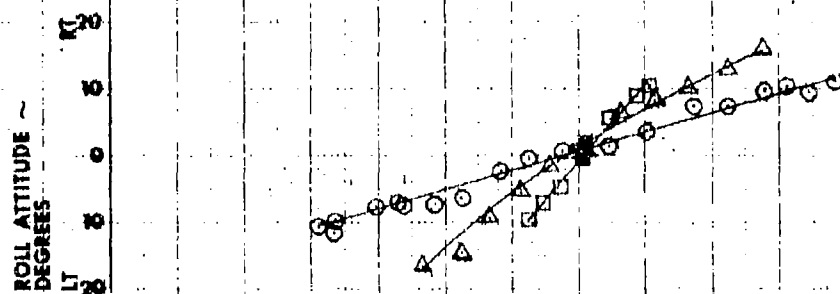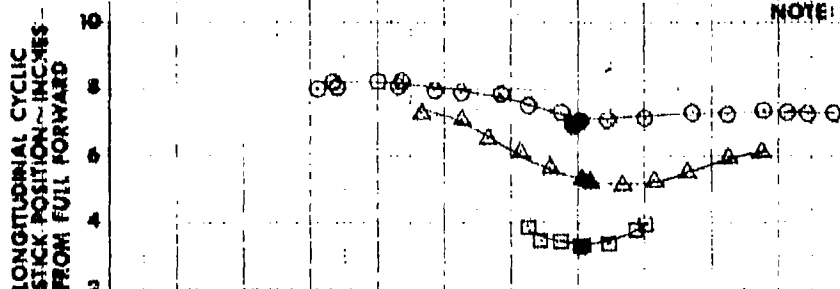

FULL LATERAL STICK TRAVEL=10.30 IN.

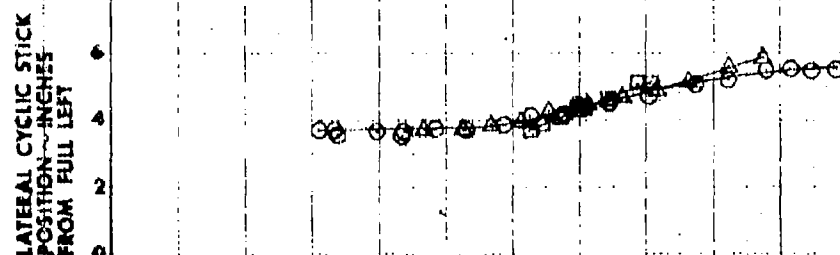

FULL PEDAL TRAVEL=6.86 IN.

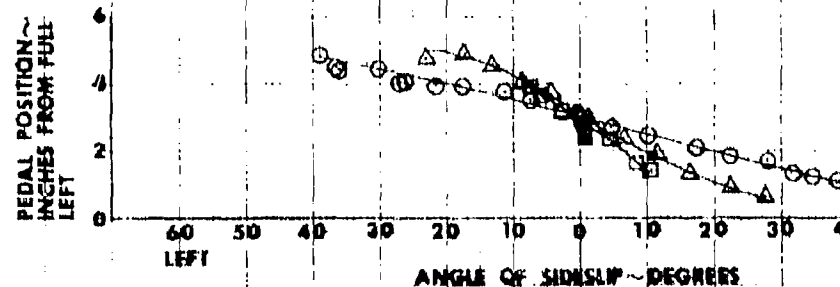


FIGURE 29 **STATIC LATERAL DIRECTIONAL STABILITY** **ON SEA USA S/N 48-4704**

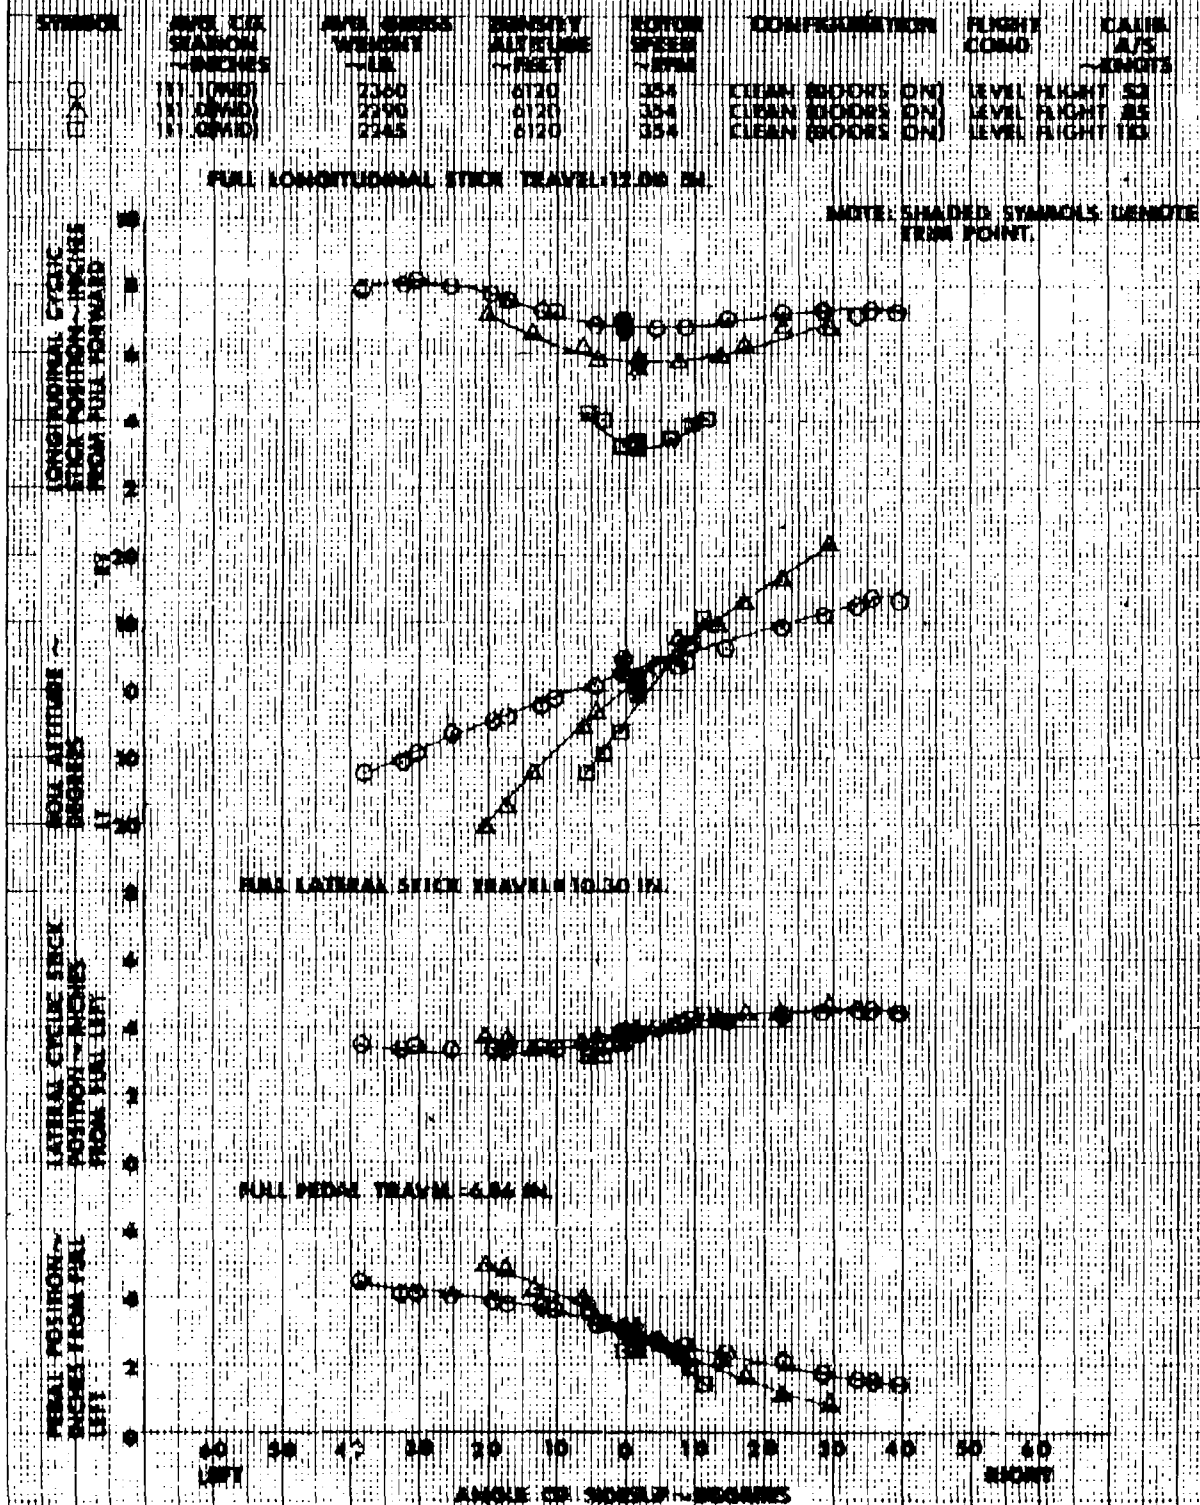


FIGURE 30
DUTCH ROLL IN LEFT SIDESLIP
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 2950 FT
CALIBRATED AIRSPEED ~ 93 KTS
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 2740 LB
CG STATION ~ 105.3 IN (FWD)
CONFIGURATION - ARMED (DOORS ON)

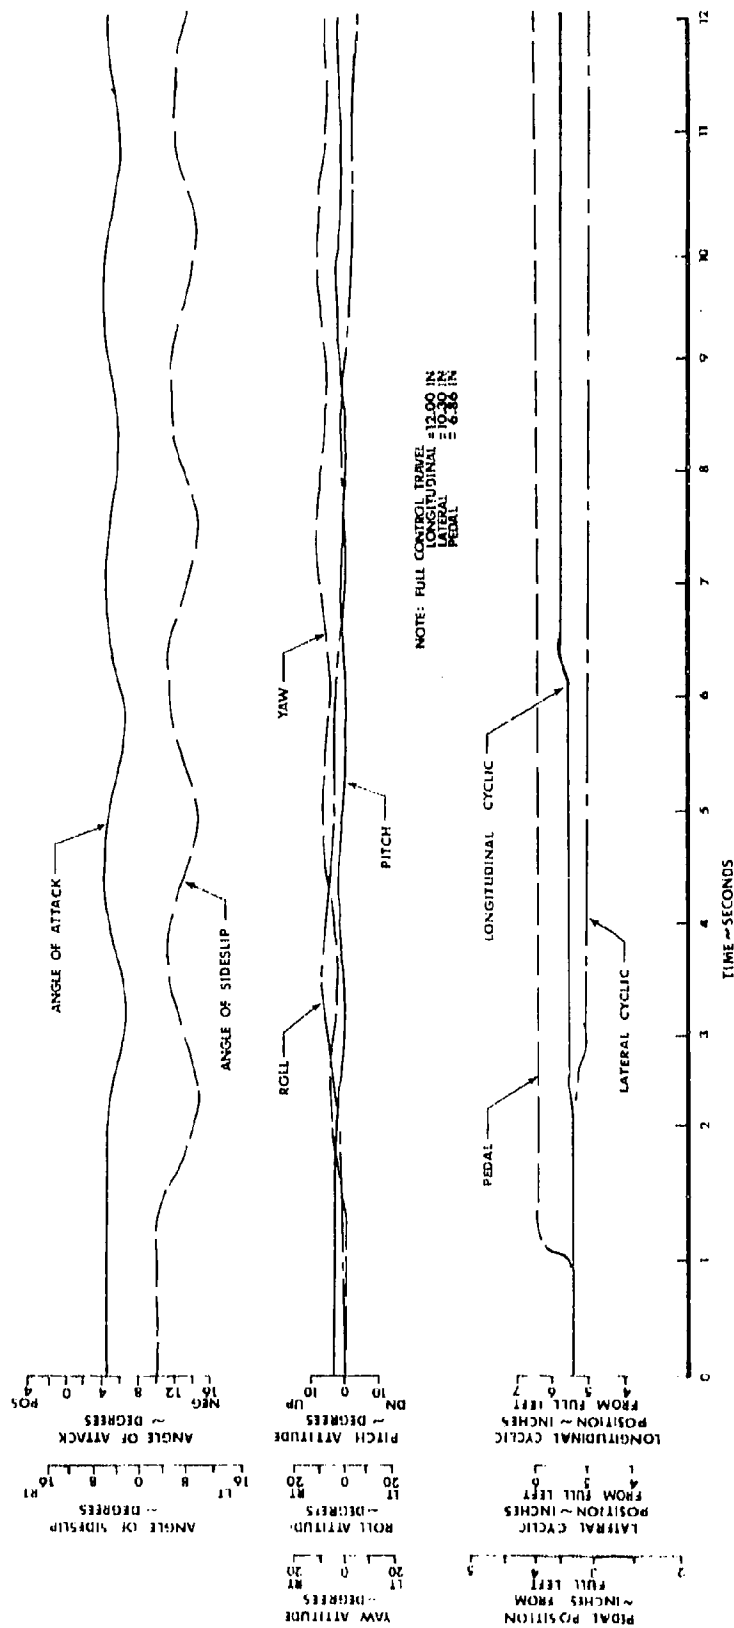


FIGURE 31
LONGITUDINAL PULSE IN HIGH SPEED LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5720 FT
CALIBRATED AIRSPEED ~ 85 KTS
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 2750 LB
CG STATION ~ 1724 IN (FWD)
CONFIGURATION ~ CLEAN (DOORS ON)

NOTE: FULL LONGITUDINAL CONTROL TRAVEL = 12.00 IN

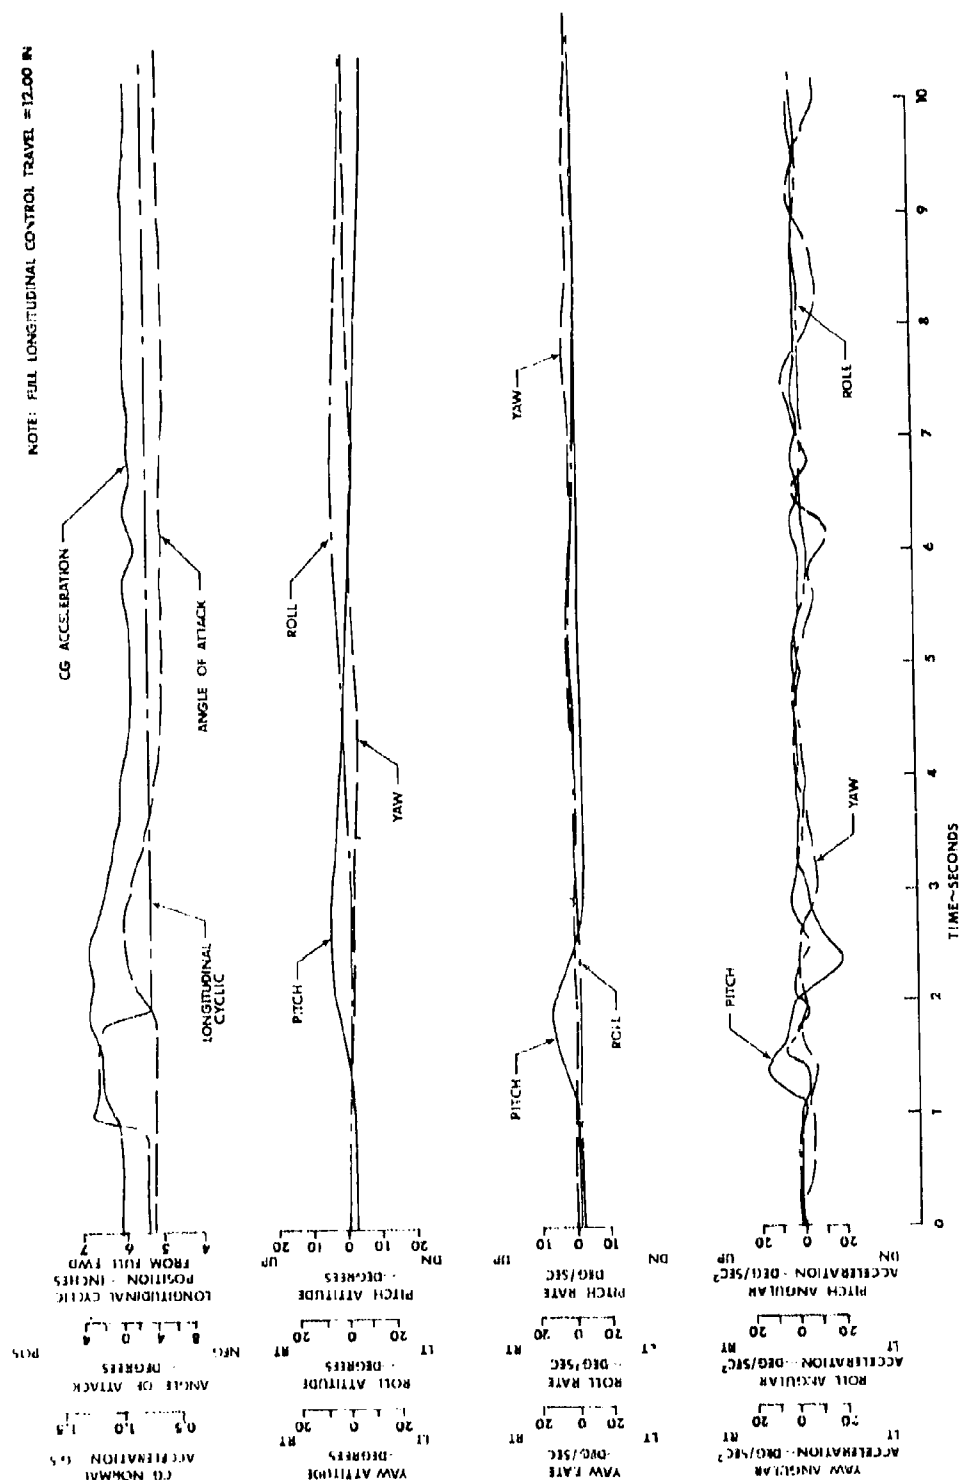


FIGURE 32
LONGITUDINAL PULSE IN LOW SPEED LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5720 FT
CALIBRATED AIRSPEED ~ 38 KTS
ROT R SPEED ~ 354 RPM
GROSS WEIGHT ~ 2770 LB
CG STATION ~ 105.6 IN (FWD)
CONFIGURATION ~ CLEAN (DOORS ON)
NOTE: FULL LONGITUDINAL CONTROL TRAVEL = 12.00 IN

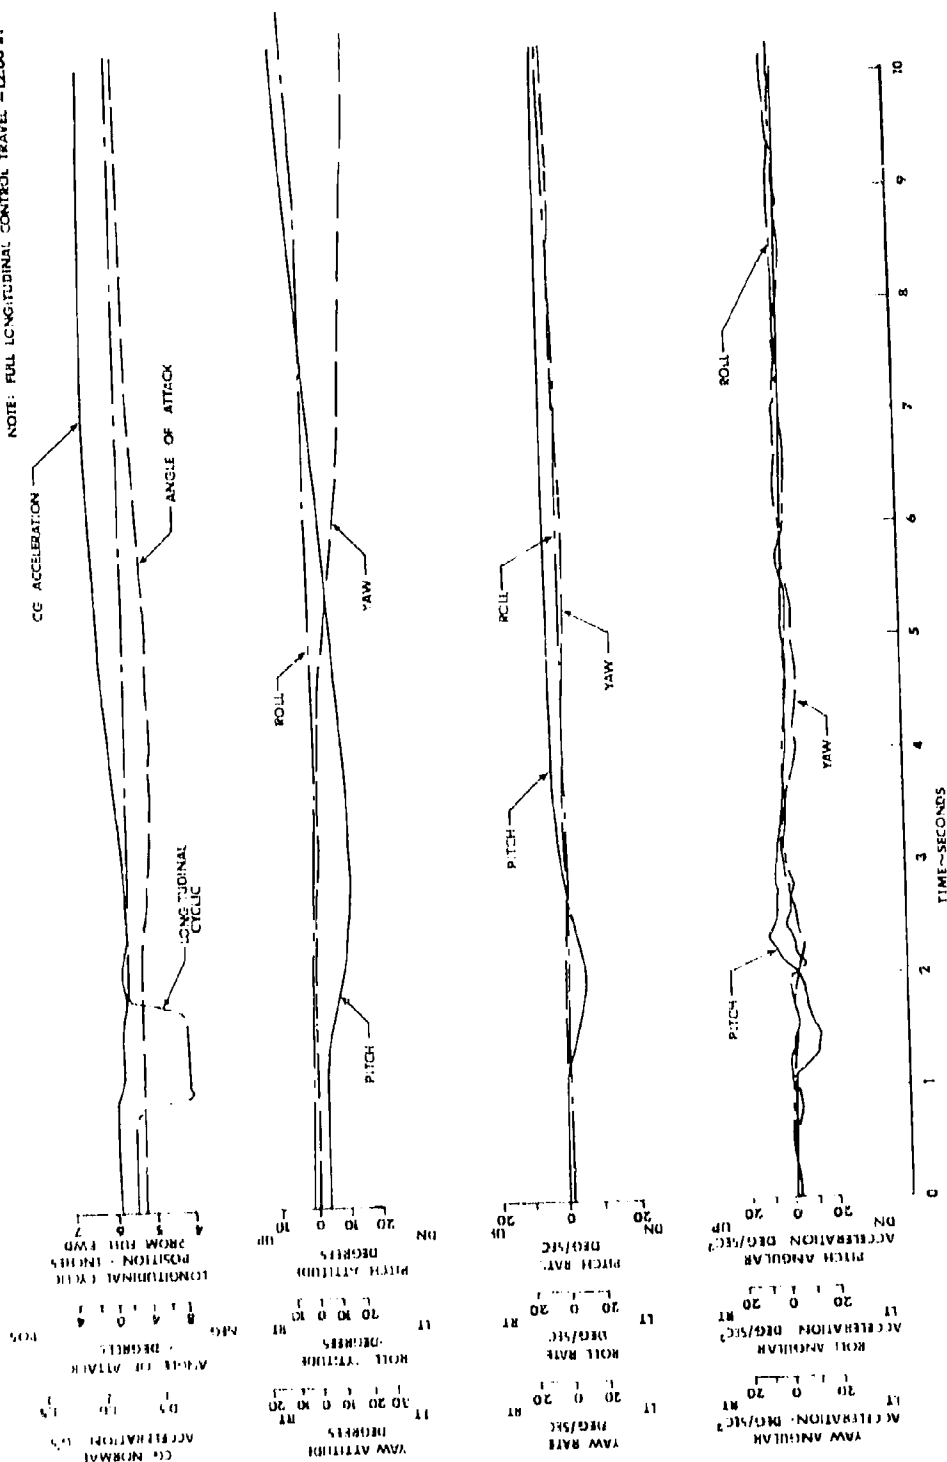


FIGURE 33

LATERAL PULS IN HIGH SPEED LEVEL FLIGHT

OH-58A USA S/N 68-16706

DENSITY ALTITUDE - 5930 FT
 CALIBRATED AIRSPEED - 104 KTS
 ROTOR SPEED - 354 RPM
 GROSS WEIGHT - 2450 LB
 CG STATION - 105.5 IN (FWD)
 CONFIGURATION - CLEAN (DOORS ON)

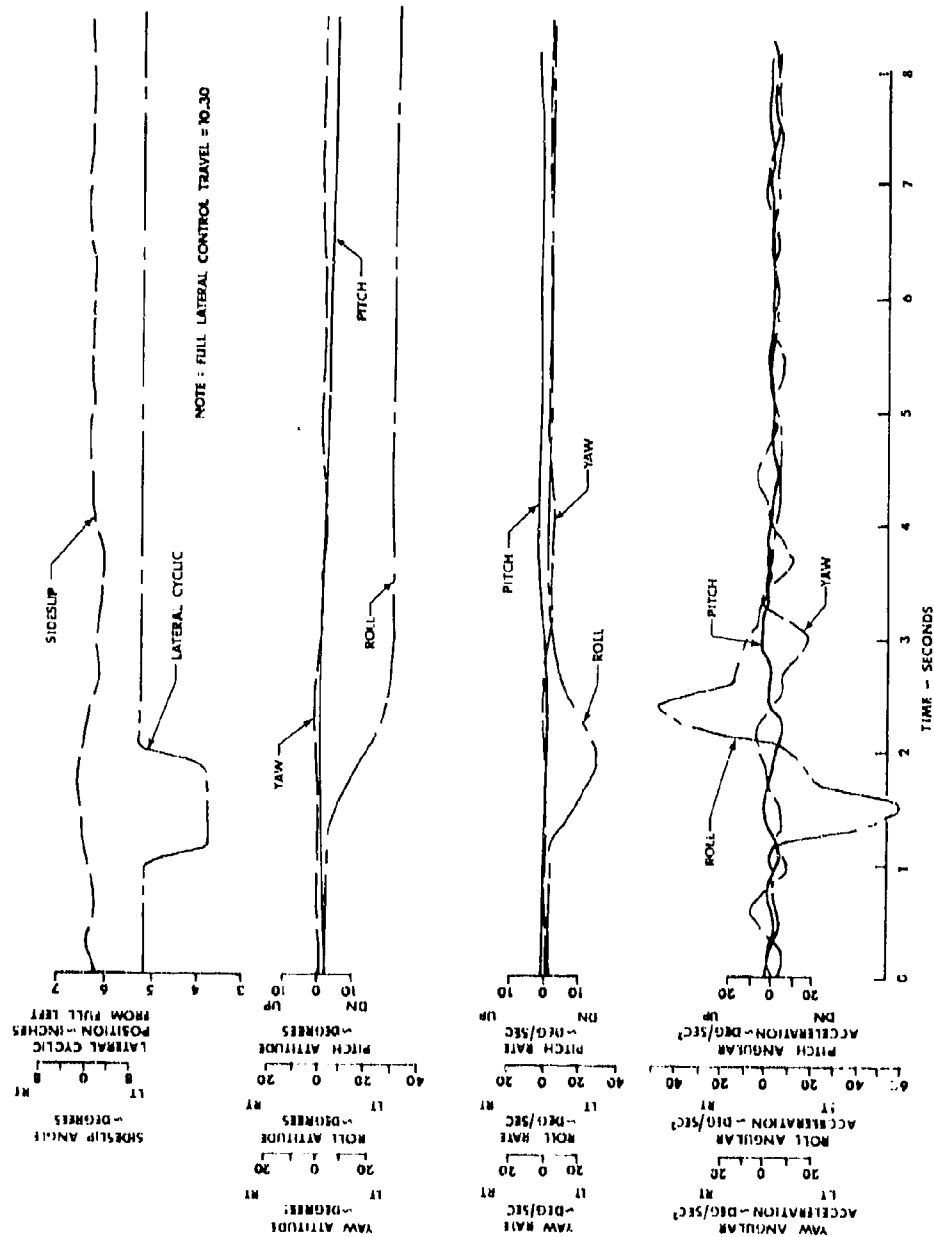


FIGURE 34
LATERAL PULSE IN LOW SPEED LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5960 FT
GROSS WEIGHT ~ 2720 LB
CG STATION ~ 107.0 IN (FWO)
CONFIGURATION ~ ARMED (DOORS ON)
CLIMB RATE ~ 49 FTS
ROTOR SPEED ~ 354 RPM

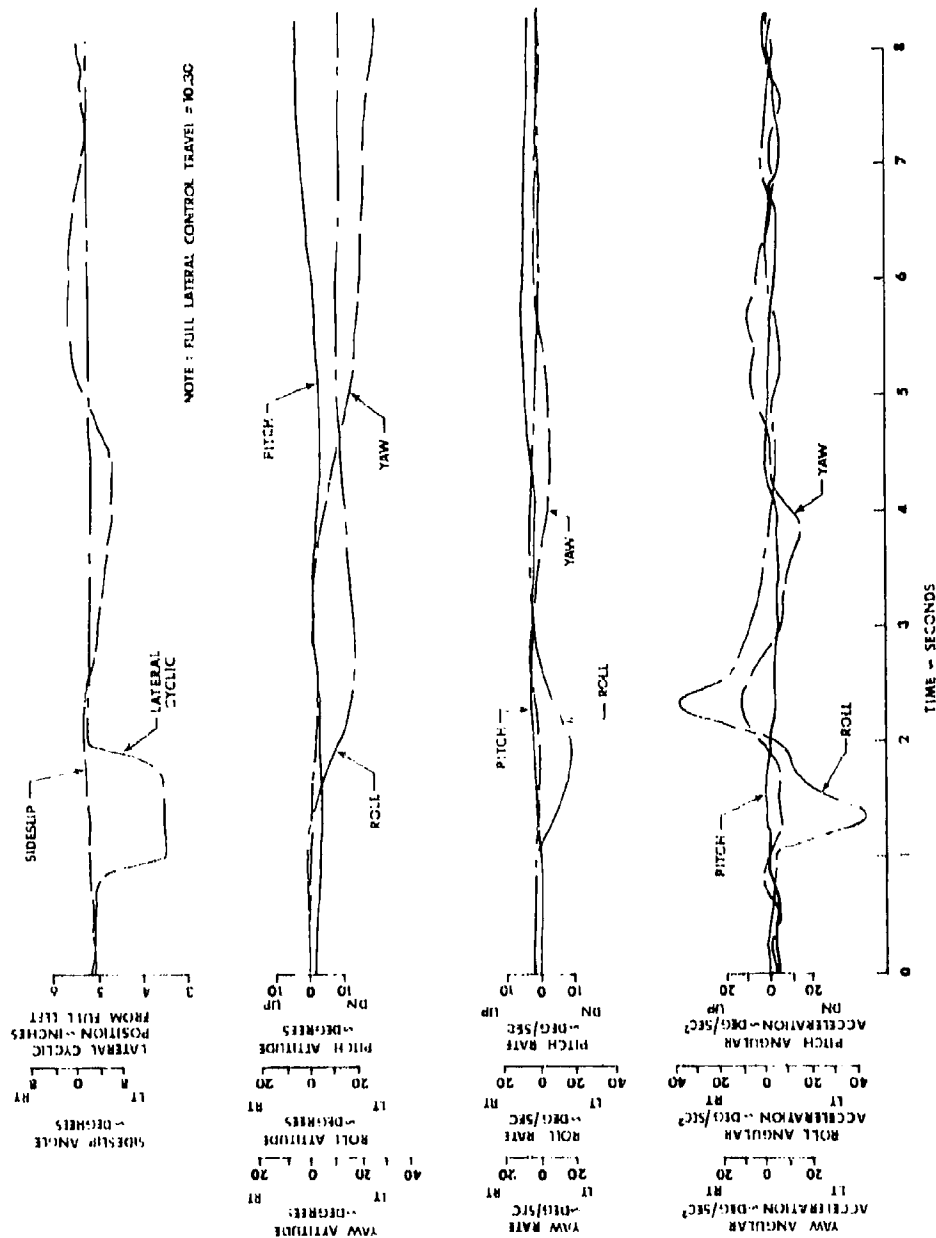


FIGURE 35
PEDAL PULSE IN HIGH SPEED LEVEL FLIGHT
OH-SEA USA S/N 68-16706

DENSITY ALTITUDE ~ 6060 FT
GROSS WEIGHT ~ 2540 LB
CALIBRATED AIRSPEED ~ 105 KTS
CG STATION ~ 106.9 IN (FWD)
ROTOR SPEED ~ 354 RPM
CONFIGURATION ~ ARMED (DOORS ON)

NOTE: FULL PEDAL CONTROL TRAVEL = 6.56 IN

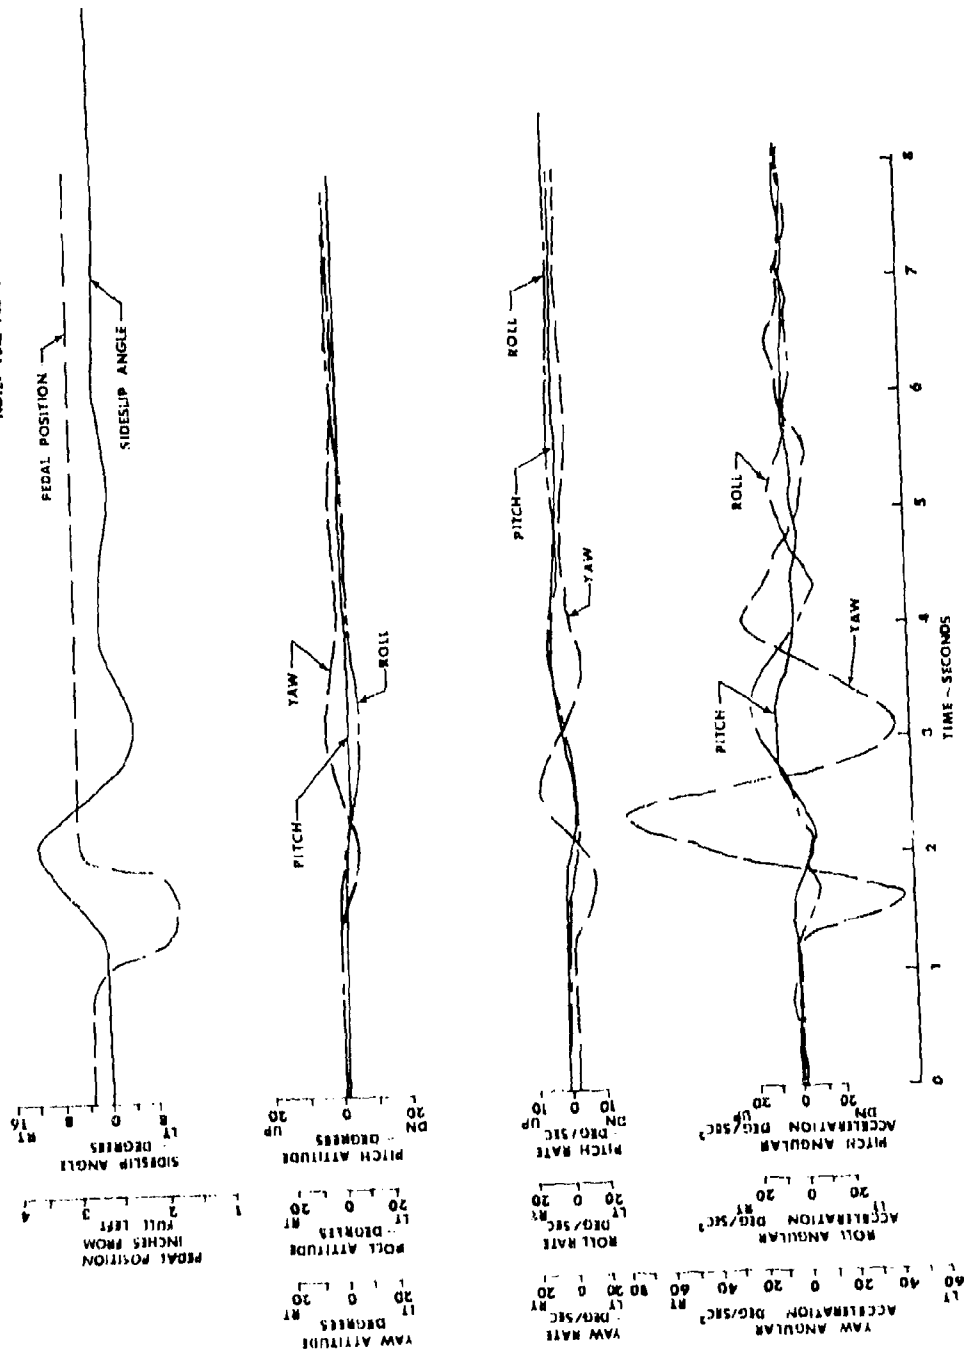


FIGURE 36
PEDAL PULSE IN LOW SPEED LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 6000 FT
GROSS WEIGHT ~ 2690 LB
CALIBRATED AIRSPEED ~ 48 KTS CG STATION ~ 1070 IN (FWD)
ROTOR SPEED ~ 354 RPM CONFIGURATION ~ ARMED (DOORS ON)

NOTE: FULL PEDAL CONTROL TRAVEL = 6.86 IN

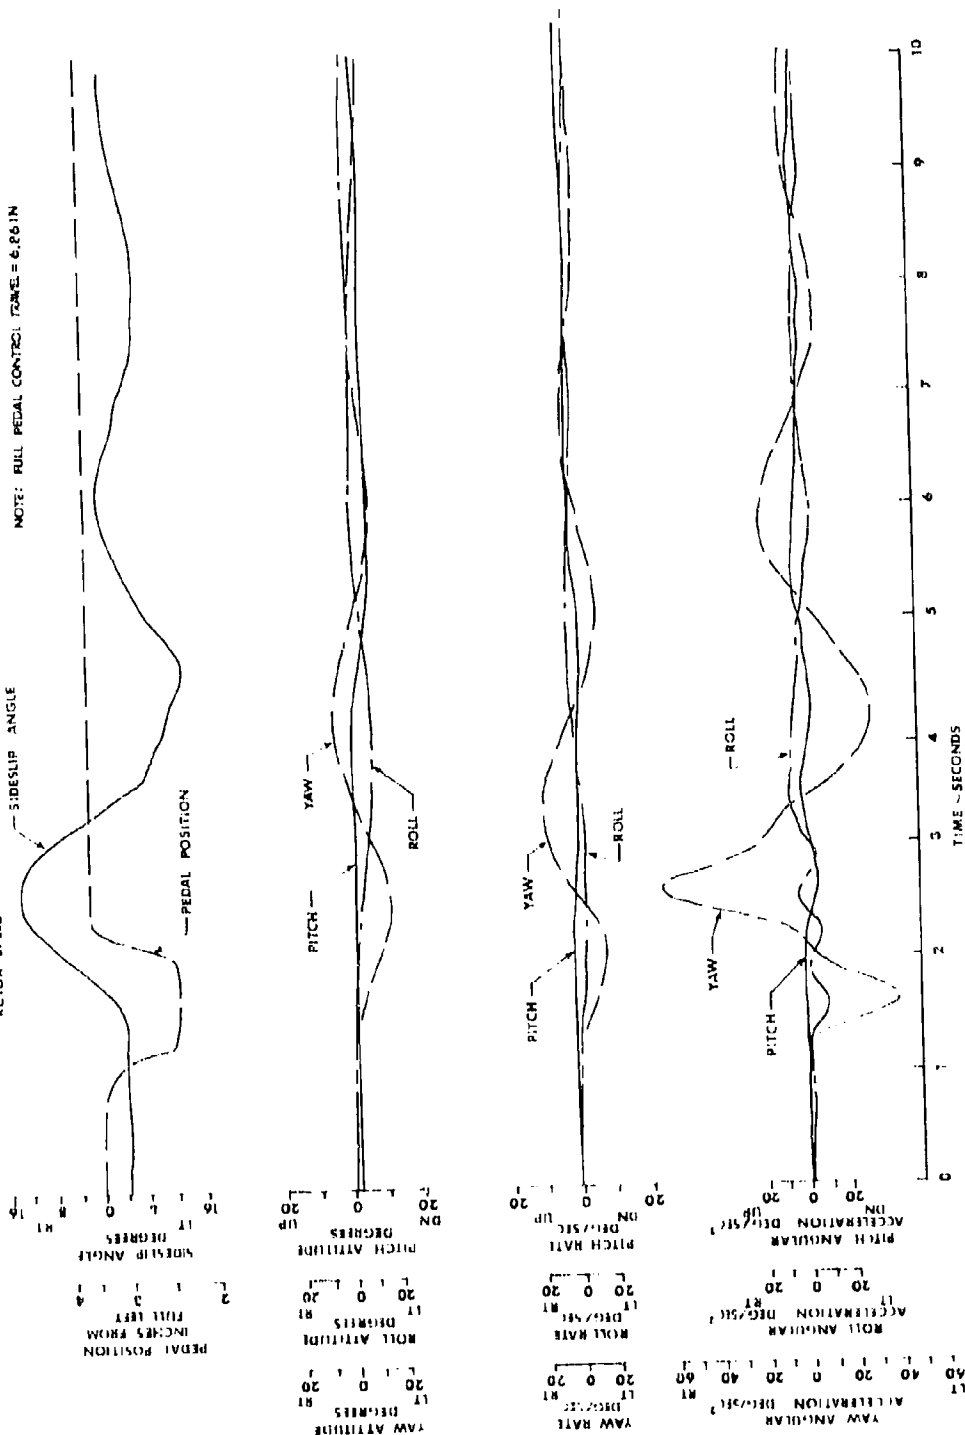


FIGURE 37 LONGITUDINAL SENSITIVITY AND RESPONSE SUMMARY OH-58A USA S/N 68-16706

SYMBOL	AVG GROSS WEIGHT~LB	AVG CG STATION~IN	DENSITY ALTITUDE~FT	ROTOR SPEED~RPM	FLIGHT CONDITION
○	2690	107.0 FWD	5940	354	LEVEL FLIGHT
⊗	2665	106.6 FWD	3910	354	HOVER
◇	2950	112.1 AFT	6140	354	LEVEL FLIGHT
⊙	2980	106.3 FWD	6320	354	LEVEL FLIGHT

GROSS WEIGHT AND CENTER OF GRAVITY COMPARISON

NOTE:

1. ARMED DOORS ON CONFIGURATION
2. OPEN SYMBOLS DENOTE PITCH UP
SHADED SYMBOLS DENOTE PITCH DOWN
3. THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUMS EXCEPT FOR THE HOVER RESPONSES WHICH WERE MEASURED AT 1 SECOND

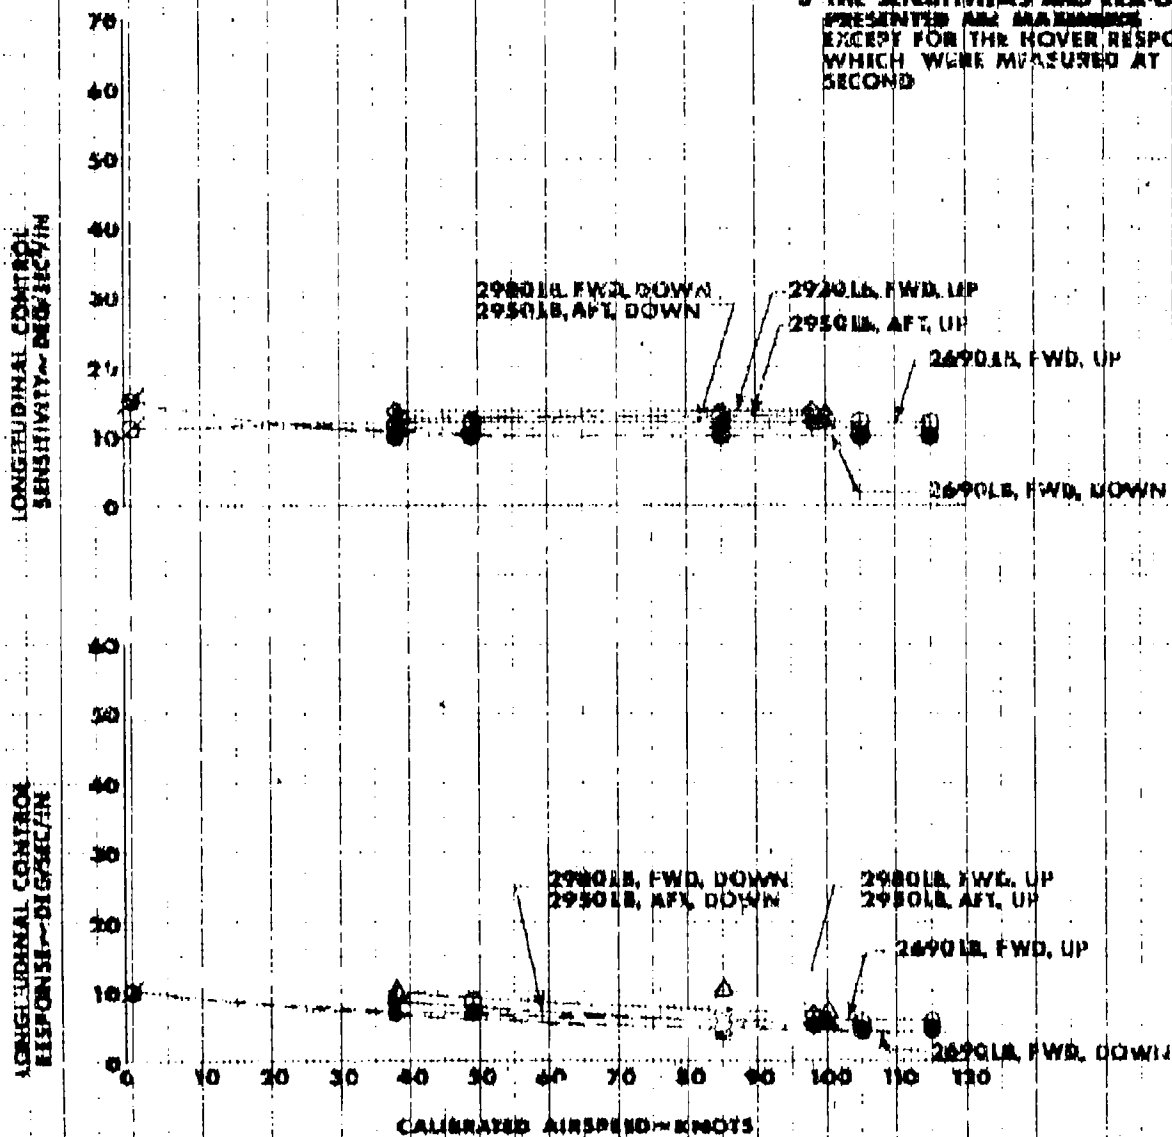


FIGURE 22
LONGITUDINAL SENSITIVITY AND RESPONSE SUMMARY
OH-55A USA S/N 52-16704

SYMBOL	AVG GROSS WEIGHT ~ LB	AVG CG STATION ~ IN	DENSITY ALTITUDE ~ FT	ROTOR SPEED ~ RPM	FLIGHT CONDITION
O B N B A	2690	107.0 FWD	5960	354	LEVEL FLIGHT
	2653	106.8 FWD	3910	354	HOVER
	2700	107.0 FWD	14900	354	LEVEL FLIGHT
	2535	109.9 MID	10830	354	HOVER
	2600	106.8 FWD	6080	354	CLIMB
	2600	106.8 FWD	6080	354	AUTOROTATION

ALTITUDE AND FLIGHT CONDITION COMPARISON

NOTE:

1. ARMED DOORS ON CONFIGURATION
2. OPEN SYMBOLS DENOTE PITCH UP
SHADE SYMBOLS DENOTE PITCH DOWN
3. THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUM EXCEPT FOR THE HOVER RESPONSES WHICH WERE MEASURED AT 1 SECOND

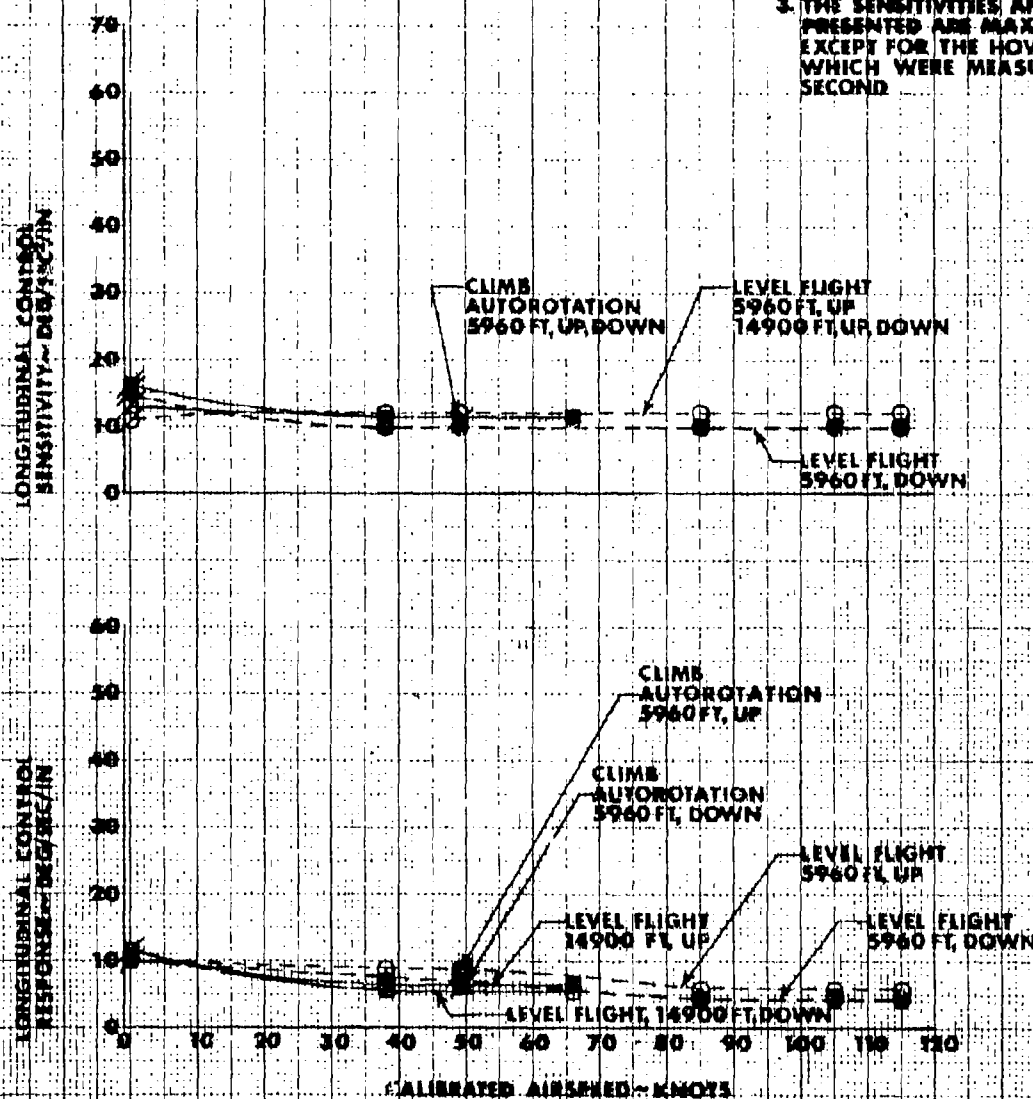


FIGURE 39
LATERAL SENSITIVITY AND RESPONSE SUMMARY
OH-58A USA S/N 68-16706

SYMBOL	AVG GROSS WEIGHT~LB	AVG CG STATION~IN	DENSITY ALTITUDE~FT	EDYOR SPEED~KPH	FLIGHT CONDITION
○	2700	107.0 FWD	5960	354	LEVEL FLIGHT
◊	2685	106.2 FWD	3910	354	HOVER
△	2835	112.0 AFT	6140	354	LEVEL FLIGHT
◐	2865	105.4 FWD	6320	354	LEVEL FLIGHT

GROSS WEIGHT AND CENTER OF GRAVITY COMPARISON

- NOTE:
1. ARMED DOORS ON CONFIGURATION
 2. OPEN SYMBOLS DENOTE RIGHT ROLL
SHADED SYMBOLS DENOTE LEFT ROLL
 3. THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUMS

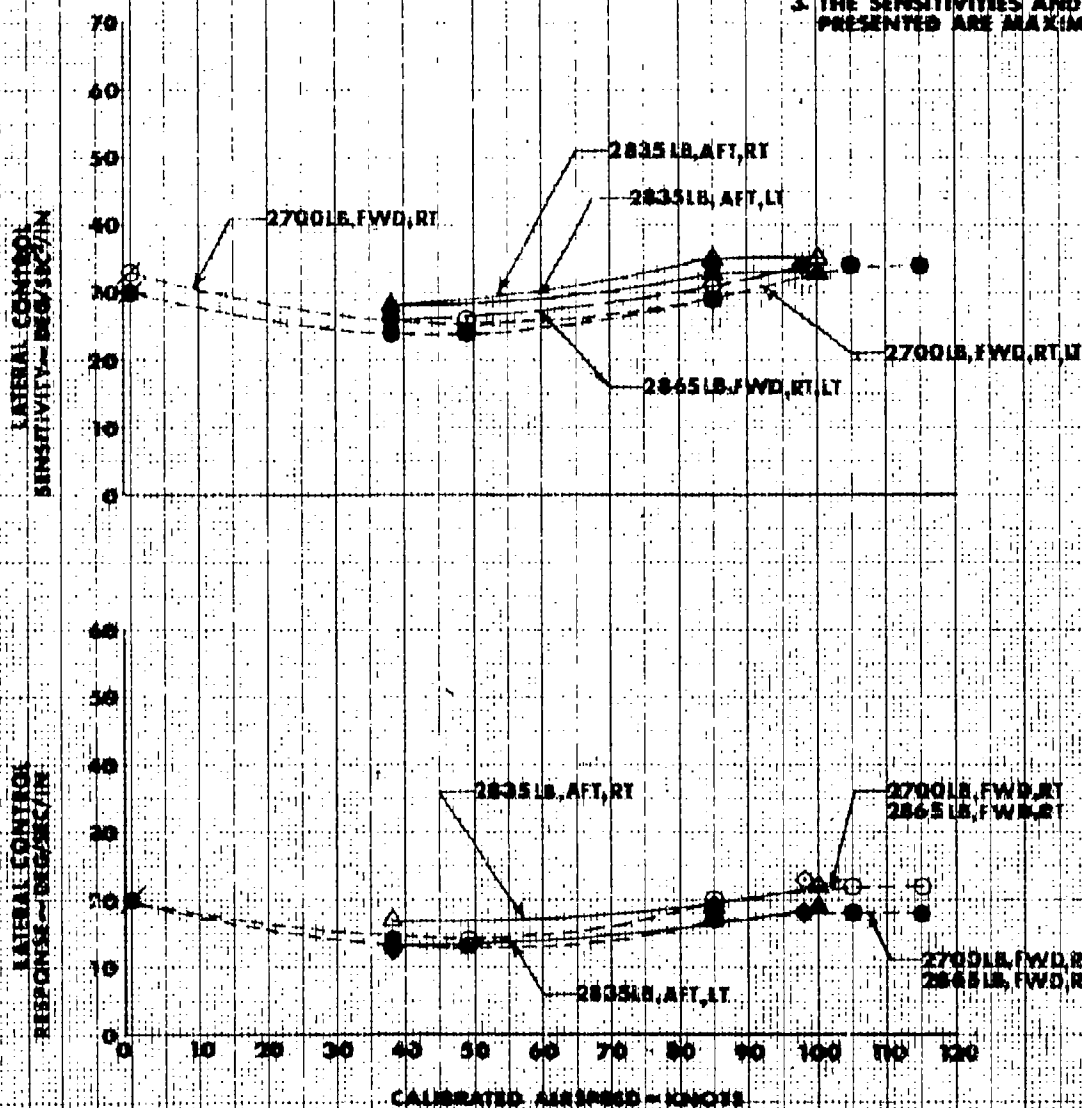


**FIGURE 10
LATERAL SENSITIVITY AND RESPONSE SUMMARY
OH-32A USA S/N 88-16704**

SYMBOL	AVG GROSS WEIGHT-LB	AVG CG STATION-IN	DENSITY ALTITUDE-FT	ROTOR SPEED-RPM	FLIGHT CONDITION
COPIRED	2750	107.8 FWD	5960	384	LEVEL FLIGHT
	2685	106.7 FWD	5910	384	HOVER
	2660	106.9 FWD	14900	384	LEVEL FLIGHT
	2510	109.1 MID	10620	384	HOVER
	2485	106.7 FWD	-30	384	HOVER
	2440	106.8 FWD	5960	384	CLIMB
	2440	106.8 FWD	5960	384	AUTOROTATION
	2440	106.8 FWD	5960	384	AUTOROTATION

NOTE:

1. ARMED DICES ON CONFIGURATION
2. OPEN SYMBOLS DENOTE RIGHT ROLL
SHADED SYMBOLS DENOTE LEFT ROLL
3. THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUM

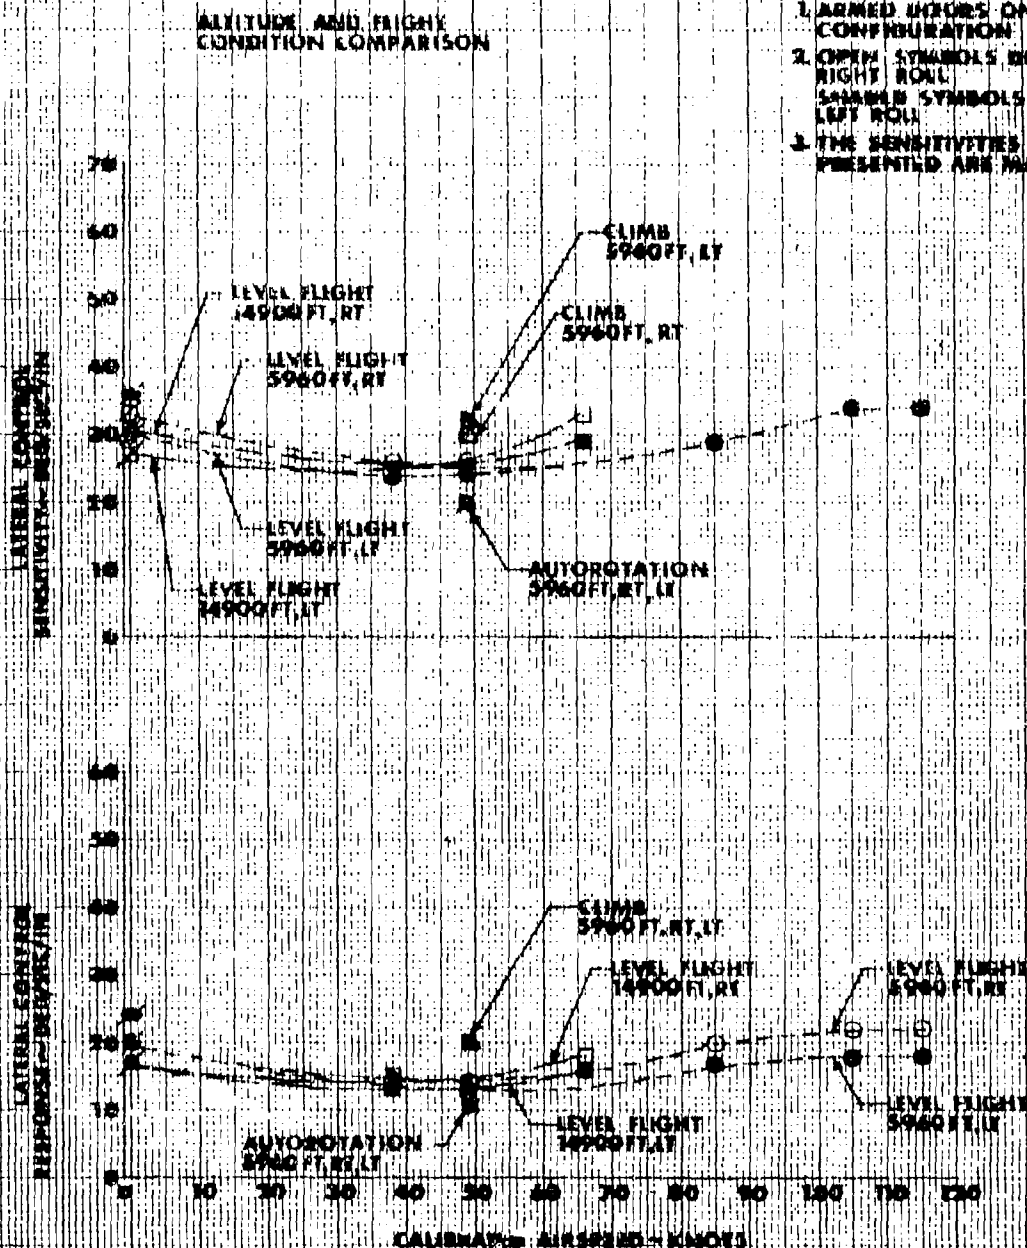


FIGURE 41 **DIRECTIONAL SENSITIVITY AND RESPONSE SUMMARY** **OH-58A USA S/N 68-16706**

SYMBOL	AVG GROSS WEIGHT ~ LB	AVG CG STATION ~ IN	DENSITY ALTITUDE ~ FT	ROTOR SPEED ~ RPM	FLIGHT CONDITION
○	2645	106.9 FWD	6060	354	LEVEL FLIGHT
◐	2640	106.2 FWD	4450	354	HOVER
△	2930	112.1 AFT	5780	354	LEVEL FLIGHT
◑	2930	104.0 FWD	6130	354	LEVEL FLIGHT

GROSS WEIGHT AND CENTER OF GRAVITY COMPARISON

NOTE:

1. ARMED DOORS ON CONFIGURATION
2. OPEN SYMBOLS DENOTE RIGHT YAW
SHADED SYMBOLS DENOTE LEFT YAW
3. THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUMS EXCEPT FOR THE HOVER RESPONSES WHICH WERE MEASURED AT 1 SECOND

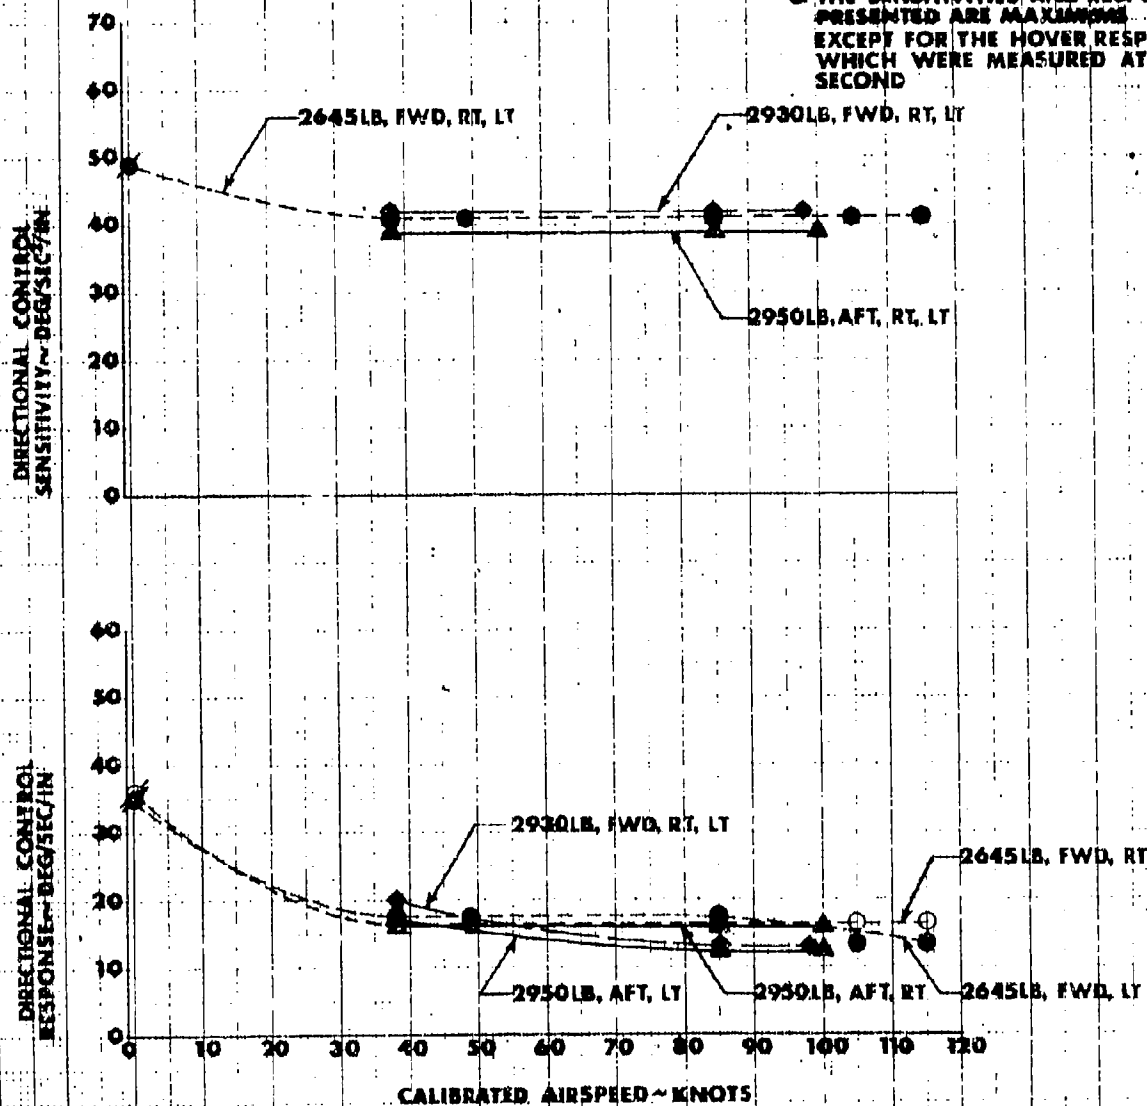



FIGURE 41
DIRECTIONAL SENSITIVITY AND RESPONSE SUMMARY
OH-58A USA S/N 68-16706

SYMBOL	AVG GROSS WEIGHT - LB	AVG CG STATION - IN	DENSITY ALTITUDE - FT	ROTOR SPEED - RPM	FLIGHT CONDITION
O P E N	2643	106.9 FWD	6060	354	LEVEL FLIGHT
	2640	106.2 FWD	4450	354	HOVER
	2620	105.8 FWD	14900	354	LEVEL FLIGHT
	2490	108.7 MID	10530	354	HOVER
	2600	105.9 FWD	-30	354	HOVER
	2535	106.4 FWD	6060	354	CLIMB
S H A D E D	2535	106.4 FWD	6060	354	CLIMB
	2535	106.4 FWD	6060	354	AUTOROTATION

ALTITUDE AND FLIGHT
CONDITION COMPARISON

NOTE:

- 1 ARMED DOORS ON CONFIGURATION
- 2 OPEN SYMBOLS DENOTE RIGHT YAW
SHADED SYMBOLS DENOTE LEFT YAW
- 3 THE SENSITIVITIES AND RESPONSES PRESENTED ARE MAXIMUMS EXCEPT FOR THE HOVER RESPONSES WHICH WERE MEASURED AT 1 SECOND

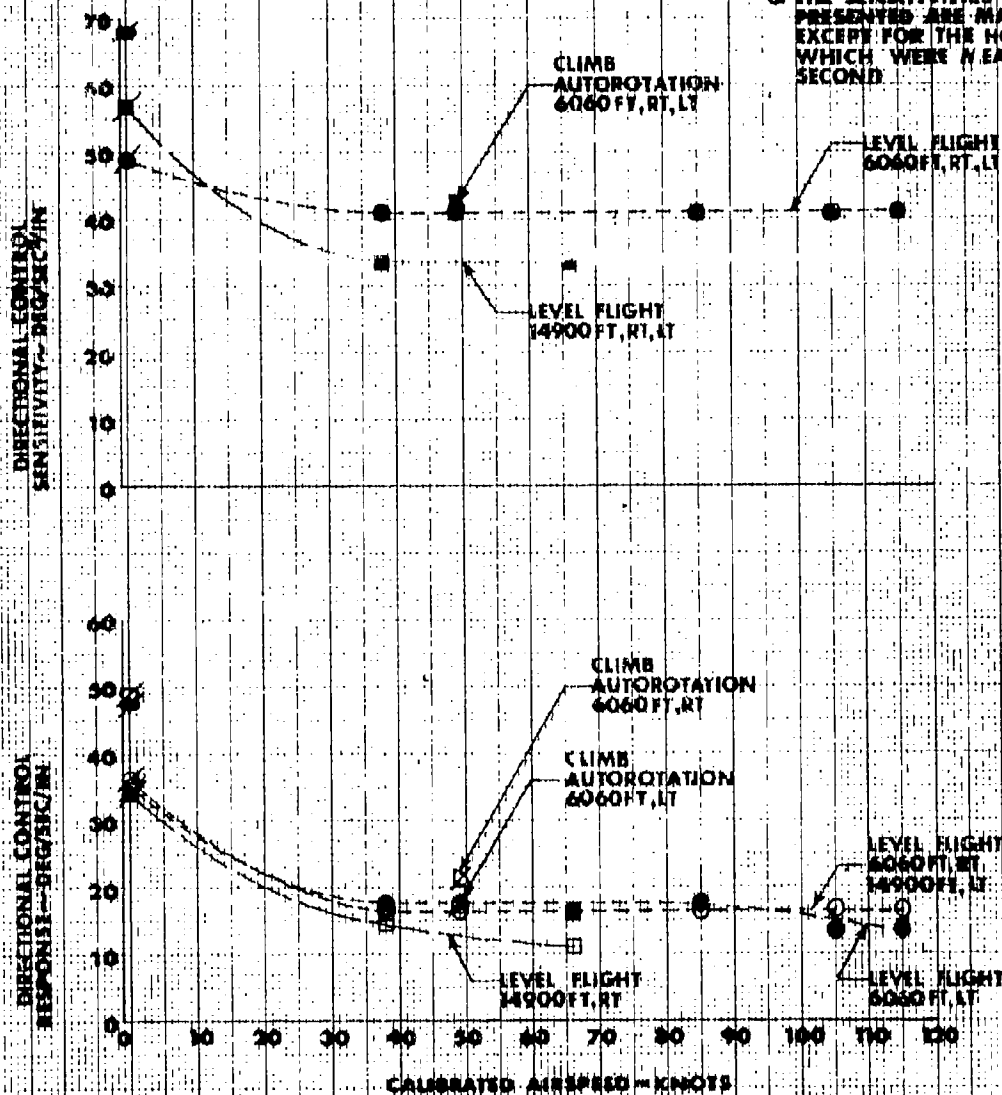

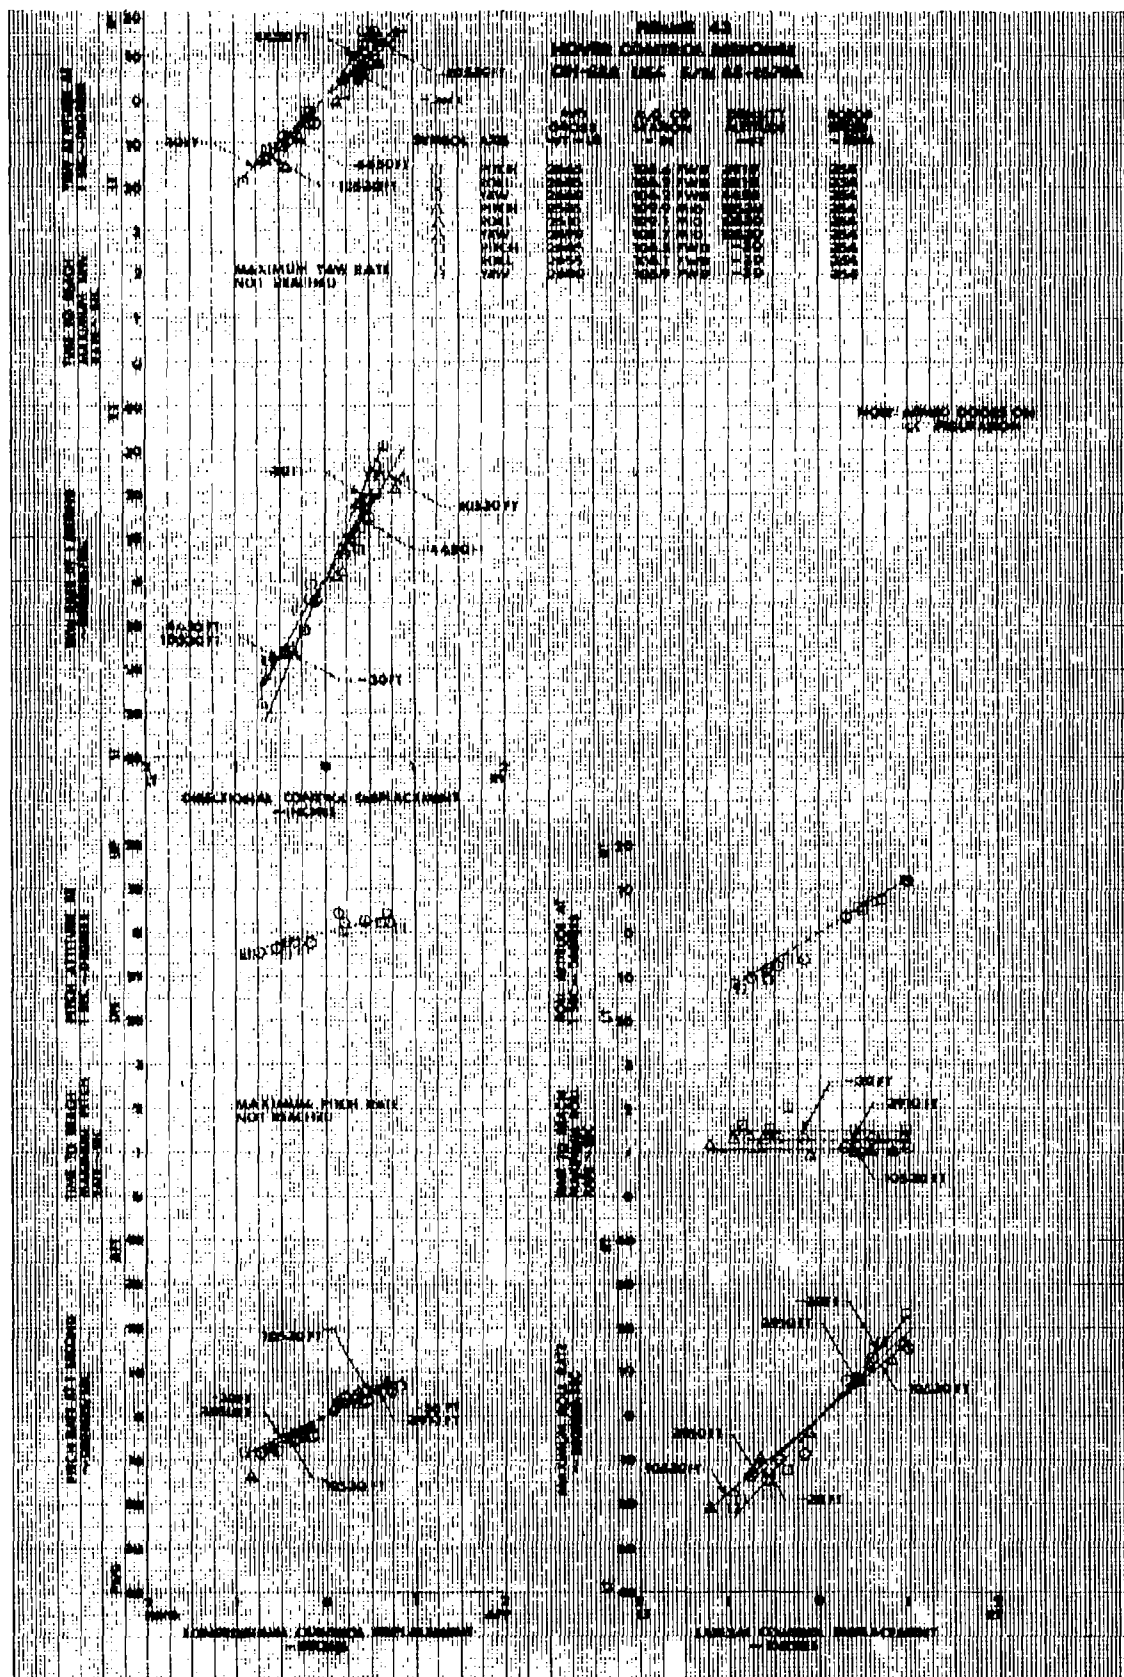


FIGURE 44 CONTROL RESPONSE ON-SEA USA S/N 48-46704

AXIS
PITCH
ROLL
YAW

AVG GROSS
WT ~ 12
2690
2700
2645

AVG CG
STATION ~ IN
1070 FWD
1070 FWD
1049 FWD



DENSITY
ALTITUDE ~ FT
6080
5940
6060


REFIN
SPEED ~ RPM
334
324
354

FLIGHT
CONDITION
LEVEL FLIGHT
LEVEL FLIGHT
LEVEL FLIGHT
LEVEL FLIGHT
DIVE

CLAMP
ARM PER
K
3P
49
85
105
115

NOTE: ARMED DOORS ON
CONFIGURATION

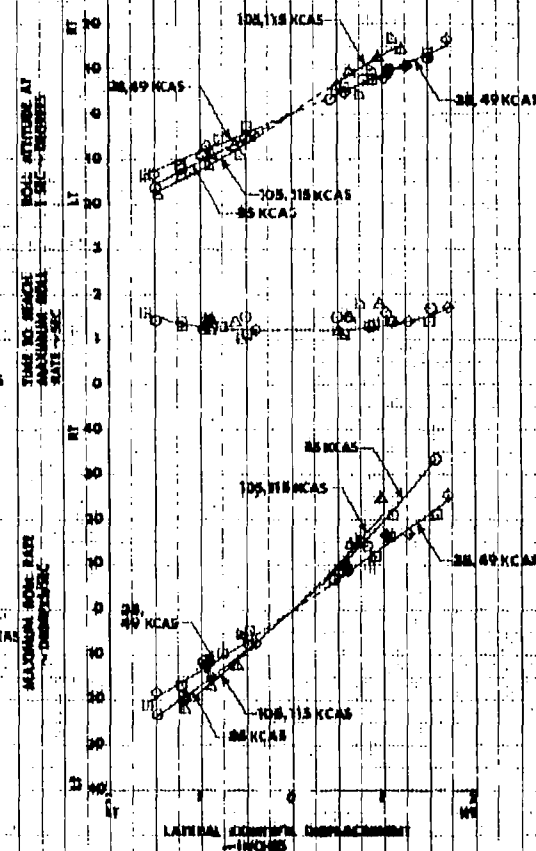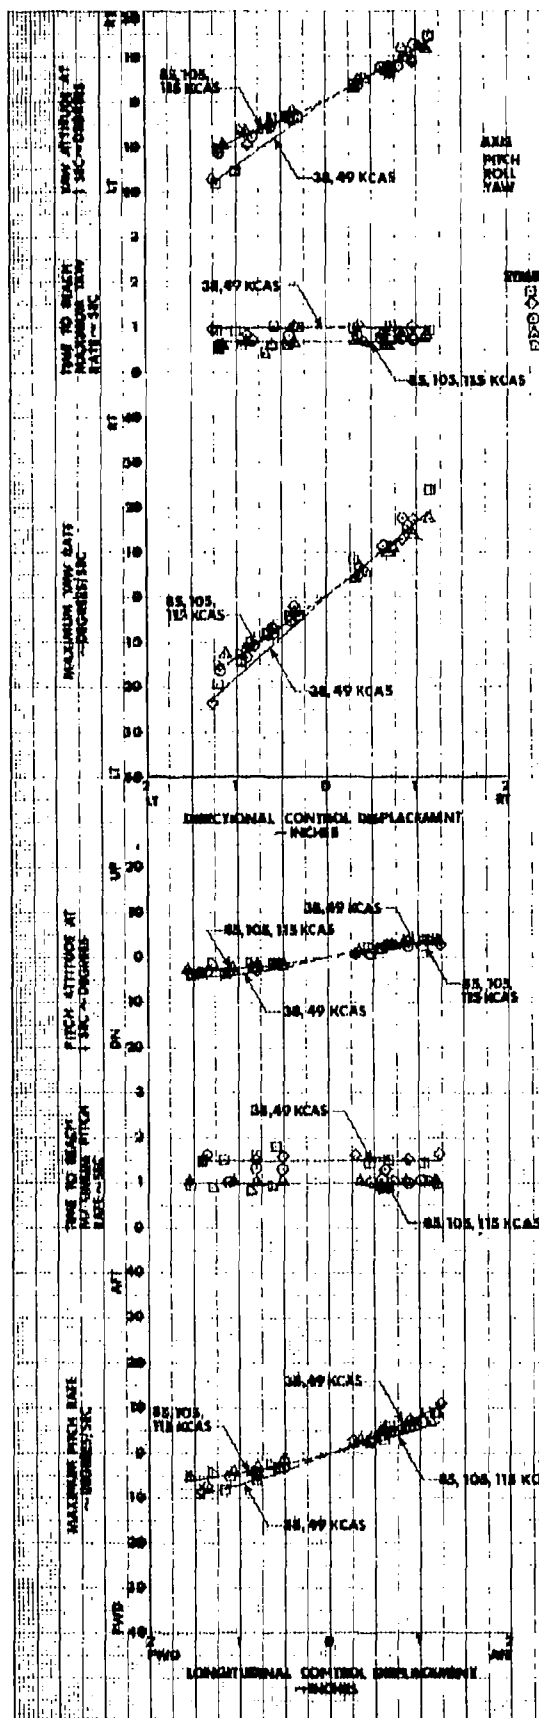

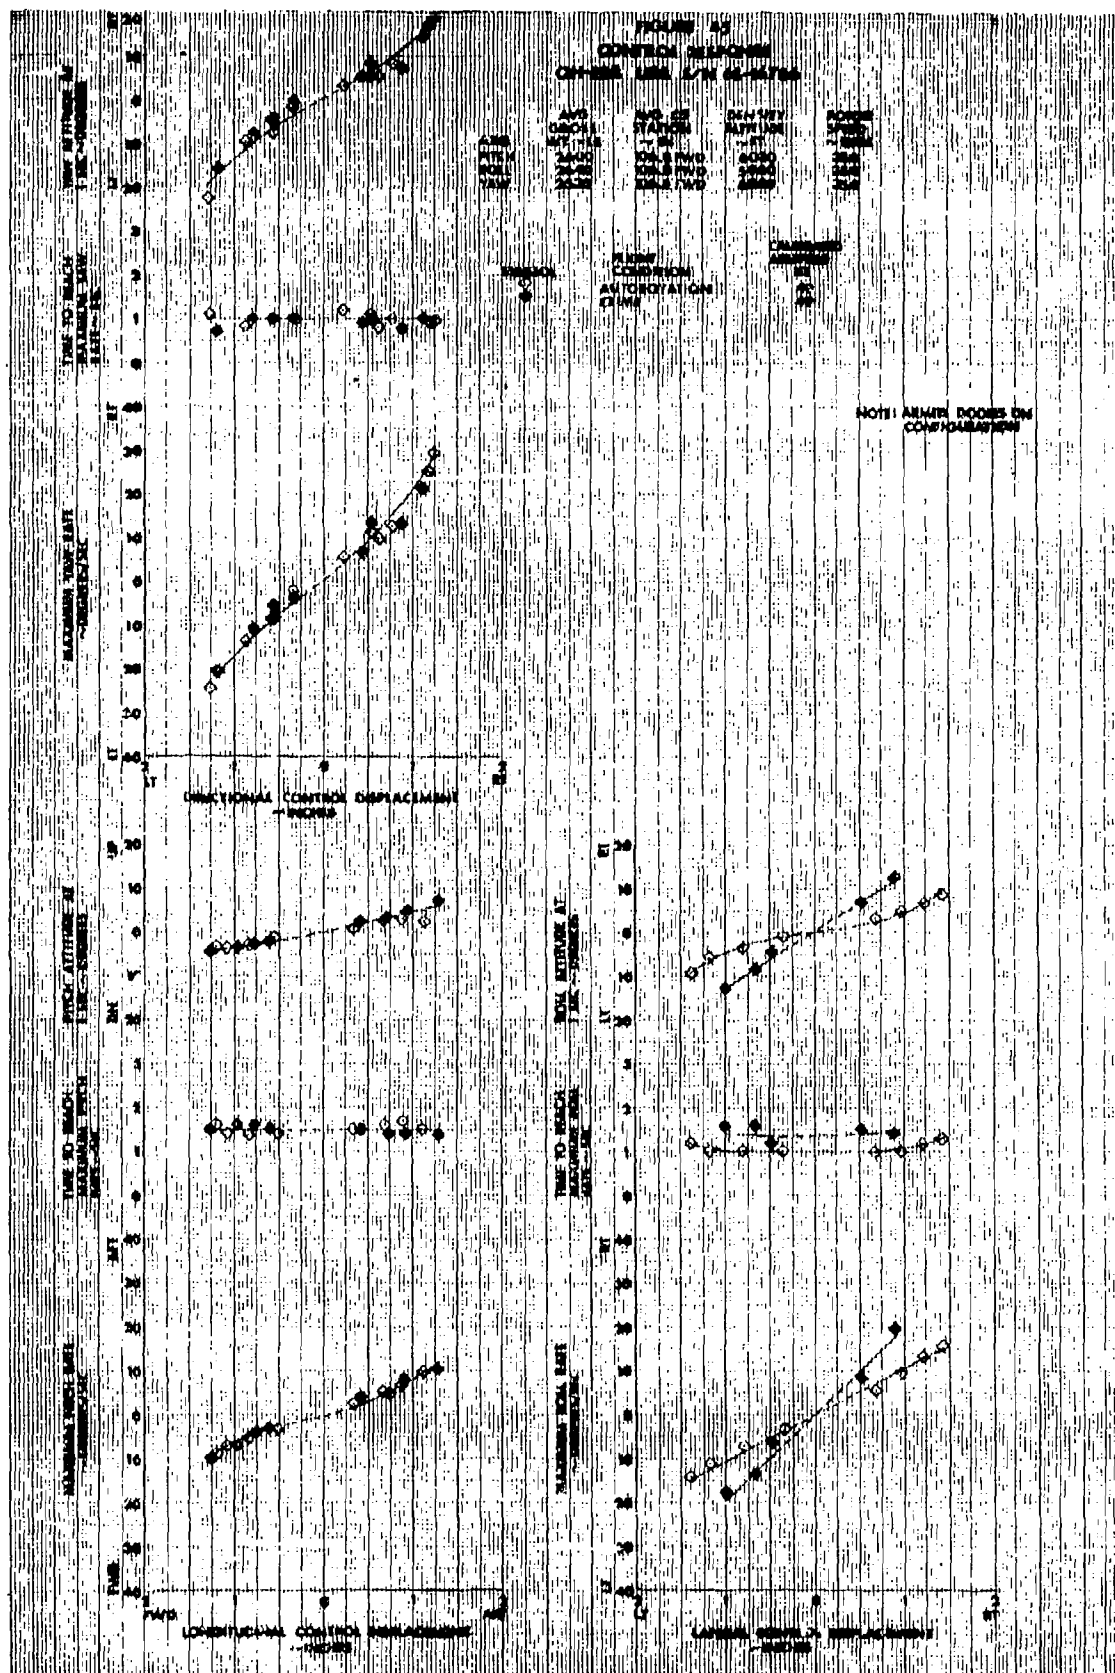







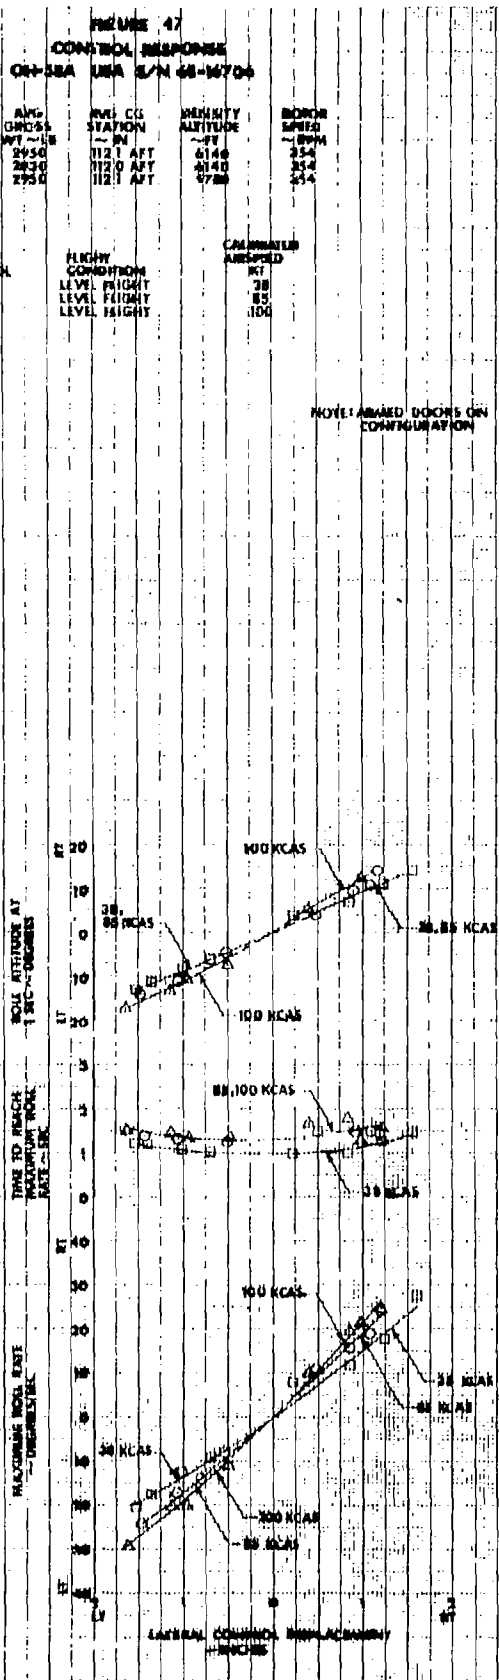


FIGURE 48
CONTROL RESPONSE
OH-55A USA S/N 88-16706

AUG GROSS WT ~ LB	AXIS PITCH	AVL CD STATION ~ IN	DENSITY ALTITUDE ~ FT	ROTOR SPEED ~ RPM
2700	2680	107.0 (WD)	14900	354
	ROLL	106.9 (FWD)	14900	354
	YAW	106.8 (FWD)		354




SYMBOL	FLIGHT CONDITION	FAIRBATED AIRSPEED
△	LEVEL FLIGHT	KT
△	LEVEL FLIGHT	65

NOTE: ARMED DOORS ON CONFIGURATION

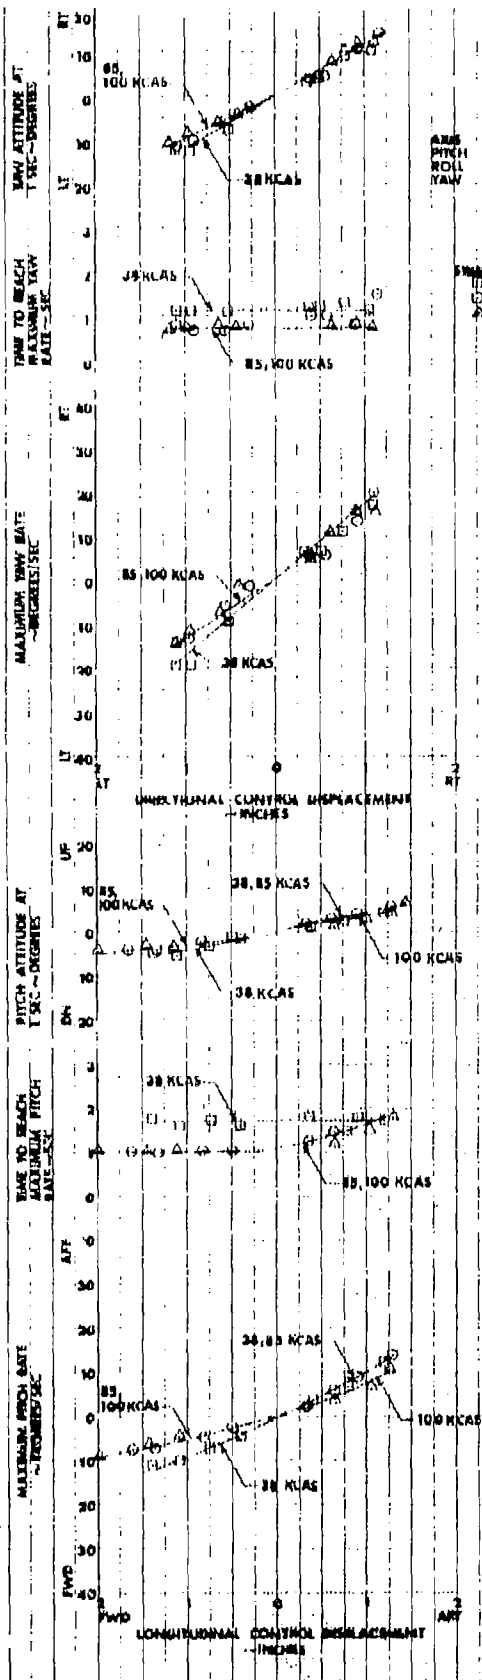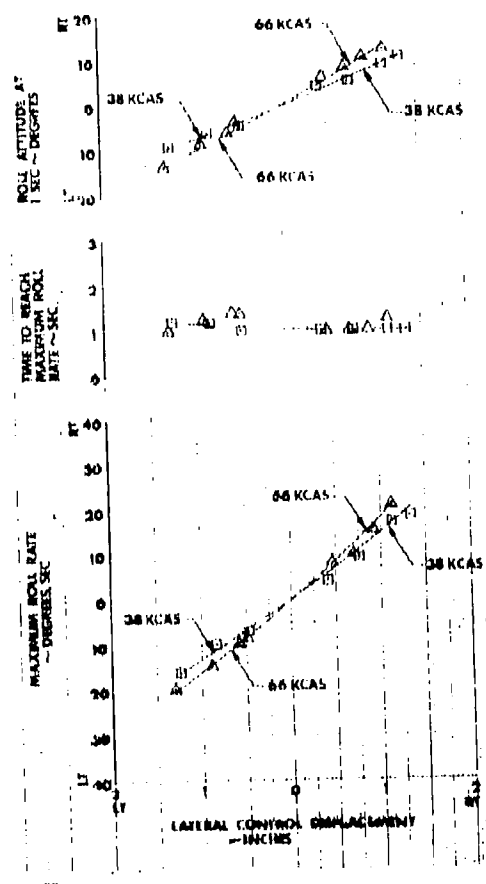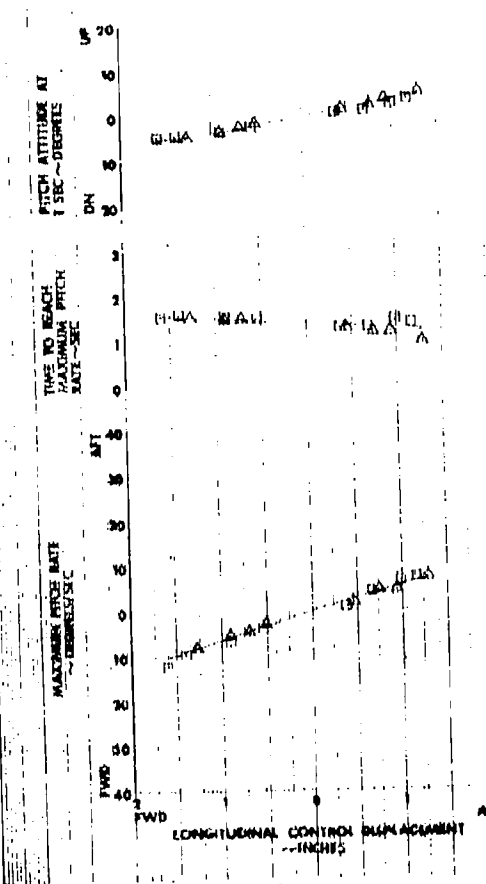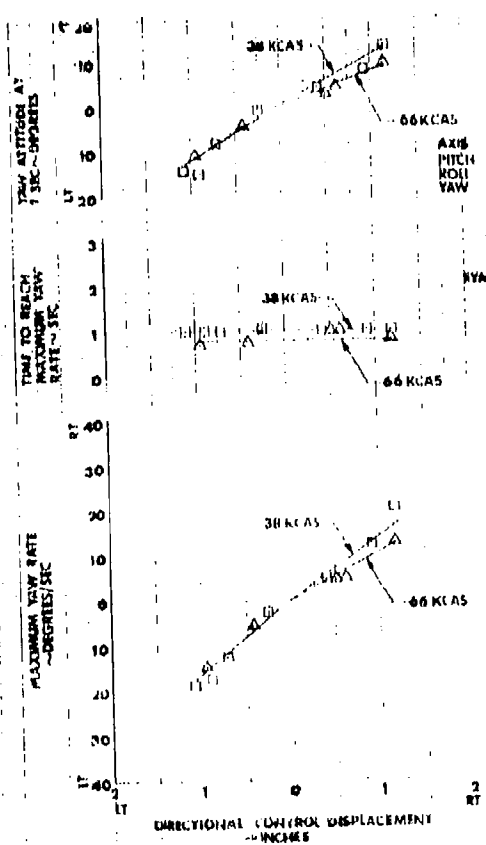

00000000

ALT DRESS	ALT CL. STATION	CHASITY ALTITUDE	REPORT SPEED
WT-18	-18	-17	-18-19
2645	105.6 TWE	3390	234
2655	106.2 DVE	3310	234
2650	106.2 DVE	4480	234
2658	105.9 DVE	10530	234
2710	106.1 DVE	10530	234
2740	106.7 DVE	10530	234
2805	106.5 DVE	-30	234
2815	106.1 DVE	-30	234
2830	106.5 DVE	-30	234

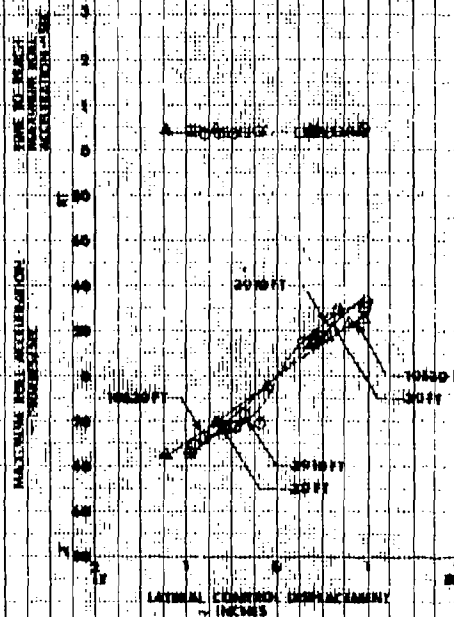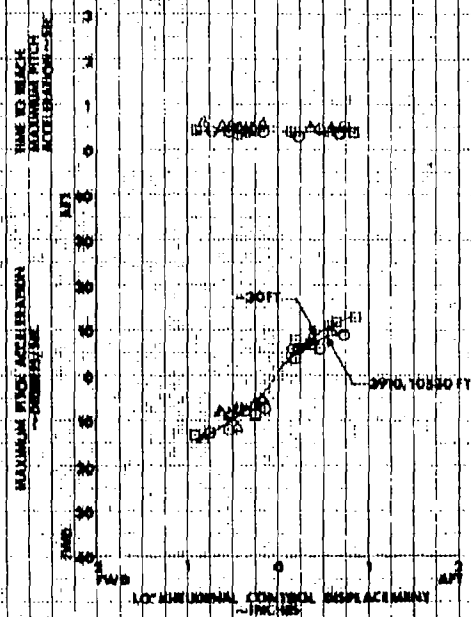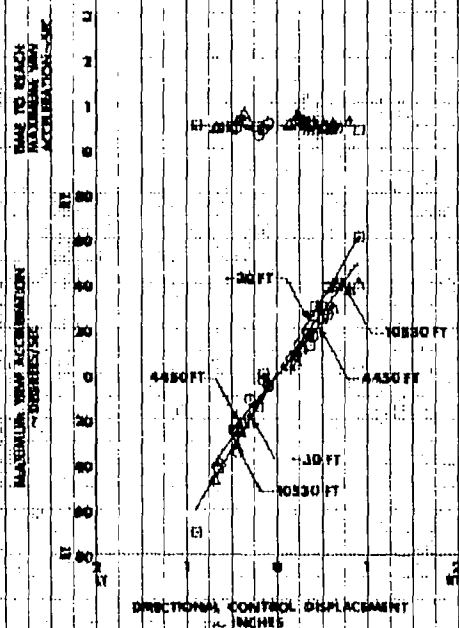

NOTE: ARMED DOORS ON
CONFINEMENT


FIGURE 50
CONTROL SENSITIVITY
ON-SEA USA L/N 48-16704

AXIS	AVG. CG	AVG. CG	DENSITY	ENTER
PITCH	WT - LB	SECTION	AUTUMN	SPEED
ROLL	2400	- IN	- FT	700
YAW	2700	100.0 FWD	6000	354
	2450	100.0 FWD	5000	354
		104.0 FWD	6040	354


SYMBOL	FLIGHT CONDITION
□	LEVEL FLIGHT
○	LEVEL FLIGHT
△	LEVEL FLIGHT
◇	DIVE

CALIBRATED AIRSPEED - KNOTS
38
49
85
108
115


TIME TO REACH
MAXIMUM ROLL
ACCELERATION - SEC

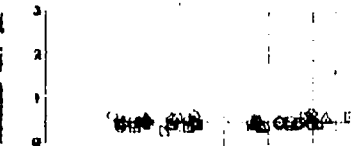


MAXIMUM ROLL ACCELERATION
- DEGREES/SEC

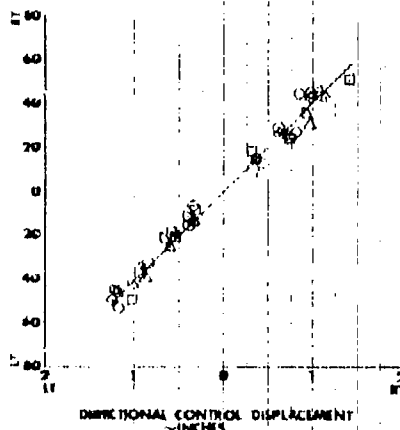


TIME TO REACH
MAXIMUM PITCH
ACCELERATION - SEC

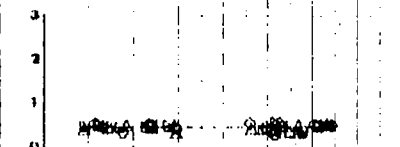


MAXIMUM PITCH ACCELERATION
- DEGREES/SEC

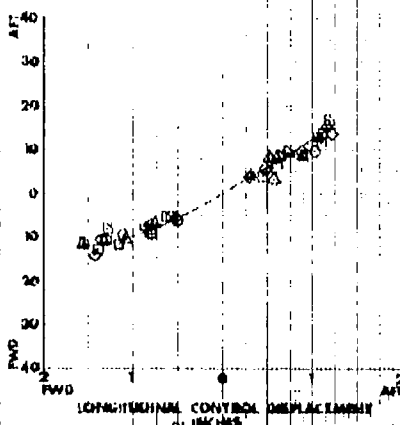

TIME TO REACH
MAXIMUM ROLL
ACCELERATION - SEC

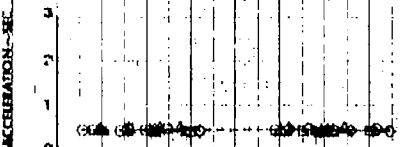

MAXIMUM ROLL ACCELERATION
- DEGREES/SEC


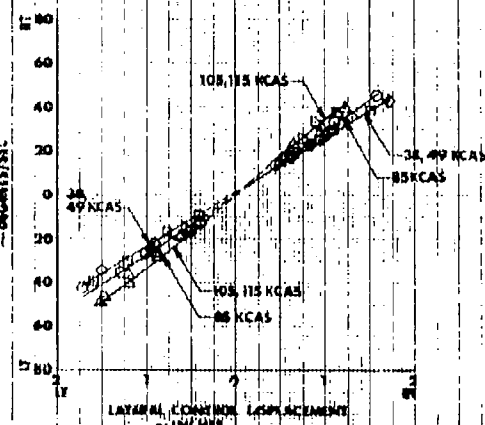


MULTI-ARMED DOORS ON
CONFIGURATION

ARRS PTCH RWL RWL	ARRS PTCH RWL RWL	ARRS PTCH RWL RWL	ARRS PTCH RWL RWL	ARRS PTCH RWL RWL
2230	2230	2230	2230	2230
2230	2230	2230	2230	2230
2230	2230	2230	2230	2230

FLIGHT
CONTINUATION
AUTOROTATION
CIRCL

**CALIFORNIA
AIR SPEED
#10005**


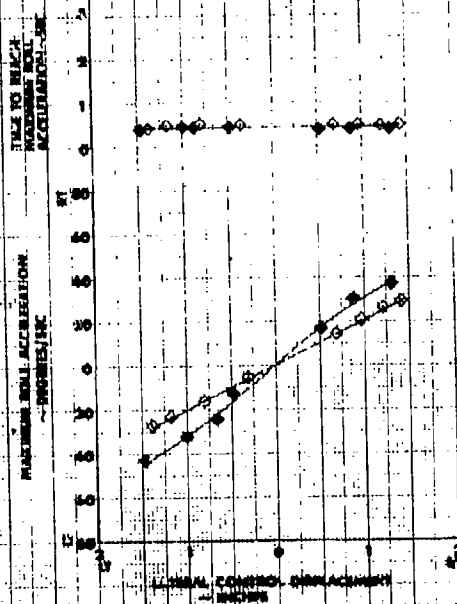



TIME	AVG CATCHES PER IN	AVG CG PER IN	DENSITY AIR/INCH	NOTES SPEED PER IN
AMES	2.76	126.5 FWD	6320	354
PITCH	2.86	126.5 FWD	6320	354
ROLL	2.86	126.5 FWD	6320	354
YAW	2.86	126.5 FWD	6320	354



FIGURE 23
CONTROL SENSITIVITY
ON-SEA USA 12N 25-1970S

ALB FITCH 1947	AND STOCK MT-1A 1950 1950 1950	AND CO STATION 112 JAN 112 JAN 112 JAN	SENTRY STATION 112 112 112	ROCK STATION 112 112 112
PERIOD 1947	PERIOD 1950	PERIOD 1950	PERIOD 1950	PERIOD 1950
LEVEL RIGHT LEVEL RIGHT LEVEL RIGHT	LEVEL RIGHT LEVEL RIGHT LEVEL RIGHT	LEVEL RIGHT LEVEL RIGHT LEVEL RIGHT	LEVEL RIGHT LEVEL RIGHT LEVEL RIGHT	LEVEL RIGHT LEVEL RIGHT LEVEL RIGHT

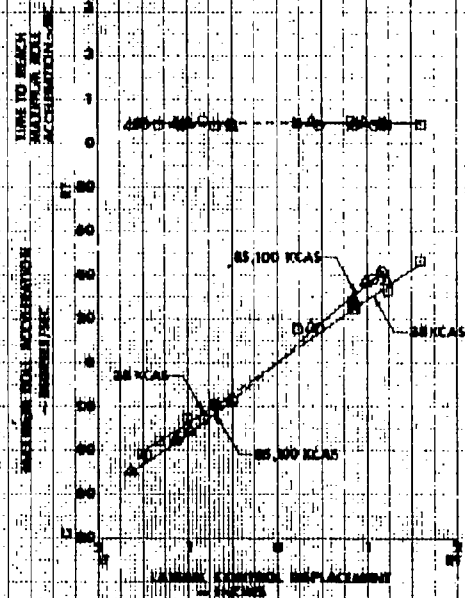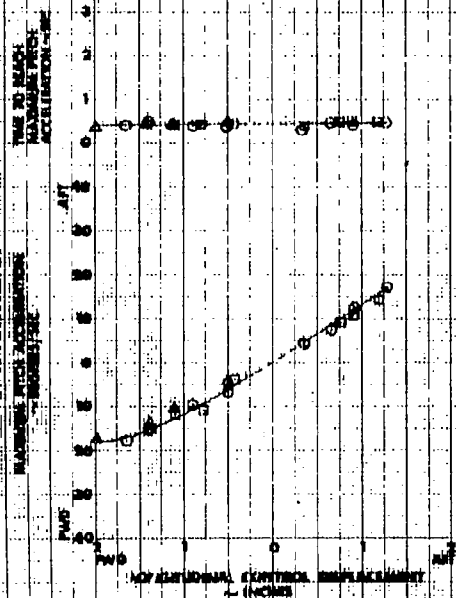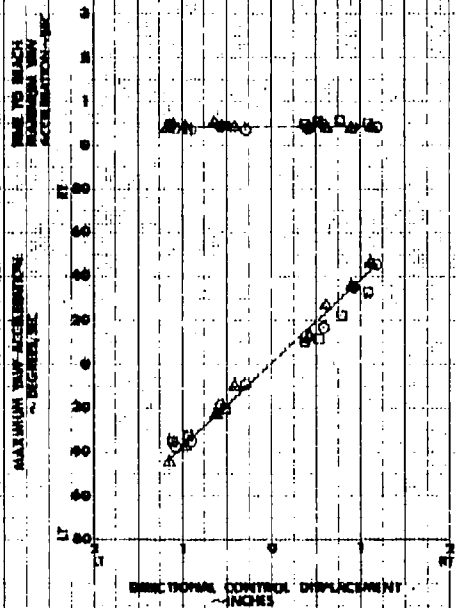

NOTE: VALUES SHOWN ON COMPARISON

FIGURE 84
CONTROL SENSITIVITY
ON-SEA USA S/N 48-14706

AVG GROSS WEIGHT 2450	AVG CG STATION 107.0 104.9 FWD 104.8 FWD	DENSITY AIRFUEL 1.2250 1.2250	NOYON SPRUE 1.000 1.000
AVG ROLL YAW			

FLIGHT
CONDITION
LEVEL FLIGHT
LEVEL FLIGHT

CANIBATED
AIRFUEL
1.2250
1.2250

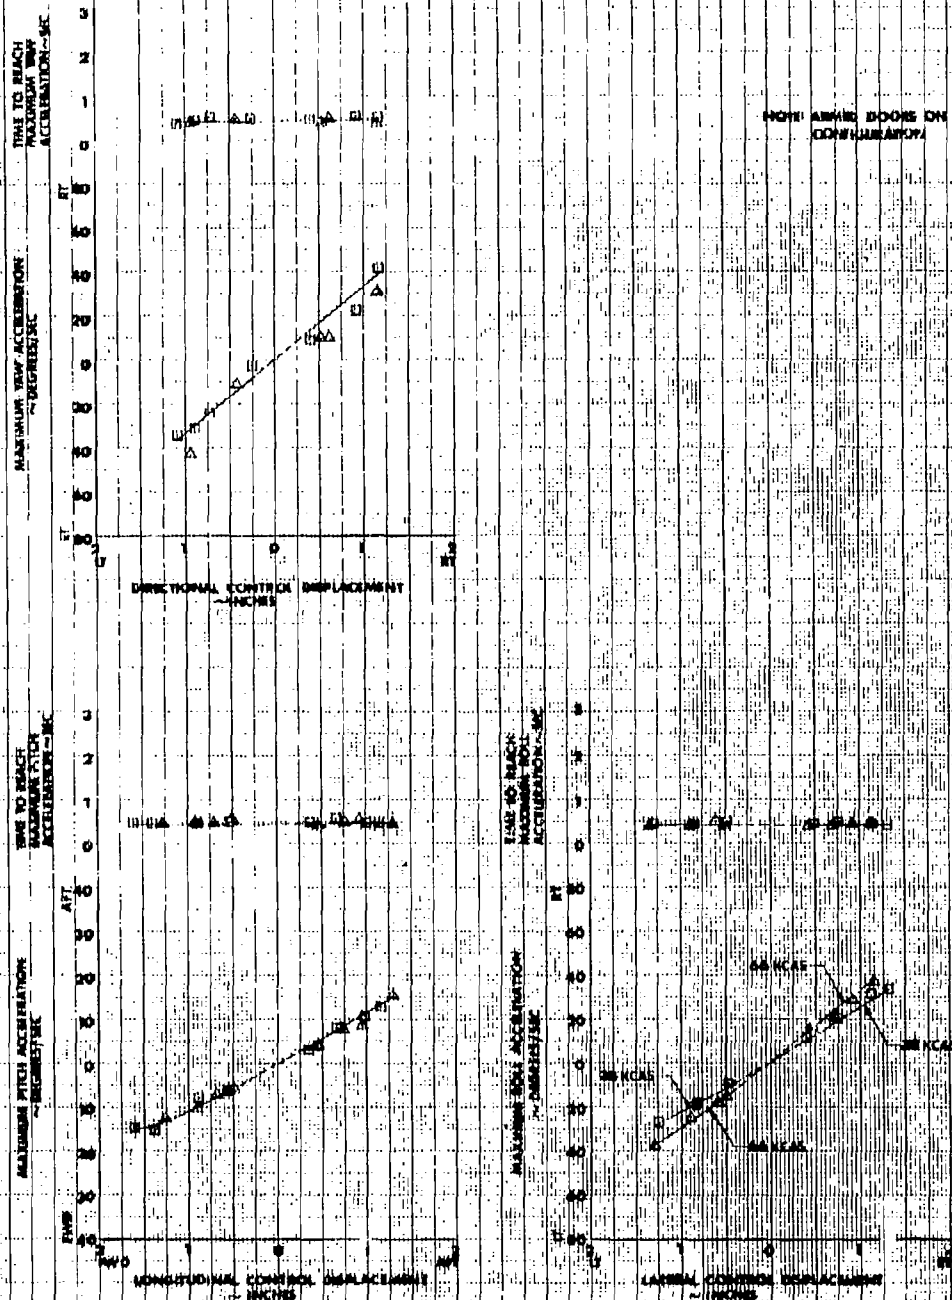


FIGURE 55
LONGITUDINAL STEP IN LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 6000 FT
CALIBRATED AIRSPEED ~ 85 KTS
ROTIC R SPEED ~ 354 RPM
GROSS WEIGHT ~ 2680 LB
CG STATION ~ 1070 IN (FWD)
CONFIGURATION ~ ARMED (DOORS DN)

NOTE: FULL LONGITUDINAL CONTROL TRAVEL = 12.00 IN

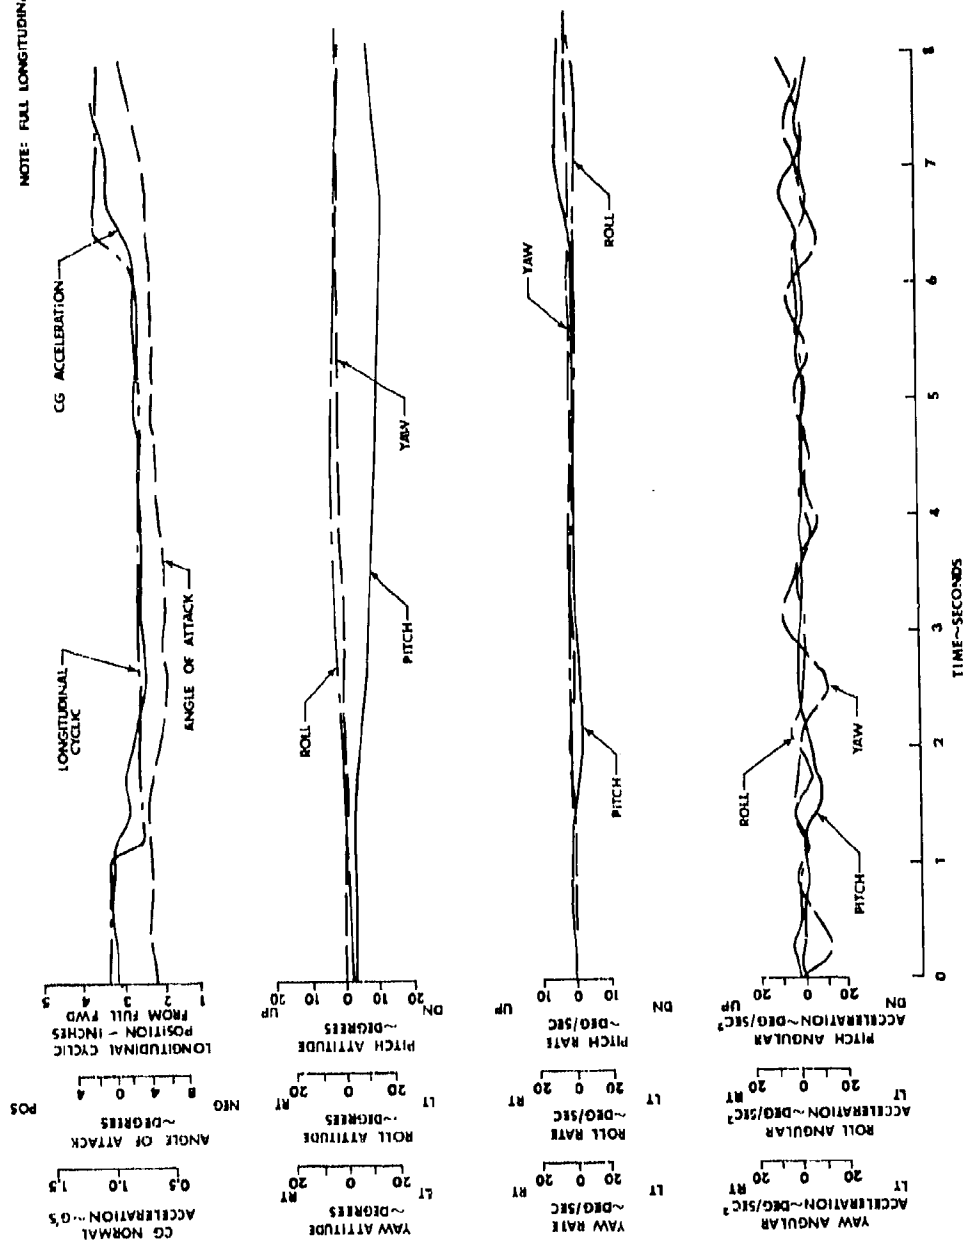


FIGURE 56
LATERAL STEP IN LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE - 5960 FT
CALIBRATED AIRSPEED - 102 KTS
ROTOR SPEED - 354 RPM
GROSS WEIGHT - 2690 LB
CG STATION - 1070 IN (FWD)
CONFIGURATION - ARMED (DOORS ON)

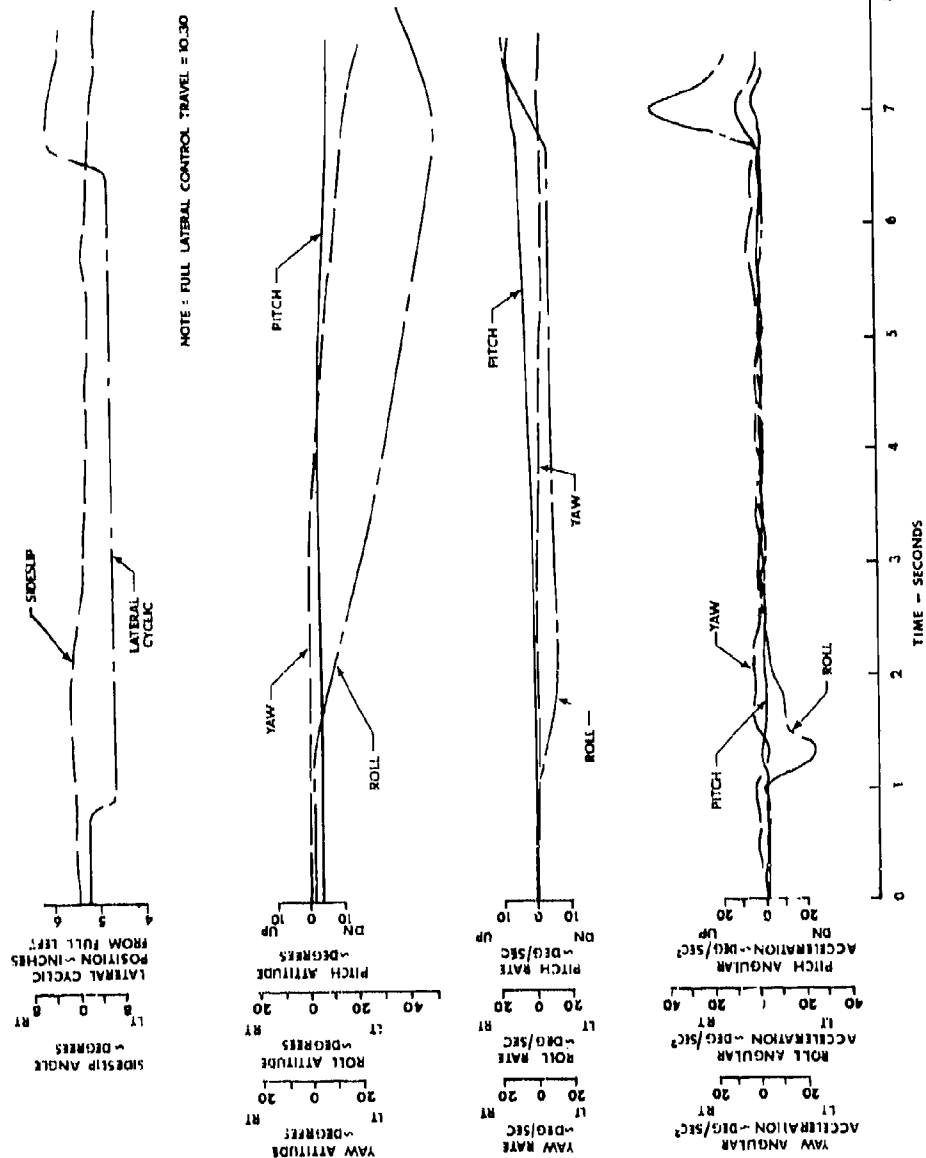


FIGURE 57
RIGHT PEDAL STEP IN HOVER
OH-58A USA S/N 68-M706

DENSITY ALTITUDE ~ -940 FT
CALIBRATE AIRSPEED ~ HOVER
MOTOR SPEED ~ 354 RPM

GROSS WEIGHT ~ 3025 LB

CG STATION ~ 112.8 IN (AFT)

CONFIGURATION ~ ARMED (DOORS ON)

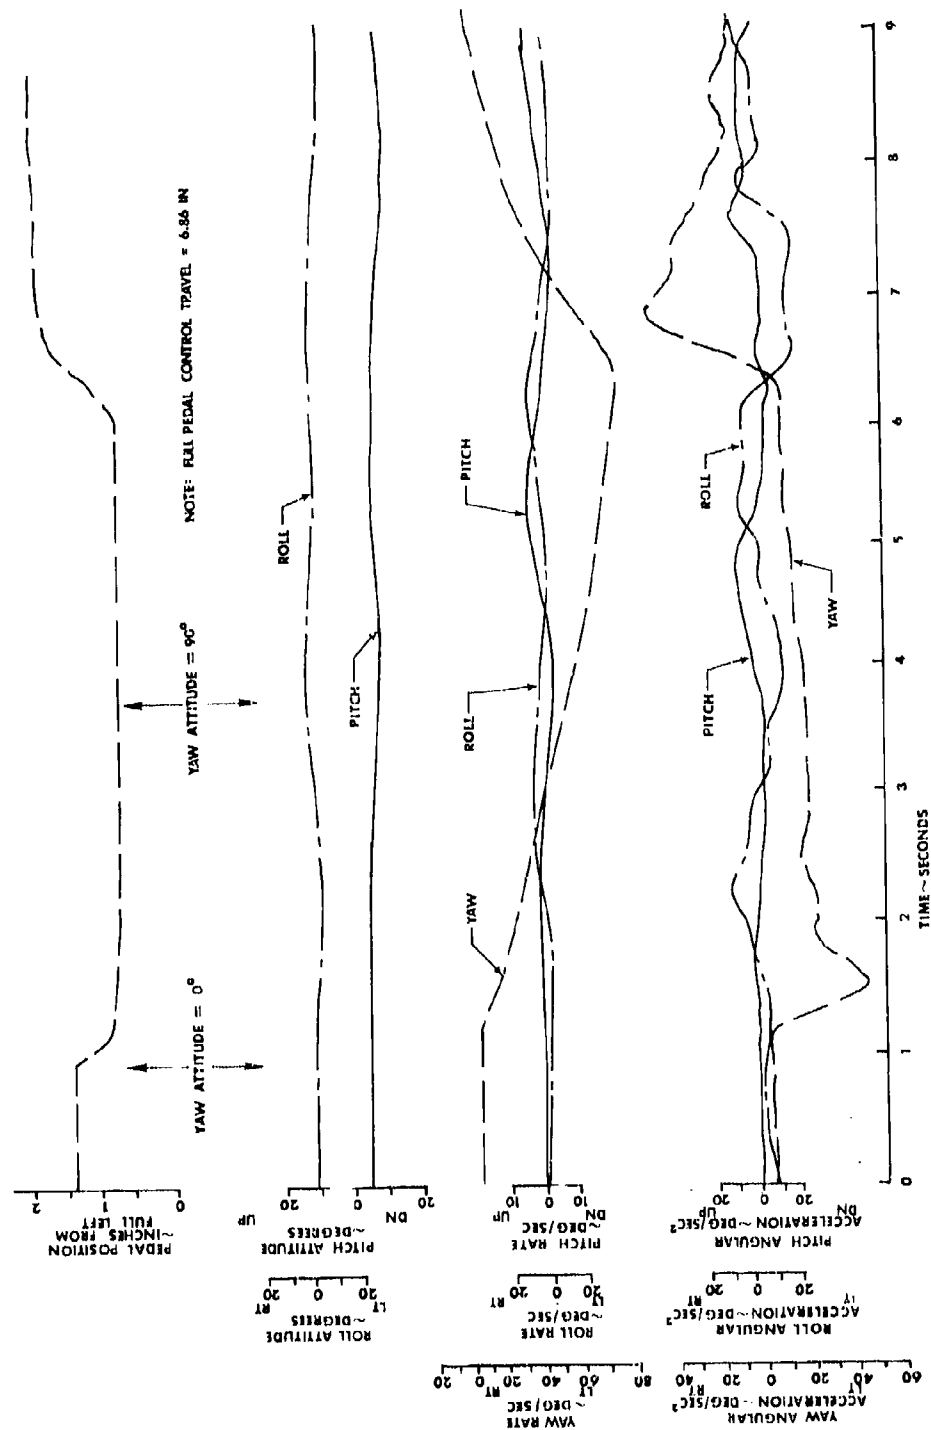


FIGURE 55
LEFT PEDAL STEP IN HOVER
OH-38A USA S/N 68-16706

DENSITY ALTITUDE ~ -940 FT
CALIBRATE AIRSPEED ~ HOVER
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 3015 LB
CG STATION ~ 1152 IN (AF)
CONFIGURATION ~ ARMED (DOORS ON)

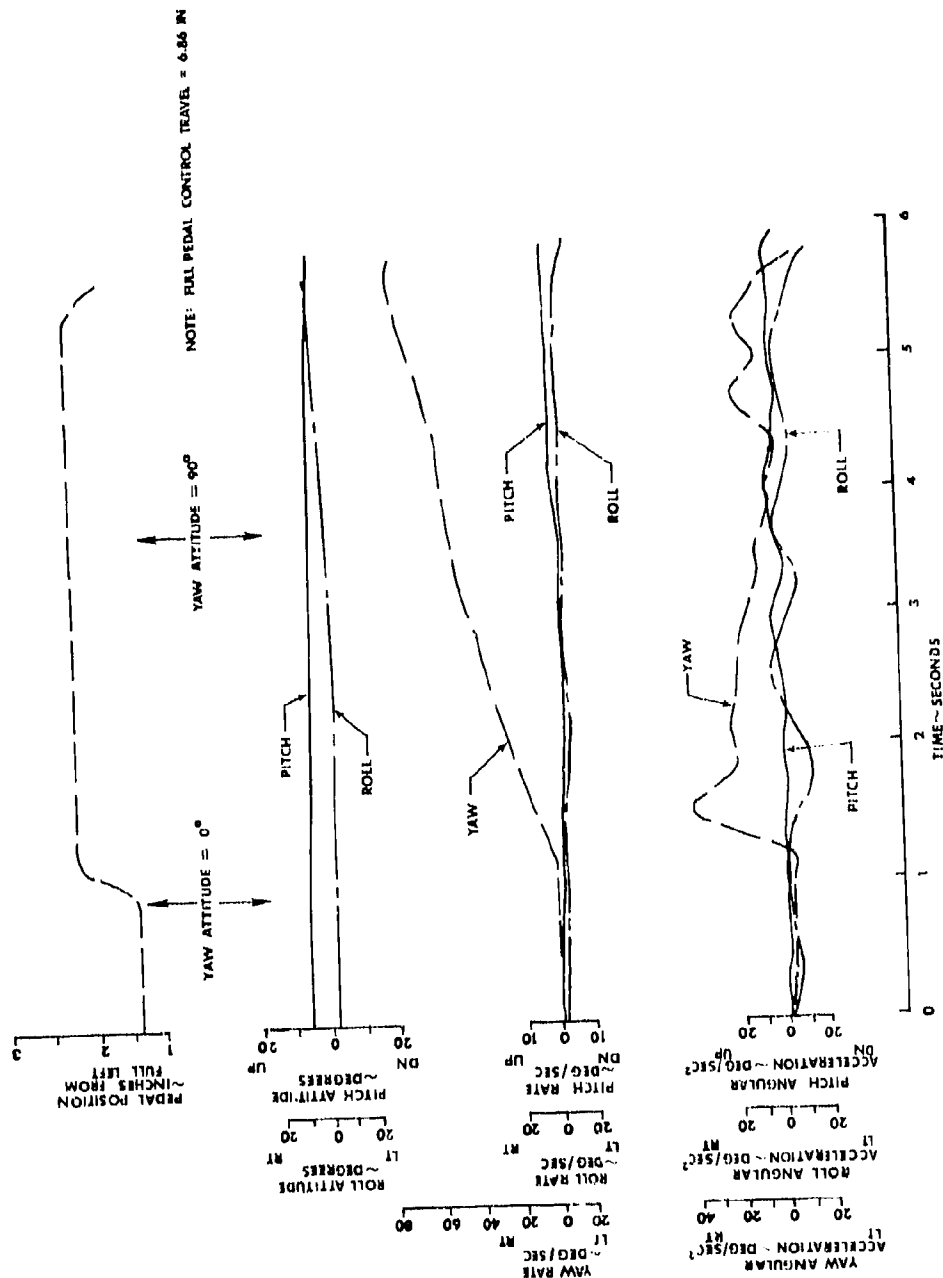


FIGURE 29
MANEUVERING STABILITY SUMMARY
OH-6A USA S/N 48-16706

CURVE NUMBER	GROSS WEIGHT ~LB	CG STATION ~IN	DENSITY ALTITUDE ~FT	ROTOR SPEED ~RPM	CONFIGURATION
1	2990	104.3 (FWD)	4950	354	ARMED (DOORS ON)
2	2970	112.2 (AFT)	5250	354	ARMED (DOORS ON)
3	2702	107.1 (FWD)	5230	354	ARMED (DOORS ON)

NOTE: FOR A SPEED RANGE
 FROM 59 KCAS TO 100 KCAS

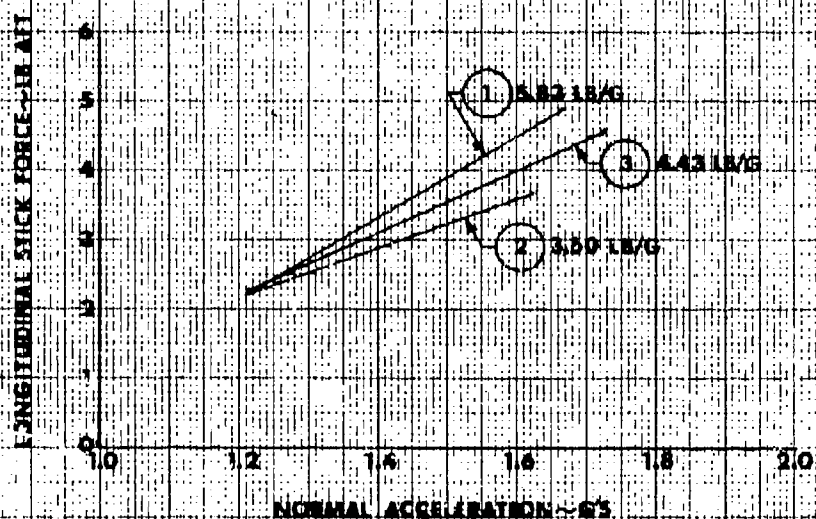


FIGURE 60
MANEUVERING STABILITY
ON-SEA UZA 14N 12-12786

CURVE NUMBER	WING WEIGHT - LB	CG POSITION - IN	ARMEDTY ALTITUDE - FT	ROTARY SPEED - RPM	COMPARISON
1	2450	106.5 IN	3000	354	CLIMBING ON 100
2	2700	107.1 IN	3120	354	ARMEDTY ON 100
3	2475	107.5 IN	3000	354	ARMEDTY ON 100
4	2450	106.5 IN	3000	354	ARMEDTY ON 100
5	2770	112.5 IN	3350	354	ARMEDTY ON 100
6	2970	106.7 IN	4950	354	ARMEDTY ON 100

SYMBOL CALIBRATED
ALTIMETER KTS
50.0
80.0
100.0

NOTE:
1. ALL FORCES MEASURED WITH
HYDRAULIC BOOST ON, FORCE
TRIM ON, AND FUEL ON
2. LOAD FACTORS ASSUMED IN
STATISTICAL ANALYSIS EXCEPT
AS NOTED


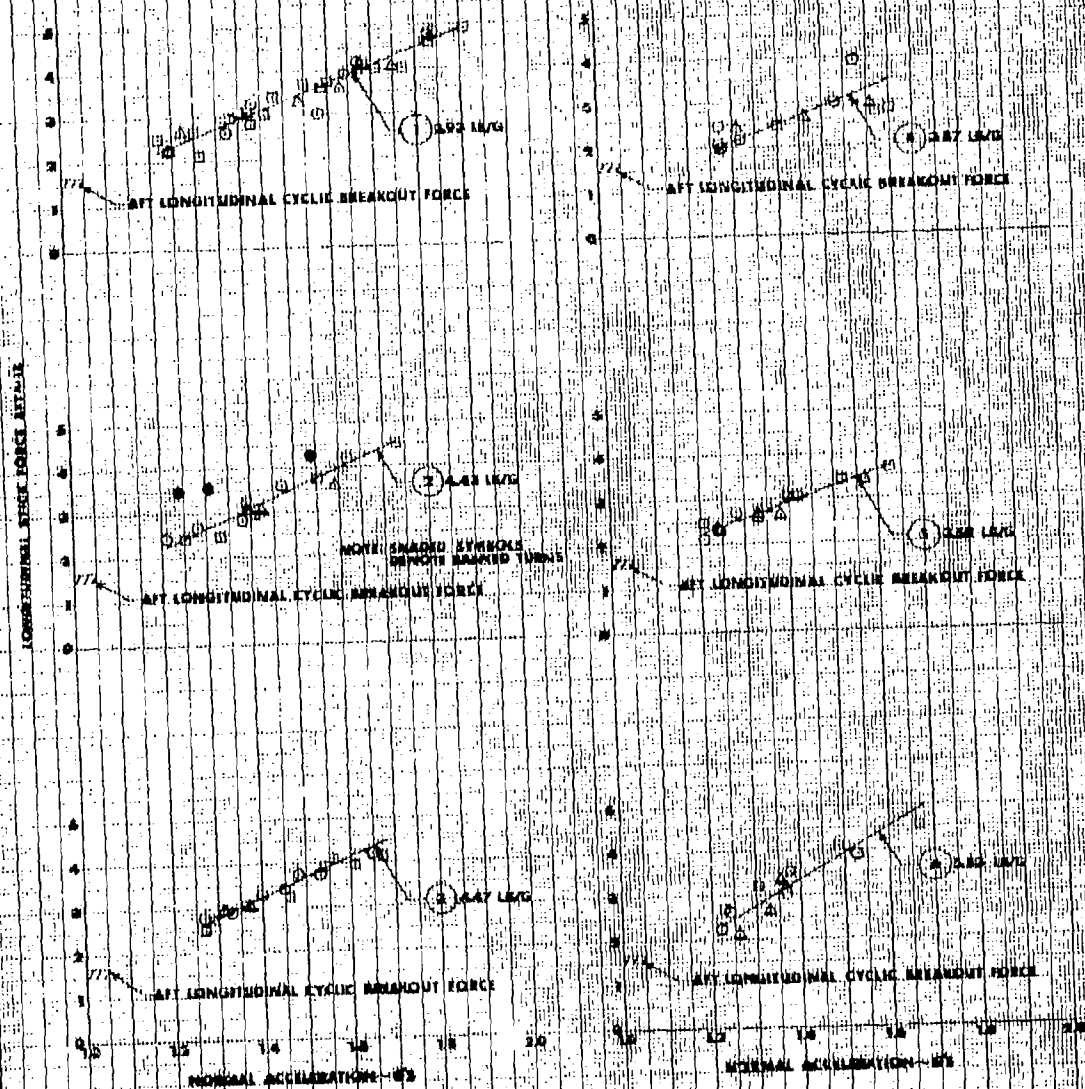


FIGURE 61
MANEUVERING STABILITY IN SYMMETRICAL PULL-UP
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5000 FT
CALIBRATED AIRSPEED ~ 80 KTS
ROT R SPEED ~ 354 RPM
GROSS WEIGHT ~ 2420 LB
CG STATION ~ 106.7 IN (FWO)
CONFIGURATION ~ ARMED (DOORS ON)

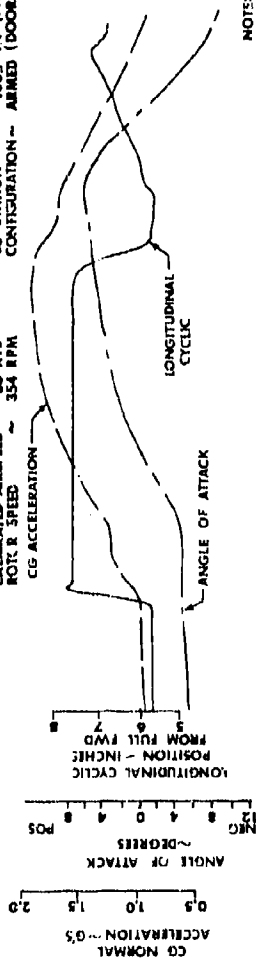

NOTE: HYDRAULIC BOOST SYSTEM ON





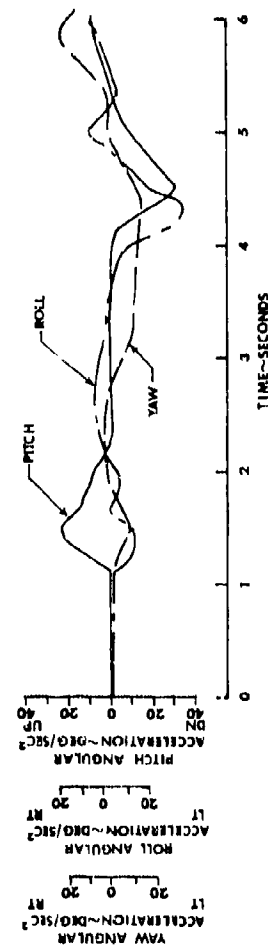


FIGURE 62
BOOST-OFF MANEUVERING STABILITY IN SYMMETRICAL PULL-UP
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5390 FT
CALIBRATED AIRSPEED ~ 80 KTS
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 2630 LB
CG STATION ~ 106.8 IN (FWD)
CONFIGURATION ~ ARMED (DOORS ON)

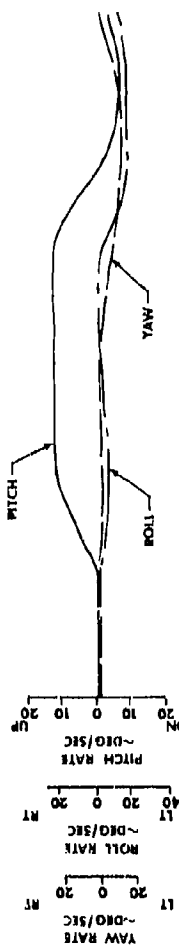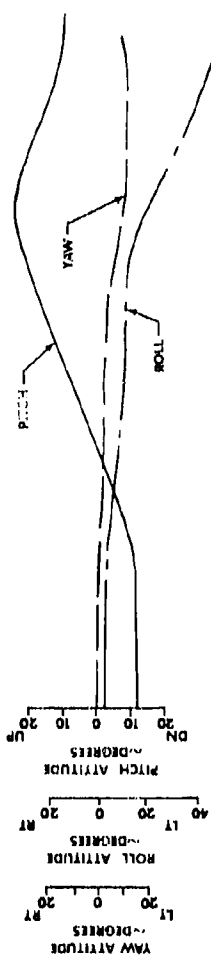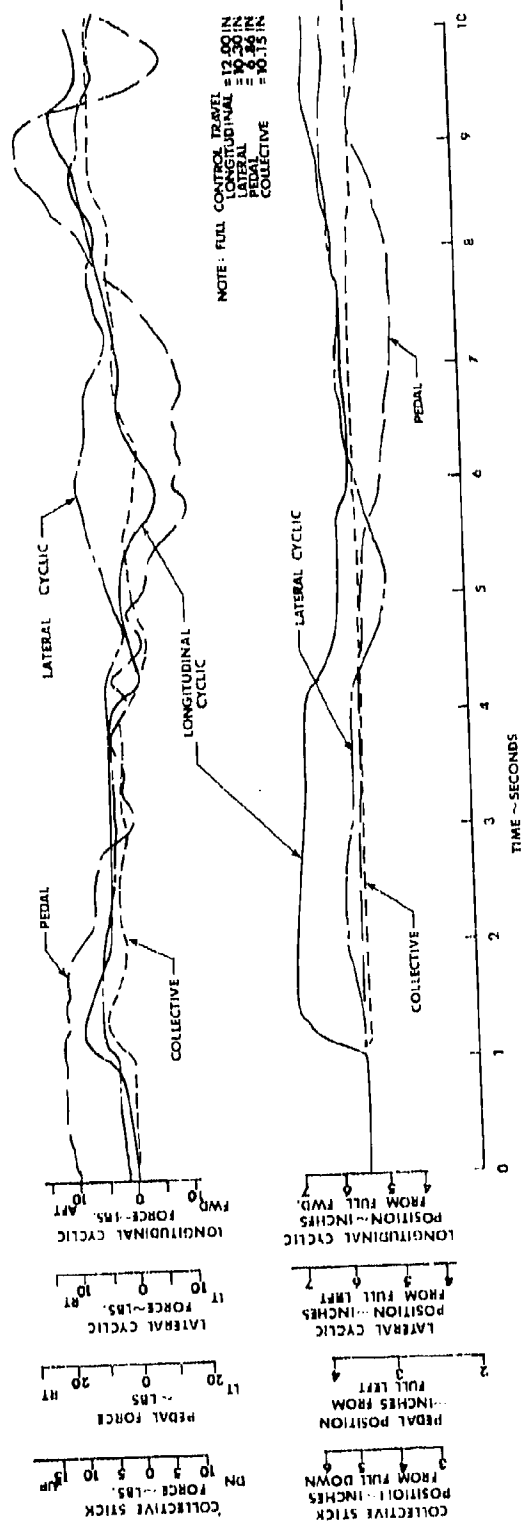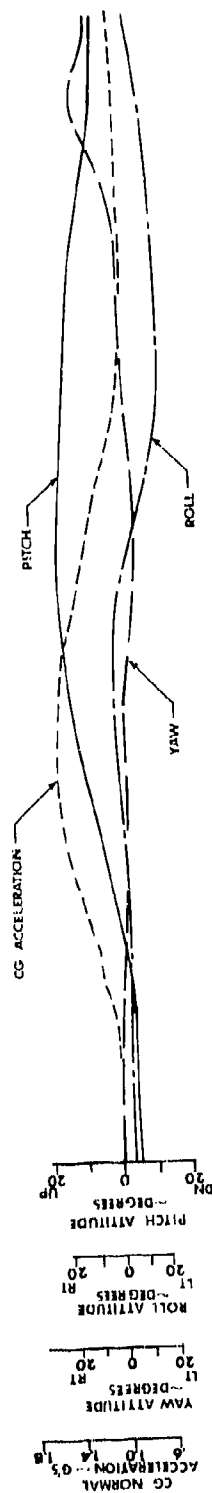

NOTE: FULL CONTROL TRAVEL
LONGITUDINAL = 12.00 IN
LATERAL = 10.00 IN
PEDAL = 6.00 IN
COLLECTIVE = 10.15 IN

FIGURE 63
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
OH-55A USA S/N 68-16706


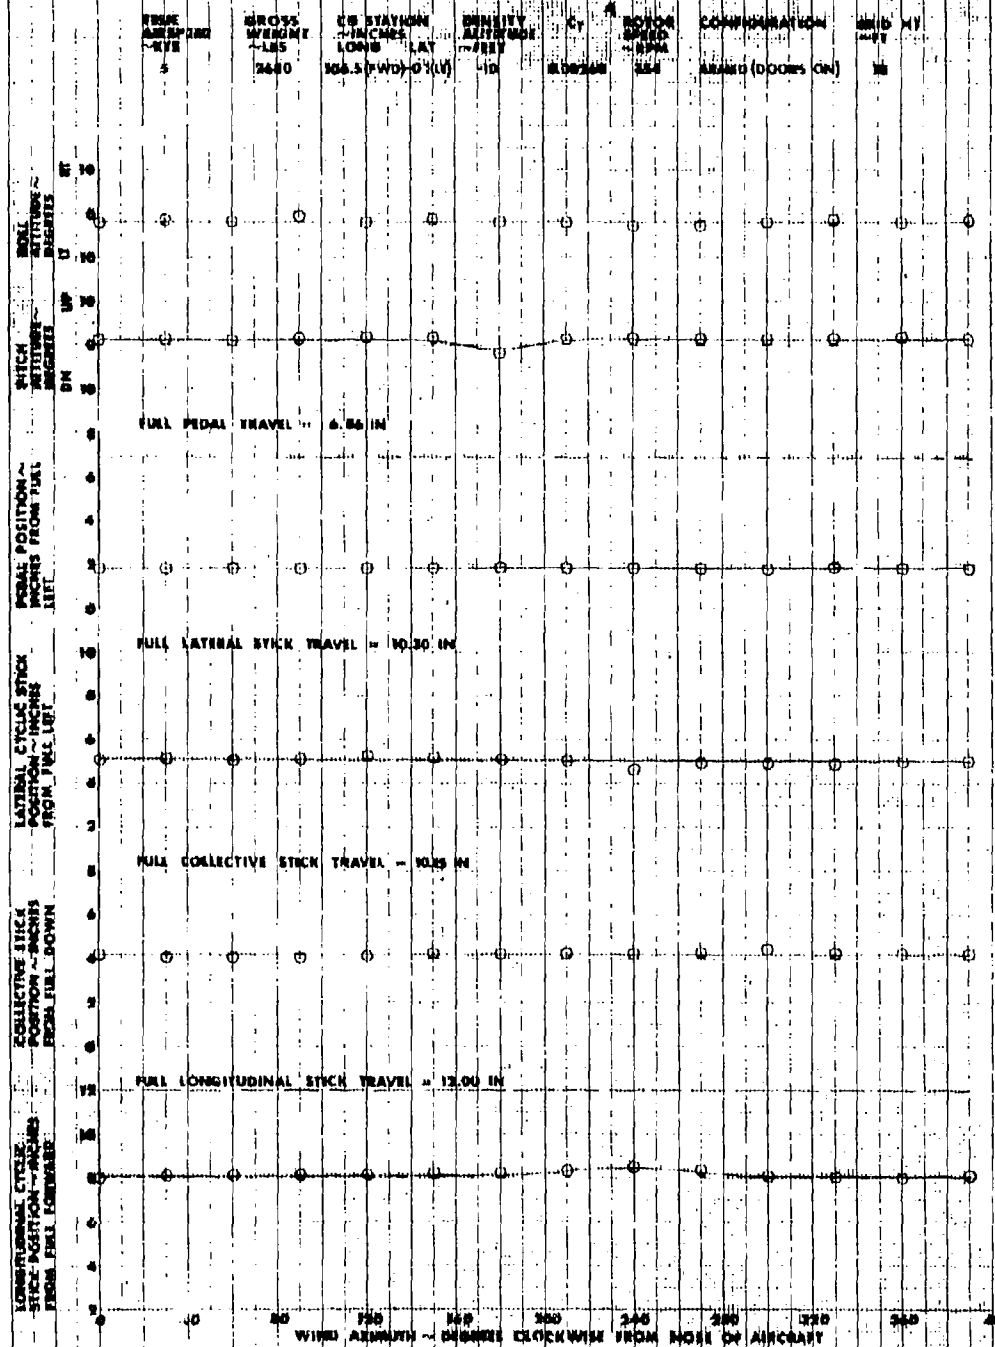


FIGURE 64
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
OH-55A USA S/N 48-16706

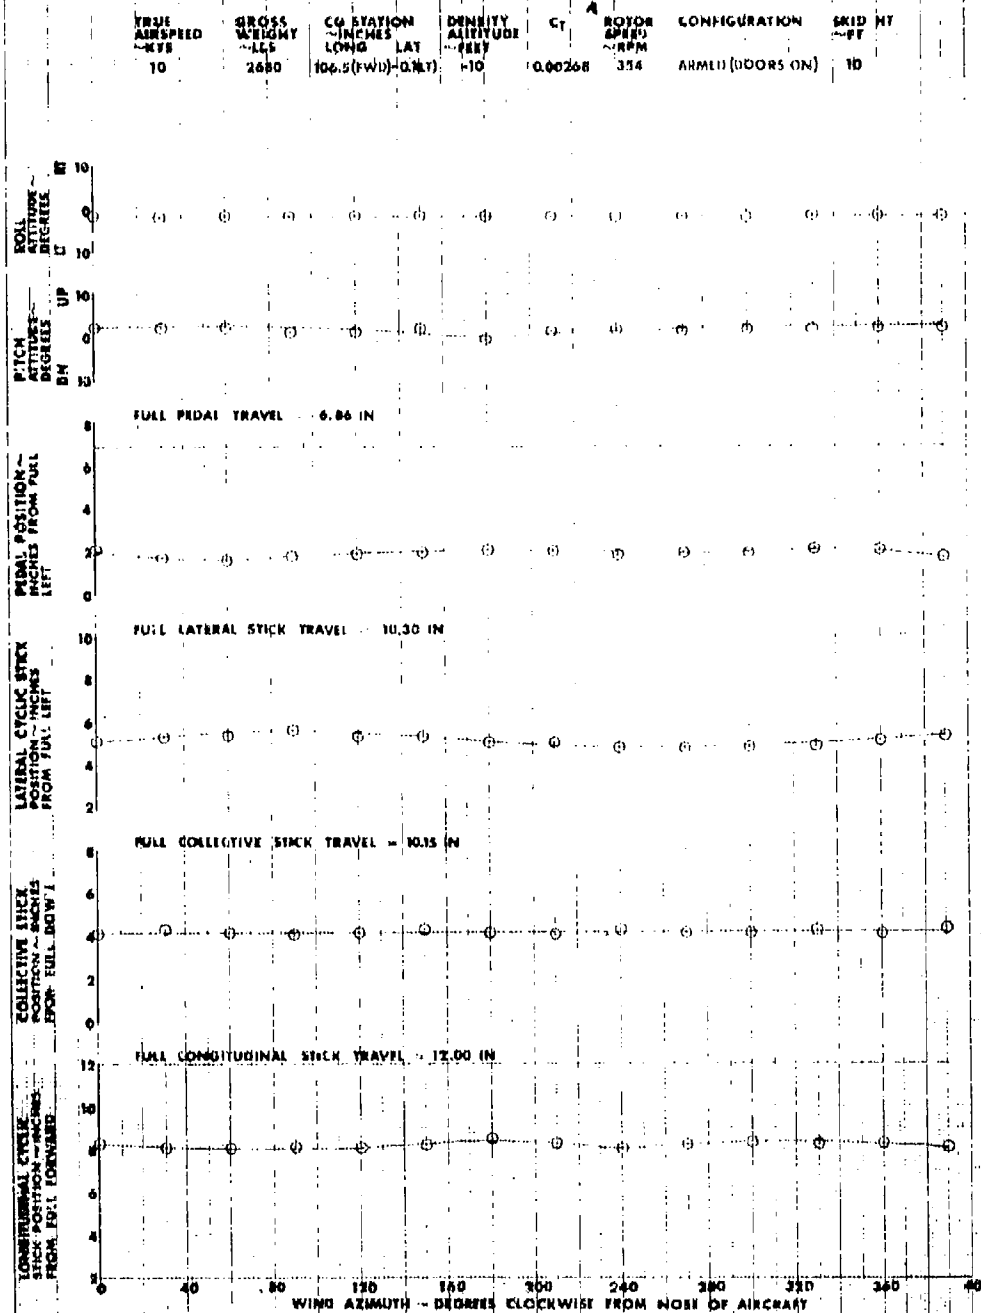

TRAIL NUMBER	200 YD WEIGHT ~150	25 YARDS CROSS COUNTRY ~100	50 YARDS CROSS COUNTRY ~100	CI	NOTES	CONFIGURATION	TIME MIN
15	2450	1045 (HARD-ANGLE)	-5	0.0000	150	ARMED (DOORS ON)	18

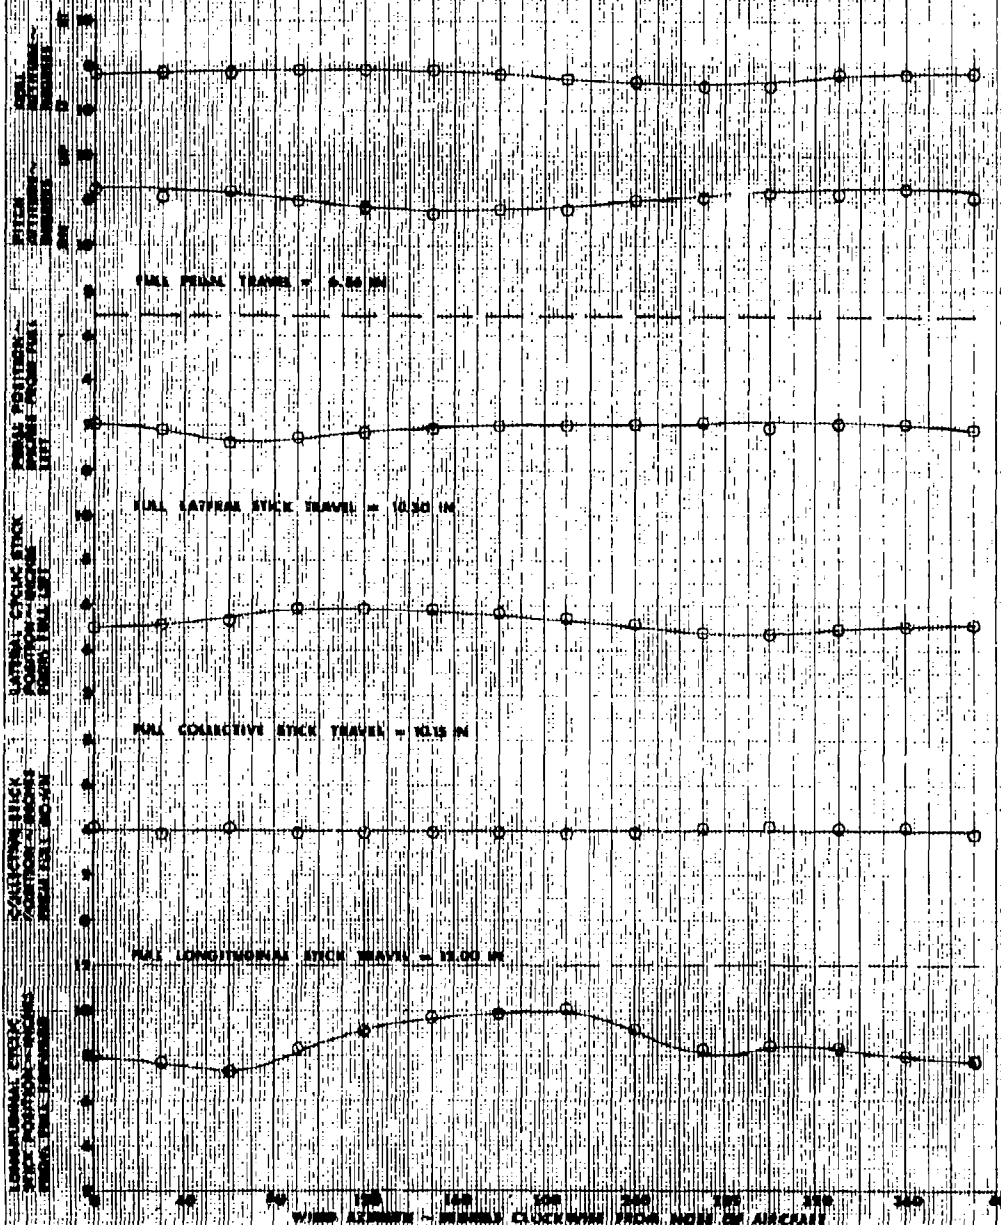


FIGURE 44
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
OH-35A USA S/N 68-14704

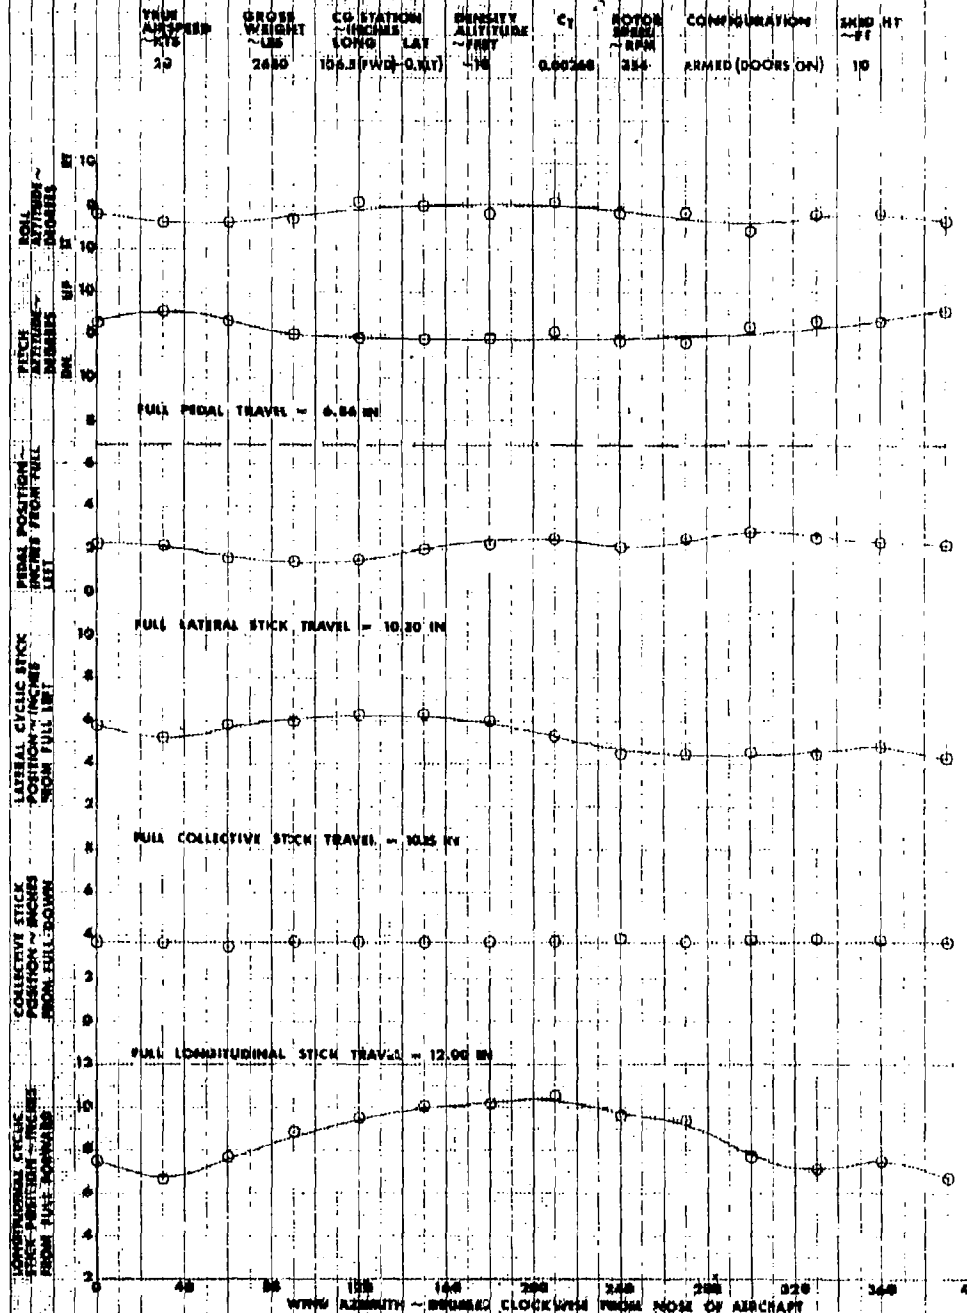


FIGURE 67
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
ON SEA USA E/N 65-4706

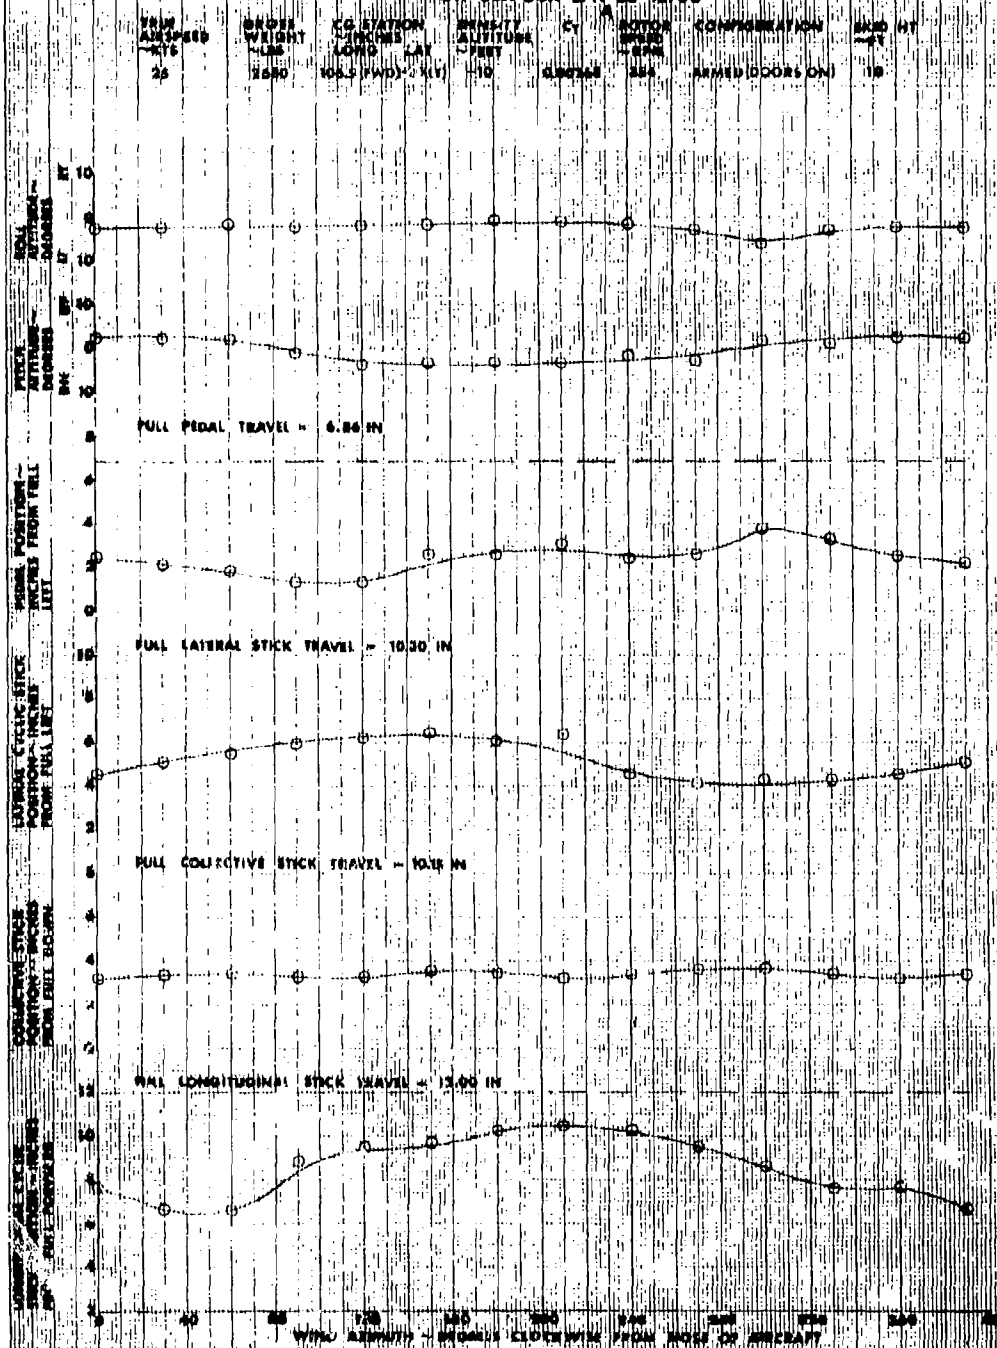


FIGURE 42
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
ON-SEA USA & N 44-12704

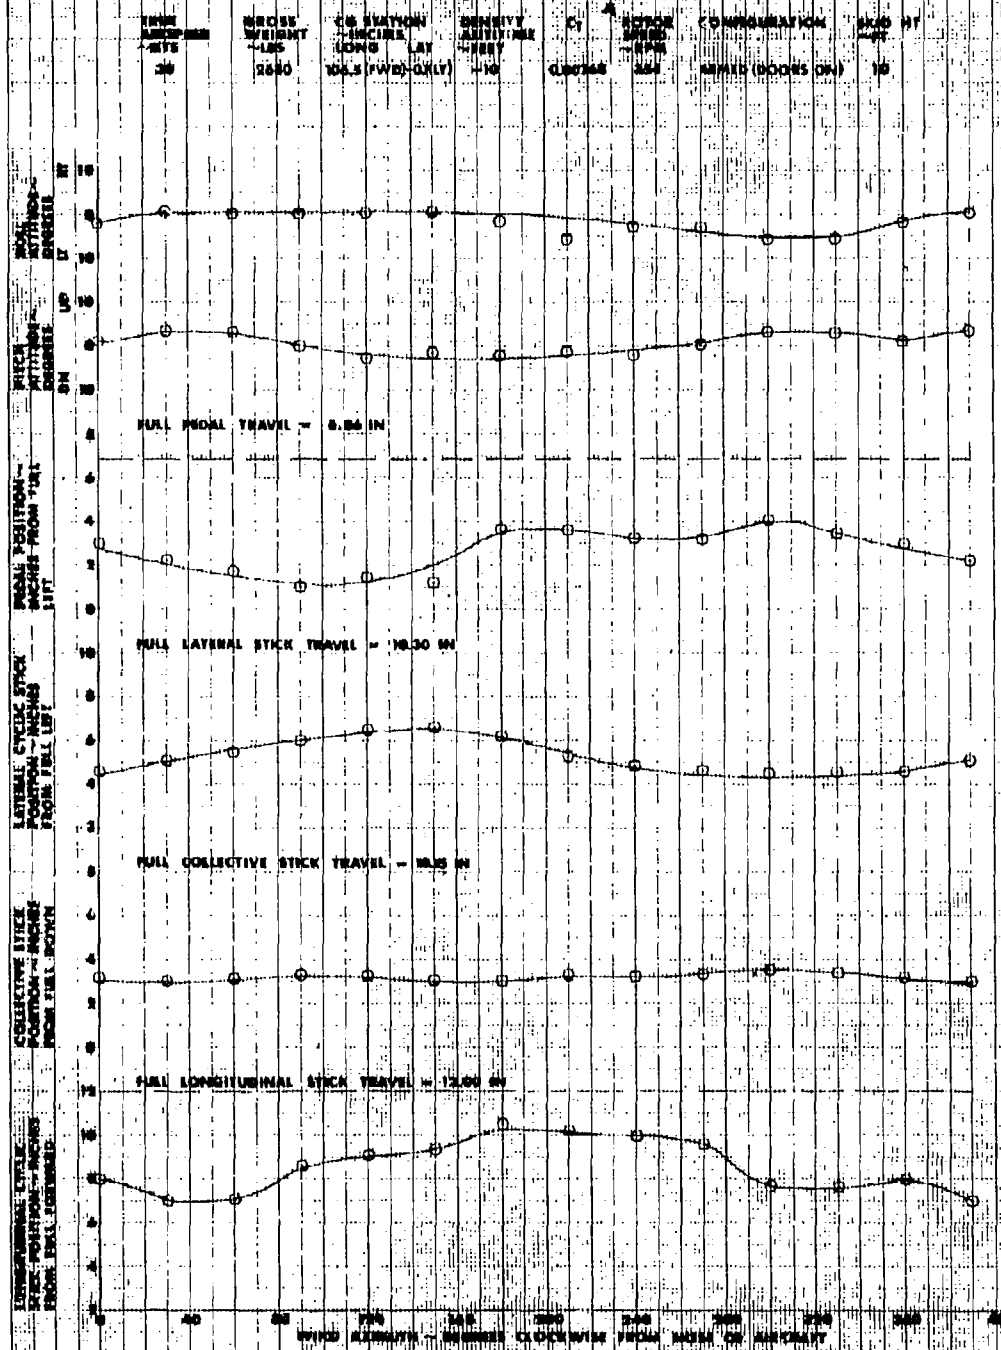


FIGURE 49
CONTROL POSITIONS VERSUS RELATIVE WIND AZIMUTH
OH-13A USA S/N 68-16786

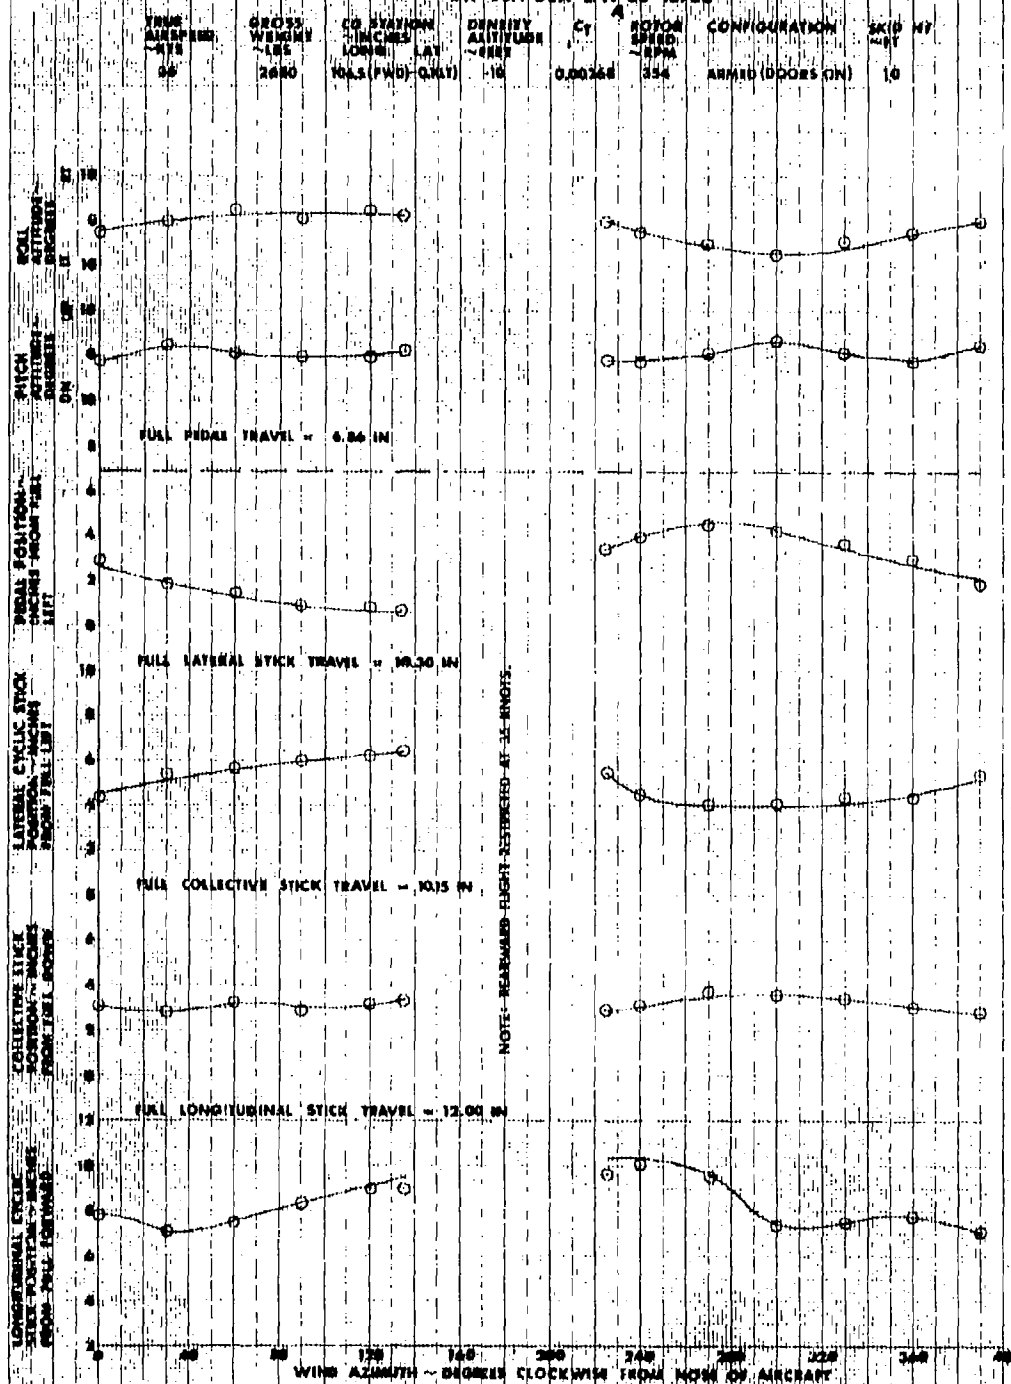


FIGURE 70 CONTROL POSITIONS IN SIDWARD, REARWARD AND FORWARD FLIGHT OH-68A USA S/N 68-12764

GROSS WEIGHT 2630 C.G. TATION 104.89 IN WING - 6.21 IN ALTITUDE 2770 DENSITY 0.00294 C. 12.5 RPM ROTOR SPEED 12.5 RPM COMPRESSION 100% SQUAD HT 10
 100% ARMED (DOORS ON) 10

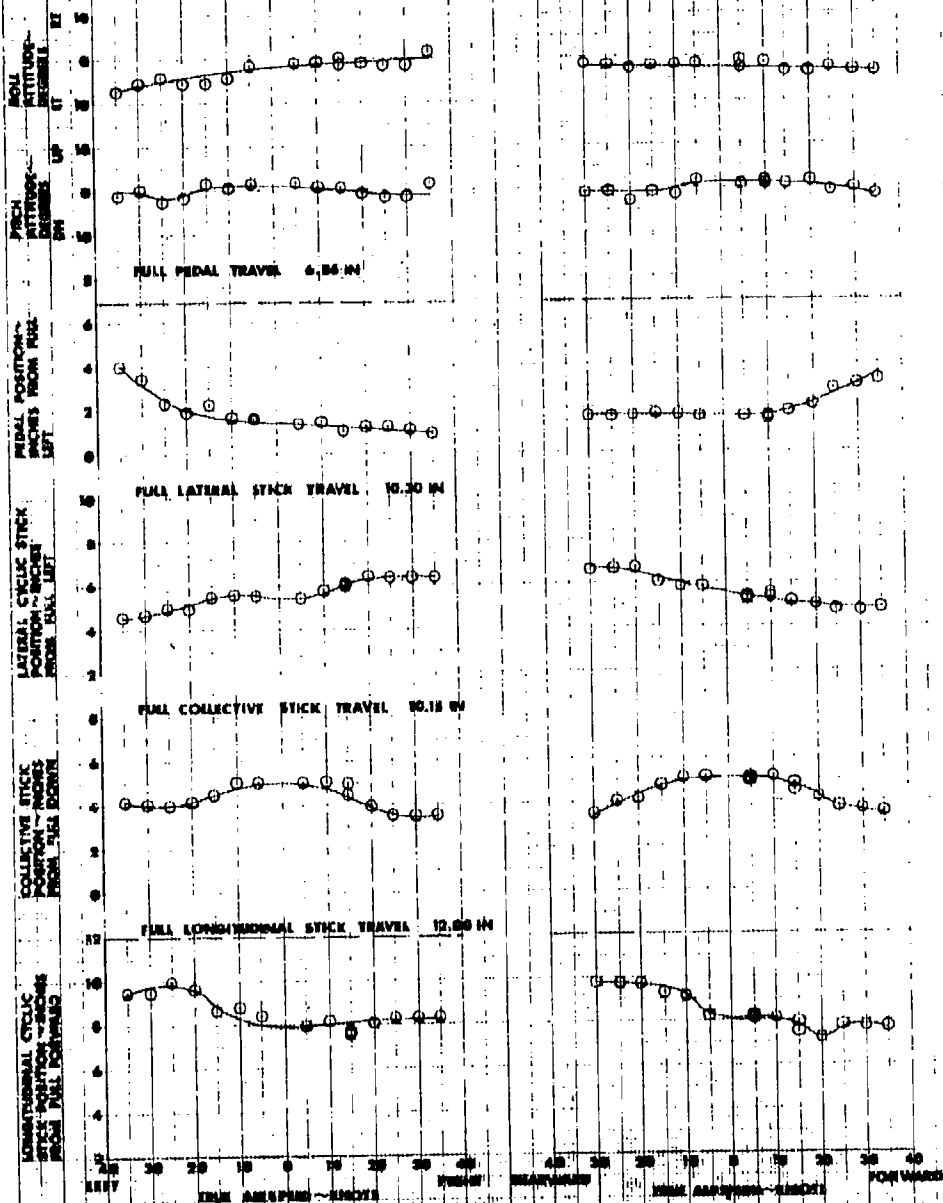


FIGURE 7
CONTROL POSITIONS IN SIDEWARD, REARWARD AND FORWARD FLIGHT
OH-55A USA S/N 43-14709

GROSS WEIGHT	C.M. STATION	DENSITY ALTITUDE	ENGINE SPEED	CONFIGURATION	SWITCH NO.
18	106.50 WU (CLRT)	7100	0.50000	ARMED (DOOR) ON	18

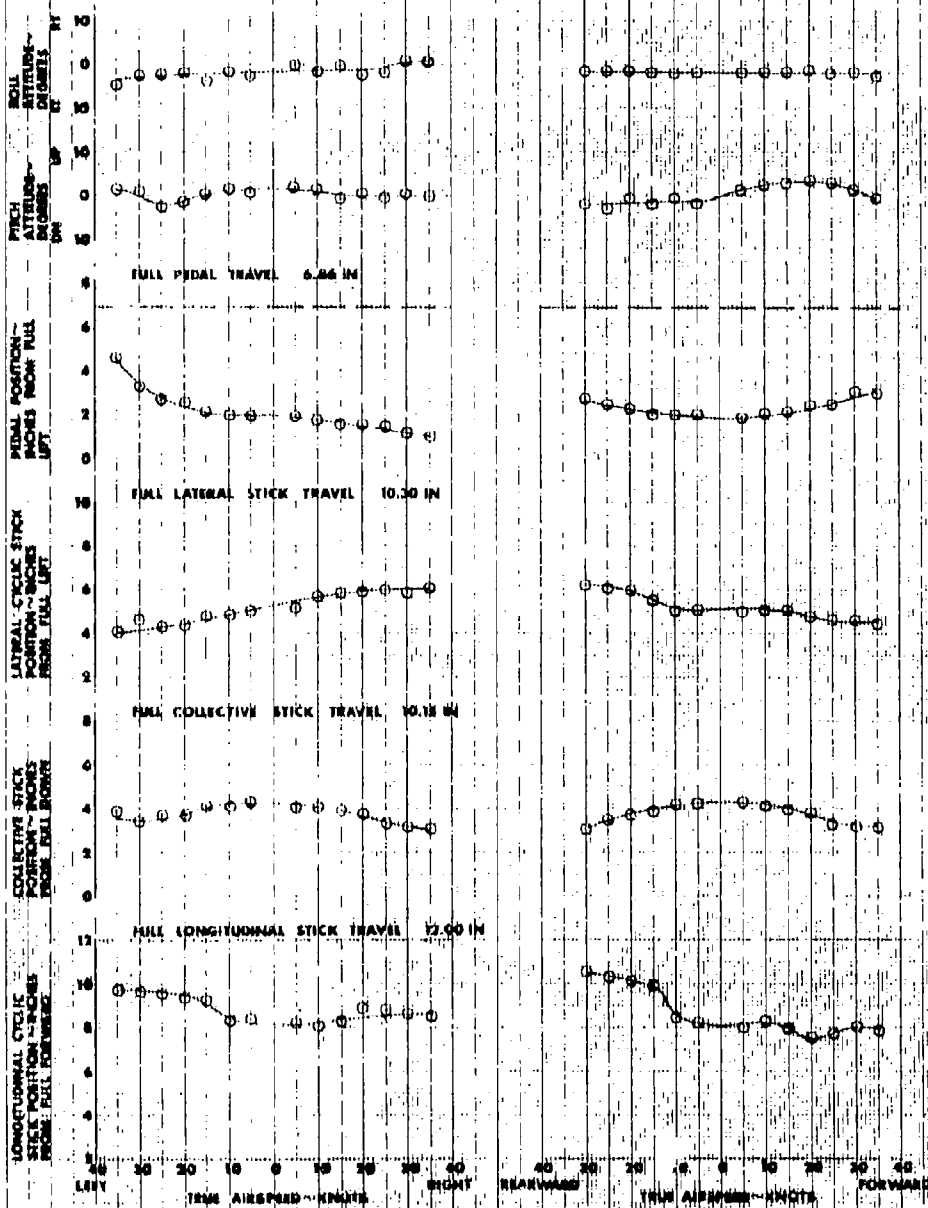


FIGURE 73 CONTROL POSITIONS IN STEADY, REARWARD AND FORWARD FLIGHT (ON SEA USE AIR 25, 30, 35, 40, 45, 50, 55, 60, 65, 70, 75, 80, 85, 90, 95, 100)

TABLE 1. CONTROL POSITIONS IN STEADY, REARWARD AND FORWARD FLIGHT
(ON SEA USE AIR 25, 30, 35, 40, 45, 50, 55, 60, 65, 70, 75, 80, 85, 90, 95, 100)

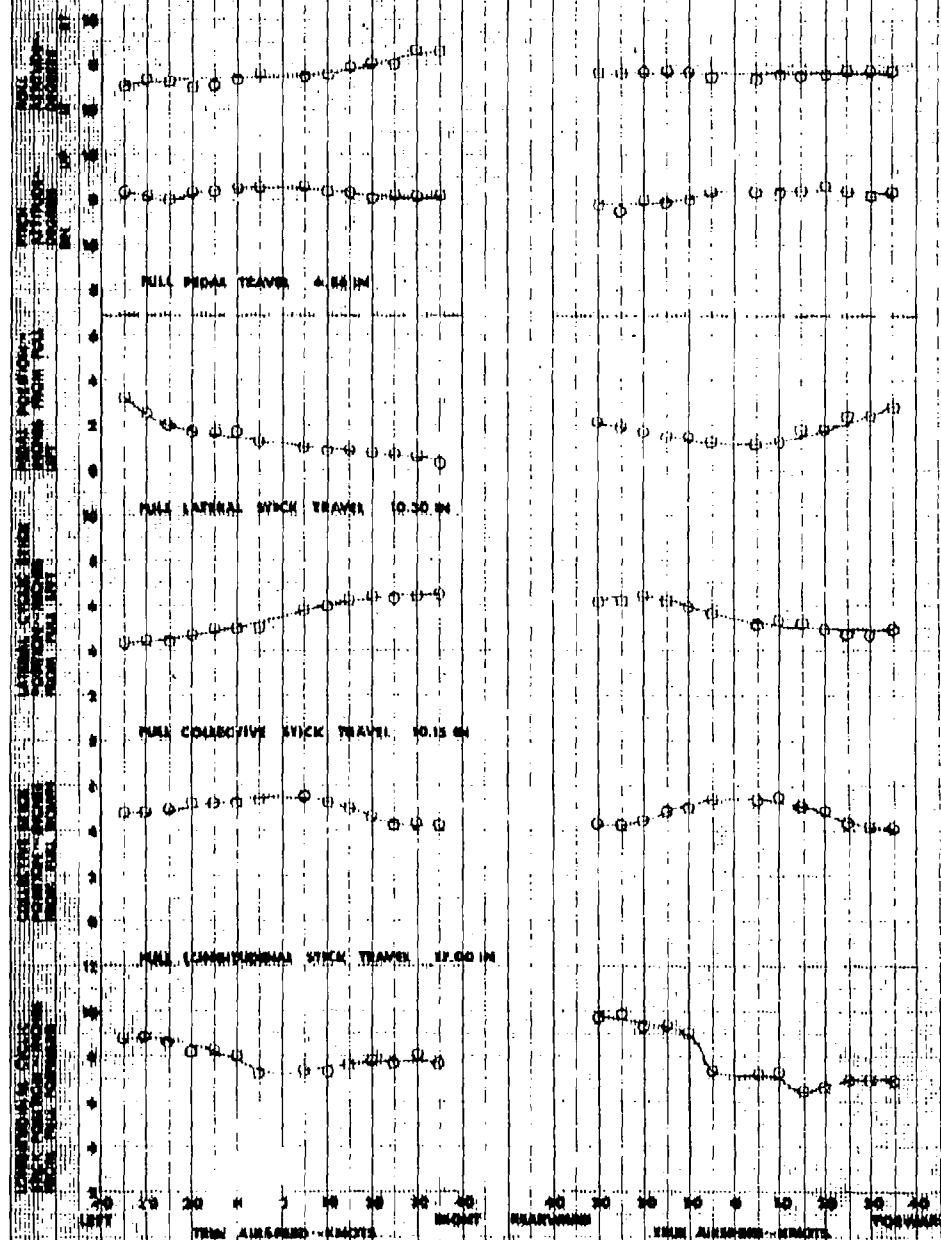


FIGURE 73 CONTROL POSITIONS IN SIDEWARD, REARWARD AND FORWARD FLIGHT OH-58A USA S/N 48-16786

GROSS WEIGHT -LB	C.G. STATION -INCHES	DENSITY ALTITUDE -FEET	C -RPM	ROTOR SPEED -RPM	CONFIGURATION	SKID MT -FT
2950	107.55 (Wt - 0.25)	150	0.00299	354	ARMED (DOORS ON)	10

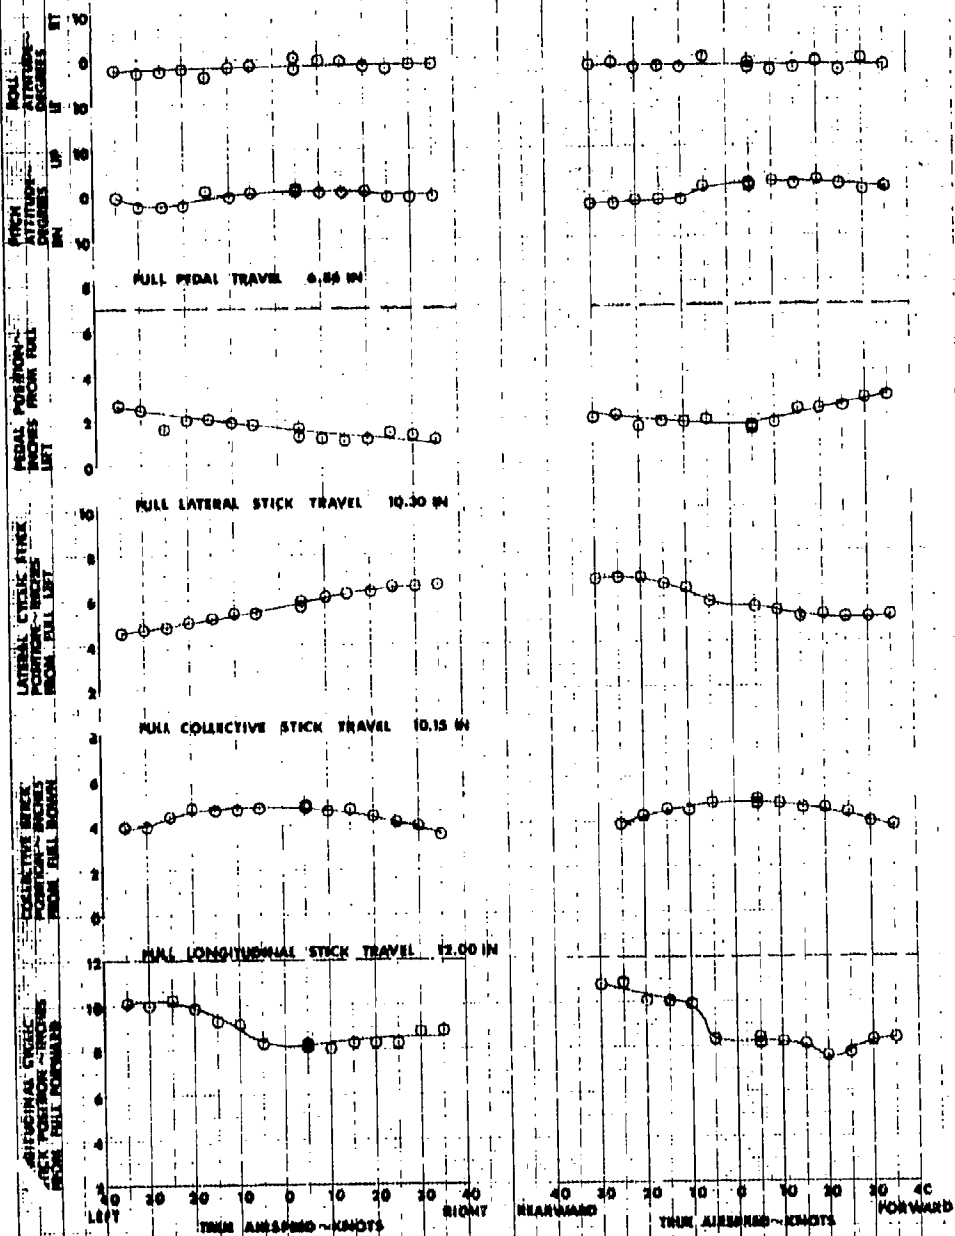


FIGURE 74 CONTROL POSITIONS IN FORWARD, REARWARD AND FORWARD FLIGHT ON 22 JUL 54 S/N 42-1074

DATE: 22 JUL 54
PILOT: J. H. HARRIS
FLIGHT: 101
TIME: 14:00
LOCATION: 101
C. 101
COMPARISON: 101
S/N: 42-1074

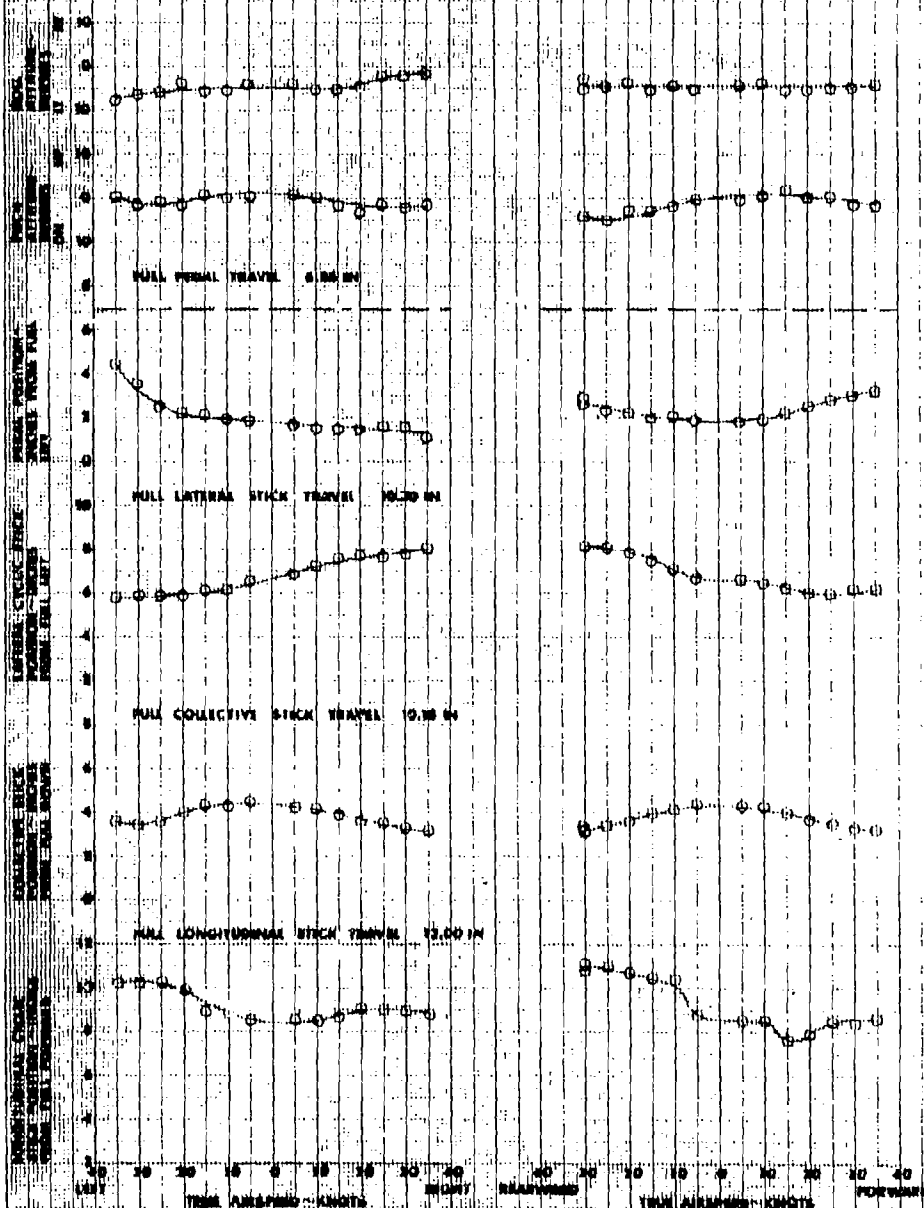


FIGURE 75
CONTROL POSITIONS IN SIDELAND, REARWARD AND FORWARD FLIGHT
ON SEA USA 4-10-45-10-700

ORDER	COL STATION	DENSITY	C	ROTOR	CONFIGURATION	SKED IN
WEIGHT	INCHES	ALTITUDE		SPIN		FT
2675	100.00	1000	0.00260	150	CLEAN (DOORS ON)	10

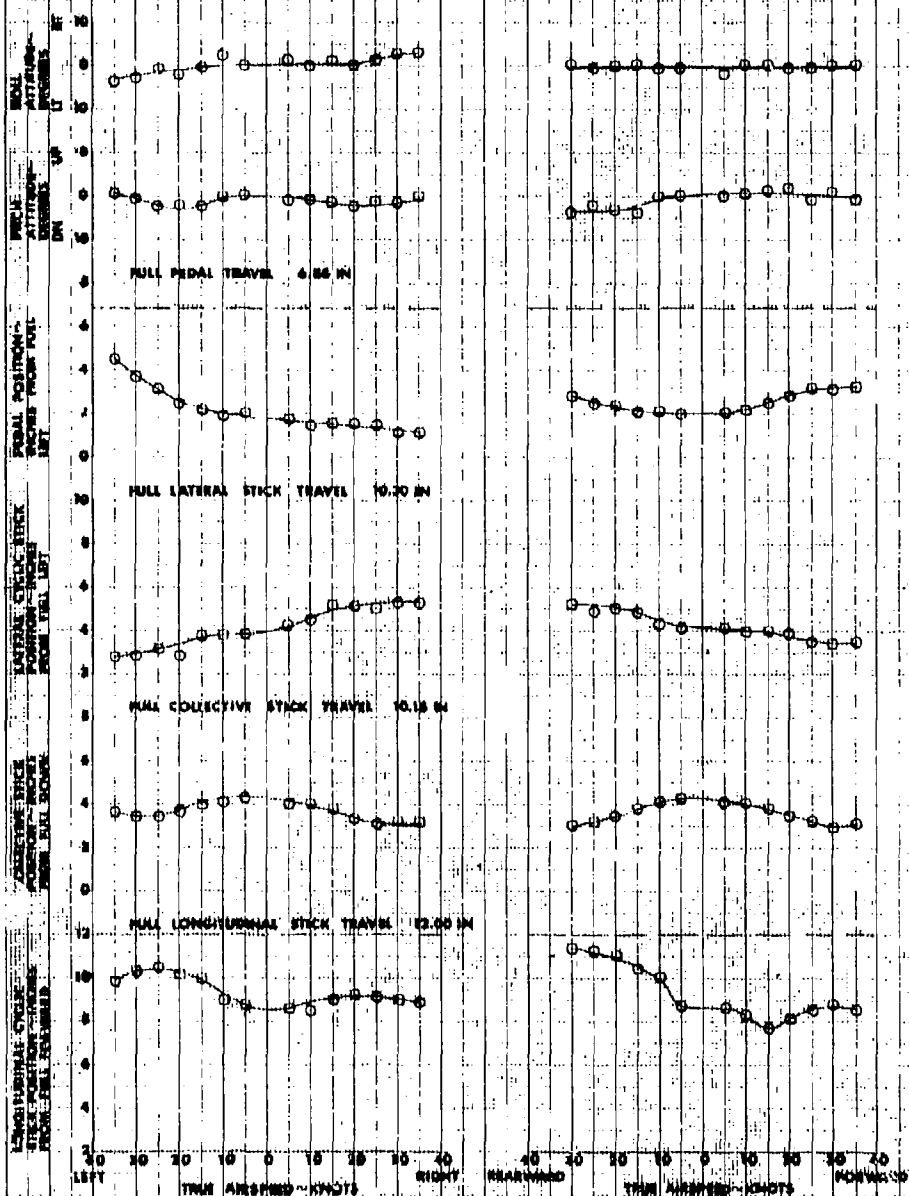


FIGURE 76
LEFT SIDEWARD FLIGHT AT 15 KTAS
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 140 FT
TRUE AIRSPEED ~ 15 KTS
ROTOR SPEED ~ 334 RPM
GROSS WEIGHT ~ 2920 LB
CG STATION ~ 107.4 IN (TWD)
CONCENTRATION ~ ARMED (DOORS ON)
SKID HEIGHT ~ 10 FT

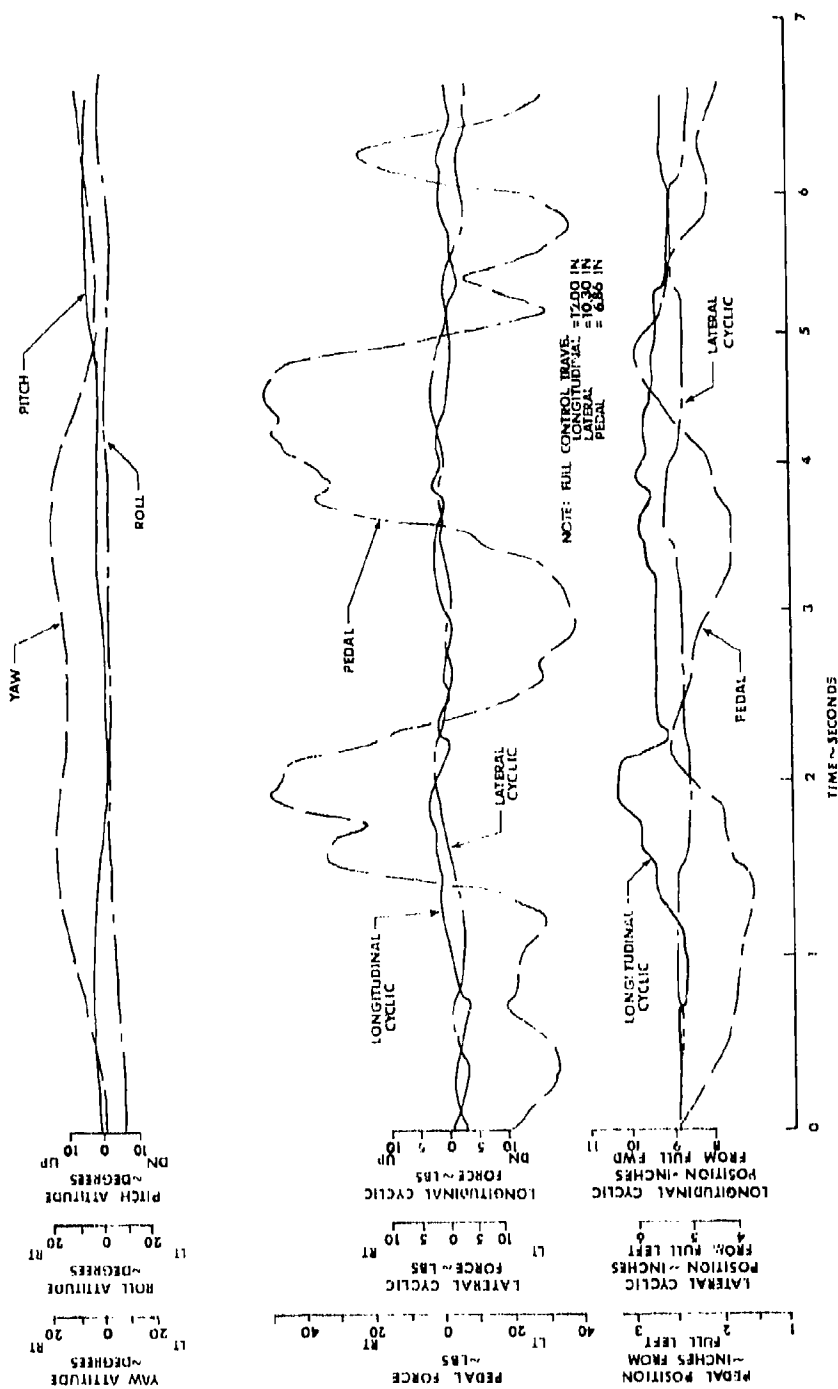



FIGURE 77
AUTOROTATIONAL ENTRY CHARACTERISTICS
OH-58A USA 37N 68-14706

CG STATION ~IN	AVG GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FT	ENTRY MOTOR SPEED ~RPM	CONFIGURATION
106.51 FWD	2725	3150	354	ARMED (DOORS ON)


NOTE:

SHADED SYMBOLS DENOTE MAXIMUM
 POWER DIPS
 FLAGGED SYMBOLS DENOTE MAXIMUM
 POWER CLIMBS
 OPEN SYMBOLS DENOTE LEVEL FLIGHT

MAXIMUM TIME DELAY BEFORE COLLECTIVE STICK
 IS LOWERED ~ SECONDS

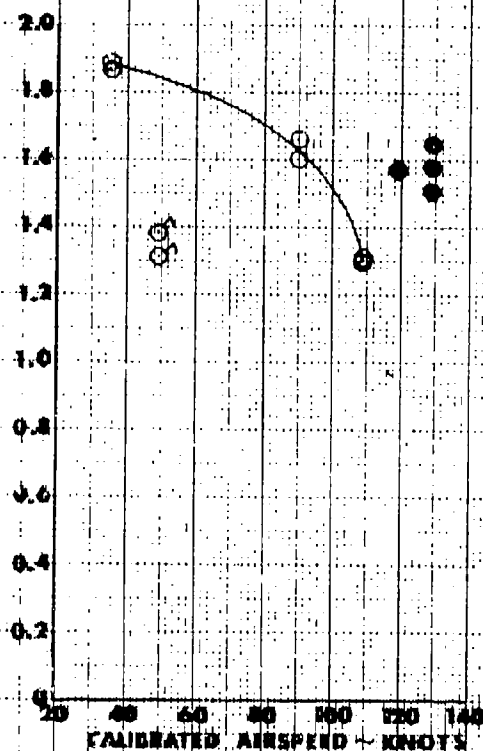

RATE OF ROTOR DECAY ~ RPM/SEC

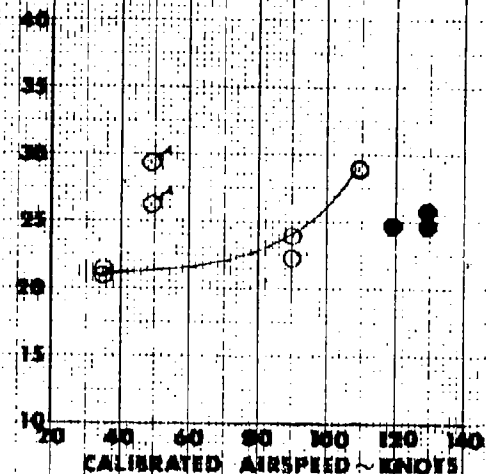

PITCH, ROLL, AND YAW RATES AT
 1 SECOND AFTER THROTTLE CLOSURE
 ~ DEGREE/SECOND

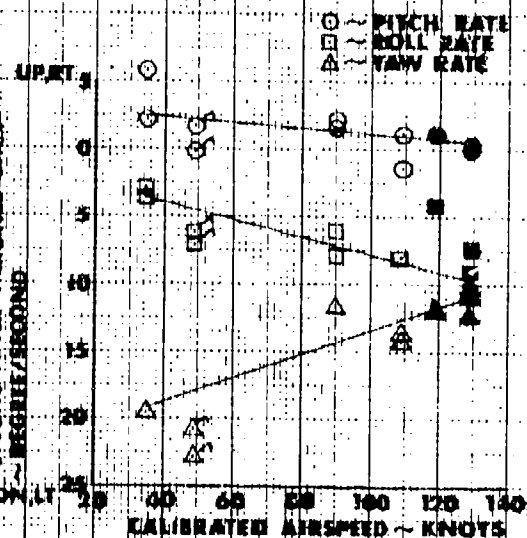


FIGURE 78
AUTOROTATIONAL ENTRY CHARACTERISTICS
 OH-58A USA E/N 65-14706

CG STATION ~IN	AVG GROSS WEIGHT ~LB	DENSITY ALTITUDE ~FT	ENTRY ROTOR SPEED ~RPM	CONFIGURATION
112.6(AH)	2920	2250	354	ARMED (DOORS ON)

NOTE:

SHADED SYMBOLS DENOTE MAXIMUM
 POWER DIVES
 FLAGGED SYMBOLS DENOTE MAXIMUM
 POWER CLIMBS
 OPEN SYMBOLS DENOTE LEVEL FLIGHT

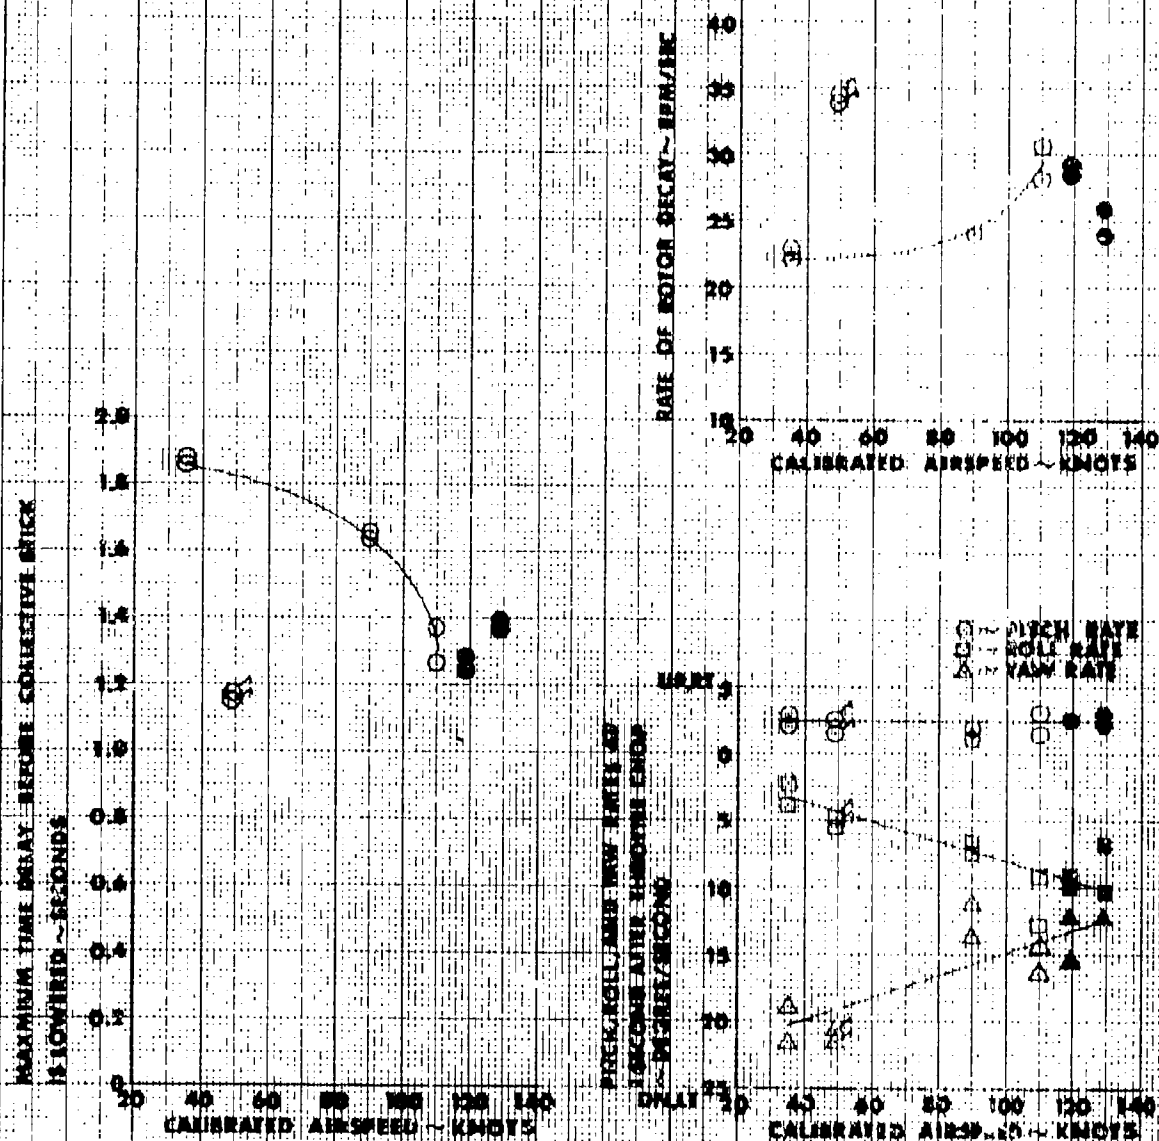


FIGURE 79
AUTOROTATIONAL ENTRY CHARACTERISTICS
OH-55A USA 57N 60-10706

CG STATION ~IN	AVG BRASS WEIGHT ~LB	DENSITY ALTITUDE ~FT	ENTRY ROTOR SPEED ~RPM	CONFIGURATION
112.4(AVT)	2920	9850	354	ARMED (MOORS ON)

NOTE

SHADED SYMBOLS DENOTE MAXIMUM
 POWER DIVES
 FLAGGED SYMBOLS DENOTE MAXIMUM
 POWER CLIMBS
 OPEN SYMBOLS DENOTE LEVEL FLIGHT

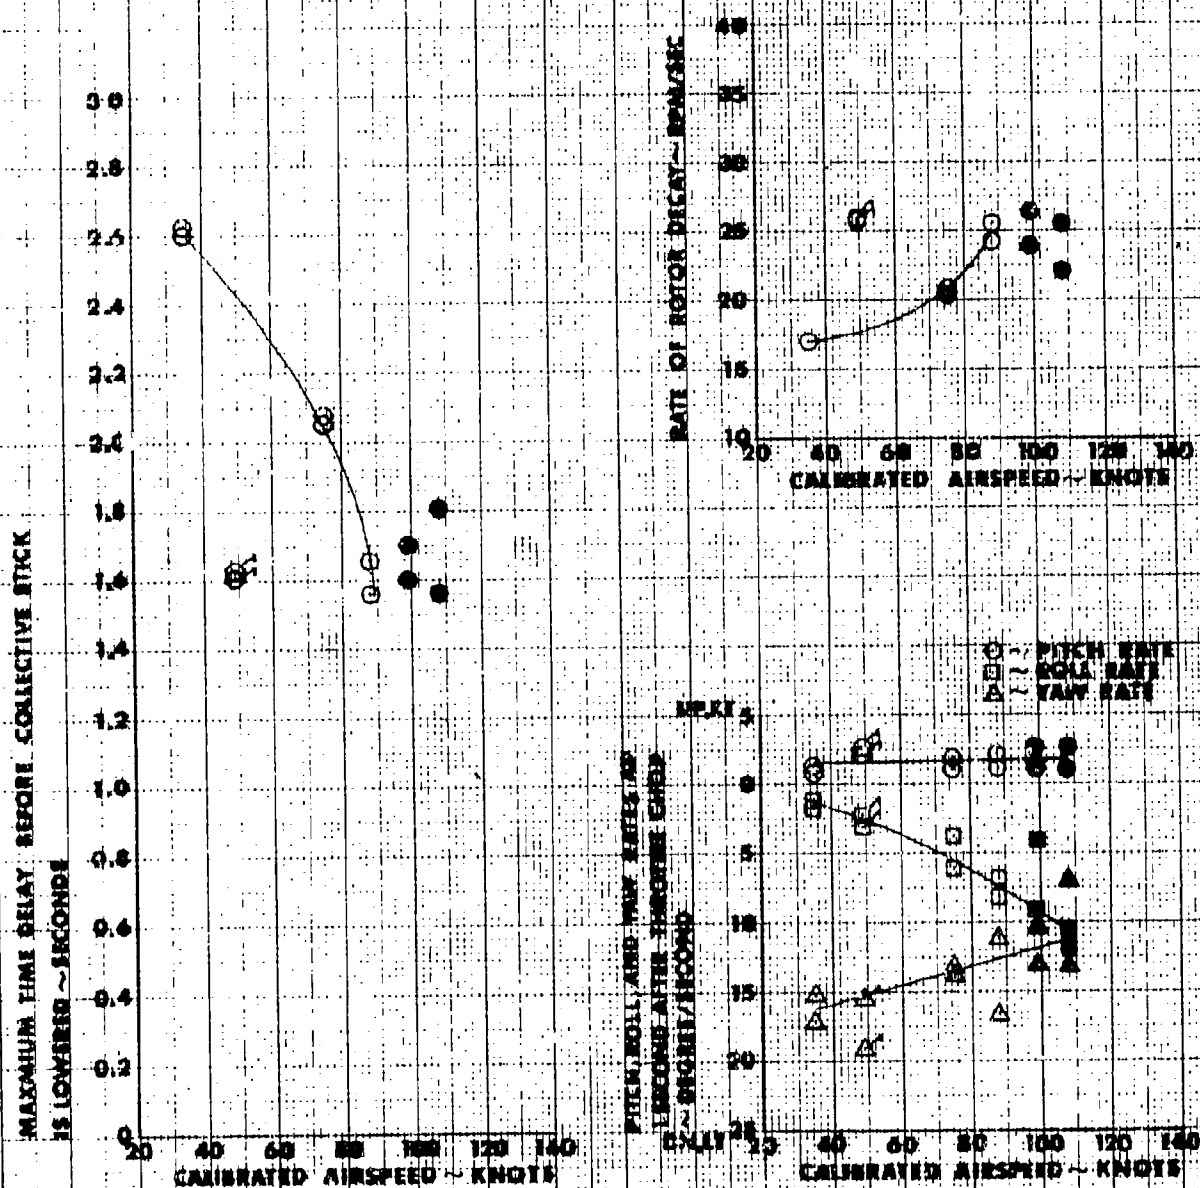


FIGURE 80
AUTOROTATIONAL ENTRY FROM LEVEL FLIGHT
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~3180 FT
CALIBRATED AIRSPEED ~127 KTS
GROSS WEIGHT ~ 2690 LB
CG STATION ~ 106.1 IN (FWD)
CONFIGURATION ~ ARMED (DOORS ON)

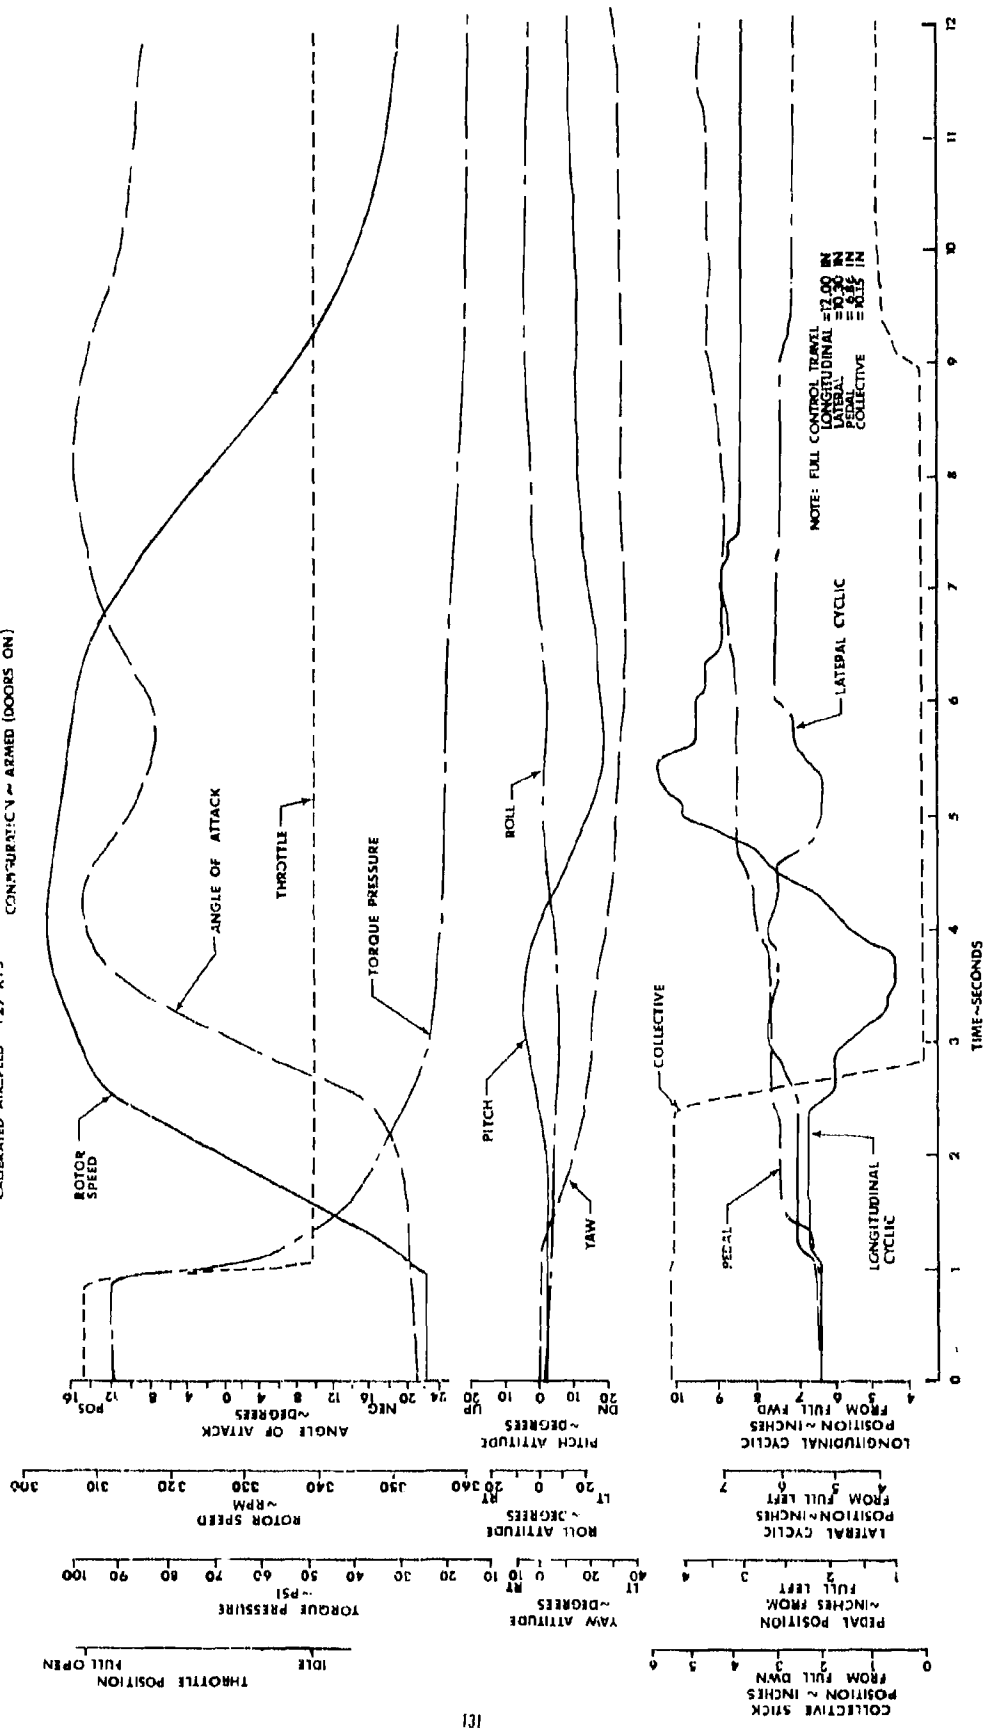


FIGURE 8
CONTROLLED FIRE WITH XM271 ARMAAMENT KIT
DN-35A USA D/N 66-16706

SYM	CG STATION ~ IN	DRUM WEIGHT ~ LB	DENSITY ALTITUDE ~ FT	ROTARY SPEED ~ RPM	GUN DEFLECTION POSITION	RATE OF FIRE ~ ROUNDS/MINUTE
○	107.1 FWD	2840	3130	354	HORIZONTAL	4000
□	107.1 FWD	2840	3130	354	HORIZONTAL	2000
●	107.1 FWD	2840	3130	354	FULL DOWN	4000
■	107.1 FWD	2840	3130	354	FULL DOWN	2000
◇	107.1 FWD	2840	3130	354	FULL UP	2000




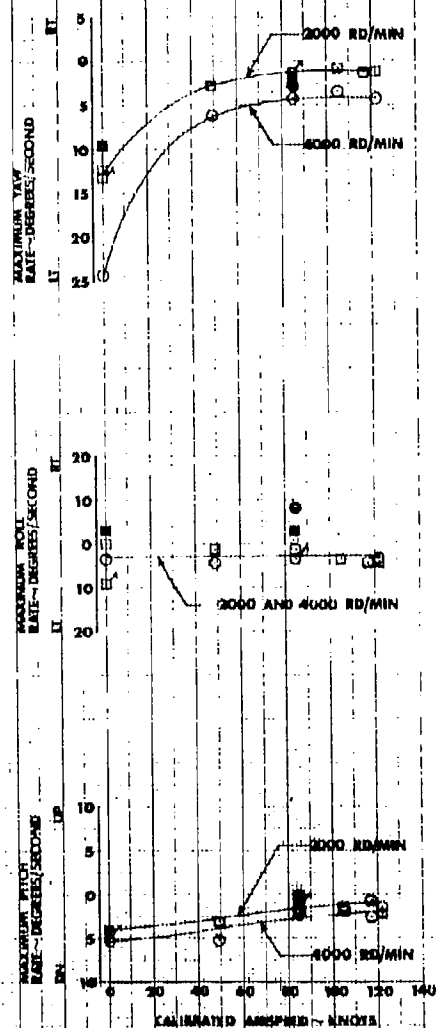




FIGURE 82
FIRING - LOW SPEED
OH-58 USA S/N 16706

DENSITY ALTITUDE ~ 3470 FT
CALIBRATED AIRSPEED ~ 49 KTS
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 2880 LB
CG STATION ~ 1078 IN (FWD)
CONFIGURATION ~ ARMED (DOORS ON)

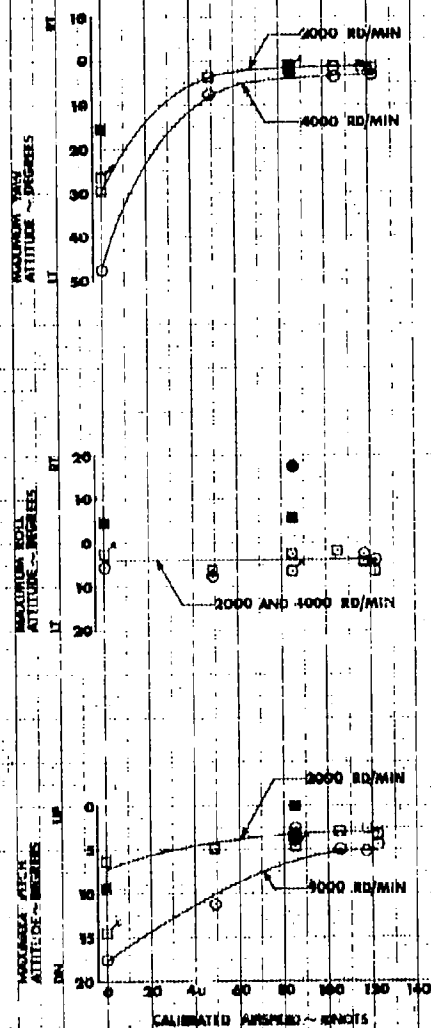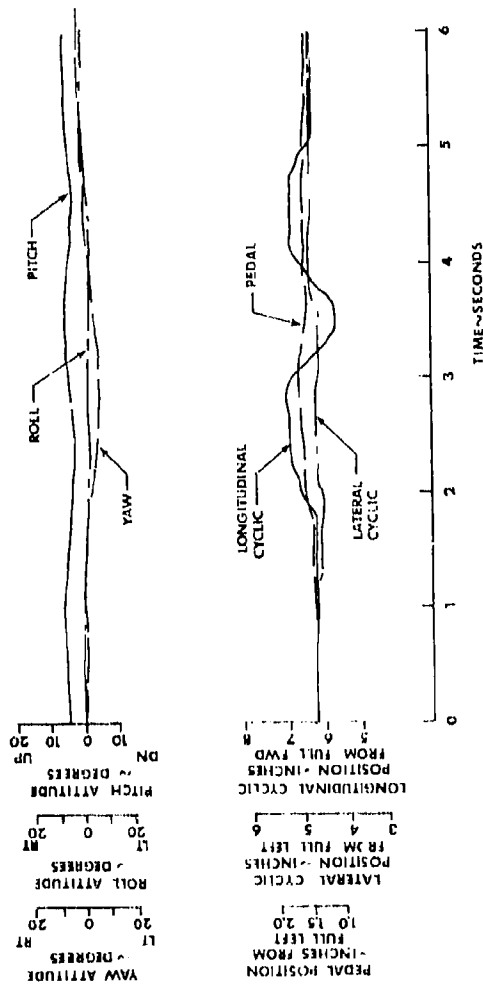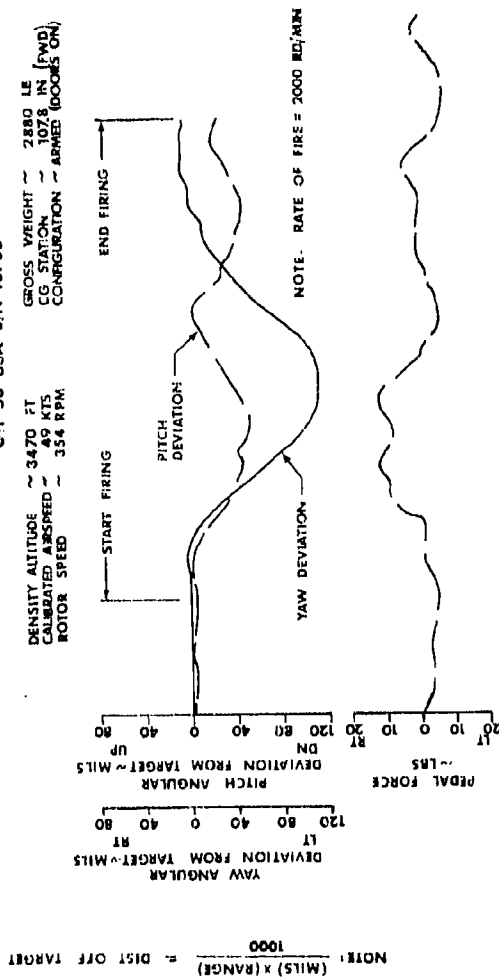

NOTE: FULL CONTROL TRAVEL
LONGITUDINAL = 12.00 IN
LATERAL = 10.00 IN
PEDAL = 0.36 IN

FIGURE 83
FIRING - HIGH SPEED
OH-58 USA S/N 16706

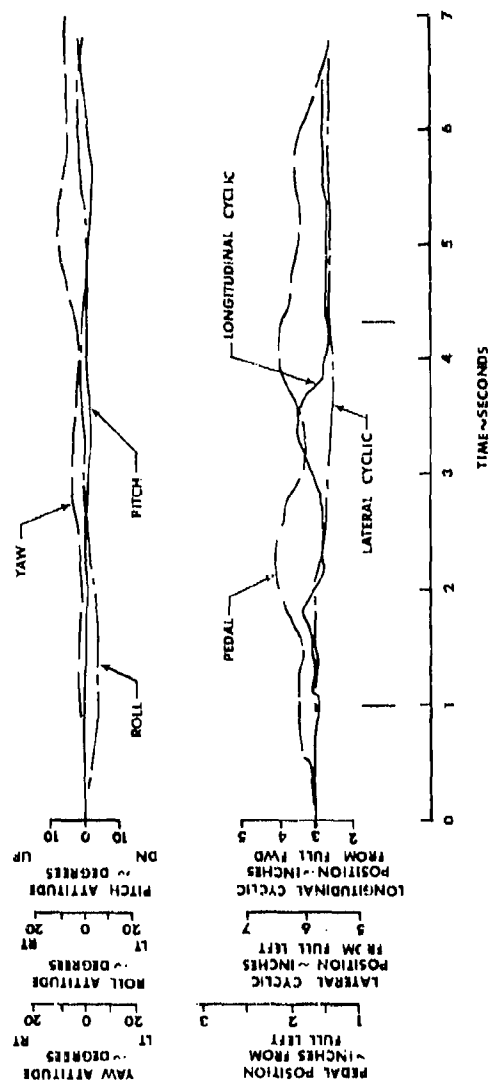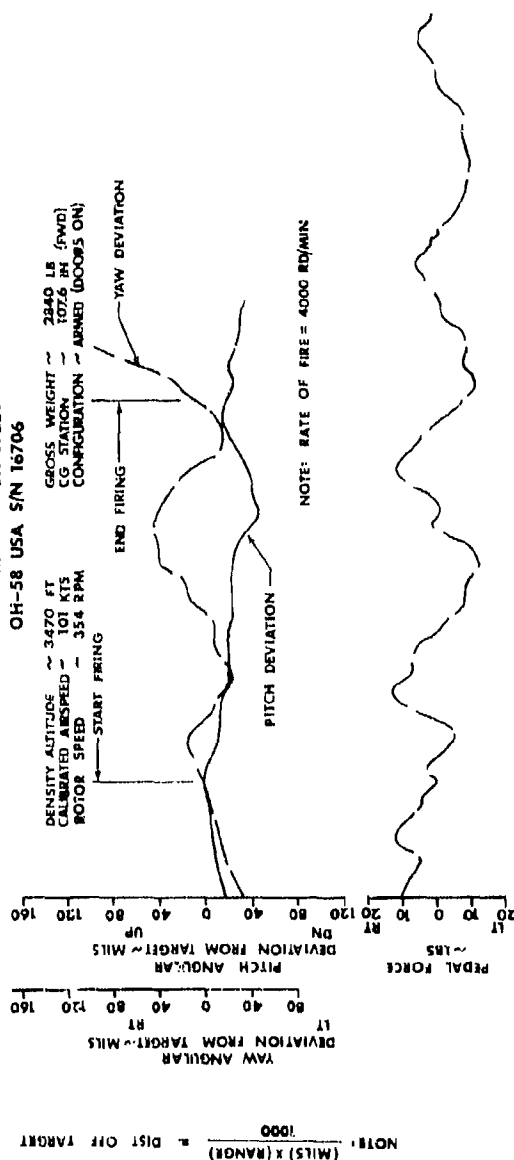

NOTE: FULL CONTROL TRAVEL
 LONGITUDINAL ~ 12.00 IN
 LATERAL ~ 10.30 IN
 PEDAL ~ 6.46 IN

FIGURE 84
FIRING - HOVER
OH-58 USA S/N 16706

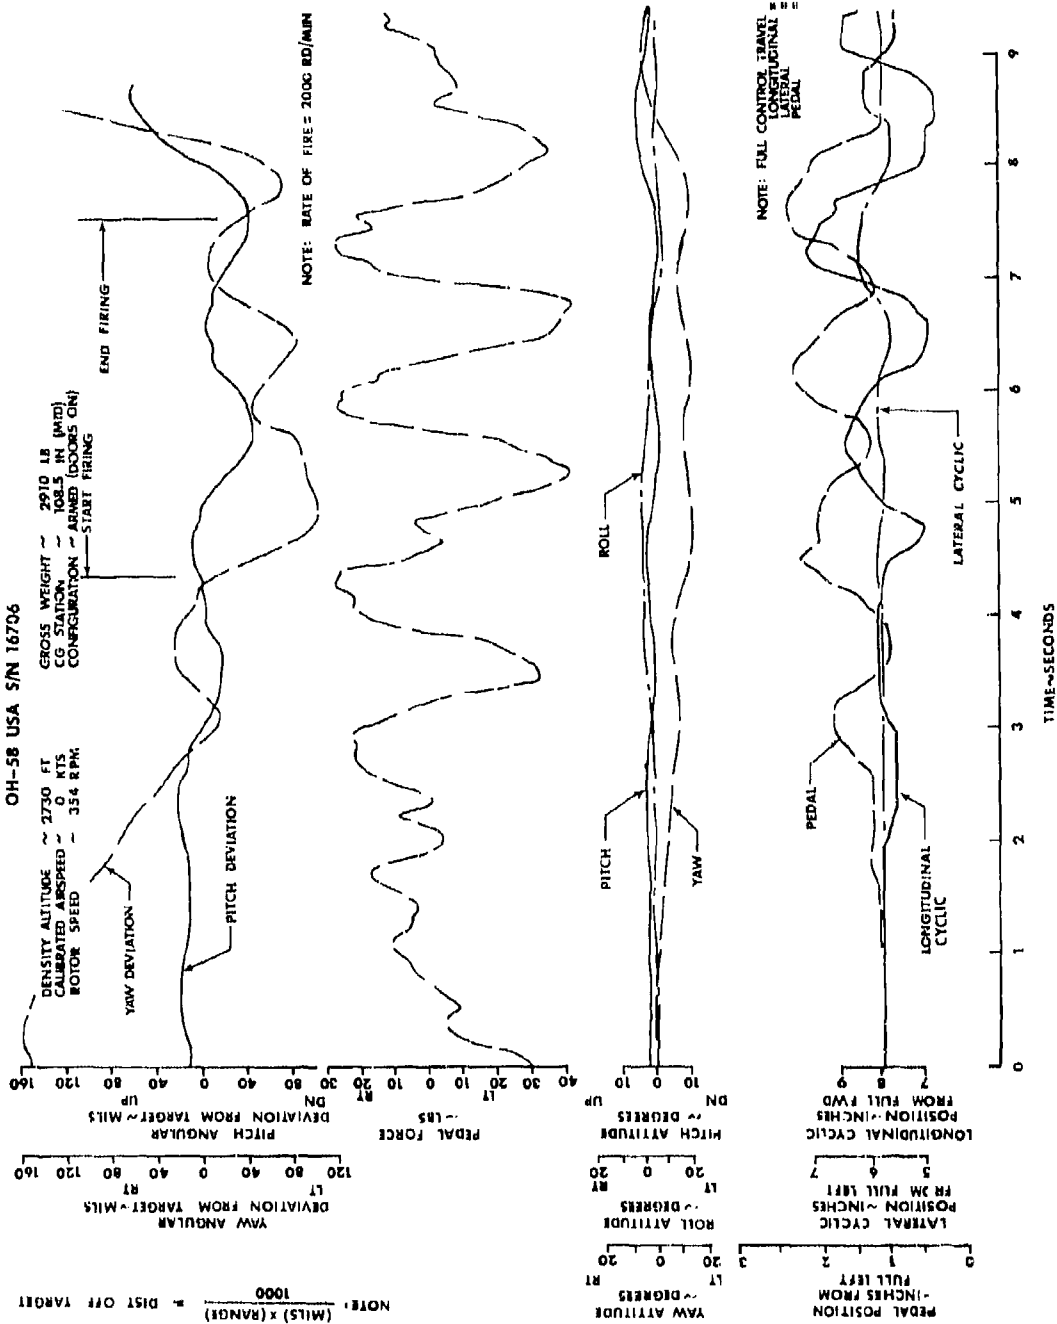


FIGURE 83
BOOST OFF CONTROL FORCES
OH-58A USA S/N 68-16706

NOTES:

1. TESTS CONDUCTED WITH HELICOPTER ON THE GROUND WITH ROTOR STATIC FORCE TRIM OFF
2. FRICTION OFF





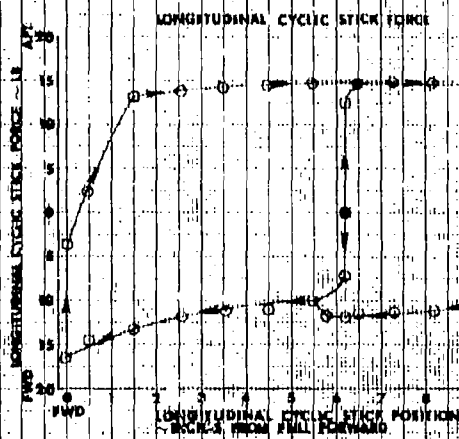


FIGURE 8A
BOOST ON LONGITUDINAL CYCLIC STICK FORCES
OH-38A USA S/N-68-16704

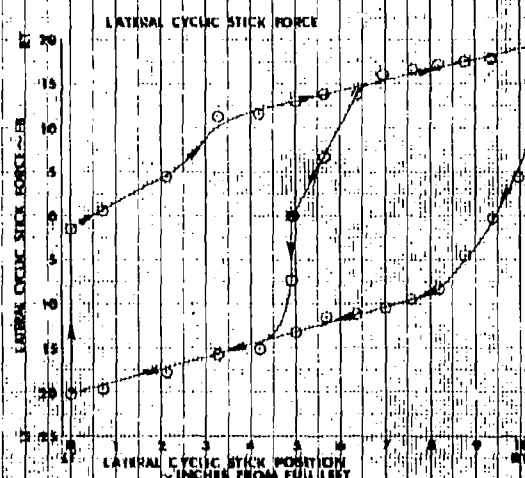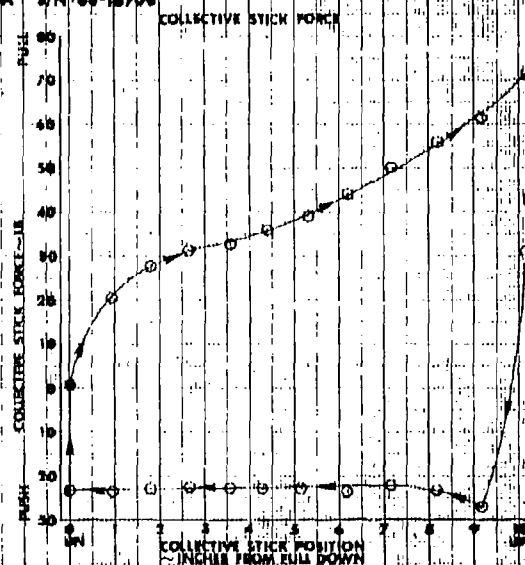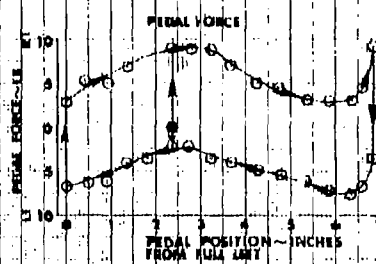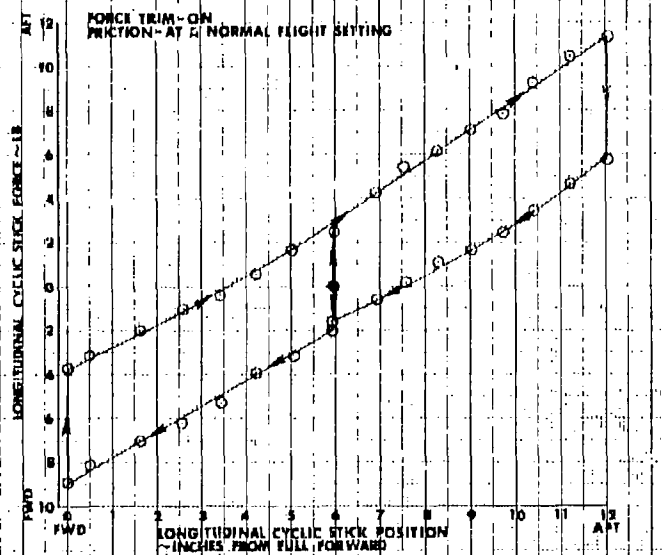

NOTES:

1. TESTS CONDUCTED WITH HELICOPTER ON THE GROUND WITH ROTOR STATIC
2. BOOST ON TESTS CONDUCTED WITH HYDRAULIC PRESSURE SUPPLIED BY AN EXTERNAL SOURCE





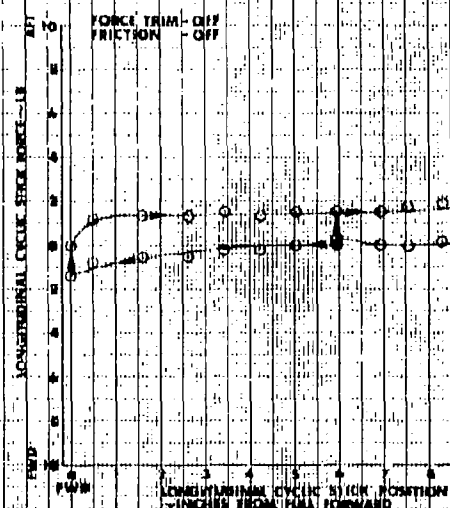


FIGURE 87
LATERAL CYCLIC STICK FORCES
OH-58A USA S/N 68-16706

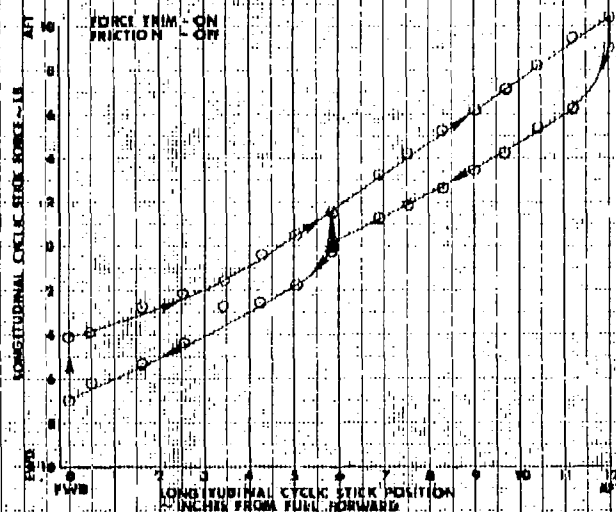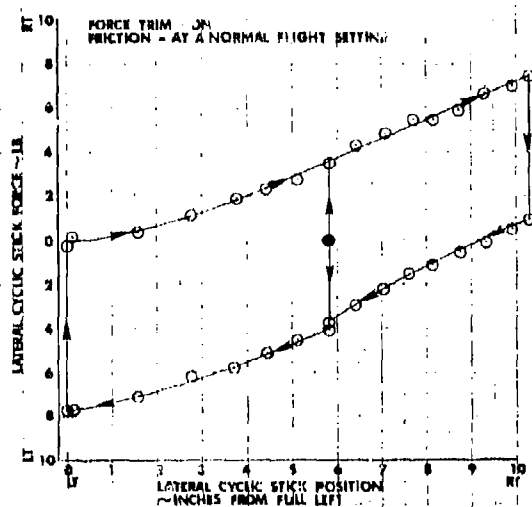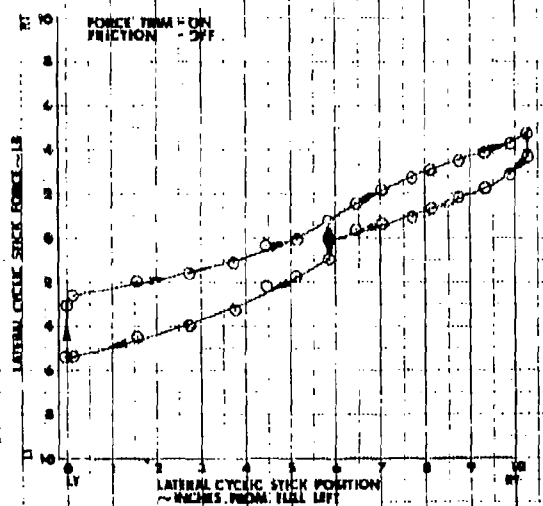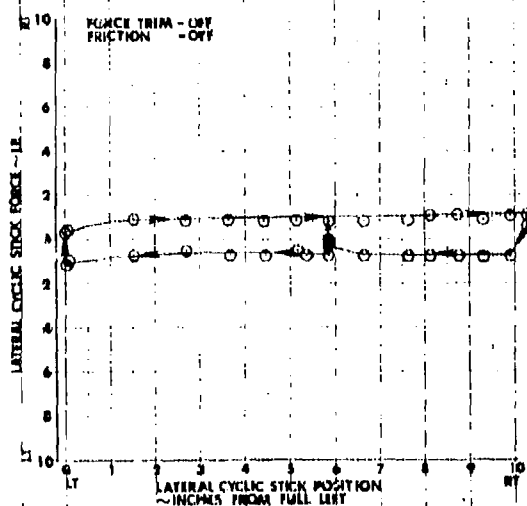

NOTES:

1. TESTS CONDUCTED WITH HELICOPTER ON GROUND WITH ROTOR STATIC
2. ROUGH ON TESTS CONDUCTED WITH HYDRAULIC PRESSURE SUPPLIED BY AN EXTERNAL SOURCE




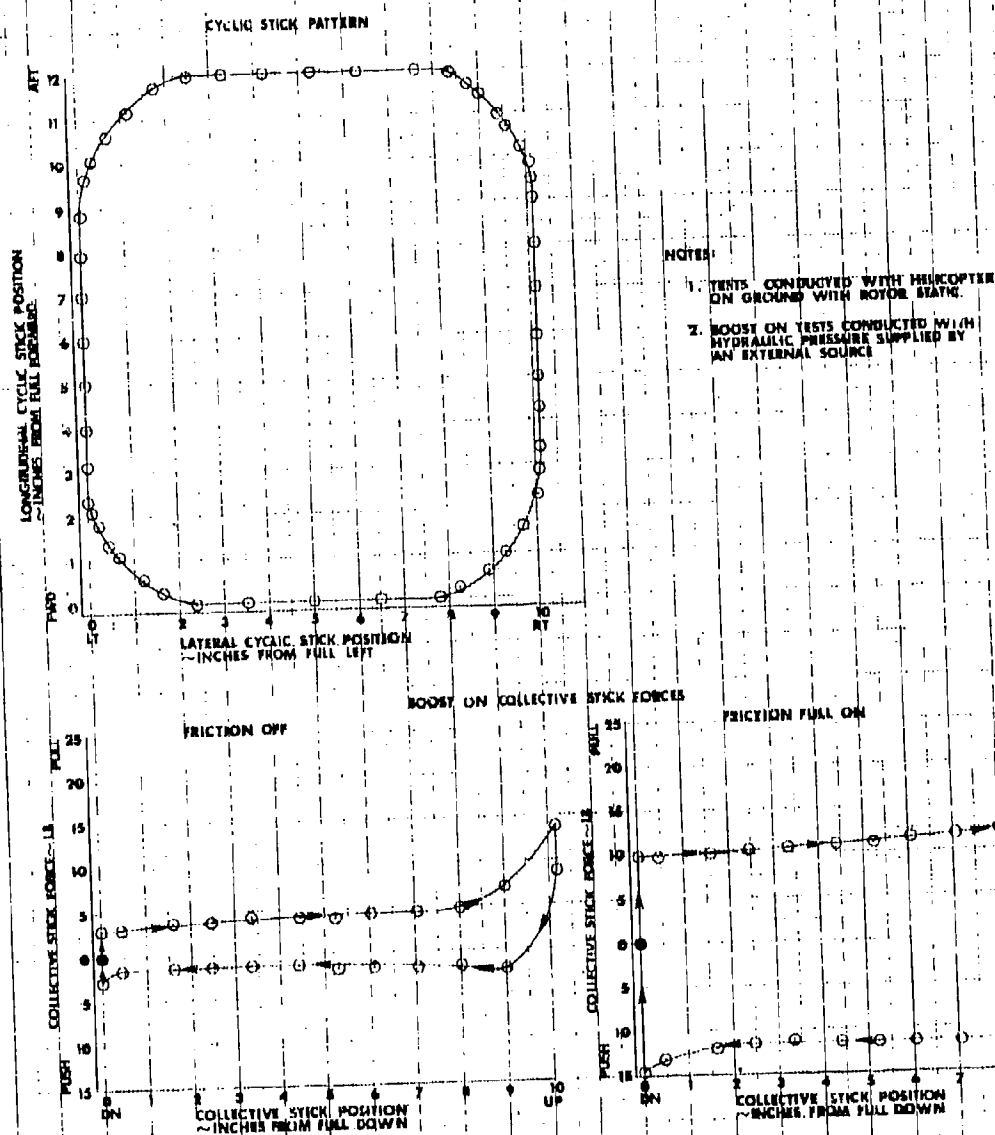


FIGURE 89
LONGITUDINAL COLLECTIVE CONTROL COUPLING
OH-58A USAF S/N 68-16706

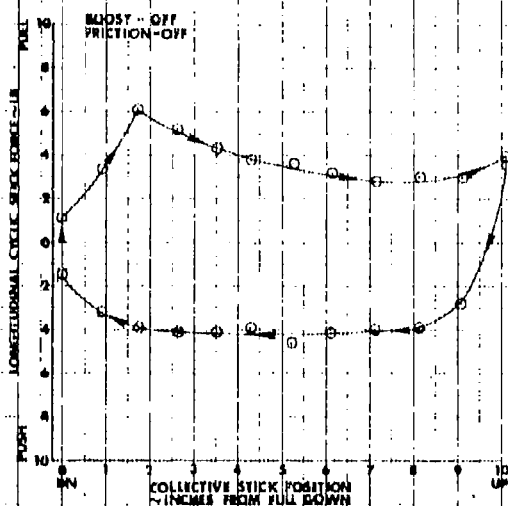

NOTES

1. TESTS CONDUCTED WITH HELICOPTER ON THE GROUND WITH ROTOR STATIC
2. BOOST ON TESTS CONDUCTED WITH HYDRAULIC PRESSURE SUPPLIED BY AN EXTERNAL SOURCE

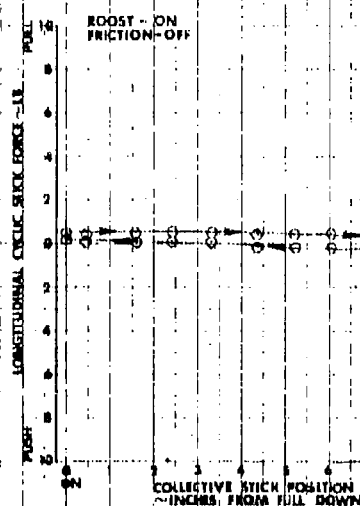


FIGURE 90
BOOST-OFF LANDING
OH-58A USA S/N 68-16706

DENSITY ALTITUDE ~ 5180 FT
CALCULATED AIRSPEED ~ 75 KTS
ROTOR SPEED ~ 354 RPM
GROSS WEIGHT ~ 2950 LB
CG STATION ~ 112.1 IN (AFT)
CONFIGURATION ~ ARMED (DOORS ON)



FIGURE 8 VIBRATION CHARACTERISTICS ON SEA TEST 2/11/68

AVG CG STATION 152.4 (1/40) 3730
AVG CG 152.4 (1/40) 3730
WEIGHT 152.4 (1/40) 3730
HEIGHT 152.4 (1/40) 3730
ALTITUDE 152.4 (1/40) 3730
SPEED 152.4 (1/40) 3730
CONFIGURATION CLEAN (NOO) 018






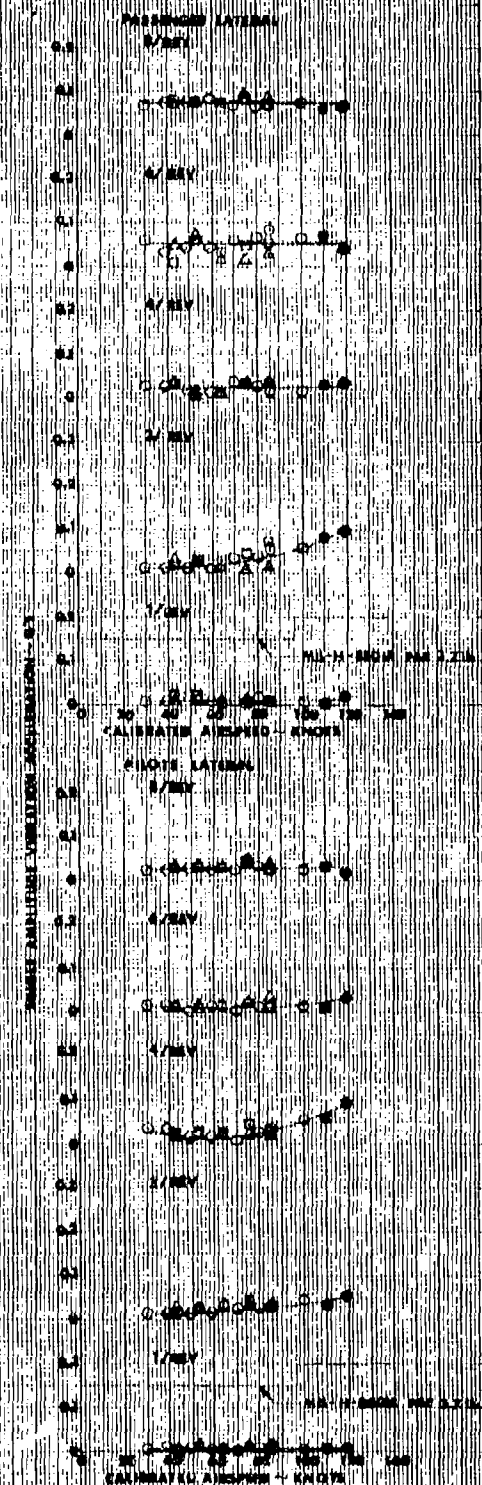


FIGURE 92 VIBRATION CHARACTERISTICS OH-55A, USA S/N 68-14706

AVG CO STATIONARY WEIGHT ~ 1070 (FWD) 27.0
AVG CROSS WEIGHT ~ 13
DENSITY ALTITUDE ~ 10000
ROTOR SPEED ~ 334
CONFIGURATION: ARMED (DOORS ON)

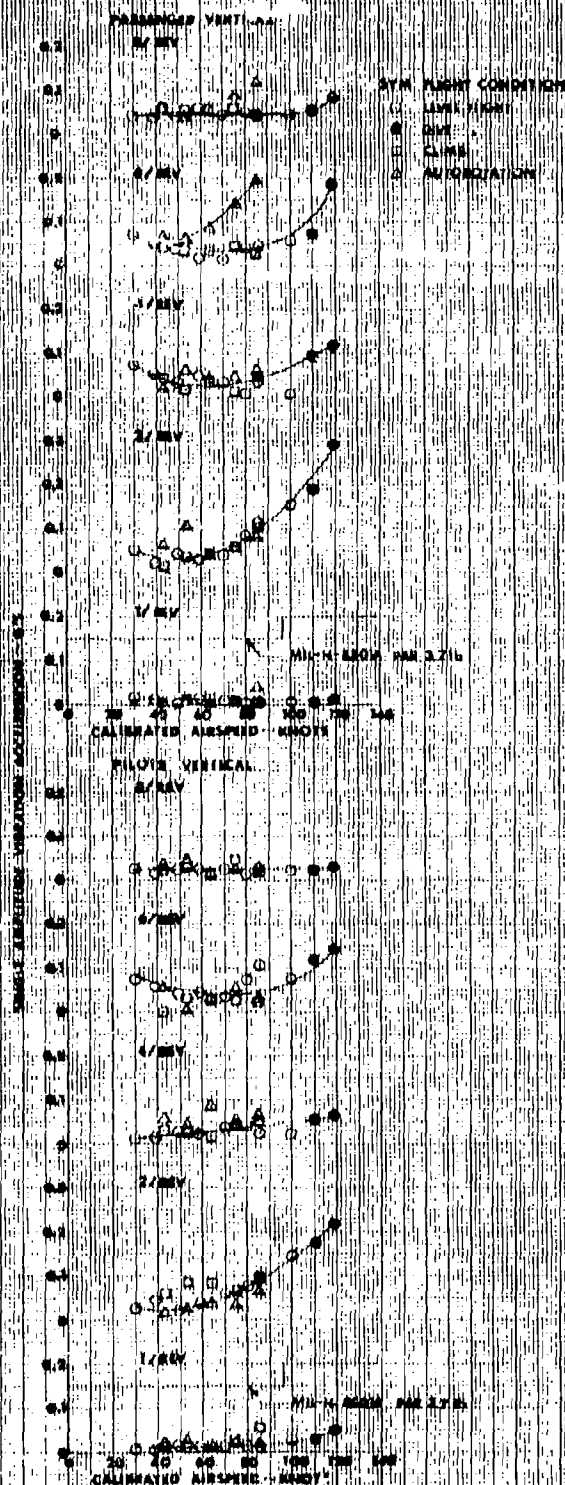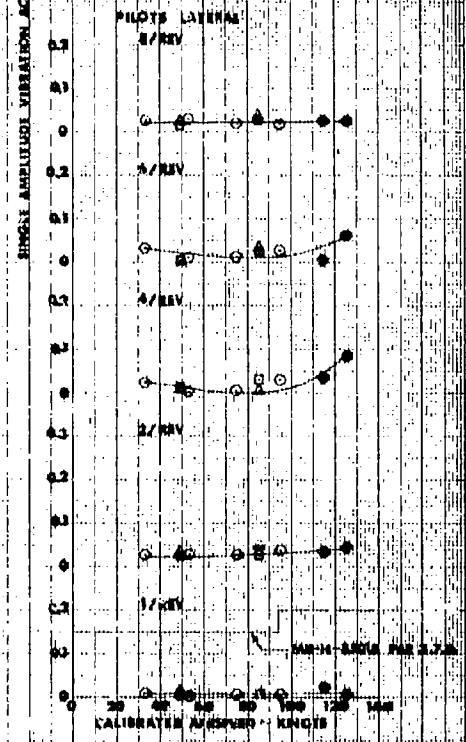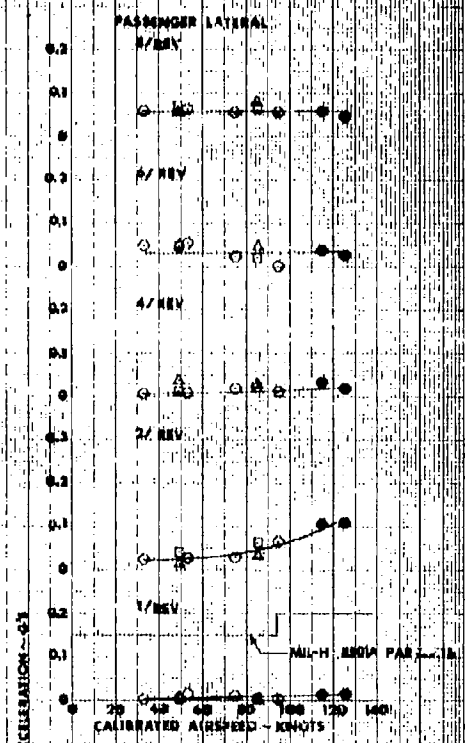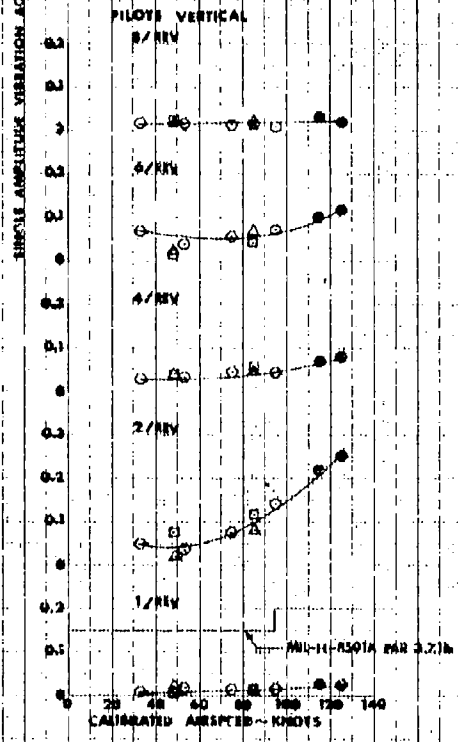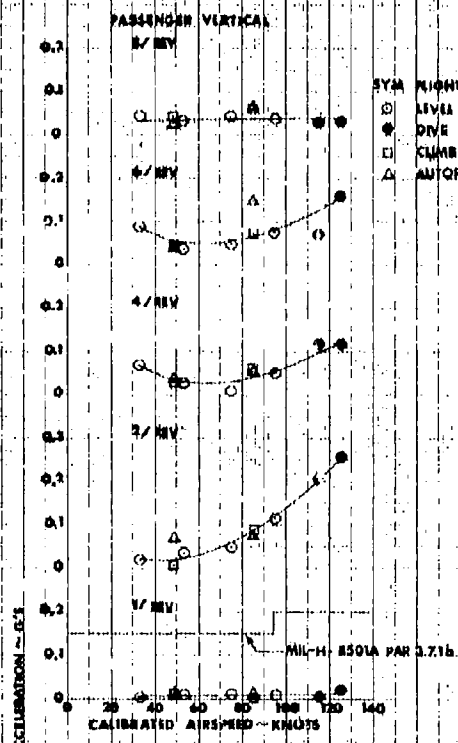

SYM NIGHT CONDITION
○ LEVEL FLIGHT
● DIVE
□ CLIMB
△ AUTOROTATION

WFO CH WATSON - JAMES	WFO CH WATSON - JAMES	SHERIFF SHERIFF - JAMES	WFO CH WATSON - JAMES	CONFIDENTIALITY
104.3 (W.D.)	2003	4500	354	ARMED LOOKS



FIGURE 94
VIBRATION CHARACTERISTICS
OH-SEA 115A S/N 68-16706

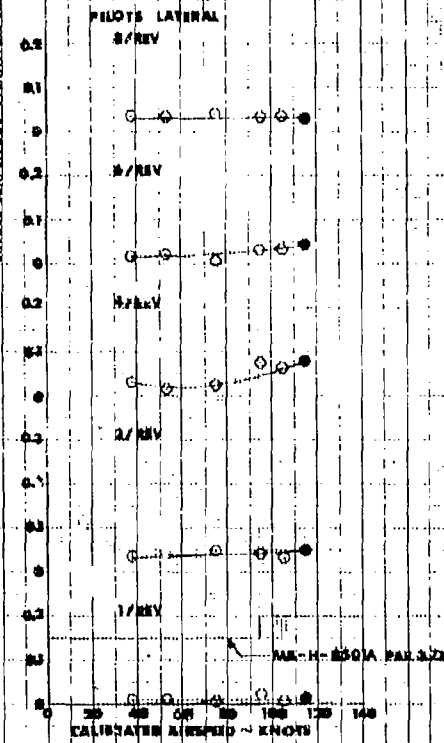
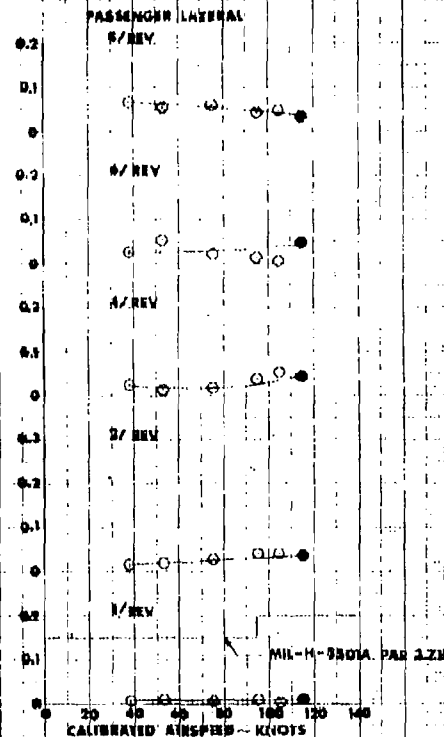
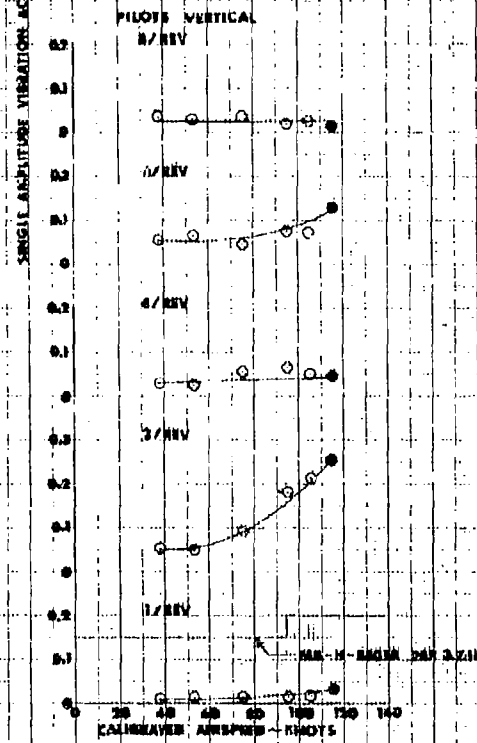
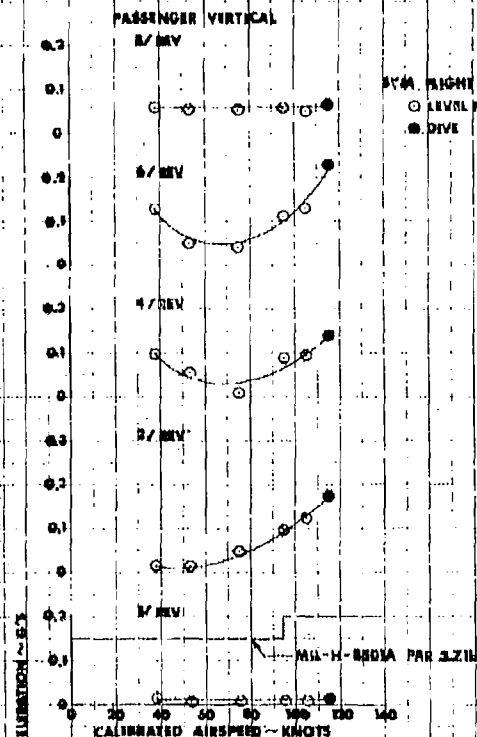


FIGURE 75
VIBRATION CHARACTERISTICS
OH-SEA USA 1/4" 55-14036

WFO C/S
ENTRANCE
~ INCHES
107.1 (FWD)

WFO CROSS
AMOUNT
~ 25
2730





DENSITY
ALTITUDE
~ 71
10930

WFO C/S
ENTRANCE
~ INCHES
107.1 (FWD)

WFO CROSS
AMOUNT
~ 25
2730

CONVOLUTION

1/4" 55-14036

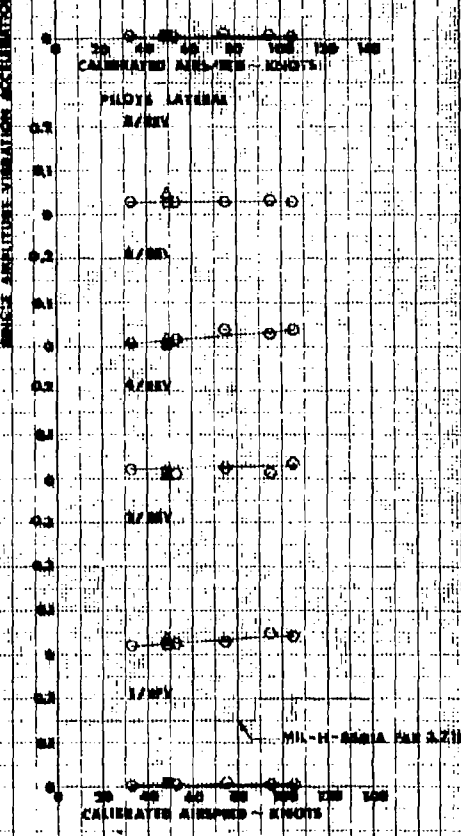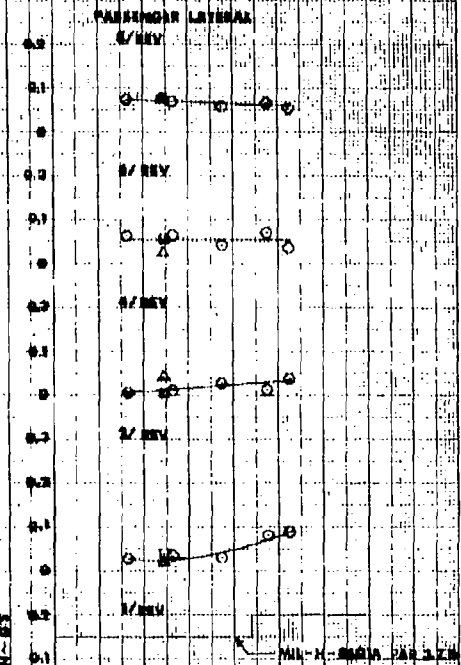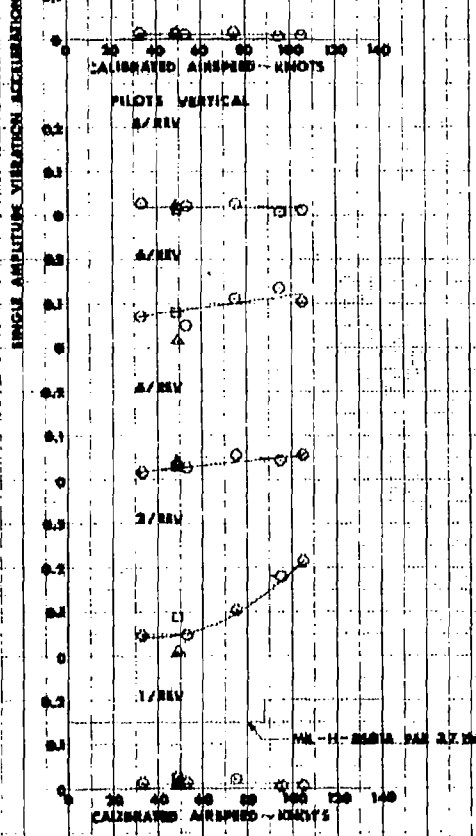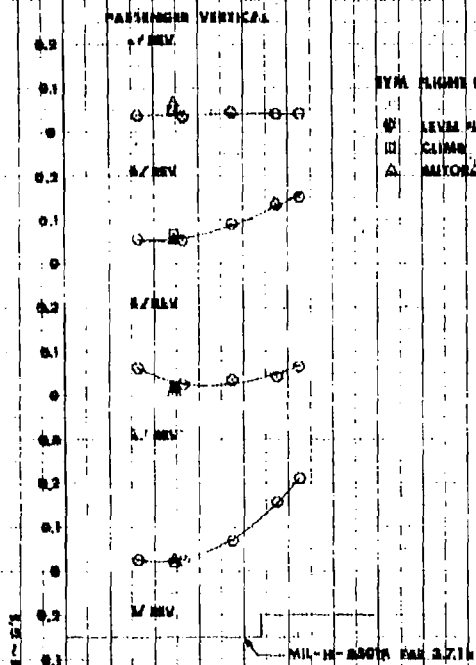

SYM FLIGHT CONDITION

○ LEVEL FLIGHT
□ CLIMB
△ DESCENT

APPENDIX V. SPECIFICATION NONCOMPLIANCE TABLE

Type of Test	Specification MTL-H-8501A Requirement	Specification MTL-H-8501A Paragraph	Results	Test Report Paragraph
Static longitudinal stability	3-inch maximum longitudinal trim change	3.2.10.2	Longitudinal cyclic trim change was 3.5 inches between climb and autorotation	21
Static lateral-directional stability	Pedal and lateral displacement gradients approximately linear between sideslip angles of ± 15 degrees	3.3.9	Pedal and lateral gradients sometimes nonlinear	32
Static lateral-directional stability	Positive pedal and lateral control displacement gradients	3.3.9	Some negative gradients	32
Autorotational entry	2-second minimum delay before lowering collective	3.5.5	Delay times as low as 1.16 seconds in climb	62
Control system evaluation	1.5-pound maximum longitudinal breakout force	3.2.7	1.7-pound longitudinal breakout force	78
Control system evaluation	7-pound maximum pedal breakout force	3.3.13	9-pound pedal breakout force	80
Control system evaluation	Linear pedal force gradient	3.3.11	Nonlinear gradient	80
Control system evaluation	Pedal forces not excessive in steady sideward flight	Deviation 19 (detail spec)	Pedal forces considered excessive (49 pounds)	81
Control system evaluation	15-pound maximum pedal force in sideward flight	3.3.12	49-pound right pedal force, 38-pound left pedal force	81
Control system evaluation	3-pound maximum collective breakout force	3.4.2	4.3-pound collective breakout force	83
Control system evaluation	No control force coupling	3.4.3	0.5-pound force transmitted to cyclic by collective movement (boost ON)	84
Control system evaluation	0.2-inch maximum control free play	3.5.10	0.53-inch longitudinal control free play, 0.91-inch lateral free play (boost OFF)	86
Control system evaluation	1-pound maximum control force transmitted to cyclic by moving collective	3.4.3	6-pound force transmitted (boost OFF)	87
Control system evaluation	Maximum breakout forces: (1.5-lb long. and lat) (3-lb coll)	3.2.7, 3.3.13, 3.4.2	Breakout forces (boost OFF): (14.5-lb long.) (13-lb lat) (38-lb coll)	88
Vibrations	0.15-g maximum vibration level below V cruise	3.7.1(b)	0.19g at 85 KCAS	90
Control response and sensitivity	Damping at least 4575 ft-lb/rad/sec	3.3.19	Damping approached zero	43
Control response and sensitivity	20-deg/sec/in. maximum lateral control response	3.3.15	24-deg/sec/in. lateral control response reached	41

APPENDIX VI. DISTRIBUTION

<u>Agency</u>	<u>Test Plans</u>	<u>Interim Reports</u>	<u>Final Reports</u>
Commanding General US Army Aviation Systems Command			
ATTN: AMSAV-R-F	5	5	6
AMSAV-C-A	-	-	2
AMSAV-D-ZDOR	-	-	2
AMSAV-D-W	-	-	2
AMSAV-R-R	-	-	1
PO Box 209 St. Louis, Missouri 63166			
Commanding General US Army Materiel Command			
ATTN: AMCPM-LH	5	1	25
PO Box 209 St. Louis, Missouri 63166			
Commanding General US Army Materiel Command			
ATTN: AMCRD	2	1	2
AMCAD-S	-	-	1
AMCPP	-	-	1
AMCMR	2	-	2
AMCQA	-	-	1
Washington, D. C. 20315			
Commanding General US Army Combat Developments Command			
ATTN: USACDC LnO	11	11	11
PO Box 209 St. Louis, Missouri 63166			
Commanding General US Continental Army Command			
ATTN: DCSIT-SCH-PD	-	-	1
Fort Monroe, Virginia 23351			

<u>Agency</u>	<u>Test Plans</u>	<u>Interim Reports</u>	<u>Final Reports</u>
Commanding General US Army Test and Evaluation Command			
ATTN: AMSTE-BG	2	2	2
USMC InO	1	1	1
Aberdeen Proving Ground, Maryland 21005			
Commanding Officer US Army Aviation Materiel Laboratories			
ATTN: SAVFE-SO, M. Lee	-	-	1
SAVFE-TD	-	-	2
SAVFE-AM	-	-	1
SAVFE-AV	-	-	1
SAVFE-PP	-	-	1
Fort Eustis, Virginia 23604			
Commanding General US Army Aviation Center Fort Rucker, Alabama 36362	1	1	1
Commandant US Army Primary Helicopter School Fort Wolters, Texas 76067	1	1	1
President US Army Aviation Test Board Fort Rucker, Alabama 36362	1	1	1
Director US Army Board for Aviation Accident Research Fort Rucker, Alabama 36362	-	1	1
President US Army Maintenance Board Fort Knox, Kentucky 40121	-	-	1
Commanding General US Army Electronics Command ATTN: AMSEL-VL-D Fort Monmouth, New Jersey 07703	-	-	1

<u>Agency</u>	<u>Test Plans</u>	<u>Interim Reports</u>	<u>Final Reports</u>
Commanding General US Army Weapons Command ATTN: AMSWE-RDT ANSWE-REW (Airborne Armament Flying) Rock Island Arsenal Rock Island, Illinois 61202	- -	- -	2 2
Commandant US Marine Corps Washington, D. C. 20315	-	-	1
Director US Marine Corps Landing Force Development Center Quantico, Virginia 22133	1	1	2
US Air Force Aeronautical Systems Division ATTN: ASNFD-10 Wright Patterson Air Force Base, Ohio 45433	-	-	1
Air Force Flight Test Center ATTN: PSD SYSE Edwards Air Force Base, California 93523	- -	- -	5 2
Naval Air System Command Headquarters (A530122) Department of the Navy Washington, D. C. 20350	-	-	1
Commander Naval Air Test Center (FT23) Patuxent River, Maryland 20670	1	-	1
Federal Aviation Administration ATTN: Administrative Standards Division (MS-110) 800 Independence Avenue S.W. Washington, D. C. 20590	-	-	2

<u>Agency</u>	<u>Test Plans</u>	<u>Interim Reports</u>	<u>Final Reports</u>
Department of the Army Office of the Chief, Research and Development ATTN: CRD Washington, D. C. 20310	7	-	7
Department of the Army Deputy Chief of Staff for Logistics ATTN: LOG/MED LOG/SAA-ASLSB Washington, D. C. 20310	- -	- -	1 1
Director US Army Aeromedical Research Unit Fort Rucker, Alabama 36360	-	-	1
Bell Helicopter Company Military Marketing Sales Engineering PO Box 482 Fort Worth, Texas 79901	-	-	5
Allison Division of General Motors Corporation PO Box 894 Indianapolis, Indiana 46206	-	-	5
Defense Documentation Center Cameron Station Alexandria, Virginia 22314	-	-	20

UNCLASSIFIED

Security Classification

DOCUMENT CONTROL DATA - R & D

(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)

1. ORIGINATING ACTIVITY (Corporate author) US ARMY AVIATION SYSTEMS TEST ACTIVITY EDWARDS AIR FORCE BASE, CALIFORNIA 93523		2a. REPORT SECURITY CLASSIFICATION UNCLASSIFIED	
3. REPORT TITLE AIRWORTHINESS AND FLIGHT CHARACTERISTICS TEST, PRODUCTION OH-58A HELICOPTER UNARMED AND ARMED WITH XM27E1 ARMAMENT SUBSYSTEM, STABILITY AND CONTROL		2b. GROUP	
4. DESCRIPTIVE NOTES (Type of report and inclusive dates) FINAL REPORT, August 1968 through June 1970			
5. AUTHOR(S) (First name, middle initial, last name) EMMETT J. LAING, Project Engineer WILLIAM A. GRAHAM, JR., LTC TC, US Army, Project Officer/Pilot PAUL C. STRINGER, MAJ CE, US Army, Project Pilot			
6. REPORT DATE OCTOBER 1970		7a. TOTAL NO. OF PAGES 162	7b. NO. OF REFS 6
8a. CONTRACT OR GRANT NO.		9a. ORIGINATOR'S REPORT NUMBER(S) USAASTA PROJECT NO. 68-30	
b. PROJECT NO. USAAVSCOM PPROJECT NO. 68-30		9b. OTHER REPORT NO(S) (Any other numbers that may be assigned this report) N/A	
c. USAASTA PROJECT NO. 68-30			
d.			
10. DISTRIBUTION STATEMENT This document may be further distributed by any holder only with specific prior approval of the CG, USAAVSCOM, ATTN: AMSAV-R-F, PO Box 209, St. Louis, Missouri 63166			
11. SUPPLEMENTARY NOTES		12. SPONSORING MILITARY ACTIVITY US ARMY AVIATION SYSTEMS COMMAND ATTN: AMSAV-R-F PO Box 209, St. Louis, Missouri 63166	
13. ABSTRACT Stability and control tests were conducted on a production model OH-58A helicopter to evaluate its flying qualities in the unarmed configuration and in an armed configuration with the XM27E1 weapon system. Limited testing was also performed to evaluate the helicopter slope landing capabilities and flying qualities with skis installed. Human factors and maintainability characteristics were noted throughout the evaluation. Testing was performed by the US Army Aviation Systems Test Activity, Edwards Air Force Base, California, between 6 October 1969 and 16 February 1970. The testing consisted of 89 flights which totaled 85.3 hours of productive flight testing. There were no deficiencies recorded. Eighteen shortcomings are reported. Difficulty in maintaining precise directional control during hovering flight is a shortcoming which warrants improvement on a priority basis. This shortcoming requires excessive pilot effort and degrades the accuracy in firing of the XM27E1 armament subsystem. It is recommended that a caution note be placed in the operator's manual warning against hovering in a tail wind in excess of 30 knots. The capability of landing on a 10-degree slope was marginal but is not considered to be a shortcoming. Flying qualities of the aircraft with skis installed were satisfactory. Maintainability of the helicopter was excellent throughout the test program.			

DD FORM 1473

NOV 66

REPLACES DD FORM 1473, 1 JAN 64, WHICH IS OBSOLETE FOR ARMY USE.

UNCLASSIFIED

Security Classification

UNCLASSIFIED

Security Classification

14. KEY WORDS	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT
OH-58A helicopter Stability and control XM27E1 weapon system Flying qualities with skis Human factors						

UNCLASSIFIED