

| REPORT DOCUMENTATION PAGE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                                     | READ INSTRUCTIONS<br>BEFORE COMPLETING FORM                                   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|-------------------------------------------------------------------------------|
| 1. REPORT NUMBER<br>(12) NWSC/CR RDTR-150                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 2. GOVT ACCESSION NO.<br>AD-A105451 | 3. RECIPIENT'S CATALOG NUMBER                                                 |
| 4. TITLE (and Subtitle)<br>Optical Constants of Boron Carbide                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                                     | 5. TYPE OF REPORT & PERIOD COVERED<br>(9) Final Report                        |
| 7. AUTHOR(s)<br>(10) James L. Lauer                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                                     | 6. PERFORMING ORG. REPORT NUMBER                                              |
| 9. PERFORMING ORGANIZATION NAME AND ADDRESS<br>Department of Mechanical Engineering<br>Rensselaer Polytechnic Institute<br>Troy, NY 12181                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                                     | 8. CONTRACT OR GRANT NUMBER(s)<br>(15) N00164-79-M-2522                       |
| 11. CONTROLLING OFFICE NAME AND ADDRESS<br>Department of the Navy<br>Naval Weapons Support Center<br>Crane, IN 47522                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |                                     | 10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS<br>11, 14, 12, 11 |
| 14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                                     | 12. REPORT DATE<br>August 14, 1981                                            |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                     | 13. NUMBER OF PAGES<br>115 (12) 13.5                                          |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                     | 15. SECURITY CLASS. (of this report)<br>NC                                    |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                     | 15a. DECLASSIFICATION/DOWNGRADING SCHEDULE                                    |
| 16. DISTRIBUTION STATEMENT (if different from Controlling Office)<br><br>Approved for Public Release;<br>Distribution Unlimited                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                     |                                                                               |
| 17. DISTRIBUTION STATEMENT (of abstract entered in Block 20, if different from Report)<br><br>DTIC ELECTE<br>OCT 14 1981                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                                     |                                                                               |
| 18. SUPPLEMENTARY NOTES                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                                     |                                                                               |
| 19. KEY WORDS (Continue on reverse side if necessary and identify by block number)<br>Boron Carbide, infrared reflectance, optical constants, refractive index, absorptivity                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                                     |                                                                               |
| 20. ABSTRACT (Continue on reverse side if necessary and identify by block number)<br>The optical constants $n$ and $k$ have been determined in the $700\text{--}1200\text{ cm}^{-1}$ wavenumber region for a boron carbide flat of compressed 2 micrometer diameter particles by the polarized reflection method. A broad absorption band has been found near $1050\text{ cm}^{-1}$ , where $k$ reached values of 1 to 2 and $n$ of lower than 1.5. The scatter of the data points was large, probably because of the demonstrated presence of up to 10% of iron oxide on the surfaces (by SEM/X-ray).<br>More accurate procedures are suggested for future work. The suspension of the particles in one arm of a Michelson interferometer is probably the most |                                     |                                                                               |

406357

direct and superior method for obtaining n and k for such particles.

OPTICAL CONSTANTS OF BORON CARBIDE

by

James L. Lauer  
Research Professor of Mechanical Engineering  
Rensselaer Polytechnic Institute  
Troy, NY 12181

Final Report (Part II)  
NO0164-79-M-2522  
Requisition No. 542-50-9013-0636

Submitted to:

Dr. Carl E. Dinerman  
Naval Weapons Support Center  
Crane, Indiana 47522

# TABLE OF CONTENTS

|                                   | page |
|-----------------------------------|------|
| ABSTRACT.....                     | iv   |
| I. INTRODUCTION.....              | 1    |
| II. MATERIAL.....                 | 3    |
| III. APPARATUS.....               | 4    |
| IV. EXPERIMENTAL PROCEDURE.....   | 7    |
| V. DATA PROCESSING.....           | 9    |
| VI. RESULTS.....                  | 12   |
| VII. DISCUSSION.....              | 13   |
| VIII. SUGGESTED FURTHER WORK..... | 14   |
| REFERENCES.....                   | 15   |
| LIST OF FIGURES.....              | 16   |
| APPENDIX I                        |      |

|                    |                                     |
|--------------------|-------------------------------------|
| Accession For      |                                     |
| NTIS GRA&I         | <input checked="" type="checkbox"/> |
| DTIC TAB           | <input type="checkbox"/>            |
| Unannounced        | <input type="checkbox"/>            |
| Justification      |                                     |
| By                 |                                     |
| Distribution/      |                                     |
| Availability Codes |                                     |
| Dist               | Avail and/or<br>Special             |
| A                  |                                     |

# ABSTRACT

The optical constants  $n$  and  $k$  have been determined in the 700 - 1200  $\text{cm}^{-1}$  wavenumber region for a boron carbide flat of compressed 2 micrometer diameter particles by the polarized reflection method. A broad absorption band has been found near 1050  $\text{cm}^{-1}$ , where  $k$  reached values of 1 to 2 and  $n$  of lower than 1.5. The scatter of the data points was large, probably because of the demonstrated presence of up to 10% of iron oxide on the surfaces (by SEM/X-ray).

More accurate procedures are suggested for future work. The suspension of the particles in one arm of a Michelson interferometer is probably the most direct and superior method for obtaining  $n$  and  $k$  for such particles.

## I. INTRODUCTION

Boron carbide has been suggested as a material suitable for obscuration against thermal imaging. Early work by Brame<sup>1</sup> and coworkers, using the KBr disk dispersion method, showed a broad absorption band near 9.5  $\mu\text{m}$  and a weak band near 12.5  $\mu\text{m}$ , the former band overlapping one of the  $\text{CO}_2$  laser bands (9.6  $\mu\text{m}$ ). It has been shown that obscuration by small absorbing particles is more effective than general absorption and scattering by an aerosol spray.

The obscuration characteristics of a powder depend on the complex index of refraction at the required wavelengths in the atmospheric window, which is 8 - 14  $\mu\text{m}$  in the mid-infrared, and on particle size, shape and concentration. However, the two parts of the complex index, the real and the imaginary part, which are the optical constants  $n$  and  $k$ , themselves depend on particle size and shape and -- to make things even more complicated -- are not independent of each other. The pragmatic way of measuring these quantities and their interrelation, namely by field trials, is costly and not really practical, since different conditions and their interactions would require exploration. The closest laboratory simulation of field conditions would seem to be dispersion of the powder in one arm of a two-beam interferometer and comparison with a reference phase and intensity. Stabilization of the powder as an aerosol should not be too difficult to obtain. This method was given much thought, but was not applied because enough time on our infrared interferometer was not available. This was unfortunate, because the data so obtained would have been applicable to the problem at hand with only a minimum of theoretical interfacing.

Next in line of sophistication appeared to be Brame's method, already referred to, i.e. the determination of transmittancy through KBr disks in which boron carbide powder is dispersed. Huffman<sup>2</sup> recently advanced this procedure to make it more pertinent to the obscuration problem. Our experience with the KBr technique in an analytical laboratory warned us of a number of difficulties, such as nonuniform dispersion, accumulation of impurities, especially water, at interfaces, particle size and concentration effects, etc. Huffman has been able to minimize these difficulties by careful attention to detail.

Given the various restrictions and our desire to make a beginning in this study, we decided on using the polarized reflectance method with a polished plate of compressed boron carbide. This was not the procedure we had originally proposed, but we thought it would--and, in fact, it did--give us better insight into the overall problem and provide some preliminary data. It would then become the basis for an adaptation of the interferometer method at some later time.

## II. MATERIAL

Boron carbide is heterotropic; however, it is not too far from being isotropic, being hexagonal and rhombohedral, so that a diamond-polished compressed and sintered disk should present an average and representative surface. The Norton Company supplied us with a 5mm thick plate, which was cut with a diamond saw to 10mm x 10mm square. The large surfaces were diamond-turned to a flatness and polish of better than 1  $\mu$ m. A specimen was coated by evaporation with a thin layer of gold and examined under the scanning electron microscope (SEM). Figure 1 shows a representative picture at a magnification of 1000X. This picture was obtained with back-scattered electrons, since this mode showed more detail. The lighter particles amounting to about 10% of the areas studied turned out to contain significant amounts of iron (by X-ray scattering built into the SEM). The surface concentration of iron is thus much above the bulk concentration given by Norton as 0.5 - 0.9%.

The bulk density of the specimen was only 1.2 g/ml--whereas the particle density (by Norton) is a 2.5 g/ml. Accordingly the reflectivities of such a surface, assuming uniform porosity should be increased by a factor of two. However, nothing in the electron photomicrographs would indicate the need for such a correction. Perhaps the "black holes" were filled in during the polishing operation. Furthermore, as will be shown, such high reflectivities could not be reconciled with possible optical constants.

### III. APPARATUS

The instrument used for the reflectance measurements was a Model 221 Perkin-Elmer double-beam grating spectrophotometer with a Harrick reflectance adapter (VRA and VARA) containing a mirror system automatically equating angles of incidence and reflection. The optics is shown in Figure 2. The original plan was to use internal reflection with the germanium hemicylinder, according to the arrangement of Figure 2a. Considerable effort was spent on making good contact between the flat germanium surface and the boron carbide surface. It did not work. To convince ourselves that our unit functioned properly we duplicated Robinson and Price's<sup>3</sup> work on teflon and experienced no difficulty. Admittedly, we avoided exerting much pressure to force the boron carbide and germanium surfaces against each other for fear of breakage. By contrast, teflon would flow under pressure. Given more time, a liquid of suitable index of refraction could have been used as an interface, perhaps on a KRS-5 hemicylinder instead of a germanium hemicylinder. The latter material was not available, however, and the selection of a fluid (no absorption bands in the pertinent wavelength region and an index of refraction equal to that of KRS-5) would have had to be done with care. For internal reflection--it will be recalled--the refractive index of the hemicylinder must always exceed that of boron carbide. Thus, reluctantly, internal reflection--the procedure most successfully used for the determination of the optical constants of liquids by Crawford and coworkers<sup>4</sup>--had to be abandoned and specular reflection used instead.

Two principal difficulties were noted with the specular reflection arrangement: (i) Since the focus had to be located at the boron carbide

surface, there had to be some angular spread. It was about  $\pm 2$  degrees. The angular sensitivity was thus reduced. (ii) The area illuminated would vary with angle since the focal image on the boron carbide surface was not just a "point". We therefore took pains to measure a standard gold surface in exactly the same way as the boron carbide surface. However, large angles of incidence turned out to be very difficult to handle for this reason and very small angles could not be accommodated by the Harrick design. Our range of angles of incidence was therefore limited to  $40^\circ$  -  $60^\circ$ . For this reason we chose to vary the plane of polarization at a fixed angle for the optical constant determinations, rather than the angles of incidence.

The polarizer used was purchased from Cambridge Instruments of England. It consists of a one-inch diameter disk of KRS-5 containing aluminized parallel wires  $0.4 \mu\text{m}$  apart. It therefore covers the entire midinfrared range with an efficiency of better than 95%. The theory of parallel wire polarizers shows that radiation, whose electric vector is in a plane perpendicular to the direction of the wires, is transmitted.

Since the spectrophotometer is a double-beam one designed for absorption spectroscopy, it is necessary to have either an identical reflectance adapter in the reference beam or an attenuator to compensate for the radiation loss in the adapter. The latter course was chosen to avoid the high cost of another adapter. The attenuator used was made by Research and Industrial Instruments Corporation of London, England. It consists of a stationary and a rotating comb of variable position and a screen holder accommodating screens of different mesh size. Calibration of the screens and the angular positions was accomplished by placing the attenuator into the sample beam and comparing it with the unobstructed reference beam.

Originally the two beams were adjusted to be of equal strength. Differences on account of the attenuator could be directly converted to "fraction transmitted".

Since the instrument was designed for absorption spectrophotometry, the chart paper is marked in a logarithmic manner, recording the "absorbance" (base-10 logarithm of the reciprocal of the fraction of incident radiation transmitted at the sample side). The procedure of handling the data will be shown in the following section.

#### IV. EXPERIMENTAL PROCEDURE

The attenuator and screens were calibrated for various openings, i.e. "absorbances" were determined for them. The reflection adapter was placed in the sample position of the spectrophotometer and aligned for optimum signal output according to the directions of the manufacturers. A gold surface was placed at the focal position (Figure 2). The appropriate attenuator screen and position was selected to permit adjustment of the scale to a reading of zero absorbance (100% transmittance, in this case 100% reflectance) at the wavenumber of maximum signal strength. Since the instrument was thus working at a lower level of radiation and therefore at a lower signal/noise ratio than is normal, the time constant and the scanning time had to be increased considerably. The wavenumber region from 1200 to 700  $\text{cm}^{-1}$  was scanned, using a standard slit program. The run was repeated with the polarizer in the beam, both with the plane of polarization in the plane of incidence and with the plane of polarization at right angles to the plane of incidence.

Then the boron carbide surface was exchanged for the gold surface and the same three scans (unpolarized, polarized  $\perp$ , and polarized  $\parallel$ ) were performed. Since boron carbide reflected less of the incident beam than gold (whose reflectivity was assumed to be unity), it was necessary to place different screens into the attenuator and to change the angular position of the combs from what they were with the gold surface. The reflectivity of boron carbide relative to that of gold was calculated from the equation

$$A_{BC} = A_{BC}^R + A_{BC}^S - A_{Au}^R - A_{Au}^S \quad (1)$$

and

$$R_{BC} = 10^{-A_{BC}} \quad (2)$$

where

- $A_{BC}$  = apparent absorbance of the boron carbide surface
- $A_{BC}^R$  = absorbance reading for the boron carbide surface
- $A_{BC}^S$  = absorbance of the attenuator and screens used with the boron carbide scan
- $A_{Au}^R$  = absorbance reading for the gold surface
- $A_{Au}^S$  = absorbance reading of the attenuator and screens used with the gold surface scan

Prior to every scan the surface was cleaned with distilled water and acetone and the mirrors realigned. Slight changes of mirror angles were inevitable whenever the specimen holder was removed and re-inserted. Every scan was repeated; reasonable duplicates were obtained ( $\pm 10\%$  of absorbance reading). The scanning time for the  $1200 - 700 \text{ cm}^{-1}$  wavenumber range was about two hours. Scans were made at several angles by incidence, but  $40 - 60^\circ$  gave the most consistent results. A consistency check was carried out at an angle of incidence of  $45^\circ$  degrees; as Berreman<sup>5</sup> has shown the  $R_{||}$  and  $R_{\perp}$  reflectances should then be equal.

# V. DATA PROCESSING

The Fresnel equations which express the reflecting power of a given substance as a function of the optical constants,  $n$  and  $k$ , and  $\theta$ , the angle of incidence, can be written as follows:

$$R_s \equiv R_{\perp} = \frac{(\cos \theta - E)^2 + F^2}{(\cos \theta + E)^2 + F^2} \quad (3)$$

$$R_p \equiv R_{\parallel} = \frac{(A \cos \theta - E)^2 + (G \cos \theta - F)^2}{(A \cos \theta + E)^2 + (G \cos \theta + F)^2} \quad (4)$$

where  $A = n^2(1 - k^2)$

$$E = \left[ \frac{A - \sin^2 \theta + \frac{(A - \sin^2 \theta)^2 + 4n^4 k^2}{2}}{2} \right]^{1/2}$$

$$F = \left[ \frac{[(A - \sin^2 \theta)^2 + 4n^4 k^2]^{1/2} - A + \sin^2 \theta}{2} \right]^{1/2}$$

$$G = n^2 k$$

and the ratio of refractive indices is given by equation (5)

$$n = n_2/n_1 \quad (5)$$

where the subscript 1 refers to the incident medium and the subscript 2 refers to the medium under investigation. In the case of internal reflection  $n_1$  is a function of wavelength; in the case of external reflection medium 1 is air or vacuum and  $n_1 = 1$ . It is assumed that  $k_1$  (the attenuation index of the incident medium is zero so that  $k_1$  (the attenuation index of the incident medium is zero so that  $k$  above is  $k_2$ .

Furthermore

$$R = \frac{1}{2}(R_s + R_p) \quad (6)$$

The above equations are given in the form they were written down by Rusch, Koehler and Labowski<sup>6</sup>, with one important exception: Wherever these authors wrote  $n^2 k^4$  and  $nk^2$ , we substituted  $n^4 k^2$  and  $n^2 k$ . Checking through the complete derivations showed us that these errors were made.

We then had these equations calculated and plotted according to Simon's<sup>7</sup> method for every 10° degrees change of angle of incidence between 0° and 90°, using the computer program of Appendix I. Figures 3 show the plots. Plots for other angles of incidence can be obtained from the program.

The Fresnel equations are functions of three variables; however, once an angle of incidence has been fixed the equations contain only two unknowns,  $n$  and  $k$ . Thus several experimental methods are suggested, e.g. (1)  $R_s$  at  $\theta_1$  and  $\theta_2$ , (2)  $R_p$  at  $\theta_1$  and  $\theta_2$ , (3)  $R_s, R_p$  at  $\theta$ , (4)  $R, R_s$  at  $\theta$ .... As mentioned earlier, it turned out that the last method was easier since the specimen area illuminated could be kept constant. However, the other methods were also tried.

The graphs can be used with any of these methods. Only one combination of  $n$  and  $k$  will fit two graphs, e.g.  $R_s$  vs  $n$  at a given  $\theta$ , simultaneously.

For method (3), Heilmann<sup>8</sup> and Abel's<sup>9</sup> have shown an explicit solution for  $n$  and  $k$ , for  $k < n$ , viz.

$$n = \sqrt{\frac{1}{2} (z - w + \sqrt{2z \sin^2 \theta + w^2})} \quad (7)$$

$$k = \sqrt{\frac{1}{2} (-z + w + \sqrt{2z \sin^2 \theta + w^2})} \quad (8)$$

or less directly,

$$n^2 - k^2 = z - w \quad (9)$$

$$n^2 + k^2 = \sqrt{2z \sin^2 \theta + w^2} \quad (10)$$

Here  $w$  and  $\sqrt{z}$  are obtained from

$$w = \tan^2 \theta \cdot \frac{\mu - 1}{\tan^2 \theta - \mu}, \quad \sqrt{z} = \frac{\tan^2 \theta - 1}{\sqrt{z} \cdot \cos \theta} \frac{\sigma}{\tan^2 \theta - \mu}$$

$$\text{where } \mu = \frac{R_s - R_p}{R_s + R_p} \cdot \frac{1 + R_s}{1 - R_s} \text{ and } \sigma = \frac{R_s - R_p}{R_s + R_p}$$

These relations are also consistent with the Kramers-Kronig equations relating  $n$  and  $k$ .

We found it easier to use the graphic method first and then check the results by the analytic expressions, even for the  $R_p, R_s, \theta$  method, since no errors are allowed by the analytic expressions. Furthermore, in our case the simplifying assumption,  $k < n$ , was not generally true.

## VI. RESULTS

Figures 4 and 5 show  $n$  and  $k$  as obtained by the Robinson-Price method, i.e. from  $R_p$ ,  $R_s$ , and  $R$ , using the plots of Figure 3 and graphical matching. The results appear to be reasonable for the frequency region. The scatter of the points is appreciable, but a wide absorption peak near  $1050\text{ cm}^{-1}$  is clearly shown. Hence the behavior of  $k$  is reasonable. The refractive index values ( $n$ ) are consistent between Figures 4 and 5, within our limits of error, but the expected initial rise of  $n$  did not come out of the curve fitting, although some high values were observed. An earlier set of data plots obtained for a different angle of incidence (Figure 6) did show the rise (by just two points), but also showed the dip and the dip more clearly. Figure 7 shows the reflectivities from which these data were calculated.

The scatter of the points may have a number of reasons, but the non-uniformity of the surface (Figure 1) caused largely by the patches of iron oxide could be the principal factor.

We found the graphical method was preferable over direct computation largely because of the scatter of the points.

## VII. DISCUSSION

The limitations of the reflection method are quite clear as the comparison given by Huffman<sup>10</sup> has shown. An "absorption" spectrum of a KBr disc containing suspended particles of a very limited size range appears to be more direct. This author is, however, well aware of many difficulties of the pressed KBr technique in quantitative infrared spectroscopy and some of them would seem to be applicable here as well. As our SEM/X-ray measurements have shown contaminants prefer to accumulate at interfaces. The interface area of suspended particles is extremely large. Infrared-invisible contaminants may affect the scattering characteristics of other material.

We tried to correct for the differences between bulk and particle densities by assuming a proportion of "black" holes on the reflecting surfaces. However, it turned out to be impossible to get consistent results. Judging from the SEM photos, it would seem that the holes were "filled in" in the polishing operation.

#### VIII. SUGGESTED FURTHER WORK

This report section was long delayed because we far exceeded the allotted funds (\$6000 for two different areas of work, this being one of them) and yet were intrigued by the problem sufficiently to look for better approaches. However, unallocated time was hard to find on our instrumentation. For example, substitution of a boron carbide surface (a diamond-turned, laser-quality surface) for part of the stationary mirror in a Michelson interferometer would be a more direct procedure to obtain phase changes on reflection and thus the optical constants (Parker et. al.<sup>11</sup>). However, the most direct approach to the problem at hand would seem to be the filling of one arm of the Michelson interferometer with the boron carbide dust. An analogous procedure has been used to get accurate absorption spectra of gases at low pressure.

# REFERENCES

1. Brame, E.G., Jr., Margrave, John L., and Meloche, V.W., "Infrared Spectra of Inorganic Solids - II, Oxides, Nitrides, Carbides, and Borides," J. Inorg. Chem., 1957, 5, 48-52 (1957).
2. Huffman, D.R., "A Survey of Optical Constants in the 5-25 Micron Spectral Region". Final Technical Report to Naval Air System Command, Contract No. N00019-79-C-0557. March 13, 1981.
3. Robinson, T.S., and Price, W.C., "The Determination of Infrared Absorption Spectra From Reflection Measurements," Proc. Phys. Soc. (London), 46, 969-974 (1953).
4. Crawford, Bryce, Jr., Goplen, T.G., and Swanson, D., "The Measurements of Optical Constants in the Infrared by Attenuated Total Reflection," in Advances in Infrared and Raman Spectroscopy, Vol. 4 (R.J.H. Clark and R.E. Hester, Eds.) Heyden & Son Ltd., London, 1978, pp. 47-84.
5. Berreman, D.W., "Simple Relations Between Reflectances of Polarized Components of a Beam When the Angle of Incidence is 45 Degrees," J. Opt. Soc. Am., 56, 1784 (1966).
6. Rusch, P.F., Koehler, W.H., and Lagowski, J.J., "The Determination of Optical Constants from Reflection Data by Application of the Newton-Raphson Method to the Fresnel Equations," Spectrochimica Acta, 25A 1527-1534 (1969).
7. Simon, I., "Spectroscopy in the Infrared by Reflection and Its Use for Highly Absorbing Substances," J. Opt. Soc. Am., 41, 336-345 (1951).
8. Heilmann, G., "The Optical Constants of Calcium Fluoride in the Infrared," Z. Naturforsch. 16a, 714-716 (1961).
9. Abeles, F., "Determination of the Optical Constants of Solids by Photometric Measurements," Rev. Opt. (Theor. Instrum.) 31, 127-130 (1952).
10. Huffman, D.R., Adv. in Physics, 26, 129 (1977).
11. Parker, J.J., Chambers, W.G., and Augress, J.F., "Dispersive Reflection Spectroscopy in the Far Infrared by Division of the Field of View in a Michelson Interferometer," Infrared Physics, 14, 207-214 (1974).

## LIST OF FIGURES

- Figure 1        Scanning Electron Microscope photograph of boron carbide plate
- Figure 2a       Adapter to infrared spectrophotometer for reflectance measurements
- a. Internal reflection by the germanium hemicylinder method
- b. Specular reflection method.
- Figure 3.1.1   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees.
- Figure 3.1.2   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees.
- Figure 3.1.3   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees.
- Figure 3.2.1   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.
- Figure 3.2.2   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.
- Figure 3.2.3   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.
- Figure 3.3.1   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees.
- Figure 3.3.2   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees.
- Figure 3.3.3   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees.
- Figure 3.4.1   Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^\circ$  degrees.

- Figure 3.4.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^{\circ}$  degrees.
- Figure 3.4.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^{\circ}$  degrees.
- Figure 3.5.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^{\circ}$  degrees.
- Figure 3.5.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^{\circ}$  degrees.
- Figure 3.5.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^{\circ}$  degrees.
- Figure 3.6.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $50^{\circ}$  degrees.
- Figure 3.6.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $50^{\circ}$  degrees.
- Figure 3.6.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $50^{\circ}$  degrees.
- Figure 3.7.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^{\circ}$  degrees.
- Figure 3.7.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^{\circ}$  degrees.
- Figure 3.7.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^{\circ}$  degrees.
- Figure 3.8.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $70^{\circ}$  degrees.
- Figure 3.8.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $70^{\circ}$  degrees.

- Figure 3.8.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $70^{\circ}$  degrees.
- Figure 3.9.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^{\circ}$  degrees.
- Figure 3.9.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^{\circ}$  degrees.
- Figure 3.9.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^{\circ}$  degrees.
- Figure 3.10.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $90^{\circ}$  degrees.
- Figure 3.10.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $90^{\circ}$  degrees.
- Figure 3.10.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $90^{\circ}$  degrees.
- Figure 4 Refractive index and absorption coefficient for boron carbide as measured for  $40^{\circ}$  degrees incidence.
- Figure 5 Refractive index and absorption coefficient for boron carbide as measured for  $60^{\circ}$  degrees incidence.
- Figure 6 Refractive index and absorption coefficient for boron carbide as measured for  $50^{\circ}$  degrees incidence.
- Figure 7 Reflectivities from which Figure 6 were calculated

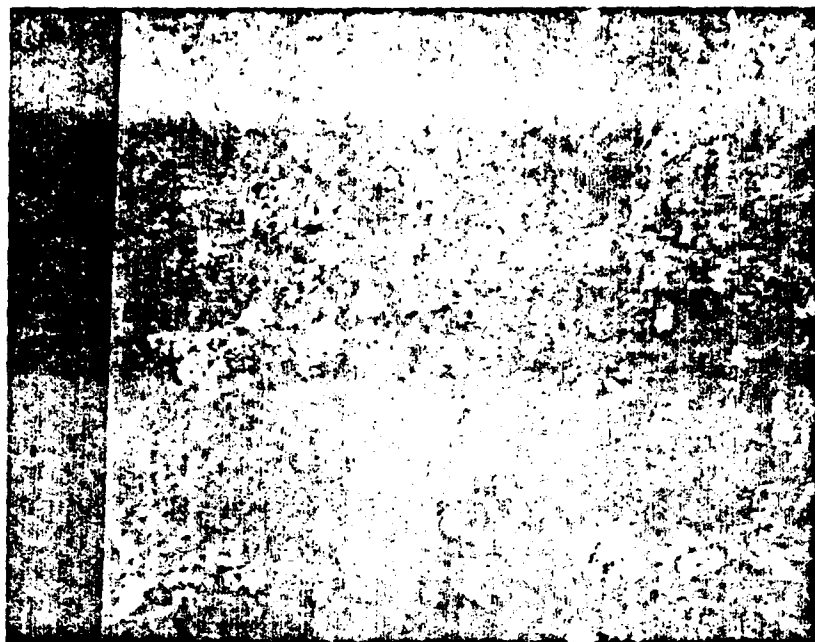


Figure 1 Scanning Electron Microscope photograph of Boron carbide plate. (1000 X)

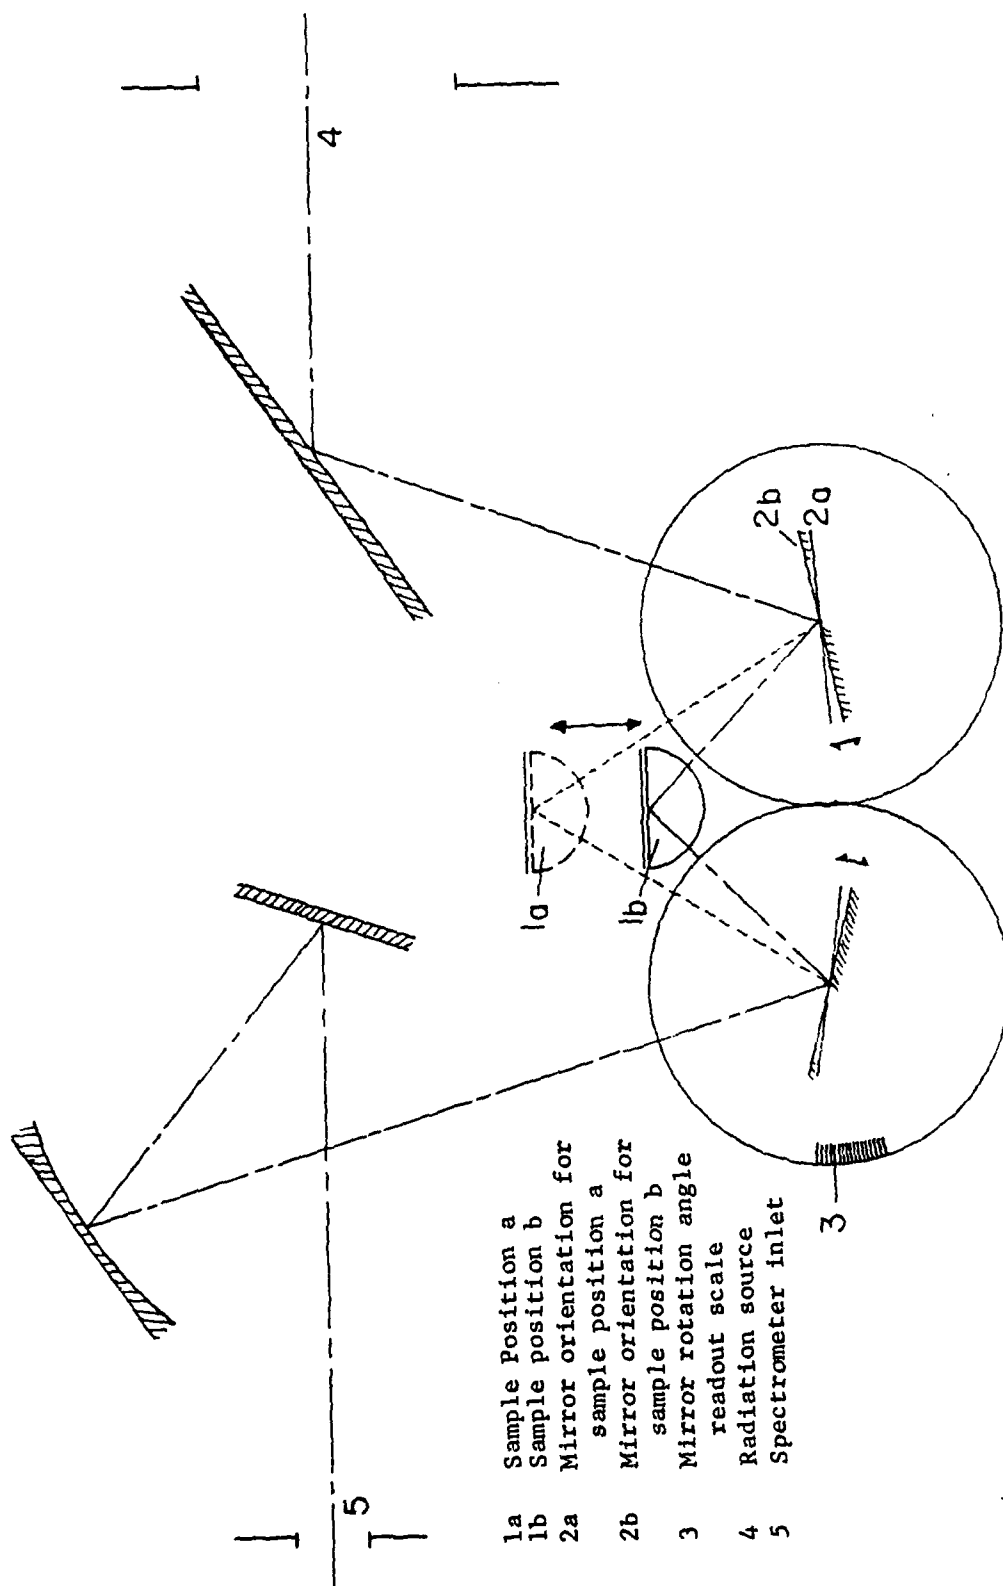


Figure 2a Adapter to infrared spectrophotometer for reflectance measurements

- a. Internal reflection by the germanium hemicylinder method
- b. Specular reflection method

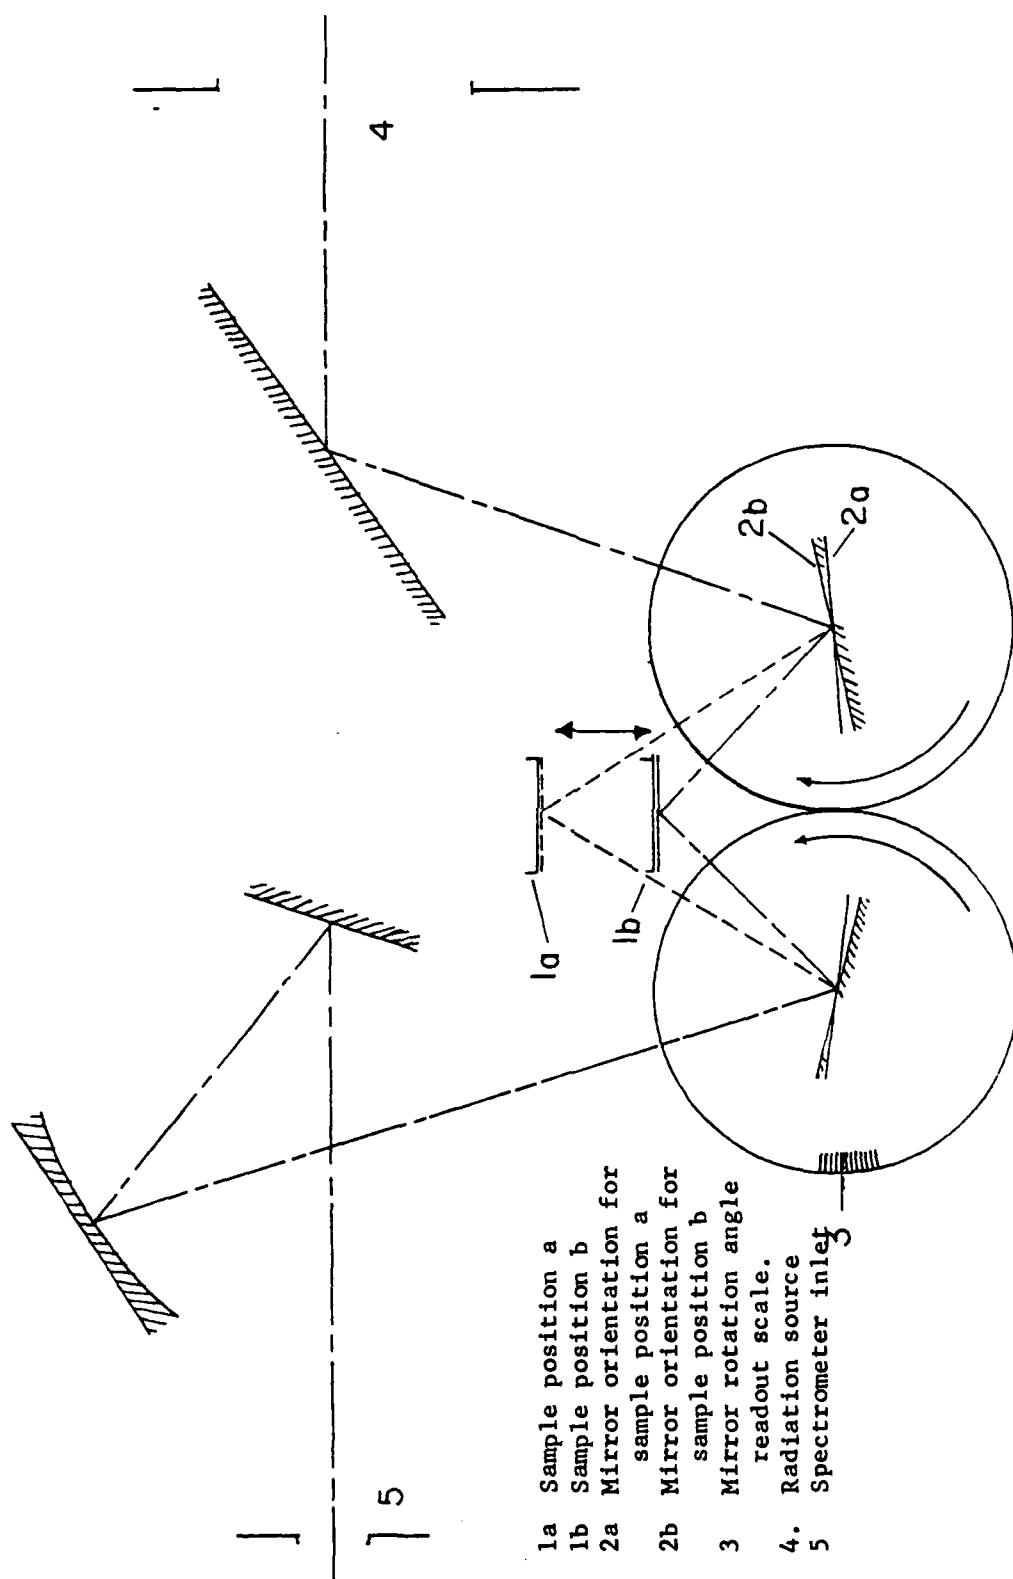


Figure 2b Adapter to infrared spectrophotometer for reflectance measurements

- a. Internal reflection by the germanium hemicylinder method
- b. Specular reflection method

PHI- 0.

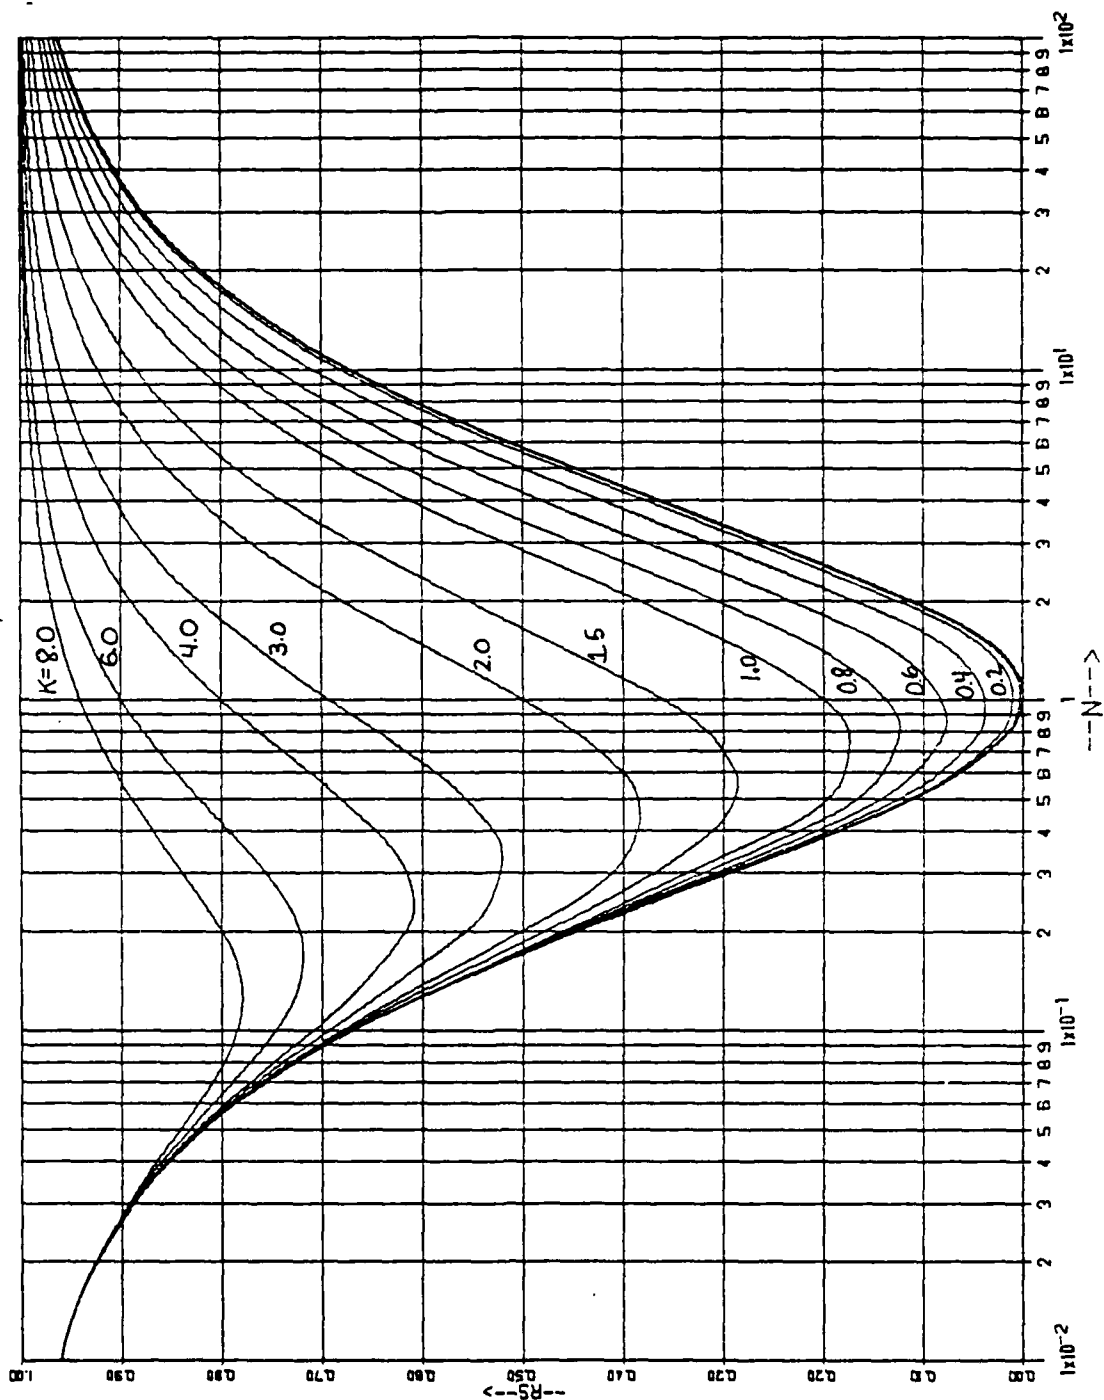


Figure 3.1.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees.

PHI- 0.

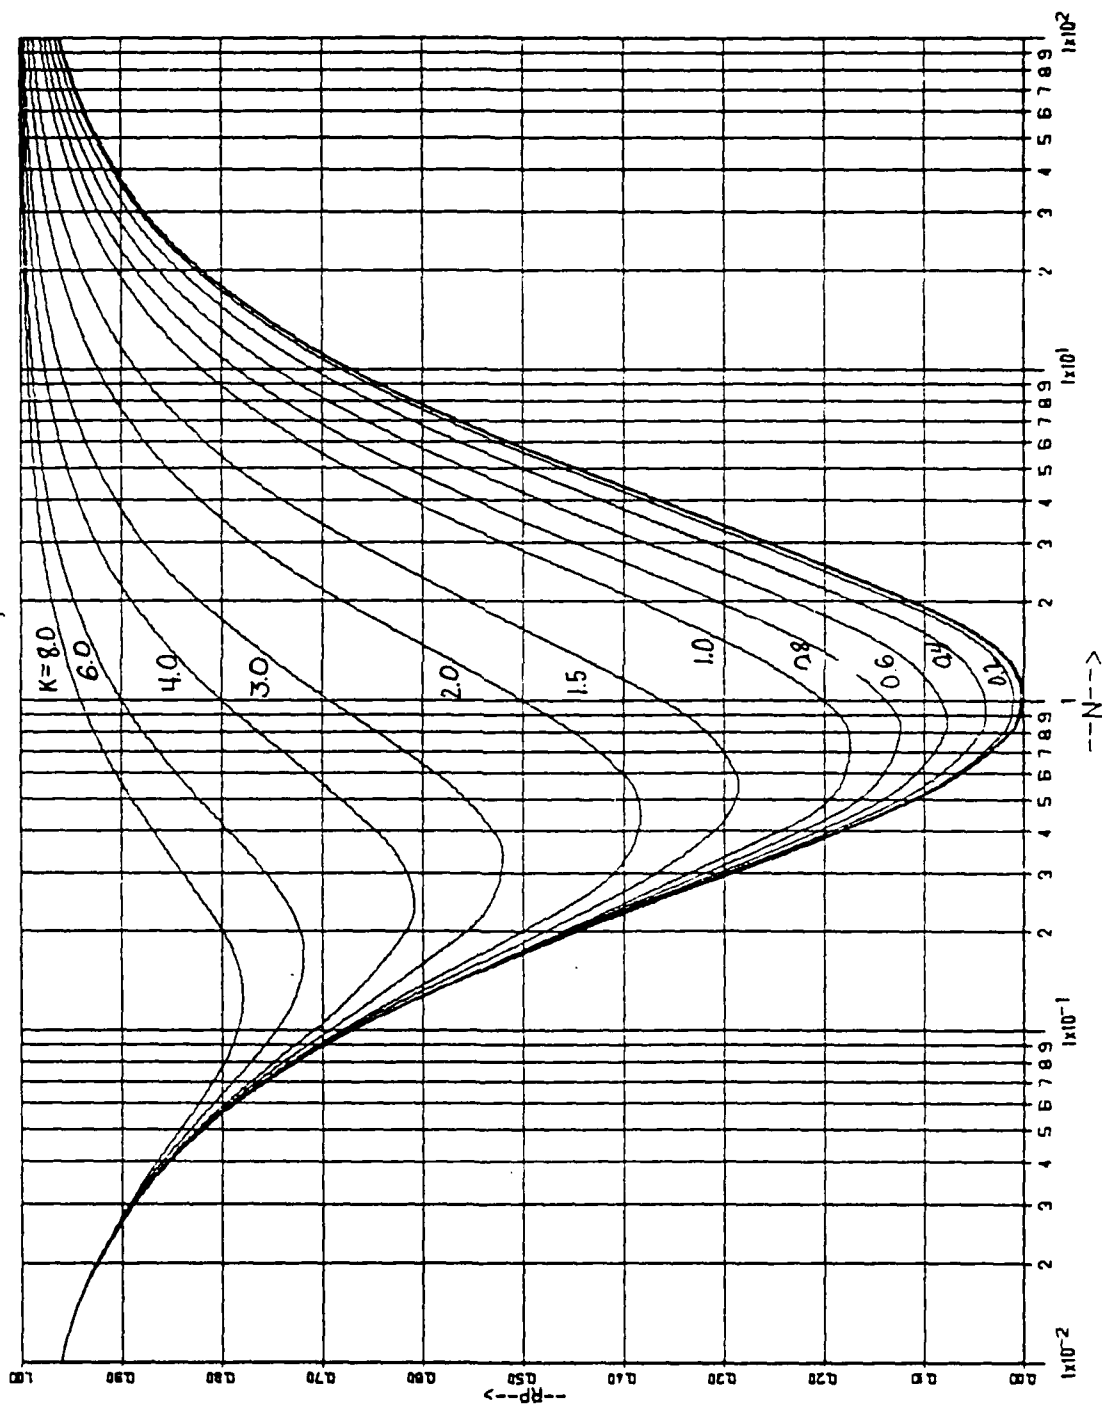


Figure 3.1.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees.

PHI- 0.

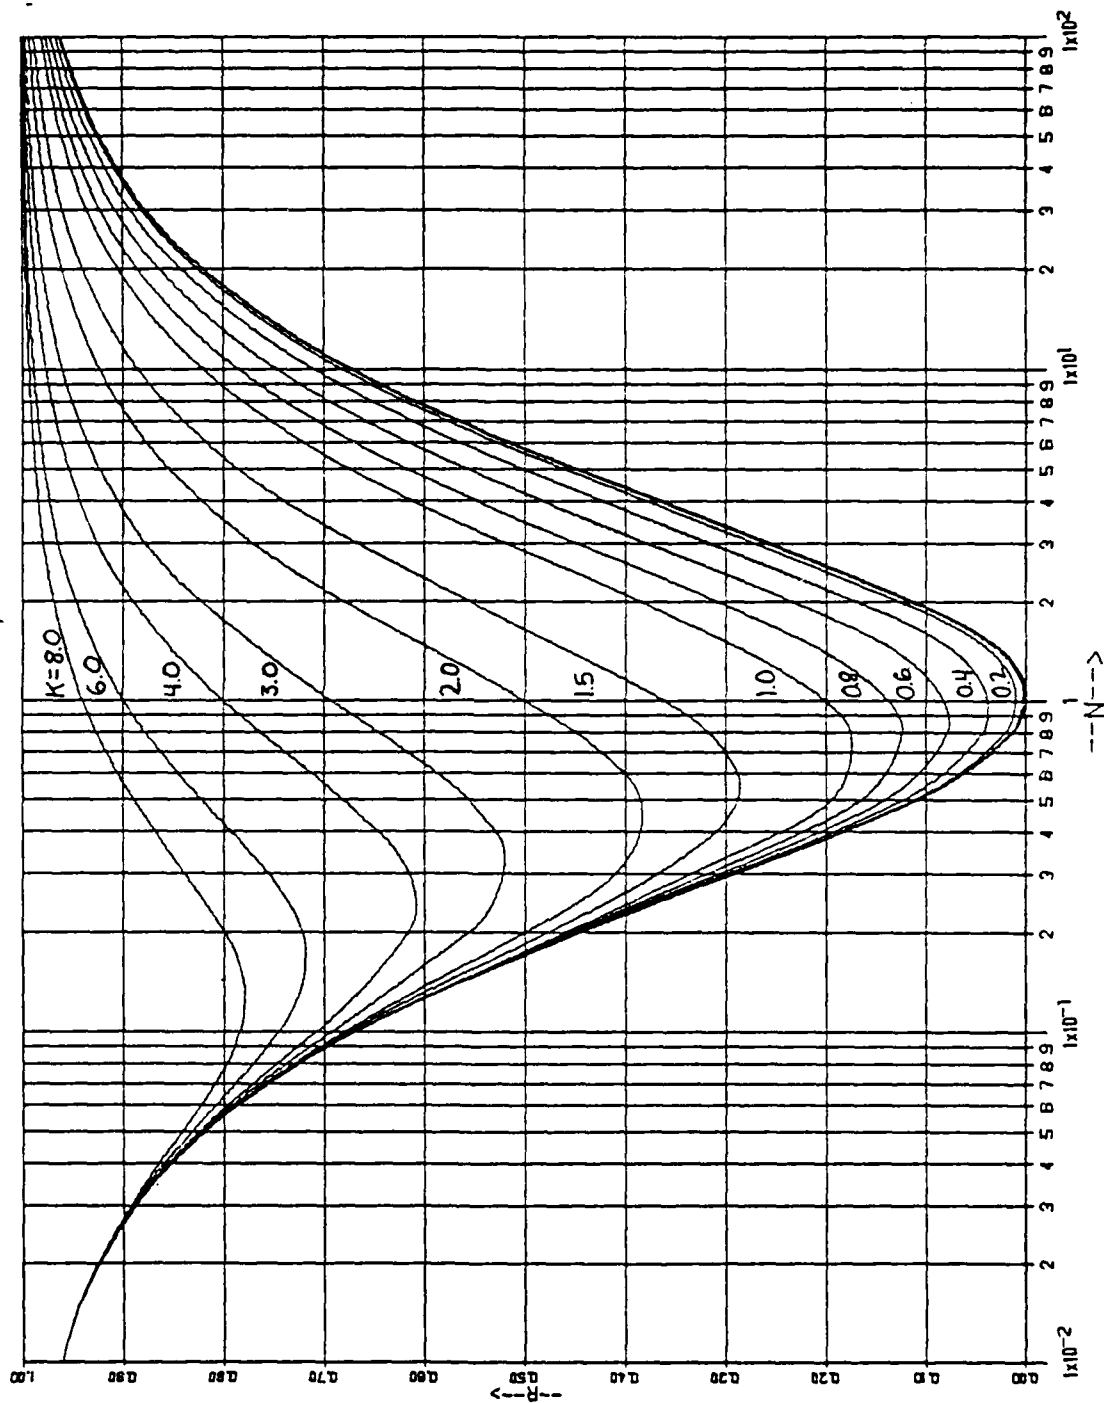


Figure 3.1.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $0^\circ$  degrees .

PHI- 10.

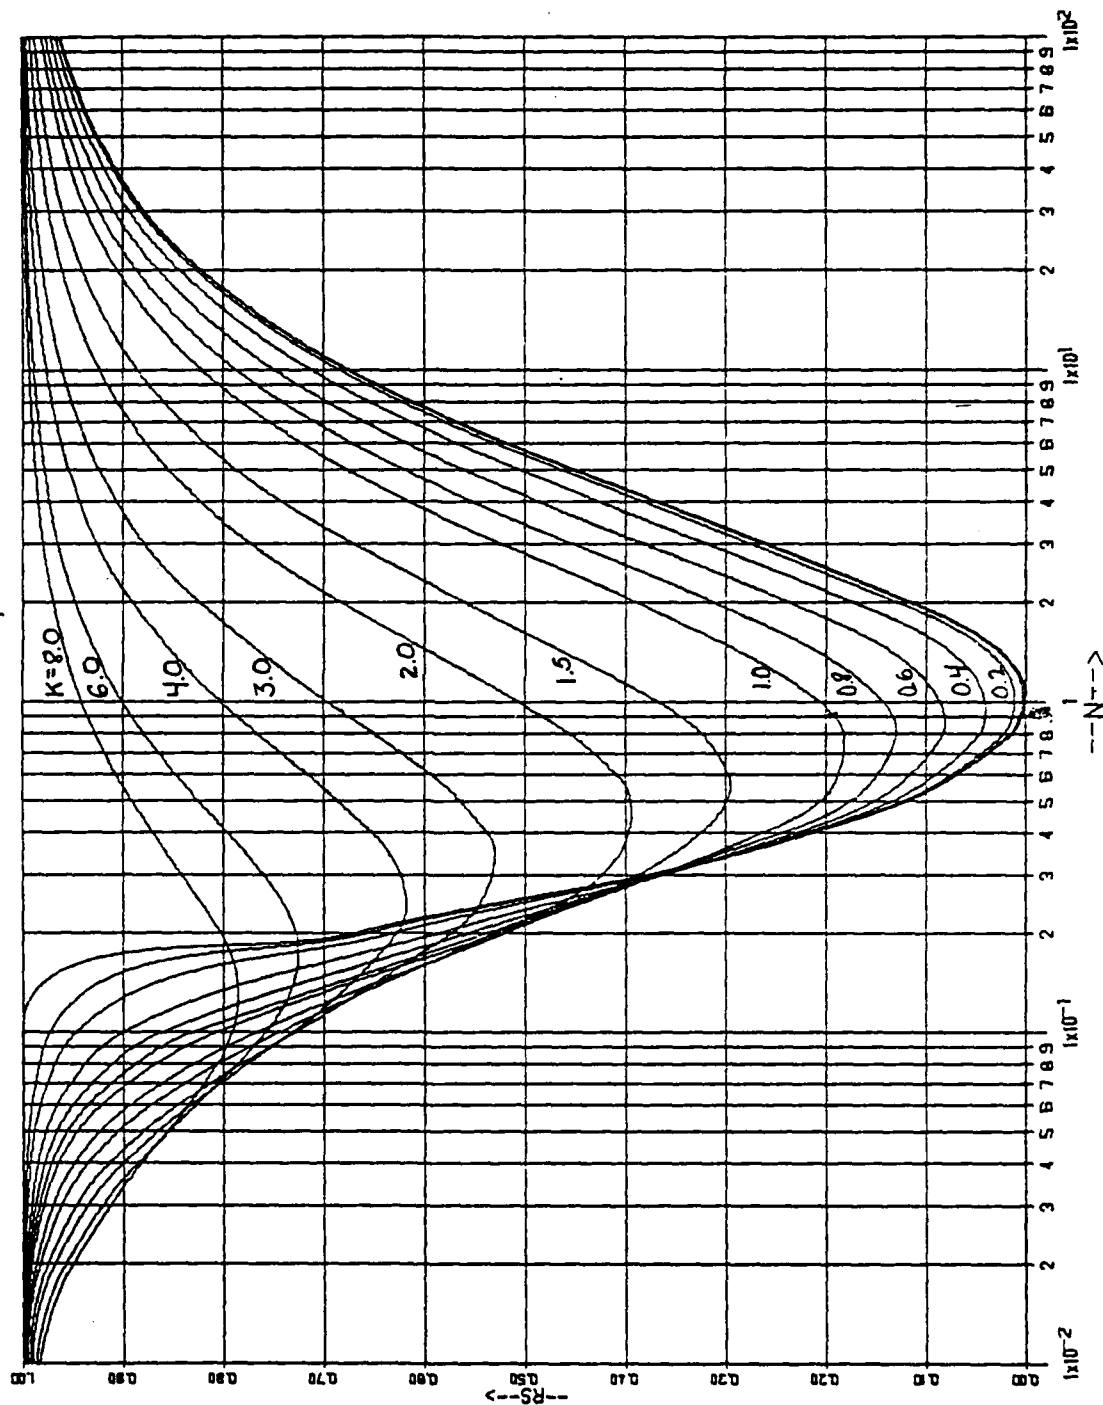


Figure 3.2.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.

PHI- 10.

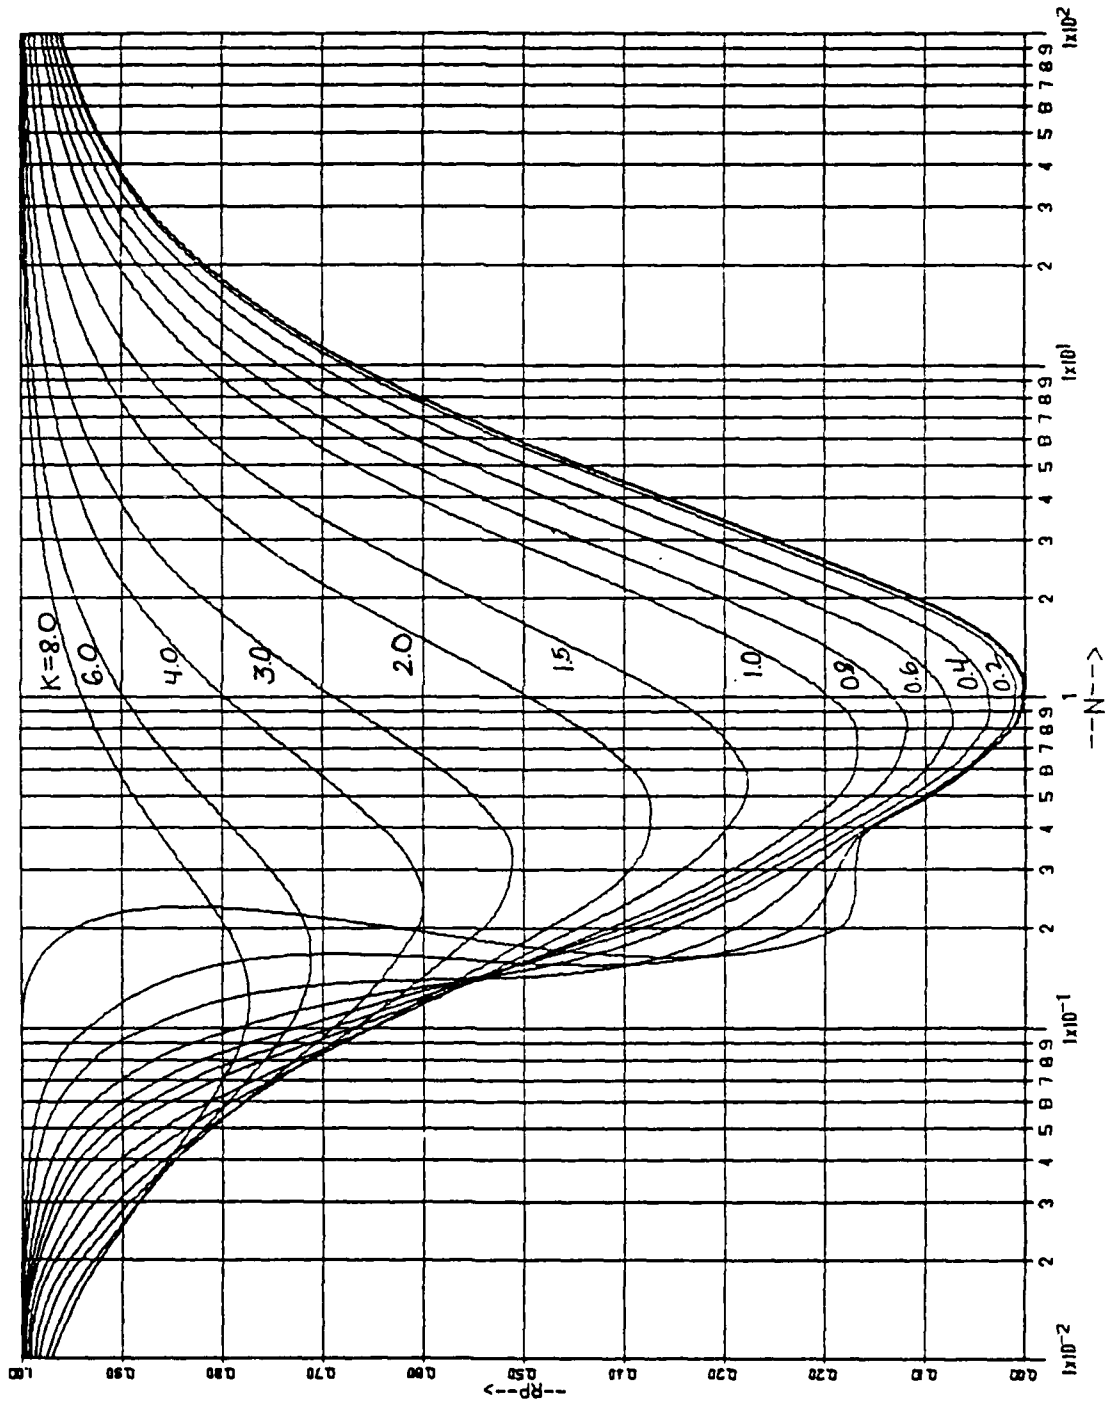


Figure 3.2.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.

PHI- 10.

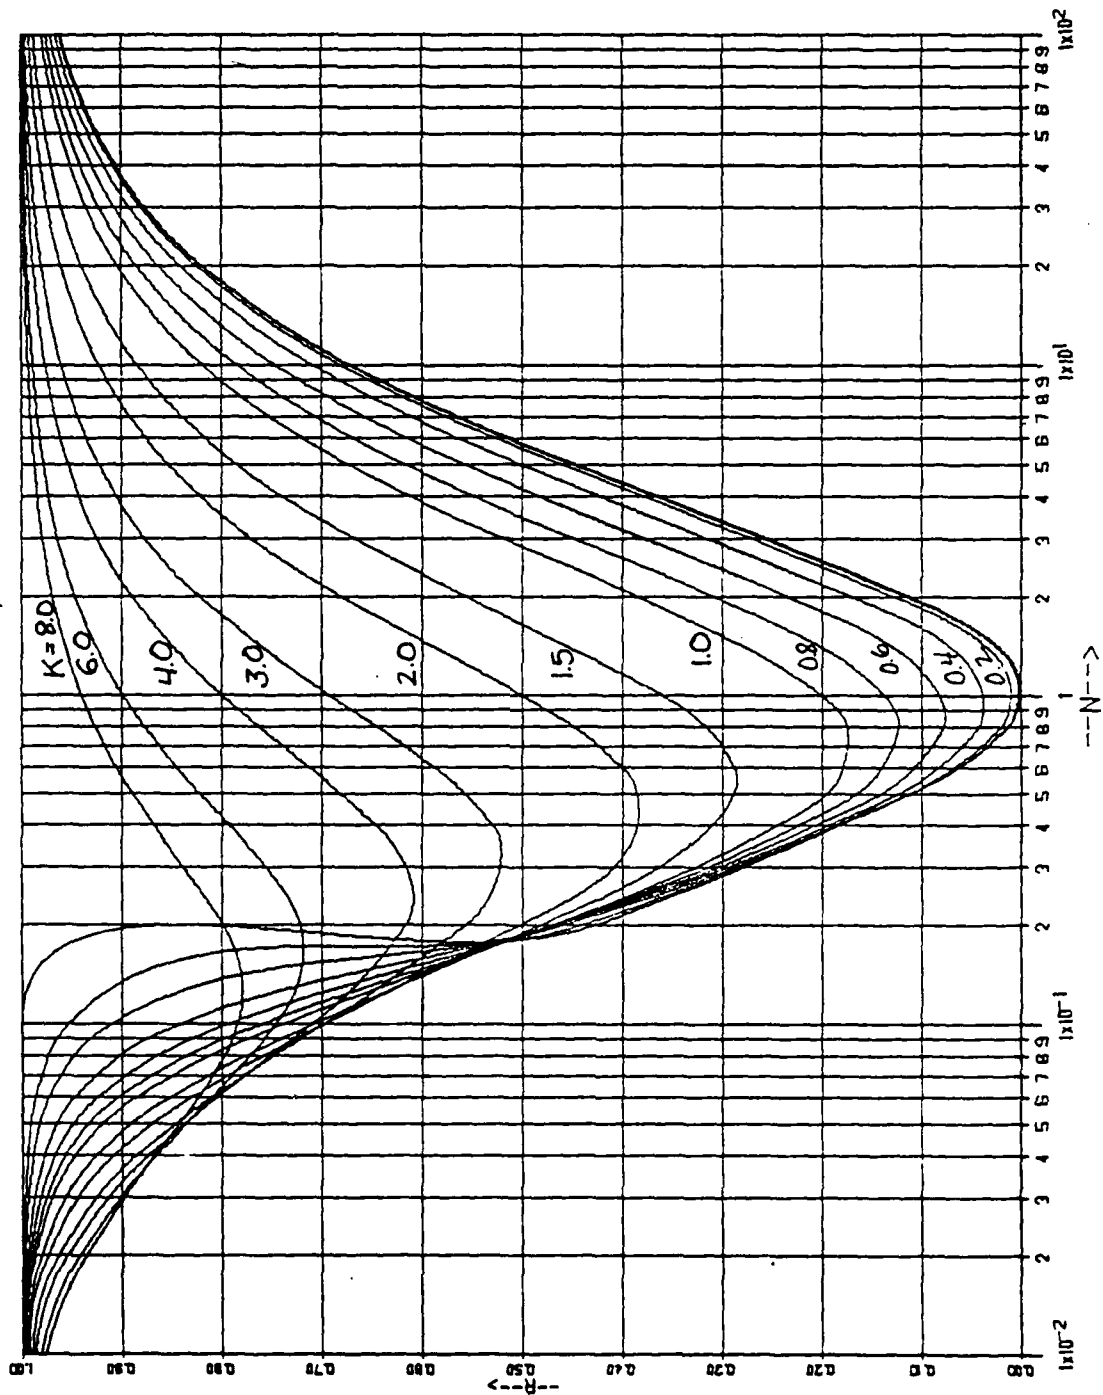


Figure 3.2.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $10^\circ$  degrees.

PHI- 20.

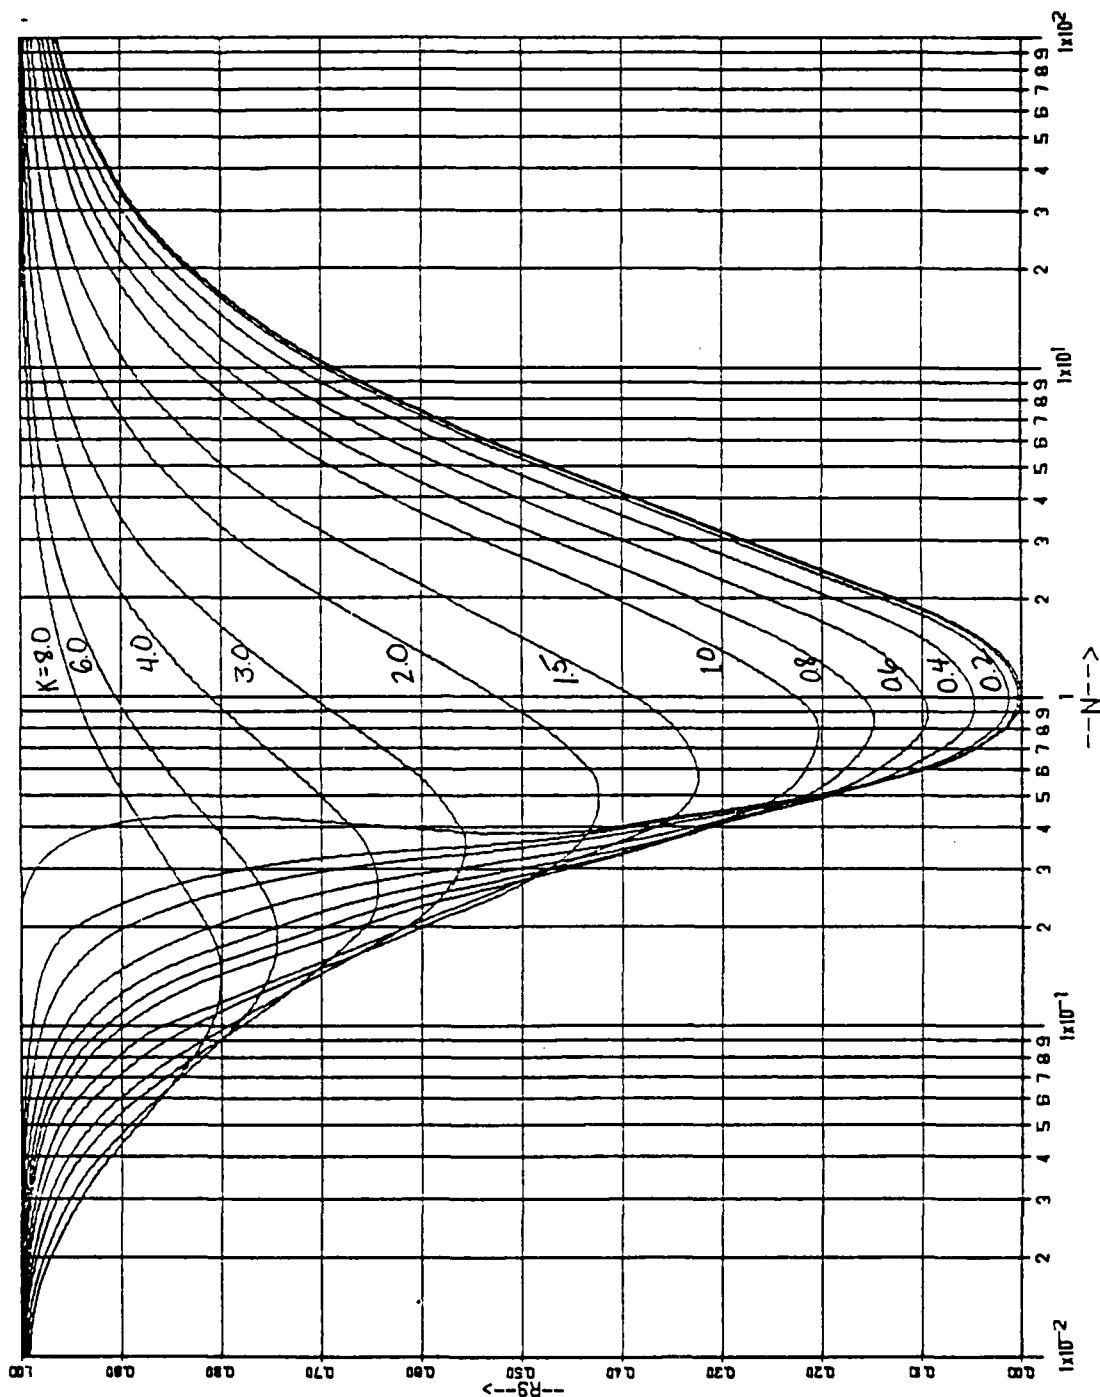


Figure 3.3.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees .

PHI- 20.

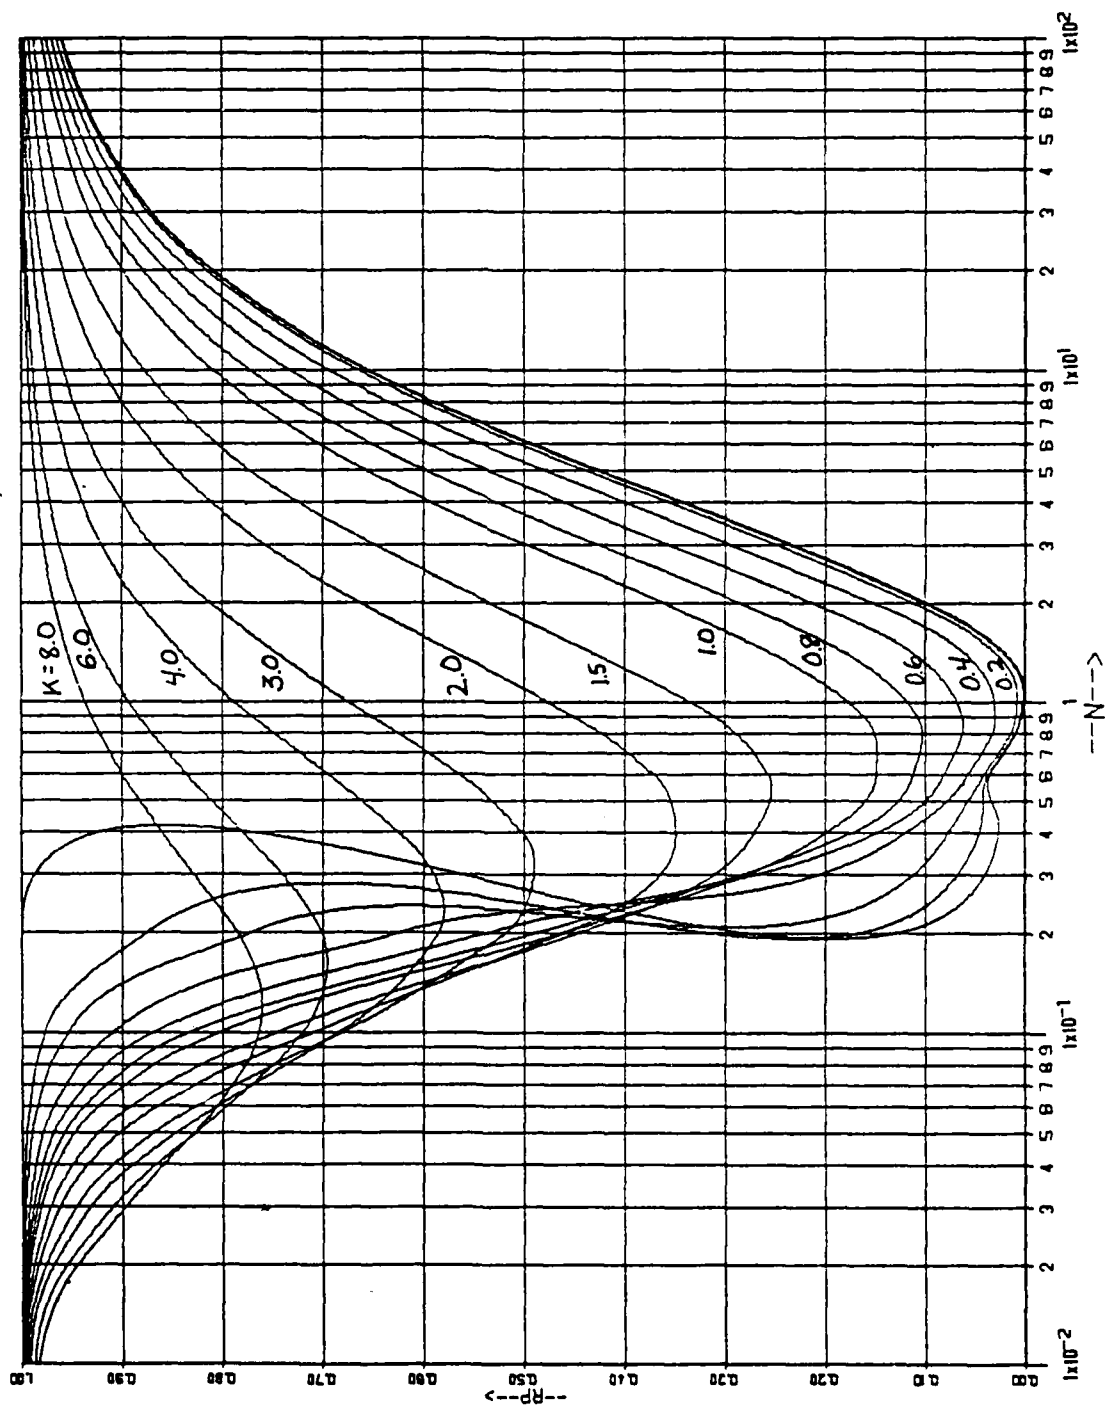


Figure 3.3.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees.

PHI- 20.

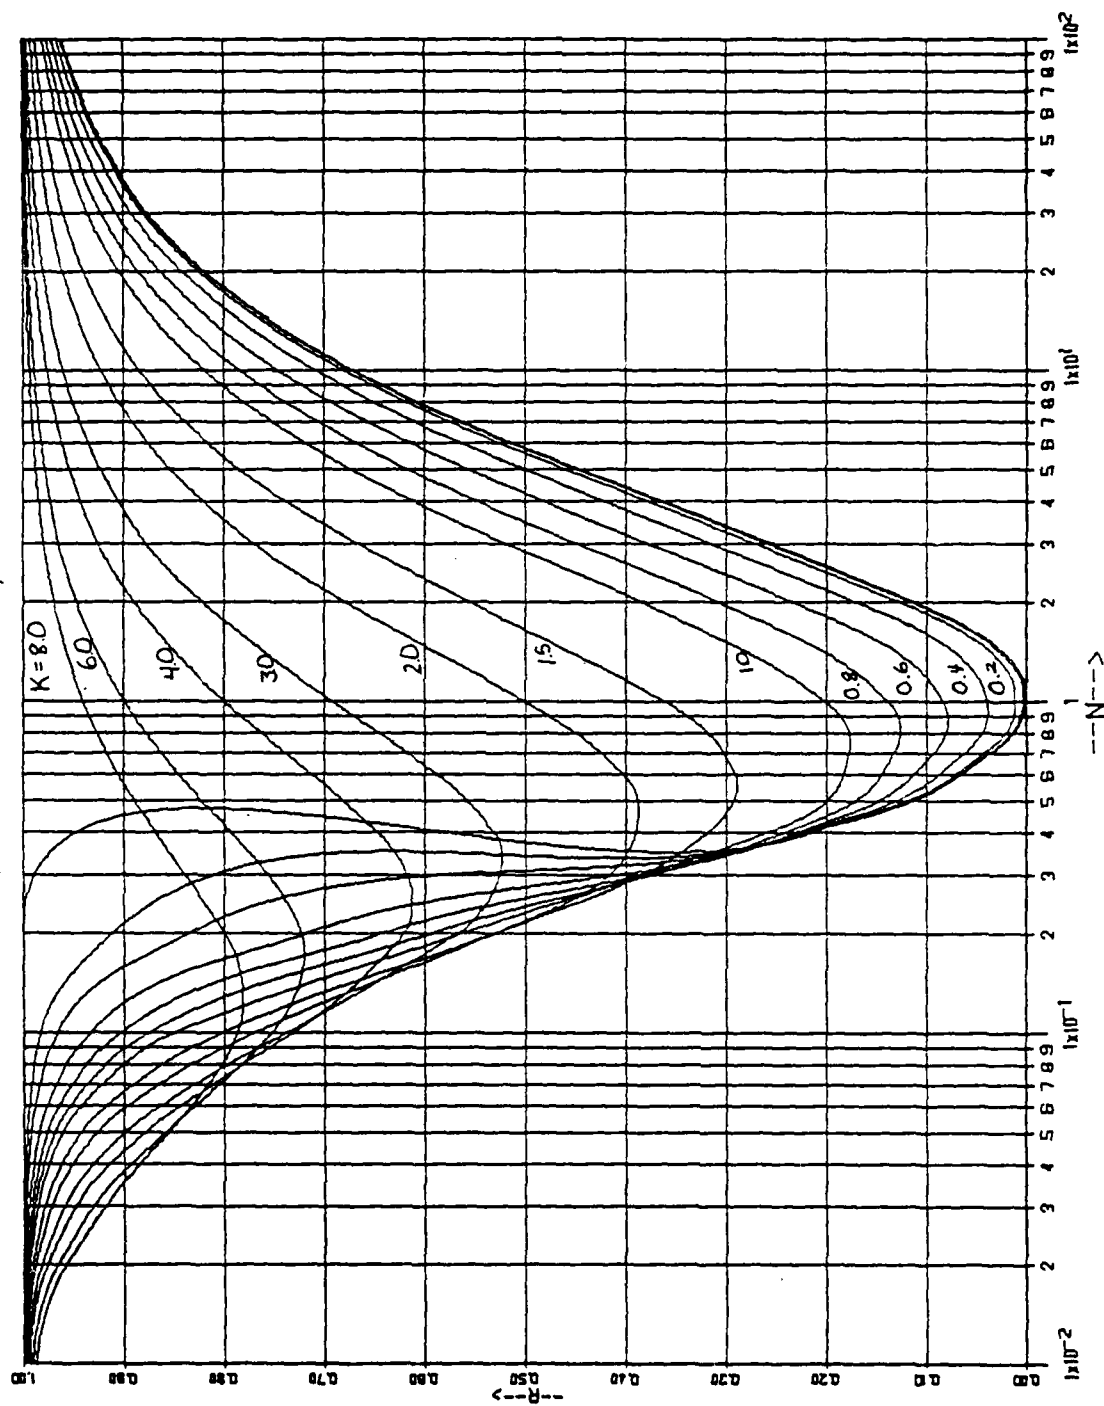


Figure 3.3.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $20^\circ$  degrees .

PHI- 30.

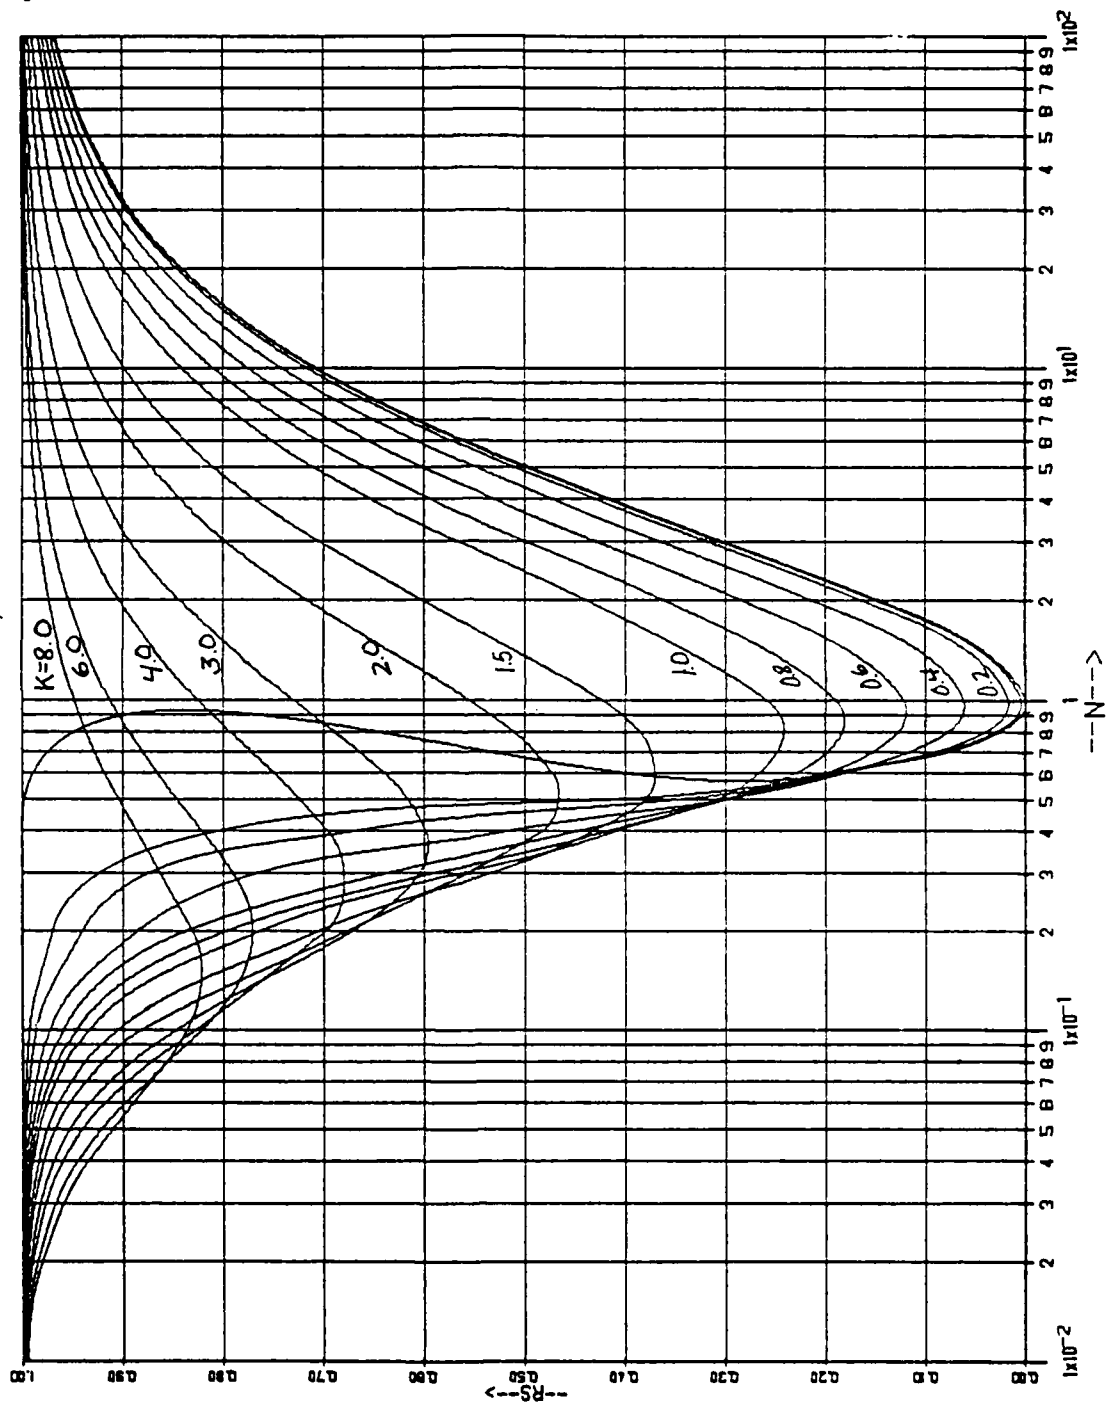


Figure 3.4.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^\circ$  degrees.

PHI- 30.

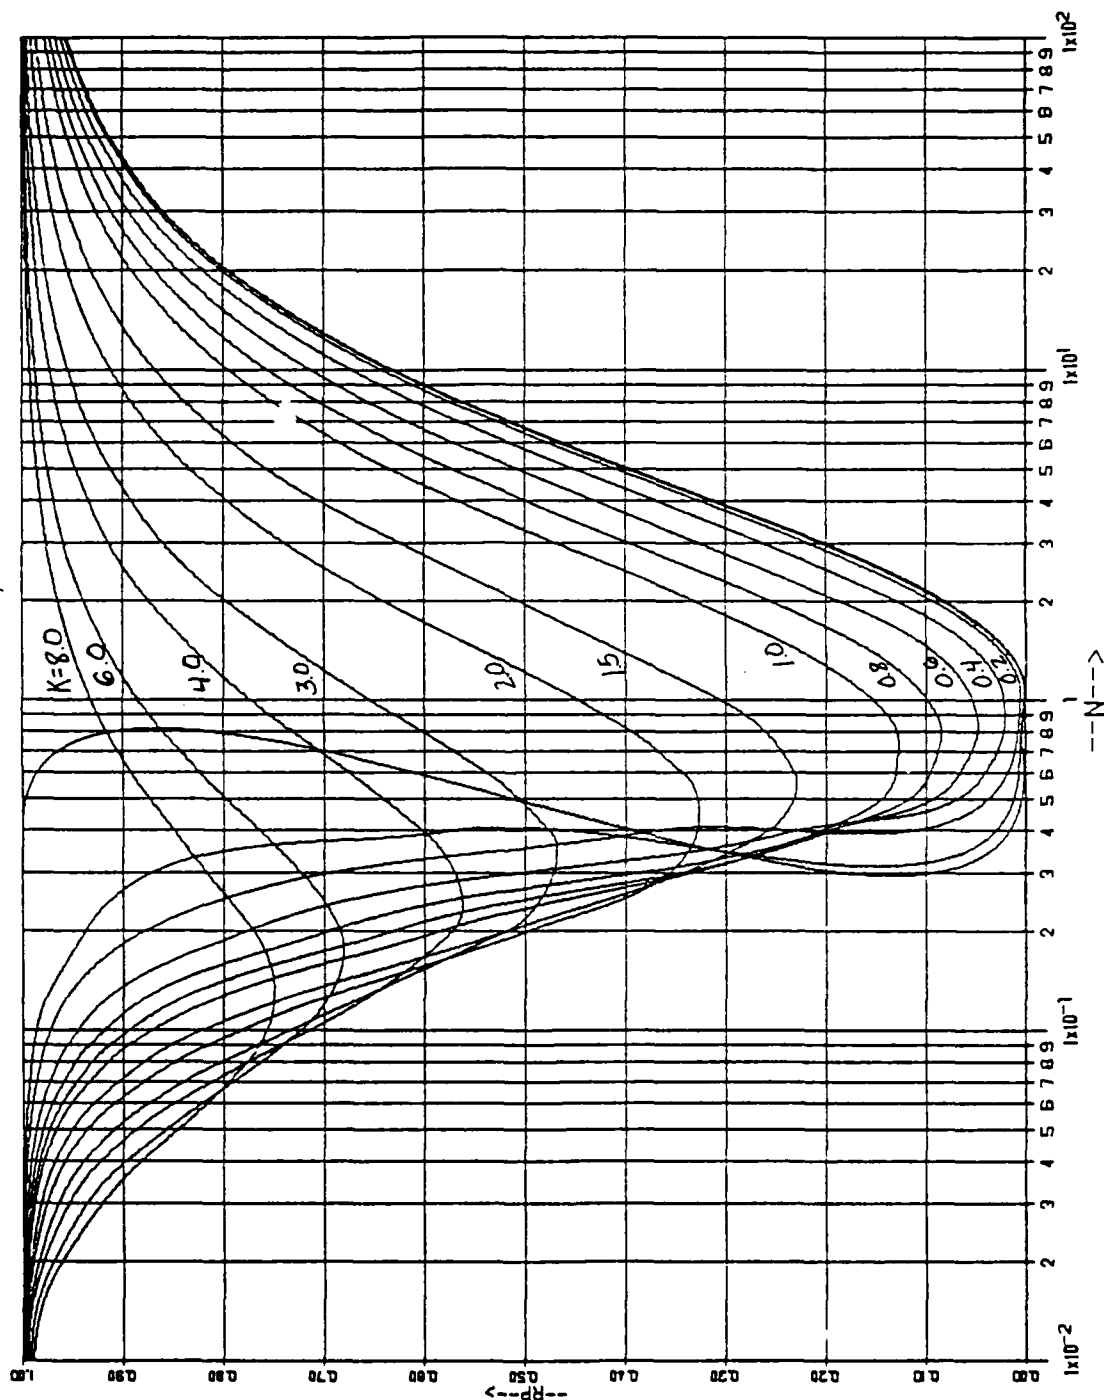


Figure 3.4.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^\circ$  degrees .

PHI- 30.

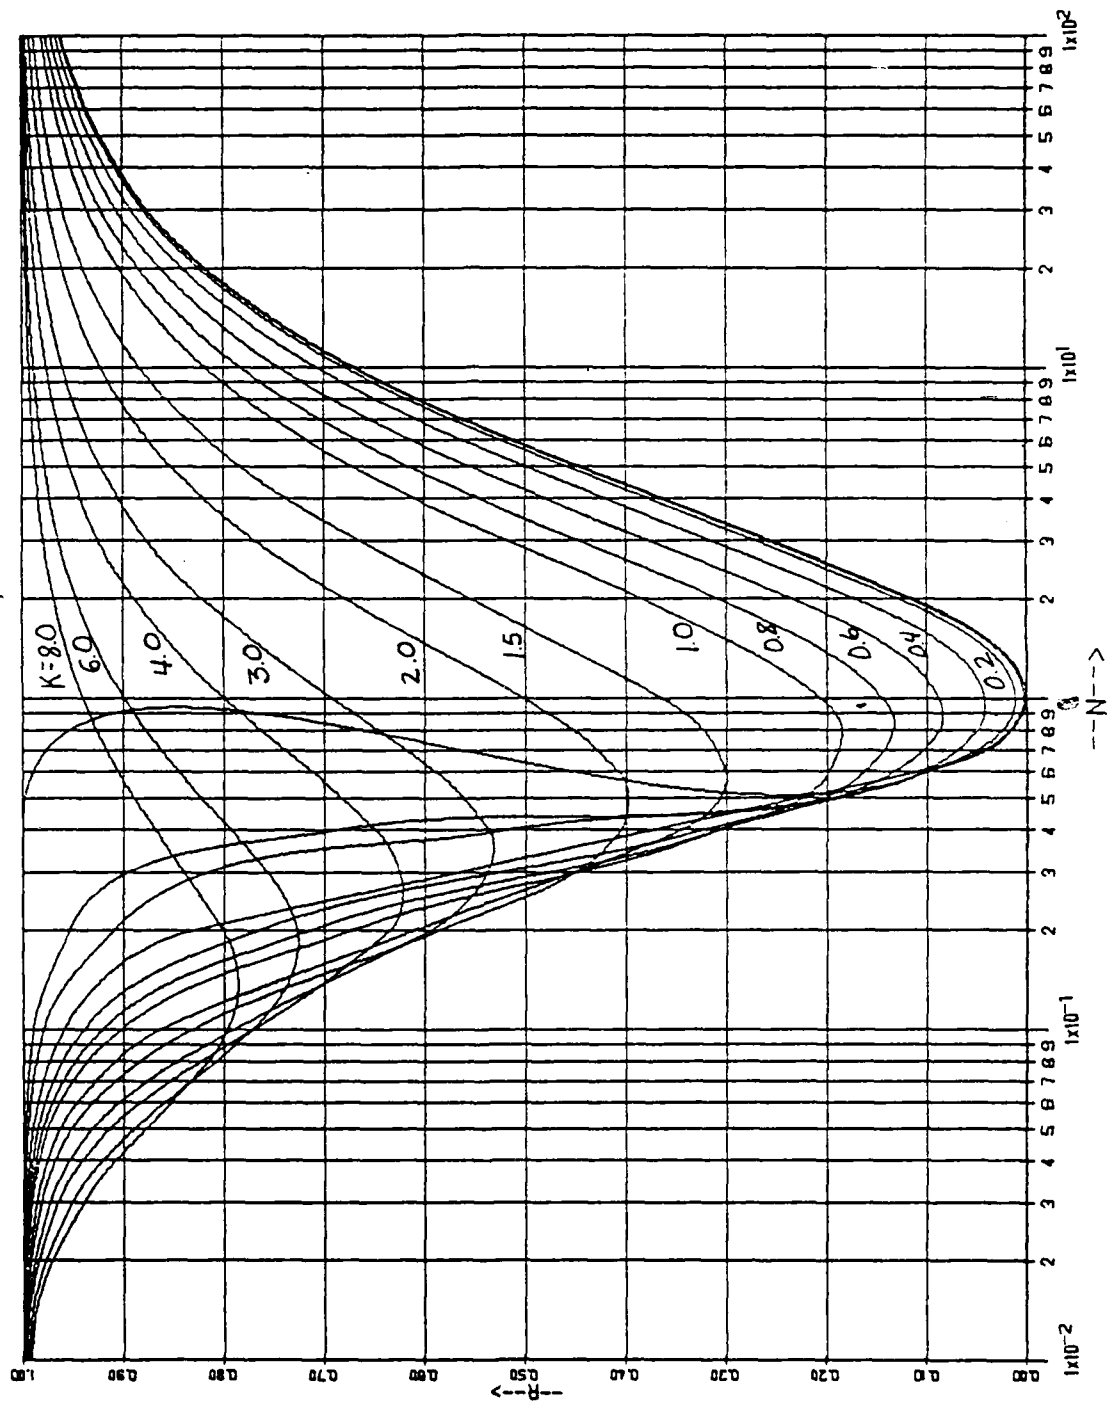


Figure 3.4.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $30^\circ$  degrees.

PHI- 40.

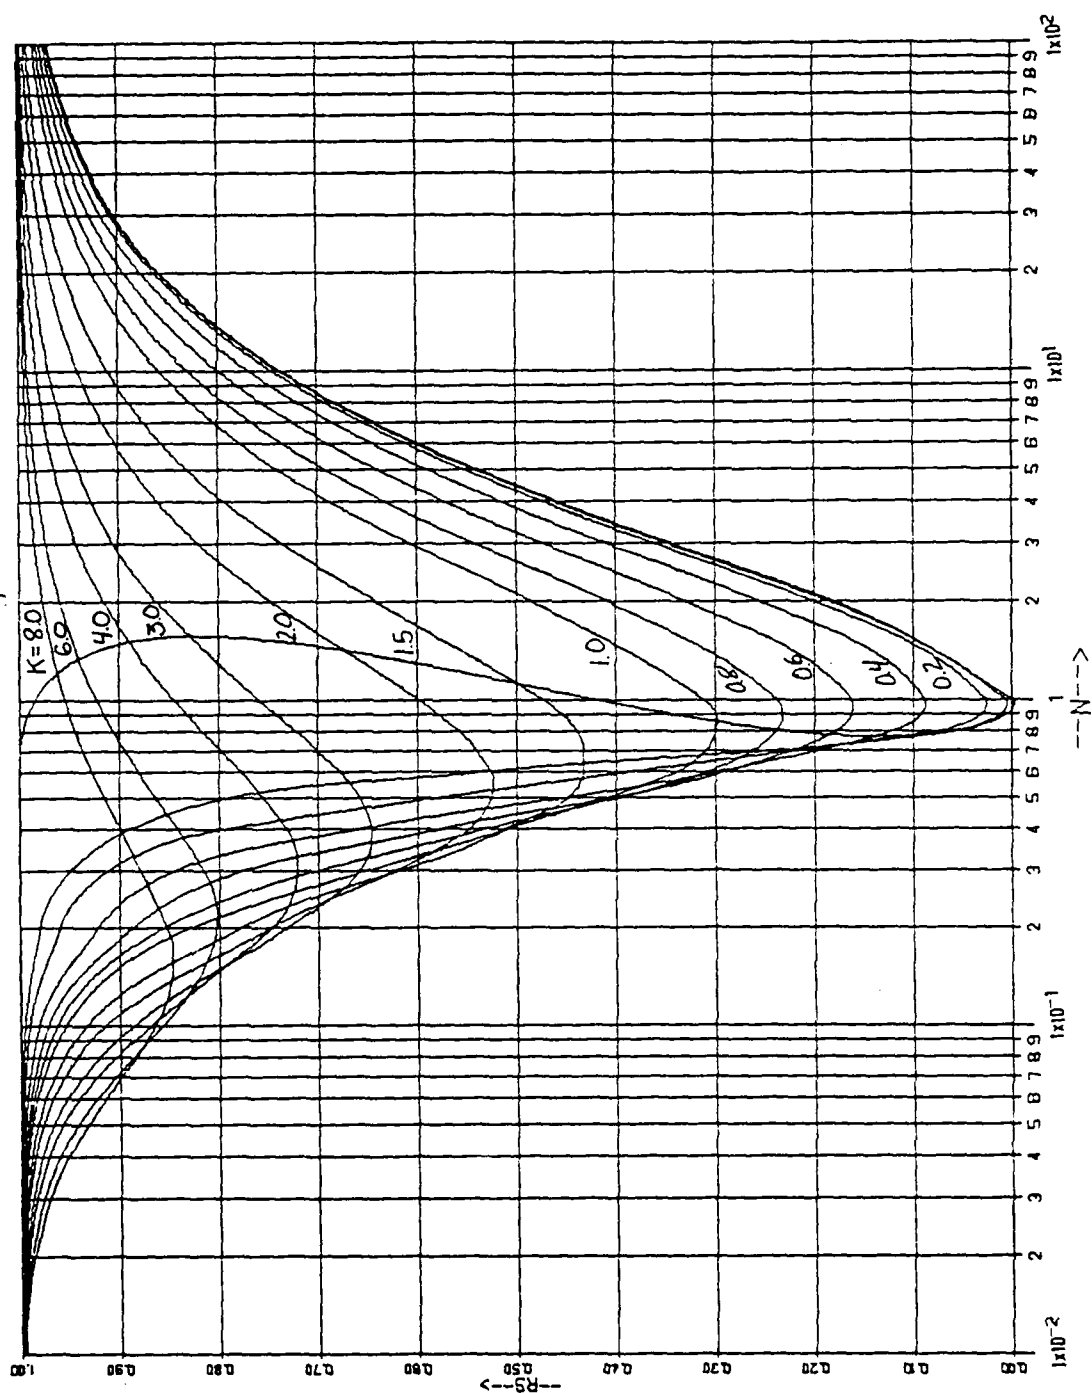


Figure 3.5.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^\circ$  degrees.

PHI- 40.

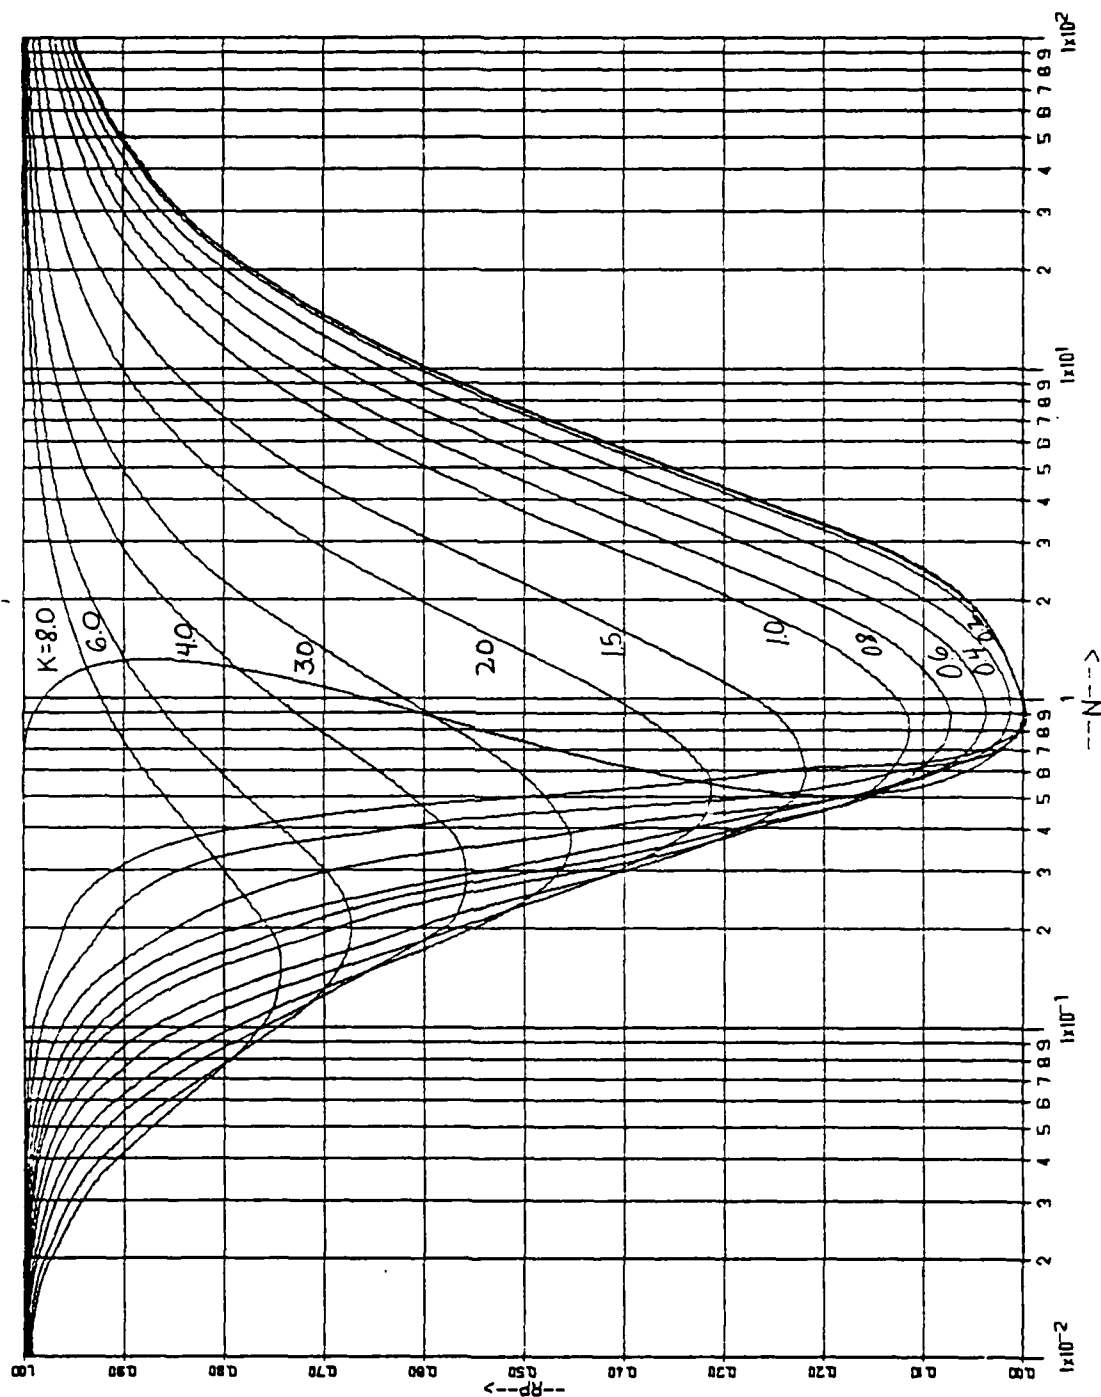


Figure 3.5.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^\circ$  degrees.

PHI- 40.

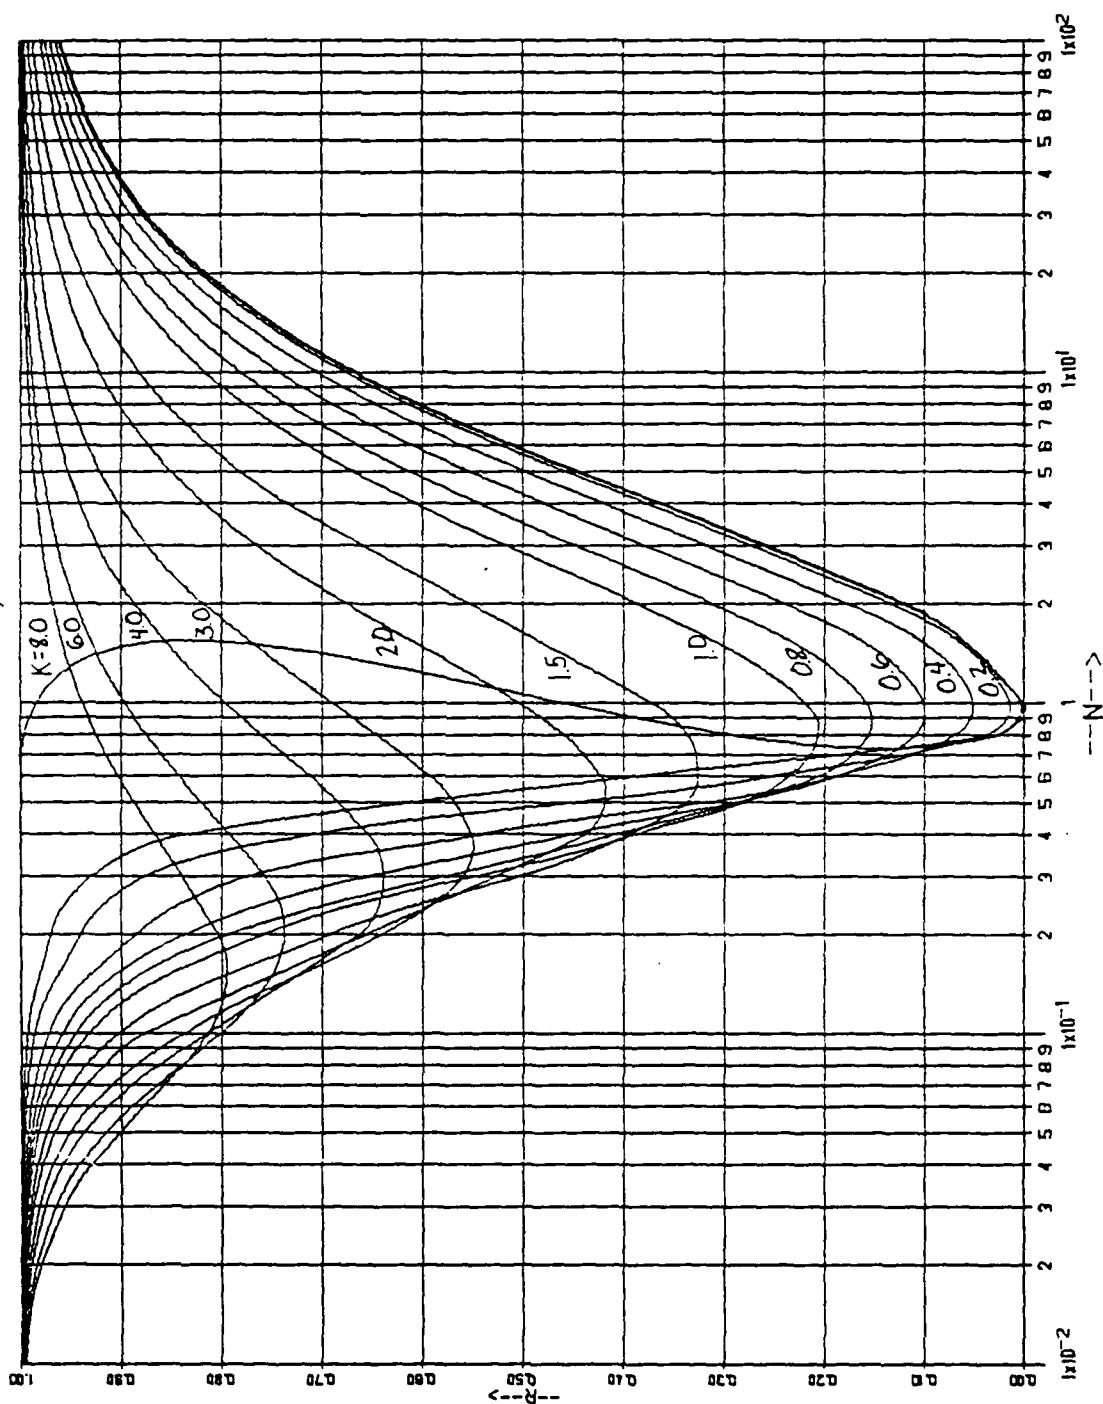


Figure 3.5.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $40^\circ$  degrees .

PHI- 50.

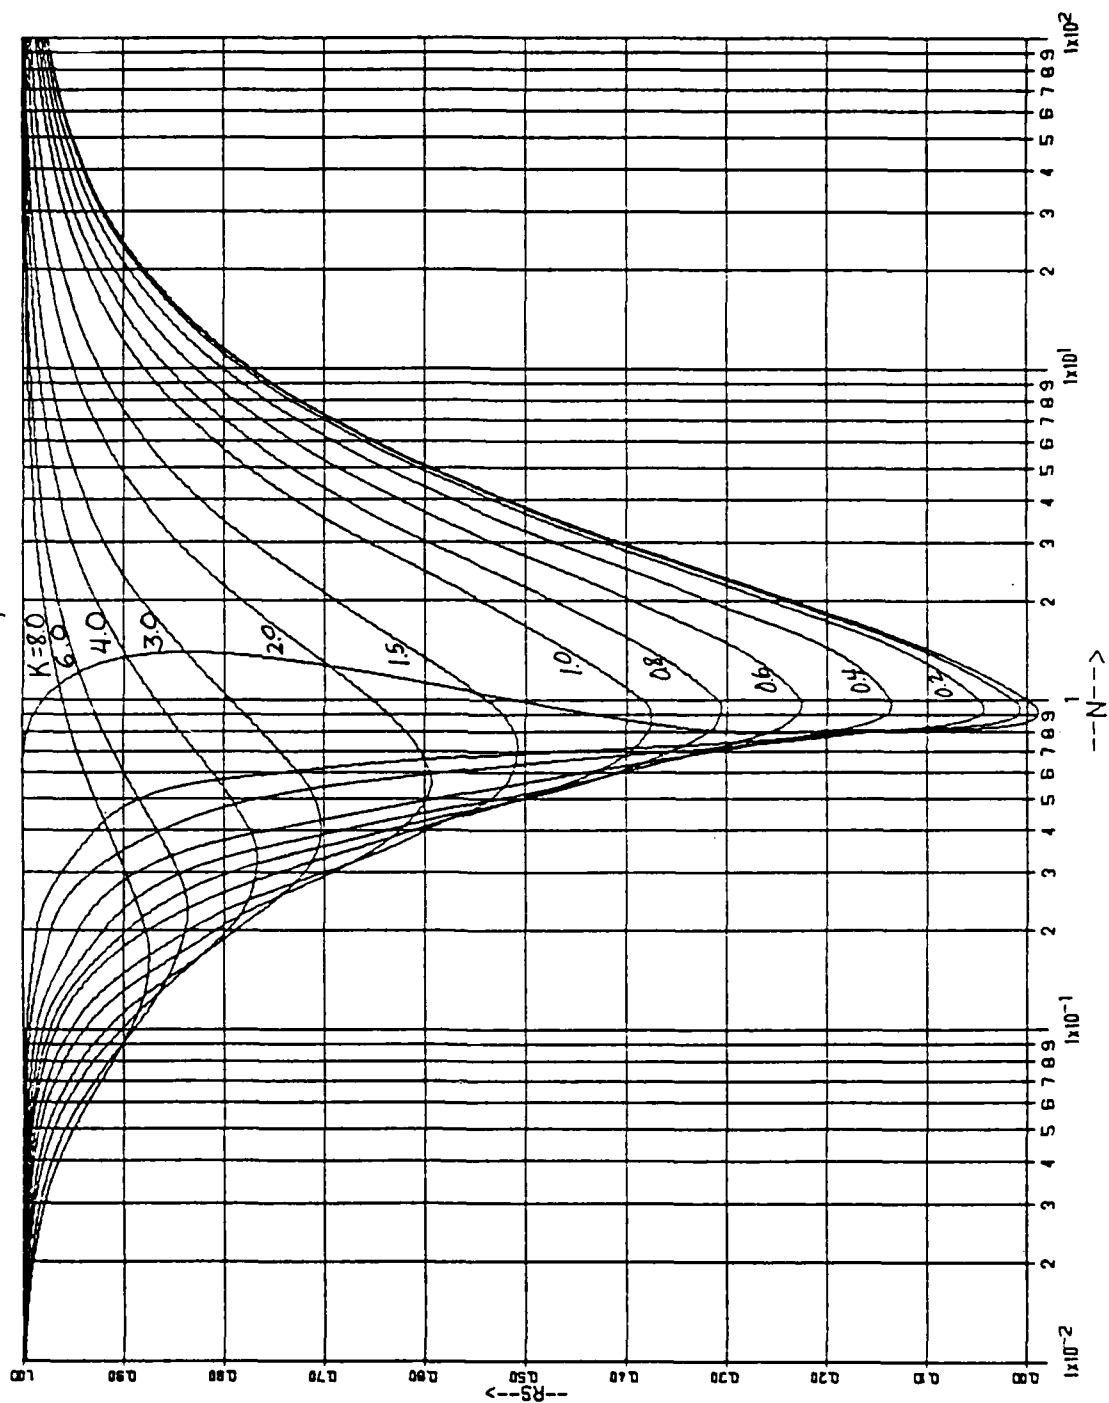


Figure 3.6.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $50^\circ$  degrees.

PHI- 50.

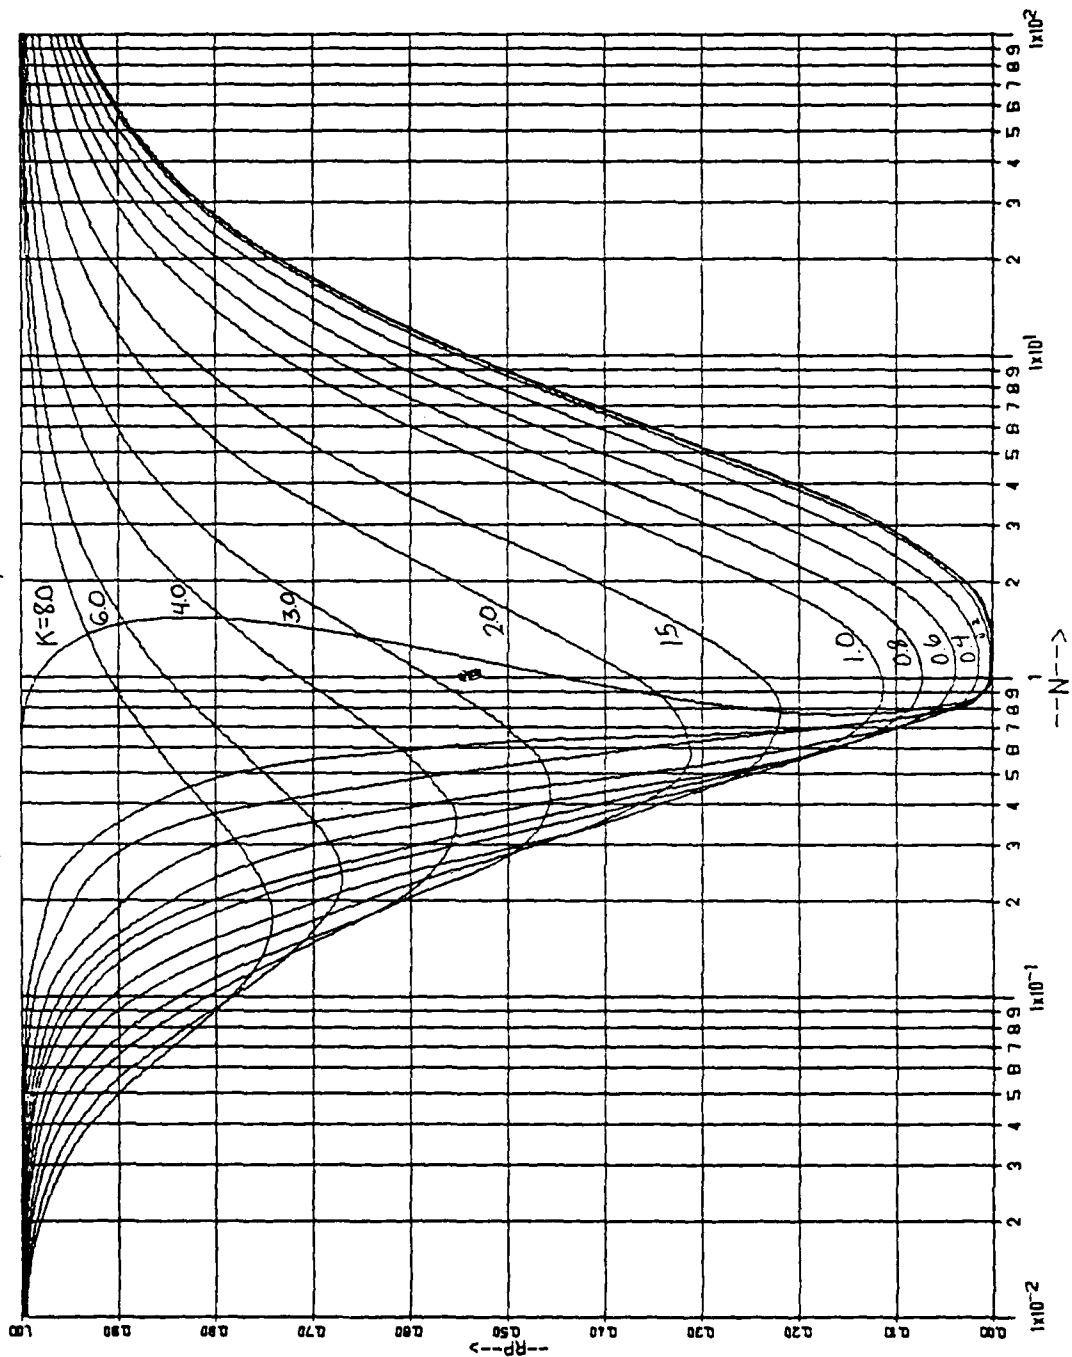


Figure 3.6.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is 50° degrees .

PHI - 50.

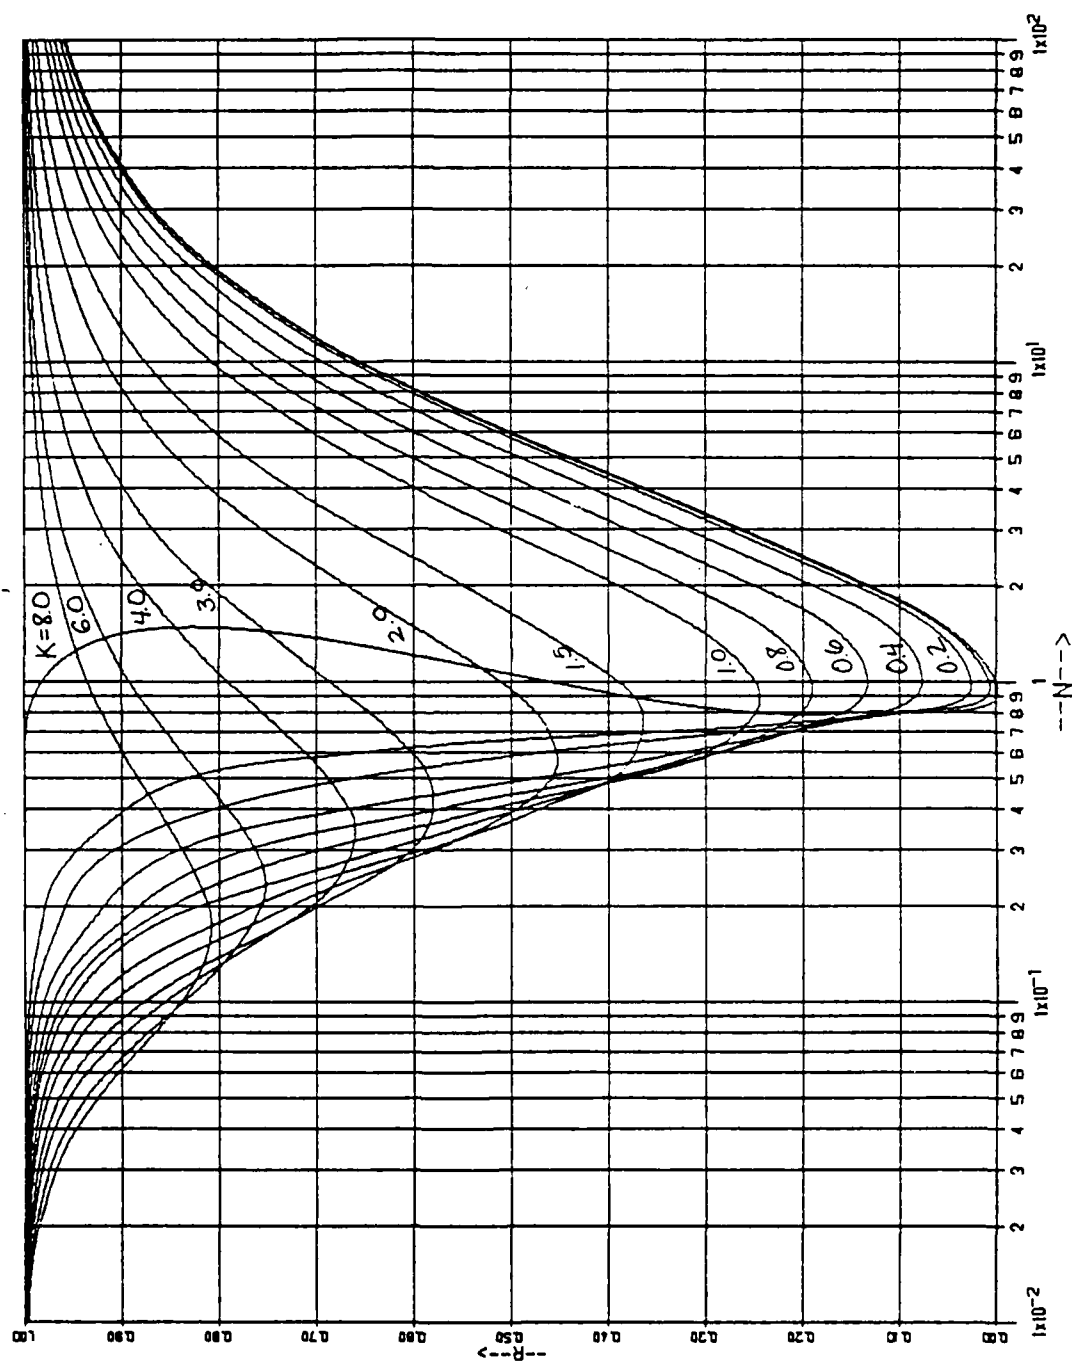


Figure 3.6.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is 50 degrees.

PHI- 60.

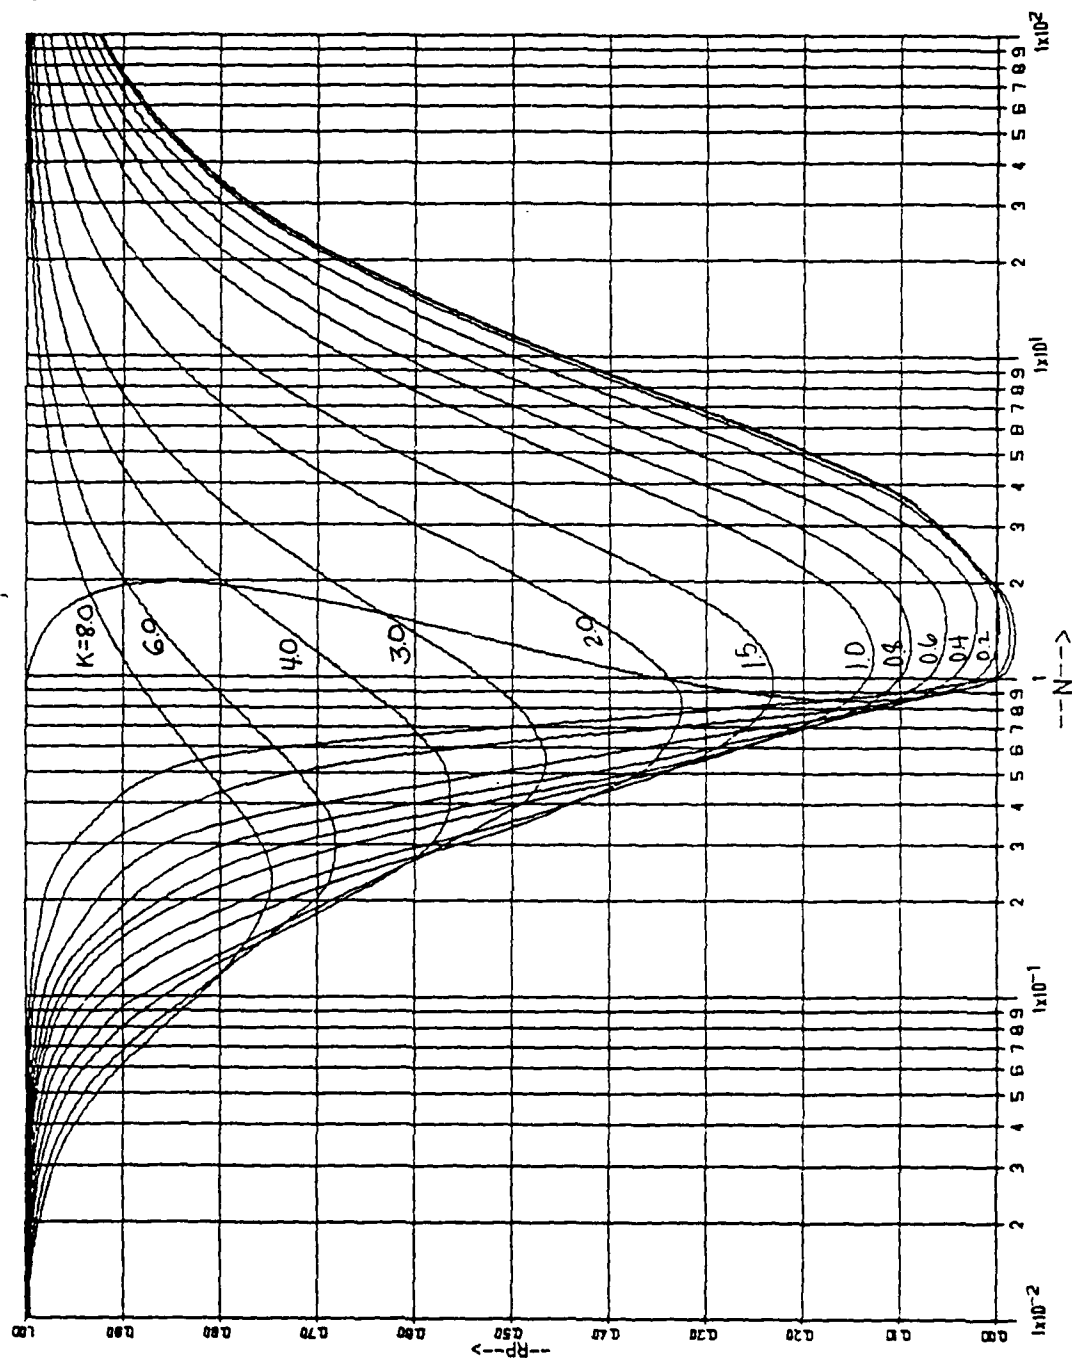


Figure 3.7.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^\circ$  degrees.

PHI - 60.

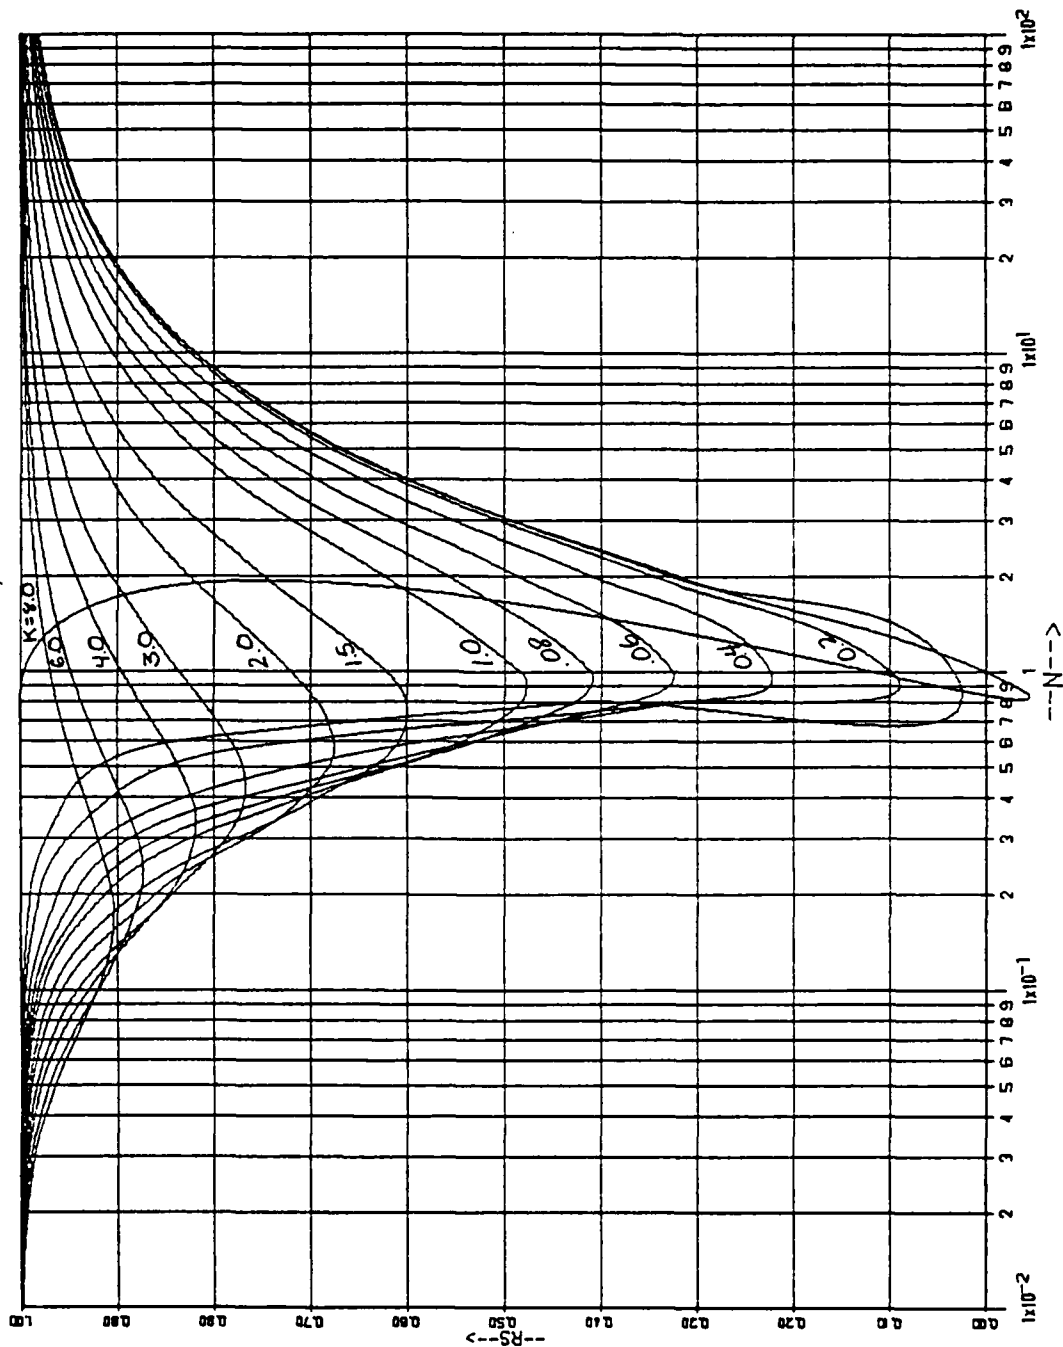


Figure 3.7.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^\circ$  degrees.

PHI- 60.

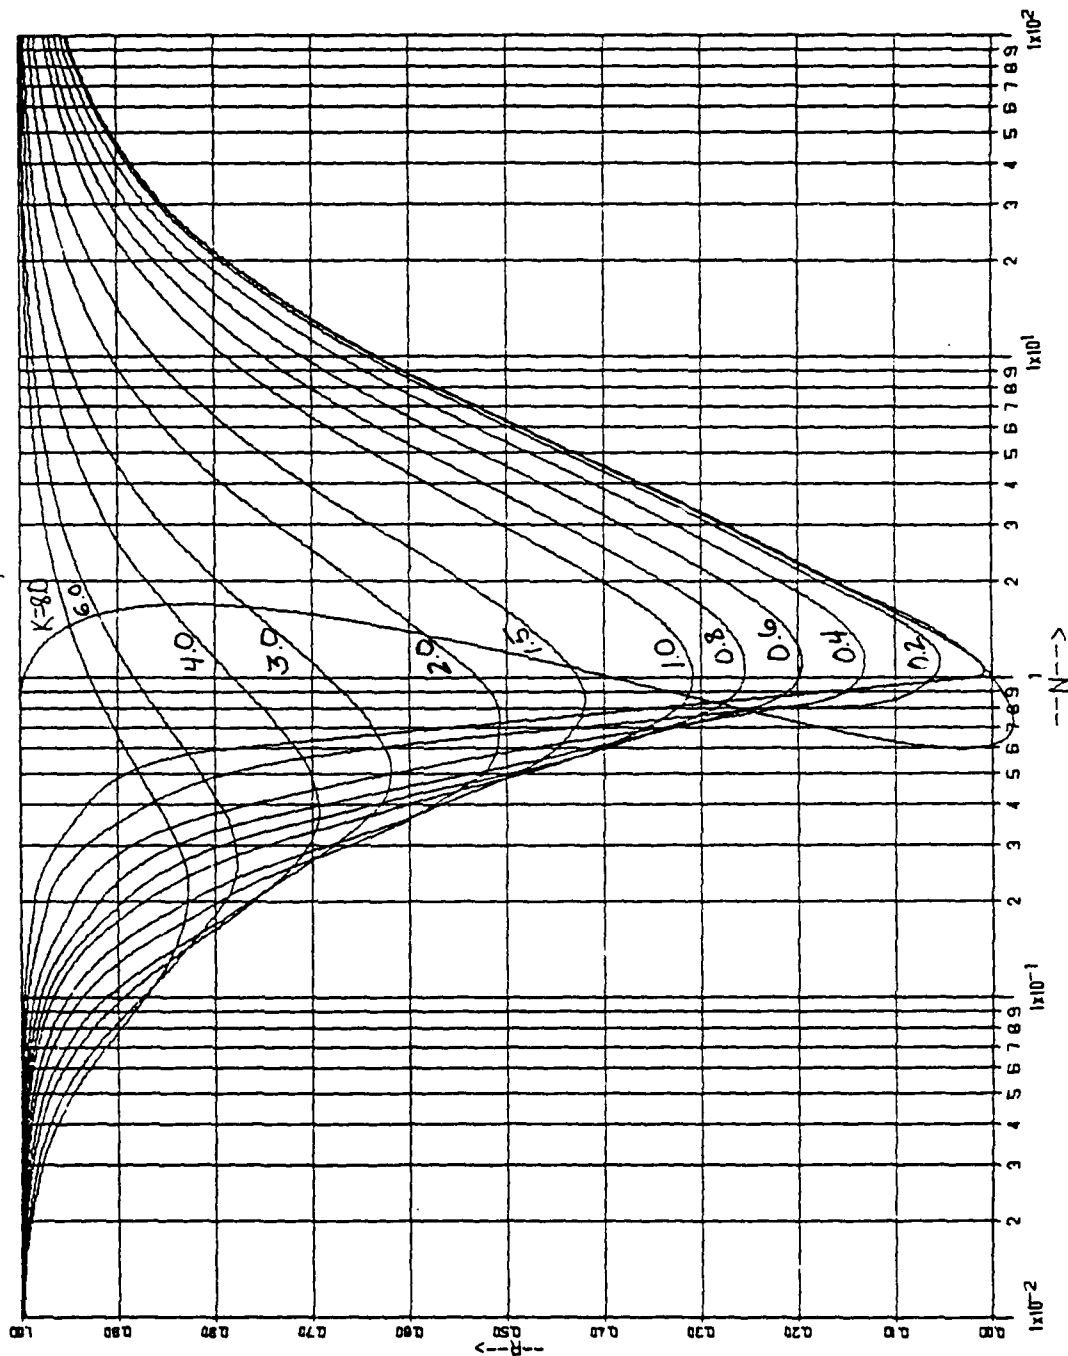


Figure 3.7.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $60^\circ$  degrees .

PHI- 70.

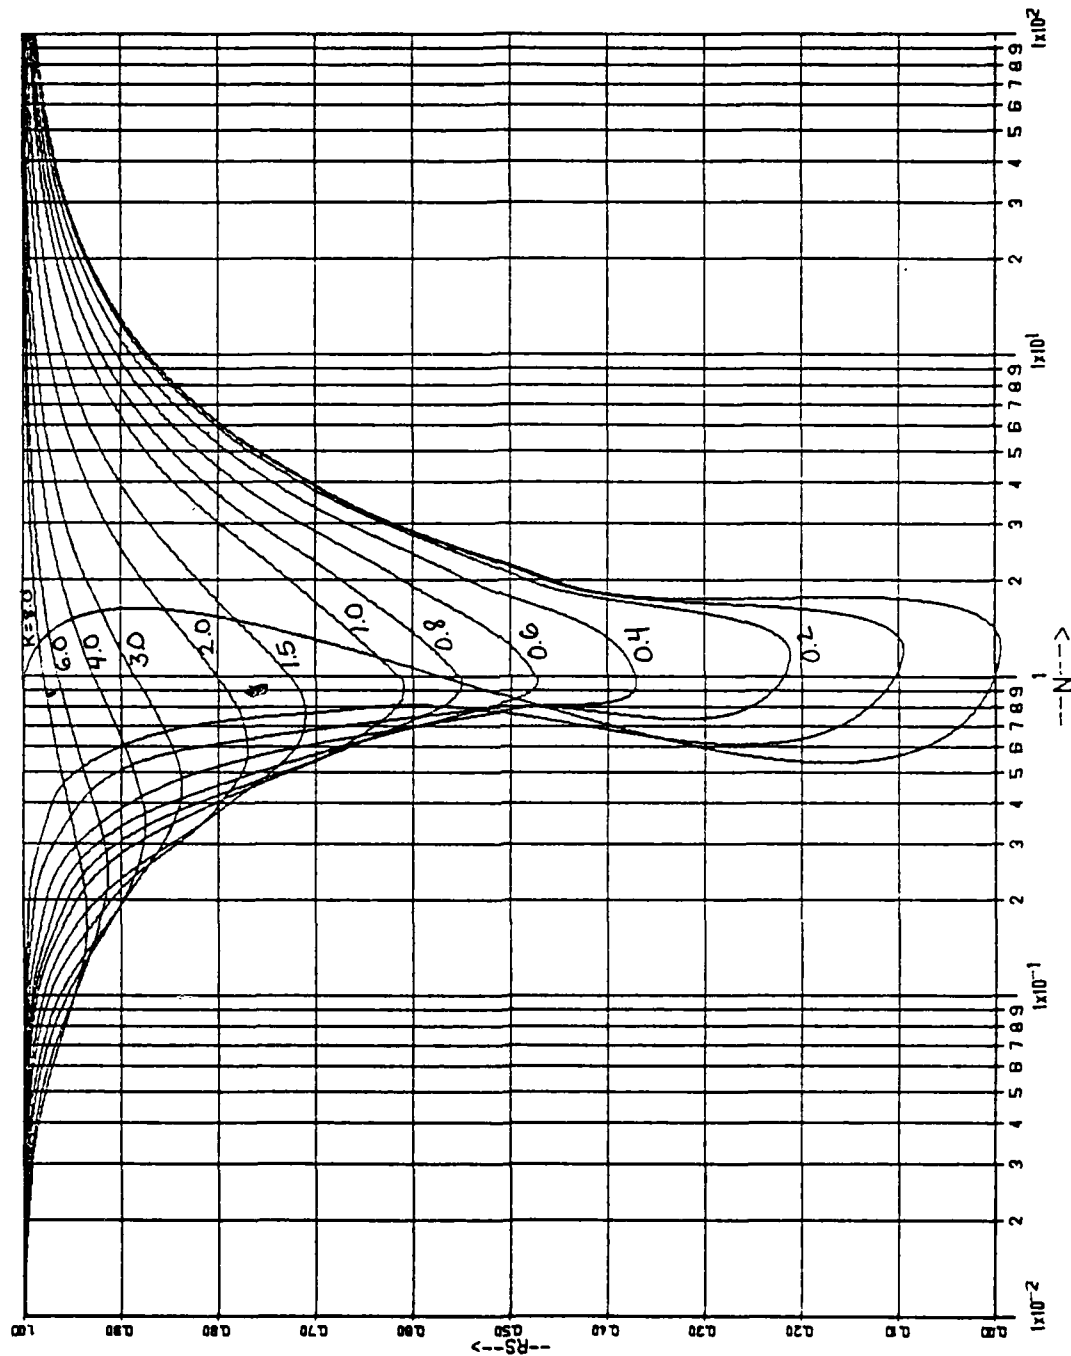


Figure 3.8.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $70^\circ$  degrees.

PHI - 70.

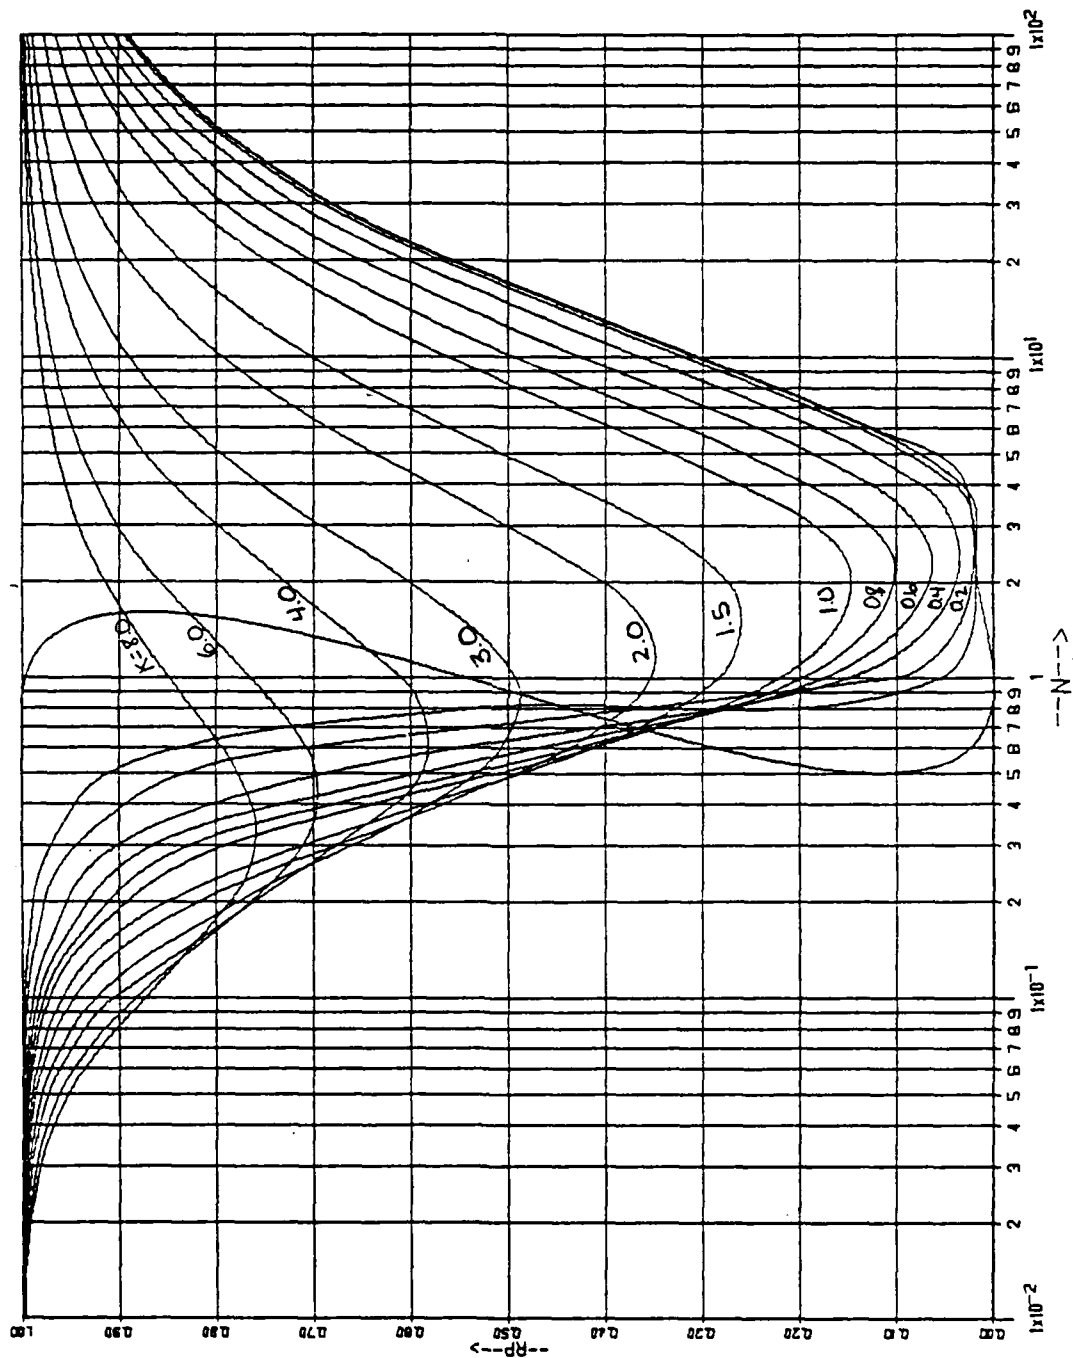


Figure 3.8.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is 70° degrees .

PHI- 70.

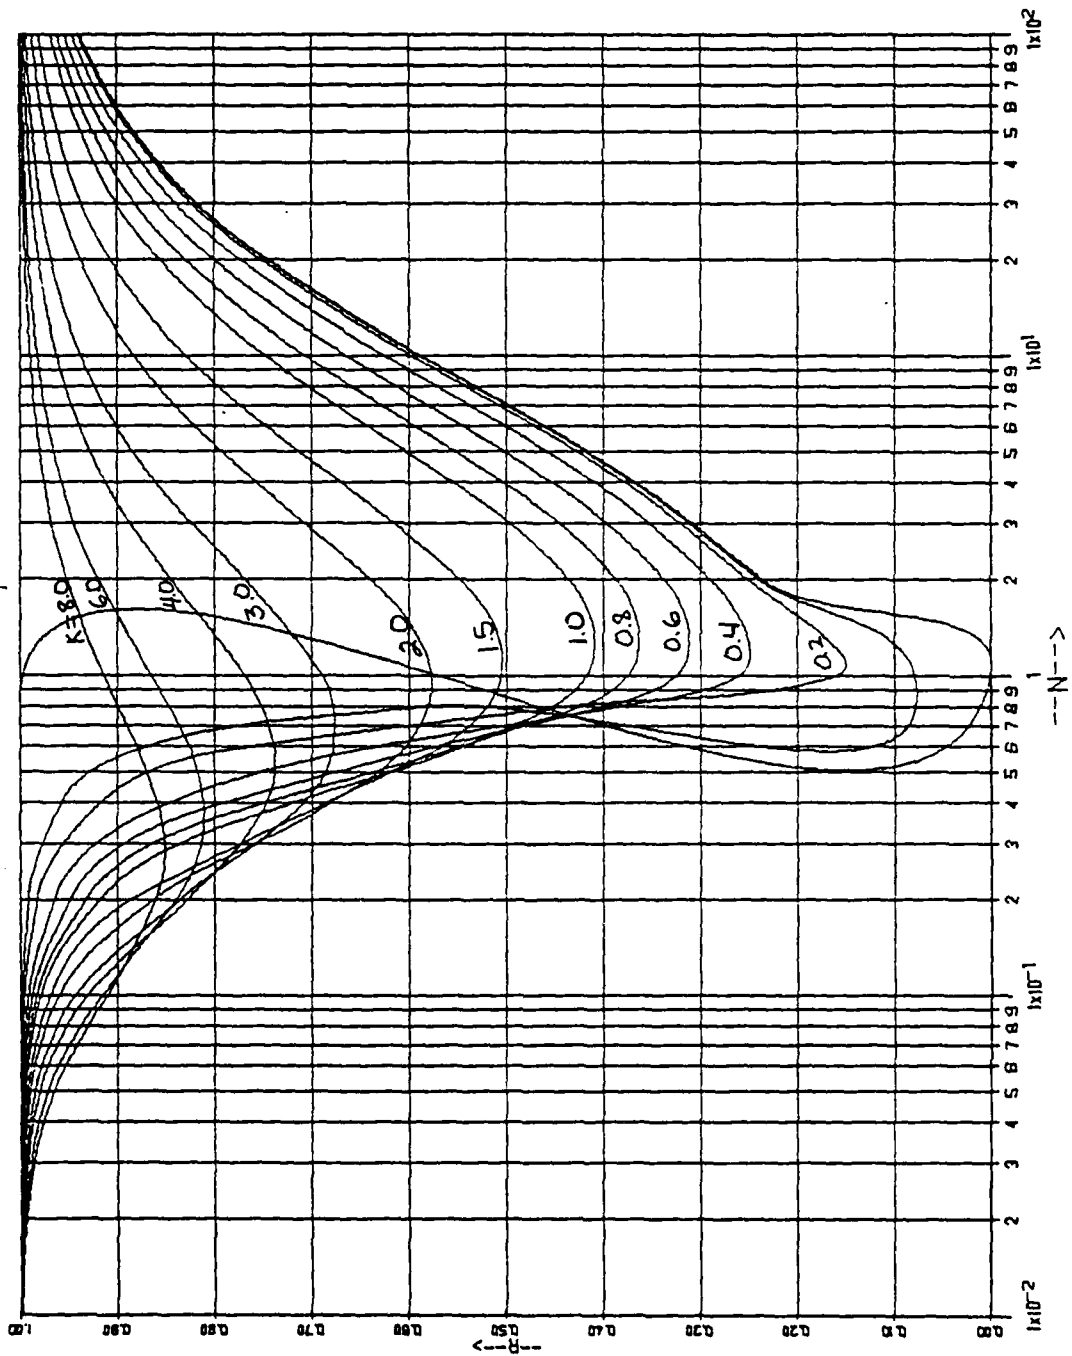


Figure 3.8.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is 70 degrees.

PHI - 80.

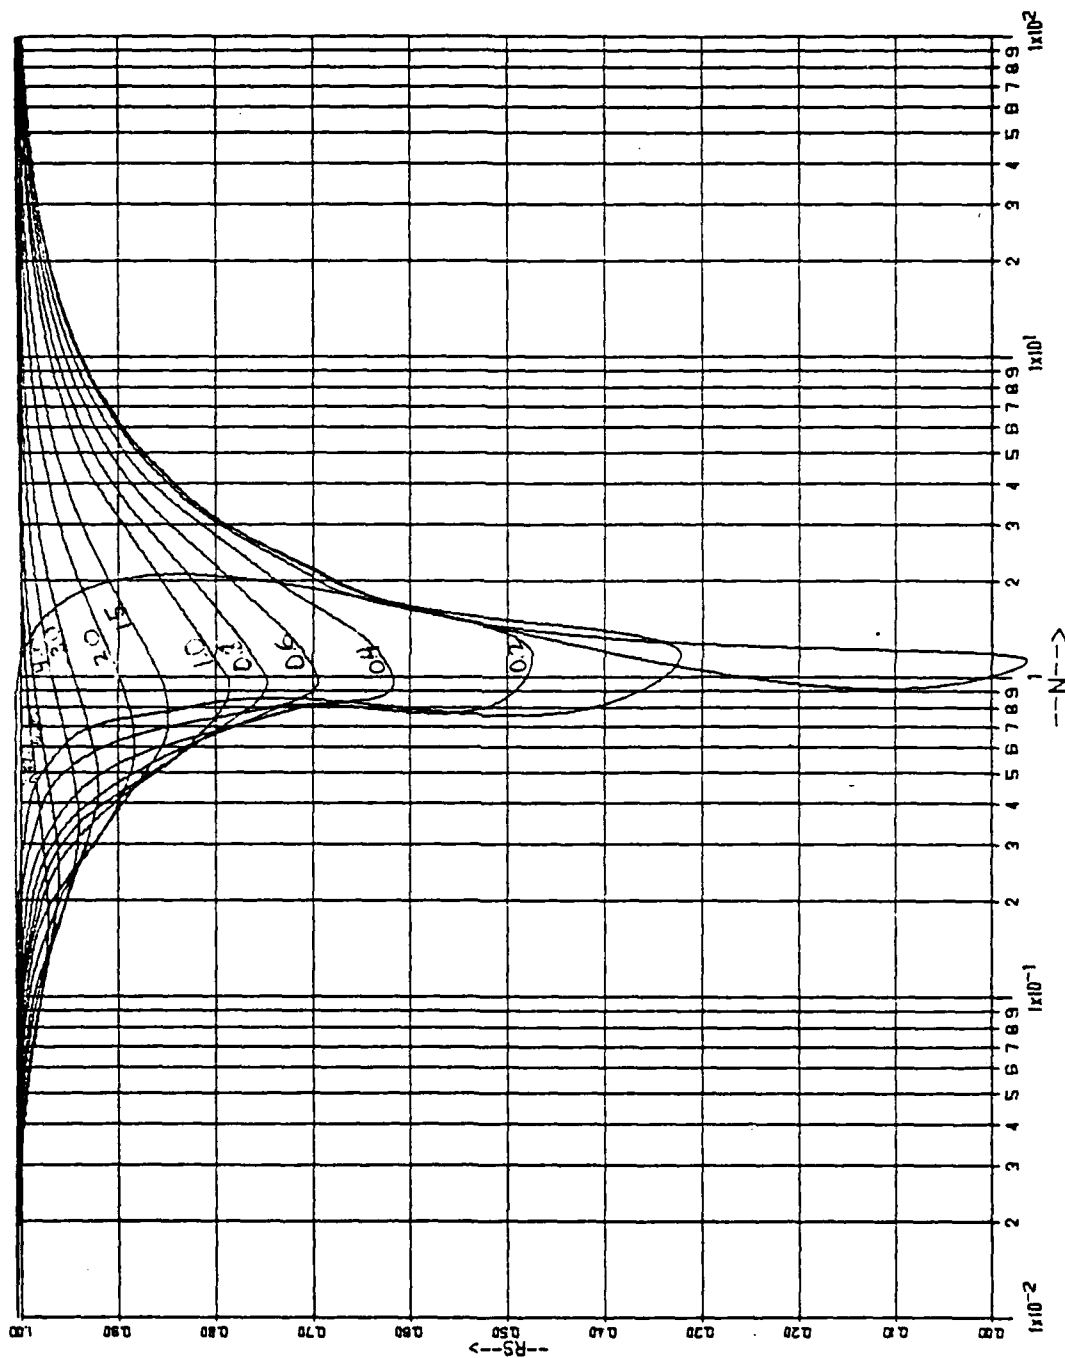


Figure 3.9.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^\circ$  degrees .

PHI- 80.

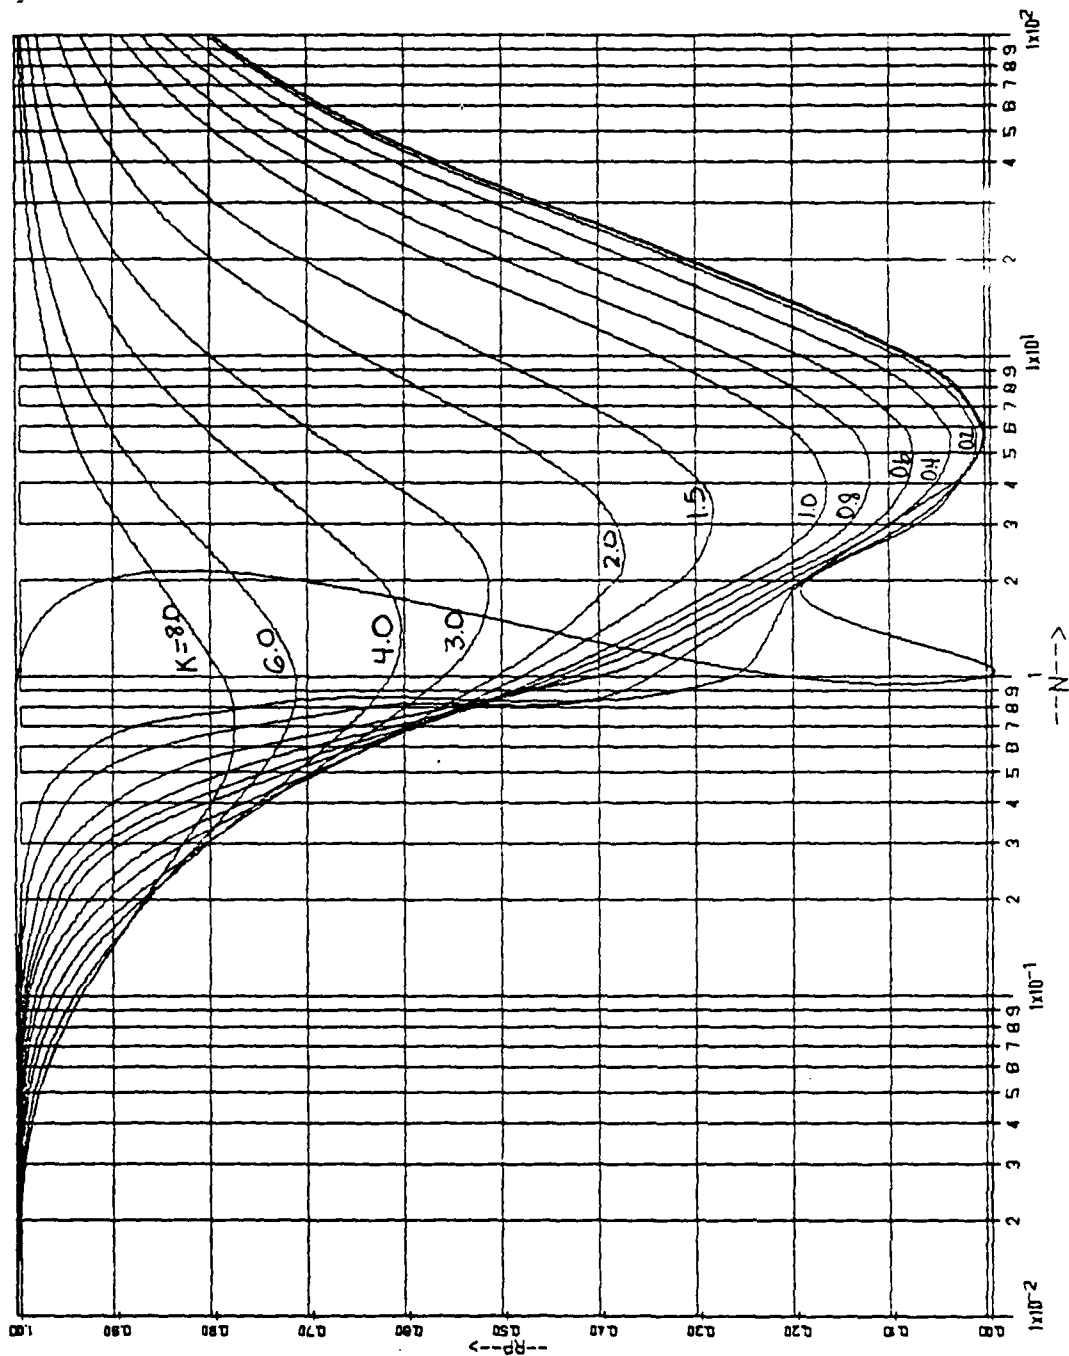


Figure 3.9.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^\circ$  degrees.

PHI- 80.

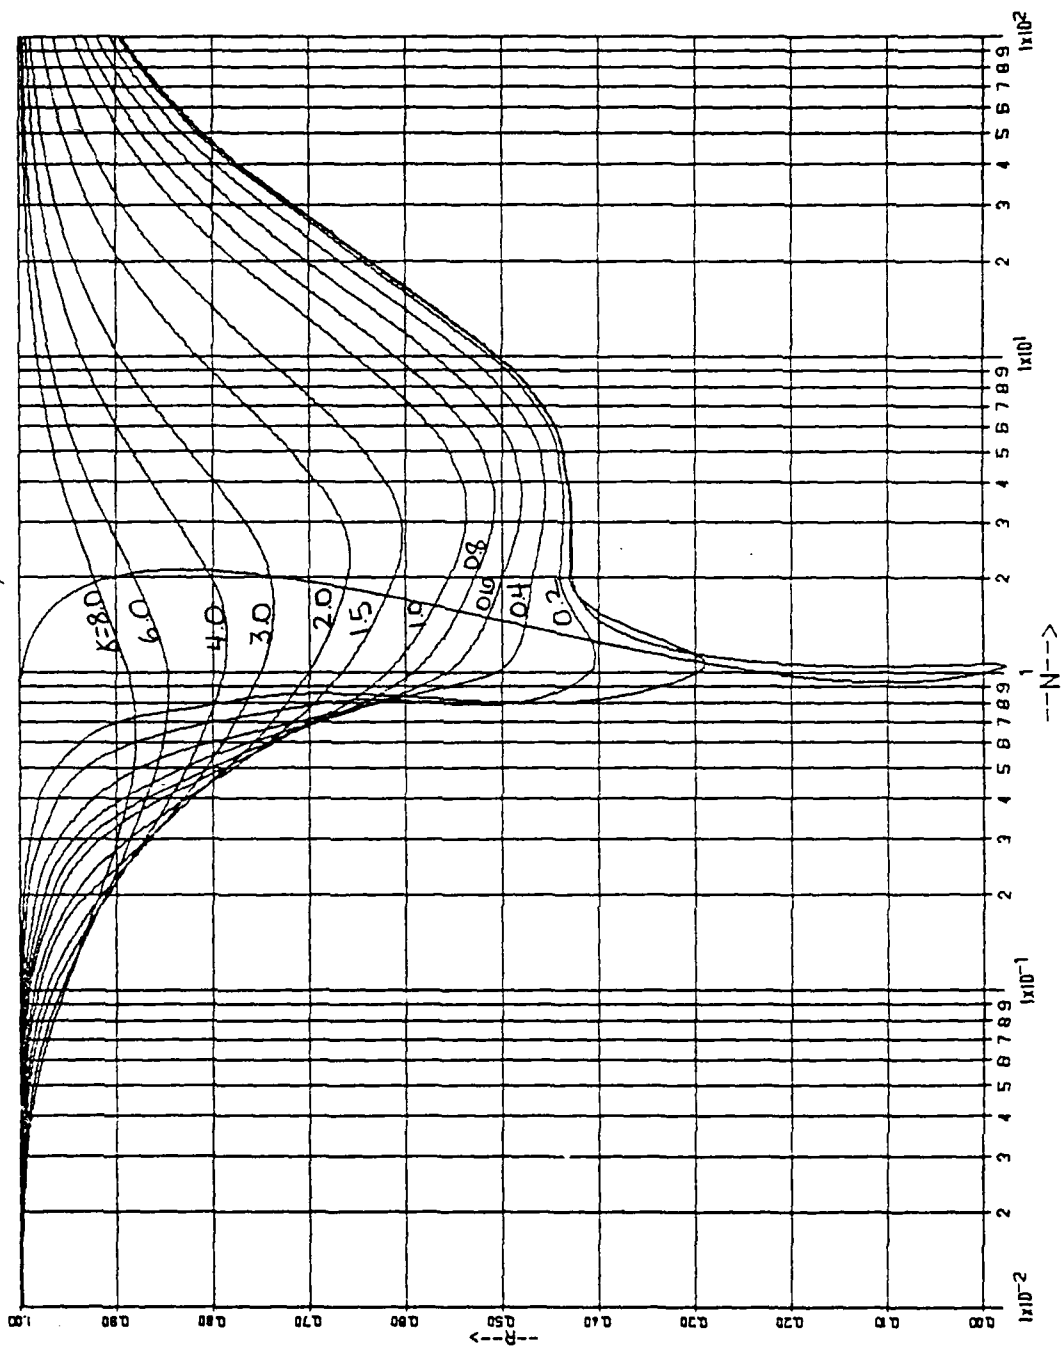


Figure 3.9.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $80^\circ$  degrees .

PHI- 90.

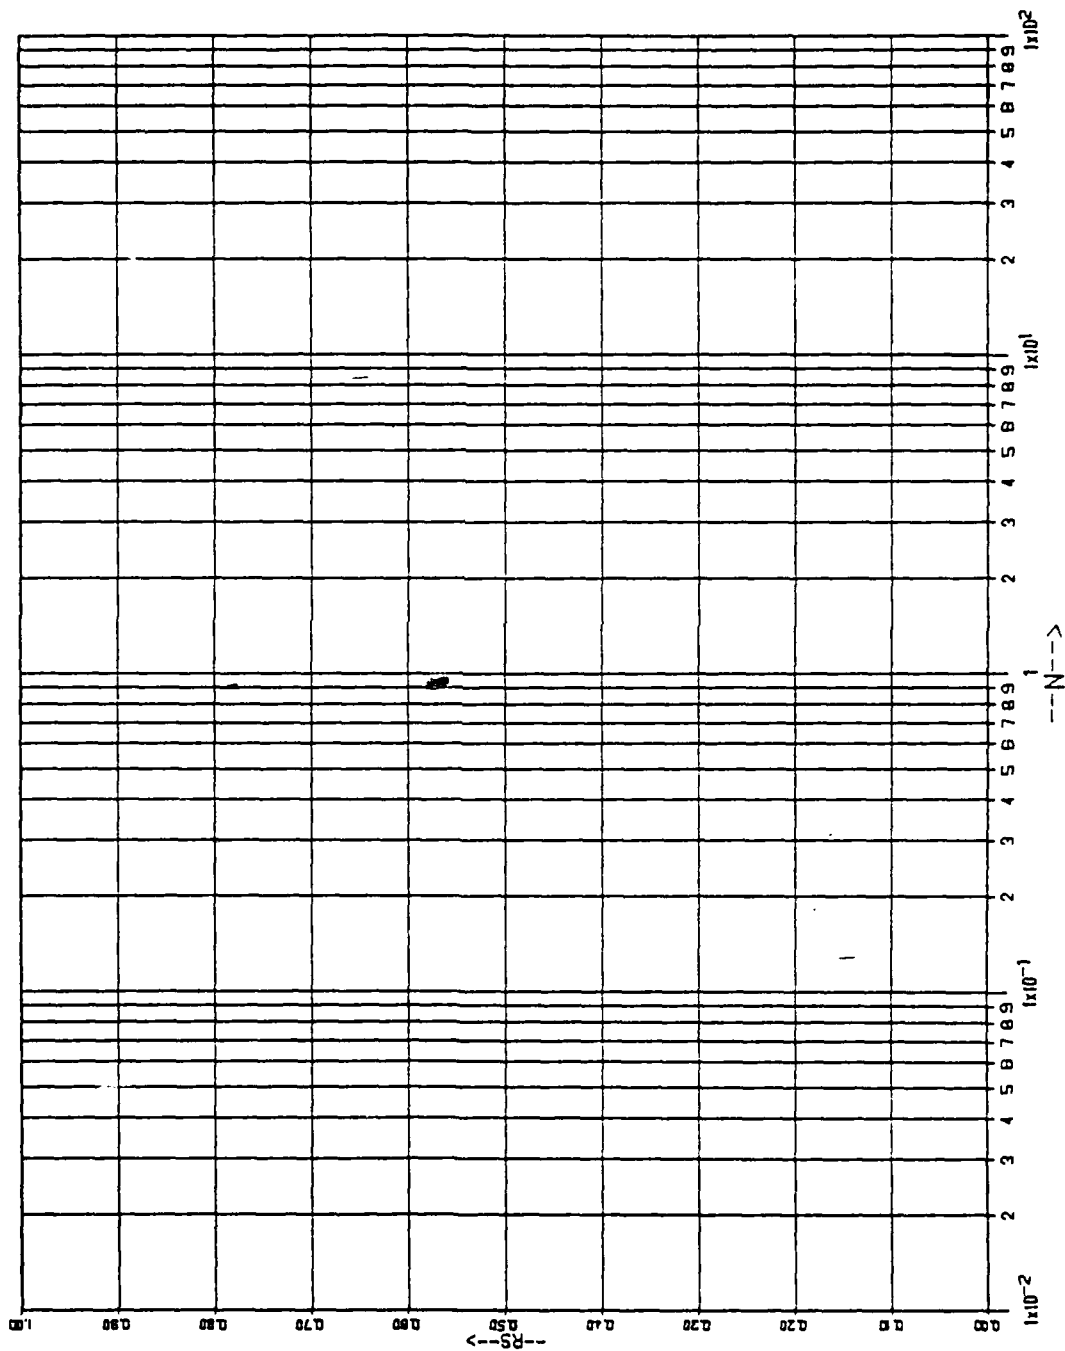


Figure 3.10.1 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is 80° degrees.

PHI- 90.

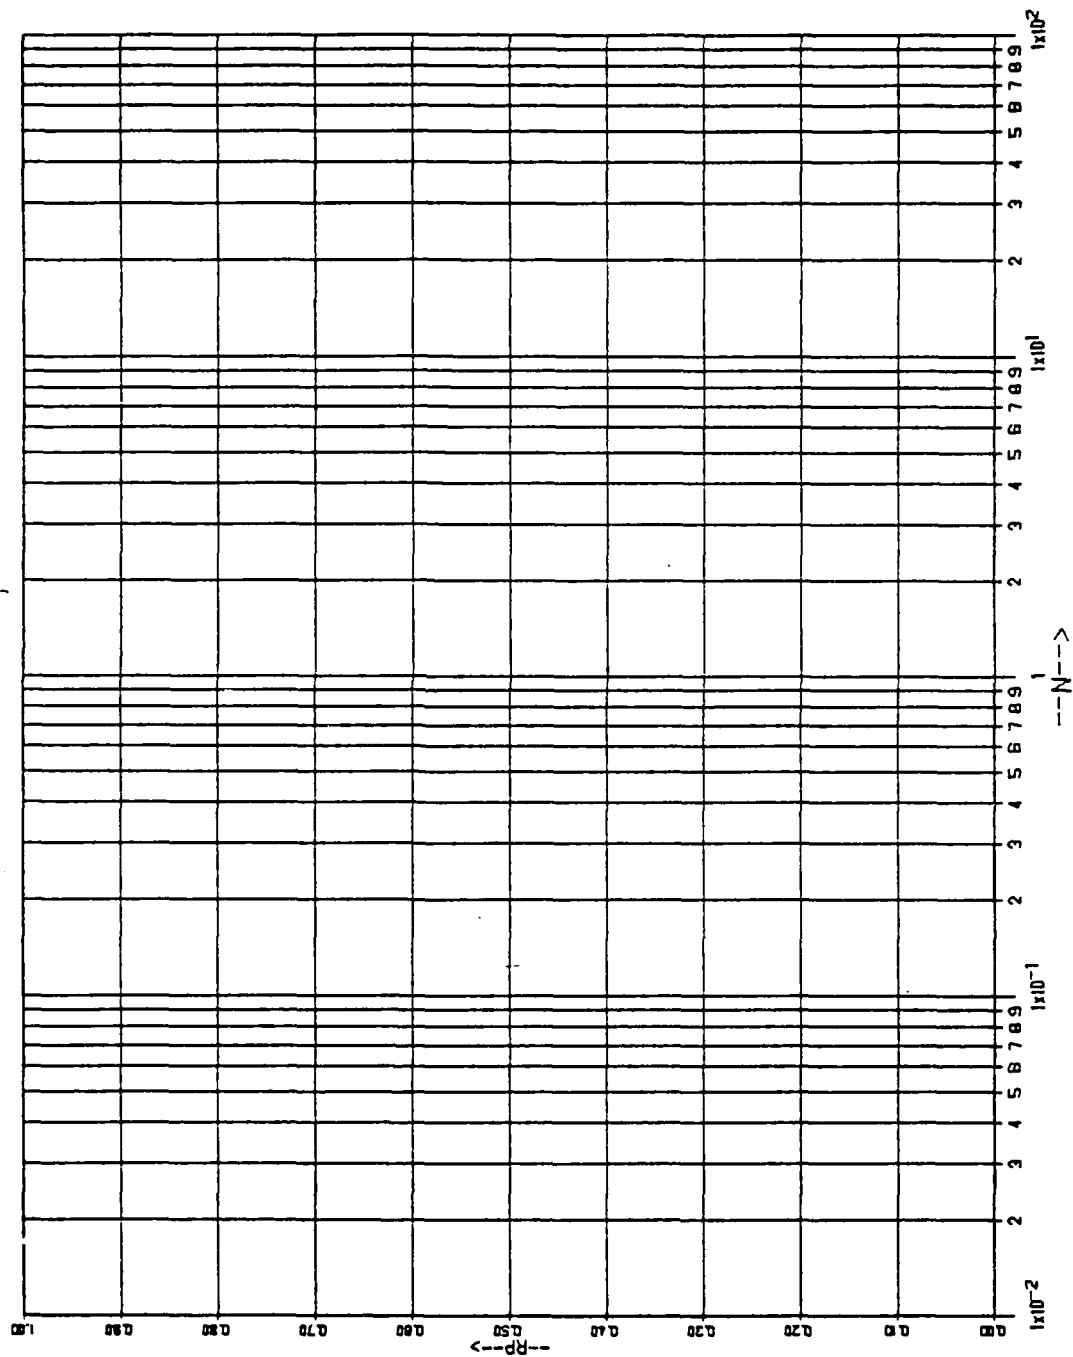


Figure 3.10.2 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $90^\circ$  degrees .

PHI - 90.

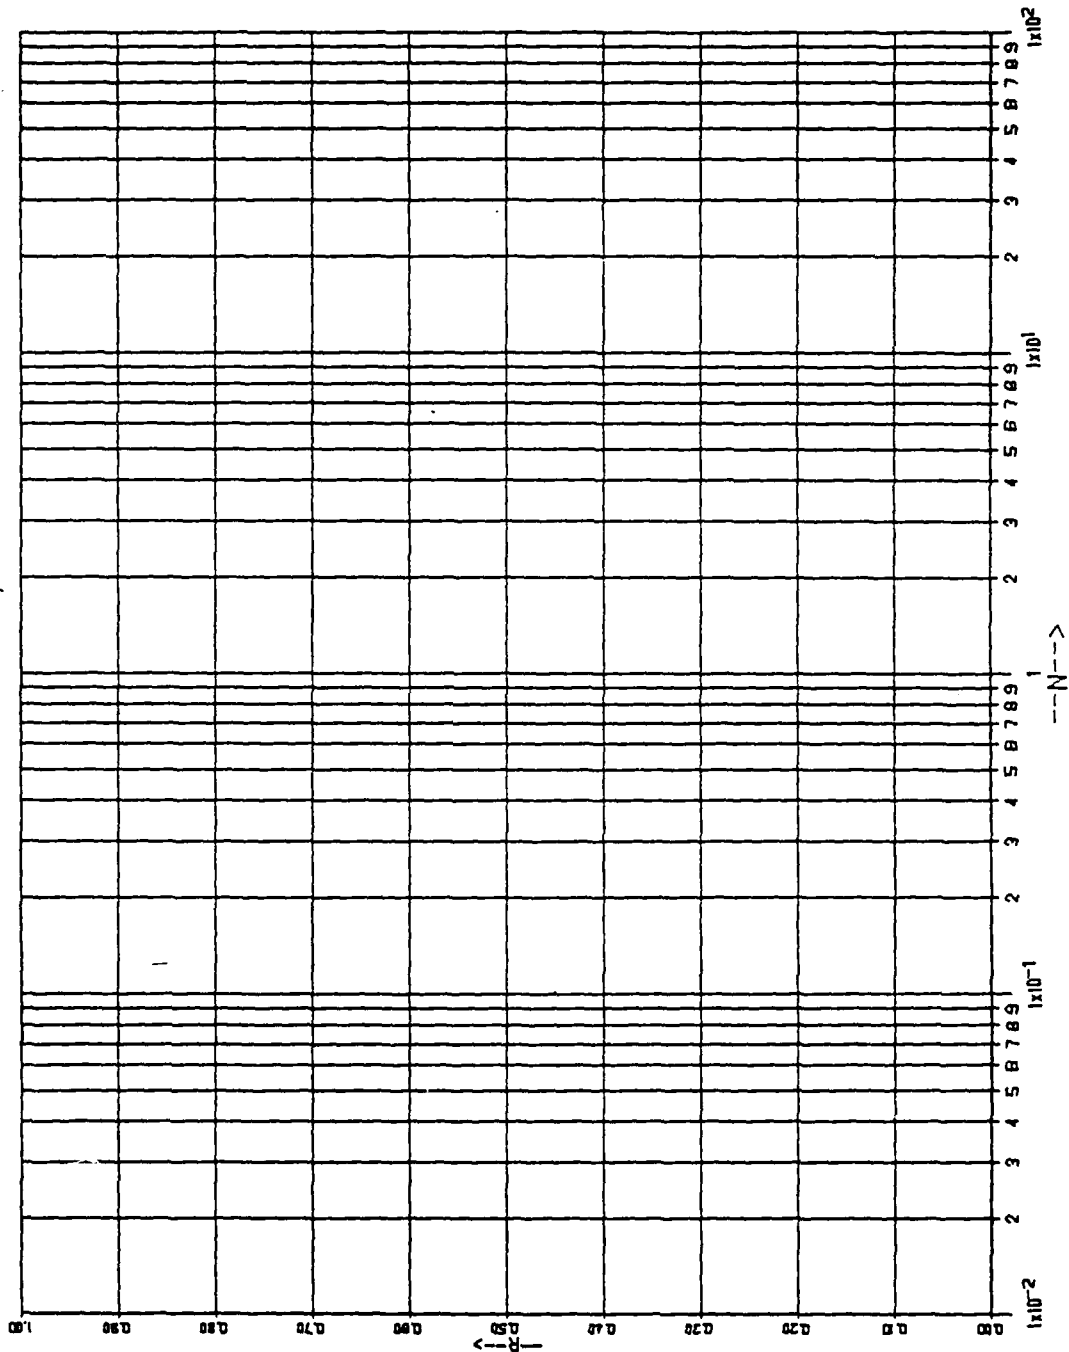


Figure 3.10.3 Simon plots of index of refraction against reflectivities for series of absorption coefficients. The angle of incidence is  $90^\circ$  degrees.

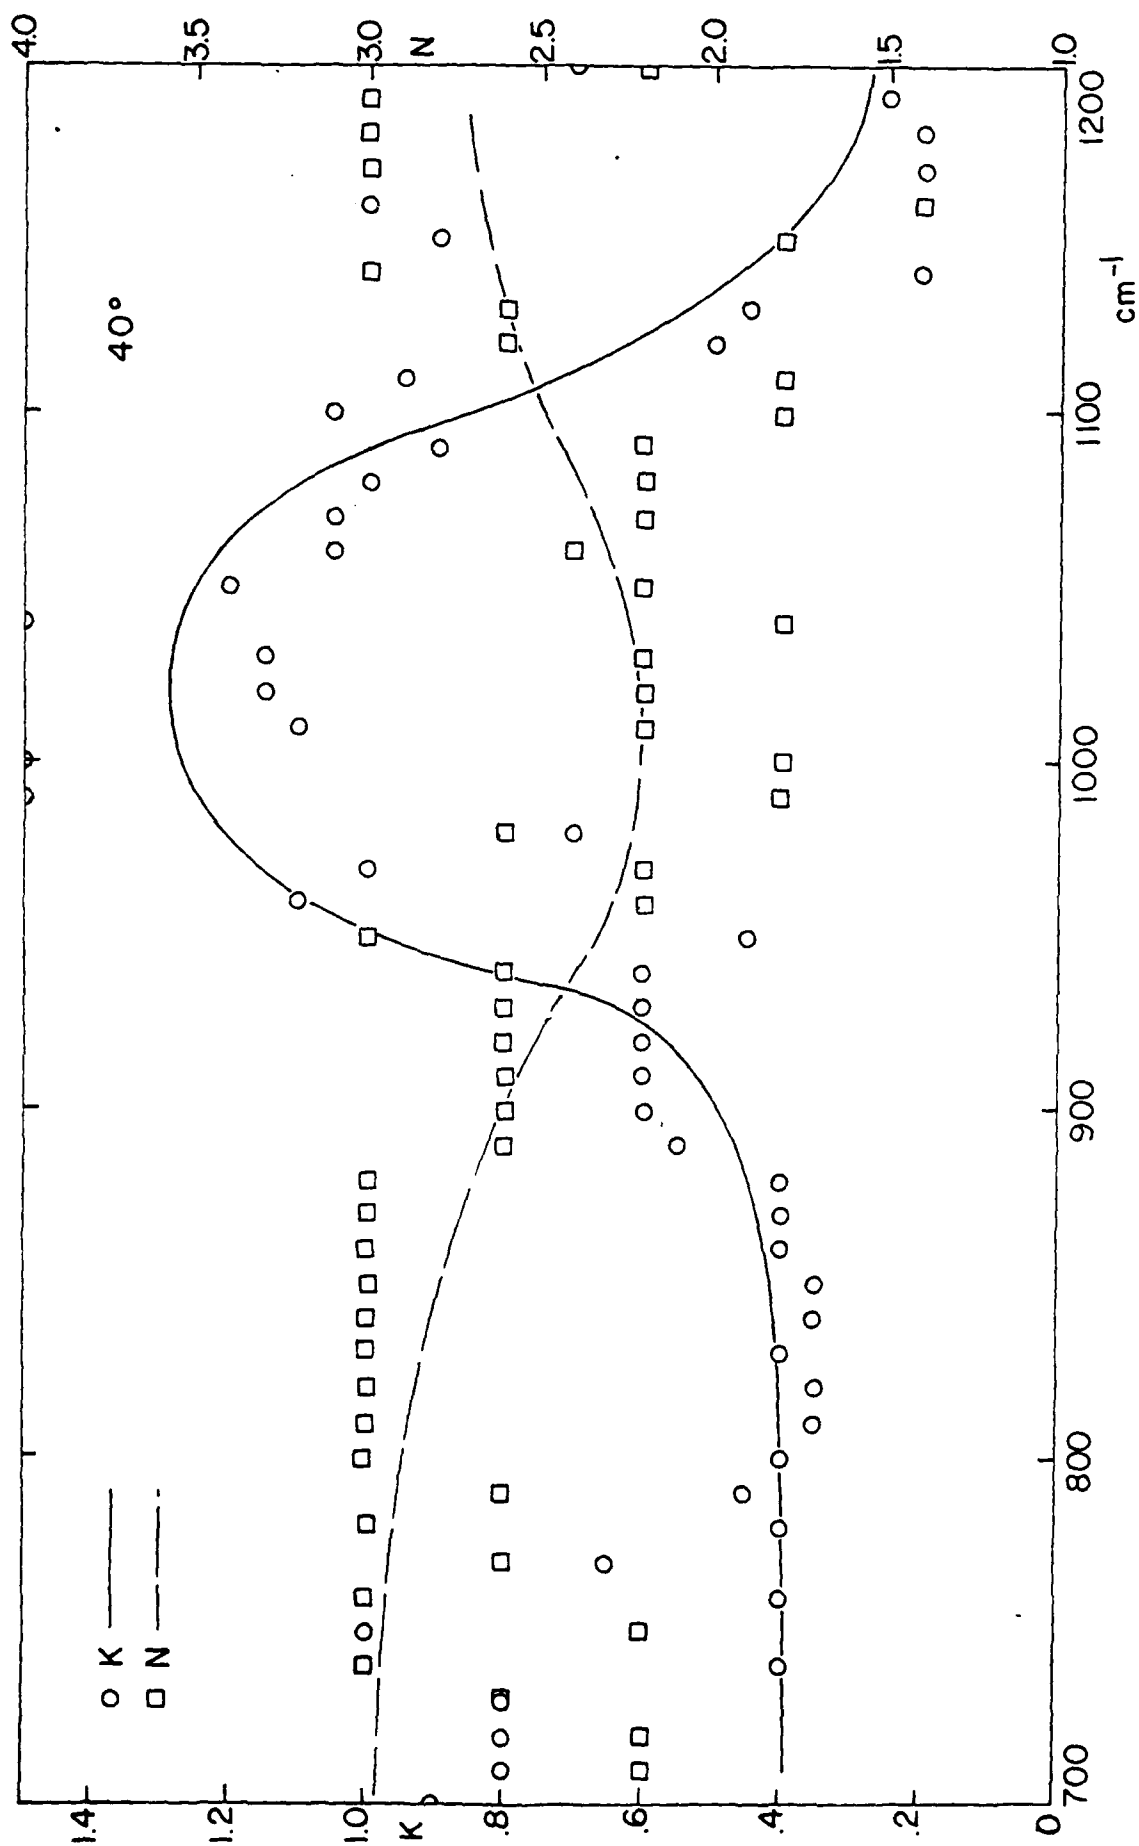


Figure 4 Refractive index and absorption coefficient for boron carbide as measured for 40° degrees incidence

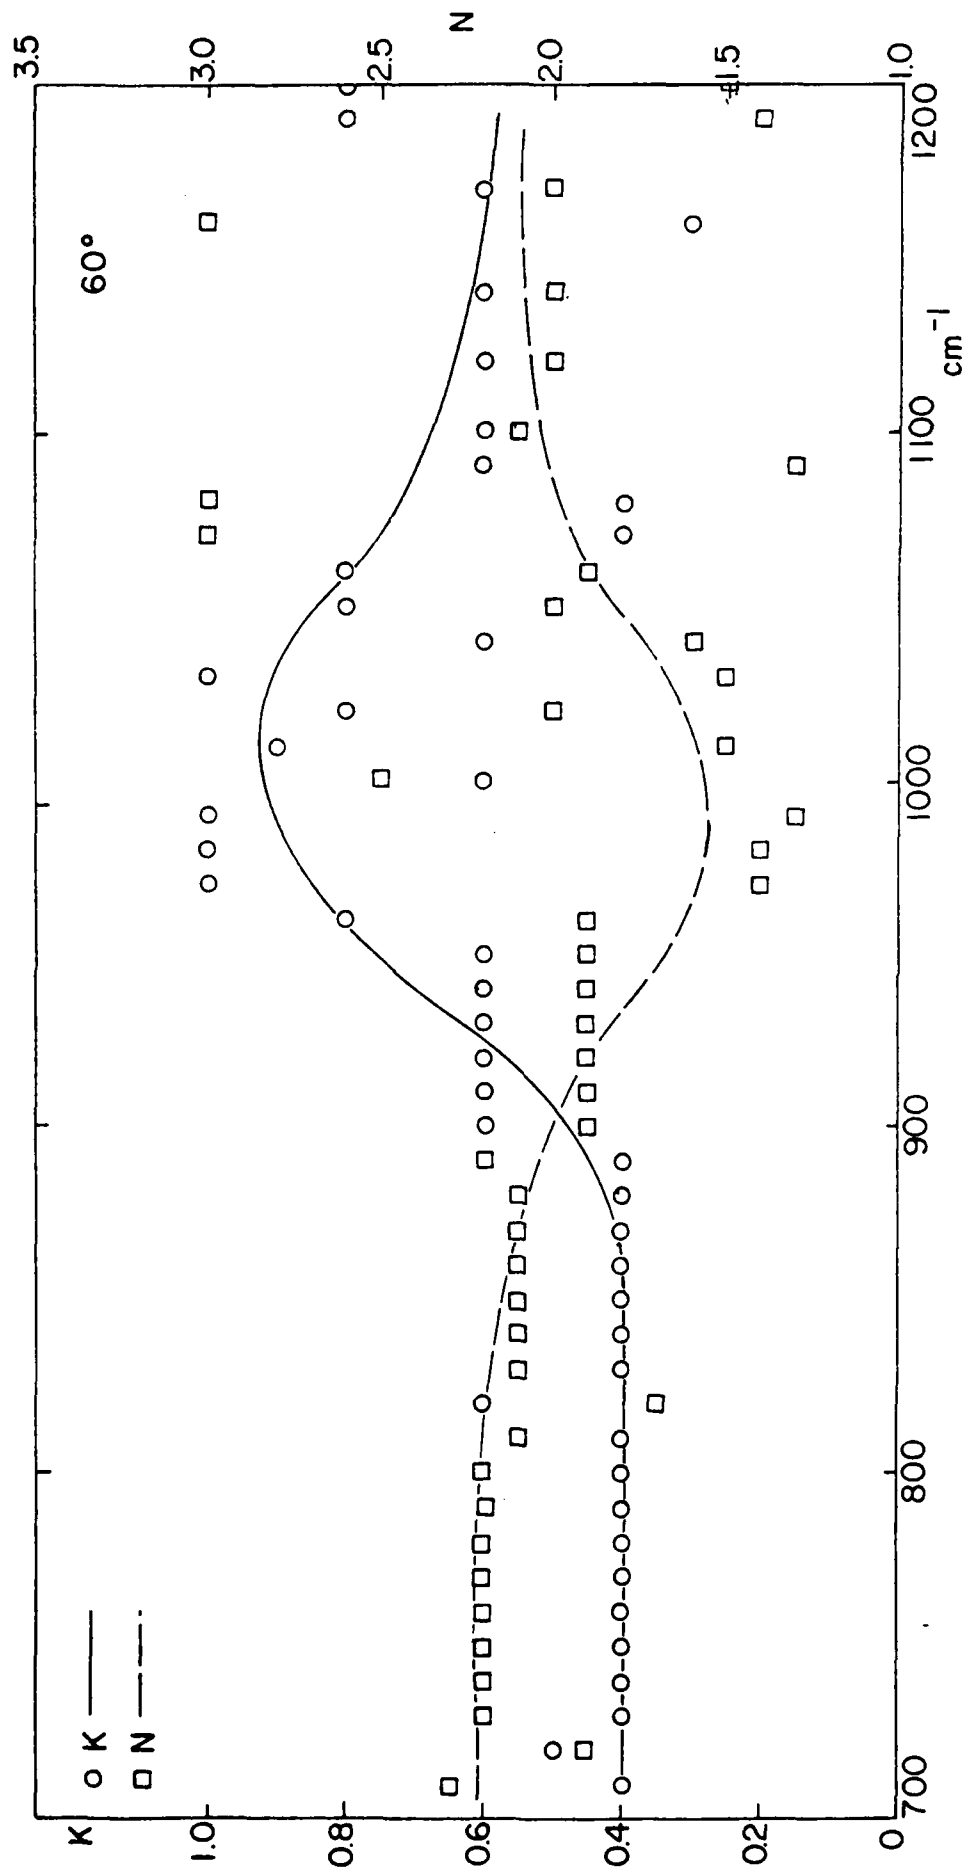


Figure 5 Refractive index and absorption coefficient for boron carbide as measured for 60 degrees incidence

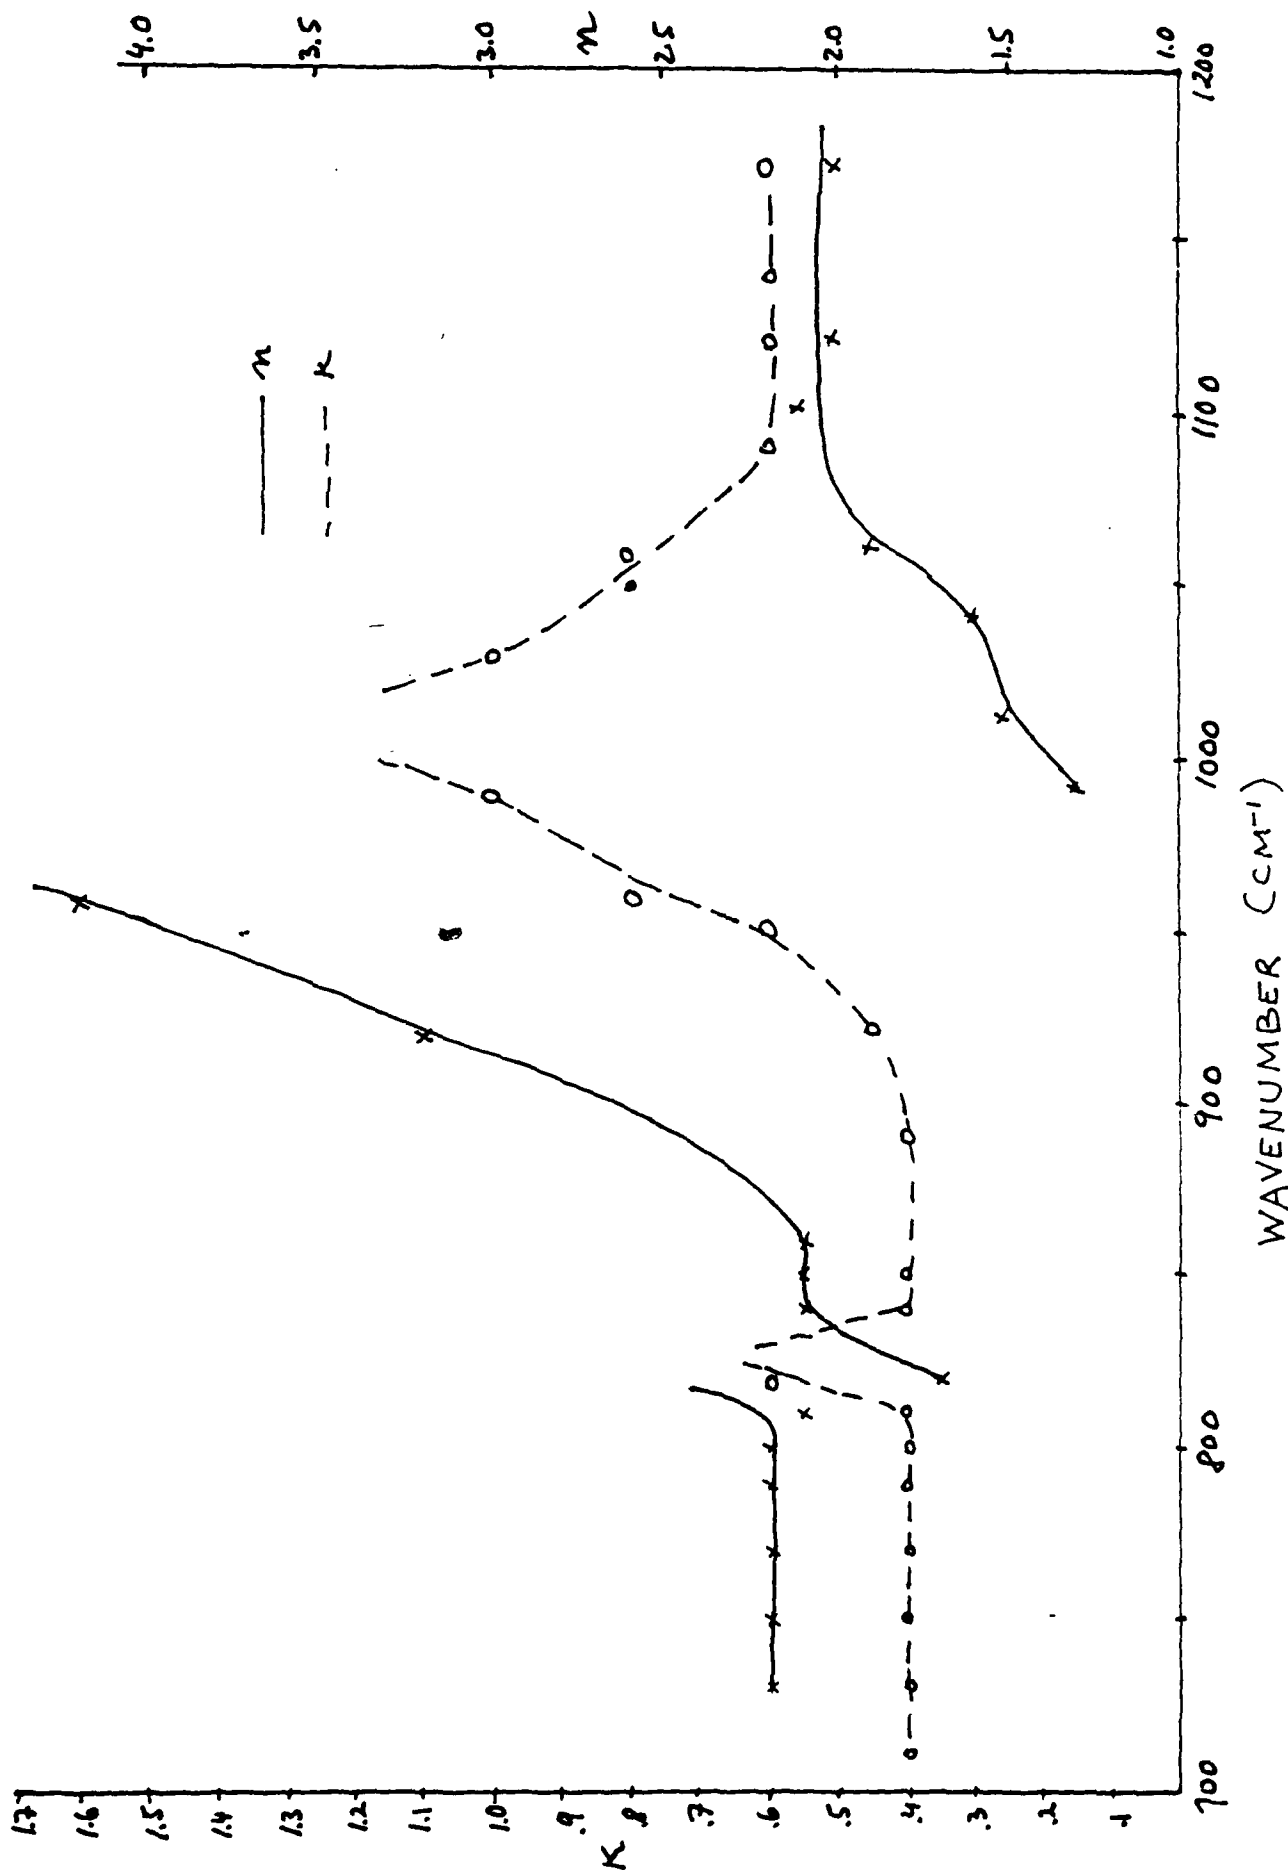


Figure 6 Refractive index and absorption coefficient for boron carbide as measured for 50° incidence

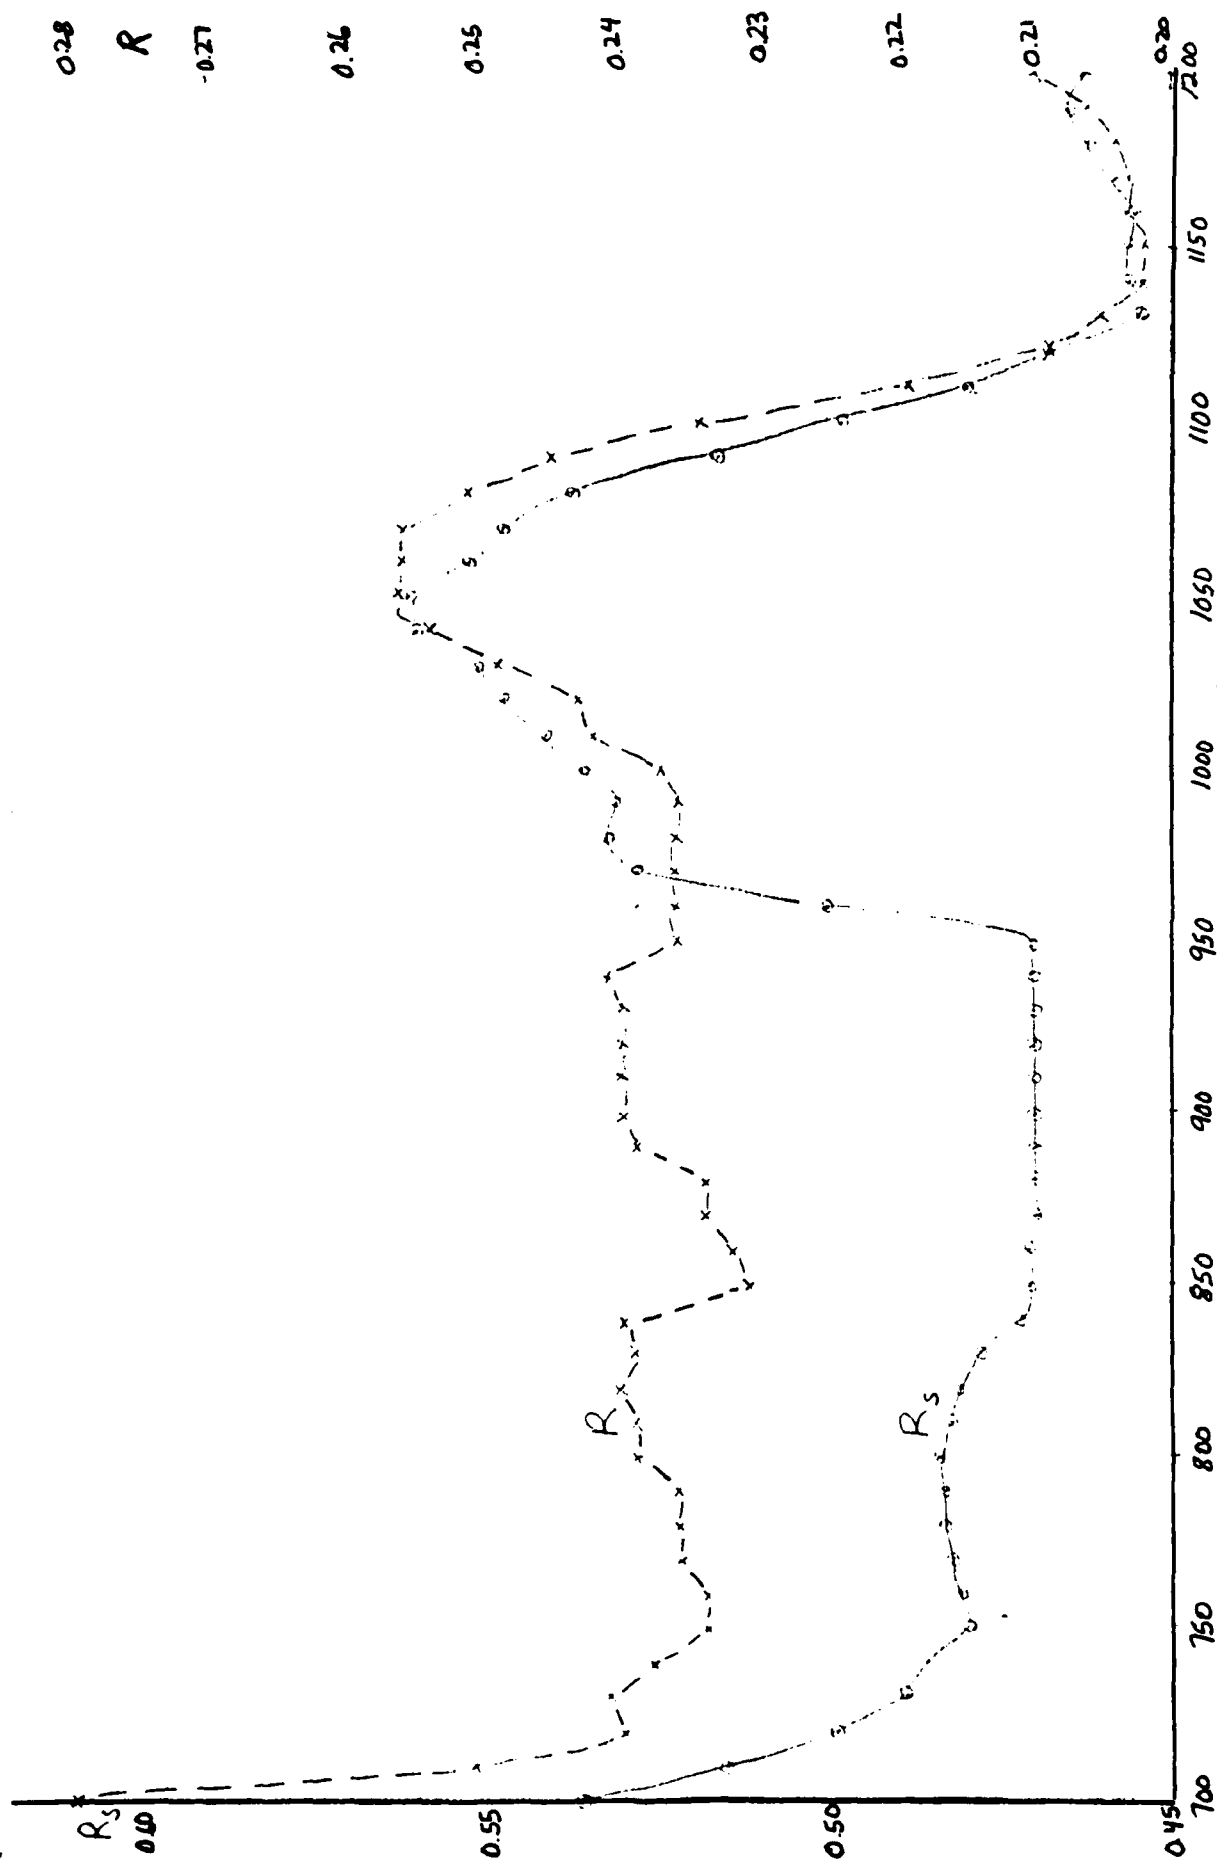


Figure 7 Reflectivities from which Figure 6 were calculated

APPENDIX I

COMPUTER PROGRAM FOR THE CALCULATION OF THE OPTICAL  
CONSTANTS FROM REFLECTIVITIES AND TABULATIONS

# MICHIGAN TERMINAL SYSTEM FORTRAN G(21.8)

MAIN

38-31-79

39:53:13

```

0001 RFAL*4 N(21),K(13),RS(21),RP(21),R(21)
0002 DO 10 I=1,14
0003 READ (5,3)K(I)
0004 FORMAT(F5.2)
0005 7
0006 10 CONTINUE
0007 DO 20 J=1,21
0008 READ (5,4)N(J)
0009 FORMAT(F7.2)
0010 4
0011 20 CONTINUE
0012 CALL PLTXMX(72.)
0013 ORX1=3.
0014 ORX2=ORX1+13.
0015 ORX3=ORX2+13.
0016 YLEN=7.5
0017 ORY=12.5
0018 1 READ(5,2,END=999)PHI
0019 2 FORMAT(F5.3)
0020 WRITE(6,101)PHI
0021 101 FORMAT('1.62X.1 PHI=',F3.0//)
0022 PHI=PHI*3.1415925/180.
0023 SINP=SIN(PHI)
0024 SINP2=SINP**2
0025 COSP=COS(PHI)
0026 COSP2=COSP**2
0027 TAND=TAN(PHI)
0028 TAND2=TAND**2
0029
0030 C
0031 C
0032 C
0033 C
0034 C
0035 C
0036 C
0037 C
0038 C
0039 C
0040 C
0041 C
0042 C
0043 C
0044 C
0045 C
0046 C
0047 C
0048 C
0049 C
0050 C
0051 C
0052 C
0053 C
0054 C
0055 C
0056 C
0057 C
0058 C
0059 C
0060 C
0061 C
0062 C
0063 C
0064 C
0065 C
0066 C
0067 C
0068 C
0069 C
0070 C
0071 C
0072 C
0073 C
0074 C
0075 C
0076 C
0077 C
0078 C
0079 C
0080 C
0081 C
0082 C
0083 C
0084 C
0085 C
0086 C
0087 C
0088 C
0089 C
0090 C
0091 C
0092 C
0093 C
0094 C
0095 C
0096 C
0097 C
0098 C
0099 C
0100 C
0101 C
0102 C
0103 C
0104 C
0105 C
0106 C
0107 C
0108 C
0109 C
0110 C
0111 C
0112 C
0113 C
0114 C
0115 C
0116 C
0117 C
0118 C
0119 C
0120 C
0121 C
0122 C
0123 C
0124 C
0125 C
0126 C
0127 C
0128 C
0129 C
0130 C
0131 C
0132 C
0133 C
0134 C
0135 C
0136 C
0137 C
0138 C
0139 C
0140 C
0141 C
0142 C
0143 C
0144 C
0145 C
0146 C
0147 C
0148 C
0149 C
0150 C
0151 C
0152 C
0153 C
0154 C
0155 C
0156 C
0157 C
0158 C
0159 C
0160 C
0161 C
0162 C
0163 C
0164 C
0165 C
0166 C
0167 C
0168 C
0169 C
0170 C
0171 C
0172 C
0173 C
0174 C
0175 C
0176 C
0177 C
0178 C
0179 C
0180 C
0181 C
0182 C
0183 C
0184 C
0185 C
0186 C
0187 C
0188 C
0189 C
0190 C
0191 C
0192 C
0193 C
0194 C
0195 C
0196 C
0197 C
0198 C
0199 C
0200 C
0201 C
0202 C
0203 C
0204 C
0205 C
0206 C
0207 C
0208 C
0209 C
0210 C
0211 C
0212 C
0213 C
0214 C
0215 C
0216 C
0217 C
0218 C
0219 C
0220 C
0221 C
0222 C
0223 C
0224 C
0225 C
0226 C
0227 C
0228 C
0229 C
0230 C
0231 C
0232 C
0233 C
0234 C
0235 C
0236 C
0237 C
0238 C
0239 C
0240 C
0241 C
0242 C
0243 C
0244 C
0245 C
0246 C
0247 C
0248 C
0249 C
0250 C
0251 C
0252 C
0253 C
0254 C
0255 C
0256 C
0257 C
0258 C
0259 C
0260 C
0261 C
0262 C
0263 C
0264 C
0265 C
0266 C
0267 C
0268 C
0269 C
0270 C
0271 C
0272 C
0273 C
0274 C
0275 C
0276 C
0277 C
0278 C
0279 C
0280 C
0281 C
0282 C
0283 C
0284 C
0285 C
0286 C
0287 C
0288 C
0289 C
0290 C
0291 C
0292 C
0293 C
0294 C
0295 C
0296 C
0297 C
0298 C
0299 C
0300 C
0301 C
0302 C
0303 C
0304 C
0305 C
0306 C
0307 C
0308 C
0309 C
0310 C
0311 C
0312 C
0313 C
0314 C
0315 C
0316 C
0317 C
0318 C
0319 C
0320 C
0321 C
0322 C
0323 C
0324 C
0325 C
0326 C
0327 C
0328 C
0329 C
0330 C
0331 C
0332 C
0333 C
0334 C
0335 C
0336 C
0337 C
0338 C
0339 C
0340 C
0341 C
0342 C
0343 C
0344 C
0345 C
0346 C
0347 C
0348 C
0349 C
0350 C
0351 C
0352 C
0353 C
0354 C
0355 C
0356 C
0357 C
0358 C
0359 C
0360 C
0361 C
0362 C
0363 C
0364 C
0365 C
0366 C
0367 C
0368 C
0369 C
0370 C
0371 C
0372 C
0373 C
0374 C
0375 C
0376 C
0377 C
0378 C
0379 C
0380 C
0381 C
0382 C
0383 C
0384 C
0385 C
0386 C
0387 C
0388 C
0389 C
0390 C
0391 C
0392 C
0393 C
0394 C
0395 C
0396 C
0397 C
0398 C
0399 C
0400 C
0401 C
0402 C
0403 C
0404 C
0405 C
0406 C
0407 C
0408 C
0409 C
0410 C
0411 C
0412 C
0413 C
0414 C
0415 C
0416 C
0417 C
0418 C
0419 C
0420 C
0421 C
0422 C
0423 C
0424 C
0425 C
0426 C
0427 C
0428 C
0429 C
0430 C
0431 C
0432 C
0433 C
0434 C
0435 C
0436 C
0437 C
0438 C
0439 C
0440 C
0441 C
0442 C
0443 C
0444 C
0445 C
0446 C
0447 C
0448 C
0449 C
0450 C
0451 C
0452 C
0453 C
0454 C
0455 C
0456 C
0457 C
0458 C
0459 C
0460 C
0461 C
0462 C
0463 C
0464 C
0465 C
0466 C
0467 C
0468 C
0469 C
0470 C
0471 C
0472 C
0473 C
0474 C
0475 C
0476 C
0477 C
0478 C
0479 C
0480 C
0481 C
0482 C
0483 C
0484 C
0485 C
0486 C
0487 C
0488 C
0489 C
0490 C
0491 C
0492 C
0493 C
0494 C
0495 C
0496 C
0497 C
0498 C
0499 C
0500 C
0501 C
0502 C
0503 C
0504 C
0505 C
0506 C
0507 C
0508 C
0509 C
0510 C
0511 C
0512 C
0513 C
0514 C
0515 C
0516 C
0517 C
0518 C
0519 C
0520 C
0521 C
0522 C
0523 C
0524 C
0525 C
0526 C
0527 C
0528 C
0529 C
0530 C
0531 C
0532 C
0533 C
0534 C
0535 C
0536 C
0537 C
0538 C
0539 C
0540 C
0541 C
0542 C
0543 C
0544 C
0545 C
0546 C
0547 C
0548 C
0549 C
0550 C
0551 C
0552 C
0553 C
0554 C
0555 C
0556 C
0557 C
0558 C
0559 C
0560 C
0561 C
0562 C
0563 C
0564 C
0565 C
0566 C
0567 C
0568 C
0569 C
0570 C
0571 C
0572 C
0573 C
0574 C
0575 C
0576 C
0577 C
0578 C
0579 C
0580 C
0581 C
0582 C
0583 C
0584 C
0585 C
0586 C
0587 C
0588 C
0589 C
0590 C
0591 C
0592 C
0593 C
0594 C
0595 C
0596 C
0597 C
0598 C
0599 C
0600 C
0601 C
0602 C
0603 C
0604 C
0605 C
0606 C
0607 C
0608 C
0609 C
0610 C
0611 C
0612 C
0613 C
0614 C
0615 C
0616 C
0617 C
0618 C
0619 C
0620 C
0621 C
0622 C
0623 C
0624 C
0625 C
0626 C
0627 C
0628 C
0629 C
0630 C
0631 C
0632 C
0633 C
0634 C
0635 C
0636 C
0637 C
0638 C
0639 C
0640 C
0641 C
0642 C
0643 C
0644 C
0645 C
0646 C
0647 C
0648 C
0649 C
0650 C
0651 C
0652 C
0653 C
0654 C
0655 C
0656 C
0657 C
0658 C
0659 C
0660 C
0661 C
0662 C
0663 C
0664 C
0665 C
0666 C
0667 C
0668 C
0669 C
0670 C
0671 C
0672 C
0673 C
0674 C
0675 C
0676 C
0677 C
0678 C
0679 C
0680 C
0681 C
0682 C
0683 C
0684 C
0685 C
0686 C
0687 C
0688 C
0689 C
0690 C
0691 C
0692 C
0693 C
0694 C
0695 C
0696 C
0697 C
0698 C
0699 C
0700 C
0701 C
0702 C
0703 C
0704 C
0705 C
0706 C
0707 C
0708 C
0709 C
0710 C
0711 C
0712 C
0713 C
0714 C
0715 C
0716 C
0717 C
0718 C
0719 C
0720 C
0721 C
0722 C
0723 C
0724 C
0725 C
0726 C
0727 C
0728 C
0729 C
0730 C
0731 C
0732 C
0733 C
0734 C
0735 C
0736 C
0737 C
0738 C
0739 C
0740 C
0741 C
0742 C
0743 C
0744 C
0745 C
0746 C
0747 C
0748 C
0749 C
0750 C
0751 C
0752 C
0753 C
0754 C
0755 C
0756 C
0757 C
0758 C
0759 C
0760 C
0761 C
0762 C
0763 C
0764 C
0765 C
0766 C
0767 C
0768 C
0769 C
0770 C
0771 C
0772 C
0773 C
0774 C
0775 C
0776 C
0777 C
0778 C
0779 C
0780 C
0781 C
0782 C
0783 C
0784 C
0785 C
0786 C
0787 C
0788 C
0789 C
0790 C
0791 C
0792 C
0793 C
0794 C
0795 C
0796 C
0797 C
0798 C
0799 C
0800 C
0801 C
0802 C
0803 C
0804 C
0805 C
0806 C
0807 C
0808 C
0809 C
0810 C
0811 C
0812 C
0813 C
0814 C
0815 C
0816 C
0817 C
0818 C
0819 C
0820 C
0821 C
0822 C
0823 C
0824 C
0825 C
0826 C
0827 C
0828 C
0829 C
0830 C
0831 C
0832 C
0833 C
0834 C
0835 C
0836 C
0837 C
0838 C
0839 C
0840 C
0841 C
0842 C
0843 C
0844 C
0845 C
0846 C
0847 C
0848 C
0849 C
0850 C
0851 C
0852 C
0853 C
0854 C
0855 C
0856 C
0857 C
0858 C
0859 C
0860 C
0861 C
0862 C
0863 C
0864 C
0865 C
0866 C
0867 C
0868 C
0869 C
0870 C
0871 C
0872 C
0873 C
0874 C
0875 C
0876 C
0877 C
0878 C
0879 C
0880 C
0881 C
0882 C
0883 C
0884 C
0885 C
0886 C
0887 C
0888 C
0889 C
0890 C
0891 C
0892 C
0893 C
0894 C
0895 C
0896 C
0897 C
0898 C
0899 C
0900 C
0901 C
0902 C
0903 C
0904 C
0905 C
0906 C
0907 C
0908 C
0909 C
0910 C
0911 C
0912 C
0913 C
0914 C
0915 C
0916 C
0917 C
0918 C
0919 C
0920 C
0921 C
0922 C
0923 C
0924 C
0925 C
0926 C
0927 C
0928 C
0929 C
0930 C
0931 C
0932 C
0933 C
0934 C
0935 C
0936 C
0937 C
0938 C
0939 C
0940 C
0941 C
0942 C
0943 C
0944 C
0945 C
0946 C
0947 C
0948 C
0949 C
0950 C
0951 C
0952 C
0953 C
0954 C
0955 C
0956 C
0957 C
0958 C
0959 C
0960 C
0961 C
0962 C
0963 C
0964 C
0965 C
0966 C
0967 C
0968 C
0969 C
0970 C
0971 C
0972 C
0973 C
0974 C
0975 C
0976 C
0977 C
0978 C
0979 C
0980 C
0981 C
0982 C
0983 C
0984 C
0985 C
0986 C
0987 C
0988 C
0989 C
0990 C
0991 C
0992 C
0993 C
0994 C
0995 C
0996 C
0997 C
0998 C
0999 C
1000 C

```



```

0068      C
0069      CALL PLTOFS(-2.0,0.4,0.0,1/YLEN,ORX1,ORY)
0070      CALL PLTLOG(2)
0071      CALL PFLINE(N,RS,21,1,1)
0072      CALL PLTRFC
0073      CALL PLTOFS(-2.0,0.4,0.0,1/YLEN,ORX2,ORY)
0074      CALL PLTLOG(2)
0075      CALL PFLINE(N,RP,21,1,1)
0076      CALL PLTRFC
0077      CALL PLTOFS(-2.0,0.0,0.0,1/YLEN,ORX3,ORY)
0078      CALL PLTLOG(2)
0079      CALL PFLINE(N,R,21,1,1)
0080      CALL PLTRFC
0081      100 CONTINUE
0082      CALL PLTFND
0083      GO TO 1
0084      999 CONTINUE
0085      END
0086      *OPTIONS IN EFFECT* ID,FRCDIC,SOURCE,NOLIST,NODECK,LOAD,NOMAP
0087      *OPTIONS IN EFFECT* NAME = MAIN, LINECNT = 57
0088      *STATISTICS* SOURCE STATEMENTS = 84, PROGRAM SIZE = 3590
0089      *STATISTICS* NO DIAGNOSTICS GENERATED

```

NO STATEMENTS FLAGGED IN THE ABOVE COMPILATIONS.

```

111.000
112.000
113.000
114.000
115.000
116.000
117.000
118.000
119.000
120.000
121.000
122.000
123.000
124.000
125.000
126.000
127.000
128.000

```

PHI=20.  
K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 0.21648 | 0.40751 | 0.02544 |
| 0.60000   | 0.06593 | 0.09723 | 0.03463 |
| 0.80000   | 0.01270 | 0.01695 | 0.00846 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.11144 | 0.12547 | 0.09742 |
| 4.00000   | 0.35996 | 0.38242 | 0.33749 |
| 6.00000   | 0.50997 | 0.53115 | 0.48878 |
| 8.00000   | 0.60464 | 0.62347 | 0.58581 |
| 10.00000  | 0.66911 | 0.68577 | 0.65244 |
| 20.00000  | 0.81834 | 0.82853 | 0.80815 |
| 40.00000  | 0.90466 | 0.91029 | 0.89903 |
| 60.00000  | 0.93539 | 0.93927 | 0.93151 |
| 80.00000  | 0.95114 | 0.95410 | 0.94818 |
| 100.00000 | 0.96072 | 0.96311 | 0.95833 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99834 | 0.99888 | 0.99780 |
| 0.02000   | 0.99672 | 0.99785 | 0.99560 |
| 0.04000   | 0.99336 | 0.99560 | 0.99113 |
| 0.06000   | 0.98990 | 0.99332 | 0.98649 |
| 0.08000   | 0.98626 | 0.99095 | 0.98158 |
| 0.10000   | 0.98237 | 0.98847 | 0.97627 |
| 0.20000   | 0.95391 | 0.97227 | 0.93555 |
| 0.40000   | 0.21945 | 0.41310 | 0.02579 |
| 0.60000   | 0.06722 | 0.09931 | 0.03512 |
| 0.80000   | 0.01330 | 0.01777 | 0.00883 |
| 1.00000   | 0.00003 | 0.00004 | 0.00002 |
| 2.00000   | 0.10997 | 0.12388 | 0.09606 |
| 4.00000   | 0.35803 | 0.38049 | 0.33558 |
| 6.00000   | 0.50821 | 0.52943 | 0.48699 |
| 8.00000   | 0.60309 | 0.62197 | 0.58422 |
| 10.00000  | 0.66774 | 0.68446 | 0.65103 |
| 20.00000  | 0.81751 | 0.82774 | 0.80728 |
| 40.00000  | 0.90420 | 0.90986 | 0.89855 |
| 60.00000  | 0.93507 | 0.93897 | 0.93117 |
| 80.00000  | 0.95090 | 0.95387 | 0.94792 |
| 100.00000 | 0.96052 | 0.96293 | 0.95812 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99342 | 0.99561 | 0.99124 |
| 0.02000 | 0.98687 | 0.99123 | 0.98251 |
| 0.04000 | 0.97372 | 0.98244 | 0.96500 |
| 0.06000 | 0.96031 | 0.97350 | 0.94712 |
| 0.08000 | 0.94642 | 0.96432 | 0.92853 |
| 0.10000 | 0.93179 | 0.95477 | 0.90992 |
| 0.20000 | 0.83344 | 0.89502 | 0.77187 |
| 0.40000 | 0.22866 | 0.41194 | 0.04538 |
| 0.60000 | 0.07126 | 0.10550 | 0.03702 |
| 0.80000 | 0.01549 | 0.02076 | 0.01022 |
| 1.00000 | 0.00053 | 0.00067 | 0.00039 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 2.00000   | 0.10569 | 0.11927 | 0.09212 |
| 4.00000   | 0.35219 | 0.37462 | 0.32976 |
| 6.00000   | 0.50283 | 0.52415 | 0.48151 |
| 8.00000   | 0.59835 | 0.61736 | 0.57933 |
| 10.00000  | 0.66356 | 0.68043 | 0.64669 |
| 20.00000  | 0.81496 | 0.82532 | 0.80461 |
| 40.00000  | 0.90279 | 0.90853 | 0.89776 |
| 60.00000  | 0.93410 | 0.93806 | 0.93015 |
| 80.00000  | 0.95016 | 0.95318 | 0.94714 |
| 100.00000 | 0.95992 | 0.96236 | 0.95748 |

K = 0.4

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.97403 | 0.98257 | 0.96543 |
| 0.02000   | 0.94868 | 0.96540 | 0.93196 |
| 0.04000   | 0.89980 | 0.93173 | 0.86787 |
| 0.06000   | 0.85282 | 0.89873 | 0.80691 |
| 0.08000   | 0.80729 | 0.86615 | 0.74843 |
| 0.10000   | 0.76286 | 0.83378 | 0.69195 |
| 0.20000   | 0.55061 | 0.66909 | 0.43213 |
| 0.40000   | 0.22576 | 0.37094 | 0.12058 |
| 0.60000   | 0.08831 | 0.12534 | 0.05129 |
| 0.80000   | 0.02999 | 0.03992 | 0.02006 |
| 1.00000   | 0.00922 | 0.01169 | 0.00674 |
| 2.00000   | 0.00141 | 0.10381 | 0.07901 |
| 4.00000   | 0.32785 | 0.35011 | 0.30559 |
| 6.00000   | 0.47958 | 0.50129 | 0.45787 |
| 8.00000   | 0.57753 | 0.59714 | 0.55792 |
| 10.00000  | 0.64505 | 0.66257 | 0.62753 |
| 20.00000  | 0.80353 | 0.81445 | 0.79262 |
| 40.00000  | 0.89644 | 0.90253 | 0.89035 |
| 60.00000  | 0.92972 | 0.93392 | 0.92551 |
| 80.00000  | 0.94681 | 0.95002 | 0.94359 |
| 100.00000 | 0.95722 | 0.95982 | 0.95462 |

K = 0.6

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.94260 | 0.96122 | 0.92398 |
| 0.02000   | 0.88901 | 0.92399 | 0.85403 |
| 0.04000   | 0.79274 | 0.85411 | 0.73137 |
| 0.06000   | 0.70986 | 0.79016 | 0.62956 |
| 0.08000   | 0.63876 | 0.73180 | 0.54572 |
| 0.10000   | 0.57780 | 0.67866 | 0.47694 |
| 0.20000   | 0.37600 | 0.47612 | 0.27589 |
| 0.40000   | 0.19568 | 0.25500 | 0.13636 |
| 0.60000   | 0.11220 | 0.14419 | 0.08022 |
| 0.80000   | 0.06818 | 0.08576 | 0.05060 |
| 1.00000   | 0.04683 | 0.05765 | 0.03601 |
| 2.00000   | 0.08607 | 0.09828 | 0.07386 |
| 4.00000   | 0.28604 | 0.30775 | 0.26473 |
| 6.00000   | 0.43407 | 0.45634 | 0.41181 |
| 8.00000   | 0.53479 | 0.55546 | 0.51411 |
| 10.00000  | 0.60610 | 0.62488 | 0.58731 |
| 20.00000  | 0.77850 | 0.79060 | 0.76639 |
| 40.00000  | 0.88231 | 0.88917 | 0.87544 |
| 60.00000  | 0.91991 | 0.92468 | 0.91514 |
| 80.00000  | 0.93931 | 0.94296 | 0.93565 |
| 100.00000 | 0.95114 | 0.95410 | 0.94818 |

K = 0.8

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.90071 | 0.93218 | 0.86923 |
| 0.02000 | 0.81372 | 0.86954 | 0.75789 |

|         |         |         |         |
|---------|---------|---------|---------|
| 0.04000 | 0.67359 | 0.75983 | 0.59735 |
| 0.06000 | 0.57045 | 0.66950 | 0.47141 |
| 0.08000 | 0.49413 | 0.59572 | 0.39253 |
| 0.10000 | 0.43645 | 0.53535 | 0.33755 |
| 0.20000 | 0.28272 | 0.35384 | 0.21161 |
| 0.40000 | 0.17829 | 0.21822 | 0.13837 |
| 0.60000 | 0.14084 | 0.16979 | 0.11288 |
| 0.80000 | 0.12506 | 0.14758 | 0.10255 |
| 1.00000 | 0.11922 | 0.13902 | 0.09943 |
| 2.00000 | 0.14245 | 0.16020 | 0.12470 |
| 4.00000 | 0.25327 | 0.27454 | 0.23200 |

0.04300  
0.06300  
0.08000  
0.10300  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.67359  
0.57045  
0.49413  
0.43645  
0.28272  
0.17829  
0.14084  
0.12506  
0.11922  
0.14245  
0.25327  
0.36419  
0.45462  
0.52563  
0.71847  
0.84659  
0.89477  
0.91995  
0.93542

0.75983  
0.66950  
0.59572  
0.53535  
0.35384  
0.21822  
0.16879  
0.14758  
0.13902  
0.16020  
0.27454  
0.38676  
0.47670  
0.54651  
0.73321  
0.85535  
0.90095  
0.92472  
0.93930

0.58735  
0.47141  
0.39253  
0.33755  
0.21161  
0.13837  
0.11288  
0.10255  
0.09943  
0.12470  
0.23200  
0.34162  
0.43254  
0.50475  
0.70373  
0.83783  
0.88859  
0.91519  
0.93154

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.85038  
0.73026  
0.56215  
0.45791  
0.38967  
0.34218  
0.23076  
0.17805  
0.17561  
0.18627  
0.20114  
0.27790  
0.38471  
0.45253  
0.50049  
0.53687  
0.64154  
0.72956  
0.77272  
0.79974  
0.81875

PS  
0.89635  
0.80562  
0.66116  
0.55697  
0.48116  
0.42472  
0.28222  
0.20969  
0.20202  
0.21096  
0.22522  
0.30190  
0.40843  
0.47538  
0.52242  
0.55793  
0.65936  
0.74391  
0.78513  
0.81086  
0.82894

PD  
0.80441  
0.65491  
0.46314  
0.35886  
0.29818  
0.25964  
0.17930  
0.14642  
0.14919  
0.16158  
0.17705  
0.25389  
0.36099  
0.42967  
0.47857  
0.51582  
0.62371  
0.71522  
0.76030  
0.78861  
0.80856

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000

R  
0.73465  
0.53232  
0.36642  
0.29098  
0.24943  
0.22439  
0.18912  
0.22194  
0.27287  
0.32273  
0.36904  
0.55254  
0.76468  
0.86492  
0.91501  
0.94239

PS  
0.78507  
0.63245  
0.45320  
0.35968  
0.30547  
0.27193  
0.22006  
0.24799  
0.29850  
0.34820  
0.39419  
0.57401  
0.77776  
0.87283  
0.92010  
0.94588

PD  
0.62423  
0.43219  
0.27964  
0.22228  
0.17340  
0.17686  
0.15818  
0.19588  
0.24723  
0.29725  
0.34389  
0.53108  
0.75161  
0.85701  
0.90991  
0.93889

20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.98434  
0.99600  
0.99821  
0.99899  
0.99936

0.98531  
0.99625  
0.99832  
0.99906  
0.99940

0.98338  
0.99575  
0.99810  
0.99893  
0.99932

K = 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.56268  
0.39129  
0.26405  
0.21659  
0.19582  
0.18739  
0.20520  
0.28747  
0.36261  
0.42693  
0.48268  
0.67975  
0.86025  
0.92690  
0.95609  
0.97097  
0.99241  
0.99808  
0.99914  
0.99952  
0.99969

RS  
0.66153  
0.48258  
0.32506  
0.26180  
0.23287  
0.21988  
0.23119  
0.31270  
0.38752  
0.45108  
0.50579  
0.69655  
0.86840  
0.93130  
0.95876  
0.97275  
0.99288  
0.99820  
0.99920  
0.99955  
0.99971

RP  
0.46384  
0.30000  
0.20304  
0.17137  
0.15877  
0.15490  
0.17921  
0.26224  
0.33770  
0.40278  
0.45958  
0.66294  
0.85210  
0.92250  
0.95341  
0.96919  
0.99194  
0.99796  
0.99909  
0.99949  
0.99967

K = 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.36494  
0.24618  
0.18653  
0.18094  
0.19003  
0.20444  
0.28569  
0.41068  
0.49857  
0.56613  
0.62091  
0.79242  
0.92010  
0.96017  
0.97658  
0.98468  
0.99605  
0.99901  
0.99956  
0.99975  
0.99984

RS  
0.45186  
0.30205  
0.22063  
0.20883  
0.21587  
0.22948  
0.31036  
0.43465  
0.52098  
0.58676  
0.63977  
0.80402  
0.92489  
0.96260  
0.97802  
0.98563  
0.99630  
0.99907  
0.99959  
0.99977  
0.99985

RP  
0.27802  
0.10030  
0.15243  
0.15286  
0.16418  
0.17941  
0.26103  
0.38672  
0.47616  
0.54549  
0.60205  
0.78081  
0.91532  
0.95774  
0.97514  
0.98374  
0.99581  
0.99894  
0.99953  
0.99974  
0.99983

K = 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000

R  
0.26155  
0.19069  
0.18175  
0.20490  
0.23280  
0.26020  
0.37041

RS  
0.32247  
0.22727  
0.20804  
0.22951  
0.25714  
0.28456  
0.39457

RP  
0.20063  
0.15410  
0.15545  
0.18030  
0.20846  
0.23584  
0.34624

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.40000   | 0.50511 | 0.52720 | 0.48302 |
| 0.60000   | 0.59321 | 0.60998 | 0.57045 |
| 0.80000   | 0.65237 | 0.66999 | 0.63476 |
| 1.00000   | 0.70110 | 0.71680 | 0.68541 |
| 2.00000   | 0.84492 | 0.85393 | 0.83601 |
| 4.00000   | 0.94296 | 0.94641 | 0.93951 |
| 6.00000   | 0.97199 | 0.97371 | 0.97028 |
| 8.00000   | 0.98363 | 0.98464 | 0.98262 |
| 10.00000  | 0.98933 | 0.98999 | 0.98867 |
| 20.00000  | 0.99726 | 0.99743 | 0.99739 |
| 40.00000  | 0.99931 | 0.99935 | 0.99927 |
| 60.00000  | 0.99969 | 0.99971 | 0.99967 |
| 80.00000  | 0.99983 | 0.99984 | 0.99982 |
| 100.00000 | 0.99989 | 0.99990 | 0.99988 |

K= 6.0

| N         | R       | RS      | RO      |
|-----------|---------|---------|---------|
| 0.01000   | 0.18333 | 0.21713 | 0.14553 |
| 0.02000   | 0.18359 | 0.20895 | 0.15823 |
| 0.04000   | 0.24108 | 0.26518 | 0.21699 |
| 0.06000   | 0.29550 | 0.31972 | 0.27129 |
| 0.08000   | 0.34065 | 0.36480 | 0.31650 |
| 0.10000   | 0.37931 | 0.40224 | 0.35438 |
| 0.20000   | 0.50304 | 0.52504 | 0.48104 |
| 0.40000   | 0.62957 | 0.64791 | 0.61122 |
| 0.60000   | 0.70184 | 0.71743 | 0.68625 |
| 0.80000   | 0.75202 | 0.76544 | 0.73850 |
| 1.00000   | 0.79006 | 0.80171 | 0.77842 |
| 2.00000   | 0.89619 | 0.90232 | 0.89007 |
| 4.00000   | 0.96318 | 0.96542 | 0.96093 |
| 6.00000   | 0.98212 | 0.98322 | 0.98102 |
| 8.00000   | 0.98960 | 0.99024 | 0.98896 |
| 10.00000  | 0.99324 | 0.99365 | 0.99282 |
| 20.00000  | 0.99827 | 0.99838 | 0.99816 |
| 40.00000  | 0.99957 | 0.99959 | 0.99954 |
| 60.00000  | 0.99981 | 0.99982 | 0.99979 |
| 80.00000  | 0.99989 | 0.99990 | 0.99988 |
| 100.00000 | 0.99993 | 0.99993 | 0.99993 |

K= 8.0

| N         | R       | RS      | RO      |
|-----------|---------|---------|---------|
| 0.01000   | 0.17833 | 0.20434 | 0.15232 |
| 0.02000   | 0.22602 | 0.25002 | 0.20201 |
| 0.04000   | 0.31814 | 0.34228 | 0.29401 |
| 0.06000   | 0.38445 | 0.40826 | 0.36064 |
| 0.08000   | 0.43419 | 0.45741 | 0.41097 |
| 0.10000   | 0.47338 | 0.49594 | 0.45082 |
| 0.20000   | 0.59348 | 0.61298 | 0.57398 |
| 0.40000   | 0.70540 | 0.72081 | 0.68998 |
| 0.60000   | 0.76627 | 0.77902 | 0.75353 |
| 0.80000   | 0.80750 | 0.81828 | 0.79673 |
| 1.00000   | 0.83824 | 0.84746 | 0.82901 |
| 2.00000   | 0.92174 | 0.92641 | 0.91706 |
| 4.00000   | 0.97265 | 0.97433 | 0.97098 |
| 6.00000   | 0.98678 | 0.98760 | 0.98597 |
| 8.00000   | 0.99232 | 0.99280 | 0.99185 |
| 10.00000  | 0.99501 | 0.99532 | 0.99470 |
| 20.00000  | 0.99873 | 0.99881 | 0.99865 |
| 40.00000  | 0.99968 | 0.99970 | 0.99966 |
| 60.00000  | 0.99986 | 0.99987 | 0.99985 |
| 80.00000  | 0.99992 | 0.99992 | 0.99991 |
| 100.00000 | 0.99995 | 0.99995 | 0.99995 |

K = 1.0

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99314 | 0.99543 | 0.99386 |
| 0.02000   | 0.73221 | 0.80716 | 0.65725 |
| 0.04000   | 0.56451 | 0.66338 | 0.46564 |
| 0.06000   | 0.46014 | 0.55935 | 0.36393 |
| 0.08000   | 0.39166 | 0.48348 | 0.29984 |
| 0.10000   | 0.34392 | 0.42687 | 0.26097 |
| 0.20000   | 0.23164 | 0.28344 | 0.17983 |
| 0.40000   | 0.17790 | 0.20965 | 0.14614 |
| 0.60000   | 0.17476 | 0.20119 | 0.14832 |
| 0.80000   | 0.18488 | 0.20954 | 0.16022 |
| 1.00000   | 0.19931 | 0.22334 | 0.17528 |
| 2.00000   | 0.27452 | 0.29845 | 0.25059 |
| 4.00000   | 0.37932 | 0.40304 | 0.35561 |
| 6.00000   | 0.44561 | 0.46853 | 0.42269 |
| 8.00000   | 0.49227 | 0.51433 | 0.47322 |
| 10.00000  | 0.52750 | 0.54875 | 0.50625 |
| 20.00000  | 0.62773 | 0.64601 | 0.60946 |
| 40.00000  | 0.71040 | 0.72553 | 0.69527 |
| 60.00000  | 0.75080 | 0.76419 | 0.73741 |
| 80.00000  | 0.77674 | 0.78894 | 0.76454 |
| 100.00000 | 0.79586 | 0.80715 | 0.78456 |

-9-

I  
I  
I

PHI= 0.

K= 0.0

| N         | R       | PS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.96079 | 0.96079 | 0.96079 |
| 0.02000   | 0.92311 | 0.92311 | 0.92311 |
| 0.04000   | 0.85207 | 0.85207 | 0.85207 |
| 0.06000   | 0.78640 | 0.78640 | 0.78640 |
| 0.08000   | 0.72565 | 0.72565 | 0.72565 |
| 0.10000   | 0.66942 | 0.66942 | 0.66942 |
| 0.20000   | 0.44444 | 0.44444 | 0.44444 |
| 0.40000   | 0.18367 | 0.18367 | 0.18367 |
| 0.60000   | 0.06250 | 0.06250 | 0.06250 |
| 0.80000   | 0.01235 | 0.01235 | 0.01235 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.11111 | 0.11111 | 0.11111 |
| 4.00000   | 0.36000 | 0.36000 | 0.36000 |
| 6.00000   | 0.51020 | 0.51020 | 0.51020 |
| 8.00000   | 0.60494 | 0.60494 | 0.60494 |
| 10.00000  | 0.66942 | 0.66942 | 0.66942 |
| 20.00000  | 0.81859 | 0.81859 | 0.81859 |
| 40.00000  | 0.90482 | 0.90482 | 0.90482 |
| 60.00000  | 0.93550 | 0.93550 | 0.93550 |
| 80.00000  | 0.95123 | 0.95123 | 0.95123 |
| 100.00000 | 0.96079 | 0.96079 | 0.96079 |

K= 0.1

| N         | R       | PS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.96079 | 0.96079 | 0.96079 |
| 0.02000   | 0.92311 | 0.92311 | 0.92311 |
| 0.04000   | 0.85207 | 0.85207 | 0.85207 |
| 0.06000   | 0.78641 | 0.78641 | 0.78641 |
| 0.08000   | 0.72567 | 0.72567 | 0.72567 |
| 0.10000   | 0.66945 | 0.66945 | 0.66945 |
| 0.20000   | 0.44460 | 0.44460 | 0.44460 |
| 0.40000   | 0.18434 | 0.18434 | 0.18434 |
| 0.60000   | 0.06382 | 0.06382 | 0.06382 |
| 0.80000   | 0.01429 | 0.01429 | 0.01429 |
| 1.00000   | 0.00249 | 0.00249 | 0.00249 |
| 2.00000   | 0.11504 | 0.11504 | 0.11504 |
| 4.00000   | 0.36407 | 0.36407 | 0.36407 |
| 6.00000   | 0.51378 | 0.51378 | 0.51378 |
| 8.00000   | 0.60804 | 0.60804 | 0.60804 |
| 10.00000  | 0.67213 | 0.67213 | 0.67213 |
| 20.00000  | 0.82022 | 0.82022 | 0.82022 |
| 40.00000  | 0.90572 | 0.90572 | 0.90572 |
| 60.00000  | 0.93612 | 0.93612 | 0.93612 |
| 80.00000  | 0.95170 | 0.95170 | 0.95170 |
| 100.00000 | 0.96117 | 0.96117 | 0.96117 |

K= 0.2

| N       | R       | PS      | RD      |
|---------|---------|---------|---------|
| 0.01000 | 0.96079 | 0.96079 | 0.96079 |
| 0.02000 | 0.92311 | 0.92311 | 0.92311 |
| 0.04000 | 0.85208 | 0.85208 | 0.85208 |
| 0.06000 | 0.78643 | 0.78643 | 0.78643 |
| 0.08000 | 0.72571 | 0.72571 | 0.72571 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.66953 | 0.66953 | 0.66953 |
| 0.20000   | 0.44506 | 0.44506 | 0.44506 |
| 0.40000   | 0.18633 | 0.18633 | 0.18633 |
| 0.60000   | 0.06774 | 0.06774 | 0.06774 |
| 0.80000   | 0.02009 | 0.02009 | 0.02009 |
| 1.00000   | 0.00990 | 0.00990 | 0.00990 |
| 2.00000   | 0.12664 | 0.12664 | 0.12664 |
| 4.00000   | 0.37598 | 0.37598 | 0.37598 |
| 6.00000   | 0.52419 | 0.52419 | 0.52419 |
| 8.00000   | 0.61704 | 0.61704 | 0.61704 |
| 10.00000  | 0.68000 | 0.68000 | 0.68000 |
| 20.00000  | 0.82495 | 0.82495 | 0.82495 |
| 40.00000  | 0.90831 | 0.90831 | 0.90831 |
| 60.00000  | 0.93790 | 0.93790 | 0.93790 |
| 80.00000  | 0.95306 | 0.95306 | 0.95306 |
| 100.00000 | 0.96227 | 0.96227 | 0.96227 |

K= 0.4

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.96079 | 0.96079 | 0.96079 |
| 0.02000   | 0.92311 | 0.92311 | 0.92311 |
| 0.04000   | 0.85211 | 0.85211 | 0.85211 |
| 0.06000   | 0.78651 | 0.78651 | 0.78651 |
| 0.08000   | 0.72589 | 0.72589 | 0.72589 |
| 0.10000   | 0.66986 | 0.66986 | 0.66986 |
| 0.20000   | 0.44690 | 0.44690 | 0.44690 |
| 0.40000   | 0.19420 | 0.19420 | 0.19420 |
| 0.60000   | 0.08313 | 0.08313 | 0.08313 |
| 0.80000   | 0.04260 | 0.04260 | 0.04260 |
| 1.00000   | 0.03846 | 0.03846 | 0.03846 |
| 2.00000   | 0.17012 | 0.17012 | 0.17012 |
| 4.00000   | 0.41945 | 0.41945 | 0.41945 |
| 6.00000   | 0.56172 | 0.56172 | 0.56172 |
| 8.00000   | 0.64928 | 0.64928 | 0.64928 |
| 10.00000  | 0.70903 | 0.70903 | 0.70903 |
| 20.00000  | 0.84158 | 0.84158 | 0.84158 |
| 40.00000  | 0.91740 | 0.91740 | 0.91740 |
| 60.00000  | 0.94415 | 0.94415 | 0.94415 |
| 80.00000  | 0.95781 | 0.95781 | 0.95781 |
| 100.00000 | 0.96610 | 0.96610 | 0.96610 |

K= 0.6

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.96079 | 0.96079 | 0.96079 |
| 0.02000  | 0.92312 | 0.92312 | 0.92312 |
| 0.04000  | 0.85215 | 0.85215 | 0.85215 |
| 0.06000  | 0.78665 | 0.78665 | 0.78665 |
| 0.08000  | 0.72619 | 0.72619 | 0.72619 |
| 0.10000  | 0.67040 | 0.67040 | 0.67040 |
| 0.20000  | 0.44995 | 0.44995 | 0.44995 |
| 0.40000  | 0.20698 | 0.20698 | 0.20698 |
| 0.60000  | 0.10767 | 0.10767 | 0.10767 |
| 0.80000  | 0.07792 | 0.07792 | 0.07792 |
| 1.00000  | 0.08257 | 0.08257 | 0.08257 |
| 2.00000  | 0.23372 | 0.23372 | 0.23372 |
| 4.00000  | 0.47984 | 0.47984 | 0.47984 |
| 6.00000  | 0.61265 | 0.61265 | 0.61265 |
| 8.00000  | 0.69243 | 0.69243 | 0.69243 |
| 10.00000 | 0.74522 | 0.74522 | 0.74522 |
| 20.00000 | 0.86325 | 0.86325 | 0.86325 |

40.00000  
60.00000  
80.00000  
100.00000

0.92911  
0.95216  
0.96390  
0.97102

0.92911  
0.95216  
0.96390  
0.97102

0.92911  
0.95216  
0.96390  
0.97102

-12-

K= 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.96079  
0.92313  
0.85221  
0.78684  
0.72661  
0.67116  
0.45415  
0.22420  
0.13991  
0.12319  
0.13793  
0.30796  
0.54597  
0.66685  
0.73762  
0.78378  
0.88522  
0.94085  
0.96017  
0.96997  
0.97590

RS  
0.96079  
0.92313  
0.85221  
0.78684  
0.72661  
0.67116  
0.45415  
0.22420  
0.13991  
0.12319  
0.13793  
0.30796  
0.54597  
0.66685  
0.73762  
0.78378  
0.88522  
0.94085  
0.96017  
0.96997  
0.97591

RP  
0.96079  
0.92313  
0.85221  
0.78684  
0.72661  
0.67116  
0.45415  
0.22420  
0.13991  
0.12319  
0.13793  
0.30796  
0.54597  
0.66685  
0.73762  
0.78378  
0.88522  
0.94085  
0.96017  
0.96997  
0.97591

K= 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.96079  
0.92314  
0.85229  
0.78708  
0.72715  
0.67213  
0.45946  
0.24528  
0.17808  
0.17526  
0.20000  
0.38462  
0.60976  
0.71765  
0.77931  
0.81900  
0.90487  
0.95123  
0.96722  
0.97531  
0.98020

RS  
0.96079  
0.92314  
0.85229  
0.78708  
0.72715  
0.67213  
0.45946  
0.24528  
0.17808  
0.17526  
0.20000  
0.38462  
0.60976  
0.71765  
0.77931  
0.81900  
0.90488  
0.95123  
0.96722  
0.97531  
0.98020

RP  
0.96079  
0.92314  
0.85229  
0.78708  
0.72715  
0.67213  
0.45946  
0.24528  
0.17808  
0.17526  
0.20000  
0.38462  
0.60976  
0.71765  
0.77931  
0.81900  
0.90488  
0.95123  
0.96722  
0.97531  
0.98020

K= 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.96080  
0.92317  
0.85256  
0.78793  
0.72900

RS  
0.96080  
0.92317  
0.85256  
0.78793  
0.72900

RP  
0.96080  
0.92317  
0.85256  
0.78793  
0.72900

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.67546 | 0.67546 | 0.67546 |
| 0.20000   | 0.47712 | 0.47712 | 0.47712 |
| 0.40000   | 0.31035 | 0.31035 | 0.31035 |
| 0.60000   | 0.28783 | 0.28783 | 0.28783 |
| 0.80000   | 0.31624 | 0.31624 | 0.31624 |
| 1.00000   | 0.36000 | 0.36000 | 0.36000 |
| 2.00000   | 0.55556 | 0.55556 | 0.55556 |
| 4.00000   | 0.73770 | 0.73770 | 0.73770 |
| 6.00000   | 0.81538 | 0.81538 | 0.81538 |
| 8.00000   | 0.85778 | 0.85778 | 0.85778 |
| 10.00000  | 0.88439 | 0.88439 | 0.88439 |
| 20.00000  | 0.94034 | 0.94034 | 0.94034 |
| 40.00000  | 0.96970 | 0.96970 | 0.96970 |
| 60.00000  | 0.97970 | 0.97970 | 0.97970 |
| 80.00000  | 0.98473 | 0.98473 | 0.98473 |
| 100.00000 | 0.98777 | 0.98777 | 0.98777 |

K= 2.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.96080 | 0.96081 | 0.96080 |
| 0.02000   | 0.92323 | 0.92323 | 0.92322 |
| 0.04000   | 0.85294 | 0.85294 | 0.85294 |
| 0.06000   | 0.78910 | 0.78911 | 0.78910 |
| 0.08000   | 0.73154 | 0.73154 | 0.73154 |
| 0.10000   | 0.68000 | 0.68000 | 0.68000 |
| 0.20000   | 0.50000 | 0.50000 | 0.50000 |
| 0.40000   | 0.38462 | 0.38462 | 0.38462 |
| 0.60000   | 0.40000 | 0.40000 | 0.40000 |
| 0.80000   | 0.44828 | 0.44828 | 0.44828 |
| 1.00000   | 0.50000 | 0.50000 | 0.50000 |
| 2.00000   | 0.68000 | 0.68000 | 0.68000 |
| 4.00000   | 0.82022 | 0.82022 | 0.82022 |
| 6.00000   | 0.87565 | 0.87565 | 0.87565 |
| 8.00000   | 0.90504 | 0.90504 | 0.90504 |
| 10.00000  | 0.92322 | 0.92322 | 0.92322 |
| 20.00000  | 0.96080 | 0.96080 | 0.96080 |
| 40.00000  | 0.98020 | 0.98020 | 0.98020 |
| 60.00000  | 0.98676 | 0.98676 | 0.98676 |
| 80.00000  | 0.99005 | 0.99005 | 0.99005 |
| 100.00000 | 0.99203 | 0.99203 | 0.99203 |

K= 3.0

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.96082 | 0.96083 | 0.96082 |
| 0.02000  | 0.92337 | 0.92337 | 0.92337 |
| 0.04000  | 0.85401 | 0.85402 | 0.85401 |
| 0.06000  | 0.79239 | 0.79239 | 0.79239 |
| 0.08000  | 0.73856 | 0.73856 | 0.73856 |
| 0.10000  | 0.69231 | 0.69231 | 0.69231 |
| 0.20000  | 0.55556 | 0.55556 | 0.55556 |
| 0.40000  | 0.52941 | 0.52941 | 0.52941 |
| 0.60000  | 0.58621 | 0.58621 | 0.58621 |
| 0.80000  | 0.64444 | 0.64444 | 0.64444 |
| 1.00000  | 0.69231 | 0.69231 | 0.69231 |
| 2.00000  | 0.82222 | 0.82222 | 0.82222 |
| 4.00000  | 0.90533 | 0.90533 | 0.90533 |
| 6.00000  | 0.93566 | 0.93566 | 0.93566 |
| 8.00000  | 0.95129 | 0.95129 | 0.95129 |
| 10.00000 | 0.96082 | 0.96082 | 0.96082 |
| 20.00000 | 0.98020 | 0.98020 | 0.98020 |

40.00000  
60.00000  
80.00000  
100.00000

0.99005  
0.99336  
0.99501  
0.99601

0.99005  
0.99336  
0.99501  
0.99601

0.99005  
0.99336  
0.99501  
0.99601

-14-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

F  
0.96085  
0.92358  
0.85549  
0.79682  
0.74779  
0.70803  
0.61539  
0.64602  
0.71154  
0.76261  
0.80000  
0.89041  
0.94306  
0.96160  
0.97104  
0.97676  
0.98831  
0.99413  
0.99609  
0.99706  
0.99765

PS  
0.96085  
0.92358  
0.85549  
0.79682  
0.74779  
0.70803  
0.61538  
0.64602  
0.71154  
0.76261  
0.80000  
0.89041  
0.94306  
0.96160  
0.97104  
0.97676  
0.98831  
0.99414  
0.99609  
0.99706  
0.99765

RP  
0.96085  
0.92358  
0.85549  
0.79682  
0.74779  
0.70803  
0.61539  
0.64602  
0.71154  
0.76261  
0.80000  
0.89041  
0.94306  
0.96160  
0.97104  
0.97676  
0.98831  
0.99414  
0.99609  
0.99706  
0.99765

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

F  
0.96093  
0.92416  
0.85955  
0.80849  
0.77091  
0.74522  
0.72222  
0.79275  
0.84576  
0.87823  
0.90000  
0.94771  
0.97338  
0.98216  
0.98658  
0.98925  
0.99461  
0.99730  
0.99820  
0.99865  
0.99892

FS  
0.96093  
0.92416  
0.85955  
0.80849  
0.77091  
0.74522  
0.72222  
0.79275  
0.84576  
0.87823  
0.90000  
0.94771  
0.97338  
0.98216  
0.98658  
0.98925  
0.99461  
0.99730  
0.99820  
0.99865  
0.99892

RP  
0.96093  
0.92416  
0.85955  
0.80849  
0.77090  
0.74522  
0.72222  
0.79275  
0.84576  
0.87823  
0.90000  
0.94771  
0.97338  
0.98216  
0.98658  
0.98925  
0.99461  
0.99730  
0.99820  
0.99865  
0.99892

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.96103  
0.92495  
0.86486  
0.82275  
0.79695

RS  
0.96104  
0.92495  
0.86486  
0.82275  
0.79696

RP  
0.96103  
0.92495  
0.86486  
0.82275  
0.79695

I  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.78378  
0.80000  
0.86885  
0.90625  
0.92760  
0.94118  
0.96981  
0.98475  
0.98980  
0.99234  
0.99387  
0.99693  
0.99846  
0.99897  
0.99923  
0.99938

0.78378  
0.80000  
0.86885  
0.90625  
0.92760  
0.94118  
0.96981  
0.98475  
0.98980  
0.99234  
0.99387  
0.99693  
0.99846  
0.99897  
0.99923  
0.99938

0.78378  
0.80000  
0.86885  
0.90625  
0.92760  
0.94118  
0.96981  
0.98475  
0.98980  
0.99234  
0.99387  
0.99693  
0.99846  
0.99897  
0.99923  
0.99938

K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 0.42685 | 0.66737 | 0.18633 |
| 0.40000   | 0.18440 | 0.21551 | 0.15329 |
| 0.60000   | 0.06265 | 0.06932 | 0.05599 |
| 0.80000   | 0.01236 | 0.01333 | 0.01140 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.11113 | 0.11455 | 0.10772 |
| 4.00000   | 0.36000 | 0.36551 | 0.35448 |
| 6.00000   | 0.51019 | 0.51540 | 0.50498 |
| 8.00000   | 0.60492 | 0.60955 | 0.60029 |
| 10.00000  | 0.66940 | 0.67350 | 0.66530 |
| 20.00000  | 0.81858 | 0.82108 | 0.81607 |
| 40.00000  | 0.90481 | 0.90619 | 0.90342 |
| 60.00000  | 0.93549 | 0.93645 | 0.93454 |
| 80.00000  | 0.95122 | 0.95195 | 0.95049 |
| 100.00000 | 0.96078 | 0.96137 | 0.96020 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99969 | 0.99983 | 0.99954 |
| 0.02000   | 0.99864 | 0.99912 | 0.99816 |
| 0.04000   | 0.99432 | 0.99629 | 0.99237 |
| 0.06000   | 0.98647 | 0.99131 | 0.98162 |
| 0.08000   | 0.97373 | 0.98370 | 0.96376 |
| 0.10000   | 0.95322 | 0.97247 | 0.93398 |
| 0.20000   | 0.44151 | 0.65361 | 0.22941 |
| 0.40000   | 0.18512 | 0.21585 | 0.15439 |
| 0.60000   | 0.06398 | 0.07069 | 0.05726 |
| 0.80000   | 0.01431 | 0.01542 | 0.01321 |
| 1.00000   | 0.00250 | 0.00265 | 0.00234 |
| 2.00000   | 0.11506 | 0.11856 | 0.11156 |
| 4.00000   | 0.36407 | 0.36959 | 0.35854 |
| 6.00000   | 0.51376 | 0.51895 | 0.50857 |
| 8.00000   | 0.60802 | 0.61263 | 0.60341 |
| 10.00000  | 0.67211 | 0.67619 | 0.66804 |
| 20.00000  | 0.82021 | 0.82270 | 0.81772 |
| 40.00000  | 0.90571 | 0.90708 | 0.90433 |
| 60.00000  | 0.93611 | 0.93706 | 0.93517 |
| 80.00000  | 0.95169 | 0.95241 | 0.95097 |
| 100.00000 | 0.96116 | 0.96175 | 0.96058 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99934 | 0.99958 | 0.99909 |
| 0.02000 | 0.99726 | 0.99819 | 0.99633 |
| 0.04000 | 0.98869 | 0.99257 | 0.98492 |
| 0.06000 | 0.97325 | 0.98274 | 0.96377 |
| 0.08000 | 0.94873 | 0.96784 | 0.92962 |

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.91087  
0.45834  
0.18725  
0.06792  
0.02012  
0.00991  
0.12666  
0.37597  
0.52417  
0.61702  
0.67998  
0.82493  
0.90830  
0.93790  
0.95305  
0.96226

0.94628  
0.62812  
0.21693  
0.07480  
0.02163  
0.01050  
0.13040  
0.38151  
0.52932  
0.62157  
0.68399  
0.82736  
0.90964  
0.93882  
0.95375  
0.96283

0.87547  
0.28855  
0.15758  
0.06103  
0.01861  
0.00932  
0.12292  
0.37043  
0.51903  
0.61248  
0.67598  
0.82250  
0.90696  
0.93698  
0.95235  
0.96170

K = 0.4

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

P  
0.99864  
0.99452  
0.97766  
0.94813  
0.90382  
0.84237  
0.46868  
0.19541  
0.08335  
0.04266  
0.03849  
0.17015  
0.41944  
0.56171  
0.64926  
0.70801  
0.84157  
0.91739  
0.94414  
0.95781  
0.96610

PS  
0.99910  
0.99636  
0.98524  
0.96610  
0.93795  
0.89946  
0.58433  
0.22186  
0.09078  
0.04550  
0.04054  
0.17464  
0.42498  
0.56665  
0.65354  
0.71175  
0.84379  
0.91860  
0.94497  
0.95844  
0.96661

PD  
0.99818  
0.99269  
0.97008  
0.93017  
0.86969  
0.78529  
0.35302  
0.16896  
0.07592  
0.03983  
0.03645  
0.16565  
0.41390  
0.55676  
0.64497  
0.70427  
0.83935  
0.91618  
0.94731  
0.95718  
0.96559

K = 0.6

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

P  
0.99796  
0.99181  
0.96703  
0.92522  
0.86667  
0.79418  
0.46905  
0.20827  
0.10793  
0.07801  
0.08263  
0.23374  
0.47983  
0.61264  
0.69241  
0.74520  
0.86323

PS  
0.99865  
0.99455  
0.97809  
0.95033  
0.91113  
0.86093  
0.55537  
0.23132  
0.11599  
0.08239  
0.08634  
0.23900  
0.48523  
0.61723  
0.69630  
0.74856  
0.86518

PD  
0.99728  
0.98908  
0.95598  
0.90011  
0.82222  
0.72744  
0.38270  
0.18522  
0.09987  
0.07363  
0.07801  
0.22848  
0.47443  
0.60804  
0.68851  
0.74195  
0.86129

40.00000  
60.00000  
80.00000  
100.00000

0.92910  
0.95216  
0.96390  
0.97101

0.93015  
0.95287  
0.96444  
0.97145

0.92806  
0.95144  
0.96336  
0.97058

-18-

K= 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99728  
0.98914  
0.95689  
0.90485  
0.83714  
0.76131  
0.46906  
0.22539  
0.14018  
0.12331  
0.13800  
0.30797  
0.54596  
0.66683  
0.73760  
0.78377  
0.88521  
0.94084  
0.96016  
0.96997  
0.97590

RS  
0.99819  
0.99275  
0.97112  
0.93564  
0.88770  
0.83015  
0.53711  
0.24555  
0.14875  
0.12901  
0.14312  
0.31371  
0.55105  
0.67098  
0.74104  
0.78669  
0.88686  
0.94172  
0.96076  
0.97042  
0.97627

RP  
0.99637  
0.98552  
0.94266  
0.87406  
0.78657  
0.69248  
0.40102  
0.20523  
0.13160  
0.11760  
0.13288  
0.30223  
0.54086  
0.66268  
0.73416  
0.78084  
0.88356  
0.93997  
0.95956  
0.96952  
0.97554

K= 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99661  
0.98650  
0.94733  
0.88711  
0.81421  
0.73894  
0.47071  
0.24629  
0.17834  
0.17537  
0.20007  
0.38462  
0.60974  
0.71763  
0.77929  
0.81899  
0.90487  
0.95123  
0.96721  
0.97531  
0.98020

RS  
0.99775  
0.99097  
0.96441  
0.92213  
0.86761  
0.80587  
0.52619  
0.26415  
0.18723  
0.18200  
0.20615  
0.39050  
0.61440  
0.72129  
0.78228  
0.82150  
0.90625  
0.95196  
0.96771  
0.97568  
0.98050

RP  
0.99547  
0.98202  
0.93026  
0.85209  
0.76081  
0.67200  
0.41524  
0.22844  
0.16945  
0.16875  
0.19399  
0.37874  
0.60507  
0.71397  
0.77631  
0.81648  
0.90348  
0.95050  
0.96672  
0.97493  
0.97990

K= 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

P  
0.99493  
0.98010  
0.92625  
0.85347  
0.77794

RS  
0.99662  
0.98660  
0.94889  
0.89372  
0.83005

RP  
0.99325  
0.97359  
0.90362  
0.81323  
0.72584

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.70920 | 0.76557 | 0.65284 |
| 0.20000   | 0.48260 | 0.51905 | 0.44616 |
| 0.40000   | 0.31093 | 0.32481 | 0.29705 |
| 0.60000   | 0.28801 | 0.29694 | 0.27917 |
| 0.80000   | 0.31632 | 0.32367 | 0.30897 |
| 1.00000   | 0.36004 | 0.36677 | 0.35331 |
| 2.00000   | 0.55555 | 0.56077 | 0.55032 |
| 4.00000   | 0.73769 | 0.74116 | 0.73421 |
| 6.00000   | 0.81537 | 0.81793 | 0.81281 |
| 8.00000   | 0.85776 | 0.85978 | 0.85574 |
| 10.00000  | 0.88438 | 0.88605 | 0.88272 |
| 20.00000  | 0.94034 | 0.94122 | 0.93945 |
| 40.00000  | 0.96970 | 0.97016 | 0.96924 |
| 60.00000  | 0.97969 | 0.98000 | 0.97939 |
| 80.00000  | 0.98473 | 0.98496 | 0.98450 |
| 100.00000 | 0.98777 | 0.98795 | 0.98758 |

K= 2.0

| N         | P       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99328 | 0.99550 | 0.99106 |
| 0.02000   | 0.97405 | 0.98239 | 0.96572 |
| 0.04000   | 0.90935 | 0.93537 | 0.88332 |
| 0.06000   | 0.83213 | 0.87241 | 0.79185 |
| 0.08000   | 0.76015 | 0.80616 | 0.71414 |
| 0.10000   | 0.69837 | 0.74380 | 0.65294 |
| 0.20000   | 0.50280 | 0.52880 | 0.47679 |
| 0.40000   | 0.38494 | 0.39623 | 0.37364 |
| 0.60000   | 0.40010 | 0.40811 | 0.39208 |
| 0.80000   | 0.44831 | 0.45510 | 0.44152 |
| 1.00000   | 0.50001 | 0.50609 | 0.49393 |
| 2.00000   | 0.67998 | 0.68414 | 0.67583 |
| 4.00000   | 0.82021 | 0.82272 | 0.81770 |
| 6.00000   | 0.87564 | 0.87742 | 0.87385 |
| 8.00000   | 0.90504 | 0.90642 | 0.90365 |
| 10.00000  | 0.92322 | 0.92435 | 0.92209 |
| 20.00000  | 0.96080 | 0.96139 | 0.96021 |
| 40.00000  | 0.98020 | 0.98050 | 0.97990 |
| 60.00000  | 0.98675 | 0.98696 | 0.98655 |
| 80.00000  | 0.99005 | 0.99020 | 0.98990 |
| 100.00000 | 0.99203 | 0.99215 | 0.99191 |

K= 3.0

| N        | P       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.99007 | 0.99331 | 0.98683 |
| 0.02000  | 0.96328 | 0.97455 | 0.95201 |
| 0.04000  | 0.88659 | 0.91439 | 0.85879 |
| 0.06000  | 0.81173 | 0.84588 | 0.77759 |
| 0.08000  | 0.74953 | 0.78266 | 0.71641 |
| 0.10000  | 0.69873 | 0.72833 | 0.66914 |
| 0.20000  | 0.55644 | 0.57188 | 0.54099 |
| 0.40000  | 0.52951 | 0.53742 | 0.52160 |
| 0.60000  | 0.58622 | 0.59214 | 0.58031 |
| 0.80000  | 0.64444 | 0.64934 | 0.63954 |
| 1.00000  | 0.69230 | 0.69652 | 0.68807 |
| 2.00000  | 0.82221 | 0.82472 | 0.81969 |
| 4.00000  | 0.90532 | 0.90670 | 0.90393 |
| 6.00000  | 0.93565 | 0.93660 | 0.93469 |
| 8.00000  | 0.95129 | 0.95202 | 0.95056 |
| 10.00000 | 0.96082 | 0.96141 | 0.96023 |
| 20.00000 | 0.98020 | 0.98050 | 0.97990 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 40.00000  | 0.99005 | 0.99020 | 0.98990 |
| 60.00000  | 0.99335 | 0.99346 | 0.99325 |
| 80.00000  | 0.99501 | 0.99509 | 0.99494 |
| 100.00000 | 0.99601 | 0.99607 | 0.99595 |

K = 4.0

| N         | R       | FS      | SP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.98703 | 0.98120 | 0.98296 |
| 0.02000   | 0.95442 | 0.96762 | 0.94123 |
| 0.04000   | 0.87446 | 0.90031 | 0.84861 |
| 0.06000   | 0.80620 | 0.83309 | 0.77932 |
| 0.08000   | 0.75261 | 0.77638 | 0.72884 |
| 0.10000   | 0.71070 | 0.73094 | 0.69046 |
| 0.20000   | 0.61572 | 0.62615 | 0.60530 |
| 0.40000   | 0.64604 | 0.65177 | 0.64032 |
| 0.60000   | 0.71153 | 0.71578 | 0.70729 |
| 0.80000   | 0.76260 | 0.76602 | 0.75918 |
| 1.00000   | 0.79999 | 0.80286 | 0.79711 |
| 2.00000   | 0.89040 | 0.89200 | 0.88880 |
| 4.00000   | 0.94305 | 0.94390 | 0.94220 |
| 6.00000   | 0.96160 | 0.96217 | 0.96102 |
| 8.00000   | 0.97104 | 0.97147 | 0.97060 |
| 10.00000  | 0.97675 | 0.97711 | 0.97640 |
| 20.00000  | 0.98830 | 0.98848 | 0.98813 |
| 40.00000  | 0.99413 | 0.99422 | 0.99404 |
| 60.00000  | 0.99609 | 0.99615 | 0.99603 |
| 80.00000  | 0.99706 | 0.99711 | 0.99702 |
| 100.00000 | 0.99765 | 0.99769 | 0.99761 |

K = 6.0

| N         | R       | FS      | SP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.98157 | 0.98725 | 0.97589 |
| 0.02000   | 0.94216 | 0.95667 | 0.92765 |
| 0.04000   | 0.86655 | 0.88588 | 0.84721 |
| 0.06000   | 0.81125 | 0.82776 | 0.79474 |
| 0.08000   | 0.77217 | 0.78554 | 0.75890 |
| 0.10000   | 0.74588 | 0.75697 | 0.73489 |
| 0.20000   | 0.72229 | 0.72809 | 0.71549 |
| 0.40000   | 0.79274 | 0.79600 | 0.78948 |
| 0.60000   | 0.84535 | 0.84767 | 0.84303 |
| 0.80000   | 0.87822 | 0.88004 | 0.87641 |
| 1.00000   | 0.89999 | 0.90148 | 0.89850 |
| 2.00000   | 0.94771 | 0.94849 | 0.94692 |
| 4.00000   | 0.97337 | 0.97378 | 0.97297 |
| 6.00000   | 0.98215 | 0.98242 | 0.98188 |
| 8.00000   | 0.98658 | 0.98679 | 0.98638 |
| 10.00000  | 0.98925 | 0.98941 | 0.98909 |
| 20.00000  | 0.99461 | 0.99469 | 0.99453 |
| 40.00000  | 0.99730 | 0.99734 | 0.99726 |
| 60.00000  | 0.99820 | 0.99823 | 0.99817 |
| 80.00000  | 0.99865 | 0.99867 | 0.99863 |
| 100.00000 | 0.99892 | 0.99894 | 0.99890 |

K = 8.0

| N       | R       | FS      | SP      |
|---------|---------|---------|---------|
| 0.01000 | 0.97704 | 0.98374 | 0.97074 |
| 0.02000 | 0.93544 | 0.94917 | 0.92171 |
| 0.04000 | 0.86781 | 0.88174 | 0.85399 |
| 0.06000 | 0.82377 | 0.83455 | 0.81299 |
| 0.08000 | 0.79739 | 0.80585 | 0.78894 |

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.78400  
0.80001  
0.86884  
0.90624  
0.92759  
0.94117  
0.96981  
0.98475  
0.98980  
0.99234  
0.99387  
0.99693  
0.99846  
0.99897  
0.99923  
0.99938

0.79090  
0.80372  
0.87088  
0.90766  
0.92869  
0.94206  
0.97026  
0.98498  
0.98995  
0.99246  
0.99396  
0.99697  
0.99849  
0.99899  
0.99924  
0.99939

0.77710 -21-  
0.79631  
0.86681  
0.90482  
0.92650  
0.94028  
0.96935  
0.98451  
0.98964  
0.99222  
0.99377  
0.99688  
0.99844  
0.99896  
0.99922  
0.99938

PHI=20.

-22-

K= 0.0

| N         | P       | PS      | PD      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 0.21648 | 0.40751 | 0.02544 |
| 0.60000   | 0.06593 | 0.09723 | 0.03463 |
| 0.80000   | 0.01270 | 0.01695 | 0.00846 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.11144 | 0.12547 | 0.09742 |
| 4.00000   | 0.35996 | 0.38242 | 0.33749 |
| 6.00000   | 0.50997 | 0.53115 | 0.48878 |
| 8.00000   | 0.60464 | 0.62347 | 0.58581 |
| 10.00000  | 0.66911 | 0.68577 | 0.65244 |
| 20.00000  | 0.81834 | 0.82853 | 0.80815 |
| 40.00000  | 0.90466 | 0.91029 | 0.89903 |
| 60.00000  | 0.93539 | 0.93927 | 0.93151 |
| 80.00000  | 0.95114 | 0.95410 | 0.94818 |
| 100.00000 | 0.96072 | 0.96311 | 0.95833 |

K= 0.1

| N         | P       | PS      | PD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99999 | 1.00000 | 0.99978 |
| 0.02000   | 0.99956 | 1.00000 | 0.99912 |
| 0.04000   | 0.99736 | 0.99828 | 0.99644 |
| 0.06000   | 0.99393 | 0.99509 | 0.99187 |
| 0.08000   | 0.98900 | 0.99275 | 0.98524 |
| 0.10000   | 0.98237 | 0.98847 | 0.97627 |
| 0.20000   | 0.91046 | 0.94536 | 0.87557 |
| 0.40000   | 0.21936 | 0.39368 | 0.04505 |
| 0.60000   | 0.06733 | 0.09857 | 0.03610 |
| 0.80000   | 0.01470 | 0.01954 | 0.00986 |
| 1.00000   | 0.00254 | 0.00319 | 0.00189 |
| 2.00000   | 0.11538 | 0.12975 | 0.10101 |
| 4.00000   | 0.36402 | 0.38651 | 0.34153 |
| 6.00000   | 0.51354 | 0.53466 | 0.49241 |
| 8.00000   | 0.60773 | 0.62647 | 0.58899 |
| 10.00000  | 0.67181 | 0.68838 | 0.65525 |
| 20.00000  | 0.81997 | 0.83008 | 0.80986 |
| 40.00000  | 0.90556 | 0.91114 | 0.89908 |
| 60.00000  | 0.93601 | 0.93985 | 0.93216 |
| 80.00000  | 0.95161 | 0.95454 | 0.94868 |
| 100.00000 | 0.96110 | 0.96347 | 0.95873 |

K= 0.2

| N       | P       | PS      | PD      |
|---------|---------|---------|---------|
| 0.01000 | 0.99978 | 1.00000 | 0.99956 |
| 0.02000 | 0.99879 | 0.99935 | 0.99824 |
| 0.04000 | 0.99470 | 0.99651 | 0.99290 |
| 0.06000 | 0.98790 | 0.99198 | 0.98383 |
| 0.08000 | 0.97816 | 0.98556 | 0.97075 |

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.96518  
0.83344  
0.22262  
0.07149  
0.02065  
0.01007  
0.12699  
0.37591  
0.52394  
0.61674  
0.67968  
0.82470  
0.90816  
0.93780  
0.95297  
0.96220

0.97711  
0.89502  
0.36853  
0.10261  
0.02716  
0.01256  
0.14231  
0.39846  
0.54486  
0.63520  
0.69596  
0.83457  
0.91359  
0.94154  
0.95583  
0.96450

0.95325  
0.77187  
0.07671  
0.04038  
0.01415  
0.00758  
0.11166  
0.35337  
0.50301  
0.59827  
0.66341  
0.81482  
0.90272  
0.93405  
0.95012  
0.95990

K = 0.4

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99956  
0.99738  
0.98942  
0.97605  
0.95712  
0.93242  
0.71683  
0.22576  
0.08741  
0.04368  
0.03903  
0.17049  
0.41934  
0.56145  
0.64896  
0.70772  
0.84135  
0.91726  
0.94405  
0.95774  
0.96604

RS  
1.00000  
0.99829  
0.99297  
0.98405  
0.97147  
0.95507  
0.80955  
0.33094  
0.11864  
0.05549  
0.04746  
0.18882  
0.44185  
0.58154  
0.66638  
0.72291  
0.85038  
0.92218  
0.94743  
0.96030  
0.96812

RD  
0.99912  
0.99648  
0.98587  
0.96904  
0.94276  
0.90978  
0.62410  
0.12058  
0.05618  
0.03188  
0.03060  
0.15215  
0.39682  
0.54136  
0.63155  
0.69253  
0.83232  
0.91274  
0.94067  
0.95517  
0.96397

K = 0.6

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99902  
0.99607  
0.98420  
0.96451  
0.93709  
0.90219  
0.64085  
0.23192  
0.11220  
0.07951  
0.08353  
0.23404  
0.47967  
0.61236  
0.69211  
0.74492  
0.86304

RS  
0.99935  
0.99741  
0.98946  
0.97627  
0.95781  
0.93413  
0.74426  
0.31472  
0.14419  
0.09716  
0.09855  
0.25538  
0.50160  
0.63103  
0.70795  
0.75856  
0.87094

RD  
0.99868  
0.99473  
0.97894  
0.95775  
0.91638  
0.87026  
0.53744  
0.14913  
0.08022  
0.06186  
0.06850  
0.21270  
0.45773  
0.59368  
0.67628  
0.73129  
0.85514

40.00000  
60.00000  
80.00000  
100.00000

0.92899  
0.95208  
0.96384  
0.97096

0.93324  
0.95498  
0.96604  
0.97274

0.92474  
0.94917  
0.96163  
0.96919

K = 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99880  
0.99475  
0.97906  
0.95335  
0.91826  
0.87481  
0.59252  
0.24361  
0.14433  
0.12506  
0.13908  
0.30818  
0.54573  
0.66655  
0.73732  
0.78350  
0.84504  
0.94075  
0.96009  
0.96992  
0.97586

RS  
0.99935  
0.99651  
0.98599  
0.96865  
0.94470  
0.91451  
0.69606  
0.31312  
0.17729  
0.14758  
0.15953  
0.33140  
0.56641  
0.68340  
0.75130  
0.79540  
0.89176  
0.94432  
0.96252  
0.97176  
0.97734

RP  
0.99824  
0.99298  
0.97213  
0.93805  
0.89182  
0.83510  
0.48899  
0.17410  
0.11138  
0.10255  
0.11864  
0.28496  
0.52506  
0.64969  
0.72373  
0.77161  
0.87832  
0.93718  
0.95766  
0.96808  
0.97438

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99834  
0.99343  
0.97401  
0.94262  
0.90073  
0.85038  
0.56215  
0.26042  
0.18213  
0.17713  
0.20114  
0.38471  
0.60948  
0.71735  
0.77903  
0.81875  
0.90472  
0.95115  
0.96716  
0.97526  
0.98016

RS  
0.99888  
0.99561  
0.98257  
0.96123  
0.93220  
0.89635  
0.66116  
0.32130  
0.21582  
0.20304  
0.22522  
0.40843  
0.62841  
0.73221  
0.79115  
0.82894  
0.91035  
0.95411  
0.96916  
0.97678  
0.98138

RP  
0.99780  
0.99125  
0.96545  
0.92402  
0.86927  
0.80441  
0.46314  
0.19954  
0.14845  
0.15122  
0.17705  
0.36099  
0.59056  
0.70248  
0.76692  
0.80856  
0.89909  
0.94819  
0.96515  
0.97375  
0.97894

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99756  
0.99021  
0.96187  
0.91800  
0.86303

RS  
0.99841  
0.99347  
0.97425  
0.94374  
0.90402

RP  
0.99671  
0.98695  
0.94948  
0.89227  
0.82205

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.80196  
0.52998  
0.31869  
0.29051  
0.31749  
0.36065  
0.55540  
0.73742  
0.81513  
0.85756  
0.88421  
0.94024  
0.96965  
0.97966  
0.98470  
0.98774

0.85768  
0.61293  
0.36695  
0.32396  
0.34618  
0.38728  
0.57648  
0.75151  
0.82553  
0.86577  
0.89098  
0.94384  
0.97150  
0.98091  
0.98565  
0.98850

0.74625  
0.44703  
0.27042  
0.25706  
0.28879  
0.33402  
0.53432  
0.72333  
0.80474  
0.84936  
0.87744  
0.93664  
0.96779  
0.97841  
0.98376  
0.98699

K= 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

P  
0.99674  
0.98702  
0.95051  
0.89680  
0.83398  
0.76940  
0.52959  
0.38933  
0.40150  
0.44886  
0.50019  
0.67975  
0.81998  
0.87545  
0.90489  
0.92309  
0.96073  
0.98016  
0.98673  
0.99003  
0.99202

RS  
0.99785  
0.99129  
0.96630  
0.92797  
0.88052  
0.82841  
0.59803  
0.42992  
0.43227  
0.47557  
0.52439  
0.69655  
0.83017  
0.88271  
0.91052  
0.92769  
0.96312  
0.98138  
0.98755  
0.99065  
0.99251

RD  
0.99562  
0.98275  
0.93473  
0.86564  
0.78743  
0.71038  
0.46116  
0.34874  
0.37073  
0.42215  
0.47599  
0.66294  
0.80979  
0.86820  
0.89926  
0.91850  
0.95834  
0.97894  
0.98591  
0.99041  
0.99152

K= 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

P  
0.99512  
0.98089  
0.93061  
0.86484  
0.79786  
0.73770  
0.56649  
0.53093  
0.58650  
0.64440  
0.69213  
0.82199  
0.90517  
0.93554  
0.95121  
0.96075  
0.98017

RS  
0.99676  
0.98712  
0.95179  
0.90213  
0.84701  
0.79314  
0.61463  
0.56077  
0.60974  
0.66394  
0.70908  
0.83218  
0.91080  
0.93943  
0.95417  
0.96314  
0.98139

RD  
0.99347  
0.97466  
0.90942  
0.82754  
0.74871  
0.69225  
0.51835  
0.50110  
0.56326  
0.62486  
0.67519  
0.81180  
0.89954  
0.93166  
0.94825  
0.95836  
0.97895

40.00000  
60.00000  
80.00000  
100.00000

0.99003  
0.99334  
0.99530  
0.99600

0.99065  
0.99376  
0.99531  
0.99625

0.98941  
0.99293  
0.99469  
0.99575

-26-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

P  
0.99351  
0.97511  
0.91473  
0.84505  
0.78252  
0.73210  
0.62004  
0.64645  
0.71147  
0.76242  
0.79979  
0.89024  
0.94296  
0.96153  
0.97099  
0.97671  
0.98828  
0.99412  
0.99608  
0.99706  
0.99764

PS  
0.99566  
0.98310  
0.93942  
0.88370  
0.82827  
0.77954  
0.65563  
0.66865  
0.72834  
0.77616  
0.81138  
0.89674  
0.94641  
0.96388  
0.97276  
0.97814  
0.98901  
0.99449  
0.99632  
0.99724  
0.99779

PD  
0.99136  
0.96711  
0.89004  
0.80639  
0.73676  
0.68466  
0.58444  
0.62425  
0.69459  
0.74869  
0.78819  
0.88374  
0.93951  
0.95918  
0.96921  
0.97528  
0.98756  
0.99376  
0.99584  
0.99688  
0.99750

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99042  
0.96486  
0.89420  
0.83021  
0.78382  
0.75305  
0.72325  
0.79266  
0.84519  
0.87807  
0.89985  
0.94762  
0.97333  
0.98212  
0.98656  
0.98923  
0.99460  
0.99730  
0.99820  
0.99865  
0.99892

PS  
0.99355  
0.97572  
0.92128  
0.86461  
0.81876  
0.78587  
0.74483  
0.80559  
0.85454  
0.88540  
0.90587  
0.95081  
0.97497  
0.98322  
0.98739  
0.98990  
0.99493  
0.99746  
0.99831  
0.99873  
0.99898

PD  
0.98728  
0.95399  
0.86713  
0.79582  
0.74888  
0.72024  
0.70168  
0.77973  
0.83584  
0.87074  
0.89382  
0.94444  
0.97169  
0.98102  
0.98573  
0.98856  
0.99426  
0.99713  
0.99808  
0.99856  
0.99885

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

P  
0.98749  
0.95657  
0.88509  
0.83310  
0.80236

PS  
0.99153  
0.96938  
0.91080  
0.86099  
0.82822

PD  
0.98345  
0.94377  
0.85939  
0.80522  
0.77649

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.78677 | 0.80990 | 0.76364 |
| 0.20000   | 0.80021 | 0.81450 | 0.78593 |
| 0.40000   | 0.86871 | 0.87688 | 0.86054 |
| 0.60000   | 0.90611 | 0.91185 | 0.90037 |
| 0.80000   | 0.92748 | 0.93191 | 0.92306 |
| 1.00000   | 0.94108 | 0.94467 | 0.93748 |
| 2.00000   | 0.96976 | 0.97161 | 0.96790 |
| 4.00000   | 0.98472 | 0.98566 | 0.98378 |
| 6.00000   | 0.98978 | 0.99041 | 0.98915 |
| 8.00000   | 0.99232 | 0.99280 | 0.99185 |
| 10.00000  | 0.99385 | 0.99424 | 0.99347 |
| 20.00000  | 0.99692 | 0.99711 | 0.99673 |
| 40.00000  | 0.99846 | 0.99856 | 0.99836 |
| 60.00000  | 0.99897 | 0.99904 | 0.99891 |
| 80.00000  | 0.99923 | 0.99928 | 0.99918 |
| 100.00000 | 0.99938 | 0.99942 | 0.99935 |

PHI=30.

-28-

K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 0.10001 | 0.19906 | 0.30096 |
| 1.00000   | 0.01490 | 0.02626 | 0.00355 |
| 2.00000   | 0.00000 | 0.00000 | 0.00000 |
| 4.00000   | 0.11295 | 0.14590 | 0.08001 |
| 6.00000   | 0.35977 | 0.41183 | 0.30771 |
| 8.00000   | 0.50893 | 0.55796 | 0.45990 |
| 10.00000  | 0.60332 | 0.64689 | 0.55975 |
| 20.00000  | 0.66773 | 0.70630 | 0.62916 |
| 40.00000  | 0.81723 | 0.84083 | 0.79364 |
| 60.00000  | 0.90397 | 0.91702 | 0.89093 |
| 80.00000  | 0.93490 | 0.94389 | 0.92590 |
| 100.00000 | 0.95076 | 0.95762 | 0.94390 |
|           | 0.96041 | 0.96595 | 0.95486 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99993 | 1.00000 | 0.99986 |
| 0.02000   | 0.99972 | 1.00000 | 0.99945 |
| 0.04000   | 0.99837 | 0.99896 | 0.99777 |
| 0.06000   | 0.99620 | 0.99746 | 0.99495 |
| 0.08000   | 0.99322 | 0.99551 | 0.99094 |
| 0.10000   | 0.98928 | 0.99289 | 0.98568 |
| 0.20000   | 0.95273 | 0.96905 | 0.93641 |
| 0.40000   | 0.69203 | 0.80744 | 0.57662 |
| 0.60000   | 0.10007 | 0.19355 | 0.00659 |
| 0.80000   | 0.01720 | 0.02998 | 0.00442 |
| 1.00000   | 0.00277 | 0.00440 | 0.00114 |
| 2.00000   | 0.11691 | 0.15062 | 0.08320 |
| 4.00000   | 0.36381 | 0.41592 | 0.31170 |
| 6.00000   | 0.51249 | 0.56136 | 0.46361 |
| 8.00000   | 0.60642 | 0.64977 | 0.56306 |
| 10.00000  | 0.67044 | 0.70878 | 0.63210 |
| 20.00000  | 0.81887 | 0.84228 | 0.79547 |
| 40.00000  | 0.90488 | 0.91781 | 0.89195 |
| 60.00000  | 0.93552 | 0.94443 | 0.92661 |
| 80.00000  | 0.95123 | 0.95903 | 0.94444 |
| 100.00000 | 0.96079 | 0.96628 | 0.95530 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99986 | 1.00000 | 0.99972 |
| 0.02000 | 0.99915 | 0.99940 | 0.99889 |
| 0.04000 | 0.99665 | 0.99776 | 0.99555 |
| 0.06000 | 0.99246 | 0.99499 | 0.98993 |
| 0.08000 | 0.98650 | 0.99101 | 0.98198 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.97872 | 0.98584 | 0.97160 |
| 0.20000   | 0.90849 | 0.93933 | 0.87764 |
| 0.40000   | 0.52249 | 0.67141 | 0.37357 |
| 0.60000   | 0.10139 | 0.18511 | 0.01767 |
| 0.80000   | 0.02395 | 0.04059 | 0.00731 |
| 1.00000   | 0.01093 | 0.01706 | 0.00480 |
| 2.00000   | 0.12856 | 0.16441 | 0.09270 |
| 4.00000   | 0.37564 | 0.42785 | 0.32344 |
| 6.00000   | 0.52286 | 0.57127 | 0.47445 |
| 8.00000   | 0.61541 | 0.65813 | 0.57269 |
| 10.00000  | 0.67831 | 0.71598 | 0.64065 |
| 20.00000  | 0.82362 | 0.94648 | 0.80075 |
| 40.00000  | 0.90749 | 0.92009 | 0.89490 |
| 60.00000  | 0.93732 | 0.94599 | 0.92865 |
| 80.00000  | 0.95261 | 0.95922 | 0.94600 |
| 100.00000 | 0.96190 | 0.96724 | 0.95656 |

K = 0.4

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99972 | 1.00000 | 0.99945 |
| 0.02000   | 0.99837 | 0.99896 | 0.99778 |
| 0.04000   | 0.99335 | 0.99557 | 0.99112 |
| 0.06000   | 0.98499 | 0.98998 | 0.98001 |
| 0.08000   | 0.97327 | 0.98213 | 0.96440 |
| 0.10000   | 0.95813 | 0.97198 | 0.94428 |
| 0.20000   | 0.83002 | 0.88443 | 0.77560 |
| 0.40000   | 0.37595 | 0.51903 | 0.23286 |
| 0.60000   | 0.11199 | 0.18341 | 0.04057 |
| 0.80000   | 0.04920 | 0.07721 | 0.02118 |
| 1.00000   | 0.04175 | 0.06166 | 0.02184 |
| 2.00000   | 0.17210 | 0.21463 | 0.12957 |
| 4.00000   | 0.41885 | 0.47088 | 0.36681 |
| 6.00000   | 0.56027 | 0.60672 | 0.51383 |
| 8.00000   | 0.64761 | 0.68789 | 0.60734 |
| 10.00000  | 0.70637 | 0.74151 | 0.67122 |
| 20.00000  | 0.84034 | 0.86125 | 0.81943 |
| 40.00000  | 0.91665 | 0.92806 | 0.90524 |
| 60.00000  | 0.94362 | 0.95145 | 0.93579 |
| 80.00000  | 0.95740 | 0.96336 | 0.95145 |
| 100.00000 | 0.96577 | 0.97058 | 0.96096 |

K = 0.6

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.99958 | 1.00000 | 0.99917 |
| 0.02000  | 0.99749 | 0.99831 | 0.99668 |
| 0.04000  | 0.99004 | 0.99336 | 0.98673 |
| 0.06000  | 0.97765 | 0.98504 | 0.97025 |
| 0.08000  | 0.96040 | 0.97343 | 0.94736 |
| 0.10000  | 0.93840 | 0.95852 | 0.91828 |
| 0.20000  | 0.76524 | 0.83640 | 0.69408 |
| 0.40000  | 0.32451 | 0.44967 | 0.19935 |
| 0.60000  | 0.13313 | 0.20083 | 0.06542 |
| 0.80000  | 0.08677 | 0.12643 | 0.04711 |
| 1.00000  | 0.08782 | 0.12207 | 0.05356 |
| 2.00000  | 0.23546 | 0.28456 | 0.18636 |
| 4.00000  | 0.47890 | 0.52951 | 0.42829 |
| 6.00000  | 0.61108 | 0.65424 | 0.56702 |
| 8.00000  | 0.69077 | 0.72738 | 0.65415 |
| 10.00000 | 0.74363 | 0.77517 | 0.71208 |
| 20.00000 | 0.86213 | 0.88042 | 0.84383 |

40.00000  
60.00000  
80.00000  
100.00000

0.92845  
0.95170  
0.96355  
0.97073

0.93831  
0.95844  
0.96866  
0.97485

0.91860  
0.94497  
0.95844  
0.96661

-30-

K = 0.9

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99915  
0.99667  
0.98677  
0.97043  
0.94793  
0.91965  
0.71342  
0.30791  
0.16245  
0.13298  
0.14402  
0.30916  
0.54472  
0.66522  
0.73602  
0.78230  
0.84424  
0.94029  
0.95978  
0.96968  
0.97566

RS  
0.99943  
0.99777  
0.99116  
0.98017  
0.96492  
0.94555  
0.79560  
0.41928  
0.23000  
0.18211  
0.18965  
0.36228  
0.59238  
0.70415  
0.76336  
0.80981  
0.89980  
0.94857  
0.96541  
0.97394  
0.97910

RD  
0.99889  
0.99557  
0.98238  
0.96069  
0.93093  
0.89376  
0.63124  
0.19654  
0.09401  
0.08385  
0.09840  
0.25604  
0.49706  
0.62629  
0.70368  
0.75478  
0.86868  
0.93202  
0.95415  
0.96541  
0.97223

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99901  
0.99587  
0.98353  
0.96336  
0.93593  
0.90199  
0.67305  
0.30830  
0.19778  
0.18476  
0.20588  
0.38514  
0.60830  
0.71604  
0.77782  
0.81756  
0.90403  
0.95077  
0.96689  
0.97506  
0.98000

RS  
0.99940  
0.99726  
0.98899  
0.97537  
0.95665  
0.93314  
0.76184  
0.40991  
0.26612  
0.24057  
0.25910  
0.43928  
0.65191  
0.75039  
0.80594  
0.84124  
0.91708  
0.95763  
0.97155  
0.97858  
0.98293

RD  
0.99852  
0.99447  
0.97807  
0.95135  
0.91520  
0.87085  
0.58426  
0.20670  
0.12943  
0.12894  
0.15267  
0.33100  
0.56469  
0.68169  
0.74080  
0.79408  
0.89099  
0.94391  
0.96224  
0.97155  
0.97717

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99854  
0.99382  
0.97559  
0.94648  
0.90823

RS  
0.99916  
0.99591  
0.98363  
0.96378  
0.93719

RD  
0.99792  
0.99174  
0.96755  
0.92917  
0.87927

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.86301  
0.61101  
0.34526  
0.30063  
0.32252  
0.36336  
0.55474  
0.73618  
0.81404  
0.85664  
0.88341  
0.93978  
0.96940  
0.97949  
0.98458  
0.98764

0.90491  
0.70430  
0.43197  
0.36925  
0.38436  
0.42213  
0.60287  
0.76868  
0.83808  
0.87563  
0.89909  
0.94813  
0.97371  
0.98239  
0.98677  
0.98940

0.82110  
0.51771  
0.25855  
0.23201  
0.26068  
0.30460  
0.50660  
0.70367  
0.79000  
0.83764  
0.86773  
0.93144  
0.96510  
0.97659  
0.98239  
0.98589

K= 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99810  
0.99182  
0.96791  
0.93088  
0.88414  
0.83164  
0.58649  
0.40526  
0.40734  
0.45128  
0.50103  
0.67868  
0.81992  
0.87462  
0.90421  
0.92252  
0.96042  
0.98000  
0.98662  
0.98995  
0.99195

RS  
0.99897  
0.99461  
0.97839  
0.95287  
0.91970  
0.88108  
0.67606  
0.48228  
0.47194  
0.50962  
0.55492  
0.71717  
0.84246  
0.89142  
0.91725  
0.93317  
0.96597  
0.98283  
0.98852  
0.99138  
0.99310

RP  
0.99724  
0.98903  
0.95744  
0.90889  
0.84858  
0.78220  
0.49693  
0.32824  
0.34274  
0.30295  
0.44714  
0.64019  
0.79539  
0.85782  
0.89117  
0.91188  
0.95488  
0.97717  
0.98472  
0.98852  
0.99080

K= 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99694  
0.98779  
0.95361  
0.90413  
0.84731  
0.79007  
0.59465  
0.53673  
0.58779  
0.64426  
0.69144  
0.82100  
0.90450  
0.93506  
0.95083  
0.96044  
0.98000

RS  
0.99802  
0.99186  
0.96849  
0.93353  
0.89145  
0.84673  
0.67080  
0.59768  
0.63844  
0.68792  
0.72978  
0.84446  
0.91752  
0.94405  
0.95769  
0.96598  
0.98283

RP  
0.99586  
0.98372  
0.93872  
0.87473  
0.80317  
0.73342  
0.51850  
0.47578  
0.53714  
0.60059  
0.65310  
0.79754  
0.89148  
0.92607  
0.94397  
0.95490  
0.97718

40.00000  
60.00000  
80.00000  
100.00000

0.98995  
0.99329  
0.99496  
0.99597

0.99138  
0.99424  
0.99568  
0.99654

0.98852  
0.99233  
0.99424  
0.99539

-32-

K = 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99599  
0.98390  
0.94094  
0.88365  
0.82434  
0.77090  
0.63441  
0.64830  
0.71123  
0.76166  
0.79889  
0.88951  
0.94253  
0.96123  
0.97075  
0.97653  
0.98819  
0.99407  
0.99605  
0.99703  
0.99763

RS  
0.99747  
0.98923  
0.95951  
0.91789  
0.87203  
0.82792  
0.69744  
0.69563  
0.74882  
0.79276  
0.82535  
0.90452  
0.95052  
0.96666  
0.97487  
0.97984  
0.98986  
0.99492  
0.99661  
0.99746  
0.99796

RP  
0.99450  
0.97858  
0.92236  
0.84940  
0.77664  
0.71388  
0.57138  
0.60096  
0.67365  
0.73057  
0.77243  
0.87450  
0.93454  
0.95579  
0.96664  
0.97321  
0.98651  
0.99323  
0.99548  
0.99661  
0.99729

K = 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99392  
0.97660  
0.92105  
0.85977  
0.80875  
0.77203  
0.72719  
0.79235  
0.84448  
0.87736  
0.89920  
0.94722  
0.97311  
0.98198  
0.98645  
0.98914  
0.99455  
0.99727  
0.99818  
0.99864  
0.99891

RS  
0.99601  
0.98419  
0.94471  
0.89757  
0.85482  
0.82144  
0.77028  
0.82108  
0.86573  
0.89415  
0.91306  
0.95459  
0.97691  
0.98453  
0.98837  
0.99068  
0.99533  
0.99766  
0.99844  
0.99883  
0.99906

RP  
0.99183  
0.96901  
0.89739  
0.82197  
0.76268  
0.72261  
0.68409  
0.76363  
0.82323  
0.86056  
0.88534  
0.93986  
0.96932  
0.97942  
0.98452  
0.98760  
0.99378  
0.99688  
0.99792  
0.99844  
0.99875

K = 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99195  
0.97008  
0.90829  
0.85289  
0.81614

RS  
0.99467  
0.97960  
0.93433  
0.88926  
0.85612

RP  
0.98924  
0.96055  
0.88226  
0.81651  
0.77617

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.79586  
0.80117  
0.86815  
0.90554  
0.92698  
0.94065  
0.96952  
0.98459  
0.98970  
0.99226  
0.99380  
0.99690  
0.99845  
0.99896  
0.99922  
0.99938

0.83577  
0.83136  
0.88662  
0.91869  
0.93717  
0.94895  
0.97381  
0.98678  
0.99116  
0.99336  
0.99469  
0.99734  
0.99867  
0.99911  
0.99933  
0.99947

0.75595  
0.77098  
0.84968  
0.89239  
0.91680  
0.93235  
0.96522  
0.98241  
0.98823  
0.99116  
0.99292  
0.99645  
0.99822  
0.99882  
0.99911  
0.99929

PHI=40.

-34-

K= 0.0

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 0.02731 | 0.05441 | 0.00021 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.11775 | 0.17979 | 0.05571 |
| 4.00000   | 0.35926 | 0.45562 | 0.26290 |
| 6.00000   | 0.50587 | 0.59660 | 0.41514 |
| 8.00000   | 0.59942 | 0.68014 | 0.51870 |
| 10.00000  | 0.66364 | 0.73517 | 0.59211 |
| 20.00000  | 0.81393 | 0.85782 | 0.77004 |
| 40.00000  | 0.90192 | 0.92624 | 0.87759 |
| 60.00000  | 0.93343 | 0.95021 | 0.91664 |
| 80.00000  | 0.94962 | 0.96242 | 0.93681 |
| 100.00000 | 0.95947 | 0.96982 | 0.94912 |

K= 0.1

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99995 | 1.00000 | 0.99990 |
| 0.02000   | 0.99981 | 1.00000 | 0.99962 |
| 0.04000   | 0.99947 | 0.99947 | 0.99847 |
| 0.06000   | 0.99748 | 0.99341 | 0.99655 |
| 0.08000   | 0.99541 | 0.99699 | 0.99382 |
| 0.10000   | 0.99273 | 0.99517 | 0.99028 |
| 0.20000   | 0.96905 | 0.97935 | 0.95875 |
| 0.40000   | 0.83905 | 0.89134 | 0.78677 |
| 0.60000   | 0.39374 | 0.54042 | 0.24706 |
| 0.80000   | 0.03040 | 0.05969 | 0.00111 |
| 1.00000   | 0.00369 | 0.00709 | 0.00029 |
| 2.00000   | 0.12175 | 0.18513 | 0.05837 |
| 4.00000   | 0.36324 | 0.45966 | 0.26682 |
| 6.00000   | 0.50939 | 0.59984 | 0.41895 |
| 8.00000   | 0.60250 | 0.68282 | 0.52218 |
| 10.00000  | 0.66635 | 0.73745 | 0.59525 |
| 20.00000  | 0.81558 | 0.85913 | 0.77204 |
| 40.00000  | 0.90284 | 0.92694 | 0.87873 |
| 60.00000  | 0.93406 | 0.95069 | 0.91743 |
| 80.00000  | 0.95010 | 0.96278 | 0.93742 |
| 100.00000 | 0.95986 | 0.97012 | 0.94961 |

K= 0.2

| N       | R       | RS      | RD      |
|---------|---------|---------|---------|
| 0.01000 | 0.99990 | 1.00000 | 0.99981 |
| 0.02000 | 0.99962 | 1.00000 | 0.99924 |
| 0.04000 | 0.99782 | 0.99870 | 0.99694 |
| 0.06000 | 0.99485 | 0.99661 | 0.99310 |
| 0.08000 | 0.99079 | 0.99388 | 0.98769 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.98550 | 0.99033 | 0.98067 |
| 0.20000   | 0.93936 | 0.95924 | 0.91948 |
| 0.40000   | 0.71296 | 0.79885 | 0.62707 |
| 0.60000   | 0.25751 | 0.38954 | 0.12547 |
| 0.80000   | 0.03911 | 0.07423 | 0.00399 |
| 1.00000   | 0.01423 | 0.02664 | 0.00183 |
| 2.00000   | 0.13350 | 0.20063 | 0.06637 |
| 4.00000   | 0.37489 | 0.47141 | 0.27837 |
| 6.00000   | 0.51967 | 0.60922 | 0.43011 |
| 8.00000   | 0.61147 | 0.69061 | 0.53233 |
| 10.00000  | 0.67423 | 0.74408 | 0.60437 |
| 20.00000  | 0.82038 | 0.86292 | 0.77785 |
| 40.00000  | 0.90550 | 0.92898 | 0.88202 |
| 60.00000  | 0.93590 | 0.95208 | 0.91972 |
| 80.00000  | 0.95150 | 0.96384 | 0.93917 |
| 100.00000 | 0.96100 | 0.97097 | 0.95103 |

K = 0.4

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99981 | 1.00000 | 0.99962 |
| 0.02000   | 0.99897 | 0.99947 | 0.99847 |
| 0.04000   | 0.99543 | 0.99696 | 0.99390 |
| 0.06000   | 0.98971 | 0.99315 | 0.98627 |
| 0.08000   | 0.98166 | 0.98774 | 0.97558 |
| 0.10000   | 0.97130 | 0.98077 | 0.96193 |
| 0.20000   | 0.88425 | 0.92109 | 0.84741 |
| 0.40000   | 0.54618 | 0.66279 | 0.42958 |
| 0.60000   | 0.19178 | 0.30031 | 0.08326 |
| 0.80000   | 0.06871 | 0.12043 | 0.01699 |
| 1.00000   | 0.05091 | 0.08836 | 0.01347 |
| 2.00000   | 0.17707 | 0.25568 | 0.09846 |
| 4.00000   | 0.41745 | 0.51345 | 0.32145 |
| 6.00000   | 0.55678 | 0.64266 | 0.47090 |
| 8.00000   | 0.64360 | 0.71821 | 0.56899 |
| 10.00000  | 0.70234 | 0.76754 | 0.63714 |
| 20.00000  | 0.83731 | 0.87623 | 0.79840 |
| 40.00000  | 0.91482 | 0.93609 | 0.89356 |
| 60.00000  | 0.94232 | 0.95693 | 0.92772 |
| 80.00000  | 0.95640 | 0.96752 | 0.94529 |
| 100.00000 | 0.96496 | 0.97393 | 0.95598 |

K = 0.5

| N        | R       | RS      | RD      |
|----------|---------|---------|---------|
| 0.01000  | 0.99971 | 1.00000 | 0.99943 |
| 0.02000  | 0.99840 | 0.99908 | 0.99771 |
| 0.04000  | 0.99316 | 0.99546 | 0.99087 |
| 0.06000  | 0.98461 | 0.98972 | 0.97950 |
| 0.08000  | 0.97271 | 0.98171 | 0.96370 |
| 0.10000  | 0.95749 | 0.97142 | 0.94357 |
| 0.20000  | 0.83535 | 0.88623 | 0.78447 |
| 0.40000  | 0.45631 | 0.58016 | 0.33245 |
| 0.60000  | 0.18944 | 0.29117 | 0.08770 |
| 0.80000  | 0.10865 | 0.17708 | 0.04022 |
| 1.00000  | 0.10087 | 0.16210 | 0.03964 |
| 2.00000  | 0.23978 | 0.32946 | 0.15009 |
| 4.00000  | 0.47668 | 0.56998 | 0.38348 |
| 6.00000  | 0.60731 | 0.68709 | 0.52752 |
| 8.00000  | 0.68676 | 0.75462 | 0.61891 |
| 10.00000 | 0.73976 | 0.79830 | 0.68121 |
| 20.00000 | 0.85940 | 0.89346 | 0.82534 |

40.00000  
60.00000  
80.00000  
100.00000

0.92685  
0.95058  
0.96268  
0.97003

0.94523  
0.96315  
0.97223  
0.97772

0.90848  
0.93801  
0.95314  
0.96233

-36-

K = 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99962  
0.99778  
0.99090  
0.97958  
0.96394  
0.94414  
0.79290  
0.41063  
0.20749  
0.15497  
0.15821  
0.31215  
0.54177  
0.66131  
0.73216  
0.77870  
0.88186  
0.93893  
0.95883  
0.96895  
0.97508

RS  
1.00000  
0.99860  
0.99394  
0.98633  
0.97578  
0.96231  
0.85509  
0.53408  
0.30906  
0.23720  
0.23758  
0.40849  
0.62947  
0.73331  
0.79212  
0.82979  
0.91084  
0.95437  
0.96934  
0.97692  
0.98149

RP  
0.99924  
0.99695  
0.98785  
0.97293  
0.95211  
0.92598  
0.73072  
0.28718  
0.10592  
0.07274  
0.07885  
0.21582  
0.45406  
0.58932  
0.67219  
0.72761  
0.85287  
0.92349  
0.94832  
0.96098  
0.96866

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99952  
0.99718  
0.98864  
0.97463  
0.95539  
0.93130  
0.75681  
0.39055  
0.23550  
0.20521  
0.21920  
0.38653  
0.60485  
0.71218  
0.77421  
0.81440  
0.90198  
0.94962  
0.96611  
0.97446  
0.97951

RS  
1.00000  
0.99817  
0.99242  
0.98300  
0.96997  
0.95348  
0.82786  
0.51169  
0.33896  
0.29757  
0.31067  
0.48443  
0.68515  
0.77576  
0.82621  
0.85822  
0.92620  
0.96243  
0.97479  
0.98103  
0.98480

RP  
0.99905  
0.99619  
0.98486  
0.96626  
0.94082  
0.90912  
0.68576  
0.26942  
0.13203  
0.11285  
0.12773  
0.28864  
0.52456  
0.64860  
0.72222  
0.77058  
0.87767  
0.93682  
0.95742  
0.96789  
0.97423

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99902  
0.99575  
0.98309  
0.96260  
0.93512

RS  
0.99947  
0.99721  
0.98869  
0.97484  
0.95606

RP  
0.99857  
0.99430  
0.97749  
0.95036  
0.91418

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.90173 | 0.93287 | 0.87058 |
| 0.20000   | 0.69177 | 0.77658 | 0.60696 |
| 0.40000   | 0.39683 | 0.51197 | 0.28169 |
| 0.60000   | 0.32534 | 0.43221 | 0.21847 |
| 0.80000   | 0.33605 | 0.43896 | 0.23314 |
| 1.00000   | 0.37110 | 0.47222 | 0.26998 |
| 2.00000   | 0.55296 | 0.64024 | 0.46569 |
| 4.00000   | 0.73253 | 0.70256 | 0.67251 |
| 6.00000   | 0.81080 | 0.85540 | 0.76620 |
| 8.00000   | 0.85387 | 0.88918 | 0.81856 |
| 10.00000  | 0.88103 | 0.91021 | 0.85185 |
| 20.00000  | 0.93841 | 0.95398 | 0.92285 |
| 40.00000  | 0.96867 | 0.97671 | 0.96063 |
| 60.00000  | 0.97899 | 0.98441 | 0.97358 |
| 80.00000  | 0.98420 | 0.98928 | 0.98012 |
| 100.00000 | 0.98734 | 0.99062 | 0.98406 |

K= 2.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99878 | 0.99947 | 0.99810 |
| 0.02000   | 0.99435 | 0.99627 | 0.99242 |
| 0.04000   | 0.97766 | 0.98503 | 0.97029 |
| 0.06000   | 0.95118 | 0.96705 | 0.93532 |
| 0.08000   | 0.91663 | 0.94321 | 0.89006 |
| 0.10000   | 0.87613 | 0.91468 | 0.83758 |
| 0.20000   | 0.65594 | 0.74642 | 0.56547 |
| 0.40000   | 0.43932 | 0.54866 | 0.32998 |
| 0.60000   | 0.42244 | 0.52670 | 0.31858 |
| 0.80000   | 0.45820 | 0.55717 | 0.35922 |
| 1.00000   | 0.50370 | 0.50775 | 0.40965 |
| 2.00000   | 0.67565 | 0.74589 | 0.60541 |
| 4.00000   | 0.81580 | 0.85940 | 0.77221 |
| 6.00000   | 0.87213 | 0.90336 | 0.84090 |
| 8.00000   | 0.90218 | 0.92645 | 0.87791 |
| 10.00000  | 0.92082 | 0.94066 | 0.90099 |
| 20.00000  | 0.95949 | 0.96984 | 0.94914 |
| 40.00000  | 0.97951 | 0.98480 | 0.97423 |
| 60.00000  | 0.98629 | 0.98984 | 0.98275 |
| 80.00000  | 0.98970 | 0.99237 | 0.98703 |
| 100.00000 | 0.99175 | 0.99389 | 0.98961 |

K= 3.0

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.99788 | 0.99860 | 0.99715 |
| 0.02000  | 0.99154 | 0.99436 | 0.98871 |
| 0.04000  | 0.96730 | 0.97800 | 0.95659 |
| 0.06000  | 0.93057 | 0.95280 | 0.90834 |
| 0.08000  | 0.88575 | 0.92129 | 0.85021 |
| 0.10000  | 0.83739 | 0.88628 | 0.78349 |
| 0.20000  | 0.64010 | 0.73002 | 0.55018 |
| 0.40000  | 0.55125 | 0.64582 | 0.45667 |
| 0.60000  | 0.59171 | 0.67743 | 0.50599 |
| 0.80000  | 0.64418 | 0.72086 | 0.56751 |
| 1.00000  | 0.68967 | 0.75828 | 0.62105 |
| 2.00000  | 0.81810 | 0.86133 | 0.77488 |
| 4.00000  | 0.90250 | 0.92672 | 0.87829 |
| 6.00000  | 0.93361 | 0.95035 | 0.91686 |
| 8.00000  | 0.94969 | 0.96248 | 0.93690 |
| 10.00000 | 0.95951 | 0.96985 | 0.94917 |
| 20.00000 | 0.97952 | 0.98480 | 0.97424 |

40.00000  
60.00000  
80.00000  
100.00000

0.98970  
0.99312  
0.99484  
0.99587

0.99237  
0.99491  
0.99618  
0.99694

0.98703  
0.99134  
0.99349  
0.99479

K = 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99719  
0.98880  
0.95773  
0.91331  
0.86325  
0.81401  
0.66244  
0.65365  
0.71090  
0.75966  
0.79640  
0.88735  
0.94123  
0.96032  
0.97006  
0.97596  
0.98790  
0.99393  
0.99595  
0.99696  
0.99757

RS  
0.99817  
0.99252  
0.97147  
0.94065  
0.90482  
0.86831  
0.74537  
0.73132  
0.77659  
0.81544  
0.84447  
0.91515  
0.95611  
0.97046  
0.97774  
0.98215  
0.99103  
0.99550  
0.99700  
0.99775  
0.99820

RD  
0.99671  
0.99508  
0.94400  
0.88598  
0.82168  
0.75970  
0.57952  
0.57598  
0.64521  
0.70389  
0.74832  
0.85955  
0.92635  
0.95017  
0.96237  
0.96977  
0.98476  
0.99235  
0.99489  
0.99617  
0.99693

K = 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99575  
0.98354  
0.94145  
0.88931  
0.84033  
0.80108  
0.73703  
0.79181  
0.84255  
0.87533  
0.89731  
0.94604  
0.97247  
0.98154  
0.98611  
0.98887  
0.99442  
0.99720  
0.99814  
0.99860  
0.99888

RS  
0.99717  
0.98897  
0.96017  
0.92320  
0.88701  
0.85672  
0.80188  
0.84183  
0.88091  
0.90607  
0.92286  
0.95975  
0.97955  
0.98630  
0.98971  
0.99176  
0.99587  
0.99793  
0.99862  
0.99897  
0.99917

RD  
0.99474  
0.97811  
0.92274  
0.85541  
0.79366  
0.74544  
0.67218  
0.74178  
0.80420  
0.84459  
0.87177  
0.93233  
0.96539  
0.97677  
0.98252  
0.98599  
0.99297  
0.99648  
0.99765  
0.99824  
0.99859

K = 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99440  
0.97867  
0.92934  
0.87773  
0.83826

RS  
0.99629  
0.98567  
0.95155  
0.91421  
0.88418

RD  
0.99251  
0.97167  
0.90712  
0.84125  
0.79234

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.81328  
0.80413  
0.86667  
0.90389  
0.92553  
0.93938  
0.96880  
0.98422  
0.98944  
0.99207  
0.99365  
0.99682  
0.99841  
0.99894  
0.99920  
0.99936

0.86417  
0.85306  
0.89974  
0.92796  
0.94432  
0.95476  
0.97681  
0.98930  
0.99218  
0.99413  
0.99530  
0.99765  
0.99882  
0.99921  
0.99941  
0.99953

0.76239  
0.75520  
0.83361  
0.87982  
0.90673  
0.92400  
0.96079  
0.98014  
0.98671  
0.99031  
0.99200  
0.99599  
0.99799  
0.99866  
0.99900  
0.99920

PHI=50.

-40-

K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.15101 | 0.22273 | 0.07930 |
| 2.00000   | 0.00000 | 0.00000 | 0.00000 |
| 4.00000   | 0.13042 | 0.23402 | 0.02682 |
| 6.00000   | 0.35831 | 0.51641 | 0.20022 |
| 8.00000   | 0.49861 | 0.64807 | 0.34914 |
| 10.00000  | 0.59002 | 0.72355 | 0.45649 |
| 20.00000  | 0.65370 | 0.77242 | 0.53499 |
| 40.00000  | 0.80578 | 0.87924 | 0.73232 |
| 60.00000  | 0.89681 | 0.93773 | 0.85588 |
| 80.00000  | 0.92976 | 0.95805 | 0.90147 |
| 100.00000 | 0.94676 | 0.96837 | 0.92516 |
|           | 0.95714 | 0.97462 | 0.93966 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99997 | 1.00000 | 0.99993 |
| 0.02000   | 0.99987 | 1.00000 | 0.99973 |
| 0.04000   | 0.99924 | 0.99956 | 0.99892 |
| 0.06000   | 0.99824 | 0.99891 | 0.99757 |
| 0.08000   | 0.99676 | 0.99786 | 0.99567 |
| 0.10000   | 0.99489 | 0.99659 | 0.99320 |
| 0.20000   | 0.97864 | 0.98564 | 0.97163 |
| 0.40000   | 0.89650 | 0.92816 | 0.86484 |
| 0.60000   | 0.66246 | 0.74587 | 0.57905 |
| 0.80000   | 0.10898 | 0.17106 | 0.04690 |
| 1.00000   | 0.00717 | 0.01383 | 0.00051 |
| 2.00000   | 0.13450 | 0.24012 | 0.02889 |
| 4.00000   | 0.36215 | 0.52029 | 0.20401 |
| 6.00000   | 0.50205 | 0.65103 | 0.35307 |
| 8.00000   | 0.59307 | 0.72595 | 0.46020 |
| 10.00000  | 0.65642 | 0.77444 | 0.53840 |
| 20.00000  | 0.83748 | 0.88037 | 0.73459 |
| 40.00000  | 0.89776 | 0.93833 | 0.85720 |
| 60.00000  | 0.93043 | 0.95845 | 0.90240 |
| 80.00000  | 0.94727 | 0.96868 | 0.92587 |
| 100.00000 | 0.95755 | 0.97486 | 0.94024 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99993 | 1.00000 | 0.99987 |
| 0.02000 | 0.99973 | 1.00000 | 0.99946 |
| 0.04000 | 0.99843 | 0.99901 | 0.99785 |
| 0.06000 | 0.99638 | 0.99760 | 0.99515 |
| 0.08000 | 0.99353 | 0.99570 | 0.99135 |

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.98983  
0.95787  
0.80731  
0.47613  
0.09824  
0.02537  
0.14640  
0.37337  
0.51210  
0.60196  
0.66431  
0.81241  
0.90054  
0.93235  
0.94875  
0.95875

0.99321  
0.97154  
0.86352  
0.58606  
0.16031  
0.04814  
0.25759  
0.53154  
0.65961  
0.73291  
0.78028  
0.88363  
0.94005  
0.95963  
0.96957  
0.97558

0.98644  
0.94420  
0.75109  
0.36621  
0.03616  
0.00261  
0.03522  
0.21519  
0.36458  
0.47102  
0.54834  
0.74120  
0.86103  
0.90508  
0.92793  
0.94192

K= 0.4

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99987  
0.99946  
0.99679  
0.99274  
0.98709  
0.97980  
0.91845  
0.67034  
0.32567  
0.12021  
0.07595  
0.18975  
0.41439  
0.54849  
0.63391  
0.69255  
0.82984  
0.91028  
0.93910  
0.95391  
0.96292

RS  
1.00000  
1.00000  
0.99787  
0.99516  
0.99137  
0.98646  
0.94444  
0.75881  
0.44347  
0.19875  
0.13723  
0.31772  
0.57137  
0.68997  
0.75746  
0.80090  
0.89505  
0.94609  
0.96373  
0.97267  
0.97808

RP  
0.99973  
0.99893  
0.99570  
0.99033  
0.98281  
0.97313  
0.89246  
0.58187  
0.20787  
0.04168  
0.01468  
0.06179  
0.25740  
0.40700  
0.51036  
0.58420  
0.76463  
0.87448  
0.91447  
0.93514  
0.94777

K= 0.6

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99980  
0.99881  
0.99518  
0.98915  
0.98074  
0.96997  
0.88222  
0.58005  
0.28699  
0.15824  
0.13240  
0.25067  
0.47166  
0.59830  
0.67707  
0.73033  
0.85266

RS  
1.00000  
0.99923  
0.99680  
0.99276  
0.98711  
0.97983  
0.91913  
0.68591  
0.40697  
0.25672  
0.22650  
0.39448  
0.62389  
0.72987  
0.78959  
0.82777  
0.90981

RP  
0.99960  
0.99839  
0.99357  
0.98555  
0.97438  
0.96010  
0.84530  
0.47419  
0.16700  
0.05977  
0.03831  
0.10687  
0.31943  
0.46673  
0.56455  
0.63289  
0.79551

40.00000  
60.00000  
80.00000  
100.00000

0.92287  
0.94778  
0.96053  
0.96827

0.95384  
0.96898  
0.97665  
0.98127

0.89191  
0.92657  
0.94441  
0.95527

-42-

K= 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99973  
0.99843  
0.99358  
0.98559  
0.97449  
0.96038  
0.84947  
0.52411  
0.28660  
0.20173  
0.19053  
0.31986  
0.53497  
0.65195  
0.72278  
0.76990  
0.87594  
0.93554  
0.95646  
0.96714  
0.97361

RS  
1.00000  
0.99901  
0.99573  
0.99036  
0.98290  
0.97334  
0.89595  
0.63942  
0.41100  
0.31760  
0.30889  
0.47301  
0.67832  
0.77090  
0.82241  
0.85509  
0.92463  
0.96157  
0.97421  
0.98059  
0.98444

RP  
0.99946  
0.99785  
0.99144  
0.98081  
0.96609  
0.94741  
0.80300  
0.40880  
0.16220  
0.08587  
0.07216  
0.16670  
0.39161  
0.53300  
0.62314  
0.68470  
0.82726  
0.90951  
0.93872  
0.95368  
0.96277

K= 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99966  
0.99803  
0.99199  
0.98206  
0.96836  
0.95105  
0.82036  
0.49202  
0.30279  
0.24777  
0.24891  
0.39051  
0.59682  
0.70289  
0.76543  
0.80640  
0.89689  
0.94677  
0.96414  
0.97296  
0.97830

RS  
1.00000  
0.99875  
0.99467  
0.98800  
0.97876  
0.96701  
0.87510  
0.61283  
0.43252  
0.37710  
0.38369  
0.54576  
0.72835  
0.80818  
0.85201  
0.87961  
0.93778  
0.96838  
0.97880  
0.98406  
0.98723

RP  
0.99933  
0.99732  
0.98932  
0.97612  
0.95795  
0.93510  
0.76563  
0.37121  
0.17306  
0.11844  
0.11413  
0.23526  
0.46530  
0.59760  
0.67885  
0.73320  
0.85601  
0.92517  
0.94947  
0.96185  
0.96937

K= 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99927  
0.99700  
0.98805  
0.97343  
0.95359

RS  
0.99956  
0.99802  
0.99202  
0.98220  
0.96876

RP  
0.99899  
0.99598  
0.98407  
0.96467  
0.93842

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.92911  
0.76329  
0.47231  
0.37205  
0.36500  
0.38902  
0.54946  
0.72385  
0.80290  
0.84707  
0.87515  
0.93500  
0.96684  
0.97775  
0.98326  
0.98658

0.95203  
0.83371  
0.59990  
0.51188  
0.51082  
0.53867  
0.68891  
0.82293  
0.87722  
0.90617  
0.92411  
0.96124  
0.98042  
0.98690  
0.99016  
0.99212

0.90618  
0.69287  
0.34472  
0.23221  
0.21918  
0.23937  
0.41001  
0.62478  
0.72859  
0.78797  
0.82618  
0.90876  
0.95327  
0.96859  
0.97635  
0.98103

-43-

K= 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99932  
0.99602  
0.98417  
0.96513  
0.93980  
0.90938  
0.72646  
0.49522  
0.45330  
0.47431  
0.51091  
0.66892  
0.80825  
0.86600  
0.89716  
0.91660  
0.95716  
0.97830  
0.98547  
0.98908  
0.99125

PS  
0.99937  
0.99738  
0.98942  
0.97660  
0.95939  
0.93850  
0.80696  
0.62478  
0.59440  
0.61815  
0.65295  
0.78253  
0.88070  
0.91828  
0.93792  
0.94997  
0.97463  
0.98723  
0.99147  
0.99359  
0.99487

PP  
0.99866  
0.99465  
0.97892  
0.95366  
0.92022  
0.88027  
0.64596  
0.36565  
0.31219  
0.33047  
0.36887  
0.55531  
0.73581  
0.81373  
0.85639  
0.88322  
0.93970  
0.96937  
0.97947  
0.98456  
0.98763

K= 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99850  
0.99402  
0.97668  
0.94974  
0.91569  
0.87737  
0.69767  
0.57990  
0.60168  
0.64527  
0.68646  
0.81127  
0.89760  
0.93000  
0.94697  
0.95719  
0.97830

PS  
0.99901  
0.99603  
0.98439  
0.96620  
0.94297  
0.91648  
0.78751  
0.70297  
0.72583  
0.76220  
0.79416  
0.88247  
0.93816  
0.95818  
0.96843  
0.97464  
0.98723

PP  
0.99759  
0.99202  
0.96896  
0.93327  
0.88842  
0.83825  
0.60782  
0.45683  
0.47753  
0.52834  
0.57876  
0.74007  
0.85703  
0.90183  
0.92531  
0.93975  
0.96937

40.00000  
60.00000  
80.00000  
100.00000

0.98908  
0.99270  
0.99452  
0.99561

0.99359  
0.99572  
0.99679  
0.99743

0.98456  
0.98968  
0.99225  
0.99380

-44-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99804  
0.99207  
0.96962  
0.93625  
0.89665  
0.85531  
0.70462  
0.66630  
0.71140  
0.75579  
0.79096  
0.88213  
0.93802  
0.95805  
0.96831  
0.97454  
0.98717  
0.99356  
0.99570  
0.99677  
0.99742

RS  
0.99875  
0.99472  
0.97966  
0.95710  
0.93004  
0.90146  
0.79542  
0.77429  
0.81095  
0.84368  
0.86832  
0.92838  
0.96305  
0.97516  
0.98120  
0.98500  
0.99247  
0.99623  
0.99748  
0.99811  
0.99849

RP  
0.98733  
0.98942  
0.95958  
0.91541  
0.86327  
0.80916  
0.61382  
0.55831  
0.61186  
0.66790  
0.71360  
0.83588  
0.91298  
0.94095  
0.95533  
0.96409  
0.98187  
0.99089  
0.99392  
0.99543  
0.99635

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99701  
0.98829  
0.95711  
0.91570  
0.87337  
0.83620  
0.75634  
0.79169  
0.83853  
0.87071  
0.89286  
0.94312  
0.97087  
0.98044  
0.98528  
0.98820  
0.99408  
0.99703  
0.99802  
0.99852  
0.99881

RS  
0.99802  
0.99219  
0.97128  
0.94333  
0.91459  
0.88932  
0.83748  
0.86712  
0.89965  
0.92083  
0.93500  
0.96613  
0.98281  
0.98850  
0.99136  
0.99308  
0.99653  
0.99826  
0.99884  
0.99913  
0.99931

RP  
0.99600  
0.98439  
0.94294  
0.88807  
0.83215  
0.78307  
0.67520  
0.71627  
0.77741  
0.82060  
0.85073  
0.92011  
0.95892  
0.97239  
0.97921  
0.98333  
0.99163  
0.99580  
0.99720  
0.99790  
0.99832

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99605  
0.98471  
0.94707  
0.90347  
0.86596

RS  
0.99739  
0.98980  
0.96461  
0.93539  
0.91039

RP  
0.99470  
0.97962  
0.92953  
0.87155  
0.82153

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.83888  
0.81155  
0.86380  
0.90013  
0.92205  
0.93631  
0.96702  
0.98328  
0.98881  
0.99159  
0.99326  
0.99662  
0.99831  
0.99887  
0.99915  
0.99932

0.89266  
0.87836  
0.91580  
0.93940  
0.95316  
0.96195  
0.98051  
0.99017  
0.99343  
0.99507  
0.99605  
0.99802  
0.99901  
0.99934  
0.99951  
0.99960

0.78509  
0.74473  
0.81180  
0.86086  
0.89095  
0.91068  
0.95352  
0.97638  
0.98418  
0.98811  
0.99047  
0.99522  
0.99761  
0.99841  
0.99880  
0.99904

K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.16138 | 0.32006 | 0.00269 |
| 4.00000   | 0.35791 | 0.59752 | 0.11831 |
| 6.00000   | 0.48370 | 0.71344 | 0.25395 |
| 8.00000   | 0.56983 | 0.77739 | 0.36226 |
| 10.00000  | 0.63191 | 0.81797 | 0.44584 |
| 20.00000  | 0.78720 | 0.90473 | 0.66968 |
| 40.00000  | 0.88492 | 0.95122 | 0.81863 |
| 60.00000  | 0.92118 | 0.96721 | 0.87514 |
| 80.00000  | 0.94007 | 0.97531 | 0.90482 |
| 100.00000 | 0.95165 | 0.98020 | 0.92311 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99998 | 1.00000 | 0.99995 |
| 0.02000   | 0.99991 | 1.00000 | 0.99982 |
| 0.04000   | 0.99946 | 0.99965 | 0.99926 |
| 0.06000   | 0.99878 | 0.99923 | 0.99833 |
| 0.08000   | 0.99778 | 0.99853 | 0.99702 |
| 0.10000   | 0.99650 | 0.99766 | 0.99533 |
| 0.20000   | 0.98543 | 0.99017 | 0.98069 |
| 0.40000   | 0.93138 | 0.95183 | 0.91094 |
| 0.60000   | 0.78747 | 0.83841 | 0.73652 |
| 0.80000   | 0.35661 | 0.43089 | 0.28232 |
| 1.00000   | 0.02097 | 0.03388 | 0.00807 |
| 2.00000   | 0.16553 | 0.32682 | 0.00424 |
| 4.00000   | 0.36143 | 0.60104 | 0.12181 |
| 6.00000   | 0.48696 | 0.71598 | 0.25793 |
| 8.00000   | 0.57281 | 0.77940 | 0.36621 |
| 10.00000  | 0.63462 | 0.81964 | 0.44959 |
| 20.00000  | 0.78900 | 0.90563 | 0.67237 |
| 40.00000  | 0.88597 | 0.95169 | 0.82026 |
| 60.00000  | 0.92192 | 0.96753 | 0.87630 |
| 80.00000  | 0.94064 | 0.97555 | 0.90572 |
| 100.00000 | 0.95212 | 0.98039 | 0.92384 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99995 | 1.00000 | 0.99991 |
| 0.02000 | 0.99981 | 1.00000 | 0.99963 |
| 0.04000 | 0.99891 | 0.99931 | 0.99852 |
| 0.06000 | 0.99750 | 0.99834 | 0.99666 |
| 0.08000 | 0.99555 | 0.99704 | 0.99406 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.99300 | 0.99572 | 0.99069 |
| 0.20000   | 0.97115 | 0.98048 | 0.96182 |
| 0.40000   | 0.86928 | 0.90714 | 0.83142 |
| 0.60000   | 0.63826 | 0.71796 | 0.55856 |
| 0.80000   | 0.24153 | 0.32073 | 0.16234 |
| 1.00000   | 0.06047 | 0.09910 | 0.02185 |
| 2.00000   | 0.17750 | 0.34594 | 0.00906 |
| 4.00000   | 0.37172 | 0.61123 | 0.13221 |
| 6.00000   | 0.49649 | 0.72334 | 0.26964 |
| 8.00000   | 0.58150 | 0.78522 | 0.37778 |
| 10.00000  | 0.64251 | 0.82446 | 0.46057 |
| 20.00000  | 0.79422 | 0.90824 | 0.68020 |
| 40.00000  | 0.88901 | 0.95305 | 0.82498 |
| 60.00000  | 0.92405 | 0.96845 | 0.87965 |
| 80.00000  | 0.94228 | 0.97625 | 0.90831 |
| 100.00000 | 0.95345 | 0.98095 | 0.92595 |

K= 0.4

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99991 | 1.00000 | 0.99982 |
| 0.02000   | 0.99963 | 1.00000 | 0.99926 |
| 0.04000   | 0.99779 | 0.99853 | 0.99704 |
| 0.06000   | 0.99500 | 0.99667 | 0.99334 |
| 0.08000   | 0.99111 | 0.99406 | 0.98816 |
| 0.10000   | 0.98609 | 0.99068 | 0.98149 |
| 0.20000   | 0.94363 | 0.96167 | 0.92560 |
| 0.40000   | 0.76616 | 0.83095 | 0.70138 |
| 0.60000   | 0.47759 | 0.58353 | 0.37164 |
| 0.80000   | 0.22252 | 0.32095 | 0.12410 |
| 1.00000   | 0.13515 | 0.22394 | 0.04637 |
| 2.00000   | 0.21966 | 0.40928 | 0.03004 |
| 4.00000   | 0.40943 | 0.64684 | 0.17201 |
| 6.00000   | 0.53121 | 0.74920 | 0.31323 |
| 8.00000   | 0.61294 | 0.80565 | 0.42023 |
| 10.00000  | 0.67093 | 0.84137 | 0.50049 |
| 20.00000  | 0.81274 | 0.91737 | 0.70812 |
| 40.00000  | 0.89970 | 0.95781 | 0.84160 |
| 60.00000  | 0.93154 | 0.97167 | 0.89141 |
| 80.00000  | 0.94804 | 0.97868 | 0.91740 |
| 100.00000 | 0.95813 | 0.98291 | 0.93336 |

K= 0.6

| N        | R       | RS      | RD      |
|----------|---------|---------|---------|
| 0.01000  | 0.99986 | 1.00000 | 0.99972 |
| 0.02000  | 0.99920 | 0.99951 | 0.99889 |
| 0.04000  | 0.99669 | 0.99782 | 0.99557 |
| 0.06000  | 0.99253 | 0.99501 | 0.99004 |
| 0.08000  | 0.98672 | 0.99111 | 0.98233 |
| 0.10000  | 0.97927 | 0.98610 | 0.97244 |
| 0.20000  | 0.91779 | 0.94387 | 0.89172 |
| 0.40000  | 0.69023 | 0.77378 | 0.60669 |
| 0.60000  | 0.41688 | 0.53631 | 0.29745 |
| 0.80000  | 0.24995 | 0.37124 | 0.12866 |
| 1.00000  | 0.19835 | 0.32578 | 0.07091 |
| 2.00000  | 0.27635 | 0.48561 | 0.06709 |
| 4.00000  | 0.46243 | 0.69286 | 0.23200 |
| 6.00000  | 0.57931 | 0.78276 | 0.37586 |
| 8.00000  | 0.65591 | 0.83214 | 0.47968 |
| 10.00000 | 0.70937 | 0.86327 | 0.55547 |
| 20.00000 | 0.83716 | 0.92911 | 0.74521 |

40.00000  
60.00000  
80.00000  
100.00000

0.91357  
0.94120  
0.95545  
0.96414

0.96390  
0.97579  
0.98179  
98540

0.86325  
0.90661  
0.92911  
0.94287

K= 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99981  
0.99892  
0.99559  
0.99006  
0.98238  
0.97257  
0.89387  
0.63752  
0.40022  
0.28602  
0.25493  
0.33882  
0.52174  
0.63192  
0.70209  
0.75017  
0.86229  
0.92759  
0.95090  
0.96286  
0.97014

RS  
1.00000  
0.99931  
0.99707  
0.99336  
0.98820  
0.98159  
0.92732  
0.73438  
0.53061  
0.42759  
0.41052  
0.55970  
0.73955  
0.81681  
0.85894  
0.88536  
0.94087  
0.96997  
0.97988  
0.98487  
0.98788

RP  
0.99963  
0.99852  
0.99410  
0.98676  
0.97656  
0.96356  
0.86042  
0.54065  
0.26984  
0.14445  
0.09935  
0.11794  
0.30393  
0.44703  
0.54525  
0.61498  
0.78372  
0.88521  
0.92192  
0.94085  
0.95239

K= 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99977  
0.99862  
0.99448  
0.98762  
0.97810  
0.96603  
0.87202  
0.60304  
0.40406  
0.32435  
0.30756  
0.40184  
0.58064  
0.68274  
0.74586  
0.78833  
0.88509  
0.94009  
0.95949  
0.96941  
0.97542

RS  
1.00000  
0.99909  
0.99632  
0.99173  
0.98533  
0.97718  
0.91218  
0.70977  
0.54429  
0.48219  
0.48269  
0.62554  
0.78165  
0.84739  
0.88289  
0.90505  
0.95126  
0.97531  
0.98347  
0.98758  
0.99005

RP  
0.99954  
0.99815  
0.99264  
0.98351  
0.97087  
0.95487  
0.83185  
0.49631  
0.26383  
0.16651  
0.13244  
0.17814  
0.37963  
0.51810  
0.60884  
0.67162  
0.81893  
0.90486  
0.93552  
0.95123  
0.96079

K= 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99965  
0.99793  
0.99175  
0.98161  
0.96773

RS  
1.00000  
0.99862  
0.99449  
0.98770  
0.97837

RP  
0.99931  
0.99723  
0.98901  
0.97551  
0.95708

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.95041  
0.82691  
0.56897  
0.44889  
0.42004  
0.42690  
0.54493  
0.70538  
0.78529  
0.83161  
0.86163  
0.92703  
0.96254  
0.97480  
0.98102  
0.98478

0.96666  
0.88116  
0.69213  
0.60752  
0.60097  
0.62287  
0.74919  
0.85946  
0.90316  
0.92624  
0.94046  
0.96972  
0.98474  
0.98980  
0.99234  
0.99386

0.93416  
0.77266  
0.44581  
0.29026  
0.23912  
0.23094  
0.34066  
0.55130  
0.66742  
0.73698  
0.78281  
0.88434  
0.94034  
0.95981  
0.96970  
0.97569

-49-

K= 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99937  
0.99725  
0.98906  
0.97578  
0.95789  
0.93606  
0.79499  
0.57525  
0.50902  
0.50860  
0.52944  
0.65653  
0.79164  
0.85208  
0.88559  
0.90679  
0.95170  
0.97542  
0.98352  
0.98761  
0.99007

RS  
0.99965  
0.99819  
0.99270  
0.98381  
0.97178  
0.95703  
0.85998  
0.70801  
0.67555  
0.69257  
0.72063  
0.82681  
0.90597  
0.93586  
0.95138  
0.96087  
0.98021  
0.99005  
0.99336  
0.99501  
0.99601

RS  
0.99908  
0.99632  
0.98542  
0.96775  
0.94401  
0.91508  
0.73001  
0.44248  
0.34249  
0.32463  
0.33825  
0.48625  
0.67731  
0.76831  
0.81981  
0.85272  
0.92319  
0.96080  
0.97369  
0.98020  
0.98413

K= 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99886  
0.99587  
0.98382  
0.96481  
0.94023  
0.91177  
0.76337  
0.62956  
0.62499  
0.65173  
0.68321  
0.79693  
0.88642  
0.92165  
0.94027  
0.95176  
0.97543

RS  
0.99931  
0.99725  
0.98921  
0.97650  
0.96005  
0.94098  
0.84227  
0.76749  
0.78283  
0.81138  
0.83690  
0.90748  
0.95158  
0.96732  
0.97536  
0.98022  
0.99005

RS  
0.99862  
0.99450  
0.97844  
0.95311  
0.92041  
0.88257  
0.68447  
0.49164  
0.46715  
0.49209  
0.52952  
0.68638  
0.82125  
0.87598  
0.90519  
0.92330  
0.96081

40.00000  
60.00000  
80.00000  
100.00000

0.98761  
0.99171  
0.99378  
0.99502

0.99501  
0.99667  
0.99750  
0.99800

0.98020  
0.98676  
0.99005  
0.99203

-50-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99862  
0.99453  
0.97883  
0.95494  
0.92562  
0.89373  
0.76009  
0.69318  
0.71656  
0.75063  
0.78124  
0.87063  
0.93058  
0.95275  
0.96421  
0.97121  
0.98544  
0.99268  
0.99511  
0.99633  
0.99706

RS  
0.99909  
0.99636  
0.98590  
0.97000  
0.95056  
0.92954  
0.84583  
0.82334  
0.85116  
0.87691  
0.89641  
0.94389  
0.97115  
0.98062  
0.98542  
0.98831  
0.99414  
0.99706  
0.99804  
0.99853  
0.99882

RP  
0.99816  
0.99270  
0.97177  
0.93988  
0.90068  
0.85792  
0.67436  
0.56302  
0.58196  
0.62436  
0.66608  
0.79737  
0.89002  
0.92488  
0.94301  
0.95410  
0.97675  
0.98831  
0.99219  
0.99413  
0.99530

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99793  
0.99189  
0.96978  
0.93910  
0.90584  
0.87453  
0.78912  
0.79506  
0.83197  
0.86163  
0.88350  
0.93644  
0.96711  
0.97786  
0.98332  
0.98662  
0.99327  
0.99663  
0.99775  
0.99831  
0.99865

RS  
0.99862  
0.99461  
0.97996  
0.95988  
0.93858  
0.91918  
0.87561  
0.89621  
0.92146  
0.93805  
0.94917  
0.97357  
0.98661  
0.99104  
0.99327  
0.99461  
0.99730  
0.99865  
0.99910  
0.99932  
0.99946

RP  
0.99725  
0.98918  
0.95960  
0.91831  
0.87310  
0.82988  
0.70263  
0.69390  
0.74248  
0.78521  
0.81783  
0.89932  
0.94762  
0.96468  
0.97337  
0.97863  
0.98925  
0.99461  
0.99640  
0.99730  
0.99784

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99728  
0.98937  
0.96220  
0.92855  
0.89693

RS  
0.99822  
0.99294  
0.97511  
0.95368  
0.93455

RP  
0.99634  
0.98580  
0.94928  
0.90342  
0.85932

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.87151  
0.82790  
0.85985  
0.89272  
0.91463  
0.92952  
0.96287  
0.98106  
0.98730  
0.99045  
0.99235  
0.99616  
0.99838  
0.99872  
0.99904  
0.99923

0.92036  
0.90627  
0.93433  
0.95269  
0.96344  
0.97031  
0.98481  
0.99235  
0.99489  
0.99616  
0.99693  
0.99846  
0.99923  
0.99949  
0.99962  
0.99969

0.82266  
0.74954  
0.78536  
0.83276  
0.86583  
0.88873  
0.94094  
0.96978  
0.97972  
0.98474  
0.98777  
0.99387  
0.99693  
0.99795  
0.99846  
0.99877

K= 0.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.23614 | 0.45620 | 0.01608 |
| 4.00000   | 0.36569 | 0.70273 | 0.02865 |
| 6.00000   | 0.45813 | 0.79364 | 0.12263 |
| 8.00000   | 0.53010 | 0.84172 | 0.21847 |
| 10.00000  | 0.58653 | 0.87156 | 0.30149 |
| 20.00000  | 0.74453 | 0.93381 | 0.55526 |
| 40.00000  | 0.85626 | 0.96637 | 0.74616 |
| 60.00000  | 0.90012 | 0.97745 | 0.82279 |
| 80.00000  | 0.92349 | 0.98304 | 0.86395 |
| 100.00000 | 0.93801 | 0.98641 | 0.88960 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99999 | 1.00000 | 0.99997 |
| 0.02000   | 0.99994 | 1.00000 | 0.99988 |
| 0.04000   | 0.99977 | 1.00000 | 0.99953 |
| 0.06000   | 0.99924 | 0.99953 | 0.99895 |
| 0.08000   | 0.99860 | 0.99908 | 0.99812 |
| 0.10000   | 0.99779 | 0.99853 | 0.99706 |
| 0.20000   | 0.99085 | 0.99382 | 0.98788 |
| 0.40000   | 0.95737 | 0.96994 | 0.94480 |
| 0.60000   | 0.86988 | 0.90077 | 0.83899 |
| 0.80000   | 0.59255 | 0.64733 | 0.53778 |
| 1.00000   | 0.07904 | 0.10324 | 0.05485 |
| 2.00000   | 0.24020 | 0.46302 | 0.01738 |
| 4.00000   | 0.36856 | 0.70559 | 0.03153 |
| 6.00000   | 0.46098 | 0.79559 | 0.12637 |
| 8.00000   | 0.53286 | 0.84321 | 0.22252 |
| 10.00000  | 0.58917 | 0.87278 | 0.30557 |
| 20.00000  | 0.74652 | 0.93444 | 0.55860 |
| 40.00000  | 0.85752 | 0.96669 | 0.74834 |
| 60.00000  | 0.90103 | 0.97767 | 0.82439 |
| 80.00000  | 0.92420 | 0.98321 | 0.86520 |
| 100.00000 | 0.93859 | 0.98655 | 0.89064 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99997 | 1.00000 | 0.99994 |
| 0.02000 | 0.99988 | 1.00000 | 0.99977 |
| 0.04000 | 0.99933 | 0.99959 | 0.99907 |
| 0.06000 | 0.99843 | 0.99897 | 0.99790 |
| 0.08000 | 0.99719 | 0.99813 | 0.99625 |

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.99559  
0.98182  
0.91749  
0.76663  
0.44452  
0.16040  
0.25168  
0.37697  
0.46931  
0.54097  
0.59690  
0.75231  
0.86115  
0.90366  
0.92626  
0.94027

0.99705  
0.98769  
0.94146  
0.81999  
0.51835  
0.21802  
0.48204  
0.71381  
0.80119  
0.84752  
0.87629  
0.93628  
0.96764  
0.97831  
0.98369  
0.98693

0.99413  
0.97594  
0.89352  
0.71326  
0.37070  
0.10277  
0.02132  
0.04012  
0.13744  
0.23441  
0.31752  
0.56834  
0.75467  
0.82901  
0.86883  
0.89362

-53-

K = 0.4

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

P  
0.99994  
0.99977  
0.99861  
0.99685  
0.99439  
0.99122  
0.96424  
0.84776  
0.63542  
0.38732  
0.26026  
0.28994  
0.40788  
0.50002  
0.57064  
0.62507  
0.77303  
0.87402  
0.91291  
0.93347  
0.94618

RS  
1.00000  
1.00000  
0.99908  
0.99790  
0.99625  
0.99412  
0.97574  
0.89122  
0.71784  
0.48862  
0.37108  
0.54236  
0.74219  
0.82073  
0.86256  
0.88856  
0.94271  
0.97094  
0.98053  
0.98537  
0.98828

RP  
0.99988  
0.99953  
0.99814  
0.99580  
0.99253  
0.98831  
0.95274  
0.80431  
0.55301  
0.28601  
0.14945  
0.03753  
0.07356  
0.17931  
0.27872  
0.36158  
0.60334  
0.77709  
0.84529  
0.88158  
0.90409

K = 0.6

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

P  
0.99991  
0.99953  
0.99791  
0.99528  
0.99161  
0.98689  
0.94748  
0.79256  
0.57379  
0.39959  
0.32473  
0.33770  
0.45181  
0.54353  
0.61219  
0.66406  
0.80078

RS  
1.00000  
0.99976  
0.99862  
0.99686  
0.99439  
0.99122  
0.96432  
0.85165  
0.67522  
0.52583  
0.47360  
0.61056  
0.77805  
0.84575  
0.88189  
0.90432  
0.95095

RP  
0.99983  
0.99930  
0.99721  
0.99371  
0.98883  
0.98256  
0.93063  
0.73347  
0.47236  
0.27335  
0.17587  
0.06484  
0.12557  
0.24131  
0.34250  
0.42380  
0.65061

40.00000  
60.00000  
80.00000  
100.00000

0.89087  
0.92493  
0.94279  
0.95380

0.97517  
0.98337  
0.98750  
0.98999

0.80657  
0.86648  
0.89808  
0.91760

-54-

K= 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99988  
0.99933  
0.99721  
0.99372  
0.98886  
0.98262  
0.93169  
0.75127  
0.54964  
0.42454  
0.37462  
0.38751  
0.50205  
0.59263  
0.65824  
0.70663  
0.82988  
0.90807  
0.93708  
0.95218  
0.96143

RS  
1.00000  
0.99959  
0.99814  
0.99581  
0.99255  
0.98836  
0.95359  
0.82301  
0.66602  
0.57196  
0.55110  
0.67311  
0.81361  
0.87077  
0.90122  
0.92009  
0.95916  
0.97936  
0.98619  
0.98963  
0.99169

RD  
0.99977  
0.99907  
0.99628  
0.99164  
0.98516  
0.97688  
0.90978  
0.67952  
0.43326  
0.27711  
0.19815  
0.10192  
0.19050  
0.31448  
0.41526  
0.49317  
0.70060  
0.83678  
0.88796  
0.91473  
0.93118

K= 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99985  
0.99915  
0.99652  
0.99217  
0.98613  
0.97843  
0.91701  
0.72197  
0.54473  
0.45204  
0.41692  
0.43640  
0.55350  
0.64175  
0.70334  
0.74765  
0.85677  
0.92357  
0.94792  
0.96051  
0.96820

RS  
1.00000  
0.99947  
0.99769  
0.99478  
0.99073  
0.98555  
0.94367  
0.80414  
0.67375  
0.61662  
0.61324  
0.72627  
0.84503  
0.89294  
0.91834  
0.93404  
0.96640  
0.98305  
0.98867  
0.99149  
0.99318

RD  
0.99971  
0.99884  
0.99535  
0.98957  
0.98154  
0.97131  
0.89034  
0.63980  
0.41571  
0.28745  
0.22060  
0.14653  
0.26198  
0.39057  
0.48834  
0.56126  
0.74715  
0.86409  
0.90717  
0.92953  
0.94321

K= 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99978  
0.99870  
0.99479  
0.98835  
0.97949

RS  
1.00000  
0.99915  
0.99653  
0.99223  
0.98630

RD  
0.99956  
0.99826  
0.99305  
0.98448  
0.97268

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.96834  
0.88564  
0.68642  
0.56663  
0.51910  
0.50480  
0.54803  
0.66935  
0.74684  
0.79628  
0.82998  
0.90751  
0.95178  
0.96741  
0.97539  
0.98023

0.97882  
0.92291  
0.78819  
0.71931  
0.71089  
0.72644  
0.82127  
0.90166  
0.93272  
0.94895  
0.95888  
0.97919  
0.98953  
0.99301  
0.99475  
0.99580

0.95786  
0.84837  
0.58466  
0.41394  
0.32731  
0.28317  
0.27479  
0.43705  
0.56095  
0.64362  
0.70107  
0.83582  
0.91403  
0.94181  
0.95602  
0.96466

-55-

K = 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99959  
0.99827  
0.99308  
0.98463  
0.97314  
0.95894  
0.86209  
0.68234  
0.60340  
0.57921  
0.57705  
0.64044  
0.75651  
0.82026  
0.85828  
0.88323  
0.93816  
0.96821  
0.97861  
0.98389  
0.98708

RS  
0.99976  
0.99887  
0.99539  
0.98975  
0.98208  
0.97261  
0.90824  
0.79755  
0.76964  
0.78066  
0.80094  
0.87829  
0.93472  
0.95568  
0.96648  
0.97307  
0.98642  
0.99318  
0.99545  
0.99659  
0.99727

RP  
0.99942  
0.99768  
0.99078  
0.97950  
0.96419  
0.94527  
0.81594  
0.56714  
0.43715  
0.37776  
0.35317  
0.40259  
0.57831  
0.68483  
0.75007  
0.79339  
0.88990  
0.94324  
0.96178  
0.97119  
0.97688

K = 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99936  
0.99740  
0.98975  
0.97754  
0.96153  
0.94260  
0.83546  
0.70917  
0.67726  
0.67768  
0.68964  
0.76985  
0.86071  
0.90159  
0.92415  
0.93835  
0.96824

RS  
0.99959  
0.99827  
0.99318  
0.98508  
0.97450  
0.96209  
0.89497  
0.83848  
0.84779  
0.86781  
0.88592  
0.93584  
0.96663  
0.97753  
0.98308  
0.98643  
0.99319

RP  
0.99913  
0.99652  
0.98632  
0.97001  
0.94855  
0.92311  
0.77595  
0.57986  
0.50674  
0.48755  
0.49336  
0.60386  
0.75479  
0.82565  
0.86522  
0.89028  
0.94329

40.00000  
60.00000  
80.00000  
100.00000

0.98389  
0.98921  
0.99189  
0.99350

0.99659  
0.99772  
0.99829  
0.99863

0.97120  
0.98070  
0.98549  
0.98637

-56-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99913  
0.99654  
0.98654  
0.97108  
0.95164  
0.92989  
0.82804  
0.74639  
0.73896  
0.75164  
0.76969  
0.84622  
0.91282  
0.93974  
0.95404  
0.96288  
0.98110  
0.99047  
0.99363  
0.99522  
0.99617

RS  
0.99942  
0.99770  
0.99107  
0.98089  
0.96827  
0.95441  
0.89630  
0.87761  
0.89652  
0.91451  
0.92817  
0.96131  
0.98019  
0.98671  
0.99000  
0.99199  
0.99599  
0.99799  
0.99866  
0.99899  
0.99920

RP  
0.99884  
0.99538  
0.98202  
0.96127  
0.93502  
0.90537  
0.75978  
0.61518  
0.58141  
0.58878  
0.61121  
0.73113  
0.84546  
0.89277  
0.91808  
0.93377  
0.96622  
0.98295  
0.98860  
0.99144  
0.99314

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99871  
0.99487  
0.98065  
0.96035  
0.93743  
0.91474  
0.83941  
0.81197  
0.82672  
0.84712  
0.86573  
0.92088  
0.95784  
0.97140  
0.97838  
0.98263  
0.99124  
0.99560  
0.99706  
0.99780  
0.99824

RS  
0.99915  
0.99659  
0.98725  
0.97424  
0.96014  
0.94699  
0.91551  
0.92845  
0.94583  
0.95731  
0.96500  
0.98185  
0.99082  
0.99386  
0.99539  
0.99631  
0.99815  
0.99908  
0.99938  
0.99954  
0.99963

RP  
0.99826  
0.99314  
0.97406  
0.94646  
0.91471  
0.88248  
0.76332  
0.69548  
0.70761  
0.73694  
0.76646  
0.85990  
0.92487  
0.94894  
0.96137  
0.96894  
0.98433  
0.99213  
0.99475  
0.99606  
0.99684

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99828  
0.99326  
0.97560  
0.95273  
0.92986

RS  
0.99888  
0.99553  
0.98410  
0.97002  
0.95709

RP  
0.99769  
0.99098  
0.96710  
0.93544  
0.90264

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.90993  
0.86035  
0.85974  
0.88085  
0.89999  
0.91491  
0.95287  
0.97553  
0.98352  
0.98759  
0.99004  
0.99500  
0.99749  
0.99833  
0.99874  
0.99900

0.94720  
0.93610  
0.95486  
0.96748  
0.97488  
0.97961  
0.98959  
0.99476  
0.99650  
0.99737  
0.99790  
0.99895  
0.99947  
0.99965  
0.99974  
0.99979

0.87266  
0.78459  
0.76463  
0.79421  
0.82510  
0.85021  
0.91615  
0.95631  
0.97055  
0.97780  
0.98219  
0.99105  
0.99551  
0.99700  
0.99775  
0.99820

PHI=80.

-58-

K= 0.0

| N         | P       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.00000 | 0.00000 | 0.00000 |
| 2.00000   | 0.42731 | 0.67008 | 0.18453 |
| 4.00000   | 0.43156 | 0.83587 | 0.02724 |
| 6.00000   | 0.44499 | 0.88924 | 0.00075 |
| 8.00000   | 0.47199 | 0.91622 | 0.02776 |
| 10.00000  | 0.50311 | 0.93257 | 0.07365 |
| 20.00000  | 0.63598 | 0.96582 | 0.30613 |
| 40.00000  | 0.77142 | 0.98278 | 0.56005 |
| 60.00000  | 0.83445 | 0.98849 | 0.68042 |
| 80.00000  | 0.87040 | 0.99135 | 0.74945 |
| 100.00000 | 0.89357 | 0.99308 | 0.79406 |

K= 0.1

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99999 | 1.00000 | 0.99999 |
| 0.02000   | 0.99997 | 1.00000 | 0.99994 |
| 0.04000   | 0.99989 | 1.00000 | 0.99977 |
| 0.06000   | 0.99962 | 0.99976 | 0.99949 |
| 0.08000   | 0.99932 | 0.99955 | 0.99909 |
| 0.10000   | 0.99893 | 0.99928 | 0.99858 |
| 0.20000   | 0.99557 | 0.99701 | 0.99413 |
| 0.40000   | 0.97939 | 0.98546 | 0.97332 |
| 0.60000   | 0.93689 | 0.95198 | 0.92179 |
| 0.80000   | 0.79331 | 0.82378 | 0.76284 |
| 1.00000   | 0.29839 | 0.33369 | 0.26308 |
| 2.00000   | 0.43060 | 0.67528 | 0.18591 |
| 4.00000   | 0.43320 | 0.83760 | 0.02879 |
| 6.00000   | 0.44679 | 0.89034 | 0.00323 |
| 8.00000   | 0.47399 | 0.91704 | 0.03094 |
| 10.00000  | 0.50527 | 0.93324 | 0.07730 |
| 20.00000  | 0.63821 | 0.96616 | 0.31027 |
| 40.00000  | 0.77317 | 0.98295 | 0.56338 |
| 60.00000  | 0.83583 | 0.98860 | 0.68305 |
| 80.00000  | 0.87153 | 0.99144 | 0.75161 |
| 100.00000 | 0.89452 | 0.99315 | 0.79589 |

K= 0.2

| N       | R       | RS      | RP      |
|---------|---------|---------|---------|
| 0.01000 | 0.99999 | 1.00000 | 0.99997 |
| 0.02000 | 0.99994 | 1.00000 | 0.99989 |
| 0.04000 | 0.99967 | 0.99979 | 0.99955 |
| 0.06000 | 0.99924 | 0.99950 | 0.99898 |
| 0.08000 | 0.99864 | 0.99910 | 0.99818 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 0.99786 | 0.99857 | 0.99715 |
| 0.20000   | 0.99117 | 0.99403 | 0.98832 |
| 0.40000   | 0.95960 | 0.97145 | 0.94775 |
| 0.60000   | 0.88242 | 0.91045 | 0.85438 |
| 0.80000   | 0.68859 | 0.73801 | 0.63918 |
| 1.00000   | 0.41025 | 0.47432 | 0.34618 |
| 2.00000   | 0.43966 | 0.68956 | 0.18977 |
| 4.00000   | 0.43799 | 0.84257 | 0.03340 |
| 6.00000   | 0.45208 | 0.89353 | 0.01062 |
| 8.00000   | 0.47990 | 0.91942 | 0.04038 |
| 10.00000  | 0.51160 | 0.93514 | 0.08807 |
| 20.00000  | 0.64475 | 0.96712 | 0.32239 |
| 40.00000  | 0.77826 | 0.98344 | 0.57308 |
| 60.00000  | 0.83982 | 0.98893 | 0.69071 |
| 80.00000  | 0.87478 | 0.99169 | 0.75788 |
| 100.00000 | 0.89726 | 0.99334 | 0.80117 |

K= 0.4

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 0.99997 | 1.00000 | 0.99994 |
| 0.02000   | 0.99989 | 1.00000 | 0.99977 |
| 0.04000   | 0.99932 | 0.99955 | 0.99910 |
| 0.06000   | 0.99847 | 0.99898 | 0.99796 |
| 0.08000   | 0.99728 | 0.99819 | 0.99638 |
| 0.10000   | 0.99574 | 0.99715 | 0.99432 |
| 0.20000   | 0.98255 | 0.98819 | 0.97690 |
| 0.40000   | 0.92361 | 0.94609 | 0.90113 |
| 0.60000   | 0.80480 | 0.85338 | 0.75623 |
| 0.80000   | 0.63155 | 0.70790 | 0.55521 |
| 1.00000   | 0.50813 | 0.61159 | 0.40467 |
| 2.00000   | 0.46761 | 0.73282 | 0.20239 |
| 4.00000   | 0.45554 | 0.85948 | 0.05159 |
| 6.00000   | 0.47192 | 0.91455 | 0.03929 |
| 8.00000   | 0.50209 | 0.92768 | 0.07650 |
| 10.00000  | 0.53530 | 0.94177 | 0.12884 |
| 20.00000  | 0.66870 | 0.97049 | 0.36691 |
| 40.00000  | 0.79653 | 0.98514 | 0.60793 |
| 60.00000  | 0.85402 | 0.99007 | 0.71796 |
| 80.00000  | 0.88630 | 0.99254 | 0.78006 |
| 100.00000 | 0.90693 | 0.99403 | 0.81983 |

K= 0.6

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 0.99996 | 1.00000 | 0.99992 |
| 0.02000  | 0.99977 | 0.99988 | 0.99966 |
| 0.04000  | 0.99899 | 0.99933 | 0.99865 |
| 0.06000  | 0.99771 | 0.99848 | 0.99697 |
| 0.08000  | 0.99593 | 0.99728 | 0.99458 |
| 0.10000  | 0.99363 | 0.99574 | 0.99152 |
| 0.20000  | 0.97421 | 0.98257 | 0.96585 |
| 0.40000  | 0.89354 | 0.92542 | 0.86157 |
| 0.60000  | 0.76266 | 0.82694 | 0.69839 |
| 0.80000  | 0.63235 | 0.72944 | 0.53527 |
| 1.00000  | 0.55871 | 0.68882 | 0.42860 |
| 2.00000  | 0.49856 | 0.77862 | 0.21849 |
| 4.00000  | 0.48058 | 0.88038 | 0.08079 |
| 6.00000  | 0.50119 | 0.91846 | 0.08393 |
| 8.00000  | 0.53473 | 0.93818 | 0.13129 |
| 10.00000 | 0.56984 | 0.95022 | 0.18945 |
| 20.00000 | 0.70211 | 0.97479 | 0.42944 |

40.00000  
60.00000  
80.00000  
100.00000

0.82110  
0.87280  
0.90142  
0.91955

0.98731  
0.99152  
0.99364  
0.99491

0.65488  
0.75408  
0.80920  
0.84420

-60-

K = 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99994  
0.99967  
0.99865  
0.99695  
0.99458  
0.99154  
0.96627  
0.86981  
0.74301  
0.64483  
0.59279  
0.52751  
0.50989  
0.53623  
0.57339  
0.61011  
0.73893  
0.84696  
0.89222  
0.91689  
0.93239

ES  
1.00000  
0.99979  
0.99910  
0.99797  
0.99638  
0.99434  
0.97725  
0.90994  
0.81998  
0.75838  
0.74219  
0.81825  
0.90060  
0.93216  
0.94857  
0.95860  
0.97905  
0.98947  
0.99297  
0.99472  
0.99577

RD  
0.99989  
0.99955  
0.99819  
0.99594  
0.99279  
0.98874  
0.95528  
0.82969  
0.66605  
0.53127  
0.44339  
0.23678  
0.11918  
0.14031  
0.19822  
0.26162  
0.49881  
0.70445  
0.79147  
0.83906  
0.86900

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99993  
0.99958  
0.99831  
0.99620  
0.99326  
0.98948  
0.95878  
0.85202  
0.73599  
0.65951  
0.61879  
0.55375  
0.54125  
0.57392  
0.61421  
0.65180  
0.77470  
0.87094  
0.90990  
0.93084  
0.94390

RS  
1.00000  
0.99973  
0.99888  
0.99747  
0.99550  
0.99297  
0.97229  
0.89939  
0.82352  
0.78617  
0.78251  
0.85042  
0.91810  
0.94414  
0.95769  
0.96595  
0.98280  
0.99136  
0.99423  
0.99567  
0.99653

RD  
0.99986  
0.99944  
0.99775  
0.99493  
0.99101  
0.98600  
0.94527  
0.80465  
0.64845  
0.53284  
0.45508  
0.25707  
0.16440  
0.20370  
0.27074  
0.33764  
0.56661  
0.75053  
0.82557  
0.86602  
0.89126

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99989  
0.99937  
0.99747  
0.99434  
0.99000

RS  
1.00000  
0.99959  
0.99831  
0.99622  
0.99333

RD  
0.99979  
0.99915  
0.99663  
0.99245  
0.98666

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.98451  
0.94239  
0.82775  
0.74177  
0.69408  
0.66614  
0.61033  
0.62027  
0.66604  
0.70965  
0.74566  
0.84728  
0.91641  
0.94260  
0.95631  
0.96474

0.98968  
0.96177  
0.88972  
0.84897  
0.84284  
0.85139  
0.90505  
0.94882  
0.96526  
0.97375  
0.97891  
0.98938  
0.99467  
0.99644  
0.99733  
0.99787

0.97933  
0.92302  
0.76578  
0.63457  
0.54532  
0.48089  
0.31562  
0.29173  
0.36683  
0.44556  
0.51242  
0.70518  
0.83815  
0.88875  
0.91529  
0.93161

-61-

K= 2.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99980  
0.99916  
0.99664  
0.99251  
0.98686  
0.97982  
0.92959  
0.82146  
0.75751  
0.72250  
0.70023  
0.65884  
0.60155  
0.74280  
0.78399  
0.81517  
0.89473  
0.94402  
0.96193  
0.97117  
0.97680

RS  
0.99988  
0.99945  
0.99776  
0.99502  
0.99127  
0.98662  
0.95417  
0.89418  
0.87731  
0.88290  
0.89404  
0.93633  
0.96632  
0.97725  
0.98284  
0.98623  
0.99308  
0.99653  
0.99769  
0.99826  
0.99861

RD  
0.99972  
0.99887  
0.99552  
0.99001  
0.98245  
0.97302  
0.90502  
0.74873  
0.63771  
0.56209  
0.50641  
0.38135  
0.41679  
0.50836  
0.58513  
0.64410  
0.79637  
0.89151  
0.92618  
0.94408  
0.95500

K= 3.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000

R  
0.99968  
0.99874  
0.99501  
0.98902  
0.98107  
0.97153  
0.91395  
0.82954  
0.78881  
0.76510  
0.75010  
0.73998  
0.79780  
0.84435  
0.87509  
0.89613  
0.94422

RS  
0.99979  
0.99916  
0.99669  
0.99273  
0.98753  
0.98138  
0.94699  
0.91583  
0.92028  
0.93091  
0.94056  
0.96692  
0.98292  
0.98853  
0.99137  
0.99309  
0.99653

RD  
0.99958  
0.99831  
0.99334  
0.98532  
0.97461  
0.96168  
0.88091  
0.74326  
0.65734  
0.59930  
0.55964  
0.51303  
0.61267  
0.70017  
0.75980  
0.79918  
0.89191

40.00000  
60.00000  
80.00000  
100.00000

0.97120  
0.98060  
0.98538  
0.98827

0.99827  
0.99884  
0.99913  
0.99931

0.94413  
0.96236  
0.97163  
0.97723

-62-

K= 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99958  
0.99832  
0.99344  
0.98581  
0.97605  
0.96490  
0.90806  
0.84376  
0.81373  
0.79690  
0.78835  
0.80229  
0.86326  
0.89968  
0.92143  
0.93560  
0.96636  
0.98285  
0.98850  
0.99135  
0.99307

RS  
0.99973  
0.99889  
0.99566  
0.99068  
0.98443  
0.97750  
0.94736  
0.93659  
0.94636  
0.95579  
0.96294  
0.98017  
0.98989  
0.99323  
0.99491  
0.99593  
0.99796  
0.99898  
0.99932  
0.99949  
0.99959

RP  
0.99944  
0.99776  
0.99123  
0.98094  
0.96767  
0.95230  
0.86877  
0.75094  
0.68111  
0.63802  
0.61377  
0.62441  
0.73662  
0.80613  
0.84795  
0.87528  
0.93476  
0.96673  
0.97768  
0.98321  
0.98654

K= 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
0.99937  
0.99751  
0.99053  
0.98037  
0.96857  
0.95648  
0.91002  
0.86868  
0.85101  
0.84541  
0.84696  
0.88174  
0.92888  
0.95021  
0.96185  
0.96912  
0.98424  
0.99205  
0.99468  
0.99601  
0.99680

RS  
0.99959  
0.99835  
0.99379  
0.98737  
0.98030  
0.97362  
0.95694  
0.96324  
0.97220  
0.97813  
0.98209  
0.99075  
0.99533  
0.99688  
0.99766  
0.99813  
0.99906  
0.99953  
0.99969  
0.99977  
0.99981

RP  
0.99916  
0.99667  
0.98728  
0.97337  
0.95584  
0.93933  
0.86311  
0.77412  
0.72992  
0.71270  
0.71184  
0.77272  
0.86244  
0.90354  
0.92605  
0.94012  
0.96941  
0.98456  
0.98968  
0.99225  
0.99379

K= 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
0.99917  
0.99672  
0.98799  
0.97636  
0.96423

RS  
0.99945  
0.99783  
0.99223  
0.98523  
0.97868

RP  
0.99988  
0.99561  
0.98376  
0.96750  
0.94979

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

0.95306  
0.91712  
0.88773  
0.87939  
0.88156  
0.88821  
0.92416  
0.95745  
0.97080  
0.97782  
0.98214  
0.99096  
0.99546  
0.99697  
0.99772  
0.99818

0.97357  
0.96743  
0.97691  
0.98338  
0.98718  
0.98960  
0.99470  
0.99734  
0.99822  
0.99867  
0.99893  
0.99947  
0.99973  
0.99982  
0.99987  
0.99989

0.93256  
0.84482  
0.79855  
0.77540  
0.77595  
0.78682  
0.85361  
0.91757  
0.94337  
0.95698  
0.96535  
0.98246  
0.99118  
0.99411  
0.99558  
0.99646

PHI=90.

-64-

K= 0.0

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 1.00000 | 1.00000 | 1.00000 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99998 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K= 0.1

| N         | R       | RS      | RD      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.99999 | 0.99999 | 0.99999 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99998 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K= 0.2

| N       | R       | RS      | RD      |
|---------|---------|---------|---------|
| 0.01000 | 1.00000 | 1.00000 | 1.00000 |
| 0.02000 | 1.00000 | 1.00000 | 1.00000 |
| 0.04000 | 1.00000 | 1.00000 | 1.00000 |
| 0.06000 | 1.00000 | 1.00000 | 1.00000 |
| 0.08000 | 1.00000 | 1.00000 | 1.00000 |

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.99999 | 0.99999 | 0.99999 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99998 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K = 0.4

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 0.99999 | 1.00000 | 0.99999 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99998 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K = 0.6

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 1.00000 | 1.00000 | 1.00000 |
| 0.02000  | 1.00000 | 1.00000 | 1.00000 |
| 0.04000  | 1.00000 | 1.00000 | 1.00000 |
| 0.06000  | 1.00000 | 1.00000 | 1.00000 |
| 0.08000  | 1.00000 | 1.00000 | 1.00000 |
| 0.10000  | 1.00000 | 1.00000 | 1.00000 |
| 0.20000  | 1.00000 | 1.00000 | 1.00000 |
| 0.40000  | 1.00000 | 1.00000 | 1.00000 |
| 0.60000  | 1.00000 | 1.00000 | 1.00000 |
| 0.80000  | 1.00000 | 1.00000 | 1.00000 |
| 1.00000  | 1.00000 | 1.00000 | 0.99999 |
| 2.00000  | 0.99999 | 1.00000 | 0.99999 |
| 4.00000  | 0.99999 | 1.00000 | 0.99998 |
| 6.00000  | 0.99998 | 1.00000 | 0.99997 |
| 8.00000  | 0.99998 | 1.00000 | 0.99996 |
| 10.00000 | 0.99997 | 1.00000 | 0.99995 |
| 20.00000 | 0.99995 | 1.00000 | 0.99990 |

40.00000  
60.00000  
80.00000  
100.00000

0.99990  
0.99985  
0.99980  
0.99975

1.00000  
1.00000  
1.00000  
1.00000

0.99980  
0.99970  
0.99959  
0.99949

-66-

K = 0.8

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99998  
0.99997  
0.99995  
0.99990  
0.99985  
0.99980  
0.99975

RS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99999  
0.99998  
0.99997  
0.99996  
0.99995  
0.99990  
0.99980  
0.99970  
0.99959  
0.99949

K = 1.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99998  
0.99997  
0.99995  
0.99990  
0.99985  
0.99980  
0.99975

RS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99997  
0.99996  
0.99995  
0.99990  
0.99980  
0.99970  
0.99959  
0.99949

K = 1.5

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

|           |         |         |         |
|-----------|---------|---------|---------|
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 1.00000 | 1.00000 | 1.00000 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99999 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K= 2.0

| N         | R       | RS      | RP      |
|-----------|---------|---------|---------|
| 0.01000   | 1.00000 | 1.00000 | 1.00000 |
| 0.02000   | 1.00000 | 1.00000 | 1.00000 |
| 0.04000   | 1.00000 | 1.00000 | 1.00000 |
| 0.06000   | 1.00000 | 1.00000 | 1.00000 |
| 0.08000   | 1.00000 | 1.00000 | 1.00000 |
| 0.10000   | 1.00000 | 1.00000 | 1.00000 |
| 0.20000   | 1.00000 | 1.00000 | 1.00000 |
| 0.40000   | 1.00000 | 1.00000 | 1.00000 |
| 0.60000   | 1.00000 | 1.00000 | 1.00000 |
| 0.80000   | 1.00000 | 1.00000 | 1.00000 |
| 1.00000   | 1.00000 | 1.00000 | 0.99999 |
| 2.00000   | 0.99999 | 1.00000 | 0.99999 |
| 4.00000   | 0.99999 | 1.00000 | 0.99998 |
| 6.00000   | 0.99998 | 1.00000 | 0.99997 |
| 8.00000   | 0.99998 | 1.00000 | 0.99996 |
| 10.00000  | 0.99997 | 1.00000 | 0.99995 |
| 20.00000  | 0.99995 | 1.00000 | 0.99990 |
| 40.00000  | 0.99990 | 1.00000 | 0.99980 |
| 60.00000  | 0.99985 | 1.00000 | 0.99970 |
| 80.00000  | 0.99980 | 1.00000 | 0.99959 |
| 100.00000 | 0.99975 | 1.00000 | 0.99949 |

K= 3.0

| N        | R       | RS      | RP      |
|----------|---------|---------|---------|
| 0.01000  | 1.00000 | 1.00000 | 1.00000 |
| 0.02000  | 1.00000 | 1.00000 | 1.00000 |
| 0.04000  | 1.00000 | 1.00000 | 1.00000 |
| 0.06000  | 1.00000 | 1.00000 | 1.00000 |
| 0.08000  | 1.00000 | 1.00000 | 1.00000 |
| 0.10000  | 1.00000 | 1.00000 | 1.00000 |
| 0.20000  | 1.00000 | 1.00000 | 1.00000 |
| 0.40000  | 1.00000 | 1.00000 | 1.00000 |
| 0.60000  | 1.00000 | 1.00000 | 1.00000 |
| 0.80000  | 1.00000 | 1.00000 | 1.00000 |
| 1.00000  | 1.00000 | 1.00000 | 1.00000 |
| 2.00000  | 0.99999 | 1.00000 | 0.99999 |
| 4.00000  | 0.99999 | 1.00000 | 0.99998 |
| 6.00000  | 0.99999 | 1.00000 | 0.99997 |
| 8.00000  | 0.99998 | 1.00000 | 0.99996 |
| 10.00000 | 0.99997 | 1.00000 | 0.99995 |
| 20.00000 | 0.99995 | 1.00000 | 0.99990 |

40.00000  
60.00000  
80.00000  
100.00000

0.99990  
0.99985  
0.99980  
0.99975

1.00000  
1.00000  
1.00000  
1.00000

0.99980  
0.99970  
0.99959  
0.99949

-68-

K = 4.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99999  
0.99998  
0.99997  
0.99995  
0.99990  
0.99985  
0.99980  
0.99975

PS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99997  
0.99996  
0.99995  
0.99990  
0.99980  
0.99970  
0.99960  
0.99949

K = 6.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000  
0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99998  
0.99997  
0.99995  
0.99990  
0.99985  
0.99980  
0.99975

PS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99997  
0.99996  
0.99995  
0.99990  
0.99980  
0.99970  
0.99959  
0.99949

K = 8.0

N  
0.01000  
0.02000  
0.04000  
0.06000  
0.08000

R  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

PS  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

RP  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

0.10000  
0.20000  
0.40000  
0.60000  
0.80000  
1.00000  
2.00000  
4.00000  
6.00000  
8.00000  
10.00000  
20.00000  
40.00000  
60.00000  
80.00000  
100.00000

1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99998  
0.99997  
0.99995  
0.99990  
0.99985  
0.99980  
0.99975

1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
1.00000

1.00000  
1.00000  
1.00000  
1.00000  
1.00000  
0.99999  
0.99999  
0.99998  
0.99997  
0.99996  
0.99995  
0.99990  
0.99980  
0.99970  
0.99959  
0.99949