

UNCLASSIFIED

AD NUMBER

AD015011

CLASSIFICATION CHANGES

TO: unclassified

FROM: confidential

LIMITATION CHANGES

TO:
Approved for public release; distribution is unlimited.

FROM:
Controlling DoD Organization: Naval Proving Ground, Dahlgren, VA.

AUTHORITY

Naval Surface Weapons Center notice dtd 15 Sep 1977; NSWC notice dtd 15 Sep 1977

THIS PAGE IS UNCLASSIFIED

AD No. 75011
ASTIA FILE COPY

SECURITY INFORMATION

U S NAVAL PROVING GROUND
DAHLGREN VIRGINIA

REPORT NO 1153

BOMBS AND ASSOCIATED COMPONENTS

67th Partial Report

COLD WEATHER TESTING OF FIN ASSEMBLIES
TYPE EX 10 MOD 10 AND MK 83 MOD 1

FINAL Report

Copy No. 11

Task

Assignment MPG Re3c-321-1-53

Classification CONFIDENTIAL
SECURITY INFORMATION

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

PART A

SYNOPSIS

1. This is a final report on the cold weather testing of the Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies.
2. This test was performed to determine the effects, if any, of low temperature on the assembly of the Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies.
3. It is concluded that:
 - a. The Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies can be assembled to their respective bomb bodies almost as fast at -65°F as they can at +73°F.
 - b. At low temperatures the method of attaching the Mk 83 Mod 1 Fin Assembly to a bomb is superior to that of the Ex 10 Mod 10 Fin Assembly.
 - c. The Ex 10 Mod 10 Fin Assembly is not as practicable for service use as the Mk 83 Mod 1.

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

TABLE OF CONTENTS

	<u>Page</u>
SYNOPSIS	1
TABLE OF CONTENTS.	2
AUTHORITY.	3
REFERENCES	3
BACKGROUND	3
OBJECT OF TEST	3
PERIOD OF TEST	3
DESCRIPTION OF ITEM UNDER TEST	4
DESCRIPTION OF TEST EQUIPMENT.	4
PROCEDURE.	5
RESULTS AND DISCUSSION	5
CONCLUSIONS.	6
APPENDIX A - NPG PHOTOGRAPHS	FIGURES 1-2 (Incl)
APPENDIX B - DISTRIBUTION.	1-2 (Incl)

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

PART B

INTRODUCTION

1. AUTHORITY:

This test was conducted under Task Assignment NPG-Re3c-321-1-53 authorized by reference (a) and in accordance with enclosure (1) of reference (b).

2. REFERENCES:

- a. BUORD Conf ltr NP9 Re3c-EEK:mp Ser 42777 of 29 July 1952
- b. BUORD Conf ltr NP9 Re3c-RFG:hjk Ser 55275 of 15 April 1953
- c. NPG Conf Report No. 1113 of 15 April 1953

3. BACKGROUND:

Assembly, catapult and drop tests have been conducted with the Fin Assembly, Type Ex 10 Mod 10A, and are the subject of reference (c).

4. OBJECT OF TEST:

The purpose of this test was to determine the effects, if any, of low temperature on the assembly of the Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies.

5. PERIOD OF TEST:

- | | |
|---------------------------|---------------|
| a. Date of Project Letter | 15 April 1953 |
| b. Date Material Received | 7 April 1953 |
| c. Date Commenced Test | 30 April 1953 |
| d. Date Completed Test | 1 May 1953 |

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

PART C

DETAILS OF TEST

6. DESCRIPTION OF ITEM UNDER TEST:

The Ex 10 Mod 10 Fin Assembly used for this test was identical to the Ex 10 Mod 10A Fin Assembly reported in reference (c). The Ex 10 Mod 10 and the Mk 83 Mod 1 Fin Assemblies are identical in construction except for the method of attaching to the bomb body. The Ex 10 Mod 10 Fin Assembly utilizes a locking mechanism described in detail in reference (c), whereas the Mk 83 Mod 1 Fin Assembly is attached to the bomb body by means of six (6) Allen head set-screws. The Mk 83 Mod 1 fin assembly is for use on the Ex 10 Mod 15 bomb body.

7. DESCRIPTION OF TEST EQUIPMENT:

a. The cold weather test was performed in the Altitude Chamber of the Aviation Ordnance Department. This chamber is a standard Navy type, modified to permit firing through ports in one end. The main chamber is 12 feet in diameter and 18 feet in length on the inside. The actual floor working area that was free of other equipment was 18 feet by 5 feet. The air lock is seven (7) feet in diameter and six (6) feet in length with a door opening 56 inches in diameter. The temperature range for this chamber is from -67°F to ambient. The pressure range is from atmospheric to 1.7 p.s.i. (50,000 feet altitude). There is no humidity control.

b. To enter the cold chamber it was required that each individual wear the following standard Naval Aviation winter type clothing:

- (1) Winter Flying Suits, wool backed, nylon, Stock No. R37-S-5349-42.
- (2) Winter Flying Boots, Stock No. R37-B-4214.
- (3) Face Masks, Knitted, Stock No. R37-M-143.
- (4) Gloves, Intermediate, leather, five (5) finger type with wool inner lining, Stock Nos. R37-G-2505-30 and R37-G-2500-30.

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

8. PROCEDURE:

a. The Fin Assemblies, Type Ex 10 Mod 10 and Mk 83 Mod 1, were placed in the altitude Chamber simultaneously with their respective bomb bodies, the Ex 10 Mod 10 and Ex 10 Mod 15. The fin assemblies and bomb bodies were allowed to soak for four (4) hours at low temperature, the last two (2) hours of which were at -65°F .

b. Cold weather clothing of standard Naval Aviation winter issue was worn by each person in the Altitude Chamber. One (1) Aviation Ordnanceman, 2nd Class, and one (1) Civilian Battery Attendant, 2nd step, were the personnel used for the assembly test.

9. RESULTS AND DISCUSSION:

a. Subsequent to the four (4) hour soaking period, the assembly crew and cameramen entered the Altitude Chamber. The temperature was -64°F at the start of the test and had risen to -60°F by the end of the test. This was caused by the refrigeration equipment and the circulating fans being shut off during the test so that normal voice communications were audible.

b. Some difficulty was encountered during the low temperature test of the Ex 10 Mod 10 Fin Assembly. The fin assembly was mounted on the bomb with the indicator pins in the mount position and the connector pins on the fin assembly aligned with the receiving holes in the base plate of the bomb. When the assembly is in this position the rotation of knurled nuts should lock the connector pins in their respective receiving holes. The initial rotation of these knurled nuts could not be accomplished by hand because the locking mechanisms of the fin assembly had become fouled with frost and ice. Pressure was applied to the knurled nuts using a screw driver as a lever. It was necessary to rotate the knurled nuts $1/4$ to $1/2$ turn with the screw driver before they were sufficiently free to allow rotation by hand. The knurled nuts could then be rotated by hand 85 to 95 per cent of the full lock position. The screw driver, used as a lever, was required to attain the last 5 to 15 per cent of full lock position. Approximately four (4) minutes were required to secure the Ex 10 Mod 10 Fin Assembly to the Ex 10 Mod 10 Bomb. An assembly test conducted at ambient temperature with other conditions the same as above required 1 minute and 45 seconds for completion, and no difficulties were encountered.

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

c. The low temperature assembly test of the Mk 83 Mod 1 Fin Assembly presented no difficulties. The fin assembly was properly positioned and secured in approximately two (2) minutes. The six (6) set-screws worked freely and did not hinder operations. An assembly test conducted at ambient temperature with other conditions the same as at low temperature required 1 minute and 17 seconds for completion and no difficulties were encountered.

d. The Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies were removed from the Altitude Chamber and allowed to sweat until beaded with moisture. Figures 1 and 2 show the fin assemblies at different stages of the sweating period. Subsequent to the sweating period, they were returned to the Altitude Chamber and allowed to soak for two (2) hours at -63°F . Assembly tests were conducted at the termination of this soaking period and the same results were experienced as those stated in the preceding paragraphs.

PART D

CONCLUSIONS

10. It is concluded that:

a. The Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies can be assembled to their respective bomb bodies almost as fast at -65°F as they can at $+73^{\circ}\text{F}$.

b. At low temperatures the method of attaching the Mk 83 Mod 1 Fin Assembly to a bomb is superior to that of the Ex 10 Mod 10 Fin Assembly.

c. The Ex 10 Mod 10 Fin Assembly is not as practicable for service use as the Mk 83 Mod 1.

CONFIDENTIAL

NPG REPORT NO. 1153

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

The tests upon which this report is based were conducted by:

A. J. STEPPE, Project Engineer
Aircraft Ordnance Stores Division
Aviation Ordnance Department

This report was prepared by:

A. J. STEPPE, Project Engineer
Aircraft Ordnance Stores Division
Aviation Ordnance Department

This report was reviewed by:

J. R. PETERS, Head Engineer
Aircraft Ordnance Stores Division
Aviation Ordnance Department

R. T. LYNN, Lieutenant Commander, USN
Aircraft Ordnance Stores Officer
Aviation Ordnance Department

J. C. TALLEY, Director of Research
Aviation Ordnance Department

F. A. NUSOM, Captain, USN
Aviation Ordnance Officer
Aviation Ordnance Department

C. C. BRAMBLE, Director of Research
Ordnance Group

APPROVED: J. F. BYRNE
Captain, USN
Commander, Naval Proving Ground

E. A. Ruckner

E. A. RUCKNER
Captain, USN
Ordnance Officer
By direction

CONFIDENTIAL
SECURITY INFORMATION

CONFIDENTIAL

NPG REPORT NO. 1153

U. S. NAVAL PROVING GROUND
DAHLGREN, VIRGINIA


Sixty-seventh Partial Report
on
Bombs and Associated Components

Final Report
on
Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

Project No.: NPG-Re3c-321-1-53
Copy No.: 11
No. of Pages: 7

Date: JUL 16 1953

CONFIDENTIAL
SECURITY INFORMATION

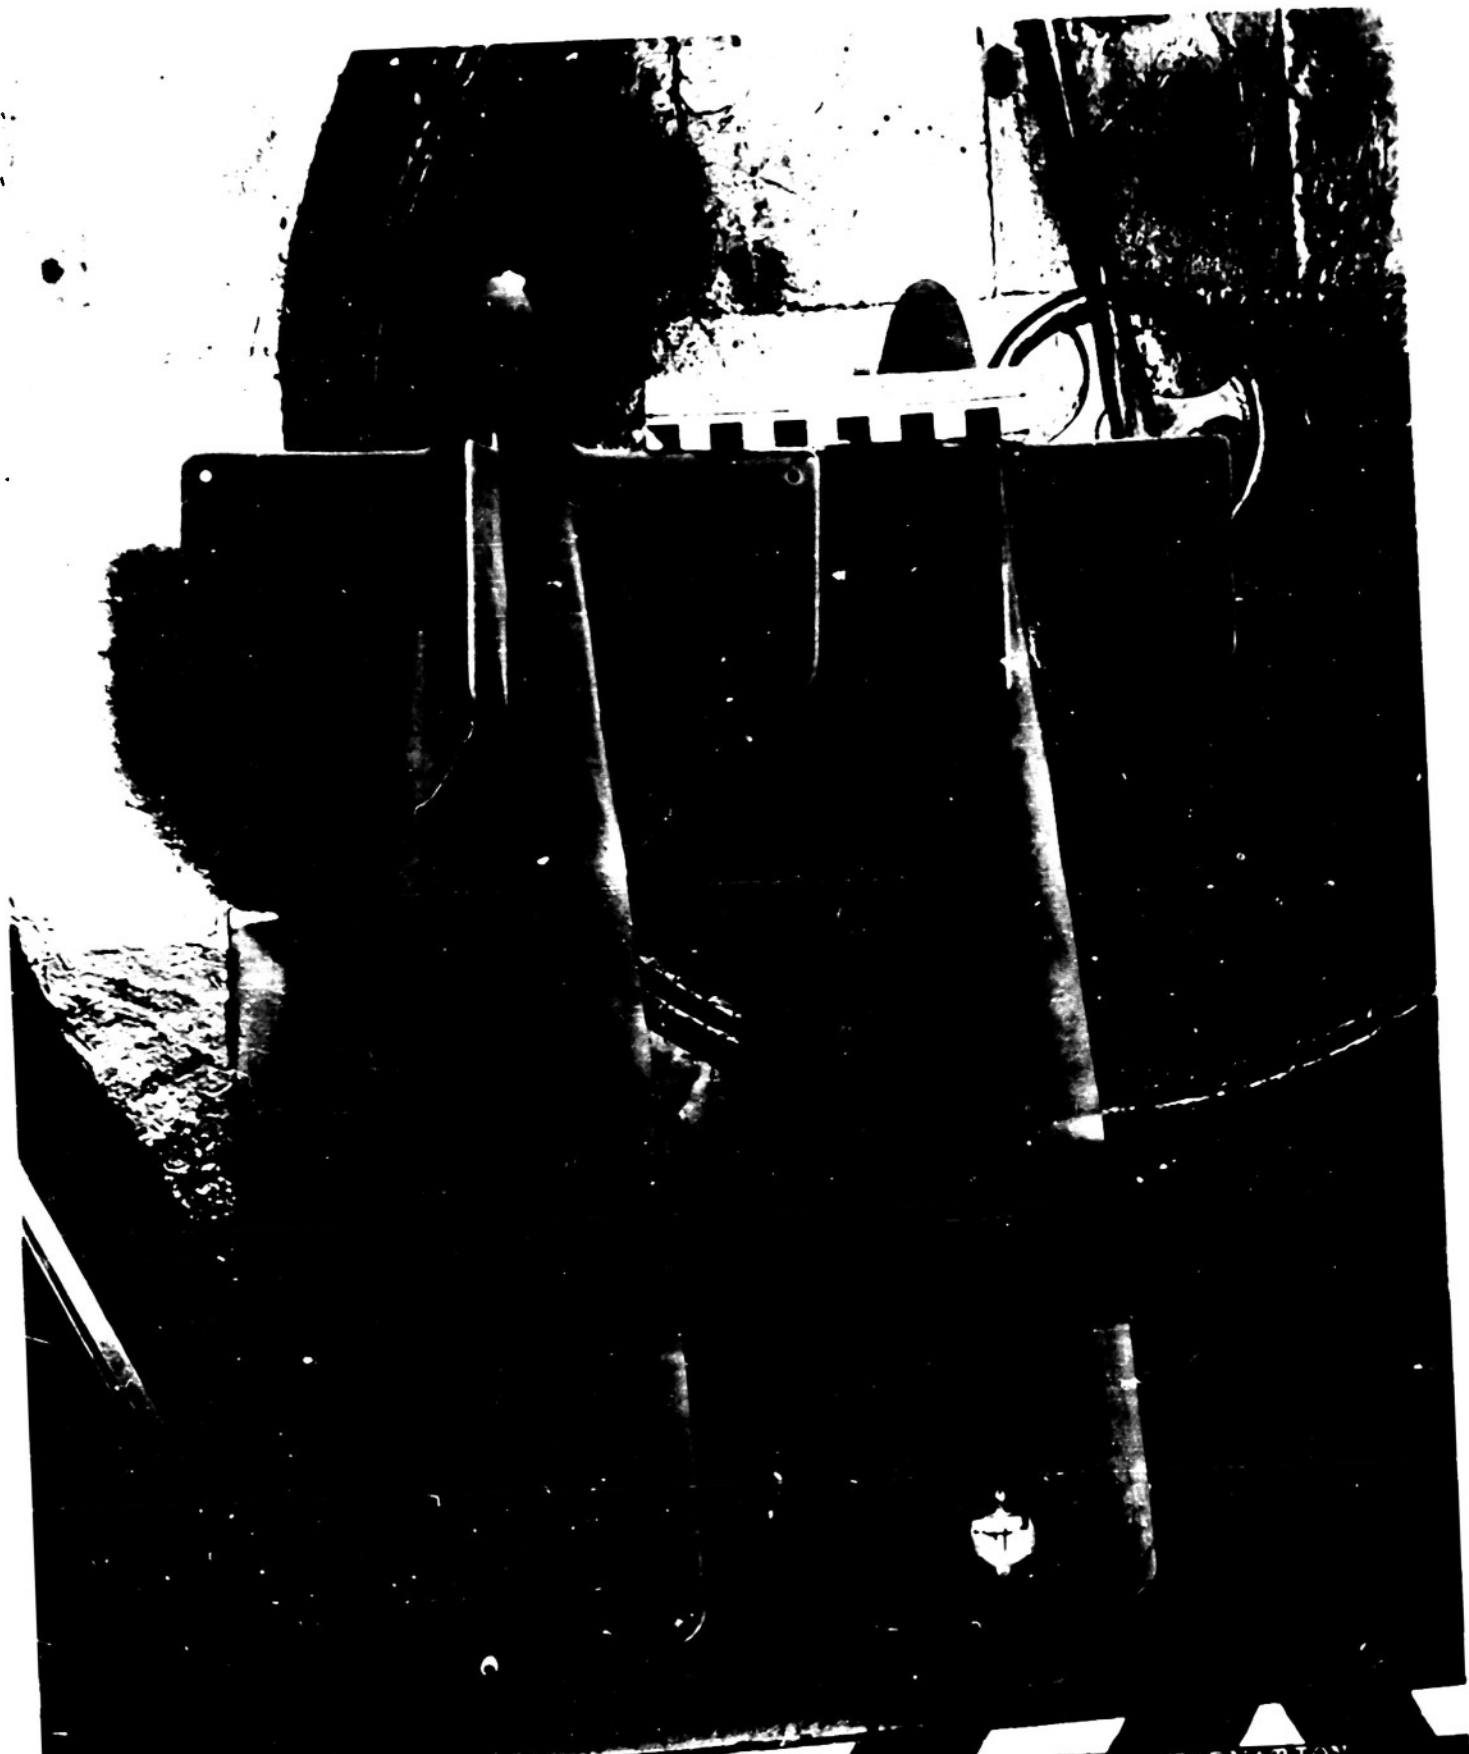

1 May 1953
Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies (the Mk 83 Mod 1 is on the left). Vertical view of fin assemblies immediately following their removal from the Altitude Chamber. (Note covering of frost). Figure 1

SECURITY INFORMATION


APPENDIX A

CONFIDENTIAL
SECURITY INFORMATION

NP9-63510
1 May 1953
Type Ex 10 Mod 10 and Mk 83 Mod 1 Fin Assemblies (the Mk 83 Mod 1 is on the left). End view of fin assemblies five (5) minutes after removal from the Altitude Chamber. (Note extent of sweating).

APPENDIX A

Figure 2

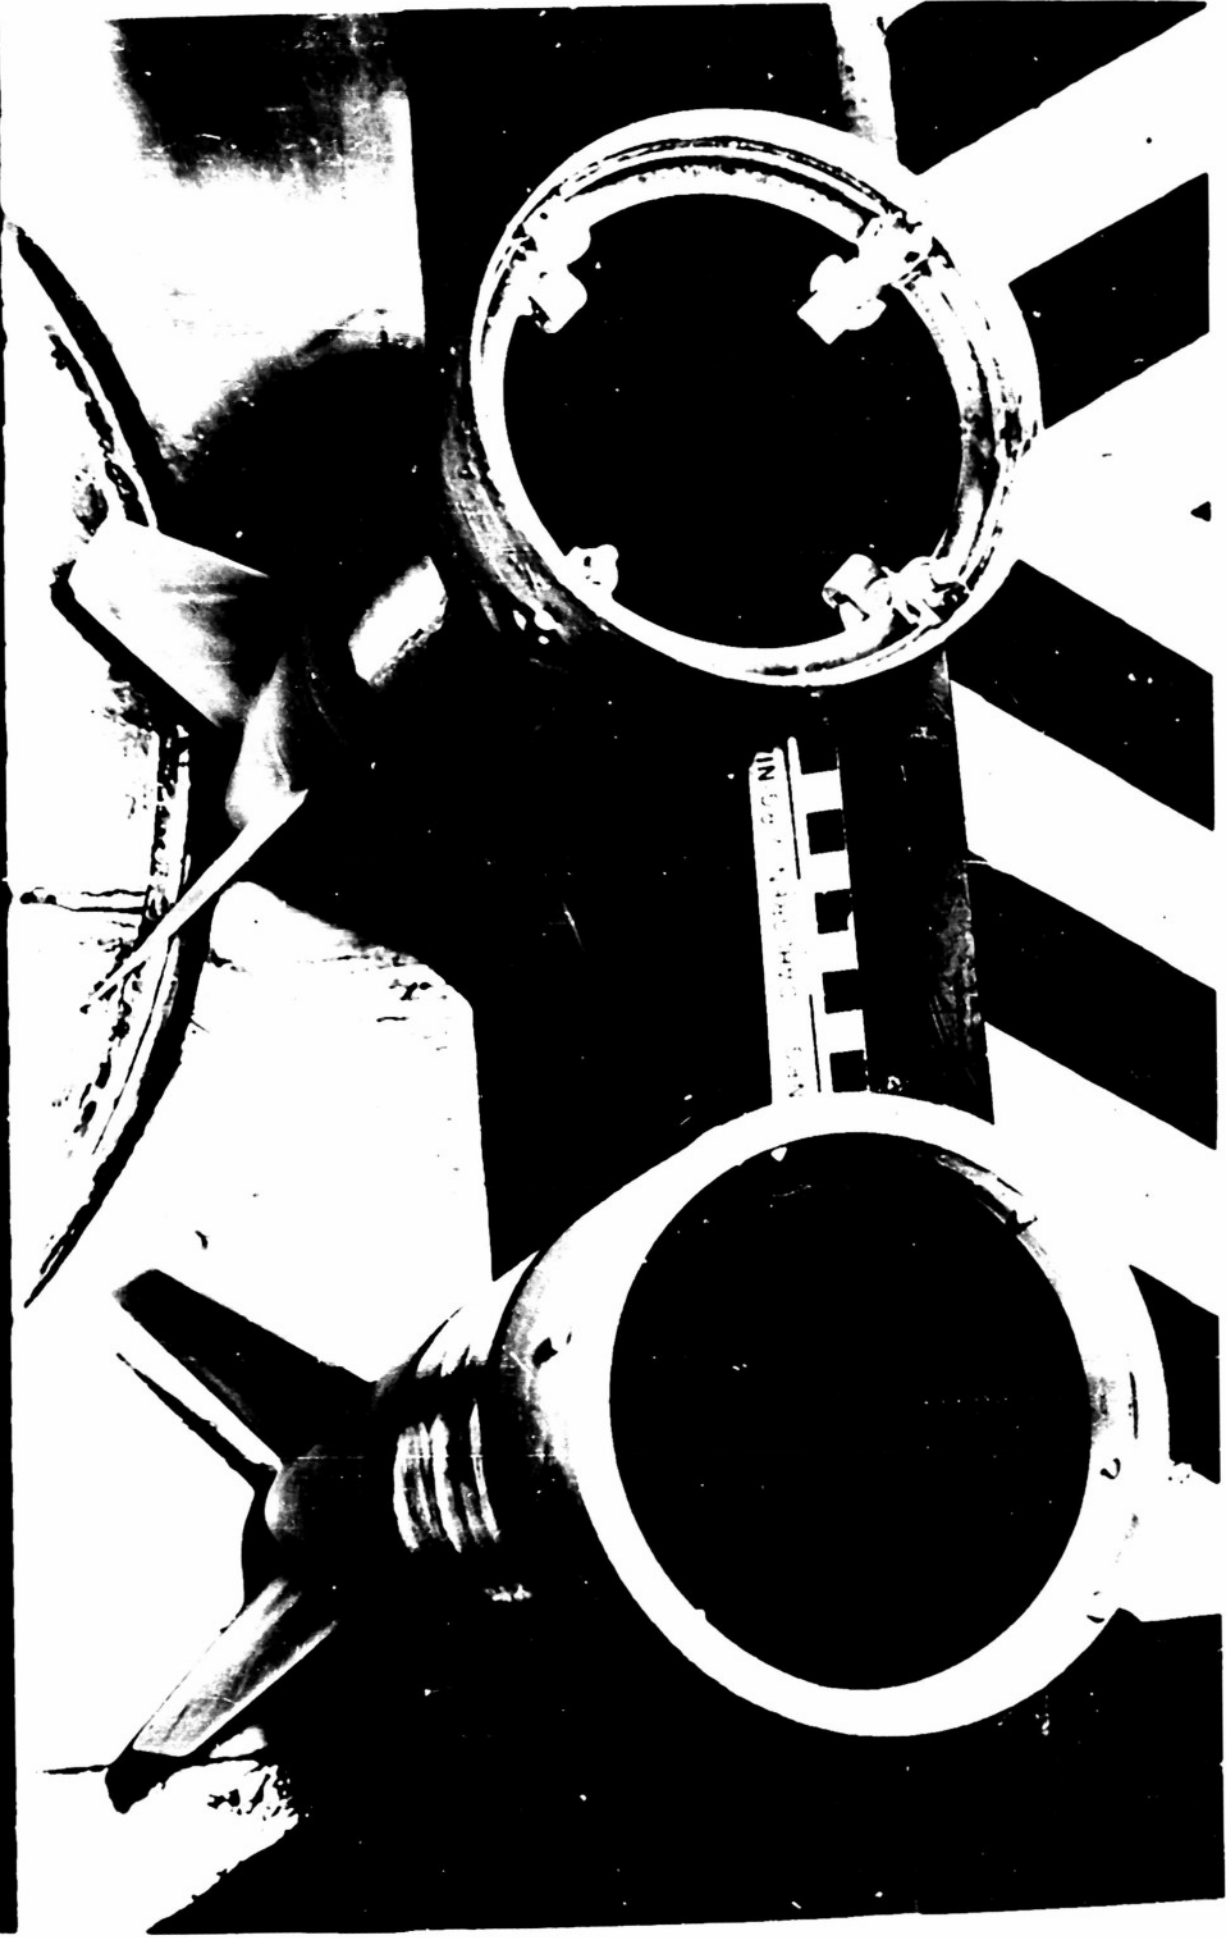

Cold Weather Testing of Fin Assemblies
Type Ex 10 Mod 10 and Mk 83 Mod 1

DISTRIBUTION

Bureau of Ordnance

Ad3	1
Re3	1
Re3c	7

Director,
Armed Services Technical Information Agency
Document Service Center
Knott Building
Dayton 2, Ohio

1

Commanding General, Aberdeen Proving Ground
Aberdeen, Maryland
Attn: Technical Information Section
Development and Proof Services

1

Commander, Operational Development Force,
U. S. Atlantic Fleet, U. S. Naval Base,
Norfolk 11, Virginia

1

Navy Research Section
Library of Congress
Washington 25, D. C.
(Via BUORD Re3)

2

Superintendent,
Naval Gun Factory

2

Bureau of Aeronautics
Attn: Armament Section

2

NATC, Patuxent River, Maryland

3

Naval Auxiliary Air Station
Chincoteague, Virginia

1

Air Material Command Liaison Officer
Wing 3 Headquarters, Aberdeen Proving Ground,
Aberdeen, Maryland

2

Cold Weather Testing of Fin Assemblies
 Type Ex 10 Mod 10 and Mk 83 Mod 1

DISTRIBUTION (Continued)

Naval Liaison Officer USAFPGC, Eglin Field, Florida	1
Department of the Navy Chief of Naval Operations Washington 25, D. C. Op - 03D3 Office	1
NOTS, Inyokern, California	1
Naval Air Development Center, Johnsville, Pennsylvania	1
U. S. Air Force, AMC Engineering Field Office Room 1833, Main Navy Building Navy Department, Washington, D. C.	2
Commanding General Air Force Armament Center Eglin Air Force Base, Florida Attn: Technical Library	1
Commanding Officer Picatinny Arsenal Dover, New Jersey Attn: Technical Division	1
Commanding Officer Picatinny Arsenal Dover, New Jersey Attn: Technical Division-Bomb Unit	1
Local:	
OV	1
OVX	1
File	1