

AD 606564




FRACTURE TOUGHNESS OF D6AC STEEL SHILLELAGH ROCKET MOTOR CASE

by

ROBERT M. KATZ

COPY 23 11 3 1964
HARD COPY \$2.00
MICROFICHE \$.650
30p

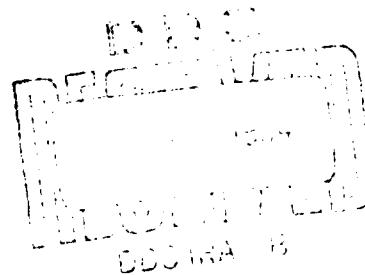

20040702042

**CLEARINGHOUSE FOR FEDERAL SCIENTIFIC AND TECHNICAL INFORMATION CFSTI
DOCUMENT MANAGEMENT BRANCH 410.11**

LIMITATIONS IN REPRODUCTION QUALITY

ACCESSION # A

- ☒ 1. WE REGRET THAT LEGIBILITY OF THIS DOCUMENT IS IN PART UNSATISFACTORY. REPRODUCTION HAS BEEN MADE FROM BEST AVAILABLE COPY.
- ☐ 2. A PORTION OF THE ORIGINAL DOCUMENT CONTAINS FINE DETAIL WHICH MAY MAKE READING OF PHOTOCOPY DIFFICULT.
- ☐ 3. THE ORIGINAL DOCUMENT CONTAINS COLOR, BUT DISTRIBUTION COPIES ARE AVAILABLE IN BLACK-AND-WHITE REPRODUCTION ONLY.
- ☐ 4. THE INITIAL DISTRIBUTION COPIES CONTAIN COLOR WHICH WILL BE SHOWN IN BLACK-AND-WHITE WHEN IT IS NECESSARY TO REPRINT.
- ☐ 5. LIMITED SUPPLY ON HAND: WHEN EXHAUSTED, DOCUMENT WILL BE AVAILABLE IN MICROFICHE ONLY.
- ☐ 6. LIMITED SUPPLY ON HAND: WHEN EXHAUSTED DOCUMENT WILL NOT BE AVAILABLE.
- ☐ 7. DOCUMENT IS AVAILABLE IN MICROFICHE ONLY.
- ☐ 8. DOCUMENT AVAILABLE ON LOAN FROM CFSTI (TT DOCUMENTS ONLY).
- ☐ 9.

NBS 9 64

PROCESSOR:

Rocket motor materials
Steel, high strength
Fracture toughness

FRACTURE TOUGHNESS OF D6AC STEEL
SHILLELAGH POCKET MOTOR CASE

Technical Report AMRA TR 64-19

by

Robert N. Katz

July 1964

AVCMS Code 5541.12.25102.05
Burst Tests of Shillelagh Rocket Motor Case

MATERIALS ENGINEERING DIVISION
U. S. ARMY MATERIALS RESEARCH AGENCY
WATERTOWN, MASSACHUSETTS 02172

U. S. ARMY MATERIALS RESEARCH AGENCY


FRACTURE TOUGHNESS OF D6AC STEEL
SHILLELAGH ROCKET MOTOR CASE

ABSTRACT

Burst tests and fracture toughness measurements on D6AC Shillelagh missile motor cases were carried out. The burst testing was done over a temperature range from room temperature down to -200 F. Results of these tests showed that the motor cases burst at approximately 250,000 psi hoop stress regardless of test temperature, and that all fractures were 100 percent shear. Fracture toughness measurements were made on cases containing machined and fatigue-cracked through-the-thickness notches, at room temperature and -65 F. The results of these measurements were in good agreement with previously obtained flat sheet data on similar materials.


ROBERT N. KATZ
Physical Metallurgist

APPROVED:


E. N. HEGGE
Chief
Materials Engineering Division

CONTENTS

	Page
ABSTRACT	
INTRODUCTION	3
BACKGROUND	3
MATERIAL	3
FABRICATION AND HEAT TREATMENT	4
EXPERIMENTAL PROCEDURE	5
BURST TESTING	5
FRACTURE TOUGHNESS MEASUREMENTS	6
RESULTS AND DISCUSSION	7
CONCLUSIONS	10
ACKNOWLEDGMENTS	11
APPENDIX A. ELECTRON BEAM WELDS	12
APPENDIX B. END CLOSURE AND PRESSURE PACKING DESIGN	14
REFERENCES	16

INTRODUCTION

The initial design of the Shillelagh missile motor case specified the use of H11 steel. In tests conducted by this Agency during October 1961 on Shillelagh motor cases fabricated from H11 steel of 0.047-inch thickness, it was shown that brittle fracture occurred at -65 F. A recommendation was made to change the material to one which would have high fracture toughness and would behave in a ductile manner at this low temperature. It is interesting to note that subsequent to this recommendation, investigations^{1,2} on the fracture toughness of H11 steel have shown that the critical thickness at room temperature for the ductile-brittle transition for material with yield strengths ranging from 190 ksi to about 230 ksi is approximately 0.040 inch. These findings further validate the recommendation to change the material for the Shillelagh missile motor case. The material recommended was D6AC steel.

This report will be concerned with the burst tests and fracture toughness measurements on the Shillelagh missile motor cases. Burst tests of actual Shillelagh motor cases fabricated from D6AC steel were carried out. Values of the fracture toughness calculated directly from motor cases containing through-the-thickness notches were obtained and were correlated with fracture toughness obtained from flat sheet tensile data.³

BACKGROUND

To provide technical support for the Shillelagh motor case program, this Agency undertook a project which consisted of a thorough investigation of the smooth and notch tensile properties of 0.040-inch-thick D6AC sheet material.³ From this investigation it was learned that D6AC steel, which has been austenitized at 1650 F and quenched and tempered in the 1000 to 1100 F range, maintained adequate fracture toughness (K_{IC} greater than 175 ksi $\sqrt{\text{in.}}$) at temperatures well below -65 F, while at the same time maintaining high levels of yield and tensile strengths (yield strength greater than 220 ksi). The relevant smooth and notch tensile data for D6AC steel sheet 0.040-inch thick are presented in Table I.

MATERIAL

The Shillelagh missile motor cases studied in this investigation were provided by the prime contractor at the request of U. S. Army Missile Command. These motor cases were made of D6AC steel forgings whose composition is given in Table II.

TABLE I. Smooth and Notch Tensile Properties of 0.040-Inch D6AC Sheet

Test Temperature (F)	Yield Strength (ksi)	Tensile Strength (ksi)	NTS (ksi)	$\frac{NTS}{UTS}$	Shear (%)	K_{c4} (ksi $\sqrt{\text{in.}}$)	$\left(\frac{G_c}{\text{in-lb}}\right)$ (sq in.)
1000 F Temper							
RT	216.5	238.5	197.0	0.83	100	182.5	1110
-40	223.5	253.5	193.5	0.77	90	182.5	1110
-120	226.5	256.0	161.0	0.63	85	128.0	545
-160	229.0	262.5	156.0	0.60	41	114.0	435
-200	233.5	271.5	147.5	0.55	25	106.5	380
1050 F Temper							
RT	211.5	237.5	207.0	0.87	100	197.0	1295
-40	215.0	247.5	203.5	0.82	100	192.5	1235
-120	229.0	256.0	169.0	0.66	95	141.0	665
-160	224.5	265.0	154.0	0.58	63	115.5	445
-200	237.5	269.0	143.5	0.53	23	103.0	355
1100 F temper							
RT	209.5	232.0	215.5	0.93	100	207.5	1435
-40	218.5	243.0	205.2	0.85	100	188.0	1180
-120	219.5	244.5	185.5	0.75	90	169.5	960
-160	220.0	251.0	158.0	0.67	95	143.5	685
-200	236.5	264.0	138.5	0.53	20	104.0	360

All specimens austenitized 20 minutes at 1650 F, air cooled.


All specimens tempered 1+1 hour at temperatures indicated.

TABLE II. Chemical Analysis of D6AC Steel

	Elements (weight %)								
	C	Mn	Si	Cr	Ni	P	S	Mo	V
Manufacturer's Analysis	0.43	0.78	0.26	0.97	0.58	0.008	0.009	0.97	0.08
Normal Composition Limits	0.42-0.49	0.60-0.90	0.15-0.30	0.90-1.20	0.40-0.70	0.015 max	0.015 max	0.90-1.10	0.05-0.10

FABRICATION AND HEAT TREATMENT

The Shillelagh missile motor case consisted of three D6AC forgings: one for the gas generator, one for the motor, and one for the bulkhead between these two sections. These forgings ranged in minimum section thickness from 0.040 inch in the gas generator to 0.047 inch in the missile motor and had built-up wall thicknesses next to the bulkheads. The three forgings were electron-beam welded (see Appendix A) to form the complete Shillelagh missile motor case unit. A photograph of the cross section of this motor case is presented in Figure 1. After welding, the motor cases were given the following heat treatment: preheat to 900 F; austenitize in an inert bath for 30 minutes at 1650 F; quench in salt at 400 F for 5 minutes; air cool; temper one hour in salt at 400 to 450 F;

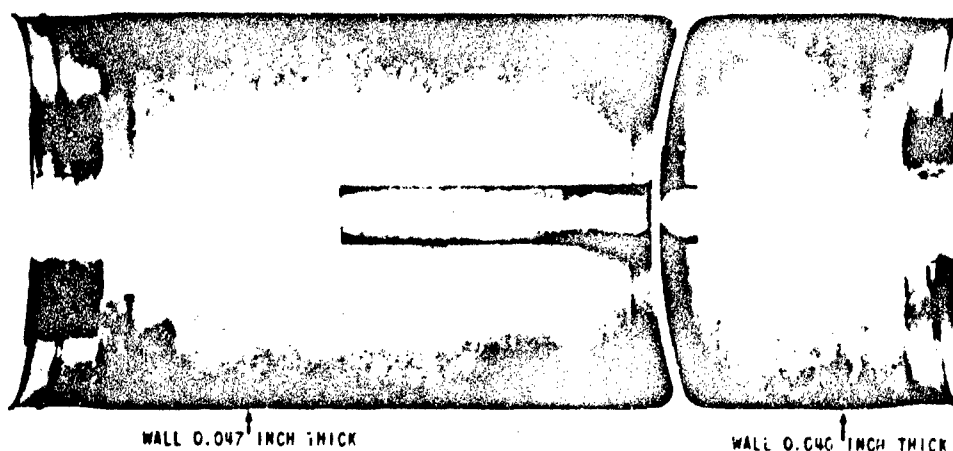

19-066-1872/AMC-63

Figure 1. CROSS-SECTIONAL VIEW OF SHILLELAGH SOLID PROPELLANT MISSILE MOTOR CASE

air cool; and air temper at 1025 F for two hours followed by an air cool. This heat treatment rendered the material fully martensitic with a Rockwell C hardness of approximately 45.

EXPERIMENTAL PROCEDURE

The experiments consisted of evaluating the burst strength of the Shillelagh missile motor cases at temperatures ranging from room temperature down to -200 F, and of measuring the fracture toughness of the cases at room temperature and -65 F. In order to make these measurements, it was necessary to devise pressure packings and end closures which could maintain their integrity at test temperatures as low as -200 F (for details on packings see Appendix B). To measure the fracture toughness, it was necessary to machine through-the-thickness slots in the motor cases. Fatigue cracking of some of the motor cases was also attempted and various means of measuring slow crack growth were investigated.

BURST TESTING

Burst tests were accomplished by packing both ends of the Shillelagh missile motor case, as described in Appendix B and loading hydrostatically by means of a pressurizing fluid. The pressurizing fluids used were water-soluble oil for room temperature tests and ethylene glycol for low-temperature tests. The low-temperature tests were made by immersing the motor case containing the pressurizing fluid in a bath of the desired temperature and allowing the system to equilibrate. Temperature readings were taken by means of thermocouples both within the motor case and in the low-temperature bath. When temperature equilibrium was achieved, the motor cases were loaded to failure.

FRACTURE TOUGHNESS MEASUREMENTS

To calculate the plane stress fracture toughness K_C of D6AC Shillelagh missile motor cases, the following formula^{4,5} for the fracture toughness of through-the-thickness notched cylindrical pressure vessels was used:

$$A_{cr} = \frac{1}{\pi} \left(\frac{K_C}{\sigma} \right)^2 - \frac{1}{2\pi} \left(\frac{K_C}{\sigma_{ys}} \right)^2. \quad (1)$$

Rearranging terms to solve for K_C ,

$$K_C = \sqrt{\frac{A_{cr}\pi}{\left[\left(\frac{1}{\sigma} \right)^2 - \frac{1}{2} \left(\frac{1}{\sigma_{ys}} \right)^2 \right]}} \quad (2)$$

where

K_C = plane stress fracture toughness

σ = applied stress in vessel normal to crack (hoop stress)

A_{cr} = 1/2 critical crack length (visual estimate)

σ_{ys} = tensile yield strength (at test temperature).

The hoop stress σ was calculated on the basis of the expression:

$$\sigma = \frac{PD}{2t} \quad (3)$$

where

P = burst pressure

D = vessel diameter

t = vessel thickness.

In order to utilize Equation 2 to calculate K_C values for the Shillelagh motor cases, through-the-thickness notches were machined in five of the motor cases. These notches were Elox slots 0.009 inch thick and 0.150 inch long (one case had a 0.250-inch-long notch). Three of the cases were fatigued to produce natural cracks. Case 110 was cycled from a maximum load of 2000 psi to a minimum load of 200 psi over 375 cycles and between 1500 and 200 psi over 450 cycles, which produced a fatigue crack 0.515 inch long (including the 0.150-inch Elox slot). Case 105 was cycled from maximum loads of 2000 psi to minimum loads at 200 psi over a period of 425 cycles, and at a maximum load of 1500 psi over a period of 173 cycles. This produced a fatigue crack 0.610 inch long. Case 113 was cycled between 2200 and 200 psi 60 times, between 2000 and 200 psi 65 times, and between 1600 and 200 psi 45 times. This resulted in a fatigue crack 0.300 inch long.

In order to maintain the internal pressure in the presence of a through-the-thickness notch, it was necessary to use a patch. The internal patch utilized in this study consisted of a layer of copper next to the notch, backed by a layer of Teflon, which was backed by a layer of Mylar; these layers were approximately 0.010 inch thick. The layers were held in place by neoprene cement.

Several methods of determining the slow crack growth $2A_{cr}$ were tried. One of these was an acoustical method using microphones and vibration-sensitive transducers to pick up the onset of fast fracture. However, the high level of background noise due to the mechanical pumping equipment (used to pressurize the motor cases) precluded the success of this technique. Ink staining also proved unsuccessful due to the ability of the pressurizing fluid to dissolve the stain. The most satisfactory technique proved to be visual determination on the basis of changes in fracture appearance.

RESULTS AND DISCUSSION

The results of the burst tests conducted on the D6AC steel Shillelagh motor cases and fracture toughness measurements on these cases are summarized in Table III.

TABLE III. Burst Test Data for D6AC Shillelagh Motor Cases


Case	Slot Length (inches)	A_{cr} (inches)	Burst Pressure (ksi)	Hoop Stress σ (ksi)	Approximate K_{IC} (ksi)	Shear (%)	Test Temperature (F)
112	None	-	3.8*	-	-	-	-65
114		-	3.7	244	-	100	70
106		-	4.0	253	-	100	-55
116		-	4.0	254	-	100	-65
111		-	3.9	243	-	100	-85
104		-	3.9*	-	-	-	-200
115	0.150	0.148	3.1	183	172	100	70
101	0.250	0.300	2.9	183	156	100	-65
	0.150						
110	fatigued to 0.515	0.257	1.6	102	144**	100	70
	0.150						
105	fatigued to 0.610	0.305	1.4	88.6	90**	100	70
	0.150						
113	fatigued to 0.300	0.173	2.4	151	168	100	70

*Case yielded without fracture, end closure leaked.

**Case yielded during fatiguing, hence K_{IC} was low due to strain hardening.


All of the D6AC Shillelagh rocket motor cases broke in the missile motor section of the case, even though the wall thickness in this portion was 0.047 inch as compared to 0.040 inch in the gas generator section. However, the gas generator section had a much smaller length-to-diameter ratio than the rocket motor portion. As a result of this condition, the bulkhead imposed more restraint on the gas generator portion than on the rocket motor portion and therefore failure occurred in the rocket motor portion. Every D6AC Shillelagh motor case which burst exhibited 100 percent shear fracture. This was true from room temperature down to -85 F. The burst hoop stresses which were recorded for the unnotched motor cases were all between 244,000 and 254,000 psi, that is, within 4 percent of each other. It is interesting to note that the two cases which yielded and leaked during testing yielded in this 250,000 psi range. Thus, the D6AC Shillelagh motor case displays an extremely high degree of reproducibility of burst strength even over a wide temperature range.

One case (No. 115) which contained a 0.150-inch-long through-the-thickness notch, but was not fatigue cracked, was tested at 70 F. The K_I calculated from this test was 172 ksi $\sqrt{\text{in.}}$, which compares favorably to the value of approximately 190 ksi $\sqrt{\text{in.}}$ which may be interpolated from the sheet data presented in Table I. A second Shillelagh motor case (No. 101) containing a 0.250-inch-long through-the-thickness notch with no fatigue crack, was tested at -65 F. This case had a K_I of 156 ksi $\sqrt{\text{in.}}$, which, again, when compared with Table I is low but not more than 10 to 15 percent. A photograph of this failed case together with a fractograph of the resultant fracture surface is shown in Figure 2. Two cases

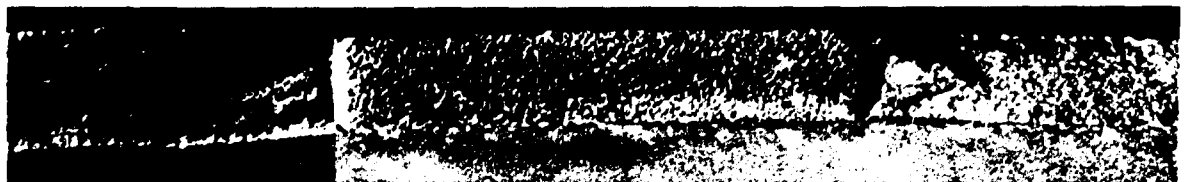

COMPOSITE FRACTOGRAPH SHOWING THE EXTENT OF THE SLOW CRACK GROWTH REGION (BOUNDED BY ARROWS) AND THE FRACTURE SURFACE

10X

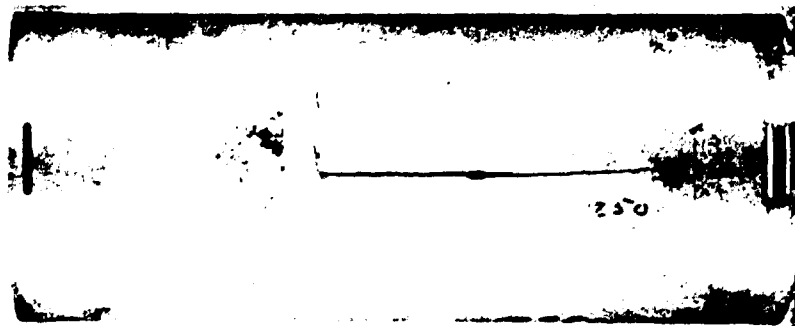

FRONTAL VIEW OF BURST MOTOR CASE. THE SHEAR NATURE OF THE FRACTURE IS EVIDENT IN THIS PHOTOGRAPH.


Figure 2. CASE NO. 101

(Nos. 110 and 105) were fatigue cracked but were stressed beyond the yield point in the vicinity of the crack during fatiguing,* producing local strain hardening and a resultant change in the fracture toughness in the vicinity of the strain hardening. Thus the values of the fracture toughness parameter K_{IC} obtained from these two cases cannot be considered reliable. However, it is interesting to note that even in these two cases (which, as can be seen from Table III, had the lowest burst strengths and K_{IC} values encountered) the burst pressures were higher than the service operating pressure of 1100 psi. This behavior in the presence of fatigue cracks in excess of 0.50 inch is, to say the least, very desirable. A photograph of Case 110 and its fracture surface are presented in Figure 3.



FRACTOGRAPH SHOWING FATIGUE CRACK. NOTE THE DIFFERENCE IN APPEARANCE BETWEEN THIS CRACK INITIATION AREA AND THAT IN THE PRECEDING FIGURE, NAMELY LACK OF DEFINITIVE SLOW CRACK ZONE AND THE FLATNESS OF FRACTURE.

10X

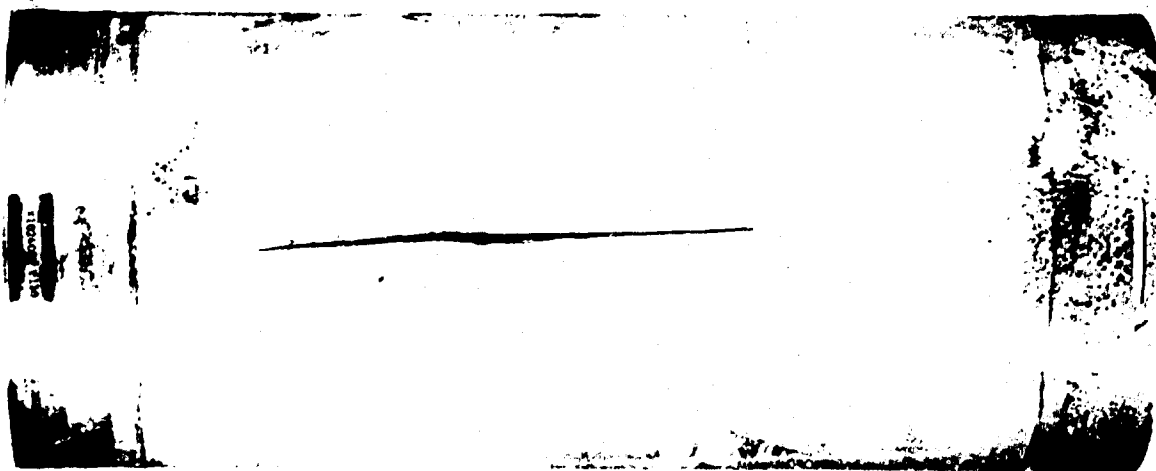

FRONTAL VIEW OF BURST MOTOR CASE. THE SHEAR NATURE OF THE CRACK (BEYOND THE FATIGUE CRACK) IS AGAIN EVIDENT. SLIGHT YIELDING (BULGING) IN THE NOTCH VICINITY IS ALSO EVIDENT.

Figure 3. CASE NO. 110

*This was only a local phenomena confined to the vicinity of the notch and resulted from the stress concentration due to the notch. The vessel as a whole did not exhibit yielding since the yield strength as determined by the burst stress formula was not exceeded.

The fatigue cracking of motor case 113 was completed without the incidence of plastic deformation in the vicinity of the crack. The K_{IC} value of 168 ksi $\sqrt{\text{in.}}$, obtained by testing this motor case at room temperature, may thus be considered to be reliable. It is indicative of the high degree of reproducibility mentioned above that the room temperature values of K_{IC} for the Elox and fatigue-cracked specimens (Nos. 113 and 115) differ by 4 ksi $\sqrt{\text{in.}}$.

Although the agreement between the K_{IC} values measured from sheet specimens and those obtained from actual Shillelagh missile motor cases is good, the values obtained from the cases are consistently lower than those measured from the sheet. There may be several reasons for this. First, the K_{IC} values^o measured from the cases were based on visually estimated values of the slow crack growth region and are therefore equivalent to K_{IC1} values,* while the sheet data were based on percent shear measurements and thus were K_{IC4} values.* It is known that values based on percent shear measurements are generally higher than those based on slow crack growth measurements. Secondly, the possibility exists that bulging of the internal patch could act as a wedge at the inner surface of the notch and thus reduce the measured fracture toughness. Of course, even in the absence of the above effects, the differences in heat treatment and processing history between the sheet material and the actual motor cases could account for the observed differences in fracture toughness.

CONCLUSIONS

1. The DAC steel is more reliable than H11 steel for use in the Shillelagh missile motor case because of superior fracture toughness at low temperatures.
2. The DAC Shillelagh motor cases tested evidence an extremely high degree of uniformity and reproducibility of properties.
3. Measurements of the fracture toughness may be made from actual motor cases using visually estimated slow crack lengths. These measurements are in good agreement with sheet data previously obtained for material of the same thickness and heat treatment.
4. The Shillelagh motor case fabricated from DAC steel can have a through-the-thickness crack greater than 1/2 inch long and still tolerate pressures exceeding the design pressure.

^o K_{IC1} refers to the fracture toughness parameter using a center notch, and measuring the slow crack length. K_{IC4} refers to the fracture toughness parameter using edge-notched specimens and a correction on term based on the percent shear which corrects for the plastic zone ahead of the crack.

ACKNOWLEDGMENTS

The author would like to express his appreciation to Mr. Edward LeMay of the AMRA High Pressure Facility for his assistance in conducting the burst testing of the Shillelagh motor cases, and to Mr. Kenneth Abbott, Chief of the Weapons Materials Section, for his help at all stages of this study, but especially in the redesign of the low-temperature pressure packings.


APPENDIX A

ELECTRON BEAM WELDS

Since the fabrication of the Shillelagh missile motor cases included electron-beam welding, it would be appropriate to discuss briefly the behavior of the electron-beam welds. Historically, welds have been the "Achilles' heel" of many solid propellant missile motor cases. It is interesting to note in the tests this Agency performed on the Shillelagh missile motor cases that:

- a. no cracks or failures initiated in the welds; and
- b. cracks, when running through the welds, would not propagate either along the weld or in the heat-affected zone.

Figure A-1 shows an early electron-beam weld on D6AC material. A clearly defined weldment and heat-affected zone can be seen. Figures A-2 and A-3 show welds cut out of Shillelagh motor cases 115 and 106. These weld segments were taken from the motor case in the vicinity of the crack. It is observed that the weldment and heat-affected zone are almost indistinguishable microstructurally from the matrix material and that the fracture is in the base metal, not the heat-affected zone. Similar microstructural observations were made by Kern and Lubin⁷ for electron-beam welded D6AC heat treated after welding (as was the Shillelagh motor case).

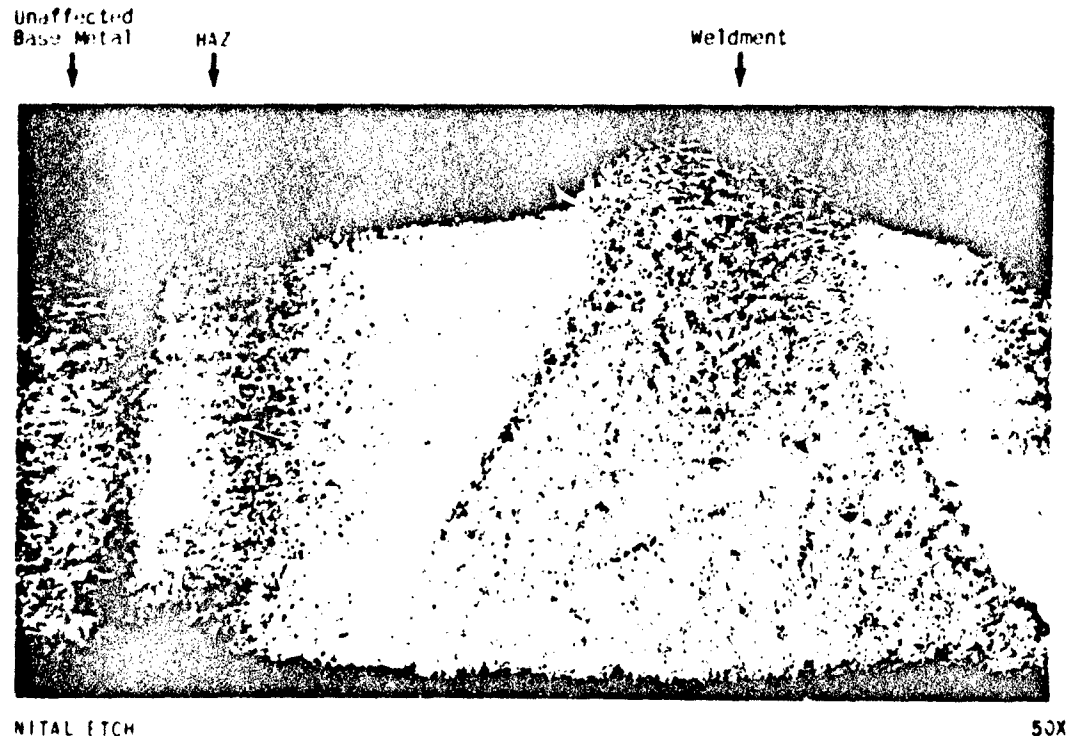

NITAL ETCH

50X

Figure A-1. EXAMPLE OF EARLY ELECTRON-BEAM WELD IN D6AC SHEET

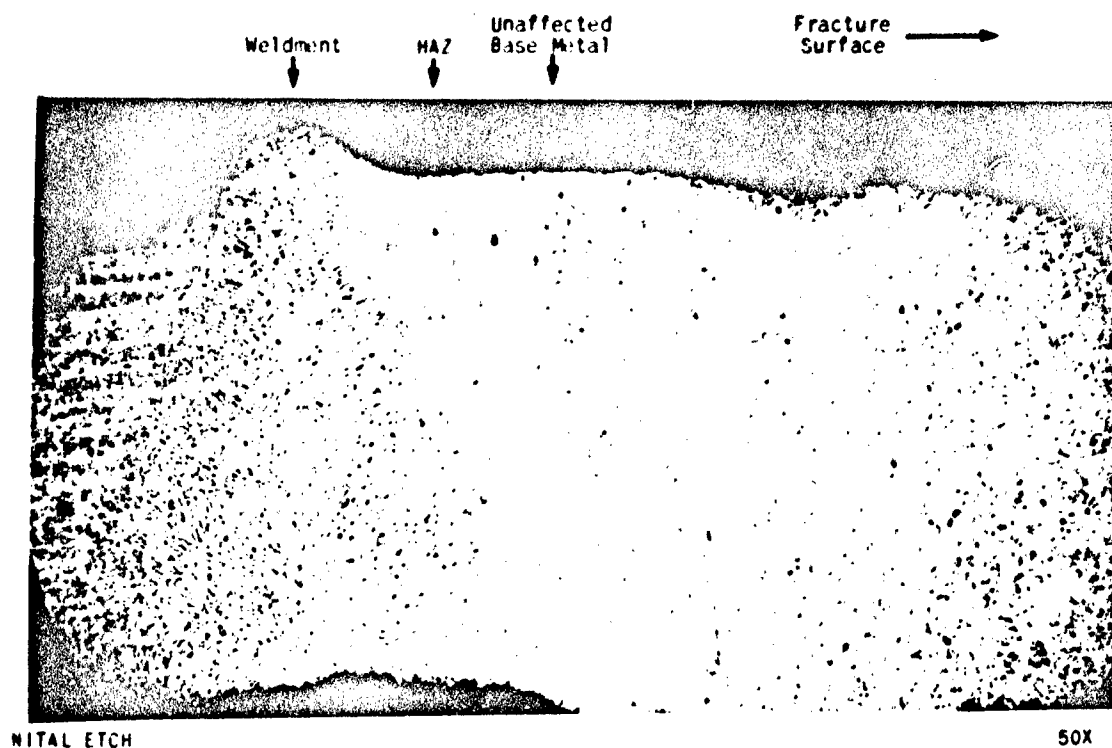


Figure A-2. ELECTRON-BEAM WELD IN CASE 115

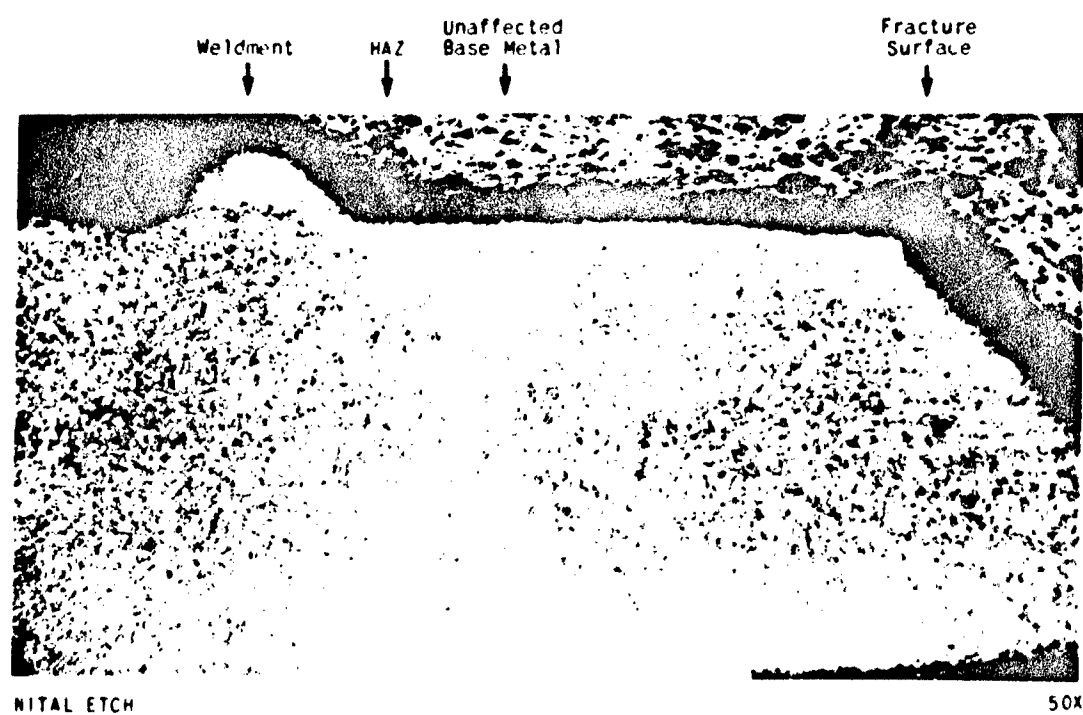


Figure A-3. ELECTRON-BEAM WELD IN CASE 106


APPENDIX B

END CLOSURE AND PRESSURE PACKING DESIGN


The end closure and pressure packing design which was chosen for use at low temperatures (also used at room temperature) consisted of a top packing support, packing, and bottom packing support. The top packing support was comprised of a split-ring packing follower seated on a solid packing restrainer. The packing follower split ring was made of segments which, when in place, formed a circle with their outer faces and a concave hexagon with their inner faces. This concave hexagon fit over a convex hexagonal surface on the packing restrainer. The hexagonal design of the contact surfaces between packing follower and packing restrainer allowed some individual motion of each segment of the follower without segment cocking which would result in a leak.

Upon the application of pressure the packing restrainer is forced upward. This upward motion of the packing restrainer results in radial motion of the packing follower ring segments. To prevent yielding of the motor case as a result of the radial movement of the packing follower segments, it was necessary to use heavy restraining rings around the motor case ends.


The packing consisted of a layer of Thiokol-impregnated leather, approximately 1/8-inch thick; a layer of silicon rubber, approximately 3/8-inch thick (this material has a glass transition temperature of about -110 C, which allows it to maintain its rubber elasticity at temperatures well below other rubbery polymers); and a layer of Teflon, approximately 1/8-inch thick. This packing, with top restrainer and follower on top of it, was supported by the bottom restrainer which consisted of a simple disk. The entire assembly was held together by a rod which was locked with a nut at either end of the packing. On one packing this rod contained a center bore allowing admission of pressurizing fluid to the motor case. The end closure assembly is shown in Figure B-1. After insertion into the case, the restraining ring was placed around the case in the vicinity of the packing.

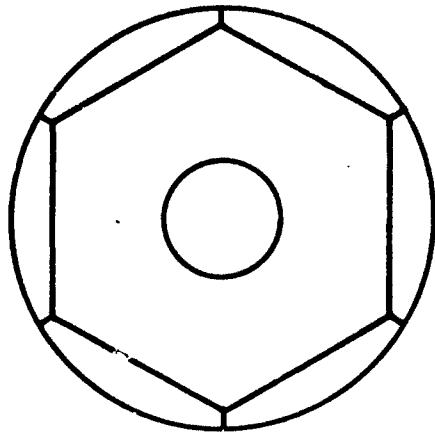


TOP VIEW OF TOP PACKING SUPPORT
RESTRAINER AND FOLLOWER

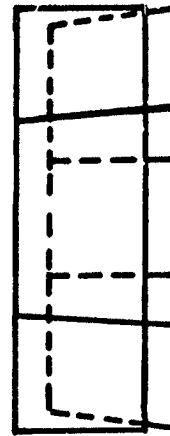

SIDE VIEW OF TOP
PACKING SUPPORT

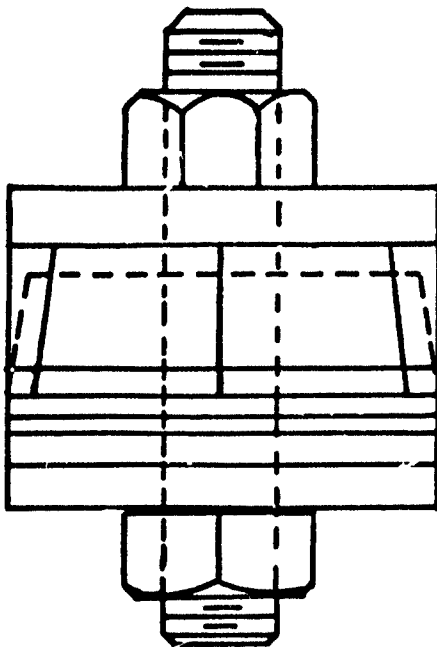

CROSS-SECTIONAL VIEW OF
ASSEMBLED PACKING

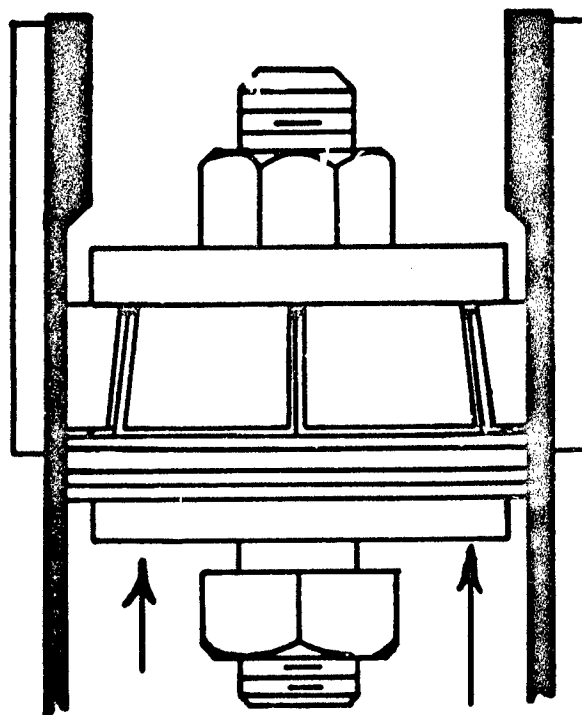

CROSS-SECTIONAL VIEW OF PACKING IN MOTOR
CASE WITH RESTRAINING RING IN PLACE

Figure 3-1

REFERENCES

1. SLINEY, JOSEPH L., and SCHMID, FRED. The Notch Properties and Shear Transitional Behavior of Hll Steel. Watertown Arsenal Laboratories, WAL TR 766.5/2, February 1963.
2. MATAS, S. J., HILL, M., and MUNGER, H. P. Current and Future Trends for Steels with High Strength and Toughness. Metals Engineering Quarterly, v. 3, no. 3, August 1963, p. 7.
3. KATZ, ROBERT N. Effect of Tempering on Notch Properties of D6AC Alloy Steel Sheet. U. S. Army Materials Research Agency, AMRA TR 63-35, November 1963.
4. CARMEN, C. M., et al. Effect of Solidification Practice on the Properties of High-Strength Steels. Presented at the Fall Meeting of the Metallurgical Society of AIME, 1963.
5. TIFFANY, C. F., and LORENZ, P. M. Notes for Meeting of ASTM Fracture Toughness of High Strength Materials Committee, August 1962.
6. AMERICAN SOCIETY FOR TESTING AND MATERIALS. Fracture Testing of High-Strength Sheet Materials. Report of a Special ASTM Committee, ASTM Bulletin, January 1960, p. 29.
7. KERN, W. I., and LUBIN, L. E. Electron Beam Welding of Aerospace Materials. Directorate of Materials and Processes, ASD-TDR-63-132, Aeronautical Systems Division, Air Force Systems Command, February 1963.

U. S. ARMY MATERIALS RESEARCH AGENCY
WATERTOWN, MASSACHUSETTS 02172

TECHNICAL REPORT DISTRIBUTION

Report No.: AMRA TR 64-19
July 1964

Title: Fracture Toughness of D6AC Steel
Shillelagh Rocket Motor Case

No. of Copies	TO
	Office of the Director, Defense Research and Engineering, The Pentagon, Washington, D. C. 20315
1	ATTN: Mr. J. C. Barrett
1	Dr. Earl T. Hayes, Assistant Director (Materials)
20	Commanding Officer, Defense Documentation Center, Cameron Station, Alexandria, Virginia 22314
	Headquarters, Department of the Army, Office of the Chief of Research and Development, Physical Sciences Division, Washington, D. C. 20310
2	ATTN: Chief, Chemistry and Materials Branch
3	Solid Propellant Information Agency, Applied Physics Laboratory, The Johns Hopkins University, Silver Spring, Maryland
1	Defense Metals Information Center, Battelle Memorial Institute, Columbus, Ohio
	Commanding General, U. S. Army Materiel Command, Washington, D. C. 20315
1	ATTN: AMCRD-CM
	Commanding General, U. S. Army Electronics Command, Fort Monmouth, New Jersey 07703
1	ATTN: Mr. H. H. Kedesky
	Commanding General, U. S. Army Missile Command, Redstone Arsenal, Alabama 35809
2	ATTN: Documentation and Technical Information Branch
1	AMSMI-RRS, Mr. R. E. Ely
1	AMSMI-RKX, Mr. R. Fink
1	AMSMI, Mr. E. Fohrell
1	AMSMI, Mr. T. N. L. Pughe
1	AMSMI-RSM, Mr. E. J. Wheelahan
1	Commanding General, U. S. Army Munitions Command, Dover, New Jersey 07801
	Commanding General, U. S. Army Tank-Automotive Center, Warren, Michigan 48090
1	ATTN: Mr. S. Sobak

No. of Copies	TO
1	Commanding General, U. S. Army Weapons Command, Rock Island, Illinois 611
1	ATTN: AMSWE-QA, Mr. B. Gerke
1	AMSWE-RDR, Mr. G. Reinsmith
1	Commanding General, Edgewood Arsenal, Maryland 21010
1	ATTN: SMJEA-EIS-C-CM, Mr. F. E. Thompson, Director of Engineering and Industrial Services, Chemical Munitions Branch
1	Commanding Officer, Harry Diamond Laboratories, Washington, D. C. 20438
1	ATTN: AMXDO, Library
1	Commanding Officer, Frankford Arsenal, Philadelphia, Pennsylvania 19137
1	ATTN: SMUFA-1330, Dr. H. Gisser
1	SMUFA-1320, Mr. H. Markus
1	SMUFA-1740, Mr. E. Roffman
3	Commanding Officer, Picatinny Arsenal, Dover, New Jersey 07801
1	ATTN: SMUPA, Mr. J. Matlack, Plastics and Packaging Laboratory
1	SMUPA-DE3, Mr. D. Stein
1	Director, PLASTECH, Picatinny Arsenal, Dover, New Jersey 07801
1	Commanding Officer, Rock Island Arsenal, Rock Island, Illinois 61202
1	ATTN: SWERI, Laboratory
1	Commanding Officer, Springfield Armory, Springfield, Massachusetts 01101
1	ATTN: SWESP, Research Materials Laboratory
1	Commanding Officer, U. S. Army Coating and Chemical Laboratory, Aberdeen Proving Ground, Maryland 21005
1	ATTN: AMSTE, Dr. C. Pickett
2	Commanding Officer, U. S. Army Engineer Research and Development Laboratories, Fort Belvoir, Virginia 22060
2	ATTN: STINFO Branch
1	Commanding Officer, U. S. Army Research and Development Office, Panama, P. O. Drawer 942, Fort Clayton, Canal Zone
1	ATTN: STEDO
2	Commanding Officer, Watertown Arsenal, Watertown, Massachusetts 02172
1	ATTN: SMIWT, Mr. Jack Hamilton, Industrial Division
1	SMIWT-CE, Industrial Engineering Section
1	Commanding Officer, Watervliet Arsenal, Watervliet, New York 12189
1	ATTN: SWEV-R, Mr. F. Dashnaw

No. of Copies	TO
9	Chief, Bureau of Naval Weapons, Department of the Navy, Washington, D. C.
1	ATTN: Mr. H. Boertzel
1	Mr. P. Goodwin
1	RMMP, Room 2225, Munitions Building
1	Commander, U. S. Naval Ordnance Laboratory, White Oak, Silver Spring, Maryland
1	ATTN: Code WM
1	Commander, U. S. Naval Ordnance Test Station, China Lake, California
1	ATTN: Technical Library Branch
1	Commander, Naval Research Laboratory, Anacostia Station, Washington, D. C.
1	ATTN: Mr. J. E. Srawley
1	Code 6110, Mr. E. Kohn
1	Chief, Office of Naval Research, Department of the Navy, Washington, D. C.
1	ATTN: Code 423
1	Chief, Special Projects Office, Department of the Navy, Washington, D. C.
1	ATTN: SP 271
1	U. S. Air Force Directorate of Research and Development, Room 4D-313, The Pentagon, Washington, D. C. 20315
1	ATTN: Lt. Col. J. B. Shipp, Jr.
1	Headquarters, Aeronautical Systems Division, Wright-Patterson Air Force Base, Ohio 45433
1	ATTN: ASRCN-11, Mr. F. J. Fecek
2	ASRCM-1, Mr. R. F. Klinger
2	ASRCT, Manufacturing and Technology Division
1	ASRCNP, Dr. Tamborski
2	ASRCEE-1-2, Mr. H. Zoeller
1	6593 Test Group (Development), Edwards Air Force Base, California 92522
1	ATTN: Solid Systems Division, DGSC
1	U. S. Atomic Energy Commission, Office of Technical Information Extension, P. O. Box 62, Oak Ridge, Tennessee
1	National Aeronautics and Space Administration, Washington, D. C. 20546
1	ATTN: Mr. B. G. Achhammer
1	Mr. G. C. Deutsch
1	Mr. R. V. Rhode
1	Director, Jet Propulsion Laboratory, California Institute of Technology, 4800 Oak Grove Drive, Pasadena, California
1	ATTN: Dr. L. Jaffe

No. of Copies	TO
	Director, George C. Marshall Space Flight Center, Huntsville, Alabama
1	ATTN: M-S&M-M, Dr. W. Lucas
1	M-ME-M, Mr. W. A. Wilson
	Philco Corporation, Aeronutronics Division of Ford Motor Company, Ford Road, Newport Beach, California
1	ATTN: Aeronutronics Library
2	Mr. Charles Martin
	Commanding Officer, U. S. Army Materials Research Agency, Watertown, Massachusetts 02172
5	ATTN: AMXMR-ATL
1	AMXMR-P
1	AMXMR-S
1	Author

106 TOTAL COPIES DISTRIBUTED

OTS Price \$0.50

AD Accession No.
U. S. Army Materials Research Agency, Watertown,
Massachusetts 02172
FRACTURE TOUGHNESS OF D6AC STEEL SHILLELAGH ROCKET
MOTOR CASE - Robert N. Katz
 Technical Report AMRA TR 64-19, July 1964, 16 pp -
 illus - tables, ANCMS Code 5541.12.25102.05,
 Unclassified Report

Burst tests and fracture toughness measurements on D6AC Shillelagh missile motor cases were carried out. The burst testing was done over a temperature range from room temperature down to -200 F. Results of these tests showed that the motor cases burst at approximately 250,000 psi hoop stress regardless of test temperature, and that all fractures were 100 percent shear. Fracture toughness measurements were made on cases containing machined and fatigue-cracked through-the-thickness notches, at room temperature and -66 F. The results of these measurements were in good agreement with previously obtained flat sheet data on similar materials.

NO DISTRIBUTION LIMITATIONS

UNCLASSIFIED

1. Rocket motor materials
2. Steel, high strength
3. Fracture toughness

- I. Katz, Robert N.
- II. ANCMS Code 5541.12.25102.05

OTS Price \$0.50

AD Accession No.
U. S. Army Materials Research Agency, Watertown,
Massachusetts 02172
FRACTURE TOUGHNESS OF D6AC STEEL SHILLELAGH ROCKET
MOTOR CASE - Robert N. Katz
 Technical Report AMRA TR 64-19, July 1964, 16 pp -
 illus - tables, ANCMS Code 5541.12.25102.05,
 Unclassified Report

Burst tests and fracture toughness measurements on D6AC Shillelagh missile motor cases were carried out. The burst testing was done over a temperature range from room temperature down to -200 F. Results of these tests showed that the motor cases burst at approximately 250,000 psi hoop stress regardless of test temperature, and that all fractures were 100 percent shear. Fracture toughness measurements were made on cases containing machined and fatigue-cracked through-the-thickness notches, at room temperature and -66 F. The results of these measurements were in good agreement with previously obtained flat sheet data on similar materials.

NO DISTRIBUTION LIMITATIONS

UNCLASSIFIED

1. Rocket motor materials
2. Steel, high strength
3. Fracture toughness

- I. Katz, Robert N.
- II. ANCMS Code 5541.12.25102.05

OTS Price \$0.50

AD Accession No.
U. S. Army Materials Research Agency, Watertown,
Massachusetts 02172
FRACTURE TOUGHNESS OF D6AC STEEL SHILLELAGH ROCKET
MOTOR CASE - Robert N. Katz
 Technical Report AMRA TR 64-19, July 1964, 16 pp -
 illus - tables, ANCMS Code 5541.12.25102.05,
 Unclassified Report

Burst tests and fracture toughness measurements on D6AC Shillelagh missile motor cases were carried out. The burst testing was done over a temperature range from room temperature down to -200 F. Results of these tests showed that the motor cases burst at approximately 250,000 psi hoop stress regardless of test temperature, and that all fractures were 100 percent shear. Fracture toughness measurements were made on cases containing machined and fatigue-cracked through-the-thickness notches, at room temperature and -66 F. The results of these measurements were in good agreement with previously obtained flat sheet data on similar materials.

NO DISTRIBUTION LIMITATIONS

UNCLASSIFIED

1. Rocket motor materials
2. Steel, high strength
3. Fracture toughness

- I. Katz, Robert N.
- II. ANCMS Code 5541.12.25102.05

OTS Price \$0.50

AD Accession No.
U. S. Army Materials Research Agency, Watertown,
Massachusetts 02172
FRACTURE TOUGHNESS OF D6AC STEEL SHILLELAGH ROCKET
MOTOR CASE - Robert N. Katz
 Technical Report AMRA TR 64-19, July 1964, 16 pp -
 illus - tables, ANCMS Code 5541.12.25102.05,
 Unclassified Report

Burst tests and fracture toughness measurements on D6AC Shillelagh missile motor cases were carried out. The burst testing was done over a temperature range from room temperature down to -200 F. Results of these tests showed that the motor cases burst at approximately 250,000 psi hoop stress regardless of test temperature, and that all fractures were 100 percent shear. Fracture toughness measurements were made on cases containing machined and fatigue-cracked through-the-thickness notches, at room temperature and -66 F. The results of these measurements were in good agreement with previously obtained flat sheet data on similar materials.

NO DISTRIBUTION LIMITATIONS

UNCLASSIFIED

1. Rocket motor materials
2. Steel, high strength
3. Fracture toughness

- I. Katz, Robert N.
- II. ANCMS Code 5541.12.25102.05