

AD-A081 006

ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND ABERD--ETC F/O 19/3
SUMMARY OF M113A1 ARMORED PERSONNEL CARRIER (APC) LEAKAGE TESTI--ETC(U)
DEC 79 J M FERRITER

UNCLASSIFIED


ARCSL-TR-79060

SDIE-AD-2410 230


NL

OF
AD
A081006



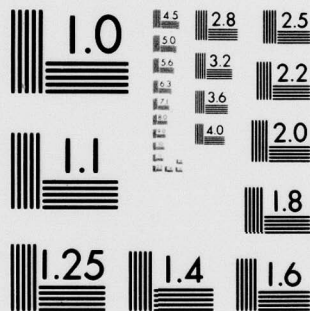

ADA081006

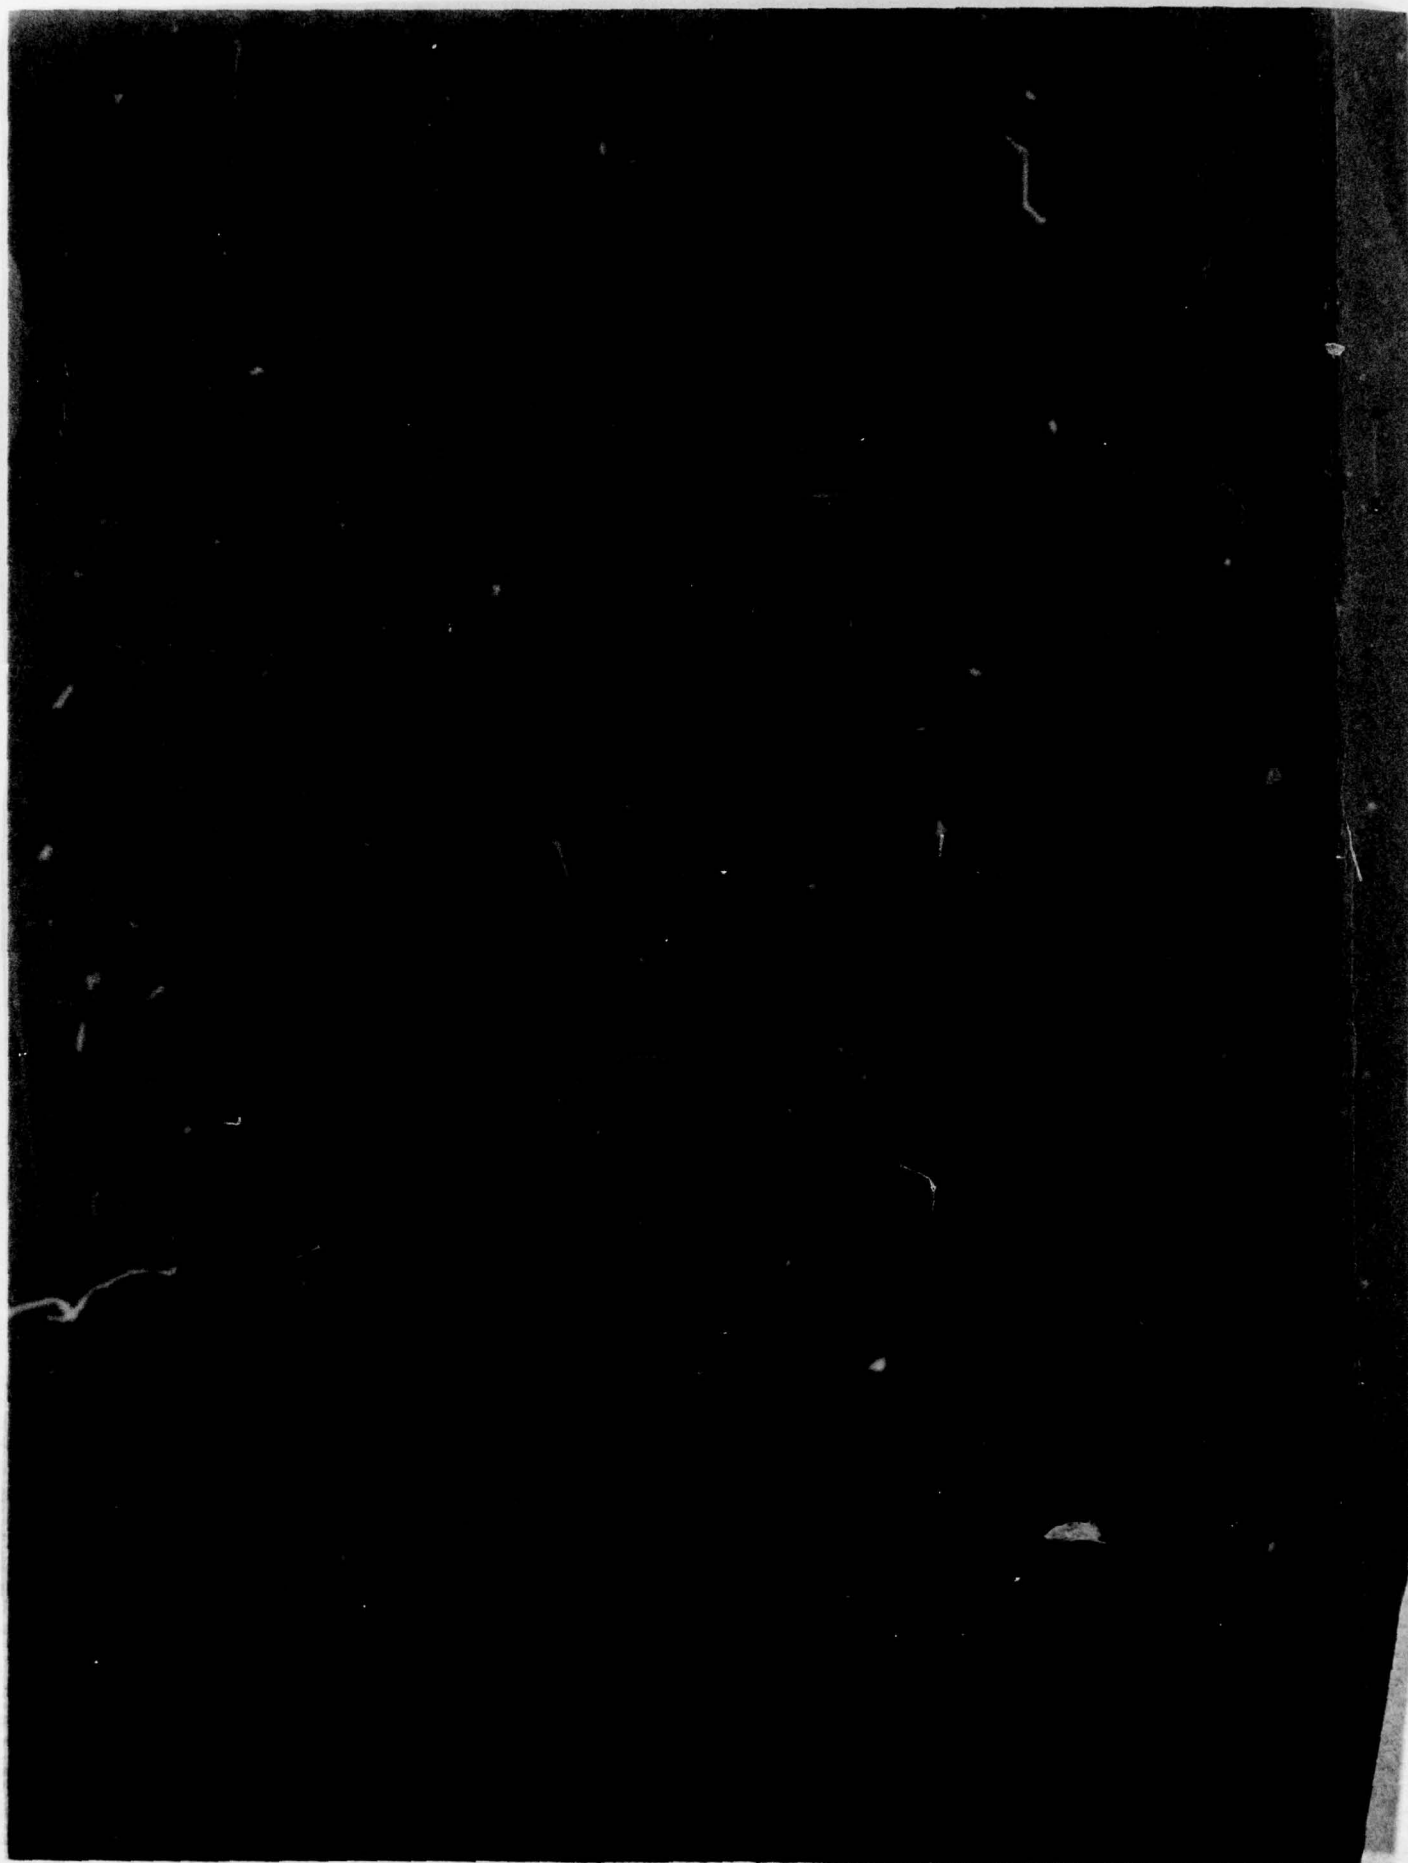

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER 14 ARCSL-TR-79060	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER 9
4. TITLE (and Subtitle) 6 SUMMARY OF M113A1 ARMORED PERSONNEL CARRIER (APC) LEAKAGE TESTING	5. TYPE OF REPORT & PERIOD COVERED Technical Report September 1977-July 1978	
7. AUTHOR(s) 10 John M. Ferriter	6. PERFORMING ORG. REPORT NUMBER	
9. PERFORMING ORGANIZATION NAME AND ADDRESS Commander/Director, Chemical Systems Laboratory Attn: DRDAR-CLW-CC Aberdeen Proving Ground, Maryland 21010	8. CONTRACT OR GRANT NUMBER(s) 12 20	
11. CONTROLLING OFFICE NAME AND ADDRESS Commander/Director, Chemical Systems Laboratory Attn: DRDAR-CLJ-R Aberdeen Proving Ground, Maryland 21010	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 16 Project 1M263721D604	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	13. NUMBER OF PAGES 22	
	15. SECURITY CLASS. (of this report) UNCLASSIFIED	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE NA	
16. DISTRIBUTION STATEMENT (of this Report) 18 SBIE 19 AD-E410/230 Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) #		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Code tester M577 Command post carrier Anemometer M113A1 Leakage reduction Leakage cu ft Armored personnel carrier Vehicle leakage		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report summarizes three sets of M113A1 Armored Personnel Carrier (APC) leakage data which were acquired from Aerophysics Company, Donaldson Company, and Research Division, Chemical Systems Laboratory. The average leakage value for the M113A1 APC is 458 ft ³ /min at 1.5-inches water gage. Six leakage reduction measures are suggested that have a potential of reducing the M113A1 APC leakage value to 110 ft ³ /min at 1.5-inches water gage. Areas where leakage reduction is possible include the commander's turret ring, scupper valve, air ventilator control, air inlet valve, hatches/doors, and bilge pump discharge line.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

410170

JG

PREFACE

The work described in this report was authorized under Project 1M263721D604, Collective Protection for Combat Vehicles. It was begun in September 1977 and finished at the end of June 1978.

Reproduction of this document in whole or in part is prohibited except with permission of the Commander/Director, Chemical Systems Laboratory, Attn: DRDAR-CLJ-R, Aberdeen Proving Ground, Maryland 21010. However, the Defense Documentation Center and the National Technical Information Service are authorized to reproduce the document for United States Government purposes.

Accession For	
NTIS GPM&I	☒
DDC TAB	☐
Unannounced	☐
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or special
A	

PREFACE

The work described in this report was authorized under Project 1M263721D604, Collective Protection for Combat Vehicles. It was begun in September 1977 and finished at the end of June 1978.

Reproduction of this document in whole or in part is prohibited except with permission of the Commander/Director, Chemical Systems Laboratory, Attn: DRDAR-CLJ-R, Aberdeen Proving Ground, Maryland 21010. However, the Defense Documentation Center and the National Technical Information Service are authorized to reproduce the document for United States Government purposes.

PRECEDING PAGE NOT FILMED
BLANK

Accession For	
NTIS GRA&I	☒
DDC TAB	☐
Unannounced	☐
Justification	
By _____	
Distribution/ _____	
Availability Codes	
Dist	Availand/or special
A	

CONTENTS

	<u>Page</u>
I. INTRODUCTION	7
II. TEST PROCEDURES	7
III. LEAKAGE DATA RESULTS	8
IV. DISCUSSION OF RESULTS	8
V. LEAK REDUCTION MEASURES	14
VI. CONCLUSIONS	11
VII. RECOMMENDATIONS	11
APPENDIX, Tables	13
DISTRIBUTION LIST	19

PRECEDING PAGE NOT FILMED
BLANK

SUMMARY OF M113A1 ARMORED PERSONNEL CARRIER (APC) LEAKAGE TESTING

I. INTRODUCTION.

To ensure that the current combat vehicle fleet has adequate nuclear, biological and chemical (NBC) protection, the Army established an armored-vehicle program managed by US Army Tank Automotive Research and Development Command (TARADCOM). The central effort of this program is at Chemical Systems Laboratory (CSL), Aberdeen Proving Ground. To characterize a vehicle's vulnerability to NBC agents, physical parameters are defined and a series of challenge tests are conducted to quantify the data base. Vehicle leakage enables modeling of air exchange between the vehicle and its environment: Air exchange determines the concentration of NBC agent that infiltrates the vehicle. The purpose of this report is (1) to summarize three sets of M113A1 Armored Personnel Carrier (APC) leakage data which has been acquired from Aerophysics Company, Donaldson Corporation, and Research Division, CSL and (2) to prepare preliminary modification for major leak areas.

II. TEST PROCEDURES.

Test methodologies were reviewed in a previous report* and it was recommended that a standardized-leakage-testing procedure be utilized. A standardized-vehicle-leakage test procedure enables comparison of leakage data generated by different sources. A short description of each test procedure is provided.

CSL supplies air through commander's hatch with a centrifugal blower and measures the flow rate with a calibrated-axial-vane anemometer immediately before discharge into the vehicle. The exterior and/or interior of the vehicle is then examined (generally by feel) to locate sources of air leakage which are then sealed with duct seal or tape. Once all accessible leaks are sealed, the unaccounted leakage is measured. Next, each individual leak is unsealed, and each associated leakage measured at several differential static pressures. Each leakage measurement is then repeated. The leak area is resealed prior to measuring the next leak area.

Aerophysics supplies the air through the air intake port using a "code tester" built in accordance with the Joint Air Moving and Conditioning Association, Inc. - American Society of Heating, Refrigerating, and Air Conditioning Engineers' specifications published in April 1975. The "code tester" has the capability to measure airflow up to 6000 ft³/min. The air mover is a variable-speed centrifugal fan, controlled by a variable voltage-variable frequency "varidyne" electric generator. Initial leak identification is made by feel. After all accessible leaks are sealed with duct tape, the unaccounted leakage is measured. Next, each leak is unsealed and the associated leakage measured at several differential static pressures.

Donaldson Corporation leakage data was extracted from a report.** It is assumed that the data was measured by a similar procedure.

* Ferriter, J. M., and Beeson, L. J. ARCSL-TR-79041. Summary of M60A1 Tank Leakage Testing. June 1979.

** Krisko, W. J., Camplin, H. R., and Schoen, D. W. Donaldson Corporation. Contract DAAK-11-78-C-0020. Final Report. Investigative Study of Positive Pressure Collective Protection for Combat/Armored Vehicles. August 1978.

III. LEAKAGE DATA RESULTS.

The data from the three sources are collected in the table. CSL and Aerophysics* conducted their tests on the same M113A1 APC's. The Donaldson Corporation data are from an unknown vehicle. Some of the Donaldson data are estimated from M577 Command Post Carrier (CPC) leakage data.

IV. DISCUSSION OF RESULTS.

Total leakage and individual leakage points are reported and are compared where applicable. All data are reported in standard cubic feet per minute at 1.5-inch water-gage static pressure.

A. Total Vehicle Leakage.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	347	422	403	474	555.9

Aerophysics supplied air through the air inlet valve and did not measure a recordable leak at the driver's hatch. Leakage for firewall auxiliary blower was not measured on the vehicles tested by Aerophysics and CSL. If the data are corrected to reflect similar leak points, the comparative values are as follows:

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	414	487	403	474	513.8

B. Commander's Turret Ring.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	116	149	92	141	157

This is a major leak area.

* Jackson, W. P., Foshag, W. F., and Boehler, G. D. Aerophysics Company. Contract DAAK11-78-M-0013. Final Report. Static Air Leakage on Two M113A1 Full Tracked Armored Personnel Carriers. August 1978.

Table. M113 APC Leakage - Comparison of Results

Leak location	Aerophysics 12B55469	Aerophysics 12C69569	CSL 12B55469	CSL 12C69569	Donaldson
	std ft ³ /min at 1.5 in wg*				
Vehicle as received	422	347	474	403	555.9
Commander's turret ring	149	116	141	92	157**
Ventilator control (closed)	103	56	109	67	39
Rear door	43		33	1	0
Grommets to engine		3		3	6.9
Scupper valve	40	93	44	100	183
Ramp	17	8	0	3	
Torsion bars	12	24	16	28	
Bilge pump	15	15	11	13	7.4
Driver's periscope cover	11	9	12	9	6
Cargo hatch	2	1	0	0	4**
Engine access door	2	1	3	4	1**
Unaccounted leakage	28	21	11	9	25**
Firewall auxiliary blower					42**
Driver's hatch					5.5**
Air inlet valve (closed)			65	67	

* Wg = water gage pressure

** Projected data

C. Ventilator Control (closed).

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	56	103	67	109	39

Good agreement is obtained between Aerophysics and CSL. This leak value may depend on the tolerances of the valve.

D. Scupper Valve.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	93	40	100	44	183

Leakage of the scupper depends on the position of valve.

E. Rear Door.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	—	43	1	33	0

The rear door on vehicle 55469 was warped.

F. Ramp.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	8	17	3	0	—

Leakage appears to depend on how securely the ramp is closed.

G. Air Inlet Valve.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	—	—	67	65	—

H. Torsion Bars.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	24	12	28	16	—

I. Bilge Pump.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	15	15	13	11	7.4

J. Driver's Periscope Cover.

	<u>Aerophysics</u>		<u>CSL</u>		<u>Donaldson</u>
Serial No.	69569	55469	69569	55469	—
ft ³ /min	9	11	9	12	6

V. LEAK REDUCTION MEASURES.

Proposed leakage reduction modifications were suggested by Donaldson Corporation, Aerophysics, and CSL. The following leakage reduction measures were suggested by Donaldson Corporation; however, Aerophysics Company and CSL had similar recommendations.

- A. The commander's turret ring could use a grease or a felt/"bristle pad" seal.
- B. A manual scupper valve device, as installed in the M577A1 CPC for NBC operation, would be advantageous.
- C. The combination of a gasket and fasteners should reduce the leakage for the air ventilator control and air inlet valve.
- D. A more pliable and wider gasket for hatches and doors could be used.
- E. The installation of a manual valve in the bilge pump discharge line should be considered.
- F. Grommets could be located at points where cables pass through the firewall.

VI. CONCLUSIONS.

A. M113A1 APC leakage data indicates the possibility for leakage reduction in the following areas: commander's turret ring, scupper valve, hatches, doors, air ventilation control, air inlet valve, and bilge pump.

B. The average leakage value for the M113A1 APC is 458 ft³/min at 1.5-inches water gage.

VII. RECOMMENDATIONS.

The six leakage reduction suggestions mentioned above ought to be examined. Incorporation of the suggested-leakage-reduction measures has a potential of reducing the M113A1 APC leakage value to 110 ft³/min at 1.5-inches water gage.

APPENDIX
TABLES

Table A-1. M113 Armored Personnel Carrier (12B55469)
Aerophysys Company

Leakage areas	Leakage rates at the internal static pressure (in water, gage) immediately below							
	1.0	2.0	3.0	4.0	5.0	6.0	7.0	8.0
	ft ³ /min							
Cupola	120	177	227	259	293	327	357	391
Ventilator (closed)	83	123	149	171	191	213	239	261
Rear door	34	52	66	81	94	109	122	137
Scupper valve	32	48	59	68	78	88	97	109
Ramp	13	20	25	26	28	32	34	40
Torsion bars	10	14	17	18	18	19	15	17
Bilge pump	12	17	21	23	25	29	29	31
Driver's periscope cover	8	14	18	20	21	24	23	27
Main hatch	1	2	2	2	2	2	3	4
Engine access doors	16	3	2	2	1	1	0	0
Sealed tank	22	33	43	51	60	66	76	81
Total (measured)	341	495	616	719	817	905	996	1094
Total (added)	351	503	629	721	811	910	995	1098

Table A-2. M113 Armored Personnel Carrier (12C69569)
Aerophysics Company

Leakage areas	Leakage rates at the internal static pressure (in water, gage) immediately below							
	1.0	2.0	3.0	4.0	5.0	6.0	7.0	8.0
	ft ³ /min							
Cupola	94	138	171	202	228	258	290	318
Ventilator (closed)	45	66	82	93	108	116	127	138
Grommets (engine/driven)	3	3	3	3	4	4	5	5
Scupper valve	77	109	134	155	171	187	202	215
Ramp	7	9	9	9	9	9	10	11
Torsion bars	19	29	35	39	43	47	50	53
Bilge pump	12	18	21	23	25	28	30	33
Driver periscope cover	7	10	12	12	12	13	14	14
Main hatch	0	1	1	1	1	1	1	1
Engine access doors	1	1	2	2	3	3	3	4
Wire channel	1	3	3	1	1	1	1	1
Sealed tank	17	25	32	40	45	50	54	58
Total (measured)	267	397	493	572	645	717	778	843
Total (added)	283	412	505	580	650	717	787	851

Table A-3. Research Leakage Data. Vehicle M113A1 (12C69569)

Leakage point	Leakage rates					
	Static pressure					
	0.5	1.0	1.5	2.0	3.0	6.0
	ft ³ /min					
Front vent open	367	523	644	746	917	1306
Rear vent open	307	441	544	632	780	1119
Commander's turret ring	51	74	92	108	135	197
Front vent closed	41	55	67	76	92	127
Rear vent closed	30	46	59	70	91	140
Scupper valve	58	82	100	115	140	198
Rear door	0	1	1	1	1	2
Torsion bars	16	23	28	32	38	54
Driver's periscope cavity plug	2	3	4	5	6	18
Rear bilge pump outlet	7	10	13	16	20	29
Driver's infrared (IR) periscope	1	1	2	2	3	4
Unaccounted for leakage	4	7	9	11	15	25
Engine compartment bulkhead area	2	3	4	5	6	9
Ramp	2	2	3	4	5	0

Table A-4. Research Leakage Data. Vehicle M113A1 (12B55469)

Leakage point	Leakage rates					
	Static pressure					
	0.5	1.0	1.5	2.8	3.0	6.8
	ft ³ /min					
Front vent open	368	523	642	743	912	1295
Rear vent open	290	413	508	587	723	1030
Commander's turret ring	75	112	141	166	218	311
Front vent closed	58	86	189	128	180	238
Rear vent closed	27	47	63	92	114	199
Scupper valve	23	34	44	52	66	99
Rear door	17	25	33	40	52	81
Torsion bars	9	13	16	19	23	34
Driver's periscope cavity plug	5	8	10	12	15	22
Rear bilge pump outlet	6	9	11	13	17	26
Driver's IR periscope	6	9	12	14	17	26
Unaccounted for leakage	5	8	11	13	17	29
Engine compartment bulkhead area	1	2	3	3	3	5
Ramp	0	0	0	0	0	0

Table A-5. Donaldson Corporation Report Data

Leakage areas	Leakage before sealing	
	1.5 in wg	7.0 in wg
	ft ³ /min	
Commander's turret ring	140*	370*
Commander's hatch	3*	8*
Commander's and driver's periscopes	14	37**
Driver's hatch	5.5**	15**
Cargo hatch	4**	11**
Driver's infrared (IR) periscope	6**	15
Firewall bilge scuppers	183	510
Firewall auxiliary blower	69	228
Firewall cable openings	43**	116
Air ventilating exhaust	39	88
Bilge pump discharge	7.4	28
Firewall access panel	1**	3
Ramp door	0	1
Personnel heater	17	39
Unaccountable leakage	<u>25**</u>	<u>66</u>
Total leakage	555.9	1535

* Estimated leakage

** Extrapolated from leakage data on M113 APC or M577 CPC.

Table A-6. M577 Command Post Carrier Air Leakage

Leakage areas	Leakage rates				
	Internal static pressure as in water gage				
	0.40	1.0	3.0	5.0	7.0
	ft ³ /min				
Unaccounted leaks	—	20.0	38.6	53.0	66.5
Commander's hatch	—	0.7	1.3	2.3	1.5
Driver's hatch	—	1.7	5.1	5.7	8.3
Ramp door	—	0.6	0.5	0.2	0.4
Air ventilating exhaust	—	32.0	59.5	80.8	88.3
Driver's IR periscope	3.3	4.9	12.8	17.0	15.0
Bilge pump discharge	6.0	6.5	10.0	20.0	28.0
Firewall access panels	0.3	—	5.0	—	3.0
Firewall cable openings	29.1	52.0	83.0	98.0	116.0
Firewall auxiliary blower	44.0	49.5	127.0	177.0	228.0
Firewall bilge scuppers	81.0	145.0	295.0	410.0	510.0
Total leakage	163.7	312.9	637.8	864.0	1065.0

NOTE: These tests were performed with the crew compartment pressurized and the engine compartment not pressurized. Under normal operating conditions, leakage through the firewall and bilge scuppers would not be this great.

DISTRIBUTION LIST 4

Names	Copies	Names	Copies
CHEMICAL SYSTEMS LABORATORY		Director	
SAFETY OFFICE		Defense Civil Preparedness Agency	
Attn: DRDAR-CLF	1	Attn: PO(DC)	1
AUTHOR'S COPIES: Physical Protection Division	20	Washington, DC 20301	
USA BIOMEDICAL LABORATORY		CINCUSAREUR	
Attn: SGRD-UV-ZA	1	Attn: AEAGC-RSI	1
		APO New York 09403	
CB DETECTION & ALARMS DIVISION		Deputy Chief of Staff for Research,	
Attn: DRDAR-CLC-C	1	Development & Acquisition	
Attn: DRDAR-CLC-E	1	Attn: DAMA-CSM-CM	1
		Attn: DAMA-ARZ-D	1
DEVELOPMENTAL SUPPORT DIVISION		Washington, DC 20310	
Attn: DRDAR-CLJ-R	3	US Army Research and Standardization	
Attn: DRDAR-CLJ-L	3	Group (Europe)	1
Attn: DRDAR-CLJ-M	1	Attn: Chief, Chemistry Branch	
Attn: DRDAR-CLJ-P	1	Box 65, FPO New York 09510	
ENVIRONMENTAL TECHNOLOGY DIVISION		HQDA (DAMI-FIT)	1
Attn: DRDAR-CLT-D	4	WASH, DC 20310	
MUNITIONS DIVISION		Commander	
Attn: DRDAR-CLN	2	HQ US Army Medical Command, Europe	
		Attn: AEMPM	1
PHYSICAL PROTECTION DIVISION		APO New York 09403	
Attn: DRDAR-CLW	2	US ARMY HEALTH SERVICE COMMAND	
Attn: DRDAR-CLW-C	1		
Attn: DRDAR-CLW-P	1	Superintendent	
Attn: DRDAR-CLW-E	1	Academy of Health Sciences	
RESEARCH DIVISION		US Army	
Attn: DRDAR-CLB	1	Attn: HSA-CDC	1
Attn: DRDAR-CLB-B	1	Attn: HSA-IHE	1
Attn: DRDAR-CLB-C	1	Fort Sam Houston, TX 78234	
Attn: DRDAR-CLB-P	1	US ARMY MATERIEL DEVELOPMENT AND	
Attn: DRDAR-CLB-R	1	READINESS COMMAND	
Attn: DRDAR-CLB-T	1		
Attn: DRDAR-CLB-TE	1	Commander	
SYSTEMS DEVELOPMENT DIVISION		US Army Materiel Development and Readiness Command	
Attn: DRDAR-CLY-A	1	Attn: DRCLDC	1
Attn: DRDAR-CLY-R	1	Attn: DRCSF-P	1
		5001 Eisenhower Ave	
DEPARTMENT OF DEFENSE		Alexandria, VA 22333	
Administrator		Commander	
Defense Documentation Center		US Army Toxic & Hazardous Materials Agency	
Attn: Document Processing Division (DDC-DD)	12	Attn: DRXTH-TS	2
Cameron Station		Aberdeen Proving Ground, MD 21010	
Alexandria, VA 22314		Human Engineering Laboratory HFE Detachment	
Director		Attn: DRXHE-EA	1
Defense Intelligence Agency		Building E3220	
Attn: DB-4G1	1	Aberdeen Proving Ground, MD 21010	
Washington, DC 20301		Commander	
DEPARTMENT OF THE ARMY		US Army Foreign Science & Technology Center	
HQDA (DAMO-SSC)	1	Attn: DRXST-MT2	1
WASH DC 20310		220 Seventh St., NE	
		Charlottesville, VA 22901	

DISTRIBUTION LIST 4 (Contd)

Names	Copies	Names	Copies
US Army Materiel Systems Analysis Activity		CDR, APG	
Attn: DRXSY-MP	1	USA ARRCOM	
Attn: DRXSY-T (Mr. Kaste)	1	Attn: SARTE	1
Aberdeen Proving Ground, MD 21005		Aberdeen Proving Ground, MD 21010	
Commander		Commander	
US Army Missile Research and Development Command		US Army Dugway Proving Ground	
Redstone Scientific Information Center		Attn: Technical Library, Docu Sect	1
Attn: DRDMI-TBD	1	Dugway, UT 84022	
Redstone Arsenal, AL 35809		Commander	
Director		Rocky Mountain Arsenal	
DARCOM Field Safety Activity		Attn: SARRM-QA	1
Attn: DRXOS-C	1	Attn: SARRM-MD	1
Charlestown, IN 47111		Commerce City, CO 80022	
US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND		Commander	
Commander		Pine Bluff Arsenal	
US Army Armament Research and Development Command		Attn: SARPB-ETA	1
Attn: DRDAR-AC	1	Pine Bluff, AR 71611	
Attn: DRDAR-LCE-M	1	US ARMY TRAINING & DOCTRINE COMMAND	
Attn: DRDAR-LCH	1	Commandant	
Attn: DRDAR-LCN	1	US Army Infantry School	
Attn: DRDAR-LCU	1	Attn: NBC Division	1
Attn: DRDAR-SER	1	Fort Benning, GA 31905	
Attn: DRDAR-TSS	2	Commandant	
Attn: DRCPM-CAWS-WP	1	US Army Missile & Munitions Center & School	
Dover, NJ 07801		Attn: ATSK-CD-MD	1
Commander		Attn: ATSK-DT-MU-EOD	1
Armament Concepts Office, Weapon Systems Concepts Team		Redstone Arsenal, AL 35809	
Attn: DRDAR-ACW	1	Commandant	
Aberdeen Proving Ground, MD 21010		US Army Military Police School/Training Center	
Director		Attn: ATZN-CDM	1
Ballistic Research Laboratory		Attn: ATZN-TDP-C	1
Attn: DRDAR-TSB-S	1	Fort McClellan, AL 36205	
Building 305		Commander	
Aberdeen Proving Ground, MD 21005		US Army Infantry Center	
CDR, APG		Attn: ATSH-CD-MS-C	1
USA ARRCOM		Fort Benning, GA 31905	
Attn: DRDAR-GCL	1	Commandant	
Aberdeen Proving Ground, MD 21010		US Army Ordnance & Chemical Center & School	
Commander		Attn: ATSL-CL-CD	1
USA Technical Detachment		Aberdeen Proving Ground, MD 21005	
US Naval EOD Facility	1	Commander	
Indian Head, MD 20640		USA Training & Doctrine Command	
US ARMY ARMAMENT MATERIEL READINESS COMMAND		Attn: ATCD-Z	1
Commander		Fort Monroe, VA 23651	
US Army Armament Materiel Readiness Command		Commander	
Attn: DRSAR-ASN	1	USA Combined Arms Combat Development Agency	
Attn: DRSAR-LE	1	Attn: ATZLCA-CO	1
Attn: DRSAR-PDM	1	Fort Leavenworth, KS 66027	
Attn: DRSAR-PE	1		
Attn: DRSAR-SF	1		
Attn: DRSAR-SR	1		
Rock Island, IL 61299			

DISTRIBUTION LIST 4 (Contd)

Names	Copies	Names	Copies
US ARMY TEST & EVALUATION COMMAND		HQ AFSC/SDAE	1
Commander		Andrews AFB, MD 20334	
US Army Test & Evaluation Command		HQ AFISC/SEV	1
Attn: DRSTE-FA	1	Norton AFB, CA 92409	
Aberdeen Proving Ground, MD 21005		NORAD Combat Operations Center/DBN	1
DEPARTMENT OF THE NAVY		Cheyenne Mtn Complex, CO 80914	
Chief of Naval Research		AMRL/HE	
Attn: Code 443	1	Attn: Dr. C.R. Replogle	1
800 N. Quincy Street		Wright-Patterson AFB, OH 45433	
Arlington, VA 22217		OUTSIDE AGENCIES	
Commander		Battelle, Columbus Laboratories	
Naval Facilities Engineering Command		Attn: TACTEC	1
Attn: Code 03	1	505 King Avenue	
200 Stovall Street		Columbus, OH 43201	
Alexandria, VA 22332		Director of Toxicology	1
Commander		National Research Council	
Naval Explosive Ordnance Disposal Facility		2101 Constitution Ave, NW	
Attn: Army Chemical Officer, Code 604	1	Washington, DC 20418	
Indian Head, MD 20640		ADDITIONAL ADDRESSEES	
Commander		Commander	
Nuclear Weapons Training Group, Atlantic		USEUCOM	
Naval Air Station		Attn: ECJ5-O/LTC James H. Alley	1
Attn: Code 21	1	APO, NY 09128	
Norfolk, VA 23511		Commander	
Chief, Bureau of Medicine & Surgery	1	DARCOM, STITEUR	
Department of the Navy		ATTN: DRXST-ST1	1
Washington, DC 20372		Box 48, APO New York 09710	
Commander		HQDA DASG-RDZ (SGRD-PL)	1
Naval Weapons Center		WASH DC 20314	
Attn: Code 3171	1	Commander/Director	
China Lake, CA 93555		Chemical Systems Laboratory	
US MARINE CORPS		Attn: DRDAR-CLC-CP	1
Director, Development Center		Attn: DRDAR-CLB-PO	1
Marine Corps Development & Education Command		Attn: DRDAR-CLY	1
Attn: Fire Power Division	1	Attn: DRDAR-CLW-P	1
Quantico, VA 22134		Aberdeen Proving Ground, MD 21010	
DEPARTMENT OF THE AIR FORCE		Commander	
Air University Library		US Army Tank Automotive Materiel Readiness Command	
Attn: AUL/LSE-8879	1	Attn: DRCPM-M60TD-T (COL Sawyer)	1
Maxwell AFB, AL 36112		Warren, MI 48090	
HQ Foreign Technology Division (AFSC)		Commander	
Attn: PDRR	1	US Army Tank Automotive Research and Development	
Wright-Patterson AFB, OH 45433		Command	
Commander		Attn: DRDTA-RN (R. DeClaire)	10
Aeronautical Systems Division		Warren, MI 48090	
Attn: ASD/AELD	1	Commander	
Wright-Patterson AFB, OH 45433		US Army Materiel Development and Readiness Command	
HQ, USAF/SGES		Attn: DRCBSI-CN (COL J. Tedeschi)	1
Bolling AFB, DC 20332	1	Attn: DRCDMR-TC-C (COL Carruth)	1
		5001 Eisenhower Ave	
		Alexandria, VA 22333	

DISTRIBUTION LIST 4 (Contd)

Names	Copies	Names	Copies
Commander		Commander	
US Army Armament Research and Development Command		US Army Training and Doctrine Command	
Attn: DRDAR	1	Attn: ATCD-Z (COL Mojecki)	1
Attn: DRDAR-SER (MAJ G. Uliano)	1	Attn: ATCD-Z (MAJ Kelly)	1
Dover, NJ 07801		Fort Monroe, VA 23651	
HQDA (DACS/BG R. Lawrence)	1	Commander	
HQDA (DAMO-NCZ/BG Falter)	1	US Army Ordnance and Chemical Center and School	
HQDA (DAMA-CSS-C/LTC Floyd)	1	Attn: ATSL-CLC-M (MAJ Novack)	1
WASH DC 20310		Aberdeen Proving Ground, MD 21005	
Commander		Commander	
US Army Logistics Center		US Army Combined Arms Center	
Fort Lee, VA 23801		Attn: ATZLCA-COM-G (1LT Loreo)	1
		Fort Leavenworth, KS 66027	
Director		Commander	
US Army Materiel Systems Analysis Activity		US Army Armor Center	
Attn: DRXSY-T (D. Metz)	1	Attn: ATZK-CD-SD	1
Aberdeen Proving Ground, MD 21005		Fort Knox, KY 40121	
US Army Environmental Hygiene Agency			
Attn: Librarian, Bldg 2100	1		
Aberdeen Proving Ground, MD 21010			