

NO-A185 127

DYNAMIC TESTS OF THE 30-ROUND MAGAZINE FOR THE M16A1
WHILE FIRING FROM TH. (U) ARMY BALLISTIC RESEARCH LAB
ABERDEEN PROVING GROUND MD T L BROSSEAU APR 87

1/1


UNCLASSIFIED

BRL-MR-3600

F/G 19/6

NL



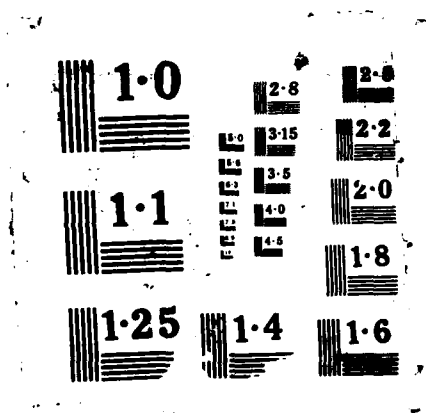

FILE COPY

ADF 300923

12

AD

AD-A185 127

MEMORANDUM REPORT BRL-MR-3600

DYNAMIC TESTS OF THE 30-ROUND
MAGAZINE FOR THE M16A1 WHILE FIRING
FROM THE M231 FIRING PORT WEAPON

T. L. BROSSAU

JUNE 1987

DTIC
ELECTE
SEP 14 1987
S D

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED.

US ARMY BALLISTIC RESEARCH LABORATORY
ABERDEEN PROVING GROUND, MARYLAND

87 9 10 009

AD-A185127

Form Approved
OMB No 0704-0188
Exp Date Jun 30, 1986

REPORT DOCUMENTATION PAGE

1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIVE MARKINGS	
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION / AVAILABILITY OF REPORT	
2b. DECLASSIFICATION / DOWNGRADING SCHEDULE			
4. PERFORMING ORGANIZATION REPORT NUMBER(S)		5. MONITORING ORGANIZATION REPORT NUMBER(S)	
6a. NAME OF PERFORMING ORGANIZATION USA Ballistic Research Lab.	6b. OFFICE SYMBOL (If applicable) IBD, BRL	7a. NAME OF MONITORING ORGANIZATION	
6c. ADDRESS (City, State, and ZIP Code) Aberdeen Proving Ground, MD 21005-5066		7b. ADDRESS (City, State, and ZIP Code)	
8a. NAME OF FUNDING / SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS	
		PROGRAM ELEMENT NO. P612618	PROJECT NO. AH80
		TASK NO.	WORK UNIT ACCESSION NO.
11. TITLE (Include Security Classification) DYNAMIC TESTS OF THE 30 ROUND MAGAZINE FOR THE M16A1 WHILE FIRING FROM THE M231 FIRING PORT WEAPON			
12. PERSONAL AUTHOR(S) Timothy L. Brosseau			
13a. TYPE OF REPORT Memorandum Report	13b. TIME COVERED FROM Feb 87 TO Apr 87	14. DATE OF REPORT (Year, Month, Day)	15. PAGE COUNT
16. SUPPLEMENTARY NOTATION			
17. COSATI CODES		18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)	
FIELD 19	GROUP 06	SUB-GROUP	
		30-Round Magazine for M16A1 Spring Surge	
		Time Displacement M231	
19. ABSTRACT (Continue on reverse if necessary and identify by block number) jmk Time displacement records of the magazine spring for the M16A1, while firing from the Firing Port Weapon, were obtained to determine if excessive spring surge was causing a stoppage problem during testing at APG. Results of the tests show there was no excessive magazine spring surge in the 30-round magazine for the M16A1 when firing from the M231 Firing Port Weapon. The results show the stoppage problem was caused by faulty magazines.			
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT ☒ UNCLASSIFIED/UNLIMITED ☐ SAME AS RPT ☐ DTIC USERS		21. ABSTRACT SECURITY CLASSIFICATION	
22a. NAME OF RESPONSIBLE INDIVIDUAL Timothy L. Brosseau		22b. TELEPHONE (Include Area Code) (301) 278-6145	22c. OFFICE SYMBOL SLCER-IB-W

TABLE OF CONTENTS

	Page
LIST OF ILLUSTRATIONS.....	11
I. INTRODUCTION.....	1
II. MEASUREMENTS.....	1
III. RESULTS.....	2
IV. CONCLUSIONS.....	6
V. RECOMMENDATIONS.....	7
DISTRIBUTION LIST.....	9

Accession For	
NTIS CRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

LIST OF ILLUSTRATIONS

Figure	Page
1. 30-Round Magazine with Slot.....	1
2. Vertical Displacement versus Time using Bad Magazine.....	3
3. Vertical Displacement versus Time using Good Magazine.....	4
4. Tilted Magazine Follower.....	5
5. Effect of Tilted Follower on Last Round.....	5
6. Tilted Magazine Spring Coils.....	6

I. INTRODUCTION

During recent testing of the M231 Firing Port Weapon at APG, several instances were recorded where the last round jumped out of the magazine either while the bolt carrier was still moving rearward or had just started moving forward. This causes two potential safety problems. The first problem would be when the last round has jumped out and become partially chambered and the face of the bolt is held by the bolt latch. If the operator is unaware of this and loads a new magazine and attempts to fire, the tip of the first round might strike the primer of the partially chambered round and initiate it with the breech open. The second problem would be when the last round has jumped out and become partially chambered and the front of the bolt carrier is held by the bolt latch. As soon as the bolt latch is released, the bolt carrier comes forward and initiates the round in the chamber before the trigger is pulled.

At a M231 Engineering Meeting held at TECOM to discuss these problems, it was felt that the weapon might be causing excessive magazine spring surges which would allow the last round to jump out. To check this out BRL agreed to take Time Displacement records of the magazine spring while firing to determine if the weapon was causing excessive magazine spring surges. Similar measurements have been previously made on the M16A1 by BRL.

II. MEASUREMENTS

Photographic records were taken of the magazine during firing using a Time Displacement camera. Slots were cut in the side of the magazine and the lower receiver and a continuous record of vertical displacement versus time was recorded for the last few rounds in the magazine, the magazine follower, and several of the spring coils in the magazine. The slot was cut in the magazine between two guide grooves so that normal operation of the magazine was not affected by the slot. The magazine with the slot is shown in Figure 1.



Figure 1. 30-Round Magazine with Slot

Records were taken of two magazines which had exhibited reliable operation during prior testing and also of one magazine which had exhibited poor performance in the latest tests. All magazines were manufactured by Adventure Line Mfg. Co. Inc. Records were taken using both versions of the M231 that were used in the latest tests. The weapons were fired from the same type of rigid ball mount used in the latest tests.

III. RESULTS

The results of the tests show that there is no excessive magazine spring surge taking place in any magazine or weapon to cause the last round to jump out of the magazine. Figure 2 is a record taken of a bad magazine which had the last round jump out and Figure 3 is a record of a good magazine which did not have the last round jump out.

Both Figure 2 and Figure 3 definitely show that excessive magazine spring surges are not present and, therefore, cannot be causing the last round to jump out of the bad magazine. The magazine spring motions recorded were similar to those of the M16A1 Rifle.

Since the records show the weapons were not causing the malfunctions, the next step was to perform a visual inspection of the good and bad magazines to try to find a reason for the last round jumping out of the bad magazine. As a result of this inspection, it was found that a combination of too great a distance between the magazine lips and a tilted follower were causing the malfunctions. The maximum tolerance between lips allows a 12.1 mm distance, but the bad magazine had a distance between lips of 12.4 mm.

Also, as Figure 4 shows, the magazine follower of the bad magazine is tilted at a steep angle with respect to the side of the magazine. Therefore, instead of the follower holding the last round tight against the side of the magazine, as in the good magazine, the round is forced away from the side of the magazine by the tilted follower, as shown in Figure 5. The result of this is that as soon as the bolt carrier moves over or attempts to strip this last round, the round literally jumps out of the magazine. In fact, it is statically impossible to push the last round out of the bad magazine without having it jump out.

Upon further investigation, it was found that the tilted follower was caused by a tilt of the coils of the magazine spring as shown in Figure 6. Due to some change in the manufacturing process, the magazine spring of the bad magazine was wound with coils that all tilted downward.

Tests were also performed to show that it was a combination of too great a distance between the magazine lips, and a tilted follower causing the malfunction in the bad magazine. A spring and follower from a good magazine were placed in a bad magazine housing with too great a distance between lips, and a spring and follower from a bad magazine were placed in a good magazine housing. In each case the magazine functioned reliably.

Another difference found between the good and bad magazines during inspection concerned the guides or grooves in the front part of the magazines. The tops of these grooves form inserts on each side of the magazine to lift the front end of the round and force the front end slightly toward the center as the round is stripped from the magazine. This prevents

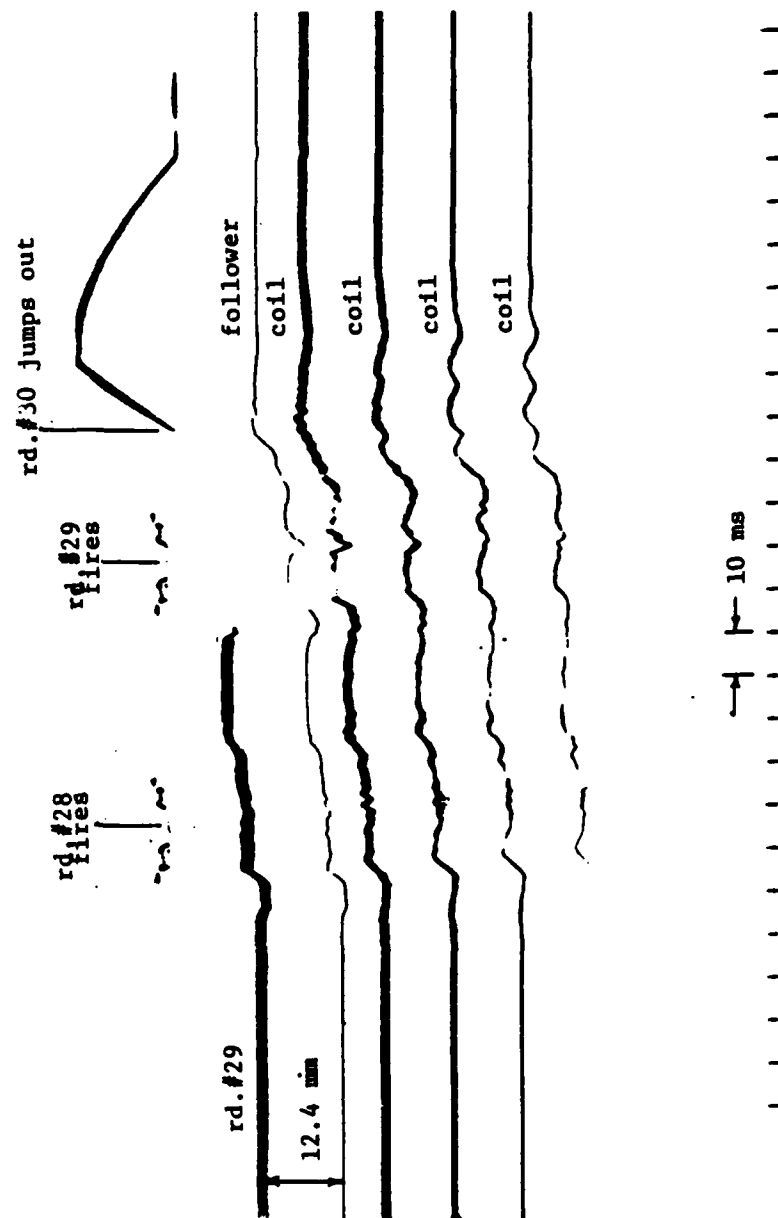


Figure 2. Vertical Displacement versus Time using Bad Magazine

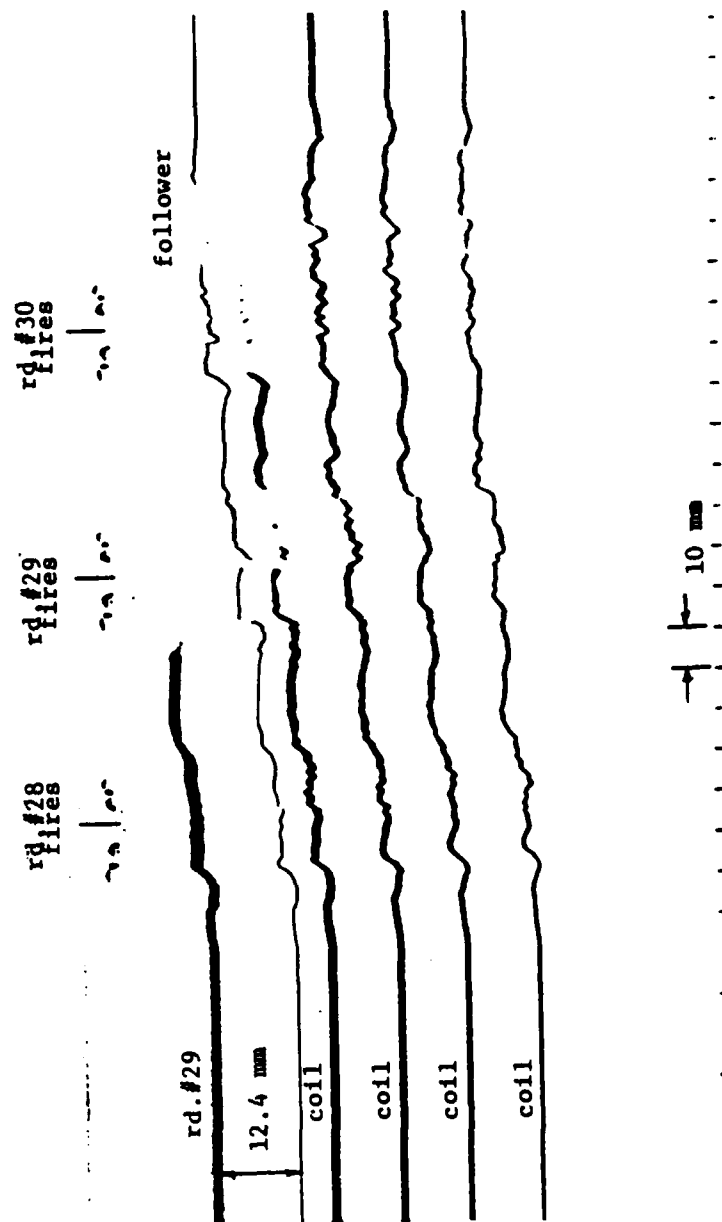


Figure 3. Vertical Displacement versus Time using Good Magazine

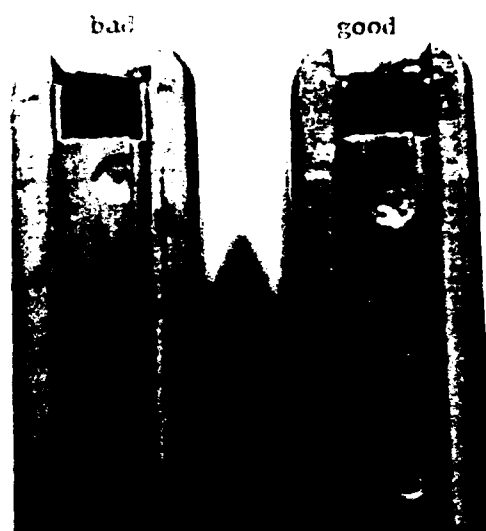


Figure 4. Tilted Magazine Follower

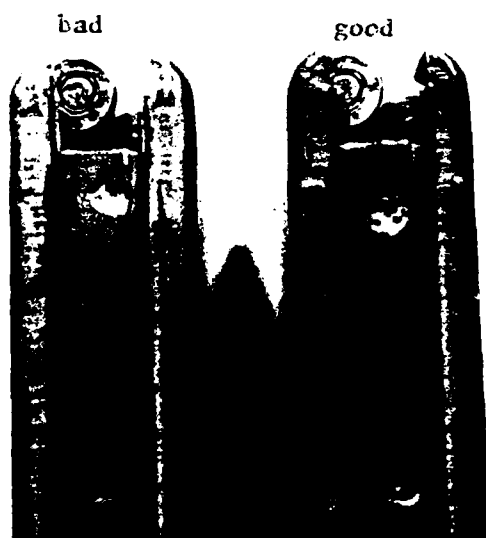


Figure 5. Effect of Tilted Follower on Last Round

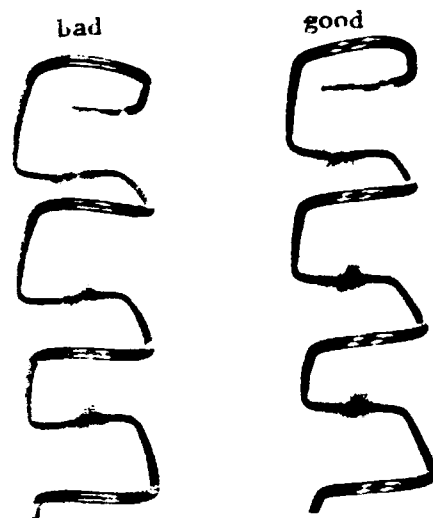


Figure 6. Tilted Magazine Spring Coils

the front end of the round from dragging over the forward edge of the magazine. The top of the grooves on the bad magazine was found to be too low to contact the round during stripping and was, therefore, no assistance in lifting or centering the round to prevent dragging of the round over the front edge of the magazine.

Also, with the top of the grooves too low, the front of the 29th round in the magazine is held up by the groove and the back of the round is tipped down. It is felt that this probably caused the bolt-override malfunction on the 29th round, which also occurred several times during the tests. In fact, there were no other bolt-override malfunctions other than on the 29th round.

Once the inspection had been completed on these samples of good and bad magazines, all of the magazines used in the recent tests at APG were obtained and visually inspected. Out of the 75 total magazines used in the tests, three had a combination of lips too wide and tilted followers, and all 75 had the grooves too low to contact the rounds during stripping. The three magazines with the combination of wide lips and tilted followers were the ones that were continually showing up in the tests with the last round jumping out.

IV. CONCLUSIONS

Based on the results the following conclusions were made:

1. There is no excessive magazine spring surge in the 30-round magazine when firing the M231 from a rigid ball mount.
2. The malfunction of the last round jumping out of the magazine during recent testing at APG was caused by three faulty magazines having a combination of lips too wide and tilted followers, and not by the weapons.

3. All of the 75 magazines used during recent testing at APG were also faulty in that grooves at the front of the magazine were not high enough to assist in lifting and centering the front of the round, and also probably caused the bolt-override malfunction on the 29th round.

V. RECOMMENDATIONS

Recommend that in the future, before any weapon testing takes place, the magazines used in the testing be completely checked out.

DISTRIBUTION LIST

<u>No. of Copies</u>	<u>Organization</u>	<u>No. of Copies</u>	<u>Organization</u>
12	Administrator Defense Technical Info Center ATTN: DTIC-DDA Cameron Station Alexandria, VA 22394-6145	5	Commander Armament R&D Center US Army AMCCOM, ARDEC ATTN: SMCAR-CCL-FW, H. Khann SMCAR-CCL-CH, A. Cianciosi SMCAR-CCL-CD, W. Gadamski SMCAR-CCJ SMCAR-CCL-A, R. Trifiletti Dover, NJ 07801
1	USDDR&E ATTN: R. Heaston The Pentagon Room 3D1089 Washington, DC 20301	1	Commander US Army AMCCOM, ARDEC ATTN: SMCAR-LCS Dover, NJ 07801
6	Headquarters Department of the Army ATTN: DAMA-CSM DAMA-WSA DAMA-WSZ-A DAMA-WSW DAMA-ART-M DACS-DM, J. Tucker Jr. Washington, DC 20310	2	Director US Army AMCCOM, ARDEC Benet Weapons Laboratory ATTN: SMCAR-LCB-TL SMCWV-QAR, Bldg 44, W. Jarrett Watervliet, NY 12189
3	Commander US Army Materiel Command ATTN: AMCDMD-ST AMCDE-SG AMCDRA-ST 5001 Eisenhower Avenue Alexandria, VA 22333	2	Commander US Army Armament, Munitions & Chemical Command ATTN: SMCAR-ESP-L, Tech Lib SMCAR-TSE-SW Rock Island, IL 61299
2	Commander US Army Laboratory Command ATTN: AMSLC-TD 2800 Powder Mill Road Adelphi, MD 20783-1145	1	Commander US Army Aviation Research and Development Command ATTN: AMSAV-E 4300 Goodfellow Blvd St. Louis, MO 63120
1	Commander US Army Laboratory Command ATTN: AMSLC-TP-PB, I. Bartkey 2800 Powder Mill Road Adelphi, MD 20783-1145	1	Director US Army Air Mobility Research and Development Laboratory Ames Research Center Moffett Field, CA 94035
2	Commander Armament R&D Center US Army AMCCOM, ARDEC ATTN: SMCAR-TSS SMCAR-TDC Dover, NJ 07801	1	Commander US Army Communications Cnd ATTN: AMSEL-ED Fort Monmouth, NJ 07703

DISTRIBUTION LIST

<u>No. of Copies</u>	<u>Organization</u>	<u>No. of Copies</u>	<u>Organization</u>
1	Commander ERADCOM Technical Library ATTN: DELSD-L (Reports Section) Fort Monmouth, NJ 07703-5301	4	Commander US Army Infantry School ATTN: ATSH-CD ATSH-CD-CSO-OR ATSH-TSM-FV ATSH-CD-MLS-M Fort Benning, GA 31905
1	Director Harry Diamond Laboratories ATTN: DELHD-DE-OS, R. Johnson 2800 Powder Mill Road Adelphi, MD 20783	2	Director US Army TRADOC Systems Analysis Activity ATTN: ATAA-SA ATAA-SL, Tech Lib White Sands Missile Range NM 88002
1	Commander US Army Missile Command RD&E Center ATTN: AMSMI-RD Redstone Arsenal, AL 35898	2	Commander US Army Operational Test and Evaluation Agency ATTN: CSTE-TM-IN CSTE-TD 5600 Columbia Pike Falls Church, VA 22041
1	Commander US Army Missile & Space Intelligence Center ATTN: AIAMS-YDL Redstone Arsenal, AL 35898- 5500	3	Commander US Army Training & Doctrine Command ATTN: ATCD-SE, ATTE-R ATCD-DCS Ft. Monroe, VA 23651-5000
5	Commander US Army Tank Automotive Cnd ATTN: AMSTA-FVS AMSTA-FVS-G AMSTA-CV-D AMSTA-UL AMSTA-TSL Warren, MI 48397-5000	3	Commander US Army Development and Employment Agency ATTN: MODE-TED-SAB, Maj. C. Ostrand AFZJ-DPT-IM Fort Lewis, WA 98433
2	Commander US Army Infantry Center ATTN: AFYC, Col. G. Rodgers Maj. M. Bailey Fort Benning, GA 31905-5000		
2	President US Army Infantry Board ATTN: ATZB-IB-SA, Maj. T. Gross L. Tomlinson Fort Benning, GA 31905		

DISTRIBUTION LIST

<u>No. of Copies</u>	<u>Organization</u>	<u>No. of Copies</u>	<u>Organization</u>
1	Commander US Army John F. Kennedy Special Warfare Center & School ATTN: ATSU-CD-ML, S. Putnam Ft. Bragg, NC 28307-5000	2	Commander USMC Development and Education Command ATTN: RVC-30903, LTC D. Willis CPT S. Walsh Quantico, VA 22134-5040
1	Naval Sea Systems Command ATTN: SEA-62Y1B Washington, DC 20362	1	Commander USMC Development Center ATTN: D0310, COL. R. Bowles Quantico, VA 22134
3	Commander Naval Ordnance Systems Cnd ATTN: ORD-9132 Washington, DC 20360	1	Air Force Armament Laboratory ATTN: AFATL/DLODL Eglin AFB, FL 32542-5000
3	Commander US Naval Weapons Center ATTN: Code 233 Code 12 Code 3176 China Lake, CA 93555	1	AFWL/SUL Kirtland, AFB, NM 87117
1	Commander Naval Special Warfare Group - 2 ATTN: N4, MMCS W. White USNAB, Little Creek Norfolk, VA 23521	10	Central Intelligence Agency Office of Central Reference Dissemination Branch Room GE-47 HQs Washington, DC 20502
3	Commander US Naval Weapons Support Center ATTN: Code 20, C. Zeller G. Dornick J. Massen Crane, IN 47522	<u>Aberdeen Proving Ground</u>	
2	Commander US Marine Corps ATTN: AX Washington, DC 20380	Dir, USAMSAA ATTN: AMXSY-D AMXSY-MP, H. Cohen	
2	Director Development Center ATTN: MCDEC/D092 MCDEC/D091 Quantico, VA 22134	Cdr, USATECOM ATTN: AMSTE-TO-F Cdr, CRDEC, AMCCOM ATTN: SMCAR-RSP-A SMCCR-MR SMCCR-SPS-IL	

USER EVALUATION SHEET/CHANGE OF ADDRESS

This Laboratory undertakes a continuing effort to improve the quality of the reports it publishes. Your comments/answers to the items/questions below will aid us in our efforts.

1. BRL Report Number _____ Date of Report _____
2. Date Report Received _____
3. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which the report will be used.) _____

4. How specifically, is the report being used? (Information source, design data, procedure, source of ideas, etc.) _____

5. Has the information in this report led to any quantitative savings as far as man-hours or dollars saved, operating costs avoided or efficiencies achieved, etc? If so, please elaborate. _____

6. General Comments. What do you think should be changed to improve future reports? (Indicate changes to organization, technical content, format, etc.) _____

CURRENT
ADDRESS

Name

Organization

Address

City, State, Zip

7. If indicating a Change of Address or Address Correction, please provide the New or Correct Address in Block 6 above and the Old or Incorrect address below.

OLD
ADDRESS

Name

Organization

Address

City, State, Zip

(Remove this sheet, fold as indicated, staple or tape closed, and mail.)

----- FOLD HERE -----

Director
US Army Ballistic Research Laboratory
ATTN: DRXBR-OD-ST
Aberdeen Proving Ground, MD 21005-5066



NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE, \$300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO 12062 WASHINGTON, DC
POSTAGE WILL BE PAID BY DEPARTMENT OF THE ARMY

Director
US Army Ballistic Research Laboratory
ATTN: DRXBR-OD-ST
Aberdeen Proving Ground, MD 21005-9989



----- FOLD HERE -----

END

11-87

DTIC