

AD-A186 651

MTL TR 87-48

AD

DTIC FILE 02

200301 271 30

FUSED SALT ELECTRODEPOSITED TiB₂ COATINGS ON HIGH-SPEED STEEL TWIST DRILLS

WILLIAM S. RICCI and JAMES L. WONG
PROCESSING TECHNOLOGY DIVISION

MILTON LEVY and KIRIT J. BHANSALI
METALS RESEARCH DIVISION



September 1987

Approved for public release; distribution is unlimited.



US ARMY
LABORATORY COMMAND
MATERIALS TECHNOLOGY
LABORATORY

U.S. ARMY MATERIALS TECHNOLOGY LABORATORY
Watertown, Massachusetts 02172-0001

87 10 8 040

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

Mention of any trade names or manufacturers in this report shall not be construed as advertising nor as an official indorsement or approval of such products or companies by the United States Government.

DISPOSITION INSTRUCTIONS

Destroy this report when it is no longer needed.
Do not return it to the originator.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

A

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER TR 87-48	2. GOVT ACCESSION NO. A186651	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) FUSED SALT ELECTRODEPOSITED TiB_2 COATINGS ON HIGH-SPEED STEEL TWIST DRILLS		5. TYPE OF REPORT & PERIOD COVERED Final report
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s) William S. Ricci, James L. Wong, Milton Levy, and Kirit J. Bhansali		8. CONTRACT OR GRANT NUMBER(s)
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Materials Technology Laboratory Watertown, Massachusetts 02172-0001 SLCMT-MC		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS D/A Project: 1L263102D077 Agency Accession: DA30 3398
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Laboratory Command 2800 Powder Mill Road Adelphi, Maryland 20783-1145		12. REPORT DATE September 1987
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		13. NUMBER OF PAGES 16
		15. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Drills, Electrodeposition, Coatings, Machining Titanium diboride, Salt		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) (SEE REVERSE SIDE)		

DD FORM 1473
1 JAN 73

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

Block No. 20

TITANIUM BORIDE

ABSTRACT

Tool life tests were conducted on high speed steel twist drills coated with TiB_2 by the fused salt electrodeposition process. Test results are presented and mechanisms of tool failure are discussed. Modifications to the fused salt electrodeposition process and the character of TiB_2 coatings are recommended for cutting tools and other applications. — *Stipingo*



Accession For	
NTIS CRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

INTRODUCTION

Titanium Nitride

The cutting tool industry has traditionally sought to extend the life of tools through the use of surface treatments. For example, ~~TiN~~ coatings, applied to tooling by the chemical vapor deposition and physical vapor deposition processes are widely used in the aircraft and automotive industries to improve tool life by providing more wear-resistant surfaces, as well as chemical and thermal barriers to diffusion.^{1,2}

Since the hardness of TiB_2 (15-45 GPa) is significantly higher than TiN (16-20 GPa), comparable improvements in tool life and cutting performance with difficult to machine materials are to be expected with TiB_2 coated tools. The problem, however, is the technical difficulty in coating tools with adherent TiB_2 by physical or chemical vapor deposition processes. Deposition of TiB_2 using a fused salt electrolysis process is a viable alternative. This concept was tried out successfully in laboratory trials.³ The purpose of this report is to evaluate the performance of fused salt electrodeposited TiB_2 coatings on high-speed steel twist drills and to specify any process modifications necessary.

EXPERIMENTAL

A pilot scale fused salt cell was built by HTC Industries, Simsbury, CT. The electrolyte employed in this process was the ternary eutectic of lithium-, sodium-, and potassium-fluoride (FLINAK), melting at 842°F (454°C) with titanium and boron added as fluotitanate (TiF_6) and fluoborate (BF_4), respectively. The fused salt cell was operated under an inert gas enclosure ("dry box").

Four heavy web, 0.25 inch diameter, M33 high speed steel twist drills with a crankshaft ground design and 135° point angles were coated with TiB_2 . Principal coating parameters and resultant coating thicknesses are shown, as reported by HTC Industries, in Table 1. The adhesion and integrity of the 0.0005-inch-thick TiB_2 coating was inferior to that of the 0.001-inch-thick coating as shown in Figure 1. This, however, could be the result of inadequate surface preparation prior to plating.

Table 1. FUSED SALT ELECTRODEPOSITION PARAMETERS AND RESULTANT COATING THICKNESS FOR EACH DRILL

Drill ID	Plating temp. (°F)*	Current Density mA/cm ²	Nominal Coating Thickness (in.)
A	1120	10	0.0005
B	1120	15	0.001
C	1120	25	0.001
D	1120	40	0.001
E	- Not Coated - Bright Finish -		
F	- Not Coated - Bright Finish -		

*Time at temperature - approximately 100 minutes

1. *TiN-Coated Tools: A Status Report*. Cutting Tool Engineering, v. 36, no. 1, (January/February), 1984, p. 1-5.
2. ANDERSON, A. E. *Vapor Deposited Coatings Combat Friction and Wear*. Metal Progress, v. 128, no. 3, August 1985, p. 41-45.
3. COUCH, H. T. *TiB_2 Electrodeposited Hard-Faced Coatings for Tools*. HTC Industries, Inc., Contract DAAG45-85-C-0026, Bimonthly Progress Report No. 5, U.S. Army Materials Technology Laboratory, July 27, 1986.

A series of holes were drilled with each drill, until tool failure, into a 0.75-inch-thick AISI 4340 steel, quenched and tempered to a hardness of 44 HRC. Drilled depths were limited to 0.50 inch to prevent the aggravated wear experienced when making through holes. Uncoated drills were similarly tested as a control.

Recommended drilling parameters⁴ were not used due to the formation of built up edges on coated tools. However, a 0.004 ipr feed and 30 fpm speed, the recommended parameters for 38 HRC steels, were used. For the uncoated drills, this resulted in a reasonable tool life of ~ 110 holes. All holes were drilled without coolant or lubricant. This was done in order to accelerate tool wear and to minimize coating failure due to thermal stresses.

Cutting force and torque about the spindle axis were monitored by a dynamometer during all experiments. Drills were considered to have failed or to have been significantly worn when the thrust force of the drill into the workpiece, required to maintain a constant feed rate, doubled its initial value to ~ 400 lbf, Figure 2.

RESULTS

The total number of holes made with each tool when drilled to failure is shown in Table 2. Erosion of the coating at the chisel edge, land, and flute surfaces was noticed after the first hole was drilled with each tool. Land wear of failed tools, both coated and uncoated, was nearly identical (see Figure 3). However, wear in the flute near the lip of coated tools was not similar. Figure 4, which shows the flute wear patterns of drills that failed after 6 and 160 holes, documents the general trend that the extent of flute wear is a function of holes drilled or the total exposure time of the flute to chip flow. Figure 5 shows that coating irregularities, such as those previously shown in Figure 1, were not found to significantly affect flute wear.

Table 2. TOTAL NUMBER OF HOLES
DRILLED WITH EACH TOOL

Drill ID	Holes Drilled
A	180
B	6
C	34
D	160
E	110
F	106

Residual traces of the coating were found in the flute wear zone. Figures 6 and 7 show qualitative element identifications for drills A and B after tool failure in the flute wear zone in the flute, but 1.5 inches from the chisel edge, respectively.

Figure 8 shows a similar trace for drill D and the presence of K, Na, and Si can be seen in the unaffected coating. Since the electrolyte employed is nominally the eutectic of lithium-, sodium-, and potassium-fluorides, the presence of K and Na is expected. The source of Si cannot be explained. In addition, from the relative Ti/Fe line intensity ratios it appears that in this section the TiB₂ coating is thinner.

4. Machining Data Handbook, Machinability Data Center, Cincinnati, OH, 1980, p. 3-15.

Figures 9 through 12 show SEM photographs of the coatings for drills A through D, respectively. For drills A through C, coating roughness and electrodeposited particle size increased with increasing current density. The overall smoother morphology of the deposited particles and overall adherence of the coating on drill D appears to be superior to that of the others, possibly due to different salt and coating chemistries. High points of deposited particles or asperities in the coating appear to have fractured preferentially, as can be seen in samples taken progressively closer to the cutting edge.

DISCUSSION

Even though the bulk TiB_2 coating was worn away from the cutting edge after only a few holes had been drilled, a residual effective coating thickness which penetrates into the substrate appears to remain. This additional affected surface, as evidenced by the EDAX results which show Ti lines even though no coating is present, appears to continue to resist abrasive wear even after the macrocoating has been destroyed. This effect is similar to that which is believed to occur in ion implanted and TiN coated cutting tools due to the interdiffusion of the deposited atomic species into the substrate.

The increase in tool life of TiB_2 coated drills A and D, over the uncoated bright finished drills E and F is not considered to be statistically significant. This is due to the small sample size tested. A sampling of at least 30 precision ground drills, for each set of coating conditions, would be required for a valid test.

Since the normal tempering temperature of high-speed steel is in the range of 325°F to 1060°F, fused salt electrodeposition process temperatures should have been kept below 1000°F and time at temperature should not have exceeded 30 minutes. The thermal cycle to which the drills were exposed during the coating process employed in this study is therefore expected to have had a deleterious effect on tool life.

The 0.001-inch-thick coatings tested in this study are considered too thick. As coating thickness increases, coatings become an entity in themselves and tend to fracture, crack, and spall under thermomechanical stresses. Coating thicknesses in the range of 0.00015 inch to 0.00025 inch, commonly found on TiN coated tools, are recommended. Reduced coating thicknesses are also expected to enable lower process temperatures and shorter process times to be used, therefore reducing the potential for substrate damage due to overtempering. The 0.0005-inch-coating thickness of drill A may, therefore, have contributed to its relatively long tool life.

The lower inclination angle of deposited particles on drill D contributed to the superior performance of this drill. Low inclination angles not only indicate good adherence but also reduced stress concentrations, which act as initiation sites for coating failure.

Unexplained differences in surface topography (drills A through C versus drill D), coating thickness (drills A through D), coating chemistry (drills A through C versus drill D) and tool life (drills A and D versus drills B and C), with respect to the primary reported process parameter (current density), indicate poor process control and/or the failure to record or report valid process parameters during fused salt electrodeposition.

CONCLUSIONS

Tool life tests of high speed steel twist drills coated with TiB_2 by the fused salt electrodeposition process were conducted. The statistical significance of those coated drills which out-performed uncoated bright finished drills may indicate a trend, but is doubtful due to the limited number of drills evaluated. Overtempering of the substrate due to excessive plating process temperatures and times may have been the cause of the short tool life observed for other drills.

Although coating wear at the chisel edge, land, and flute surfaces was immediate during the first hole, residual effects of the coating appear to continue to resist abrasive wear.

The thickness range of TiB_2 coatings should be between 0.00015 inch and 0.00025 inch for high-speed metal cutting applications. This is expected to minimize residual stresses and the tendency of coatings to crack and spall under thermomechanical stresses. Secondary benefits to reduced coating thicknesses include lower plating process temperatures and shorter process times, both of which will reduce the potential for substrate damage.

Process temperatures below 1000°F are recommended for high-speed steel tooling. Improved electrodeposition process control, from precleaning uniformity and consistency to the maintenance of salt chemistries, is also required. This is mainly because the character of deposited coatings was found to vary significantly with changes in process parameters.

Future applications for TiB_2 coatings should include low impact, low speed cutting tools such as broaches and high value added items, possibly turbine blades.

ACKNOWLEDGMENTS

The authors wish to thank Mr. James Buckley for performing the machinability tests and Ms. Gail Meyers for her work on the SEM.



a. The 0.0005 inch TiB_2 coating thickness, drill A



b. A typical 0.001 inch coating thickness, drill B

Figure 1. Photographs showing a higher concentration of surface discontinuities (Mag. 7.5).

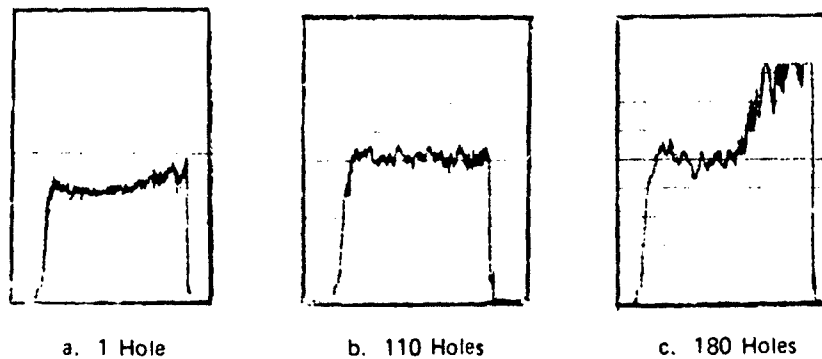


Figure 2. Cutting force traces for drill A after 1, 110, and 180 holes were drilled (Scale: 50 lb/div).



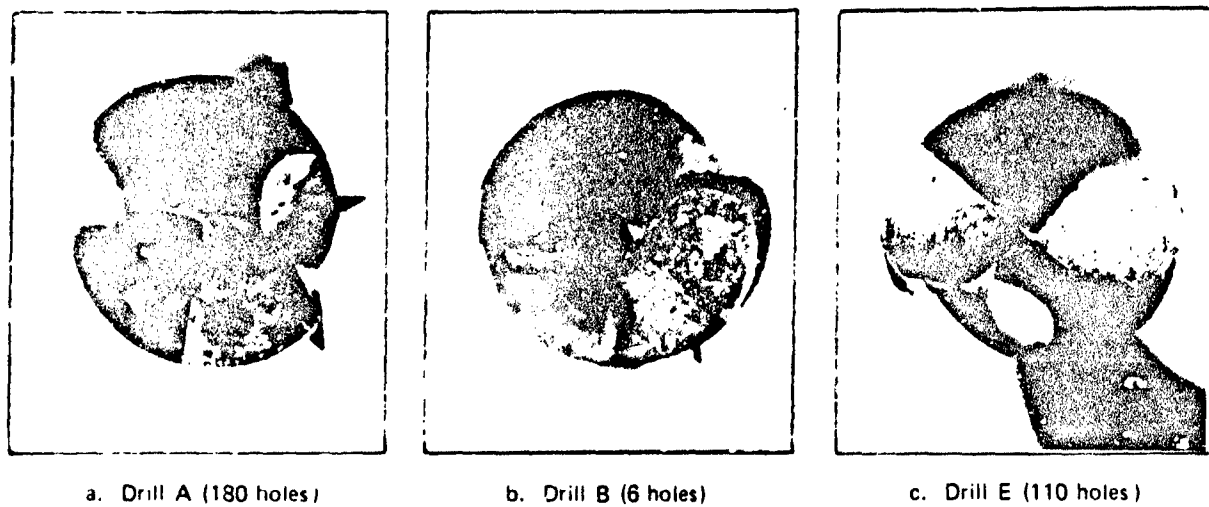


Figure 3. End view of drills showing land wear (Mag. 7X).

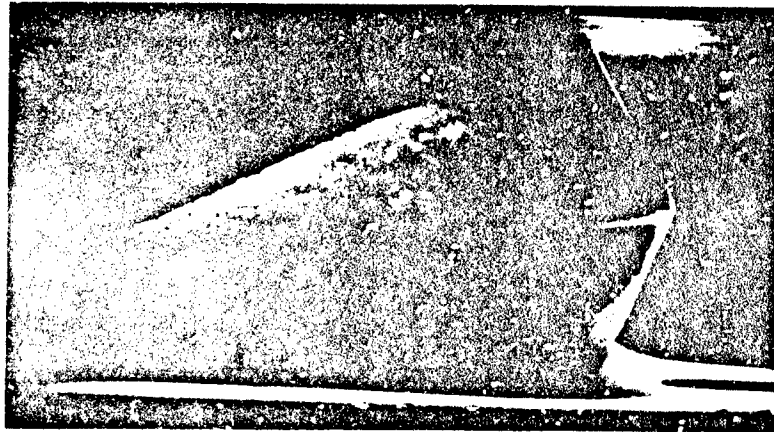

a. Drill B

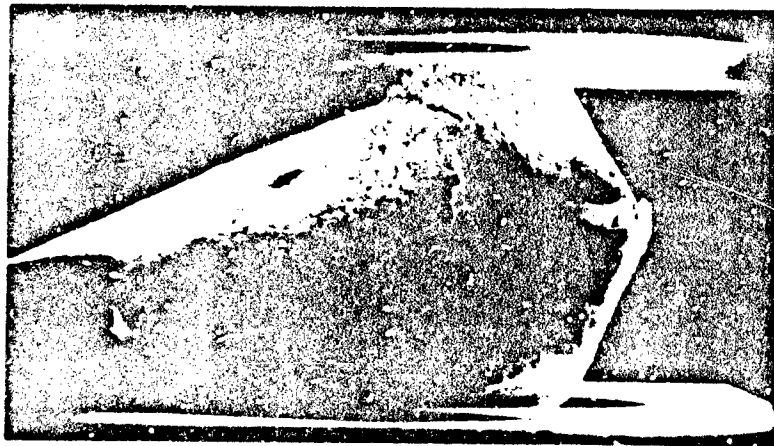


b. Drill D


Figure 4. Flute wear patterns shown by scanning electron micrography (Mag. 10X).



Figure 5. Flute wear pattern of drill A after tool failure, SEM (Mag. 10X).

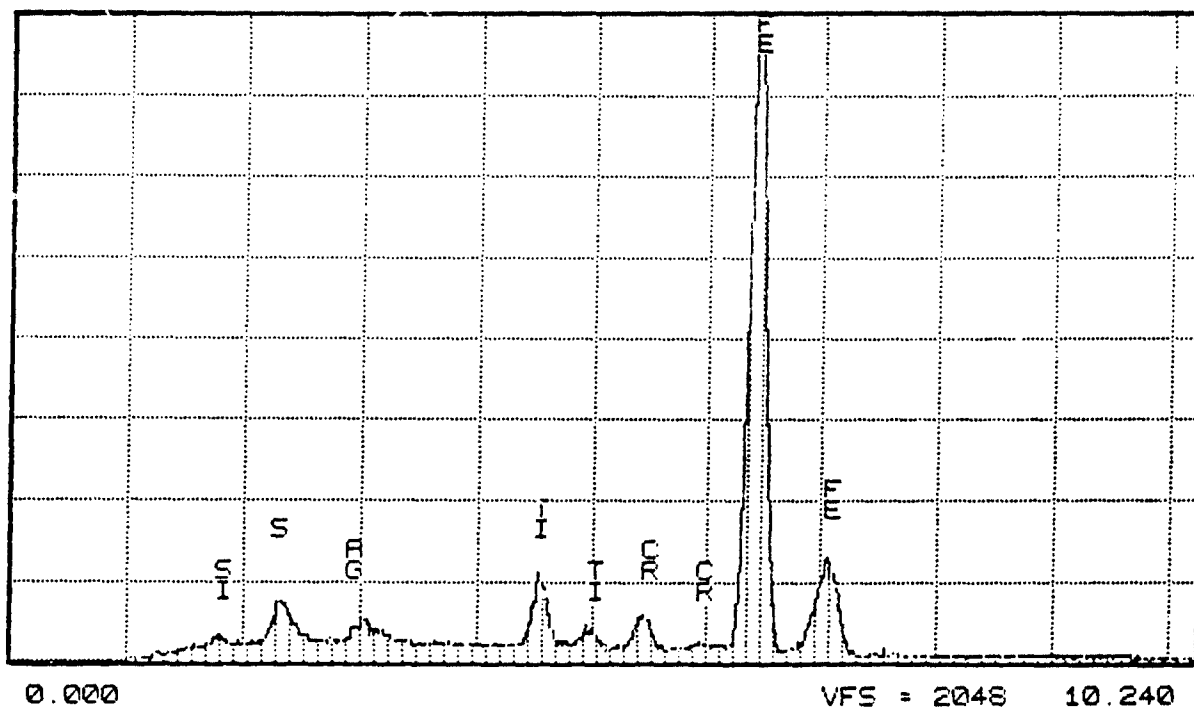


a. Drill A

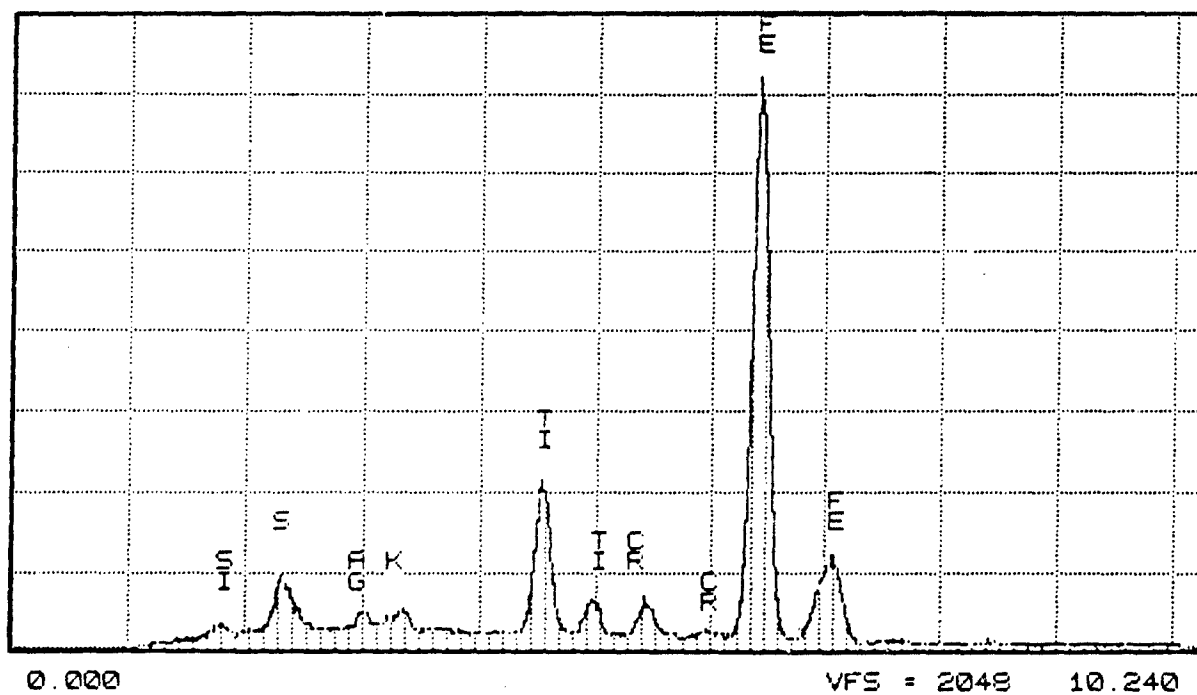


b. Drill B

Figure 6. Qualitative element identification in the flute wear zone.

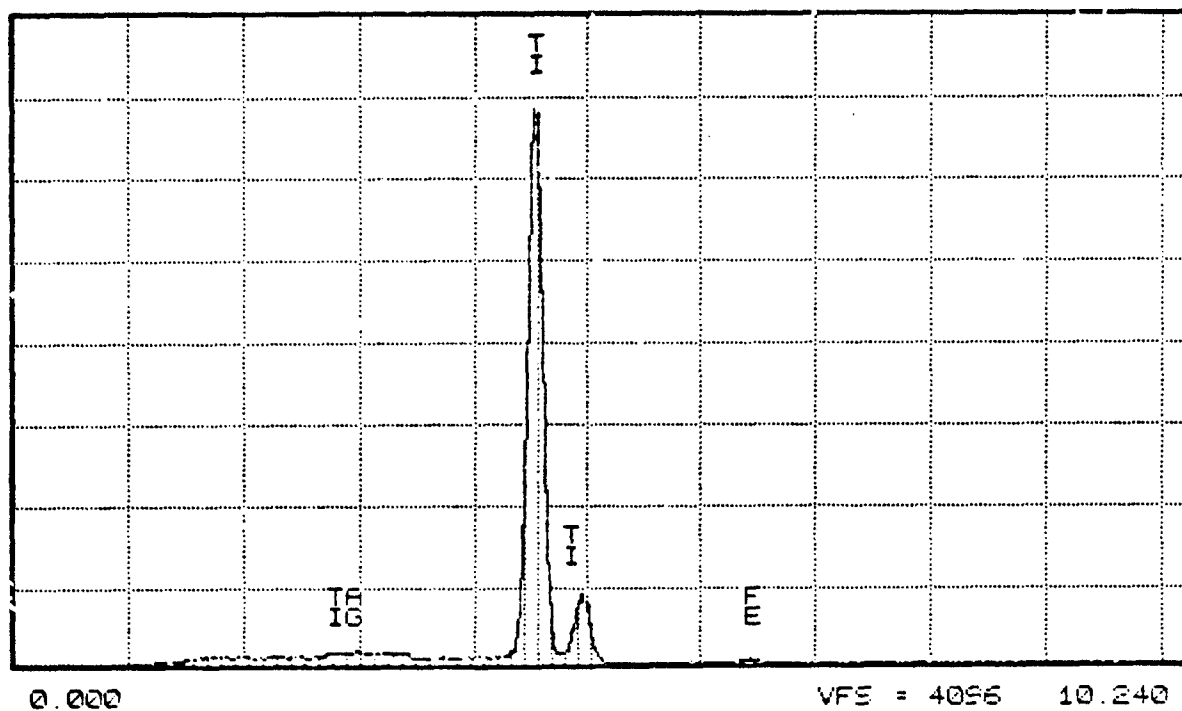


a. Drill A

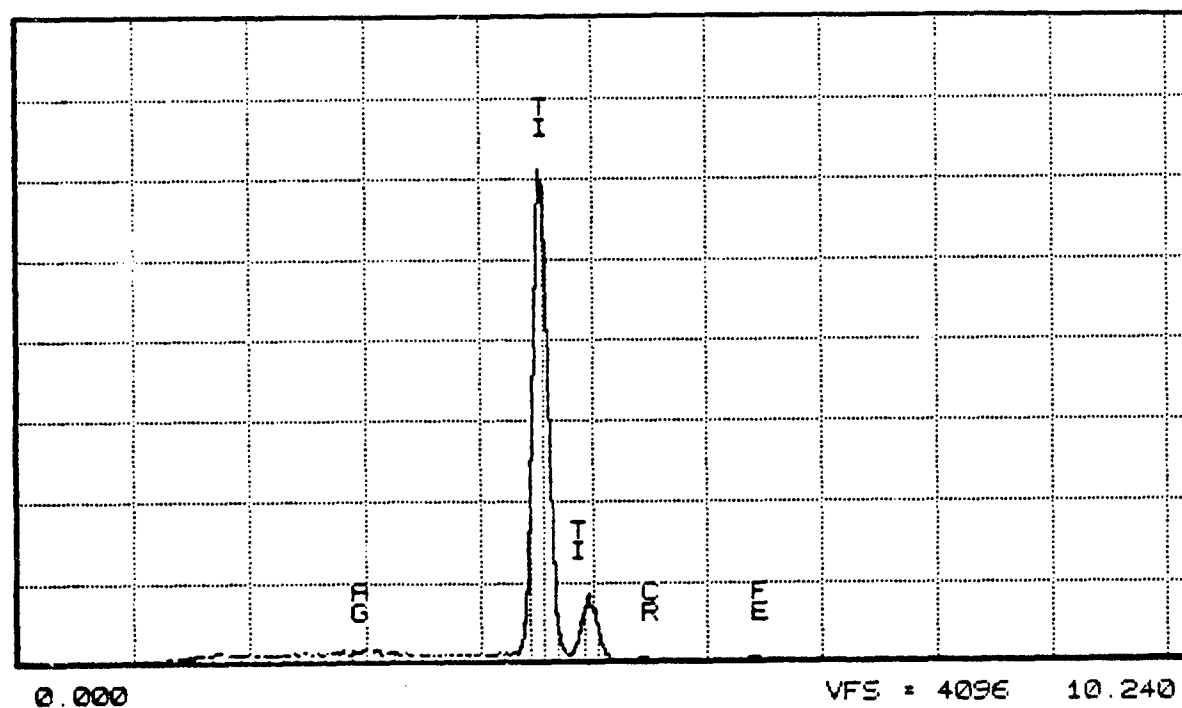


b. Drill B

Figure 7. Qualitative element identification in the unaffected flute area.

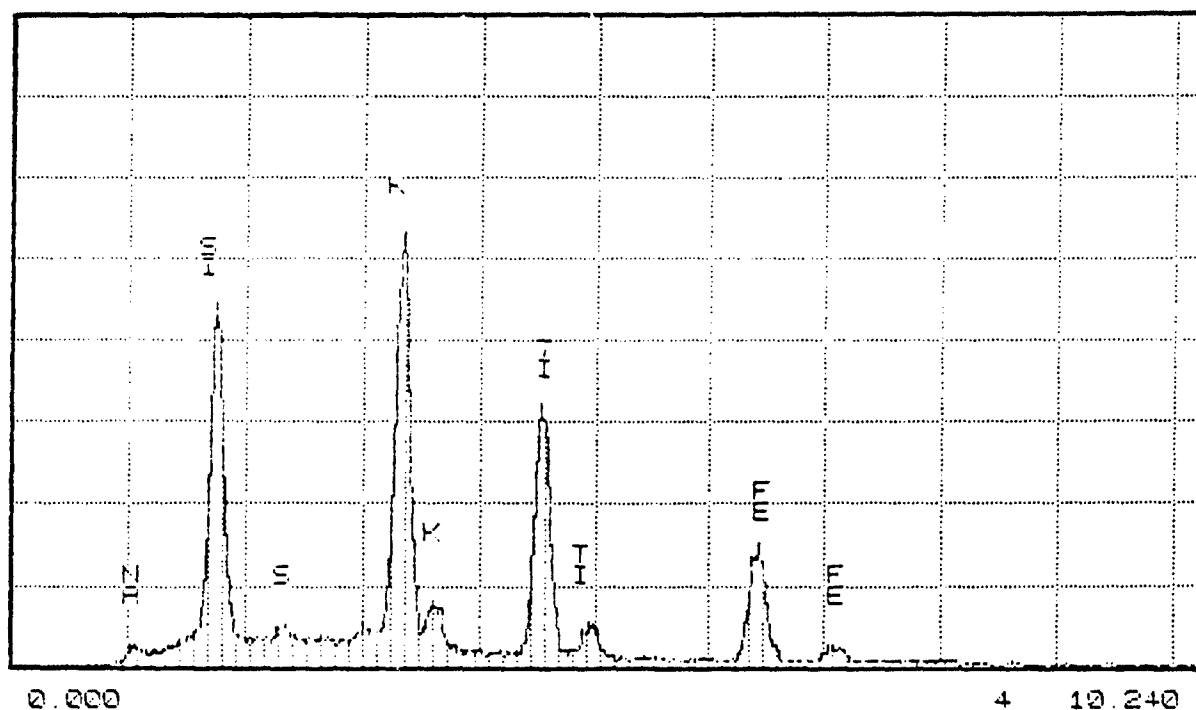


a. 1.5 Inches from chisel point

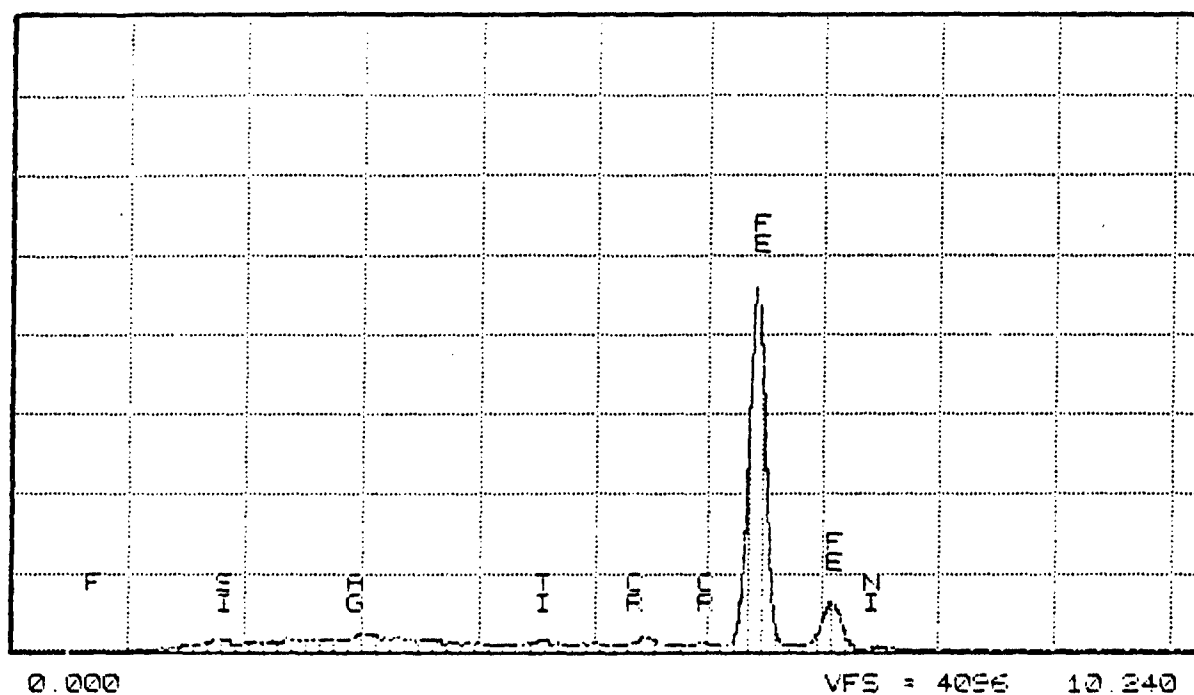

b. The flute wear zone

Figure 8. Qualitative element identification for drill D.

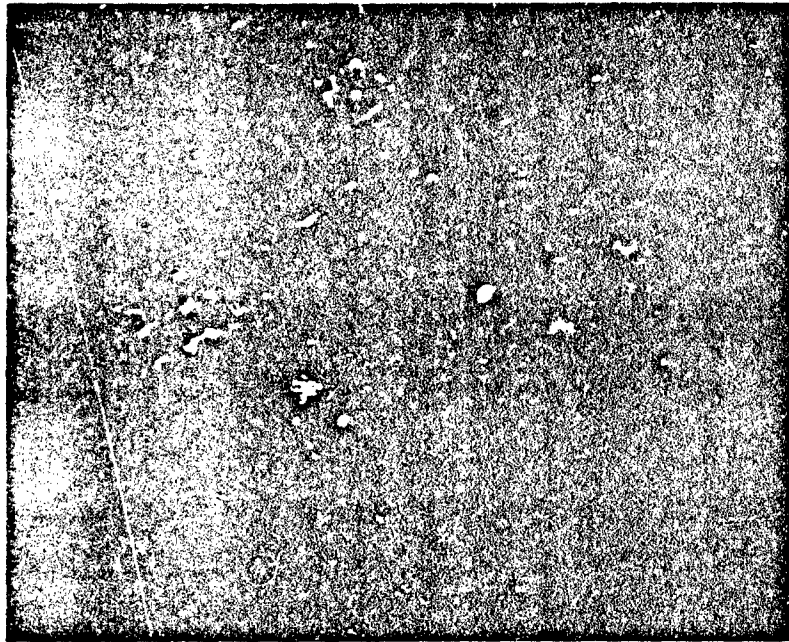

a. Away from the cutting edge of drill A



b. Close to the cutting edge of drill A

Figure 9. SEM photographs (Mag. 1000X).


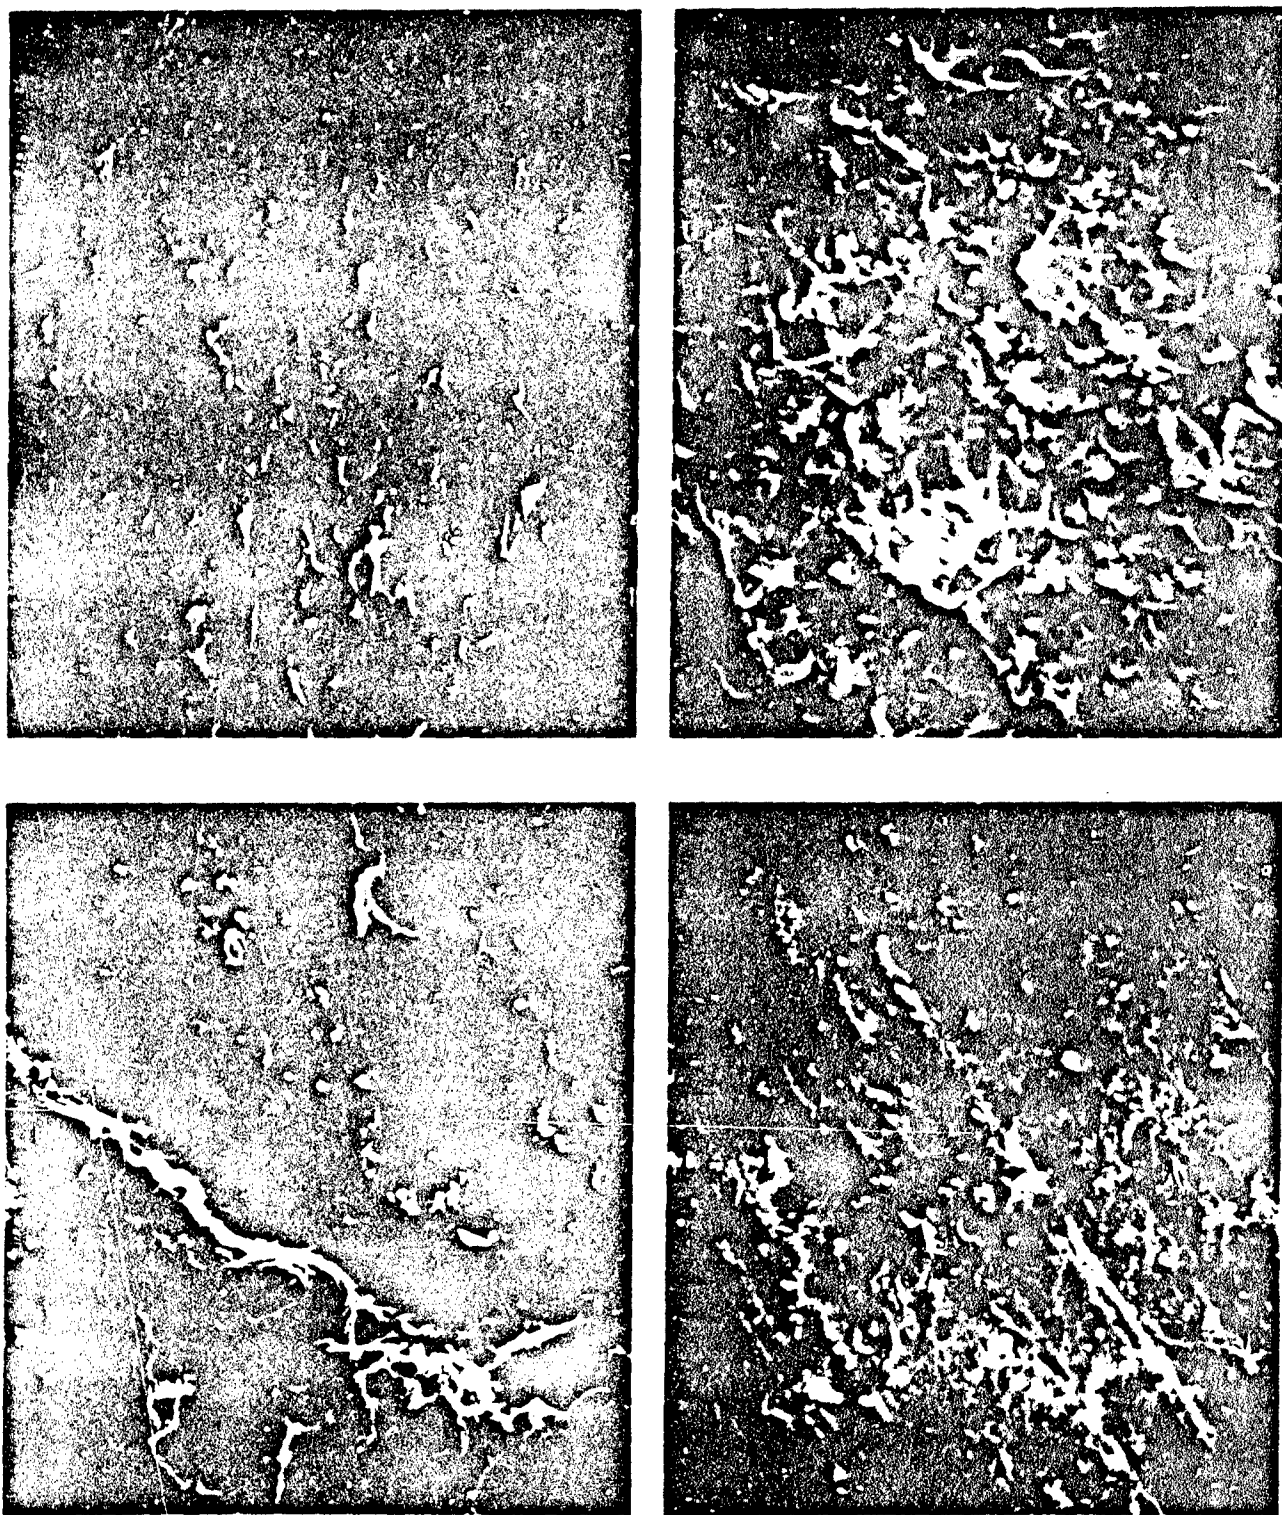



Figure 10. SEM photographs of the TiB₂ coating taken progressively closer to the cutting edge of drill B (Mag. 1U00X).



a. Mag. 250X

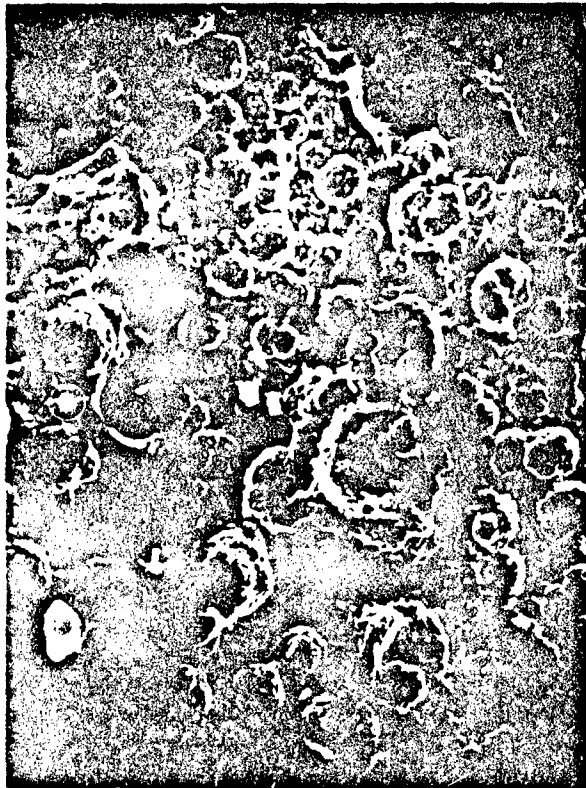


b. Mag. 1000X

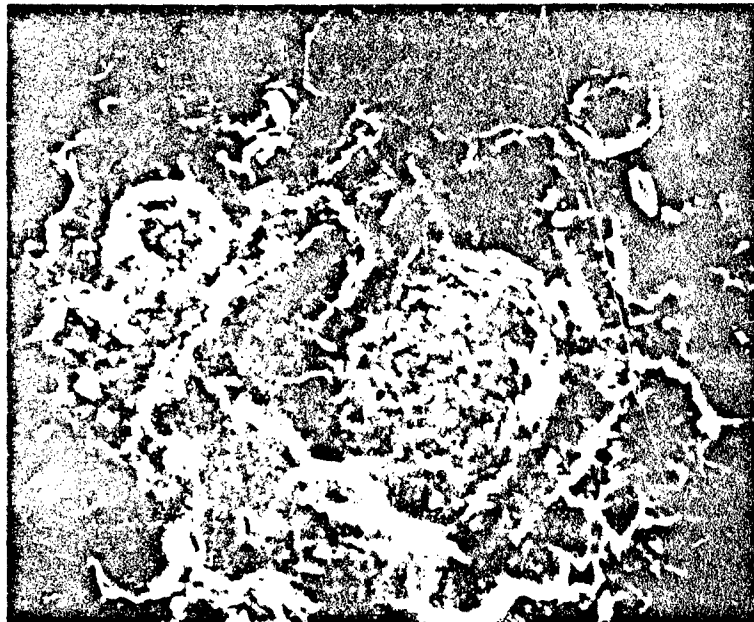

c. An area closer to the cutting edge where asperities of the coating have fractured on drill C (Mag. 1000X)


Figure 11. SEM photographs of the unaffected coating.

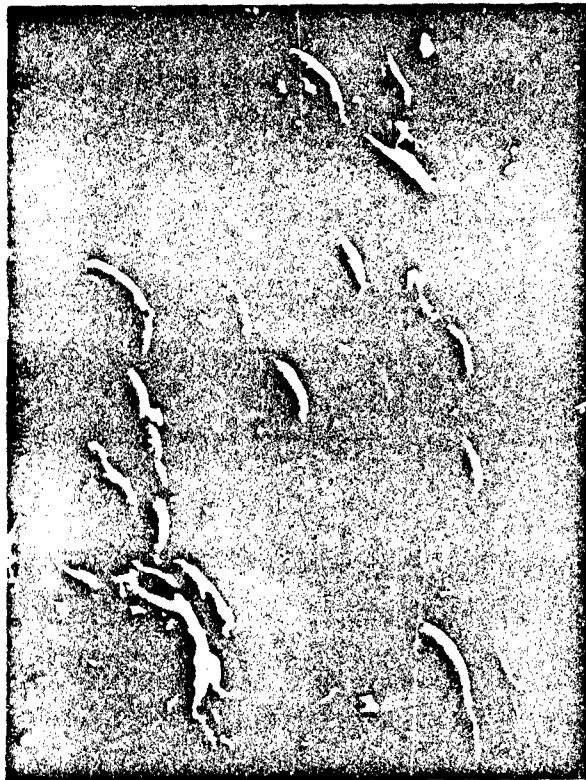

a.



b.

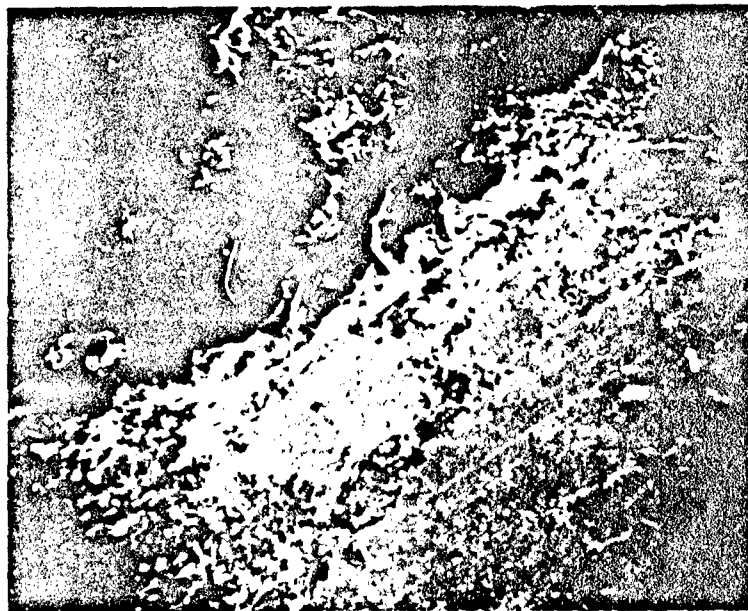

c.

Figure 12. SEM photographs of the coating of drill D progressing towards the cut edge (Mag. 1000X).

DISTRIBUTION LIST

No. of Copies	To
1	Office of the Under Secretary of Defense for Research and Engineering, The Pentagon, Washington, DC 20301
	Commander, U.S. Army Laboratory Command, 2800 Powder Mill Road, Adelphi, MD 20783-1197
1	ATTN: Technical Library
	Commander, Defense Technical Information Center, Cameron Station, Building 5, 5010 Duke Street, Alexandria, VA 22304-6145
2	ATTN: DTIC-FDAC
	Metals and Ceramics Information Center, Battelle Columbus Laboratories, 505 King Avenue, Columbus, OH 43201
1	ATTN: Mr. Robert J. Fiorentino, Program Manager
1	Defense Advanced Research Projects Agency, Defense Sciences Office/MSD, 1400 Wilson Boulevard, Arlington, VA 22209
	Headquarters, Department of the Army, Washington, DC 20314
1	ATTN: DAEN-RDM, Mr. J. J. Healy
	Commander, U.S. Air Force Wright Aeronautical Laboratories, Wright-Patterson Air Force Base, OH 45433
1	ATTN: AFWAL/MLC
1	AFWAL/MLLP, D. M. Forney, Jr.
1	AFWAL/MLBC, Mr. Stanley Schulman
1	AFWAL/MLLS, Dr. Terence M. F. Ronald
1	AFWAL/FIBEC, Dr. Steve Johnson
1	Edward J. Morrissey, AFWAL/MLTE, Wright-Patterson Air Force Base, OH 45433
	Commander, Army Research Office, P.O. Box 12211, Research Triangle Park, NC 27709-2211
1	ATTN: Information Processing Office
1	Dr. George Mayer
	Commander, U.S. Army Materiel Command, 5001 Eisenhower Avenue, Alexandria, VA 22333
1	ATTN: AMCLD
	Commander, U.S. Army Armament, Munitions and Chemical Command, Dover, NJ 07801
1	ATTN: Mr. Harry E. Peibly, Jr., PLASTEC, Director
	Commander, U.S. Army Aviation Systems Command, 4300 Goodfellow Blvd., St. Louis, MO 63120
1	ATTN: AMDAV-NS, Harold Law
	Director, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD 21005
1	ATTN: AMDAR-TSB-S (STINFO)
	Commander, U.S. Army Electronics Research and Development Command, Fort Monmouth, NJ 07703
1	ATTN: AMDSO-L
1	AMDSO-E
	Commander, U.S. Army Foreign Science and Technology Center, 220 7th Street, N.E., Charlottesville, VA 22901
1	ATTN: Military Tech
	Commander, U.S. Army Materiel Systems Analysis Activity, Aberdeen Proving Ground, MD 21005
1	ATTN: AMXSY-MP, H. Cohen
	Commander, U.S. Army Missile Command, Redstone Scientific Information Center, Redstone Arsenal, AL 35898-5241
1	ATTN: AMSMI-RD-CS-R, Documents
1	AMSMI-RLM
1	AMSMI-RLA, Dr. James J. Richardson

No. of Copies	To
	Commander, U.S. Army Belvoir Research, Development and Engineering Center, Fort Belvoir, VA 22060-5606
1	ATTN: STRBE-D
1	STRBE-G
1	STRBE-BD, C. McCord
1	STRBE-N
1	STRBE-VL
	Commander, U.S. Army Research and Technology Labs, Applied Technology Laboratory (AVSCOM), Fort Eustis, VA 23604
1	ATTN: AMDAR-ATL-ATP, Mr. James Gomez, Aerospace Engineer
	Commander, U.S. Army Tank-Automotive Command, Warren, MI 48090
1	ATTN: AMSTA-RCKM
	Director, Benet Weapons Laboratory, LCWSL, USA AMCOM, Watervliet, NY 12189
1	ATTN: AMSMC-LCB-TL
1	AMSMC-LCB-PS, Dr. I. Ahmad
	David Taylor Naval Ship Research and Development Center, Annapolis, MD 21402
1	ATTN: Dr. Michael Vassilaros - Code 2914
	Office of Naval Technology, 800 N. Quincy Street, Arlington, VA 20017
1	ATTN: Mr. J. J. Kelly - Code MAT 0715
	Naval Research Laboratory, Washington, DC 20375
1	ATTN: Dr. C. I. Chang - Code 5830
1	Dr. G. R. Yoder - Code 6384
1	Dr. S. C. Sanday - Code 6370
	Chief of Naval Research, Arlington, VA 22217
1	ATTN: Code 471
1	Dr. Steven G. Fishman
	Naval Sea Systems Command, Washington, DC 20362
1	ATTN: Mr. Marlin Kinna - 62R4
	Naval Air Development Center, Warminster, PA 18974
1	ATTN: Dr. E. U. Lee - Code 60632
	Naval Surface Weapons Center, White Oak, Silver Spring, MD 20910
1	ATTN: John V. Foltz - Code R32
1	Dr. Herbert Newborn - Code R34
	National Aeronautics and Space Administration, Washington, DC 20546
1	ATTN: Mr. Michael A. Greenfield, Program Manager for Materials, Code RTM-6
	National Aeronautics and Space Administration, Lewis Research Center, Cleveland, OH 44135
1	ATTN: Dr. James A. DiCarlo, Mail Stop 106-1
	National Aeronautics and Space Administration, Marshall Space Flight Center, Huntsville, AL 35812
1	ATTN: R. J. Schwinghammer, EH01, Dir, M&P Lab
1	Mr. W. A. Wilson, EH41, Bldg. 4612
	The Boeing Vertol Company, P.O. Box 16858, Philadelphia, PA 19142
1	ATTN: Mr. Robert L. Pinckney, Mail Stop P62-06
1	Mr. Joseph W. Lenski, Jr., Mail Stop P32-09
	E. I. DuPont De Nemours and Company, Inc., Textile Fibers Department, Pioneering Research Laboratory, Experimental Station, Wilmington, DE 19898
1	ATTN: Blake R. Bichlmeir
1	Joyce W. Widrig
	Mr. Rex C. Claridge, TRW, Incorporated, Manufacturing Division, Mail Stop 01-2210, 1 Space Park, Redondo Beach, CA 90278
1	Dr. James A. Cornie, Materials Processing Center, Bldg. 8, Room 237, Massachusetts Institute of Technology, 77 Massachusetts Avenue, Cambridge, MA 01239

No. of Copies	To
1	Dr. Bhagwan K. Das, Engineering Technology Supervisor, The Boeing Company, P.O. Box 3999, Seattle, WA 98124
1	Leroy Davis, NETCO, 2225 East 28th Street, Building 5, Long Beach, CA 90806
1	Mr. Joseph F. Dolowy, Jr., President, DWA Composite Specialties, Inc., 21133 Superior Street, Chatsworth, CA 91311
1	Mr. Robert E. Fisher, President, AMERCOM, Inc., 8948 Fullbright Avenue, Chatsworth, CA 91311
1	Mr. Louis A. Gonzalez, Kaman Tempo, 816 State Street, Santa Barbara, CA 93101
1	Prof. James G. Goree, Dept. of Mechanical Engineering, Clemson University, Clemson, SC 29631
1	William F. Grant, AVCO Specialty Materials Division, 2 Industrial Avenue, Lowell, MA 01851
1	Mr. Jacob Gubbay, Charles Stark Draper Laboratories, 555 Technology Square, Mail Station 27, Cambridge, MA 02139
1	Mr. John E. Hack, Southwest Research Institute, 6220 Culebra Road, San Antonio, TX 78284
1	Dr. H. A. Katzman, The Aerospace Corporation, P.O. Box 92957 Los Angeles, CA 90009
	Lockheed California Company, Burbank, CA 91520
1	ATTN: Mr. Rod F. Simenz, Department of Materials and Processes
	Lockheed Georgia Company, 86 South Cobb Drive, Marietta, GA 30063
1	ATTN: Materials and Processes Engineering Department
1	Mr. James Carroll
	Material Concepts, Inc., 2747 Harrison Road, Columbus, OH 43204
1	ATTN: Mr. Stan J. Paprocki
1	Mr. David Goddard
1	Dr. Mohan S. Misra, Martin Marietta Aerospace, P.O. Box 179, Denver, CO 80201
1	Mr. Patrick J. Moore, Staff Engineer, Lockheed Missiles and Space Company, Organization 62-60, Building 104, P.O. Box 504, Sunnyvale, CA 94086
1	R. Byron Pipes, Professor & Director, Center for Composite Materials, University of Delaware, Newark, DE 19711
1	Dr. Karl M. Prew, Principal Scientist, United Technologies Research Center, Mail Stop 24, East Hartford, CT 06108
1	Dr. B. W. Rosen, Materials Sciences Corporation, Gwynedd Plaza 11, Bethlehem Pike, Spring House, PA 19477
1	Prof. Marc H. Richman, Division of Engineering, Brown University, Providence, RI 02912
1	Mr. Ronald P. Tye, Energy Materials Testing Laboratory, Biddeford Industrial Park, Biddeford, ME 04005
1	Mr. Robert C. Van Siclen, Vought Corporation, Advanced Technology Center, P.O. Box 226144, Dallas, TX 75266
1	Prof. Franklin E. Wawner, Department of Materials Science, School of Engineering and Applied Sciences, University of Virginia, Charlottesville, VA 22903
1	Dr. Carl Zweben, General Electric Company, Valley Forge Space Center/M4018, P.O. Box 8555, Philadelphia, PA 19101
	Director, U.S. Army Materials Technology Laboratory, Watertown, MA 02172-0001
2	ATTN: SLCMT-IML
4	Authors

U.S. Army Materials Technology Laboratory,
Watertown, Massachusetts 02172-0001
FUSED SALT ELECTRODEPOSITED TiB₂ COATINGS
ON HIGH-SPEED STEEL TWIST DRILLS -
William S. Ricci, James L. Wong, Milton Levy,
and Kirit J. Bhansali

AD UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words
Drills
Coatings
Titanium diboride

Technical Report MTL TR 87-48, September 1987, 16 pp -
illus-tables, D/A Project IL263102D077

Tool life tests were conducted on high-speed steel twist drills coated with TiB₂ by the fused salt electrodeposition process. Test results are presented and mechanisms of tool failure are discussed. Modifications to the fused salt electrodeposition process and the character of TiB₂ coatings are recommended for cutting tools and other applications.

U.S. Army Materials Technology Laboratory,
Watertown, Massachusetts 02172-0001
FUSED SALT ELECTRODEPOSITED TiB₂ COATINGS
ON HIGH-SPEED STEEL TWIST DRILLS -
William S. Ricci, James L. Wong, Milton Levy,
and Kirit J. Bhansali

AD UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words
Drills
Coatings
Titanium diboride

Technical Report MTL TR 87-48, September 1987, 16 pp -
illus-tables, D/A Project IL263102D077

Tool life tests were conducted on high-speed steel twist drills coated with TiB₂ by the fused salt electrodeposition process. Test results are presented and mechanisms of tool failure are discussed. Modifications to the fused salt electrodeposition process and the character of TiB₂ coatings are recommended for cutting tools and other applications.