

4
AD


TECHNICAL REPORT ARCCB-TR-89001

**MACHINE TOOL DYNAMIC MEASUREMENTS
AND DIAGNOSTIC SYSTEM**

AD-A204 813

R. K. WHARTON

T. P. VINCENT

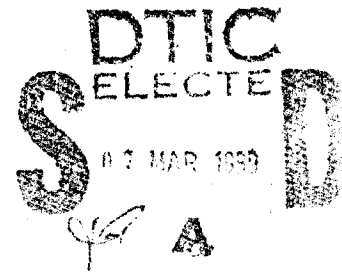

JANUARY 1989



**US ARMY ARMAMENT RESEARCH,
DEVELOPMENT AND ENGINEERING CENTER
CLOSE COMBAT ARMAMENTS CENTER
BENET LABORATORIES
WATERVLIET, N.Y. 12189-4050**



APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED

89 3 07 060

DISCLAIMER

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

The use of trade name(s) and/or manufacturer(s) does not constitute an official endorsement or approval.

DESTRUCTION NOTICE

For classified documents, follow the procedures in DoD 5200.22-M, Industrial Security Manual, Section II-19 or DoD 5200.1-R, Information Security Program Regulation, Chapter IX.

For unclassified, limited documents, destroy by any method that will prevent disclosure of contents or reconstruction of the document.

For unclassified, unlimited documents, destroy when the report is no longer needed. Do not return it to the originator.

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER ARCCB-TR-89001	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) MACHINE TOOL DYNAMIC MEASUREMENTS AND DIAGNOSTIC SYSTEM		5. TYPE OF REPORT & PERIOD COVERED Final
7. AUTHOR(s) R. K. Wharton and T. P. Vincent (See Reverse)		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS US Army ARDEC Benet Laboratories, SMCAR-CCB-TL Watervliet, NY 12189-4050		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS US Army ARDEC Close Combat Armaments Center Picatinny Arsenal, NJ 07806-5000		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS AMCMS No. 3297.06.8253 PRON No. M7-2-P1853-M7-1A
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE January 1989
		13. NUMBER OF PAGES 28
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		16a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Presented at the First Eastern Manufacturing Technology Conference, Springfield, MA, 10-12 November 1987. Published in Proceedings of the Conference.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Machine Tools, Dynamics Vibrations, Preventive Maintenance, Acquisition, Spindles, Baselines, Surfaces. (JES) ←		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Vibrations in machine tools, commonly known as chatter, often are the cause for poor machining operations and breakdown of machinery. A state-of-the-art measurement and analysis system was designed, fabricated, and implemented. The system performs real-time acquisition of raw vibration measurement data and provides analysis for preventative/predictive maintenance action. (CONT'D ON REVERSE) →		

7. AUTHORS (CONT'D)

T. P. Vincent
Operations Directorate
Watervliet Arsenal
Watervliet, NY 12189-4050

20. ABSTRACT (CONT'D)

The system has been used to determine the causes for poor surface finishes occurring during metal removal processes. In the first case, during rough and finish grinding operations, several grinder spindles were found to be significantly out of balance. Investigation revealed that during balancing of spindles, the spindle manufacturer was using frequency versus mils engineering units to represent when a spindle was balanced. This procedure was found to be inadequate for the grinder's surface finish production requirement. The system's real-time capability resulted in the spindle manufacturer's redesign of his spindles and the acceptance of frequency versus g level vibration units as more precise parameters to represent when a spindle balanced condition was present. In the second case, a surface grinder was producing poor surface finishes due to excessive vibration chatter attributed to spindle ball bearing outer race defects.

The implementation of the Machine Tool Dynamic Measurements and Diagnostic System into maintenance practices enables technological advantages in the following manufacturing areas: ability to quickly determine and remedy existing machine tool mechanical problems, reference-baseline vibration signature (newly acquired machine tools and existing units), assistance in maintaining ordnance dimensional and surface finish requirements, improvement in reducing machine downtime, and input for short/long-term management purposes.

Keywords →

Er	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
AI	



UNCLASSIFIED

TABLE OF CONTENTS

	<u>Page</u>
INTRODUCTION	1
STATEMENT OF THE PROBLEM	1
OBJECT	1
PROCEDURE	2
Machine Tool Dynamic Measurements and Diagnostic System	2
Data Reduction and Analysis	4
DISCUSSION OF RESULTS	4
CONCLUSIONS	7
REFERENCES	9
APPENDIX	22

TABLES

I. VIBRATION FREQUENCIES AND THEIR LIKELY CAUSES	10
--	----

LIST OF ILLUSTRATIONS

1. Configuration of Machine Tool Dynamic Measurements and Diagnostic System.	12
2. Accelerometer and Bearing Locations - Spindle.	14
3. Ball Bearing Assembly.	15
4. Grinder - Internal Contour, Horizontal.	16
5. Grinder - Internal Contour, Vertical.	17
6. Grinder - Internal Contour, Axial.	18

TABLE OF CONTENTS (cont'd)

	<u>Page</u>
7. Grinder - External Surface, Vertical.	19
8. Proposed Pilot System Configuration of Machinery Condition Surveillance System (MCSS).	20
9. Proposed Full Scale Configuration of Machinery Condition Surveillance System (MCSS).	21

INTRODUCTION

When operating, all machines generate characteristic mechanical vibrations which inherently contain information that can provide an insight to operating dynamics and adequacy of design. The obscured information in time-varying signals can usually be uncovered through vibration spectrum analysis involving the study of dynamic signal amplitudes over a range of frequencies in which the machinery-induced vibrations take place. These major vibration components which are resident in a composite frequency spectrum, often can be traced to specific excitation sources by relating corresponding frequencies to typical design parameters of machine parts.

STATEMENT OF THE PROBLEM

External surface and internal contour grinders are examples of high production machine tools in use at the Watervliet Arsenal.

During metal removal processes, vibrations in machine tools frequently are the cause of poor workpiece surface finishes. This condition, if left unchecked, generates lost time and dollars, particularly in a high production environment. It is vital to bring about timely awareness and determination of the origin and causes that produce these vibrations.

OBJECT

A technique for measuring and establishing machine tool baseline vibration signatures was needed. An analysis of the vibration spectra would yield causal and location of defective machine tool components.

Subsequent analysis would indicate whether a machine tool required corrective action, i.e. whether the machine spindle should be balanced or the thrust bearing checked.

A diagnostic system was developed and designed for measuring the raw analog vibration signals emanating from machine tools during their use. The system is able to categorize and identify suspect components and suggest steps that should be taken to place a machine tool into optimum performance. These actions have been derived from vibration criteria and standards adopted by the American National Standards Institute (ANSI) and the Vibration Institute.

PROCEDURE

Machine Tool Dynamic Measurements and Diagnostic System

Design

The Machine Tool Dynamic Measurements and Diagnostic System consists of four separate subsystems: sensors (accelerometers), FM four-channel tape recorder, real-time dynamic signal analyzer, and computer hardware/software. The total system monitors, detects, measures, and analyzes vibration spectra. Figure 1 is representative of the total system concept.

Operational sequence

Initial "baseline" vibration measurements are obtained at the machine tool site under no-load, run-up, and run-down operating conditions. Accelerometers are mounted externally on the machine tool housing and are primarily oriented in the horizontal, vertical, and axial

directions. When a questionable vibration reading or placement position for an accelerometer is encountered, a radial location is selected. During operation of the machine tool, voltages are generated within the accelerometer by changes in forces acting upon the accelerometer's piezoelectric crystal. These signals are proportional to acceleration (force = mass times acceleration).

Signal measurement

Two methods were employed to obtain "raw" analog vibration signals.

Method 1: The spectral voltages are simultaneously recorded on three of the tape recorder's four channels. The remaining channel is used to narrate conditions occurring during the measurement sequence, i.e. accelerometer calibration voltages and machine tool operating speed. One at a time, each channel of taped analog data is entered into the analyzer which has been pre-programmed to accept the signals and perform digital conversion and analysis. Signal conditioning functions, i.e. low and high frequency band bypass filters, are also built into the analyzer, and amplitude accuracy/frequency resolution techniques organize the converted digital signals into appropriate form. Fast Fourier transform equations perform mathematical operations on the data and derive the equivalent analog waveforms. When requested, the processed data records can be displayed on the analyzer's CRT screen.

Method 2: During the course of the program, the procedure for acquiring and converting raw measurement data was improved by reducing the number of required steps. This was accomplished by direct signal input from the accelerometers to the digital signal analyzer.

Data Reduction and Analysis

Subsequent to using either Method 1 or 2, a special purpose software program "Alert," resident to the computer, retrieves the machine tool's latest processed spectral data from the analyzer's bubble memory and compares these data with prior spectral records stored on floppy disc. Numerical tables of vibration frequencies and amplitudes are issued and a current trended "signature" is derived. The updated data tables and "signature" are copied on the mini-disc to form a permanent archive.

All future measurements are compared with the initial baseline frequency signature and amplitude (i.e. g'level) thresholds to determine if significant changes have occurred. When values have exceeded the established boundary conditions, or new suspect frequencies have surfaced, management reports are generated specifying appropriate corrective action.

DISCUSSION OF RESULTS

The overall g'levels for computed frequencies were obtained from criteria specified in a published article (Reference 1). Rolling element defect equations and their calculations are included in Appendix A, and were used to determine the probable spindle ball bearing assembly vibration defect frequencies.

I. S. M. Norris, "Suggested Guidelines for Forced Vibration in Machine Tools for Use in Protective Maintenance and Analysis Applications," Vibration Analysis to Improve Reliability and Reduce Failure, ASME, New York, NY, 1985, pp. 77-82.

A discussion follows describing two applications for which the system was employed to resolve specific mechanical/surface finish problems.

In the first case, Internal Powder Chamber - 120-mm ordnance system, during rough and finish grinding operations, several grinders were producing an undesirable 64-microinch surface finish. Each grinder spindle (Figure 2) was instrumented with accelerometers and vibration testing was performed.

Analysis of the vibration spectra suggested that all of the spindles monitored, though previously balanced by the spindle manufacturer, were still out of balance. It was determined that the spindle Original Equipment Manufacturer (OEM) and other contractors commissioned to provide these services were utilizing mediocre balancing criteria, i.e. mils. This parameter was not accurate enough for the grinder to produce the surface finish accuracy requirements mandated for this machining operation.

A closer look at one machine tool's spindle vibration measurements also revealed the presence of additional mechanical faults. The defect calculations in Appendix A for ball bearing assemblies, Figure 3, suggest that two bearing assemblies on the same spindle register defects at 815 Hz and 805 Hz. These frequencies are associated with the outer race of bearing at spindle location No. 1, and inner race of bearing at spindle location No. 4, respectively.

Through further testing and analysis, and using a test model of (0.1 to 0.2 g') threshold levels, the spindle was balanced and the required

16-microinch surface finish was obtained. Analog waveform plots for these defect frequencies are shown in Figures 4 through 6. The capability afforded by the digital signal analyzer influenced the spindle manufacturer to redesign his spindles and employ real-time analysis criteria for future balancing of spindles. The remainder of the spindles were tested and balanced as the example stated.

In the second case, during the fabrication of repair parts and gauges (105-mm, 120-mm, 155-mm, and 8-inch ordnance systems) a surface grinder was producing an undesirable 32-microinch surface finish. The (with contact) defect equations in Appendix A and real-time digital signal analysis methodology again were employed. A computed frequency of 122.68 Hz suggested that due to excessive vibration chatter, component wear had occurred in the spindle's ball bearing outer race assembly. The analog waveform plot of this defect is shown in Figure 7. On this occasion, the magnitude of g'levels necessitated removal of the spindle from the grinder for examination and replacement of the ball bearing assembly. Following reassembly of the spindle in the grinder, rebalancing was performed and the required 16-microinch surface finish was attained.

For the applications described, it should be noted that the 0.1 to 0.2 g'level boundary conditions were experimentally determined and have been adopted as appropriate engineering units to represent spindle balance and bearing threshold limits.

CONCLUSIONS

The Machine Tool Dynamic Measurements and Diagnostic System has been demonstrated satisfactorily on internal contour and external surface grinders and incorporated into Maintenance Program Management at Watervliet Arsenal.

The application of this system results in the following benefits:

1. Machine tool diagnostics and timely parts acquisition.
2. Reduction of machine downtime.
3. Input for short/long-term planning (maintenance management purposes).
4. Baseline vibration signature - new machine tool purchases.
5. Improved ordnance dimensional and surface finish requirements.

An experienced user can effectively employ the system for diagnosing and pinpointing problems in both major and subassembly machine tool components. This capability greatly lessens the amount of machine tool disassembly and associated downtime (Table I).

The system is the forerunner of the pilot on-line MACHINERY CONDITION SURVEILLANCE SYSTEM (Figures 8 and 9), and will function as a backup for the plant-wide application.

The Machine Tool Dynamic Measurements and Diagnostic System provides a means for monitoring critical production machinery not included under the on-line plant-wide monitoring system.

It is recommended that vibration measurement and testing criteria be included as part of the acceptance requirements for new machine tool purchases. Also, it is suggested that testing be performed both prior

to shipment of a unit at the contractor's facility and periodically on-site during the warranty period. Vibration "signatures" exhibiting excessive g'levels during on-site field testing could be the basis for acceptance/rejection of newly acquired units.

REFERENCES

1. S. M. Norris, "Suggested Guidelines for Forced Vibration in Machine Tools for Use in Protective Maintenance and Analysis Applications," Vibration Analysis to Improve Reliability and Reduce Failure, ASME, New York, NY, 1985, pp. 77-82.

TABLE I


VIBRATION FREQUENCIES AND THEIR LIKELY CAUSES

<u>Frequency in Terms of RPM</u>	<u>Most Likely Causes</u>	<u>Other Possible Causes and Remarks</u>
1/2 x Running RPM	Oil whirl (whip)	1. Bad drive belts 2. Background vibration 3. Subharmonic resonance 4. "Beat" vibration
1-2 x Running RPM	Unbalance	1. Eccentric journals, gears or pulleys 2. Misalignment or bent shaft - if high axial vibration 3. Bad belts if RPM of belt 4. Resonance 5. Reciprocating forces 6. Electrical problems 7. Rubbing shaft
2 x Running RPM	Mechanical looseness	1. Misalignment in high axial vibration 2. Reciprocating forces 3. Resonance 4. Bad belts if 2 x RPM of belt 5. Looseness
2-3 x Running RPM	Misalignment	Usually a combination of misalignment and excessive axial clearances (looseness)
4-8 x Running RPM	Defective roller bearing	
20-50 x Running RPM	Anti-friction bearing	Non-harmonically related

TABLE I
VIBRATION FREQUENCIES AND THEIR LIKELY CAUSES

(cont'd)

<u>Frequency in Terms of RPM</u>	<u>Most Likely Causes</u>	<u>Other Possible Causes and Remarks</u>
No. of Vanes x Running RPM	Impeller vanes	Harmonically related
No. of Teeth x Running RPM	Gear Noise	Harmonically related
No. of Blades x Running RPM	Blade rub (N blade)	Harmonically related
Random RPM	Pump cavitation	
Unsteady	Poor foundation	
Vibration soars at one particular speed	Resonance	

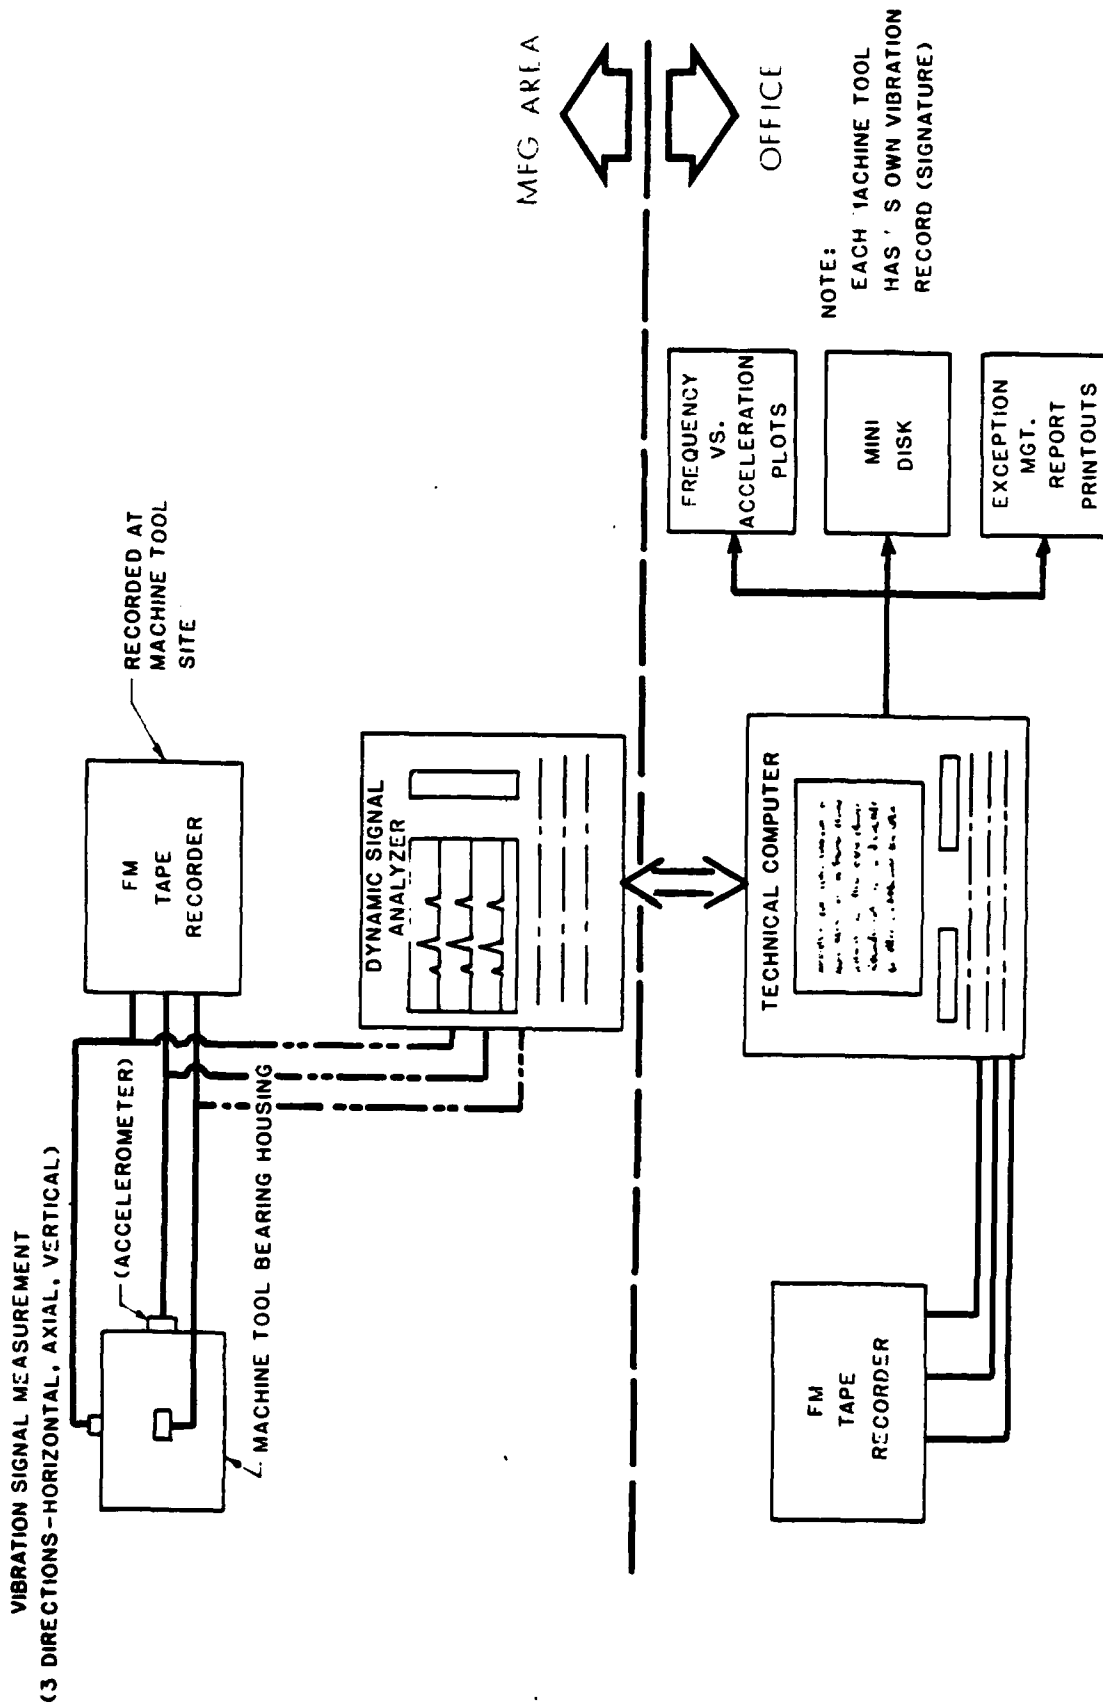

CONFIGURATION
FIGURE 1

MACHINE TOOL DYNAMIC MEASUREMENTS AND DIAGNOSTIC SYSTEM

Nomenclature - MACHINE TOOL DYNAMIC MEASUREMENTS AND DIAGNOSTIC SYSTEM

Hewlett Packard Company

Real-time Analyzer - Model 3561A - Single Channel - Range 125 μ Hz - 100 KHz

Desktop Computer - Model 9836C - 1.2 MEGA Bytes

Dual Disc Drives - 3-1/2" - Model 9122D

Dual Disc Drives - 5-1/4" - Model 9134A

Plotter - 2 Pen - Model 7470

Printer - Model 225A

Software - Basic 2.0 and 4.0 Operating Systems

Tape Recorder - FM-4 Channel - Brue1 & Kjaer - Model 7006

Accelerometers - ICP Quartz - PCB Co.

Range 2 HZ - 10,000 Hz

" 0.025 Hz - 800 Hz (Seismic)


" 5 Hz - 10,000 Hz

Vibration Envelope Detector - Shaker Research/MTI - Model 223A

Software "Alert" Predictive Maintenance Monitoring System -
Structural Measurement Systems


Figure 1A

(ACCELEROMETER) AND BEARING LOCATIONS SPINDLE

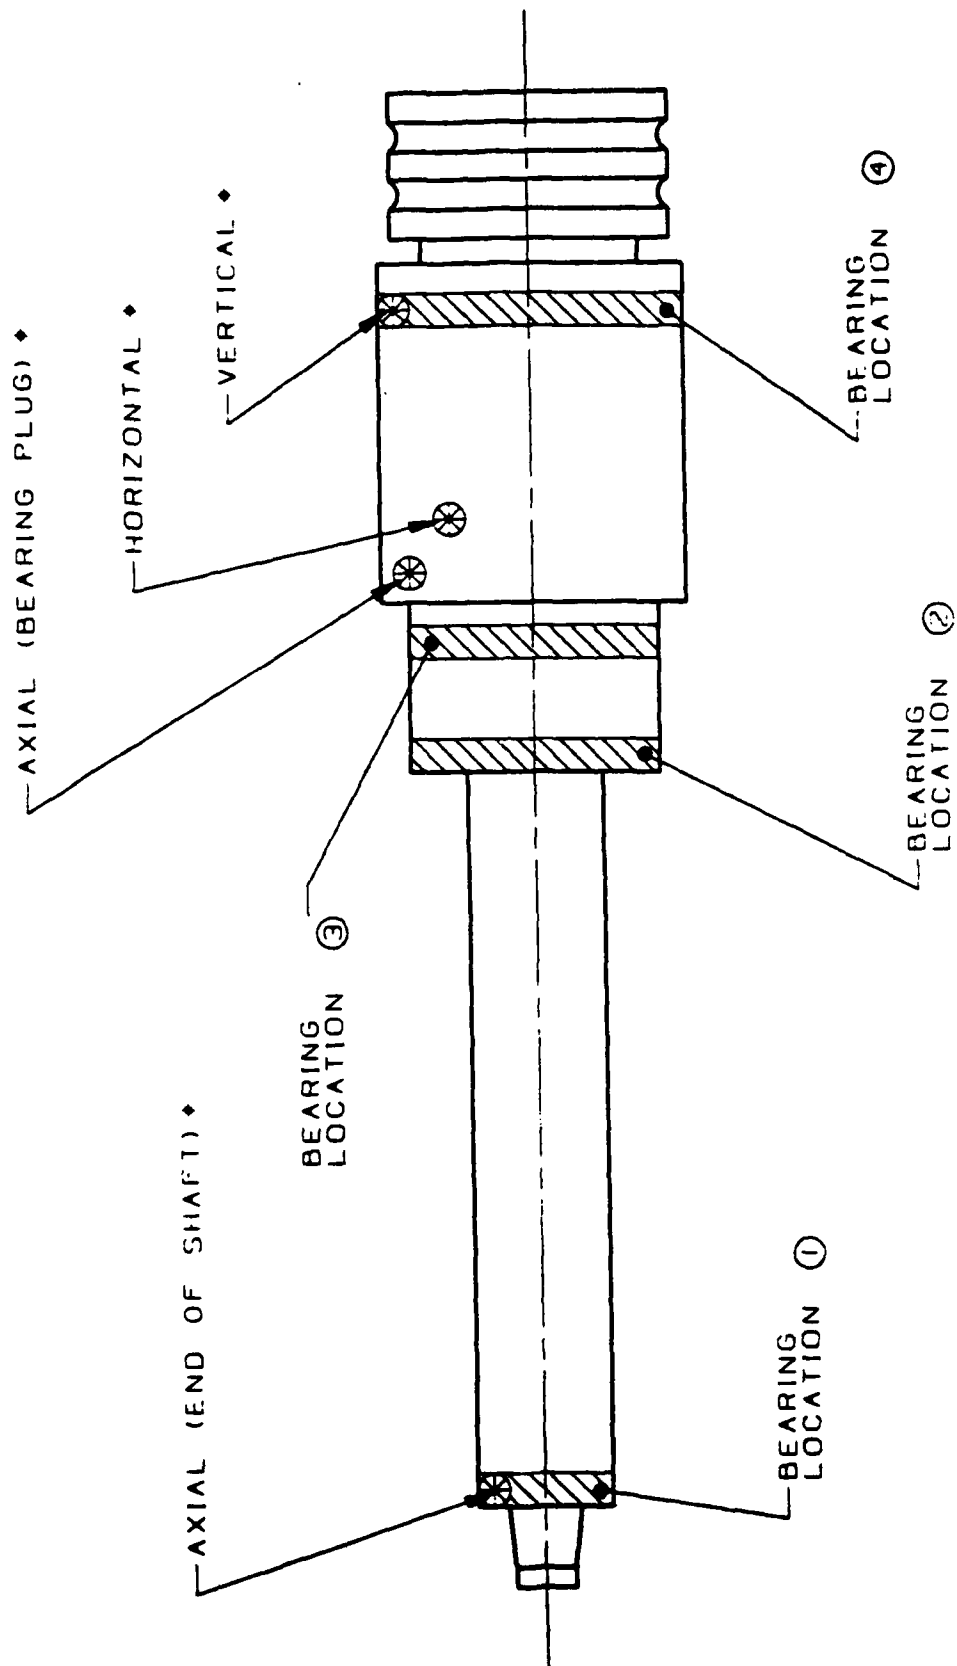

♦ ACCELEROMETER

FIGURE 2

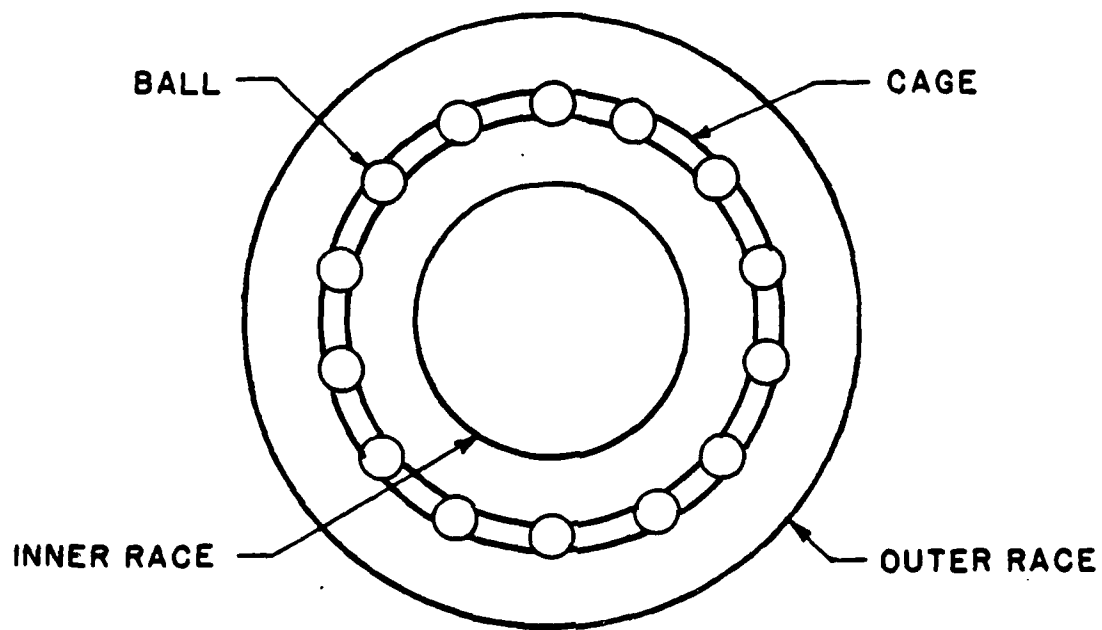

BALL BEARING ASSEMBLY

FIGURE 3

GRINDER — INTERNAL CONTOUR
ACCELEROMETER LOCATION—HORIZONTAL (Analog Vibration Spectra)

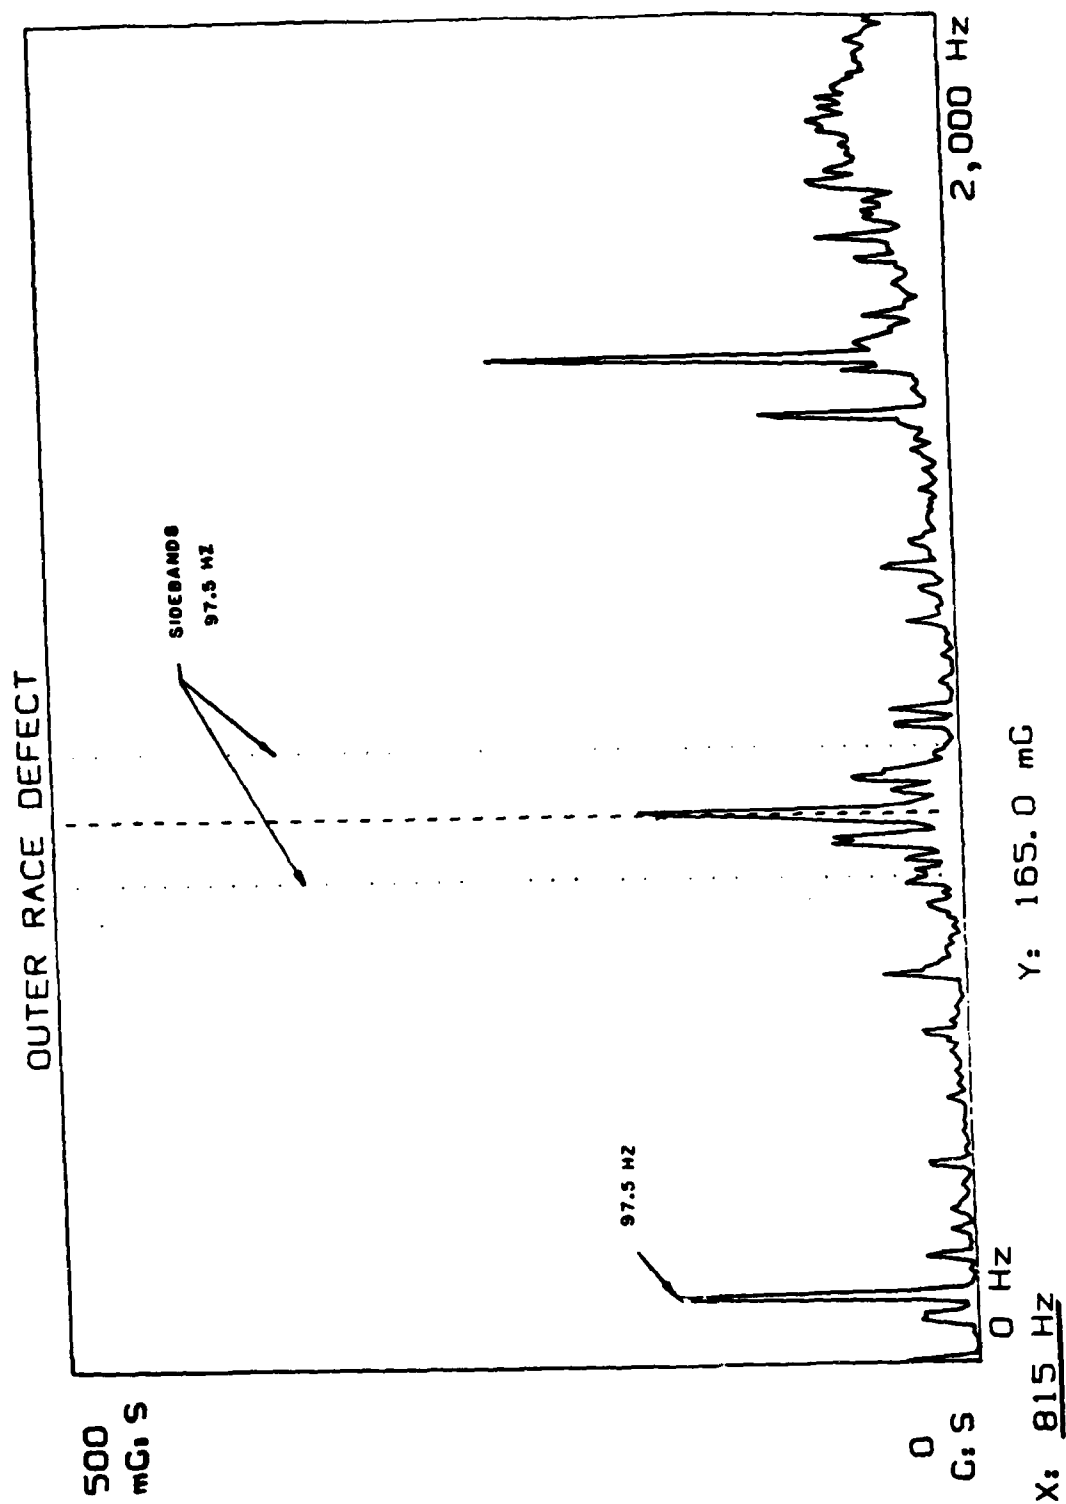


FIGURE 4

GRINDER—INTERNAL CONTOUR
ACCELEROMETER LOCATION—VERTICAL (Analog Vibration Spectra)

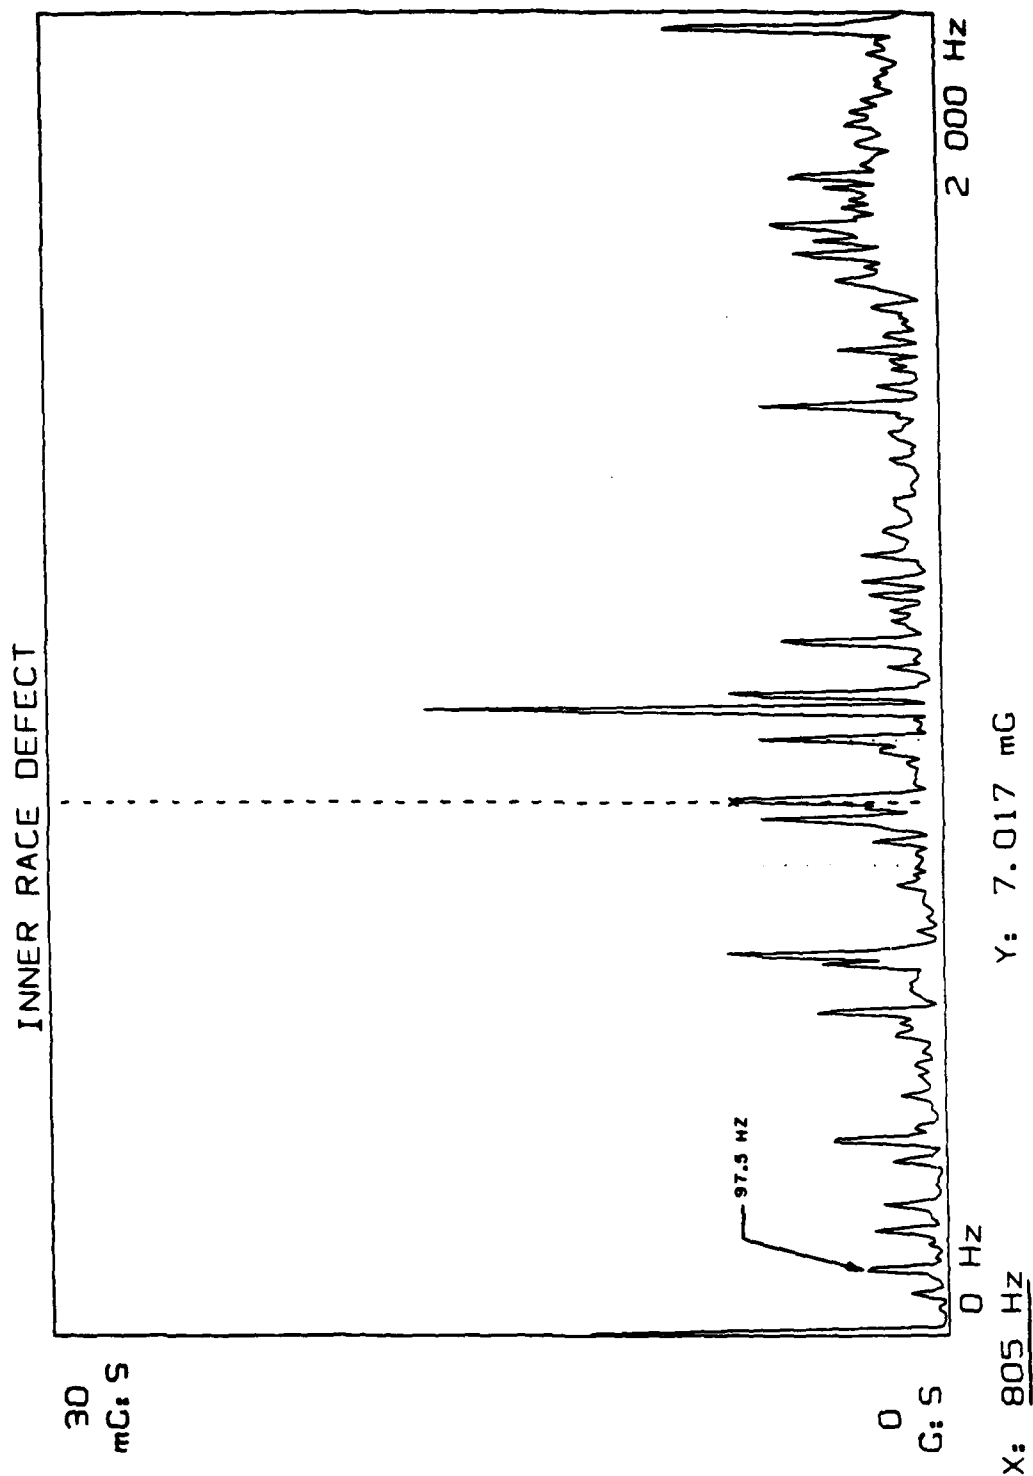


FIGURE 5

GRINDER — INTERNAL CONTOUR

ACCELEROMETER LOCATION — AXIAL (Analog Vibration Spectra)

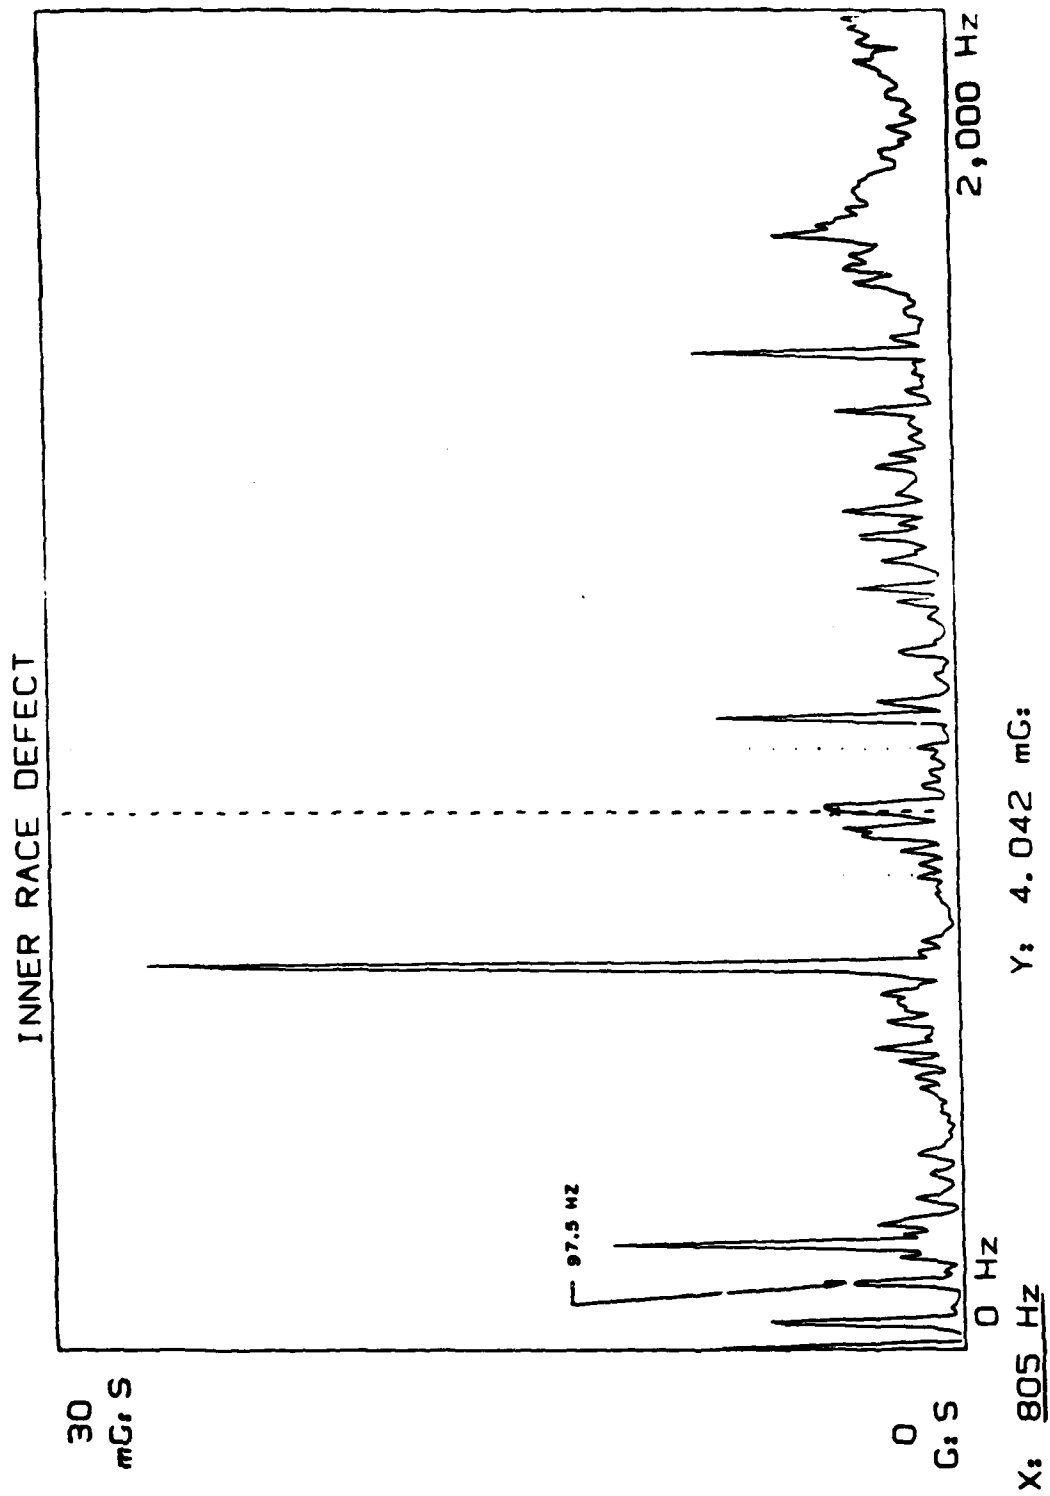


FIGURE 6

**EXTERNAL SURFACE GRINDER
ACCELEROMETER LOCATION-VERTICAL (Analog Vibration Spectra)**

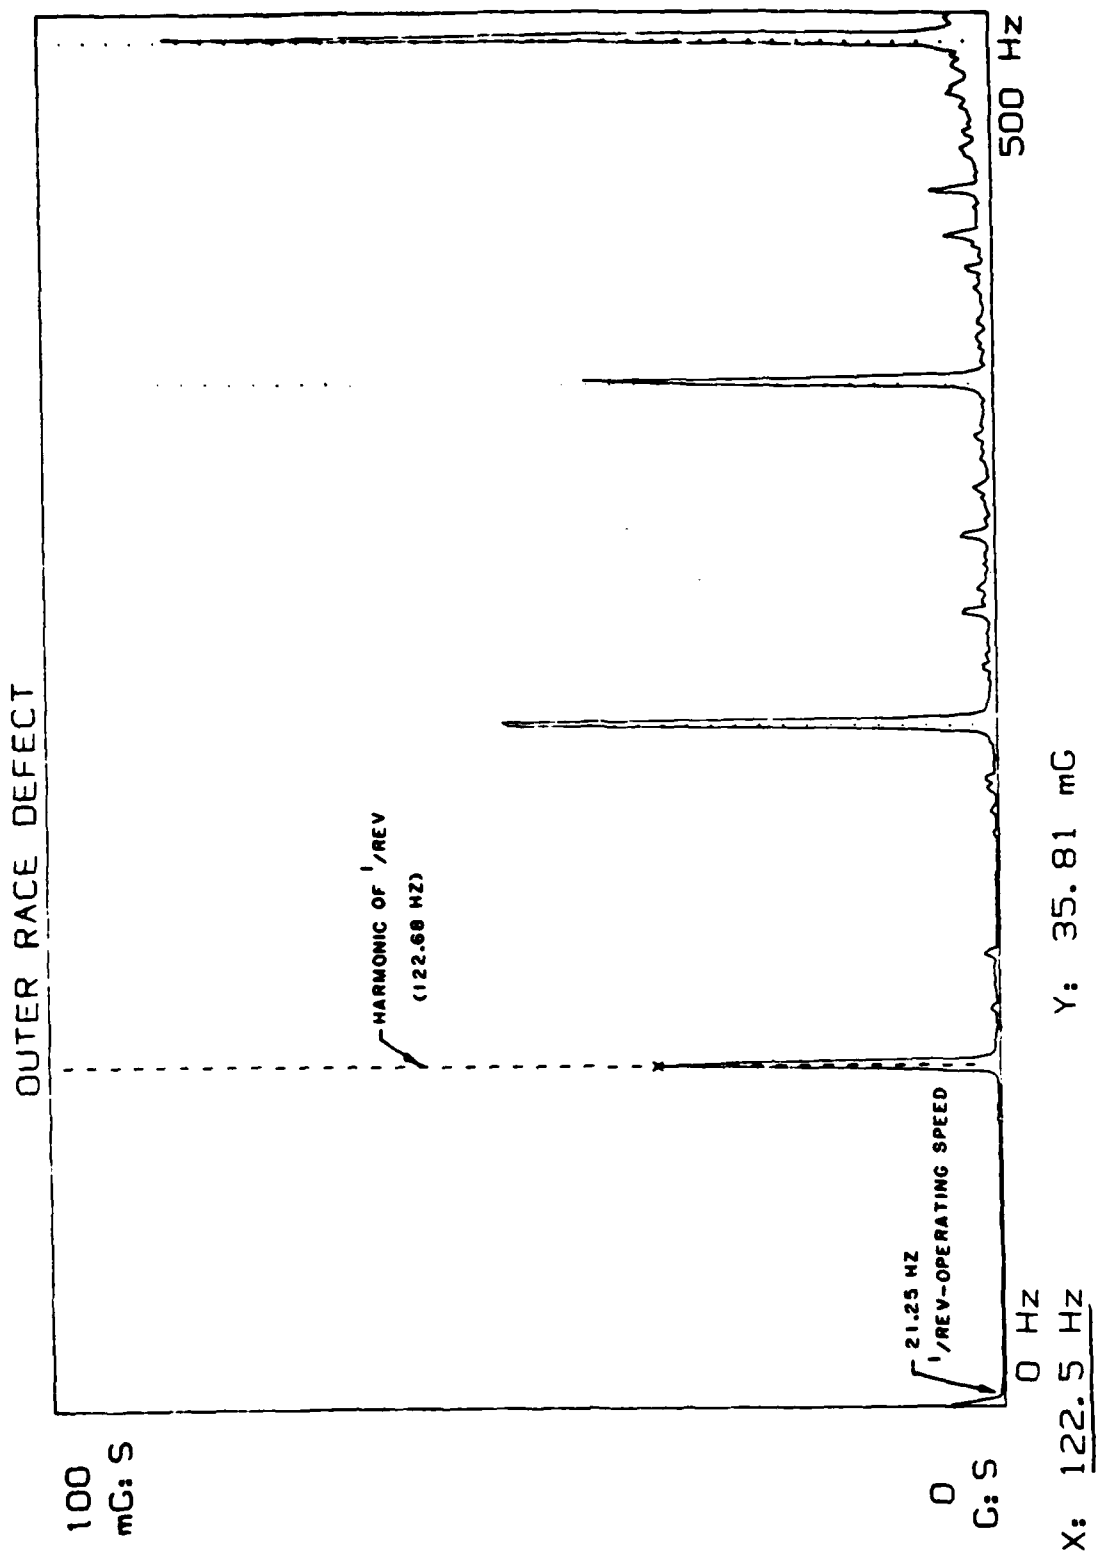


FIGURE 7

MACHINERY CONDITION SURVEILLANCE SYSTEM (MCSS) PROPOSED PILOT SYSTEM CONFIGURATION DNC/MCSS LINK


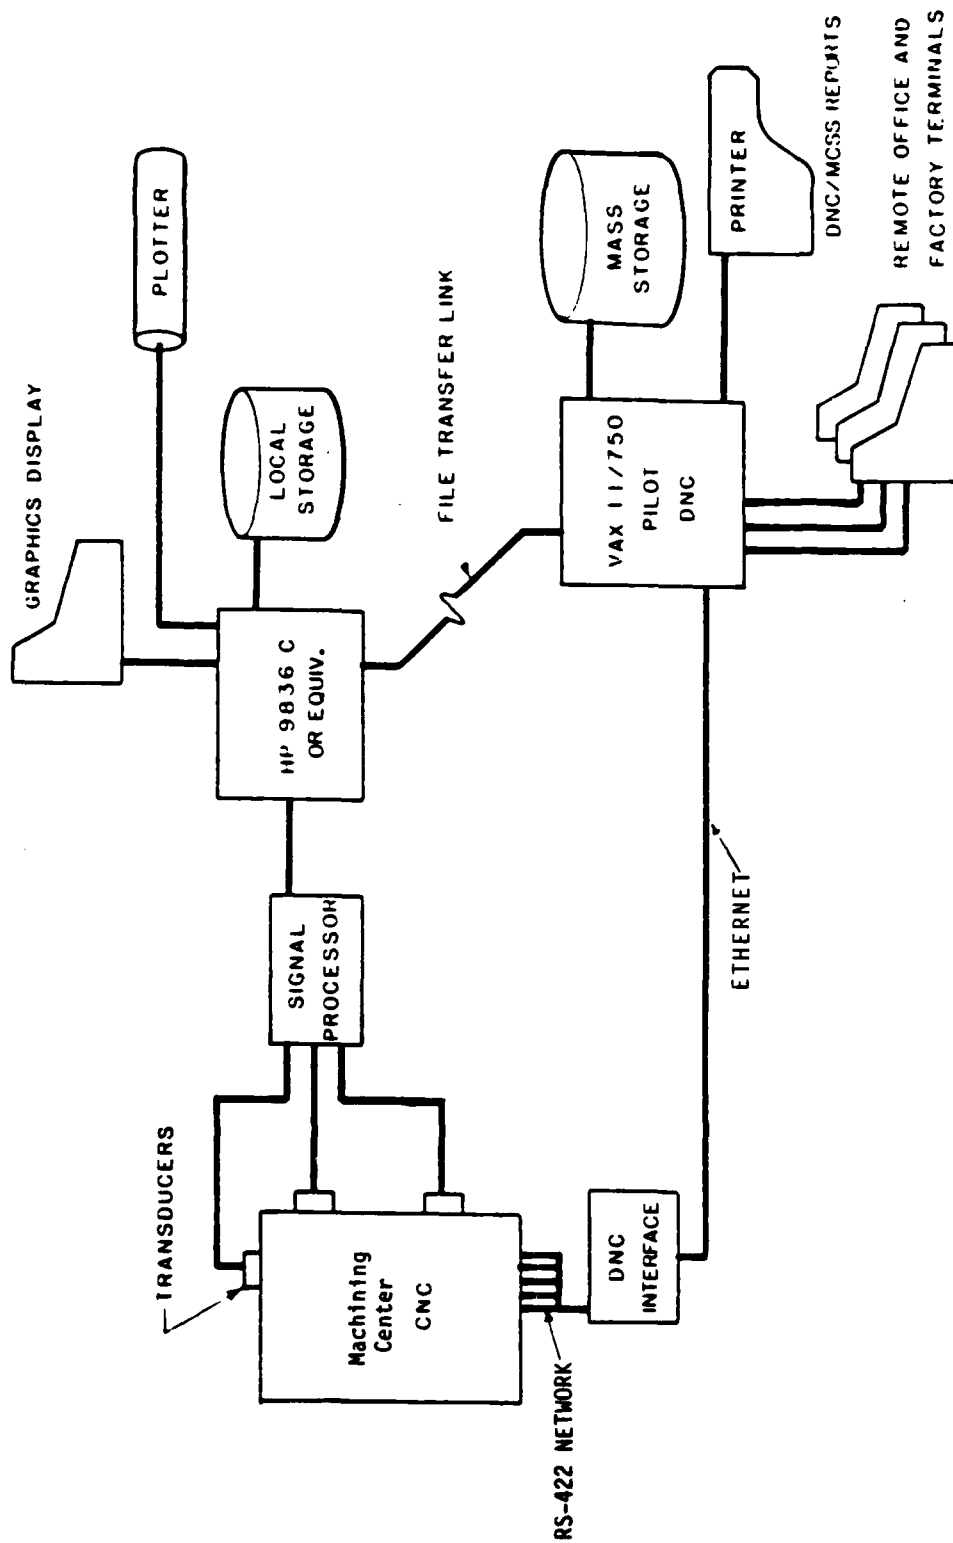


FIGURE 8

MACHINERY CONDITION SURVEILLANCE SYSTEM (MCSS) PROPOSED FULL SCALE SYSTEM CONFIGURATION DNC/MCSS INTEGRATION*

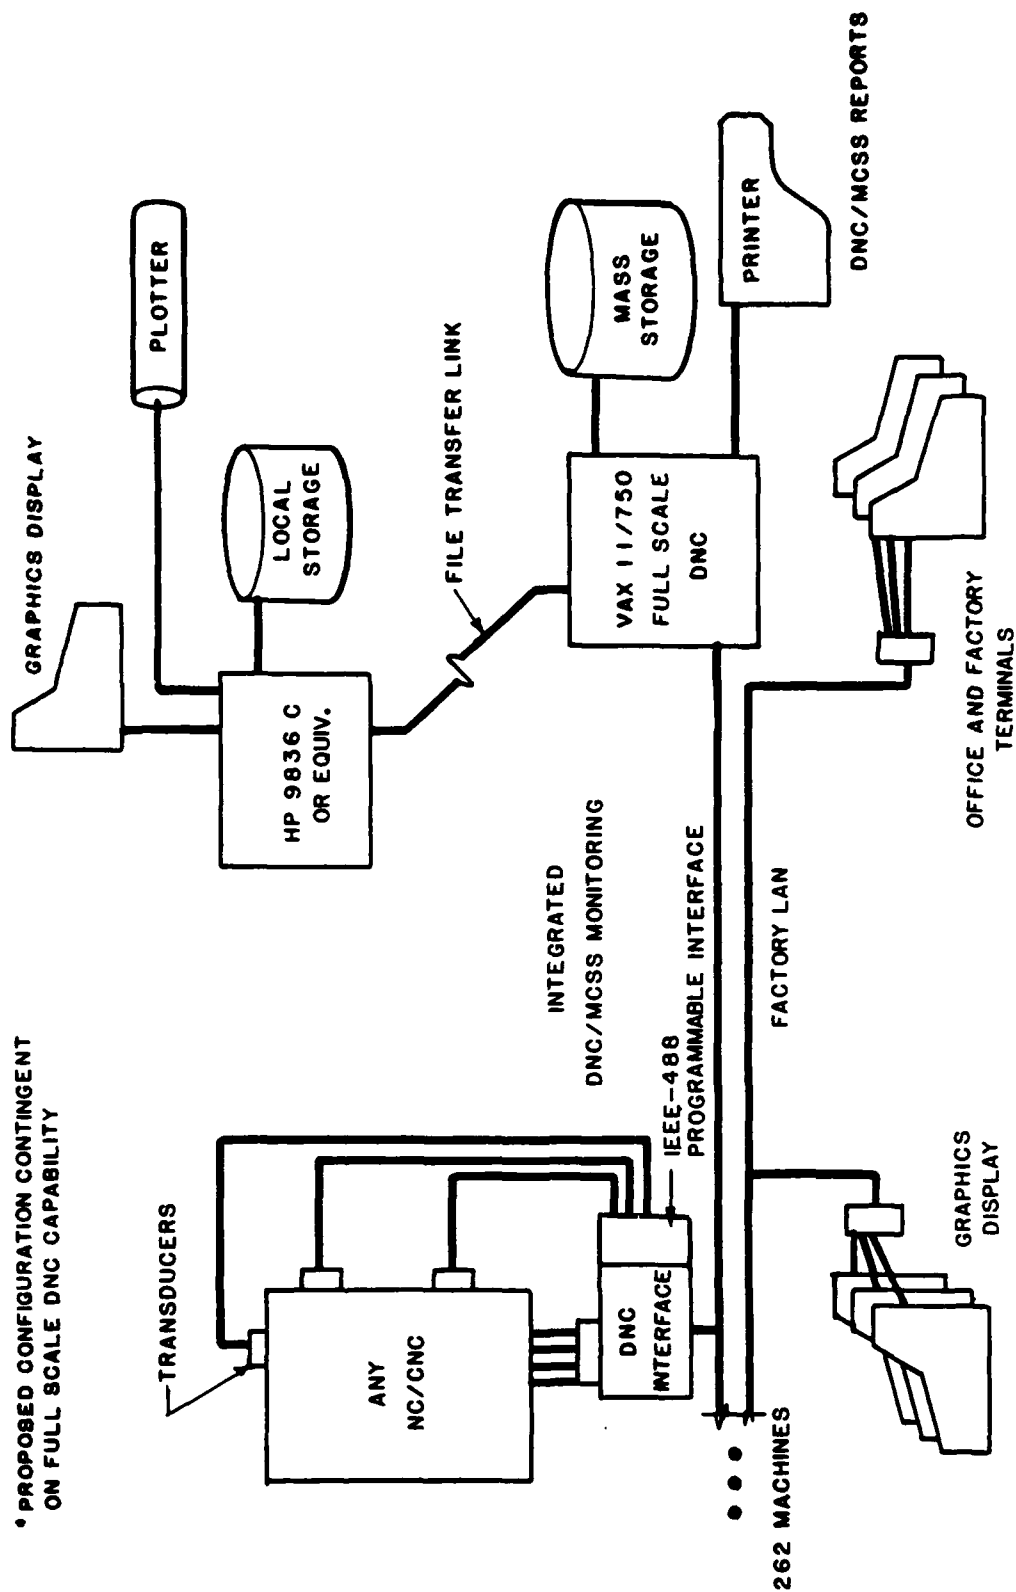

* PROPOSED CONFIGURATION CONTINGENT
ON FULL SCALE DNC CAPABILITY

FIGURE 9

ROLLING ELEMENT BEARINGS

N = Number of Balls
 BD = Diameter of Ball
 PD = Diameter of Ball Pitch
 f_o = Frequency Defect at Outer Race
 f_s = Frequency Defect (Spin of Ball)

d_1 = Diameter of Inner Race
 d_2 = Diameter of Outer Race
 f_r = Frequency (Hz) = RPM/60
 f_i = Frequency Defect - Inner Race
 α = Ball Angle of Contact with Inner Race

WITH CONTACT

$$f_o = \frac{N}{2} f_r \left(1 - \frac{BD}{PD} \cos \alpha \right)$$

$$f_i = \frac{N}{2} f_r \left(1 + \frac{BD}{PD} \cos \alpha \right)$$

$$f_s = 1/2 f_r \left(\frac{PD}{BD} \right) \left[1 - \left(\frac{BD}{PD} \right)^2 \cos^2 \alpha \right]$$

WITHOUT CONTACT

$$f_o = N f_r \left(\frac{d_1}{d_1 + d_2} \right)$$

$$f_i = N f_r \left(\frac{d_2}{d_1 + d_2} \right)$$

$$f_s = \left(\frac{d_2}{BD} \right) \left(\frac{d_2}{d_1 + d_2} \right)$$

CAGE FAULT

N_1 = No. of Revs/Cage Rev.

$$f_o = N f_r \left(\frac{1}{N_1} \right)$$

$$f_i = N f_r \left(1 - \frac{1}{N_1} \right)$$

$$f_s = \frac{f_r}{N_1} \left(\frac{d_2}{BD} \right)$$

$$f_s = 1/2 \left(\frac{RPM}{60} \right) \left(1 - \frac{BD}{PD} \cos \alpha \right)$$

APPENDIX A (Continued)
(INTERNAL CONTOUR GRINDER)
ROLLING ELEMENT BEARING
DEFECT CALCULATIONS

OUTER-RACE DEFECT (f_o)

BEARING LOCATION

$$\begin{aligned}
 f_o &= \left(\frac{N}{2}\right) (f_r) \left(1 - \frac{BD}{PD} \cos \alpha\right) \\
 &= \left(\frac{19}{2}\right) (97.5) \left(1 - \frac{.4680}{3.5433} \cos 15^\circ\right) = 808 \text{ Hz} & 3 \\
 &= \left(\frac{19}{2}\right) (97.5) \left(1 - \frac{.2188}{1.726} \cos 15^\circ\right) = \underline{816 \text{ Hz}} & \underline{1*} \\
 &= \left(\frac{14}{2}\right) (97.5) \left(1 - \frac{.6250}{3.34645} \cos 15^\circ\right) = 560 \text{ Hz} & 4 \\
 &= \left(\frac{14}{2}\right) (97.5) \left(1 - \frac{.2812}{1.67325} \cos 15^\circ\right) = 572 \text{ Hz} & 2
 \end{aligned}$$

INNER-RACE DEFECT (f_i)

$$\begin{aligned}
 f_i &= \left(\frac{N}{2}\right) (f_r) \left(1 + \frac{BD}{PD} \cos \alpha\right) \\
 &= \left(\frac{19}{2}\right) (97.5) \left(1 + \frac{.4680}{3.5433} \cos 15^\circ\right) = 1044 \text{ Hz} & 3 \\
 &= \left(\frac{19}{2}\right) (97.5) \left(1 + \frac{.2188}{1.776} \cos 15^\circ\right) = 1036 \text{ Hz} & 1 \\
 &= \left(\frac{14}{2}\right) (97.5) \left(1 + \frac{.6250}{3.34645} \cos 15^\circ\right) = \underline{805 \text{ Hz}} & \underline{4*} \\
 &= \left(\frac{14}{2}\right) (97.5) \left(1 + \frac{.2812}{1.67325} \cos 15^\circ\right) = 793 \text{ Hz} & 3
 \end{aligned}$$

* SEE FIGURES 4, 5, and 6

APPENDIX A (Continued)
(INTERNAL CONTOUR GRINDER)
ROLLING ELEMENT BEARING
DEFECT CALCULATIONS

BALL - SPIN DEFECT (f_s)

BEARING
LOCATION

$$f_s = \frac{1}{2} (f_r) \left(\frac{PD}{BD} \right) \left[1 - \left(\frac{BD}{PD} \right)^2 \cos^2 \alpha \right]$$

$= \frac{1}{2} (97.5) \left(\frac{3.5433}{.4680} \right) \left[1 - \left(\frac{.4680}{3.5433} \right)^2 (\cos 15^\circ)^2 \right] = 363 \text{ Hz}$	3
$= \frac{1}{2} (97.5) \left(\frac{1.7760}{.2188} \right) \left[1 - \left(\frac{.2188}{1.776} \right)^2 (\cos 15^\circ)^2 \right] = 390 \text{ Hz}$	1
$= \frac{1}{2} (97.5) \left(\frac{3.34645}{.6250} \right) \left[1 - \left(\frac{.6250}{3.34645} \right)^2 (\cos 15^\circ)^2 \right] = 253 \text{ Hz}$	4
$= \frac{1}{2} (97.5) \left(\frac{1.67325}{.2812} \right) \left[1 - \left(\frac{.2812}{1.67325} \right)^2 (\cos 15^\circ)^2 \right] = 282 \text{ Hz}$	2

CAGE SPEED - FUNDAMENTAL TRAIN DEFECT (f_t)

$$f_t = \frac{1}{2} \left(\frac{RPM}{60} \right) \left(1 - \frac{BD}{PD} \cos \alpha \right)$$

$= \frac{1}{2} \left(\frac{5850}{60} \right) \left(1 - \frac{.4680}{3.5433} \cos 15^\circ \right) = 43 \text{ Hz}$	3
$= \frac{1}{2} \left(\frac{5850}{60} \right) \left(1 - \frac{.2188}{1.776} \cos 15^\circ \right) = 43 \text{ Hz}$	1
$= \frac{1}{2} \left(\frac{5850}{60} \right) \left(1 - \frac{.6250}{3.34645} \cos 15^\circ \right) = 40 \text{ Hz}$	4
$= \frac{1}{2} \left(\frac{5850}{60} \right) \left(1 - \frac{.2812}{1.67325} \cos 15^\circ \right) = 41 \text{ Hz}$	2

APPENDIX A (Continued)
EXTERNAL SURFACE
GRINDER BEARING SPECIFICATIONS

I.D. - 3.937 Inches
O.D. - 7.0866 Inches
Number of Balls - 14
Ball Diameter - 1.00 Inch
Pitch Diameter - $\frac{I.D. + O.D.}{2}$ - 5.5118 Inches
Contact Angle - 15°

Grinder Operating Speed - 1/Rev. - 21.25Hz (1275 RPM)

CALCULATED DEFECT FREQUENCIES

Outer Race Defect - 122.68 Hz *

Inner Race Defect - 174.8 Hz

Ball Spin Defect - 56.8 Hz

Cage Defect - 8.8 Hz

* See Figure 7

APPENDIX A (Continued)

EXTERNAL SURFACE GRINDER ROLLING ELEMENT BEARING DEFECT CALCULATIONS

OUTER RACE DEFECT (f_o)

$$f_o = \left(\frac{N}{2}\right) (f_r) \left(1 - \frac{BD}{PD} \cos \alpha\right)$$

$$= \left(\frac{14}{2}\right) (21.25) \left(1 - \frac{1.00}{5.5118} \cos 15^\circ\right) = \underline{122.68 \text{ Hz}^*}$$

INNER RACE DEFECT (f_i)

$$f_i = \left(\frac{N}{2}\right) (f_r) \left(1 + \frac{BD}{PD} \cos \alpha\right)$$

$$= \left(\frac{14}{2}\right) (21.25) \left(1 + \frac{1.00}{5.5118} \cos 15^\circ\right) = 174.8 \text{ Hz}$$

BALL - SPIN DEFECT (f_s)

$$f_s = \frac{1}{2} (f_i) \left(\frac{PD}{BD}\right) \left[1 - \left(\frac{BD}{PD}\right)^2 \cos^2 \alpha\right]$$

$$= \frac{1}{2} (21.25) \left(\frac{5.5118}{1.00}\right) \left[1 - \left(\frac{1.00}{5.5118}\right)^2 (\cos 15^\circ)^2\right] = 56.76 \text{ Hz}$$

CAGE SPEED - FUNDAMENTAL TRAIN (F_t)

$$F_t = \frac{1}{2} \left(\frac{RPM}{60}\right) \left(1 - \frac{BD}{PD} \cos \alpha\right)$$

$$= \frac{1}{2} \left(\frac{1275}{60}\right) \left(1 - \frac{1.00}{5.5118} \cos 15^\circ\right) = 8.76 \text{ Hz}$$

* SEE FIGURE 7

TECHNICAL REPORT INTERNAL DISTRIBUTION LIST

	NO. OF COPIES
CHIEF, DEVELOPMENT ENGINEERING DIVISION	
ATTN: SMCAR-CCB-D	1
-DA	1
-DC	1
-DM	1
-DP	1
-DR	1
-DS (SYSTEMS)	1
CHIEF, ENGINEERING SUPPORT DIVISION	
ATTN: SMCAR-CCB-S	1
-SE	1
CHIEF, RESEARCH DIVISION	
ATTN: SMCAR-CCB-R	2
-RA	1
-RM	1
-RP	1
-RT	1
TECHNICAL LIBRARY	5
ATTN: SMCAR-CCB-TL	
TECHNICAL PUBLICATIONS & EDITING SECTION	3
ATTN: SMCAR-CCB-TL	
DIRECTOR, OPERATIONS DIRECTORATE	1
ATTN: SMCWV-OD	
DIRECTOR, PROCUREMENT DIRECTORATE	1
ATTN: SMCWV-PP	
DIRECTOR, PRODUCT ASSURANCE DIRECTORATE	1
ATTN: SMCWV-QA	

NOTE: PLEASE NOTIFY DIRECTOR, BENET LABORATORIES, ATTN: SMCAR-CCB-TL, OF ANY ADDRESS CHANGES.

TECHNICAL REPORT EXTERNAL DISTRIBUTION LIST

	<u>NO. OF COPIES</u>		<u>NO. OF COPIES</u>
ASST SEC OF THE ARMY RESEARCH AND DEVELOPMENT ATTN: DEPT FOR SCI AND TECH THE PENTAGON WASHINGTON, D.C. 20310-0103	1	COMMANDER ROCK ISLAND ARSENAL ATTN: SMCRI-ENM ROCK ISLAND, IL 61299-5000	1
ADMINISTRATOR DEFENSE TECHNICAL INFO CENTER ATTN: DTIC-FDAC CAMERON STATION ALEXANDRIA, VA 22304-6145	12	DIRECTOR US ARMY INDUSTRIAL BASE ENGR ACTV ATTN: AMXIB-P ROCK ISLAND, IL 61299-7260	1
COMMANDER US ARMY ARDEC ATTN: SMCAR-AEE	1	COMMANDER US ARMY TANK-AUTMV R&D COMMAND ATTN: AMSTA-DDL (TECH LIB) WARREN, MI 48397-5000	1
SMCAR-AES, BLDG. 321	1	COMMANDER US MILITARY ACADEMY ATTN: DEPARTMENT OF MECHANICS WEST POINT, NY 10996-1792	1
SMCAR-AET-O, BLDG. 351N	1		
SMCAR-CC	1		
SMCAR-CCP-A	1		
SMCAR-FSA	1		
SMCAR-FSM-E	1	US ARMY MISSILE COMMAND REDSTONE SCIENTIFIC INFO CTR ATTN: DOCUMENTS SECT, BLDG. 4484 REDSTONE ARSENAL, AL 35898-5241	2
SMCAR-FSS-D, BLDG. 94	1		
SMCAR-IMI-I (STINFO) BLDG. 59	2		
PICATINNY ARSENAL, NJ 07806-5000			
DIRECTOR US ARMY BALLISTIC RESEARCH LABORATORY ATTN: SLCBR-DD-T, BLDG. 305 ABERDEEN PROVING GROUND, MD 21005-5066	1	COMMANDER US ARMY FGN SCIENCE AND TECH CTR ATTN: DRXST-SD 220 7TH STREET, N.E. CHARLOTTESVILLE, VA 22901	1
DIRECTOR US ARMY MATERIEL SYSTEMS ANALYSIS ACTV ATTN: AMXSY-MP ABERDEEN PROVING GROUND, MD 21005-5071	1	COMMANDER US ARMY LABCO: MATERIALS TECHNOLOGY LAB ATTN: SLCMT-IML (TECH LIB) WATERTOWN, MA 02172-0001	2
COMMANDER HQ, AMCCOM ATTN: AMSMC-IMP-L ROCK ISLAND, IL 61299-6000	1		

NOTE: PLEASE NOTIFY COMMANDER, ARMAMENT RESEARCH, DEVELOPMENT, AND ENGINEERING CENTER, US ARMY AMCCOM, ATTN: BENET LABORATORIES, SMCAR-CCB-TL, WATERVLIET, NY 12189-4050, OF ANY ADDRESS CHANGES.

TECHNICAL REPORT EXTERNAL DISTRIBUTION LIST (CONT'D)

	<u>NO. OF COPIES</u>		<u>NO. OF COPIES</u>
COMMANDER US ARMY LABCOM, ISA ATTN: SLCIS-IM-TL 2800 POWDER MILL ROAD ADELPHI, MD 20783-1145	1	COMMANDER AIR FORCE ARMAMENT LABORATORY ATTN: AFATL/MN EGLIN AFB, FL 32542-5434	1
COMMANDER US ARMY RESEARCH OFFICE ATTN: CHIEF, IPO P.O. BOX 12211 RESEARCH TRIANGLE PARK, NC 27709-2211	1	COMMANDER AIR FORCE ARMAMENT LABORATORY ATTN: AFATL/MNF EGLIN AFB, FL 32542-5434	1
DIRECTOR US NAVAL RESEARCH LAB ATTN: MATERIALS SCI & TECH DIVISION CODE 26-27 (DOC LIB) WASHINGTON, D.C. 20375	1 1	METALS AND CERAMICS INFO CTR BATTELLE COLUMBUS DIVISION 505 KING AVENUE COLUMBUS, OH 43201-2693	1

NOTE: PLEASE NOTIFY COMMANDER, ARMAMENT RESEARCH, DEVELOPMENT, AND ENGINEERING CENTER, US ARMY AMCCOM, ATTN: BENET LABORATORIES, SMCAR-CCB-TL, WATERVLIET, NY 12189-4050, OF ANY ADDRESS CHANGES.