

AD-A284 300



USAARL Report No. 94-32



Apache Helicopter Seat Cushion Evaluation

94-29840




cdg

By

Barclay P. Butler

and

Nabih M. Alem

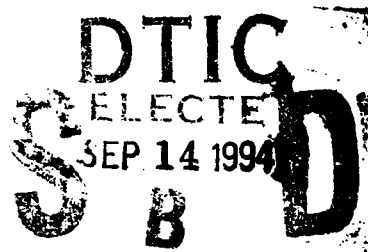

Aircrew Protection Division

July 1994

DTIC QUALITY INSPECTED 3

Approved for public release; distribution unlimited.

94

30

United States Army Aeromedical Research Laboratory
Fort Rucker, Alabama 36362-0577

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.


Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Human use


Human subjects participated in these studies after giving their free and informed voluntary consent. Investigators adhered to AR 70-25 and USAMRDC Reg 70-25 on Use of Volunteers in Research.

Reviewed:




KEVIN T. MASON
LTC, MC, MFS
Director, Aircrew Protection
Division

Released for publication:

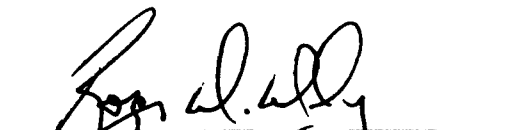

ROGER W. WILEY, O.D., Ph.D.
Chairman, Scientific
Review Committee

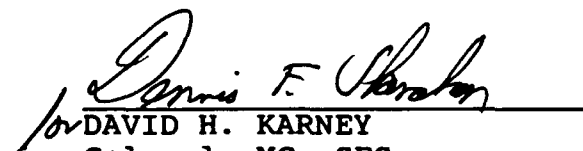

for DAVID H. KARNEY
Colonel, MC, SFS
Commanding

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

1a. REPORT SECURITY CLASSIFICATION Unclassified			1b. RESTRICTIVE MARKINGS		
2a. SECURITY CLASSIFICATION AUTHORITY			3. DISTRIBUTION / AVAILABILITY OF REPORT Approved for public release, distribution unlimited		
2b. DECLASSIFICATION / DOWNGRADING SCHEDULE			5. MONITORING ORGANIZATION REPORT NUMBER(S)		
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 94-32			7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research, Development, Acquisition, and Logistics Command		
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory		6b. OFFICE SYMBOL (If applicable) SGRD-UAD-IV	7b. ADDRESS (City, State, and ZIP Code) Fort Detrick Frederick, MD 21702-5012		
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577			9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER		
8a. NAME OF FUNDING / SPONSORING ORGANIZATION Aviation Applied Technical Directorate (AATD)		8b. OFFICE SYMBOL (If applicable)	10. SOURCE OF FUNDING NUMBERS		
8c. ADDRESS (City, State, and ZIP Code) Fort Eustis, VA			PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.
11. TITLE (Include Security Classification) Apache Helicopter Seat Cushion Evaluation					
12. PERSONAL AUTHOR(S) Barclay P. Butler and Nabih M. Alem					
13a. TYPE OF REPORT Final		13b. TIME COVERED FROM _____ TO _____		14. DATE OF REPORT (Year, Month, Day) 1994 July	
15. PAGE COUNT 49					
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES			18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP	Seat cushion, Apache, helicopter pilots, crew comfort		
05	09				
01	03				
19. ABSTRACT (Continue on reverse if necessary and identify by block number)					
Two prototypes of the AH-64 pilot seat cushions were evaluated against the standard cushion set by each of a group of 12 AH-64 instructor pilots after being exposed to simulated AH-64 vibration signatures for a period of 1 hour. Objective indications of vibration attenuation were obtained by measuring transfer functions across each cushion. Subjective pilot preferences also were obtained after each ride using a questionnaire. Results of the objective measurements indicate both the air-filled and the foam-filled prototypes reduced low-frequency transmission of vibration better than the standard cushions. Subjective responses indicate significant improvement in comfort and vibration absorption for the seat back and bottom cushions of both prototypes over the standard cushion set. DTIC QUALITY ASSURED 3					
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT ☒ UNCLASSIFIED/UNLIMITED ☐ SAME AS RPT. ☐ DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION		
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Science Support Center			22b. TELEPHONE (Include Area Code) 205-255-6907		22c. OFFICE SYMBOL SGRD-IIX-ST

acknowledgments

The authors would like to express their gratitude to Deborah M. Blanchard, Total Quality Management Office, Fort Rucker, for her assistance in the data analysis and review of the statistical results. Mrs. Mary Gramling and Mr. Udo Volker Nowak are commended for their efforts in editing this report.

Accession For	
NTIS GRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distributed/	
Availability Codes	
Dist	Avail and/or Special
A-1	

=====

This page intentionally left blank.

=====

Table of contents

	Page
List of figures	2
List of tables	2
Introduction	3
Methods	3
Analysis	5
Results	5
Discussion	6
Conclusion	7
References	8
Appendixes:	
A: List of manufacturers	33
B: List of contact addresses	34
C: Medical screening questionnaire	35
D: Anthropometric measurements	37
E: Preride questionnaire	39
F: Postride evaluation questionnaire	44
G: Interference questionnaire	46
H: Data tables	48

List of figures

Figure	Page
1. Placement of accelerometers on Apache seat	9
2. Transfer functions for the air cushion set	
a. Bottom cushion, X direction	10
b. Bottom cushion, Y direction	11
c. Bottom cushion, Z direction	12
d. Back cushion, X direction	13
e. Back cushion, Y direction	14
f. Back cushion, Z direction	15
3. Transfer functions for the foam cushion set	
a. Bottom cushion, X direction	16
b. Bottom cushion, Y direction	17
c. Bottom cushion, Z direction	18
d. Back cushion, X direction	19
e. Back cushion, Y direction	20
f. Back cushion, Z direction	21
4. Transfer functions for the standard cushion set	
a. Bottom cushion, X direction	22
b. Bottom cushion, Y direction	23
c. Bottom cushion, Z direction	24
d. Back cushion, X direction	25
e. Back cushion, Y direction	26
f. Back cushion, Z direction	27
5. Low frequency integrated response	28
6. High frequency integrated response	29
7. Seat bottom subjective response	30
8. Seat back subjective response	31

List of tables

Table	Page
1. Interference questionnaire	32
2. Low frequency integrated response	48
3. High frequency integrated response	48
4. Subjective response for the seat bottom	48
5. Subjective response for the seat back	49

Introduction

Seated operators in work environments often are required to spend long periods of time at their workstations while performing their primary duties. AH-64 Apache helicopter pilots are known to routinely spend up to 6 hours in their crewstation seat performing operations that include preflight, flight, and postflight tasks. Seat cushion design can impact directly on crew comfort and adversely affect mission performance. This study is an evaluation of two candidate replacement seat cushions, as compared to the standard seat cushion, for the AH-64 helicopter crew seat.

The Aviation Applied Technical Directorate* (AATD), Fort Eustis, Virginia, contracted with LME, Inc.* to design a replacement seat cushion set for the AH-64 Apache helicopter. Two cushion sets were designed with adjustable thigh and lumbar supports--one foam filled and one air filled. Prior to impact testing for crashworthy qualifications, AATD contacted the U.S. Army Aeromedical Research Laboratory (USAARL) to conduct a seat cushion comfort evaluation. This report documents the seat cushion comfort testing.

Methods

Twelve volunteer AH-64 Apache helicopter instructor pilots, recruited from D Company, 14th Aviation Battalion, Fort Rucker, Alabama, were exposed to AH-64 seat cushion sets using a repeated measures design. Seat cushion exposures were achieved by asking the subjects to sit atop the multiaxis ride simulator (MARS) in a partial AH-64 mockup crewstation. The mockup consisted of an AH-64 seat with collective, cyclic, and pedal controls arranged to be consistent with the placement of the AH-64 flight controls.

The repeated measures design was implemented as follows: three seat cushion sets (two candidate sets and the standard cushion set) were rotated through for each subject group. There were three groups consisting of four subjects each. Subjects were assigned randomly to the three groups. A total of 36 exposure tests were conducted.

Each of the 12 subjects was exposed to 1 hour of AH-64 simulated ride motion. This was repeated for each of the three seat cushion sets. A seat cushion set was comprised of a seat bottom, seat back, lumbar support, and an arm support. Subjects adjusted their seat position, pedal position, thigh, and lumbar support as they desired. Exposure to the remaining seat cushion

* See list of manufacturers.

sets was performed at the same time of the day on subsequent days.

Transfer functions are objective characterizations of the ability of a system to attenuate (or magnify) the transmission of vibrations through the system. The transfer functions for the seat cushions and seat backs were measured by using two B&K* model 2631 triaxial accelerometers for the seat panels proper, with one rigidly attached to the underside of the seat bottom and the other rigidly attached to the back side of the seat back. Two seat pad triaxial accelerometers, B&K model 4322, were used with one placed under the subject's buttock and on top of the seat bottom cushion, and the other placed behind the subject's back at the level of the upper thoracic spine and in front of the seat back cushion.

Three transfer functions were obtained for each accelerometer set with the Z-axis aligned out of the cushion, the X-axis aligned along the longitudinal axis parallel to the cushion surface, and the Y-axis aligned laterally and parallel to the cushion surface (Figure 1).

Accelerometer signals were amplified using Kistler* model 1430 charge amplifiers to obtain a sensitivity of 1 G/volt. Amplified accelerometer signals were recorded on a TEAC* XR-510 running at a tape speed of 4.8 cm/sec. Frequency response for this recording system was 0-1250 Hz.

Subjective assessments of seat cushion comfort were obtained from each subject following the 1-hour simulated ride exposure for each seat cushion set. Subjects filled out a questionnaire using a visual analog scale and rated each of 13 questions for the seat bottom and rated each of 17 questions for the seat back (Appendix F).

Simulated helicopter ride exposure was produced on the MARS facilities at USAARL. The MARS system is capable of reproducing field recorded triaxial acceleration signals in the 2-40 Hz range. Apache helicopter acceleration signals, previously recorded and available at USAARL for playback, were sampled by the MARS system and an iterative procedure reproduced the helicopter vibrations to within 0.5 dB. The chosen flight profile was a straight and level flight at normal cruise speed without wing stores. Simulated ride motion as reproduced at MARS and to which the subjects were exposed did not exceed the health and safety limits specified in AR 40-10 and ISO 2631.

Analysis

Transfer functions were generated from acceleration signals recorded during the testing phases using PC-based hardware and software. The analog signals were played back into antialias low-pass filters (Onsite TechFilter PC-16 card) to remove frequencies above 80 Hz. The filtered signals were passed to the analog-to-digital convertor (Metrabyte DAS-1601) which sampled each signal at the rate of 500 samples/second. The digital signals then were analyzed by the digital signal processing SnapMaster software. The main process to which digital signals were subjected was a transfer function block, tailored to apply an 8-second Hamming window in the time domain signal, then the transfer functions were averaged for 16 averages. Averaged transfer function data were exported to MicroSoft Excel for ensemble averaging across subjects for each seat cushion set.

Averaged transfer functions were processed further by integrating the response in the range of 4-8 and 20-40 Hz. The 4-8 Hz range was chosen because it is the maximally sensitive region for the Z-axis response. The Z-axis motion is the dominant response for helicopter vibration. The 20-40 Hz region was selected to represent the high frequency attenuation. A multiple comparison of means test was performed on the integrated response for seat cushion sets using Systat* statistical software run on a 286-based PC. Only Z-axis responses were analyzed using statistical methods.

Subjective responses from the questionnaires were analyzed by initially coding the responses from 1 through 7 for each question and applying a Tukey Honestly Significant Difference test. All statistical tests were performed at the $p \leq 0.1$ level.

A final questionnaire was used to assess the acceptance of the arm support, inflation bulbs and foam wedges, and lumbar support (Appendix G), and followed the last simulated ride exposure. Analysis of this data consisted of reporting means and standard deviations.

Results

Transfer function data are shown in Figures 2, 3 and 4, for the air filled (configuration A), foam filled (configuration B), and standard seat cushion sets (configuration C), respectively. Each figure has the averaged transfer function for the seat bottom X (a), Y (b), and Z (c), and the seat back X (d), Y (e), and Z (f).

The low frequency integrated response is shown in Figure 5, with significant differences found for the air and foam back cushions as compared to the standard back cushion. Figure 6 shows the high frequency integrated response with significant differences found for the air and foam bottom cushion as compared to the standard bottom cushion.

Subjective responses for the seat bottom showed significant differences for 3 of the 13 questions regarding thickness of the seat cushion (question 3), the vibration absorption (question 12), and the overall comfort (question 13). Figure 7 shows the coded scores where a lower score indicates a preference for the characteristic. Subjective responses for the seat back also showed significant differences for 3 of the 17 questions regarding thickness of the lumbar support (question 4), the covering material thickness (question 12), and the overall comfort (question 17). Figure 8 shows the coded scores where a lower score indicates a preference for the characteristic.

Subjective responses for the questionnaire addressing the arm support attachment site, the potential interference with the inflation bulbs and foam wedges with the controls, and the lumbar support is shown in Table 1. Responses were coded similarly using a range of 1-7 with a lower score indicating a characteristic that is "liked" or is "acceptable." A cell in Table 1 with no numbers indicates this question received no responses.

Discussion

Transfer function data showed that, for the Z axis and for the bottom cushion, the air and foam cushions had significantly greater attenuation over that of the standard cushion back for the higher frequency range of 20-40 Hz. This indicates the air and foam cushions reduced the amount of high frequency vibration transmitted to the subject's buttocks. That both cushions showed similar responses is not surprising because the foam wedges and air support primarily are over the thigh region. The subject's buttocks are supported by a similar covered foam material for both cushions. This reduction in transmitted vibration also is supported by the subjective responses with a significant difference found in favor of increased vibration absorption between the prototype cushions and the standard cushion. Subjective responses also showed significant differences in overall comfort with the prototype seat bottom cushions deemed more comfortable than the standard seat bottom cushion.

The seat back transfer function data showed that, for the Z axis and for the back cushion, the air and foam cushions had significantly greater attenuation over that of the standard cushion back for the lower frequency range of 4-8 Hz. This

indicates the air and foam cushions reduced the amount of gain in the low frequency range and transmitted less vibration to the subject's back. Subjective comfort data also supported the prototype seat back cushions in favor of the standard seat back cushion.

Care must be taken when interpreting the seat back transfer function data showed in Figures 1, 2, and 3. Transfer function calculations for the seat cushions assume constant contact between the input response surface and the output response surface. A break in the contact of the subject's back with the seat pad accelerometer would render the transfer function calculations invalid. Care was taken to ensure that data records used in the seat back transfer functions had good contact between the subject's back and the seat pad accelerometer. Even with this effort, contact was often times light and subject to error.

A subjective response that was not assessed in the questionnaires, but was volunteered by a majority of the subjects, was that the prototype lumbar supports needed to be "butterfly" shaped similar to that found in the standard seat cushion lumbar support. The rectangular shape of the foam filled and air filled lumbar support had a tendency to push the subjects out of the seat pan, as opposed to supporting the lumbar region of the back.

The final questionnaire surveying the arm support, the lumbar support, and potential interference with the control, indicated strong responses from three questions. Subjects appeared to dislike the arm attachment to the thigh, dislike the foam adjustable lumbar support, and found no interference with the foam wedges with the cyclic.

Conclusion

Objective transfer function results indicate the prototype air-filled and foam-filled seat cushions perform better than the standard AH-64 seat cushion for the seat bottom cushion in attenuating higher frequency vibrations. Low frequency gain is reduced over that of the standard seat cushion set for the air- and foam-filled prototype seat back cushion. Subjective responses indicate significant differences in comfort assessments for seat back and seat bottom cushions, and improved vibration absorption for the seat bottom cushion.

References

- Department of the Army. 1991. Health hazard assessment program in support of the Army materiel acquisition decision process. Washington, DC: Department of the Army. AR 40-10.
- Donelson, Sarah M., and Gordon, Claire C. 1991. 1988 Anthropometric survey of U.S. Army personnel: pilot summary statistics. Natick, MA: United States Army Natick Research, Development and Engineering Center. TR-91-040.
- International Organization for Standardization. 1985. Evaluation of human exposure to whole-body vibration, Part 1: General requirements. ISO-2631. 2nd edition. 1985-05-15.

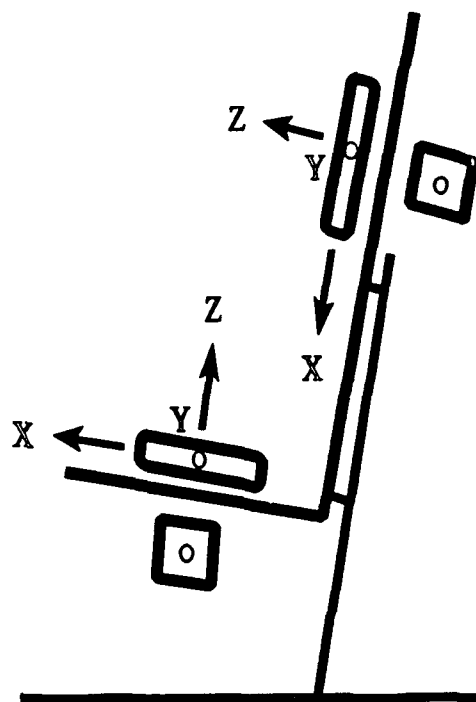


Figure 1. Placement of seat pad accelerometers (rectangles) and seat pan accelerometers (squares) with axis orientations. Seat pan accelerometers have the same orientation as the seat pad accelerometers.

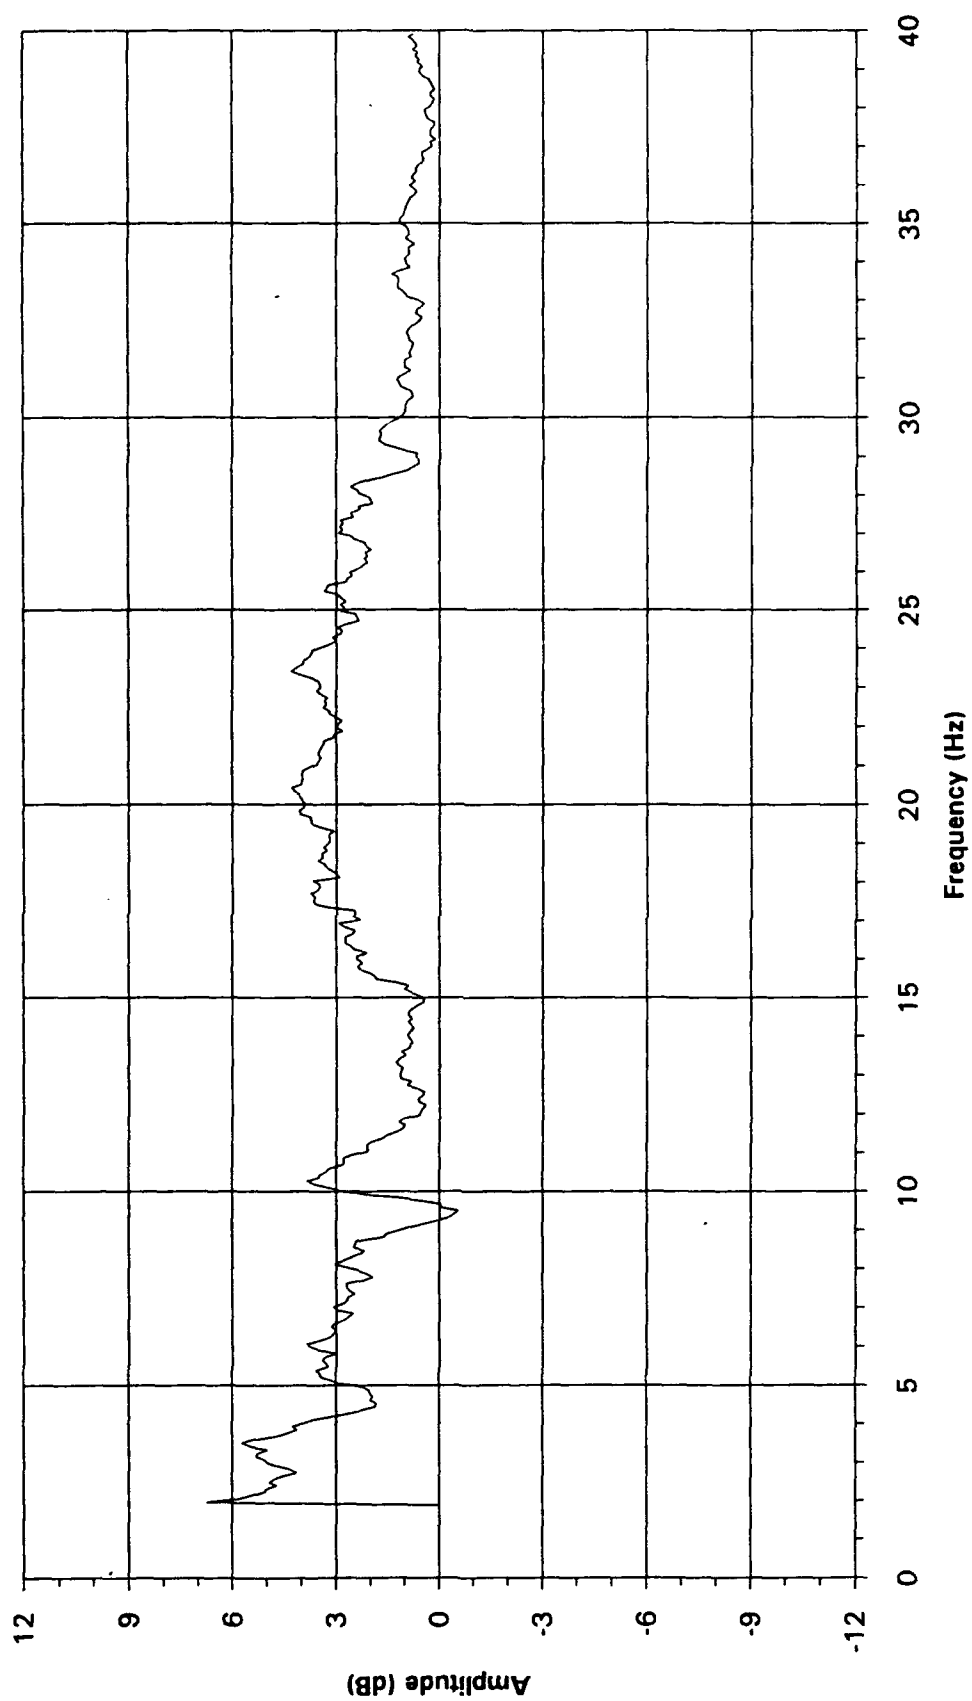


Figure 2-a. Transfer function for the air cushion set: bottom cushion, X-direction.

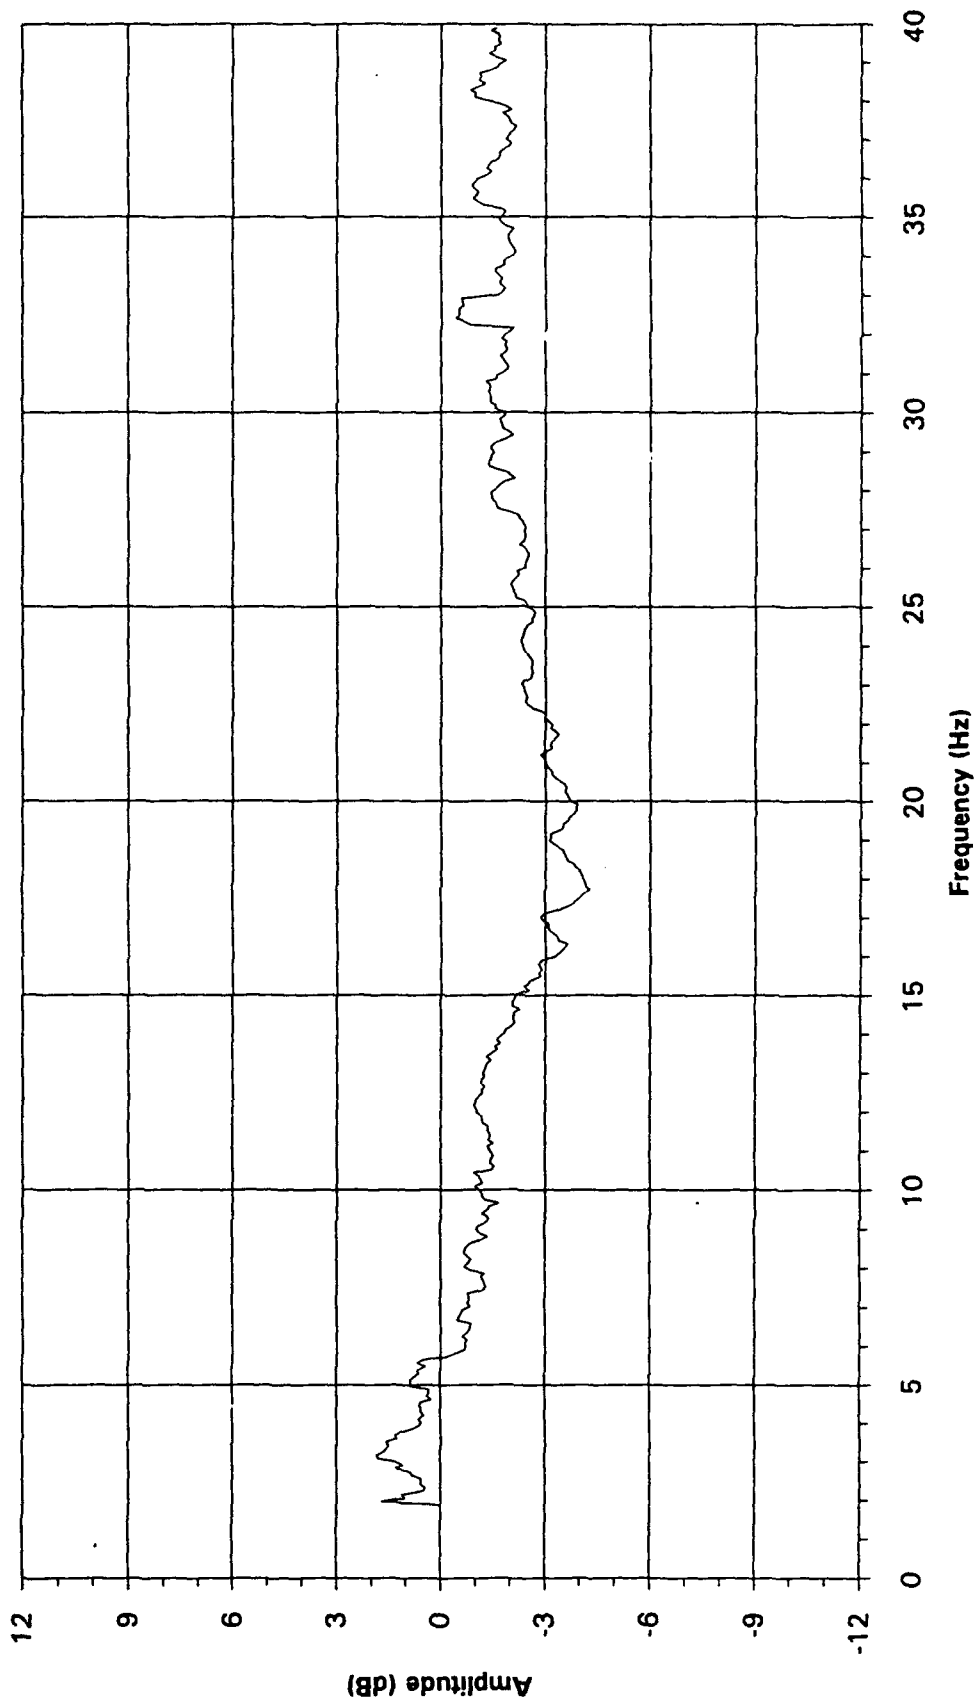


Figure 2-b. Transfer function for the air cushion set: bottom cushion, Y-direction.

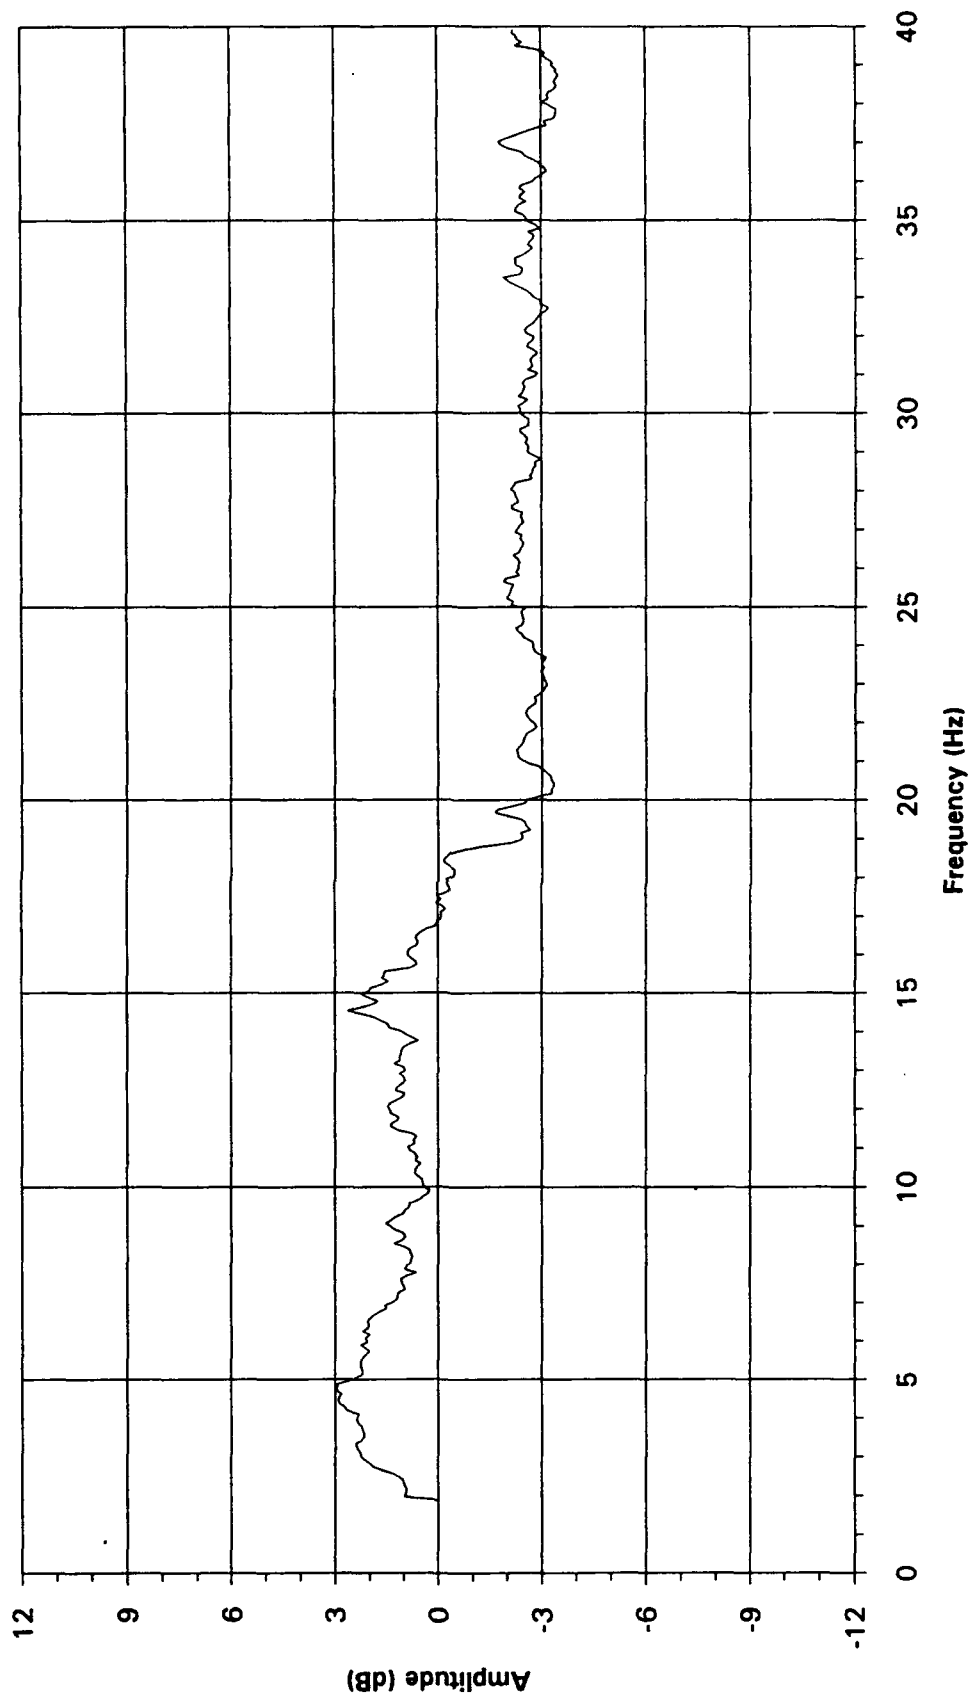


Figure 2-c. Transfer function for the air cushion set: bottom cushion, Z-direction.

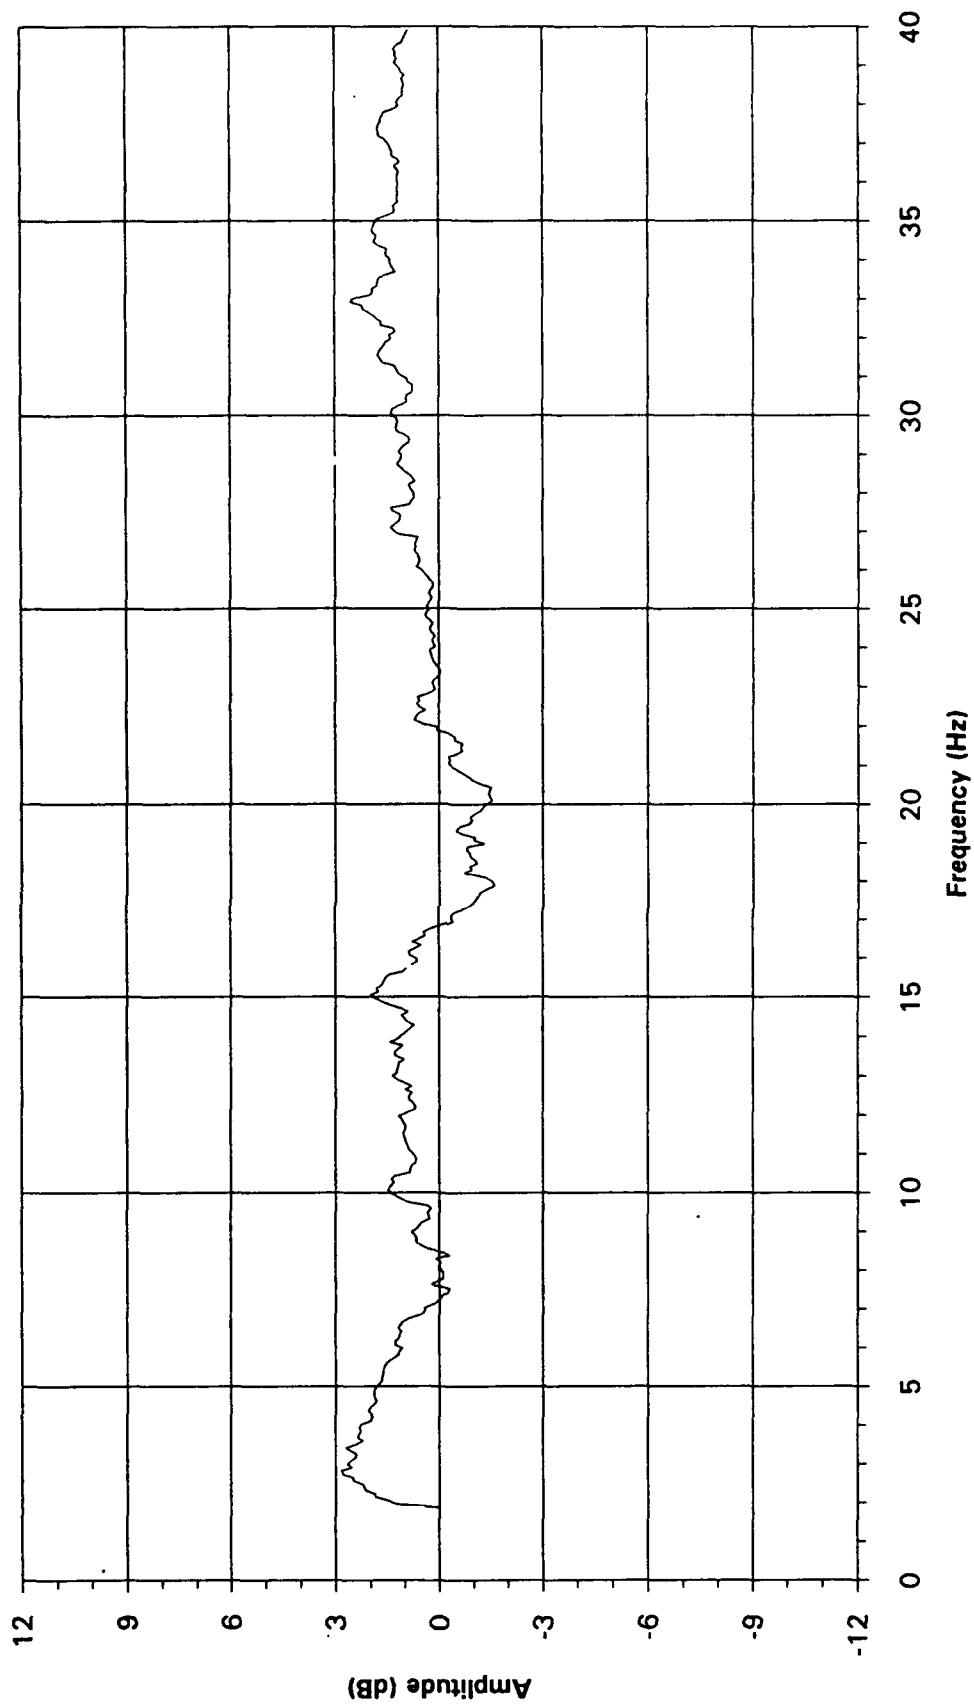


Figure 2-d. Transfer function for the air cushion set: back cushion, X-direction.

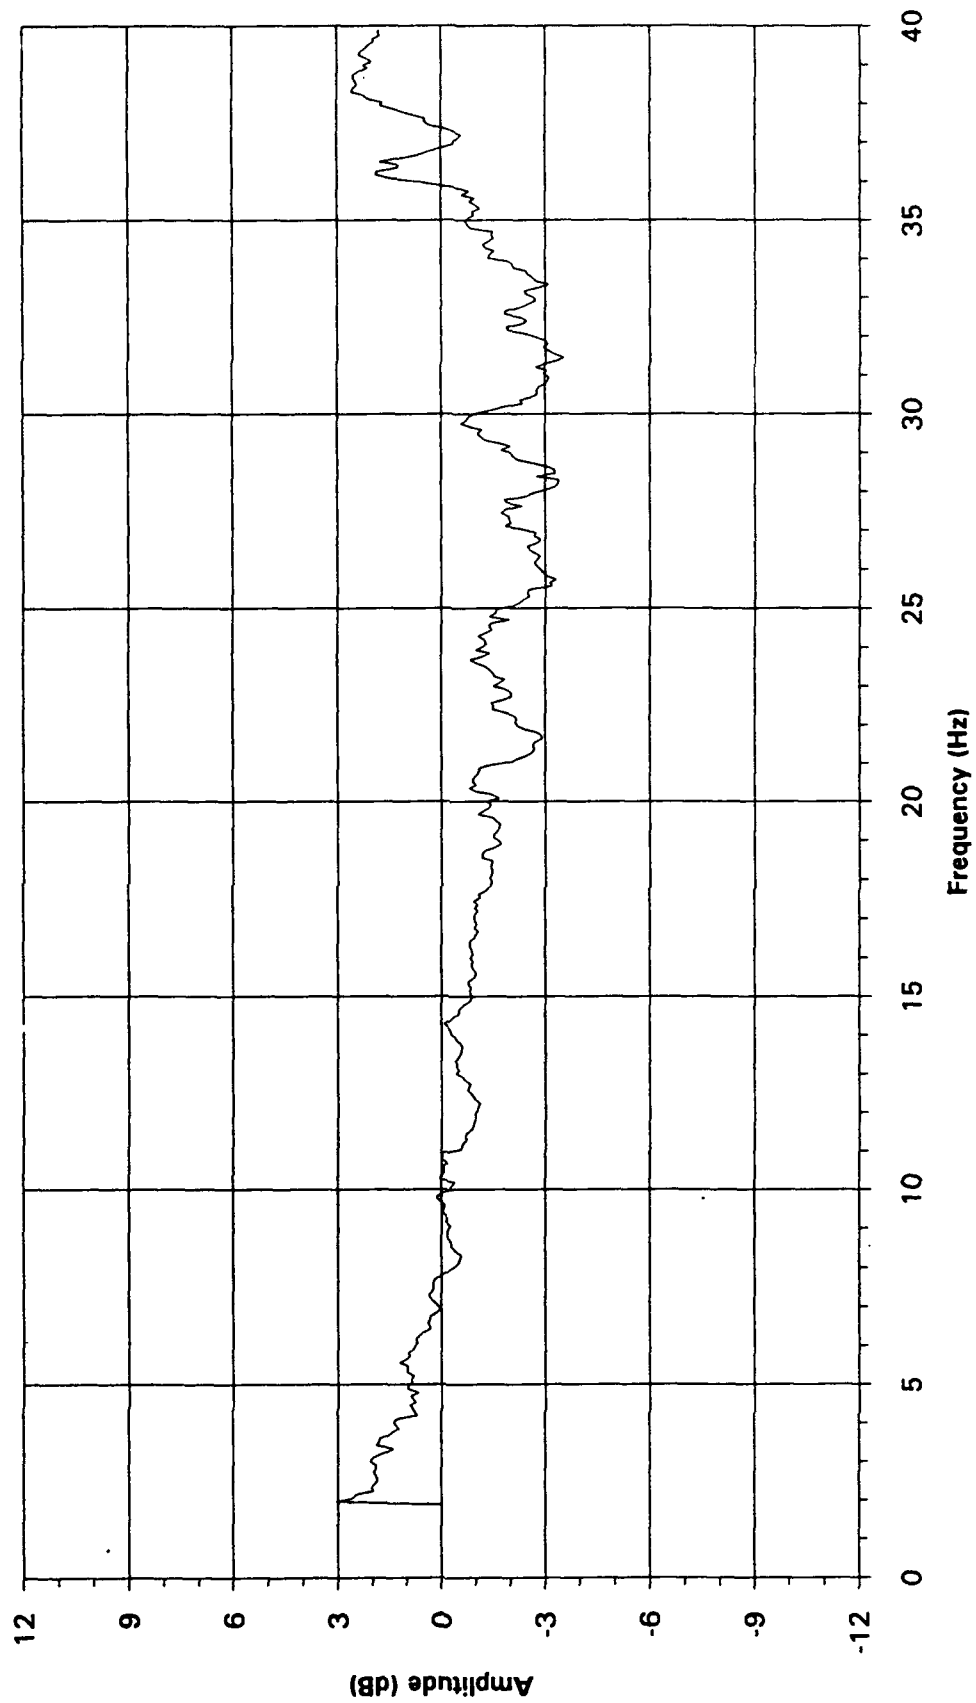


Figure 2-e. Transfer function for the air cushion set: back cushion, Y-direction.

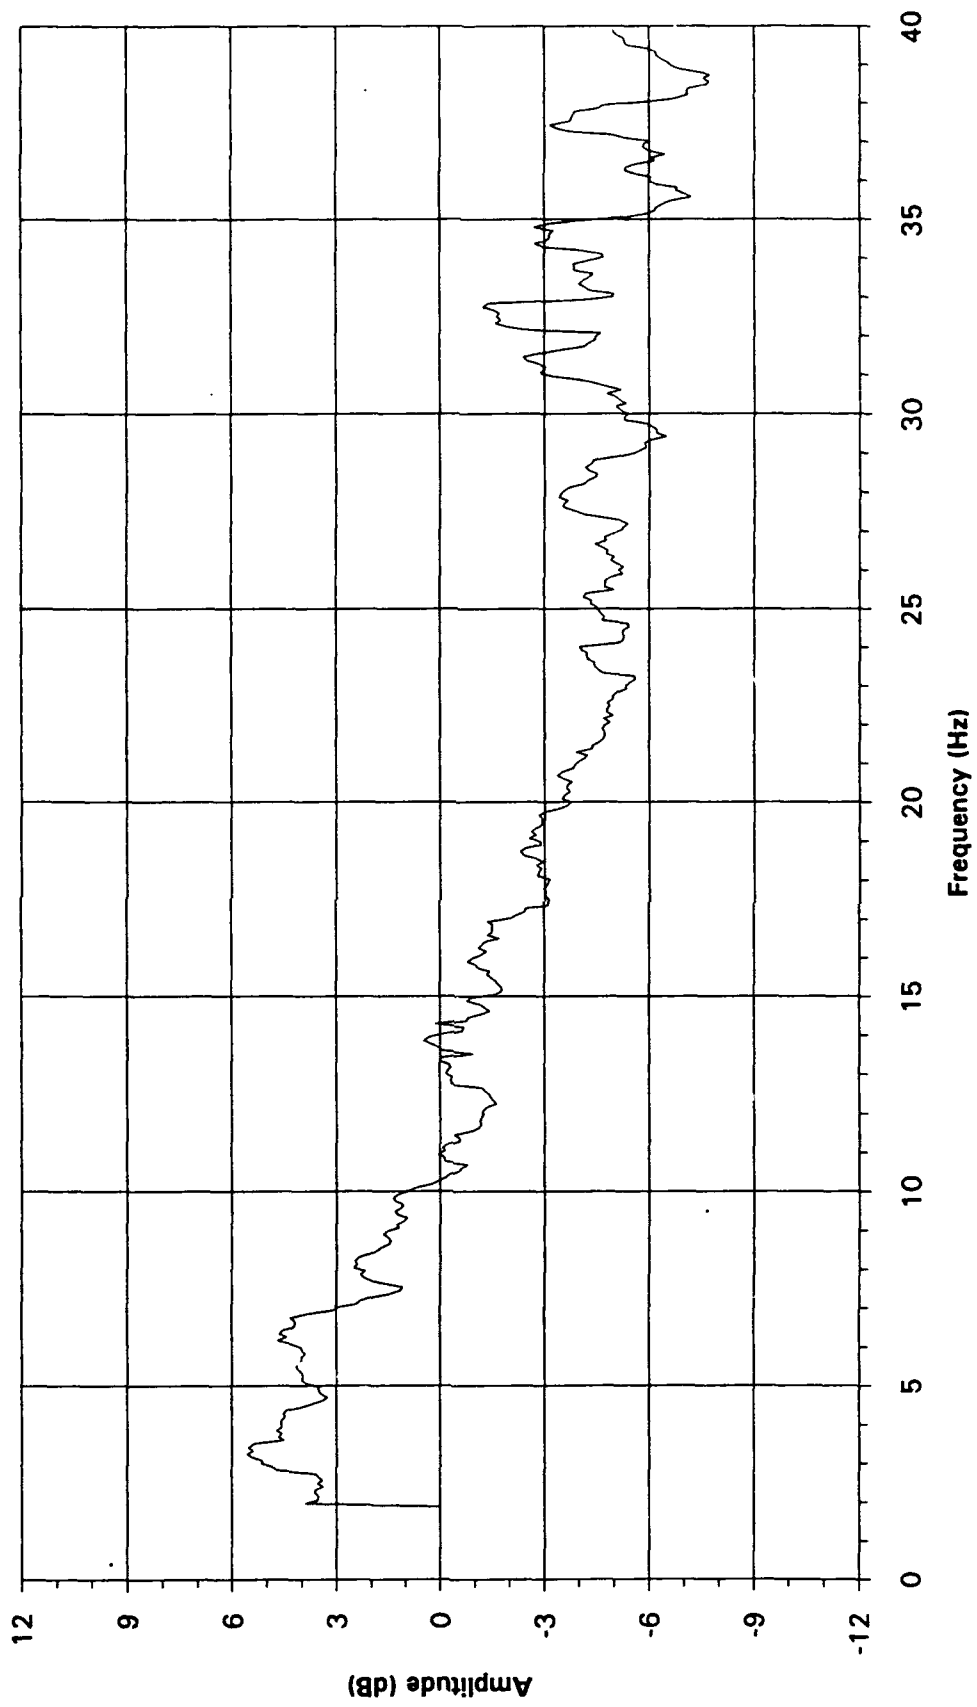


Figure 2-f. Transfer function for the air cushion set: back cushion, Z-direction.

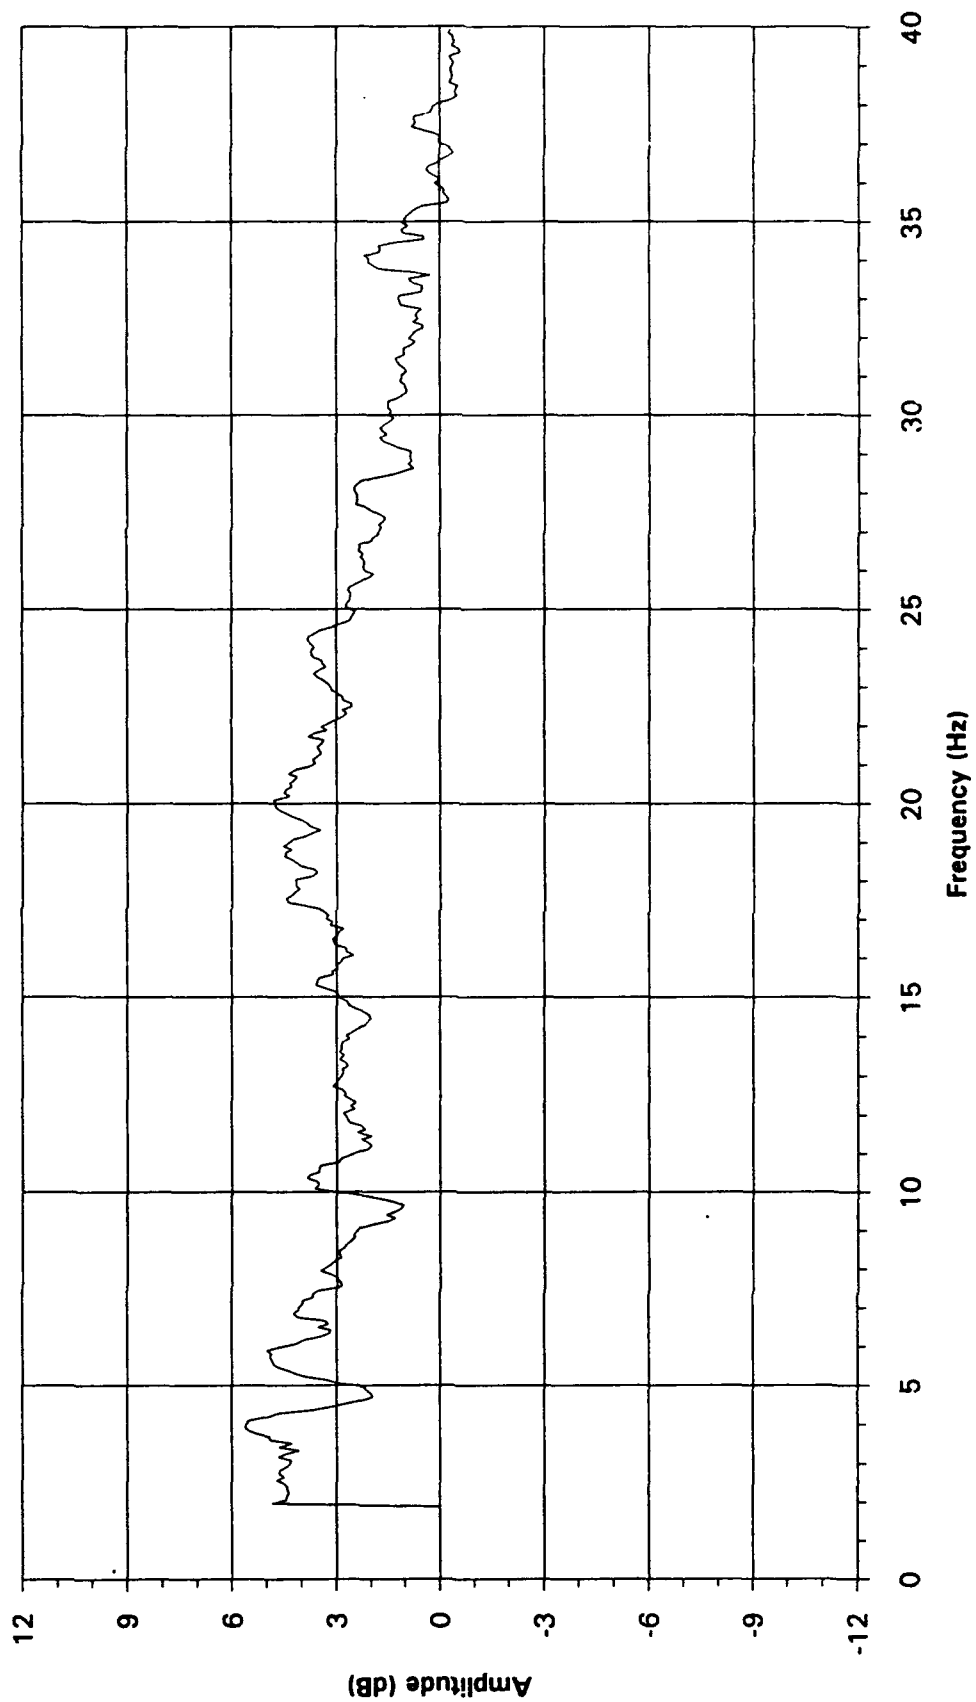


Figure 3-a. Transfer function for the foam cushion set: bottom cushion, X-direction.

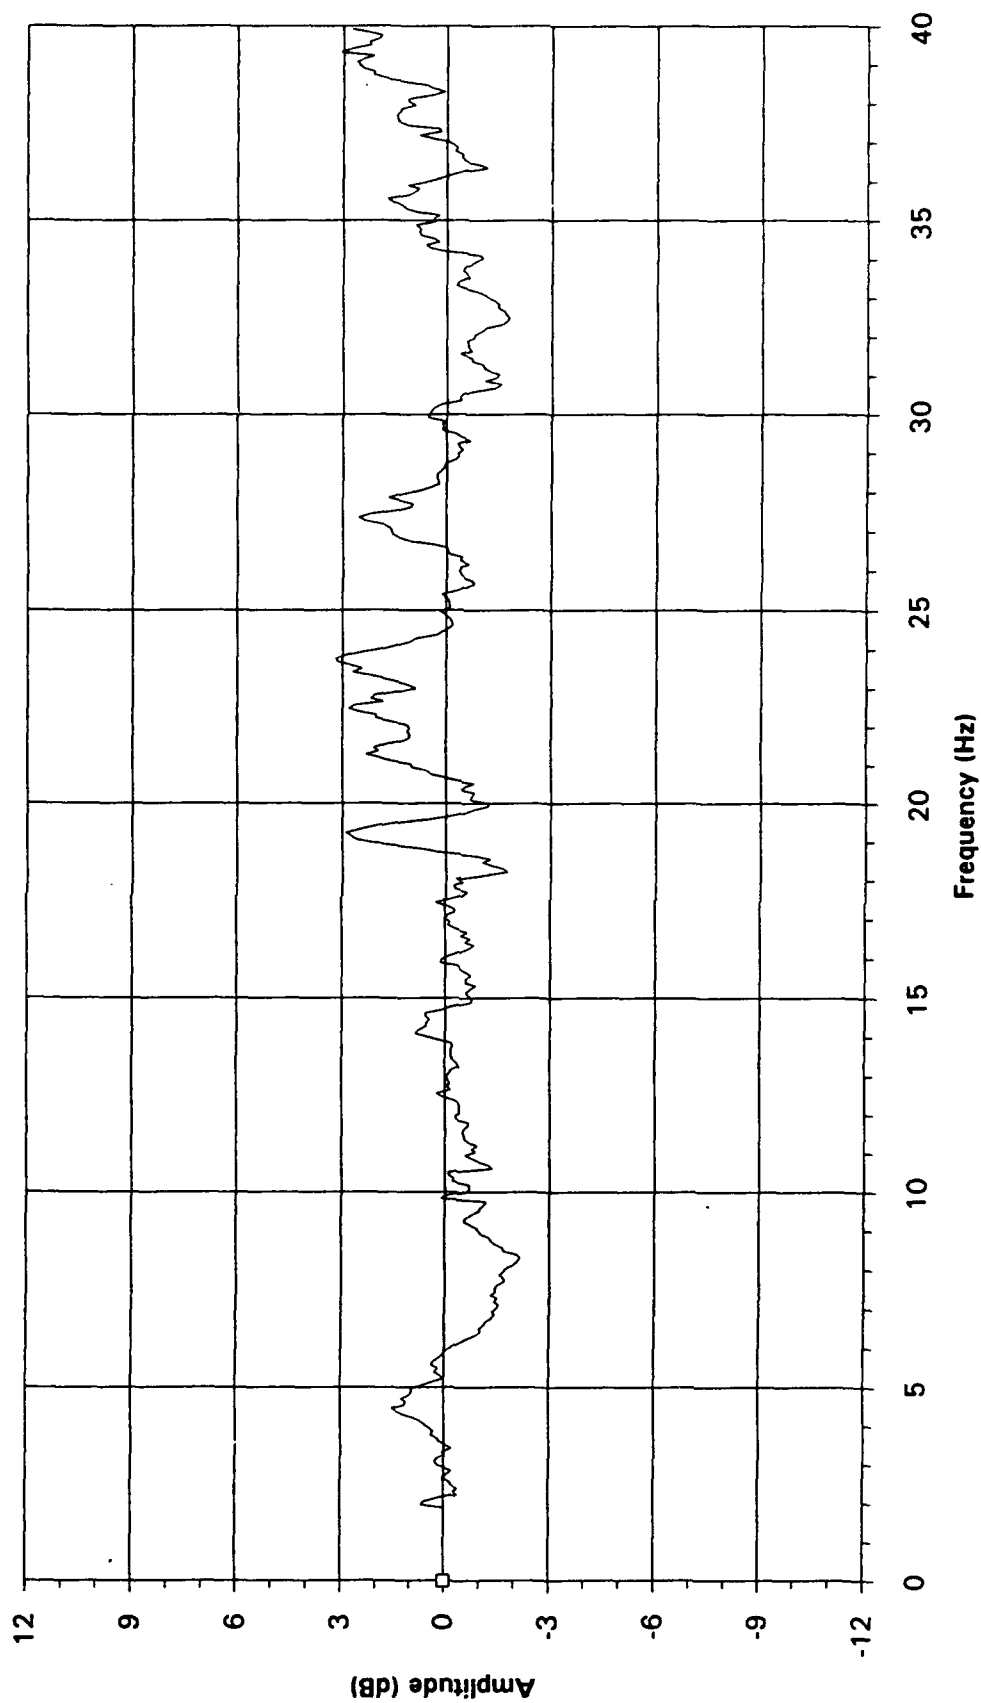


Figure 3-b. Transfer function for the foam cushion set: bottom cushion, Y-direction.

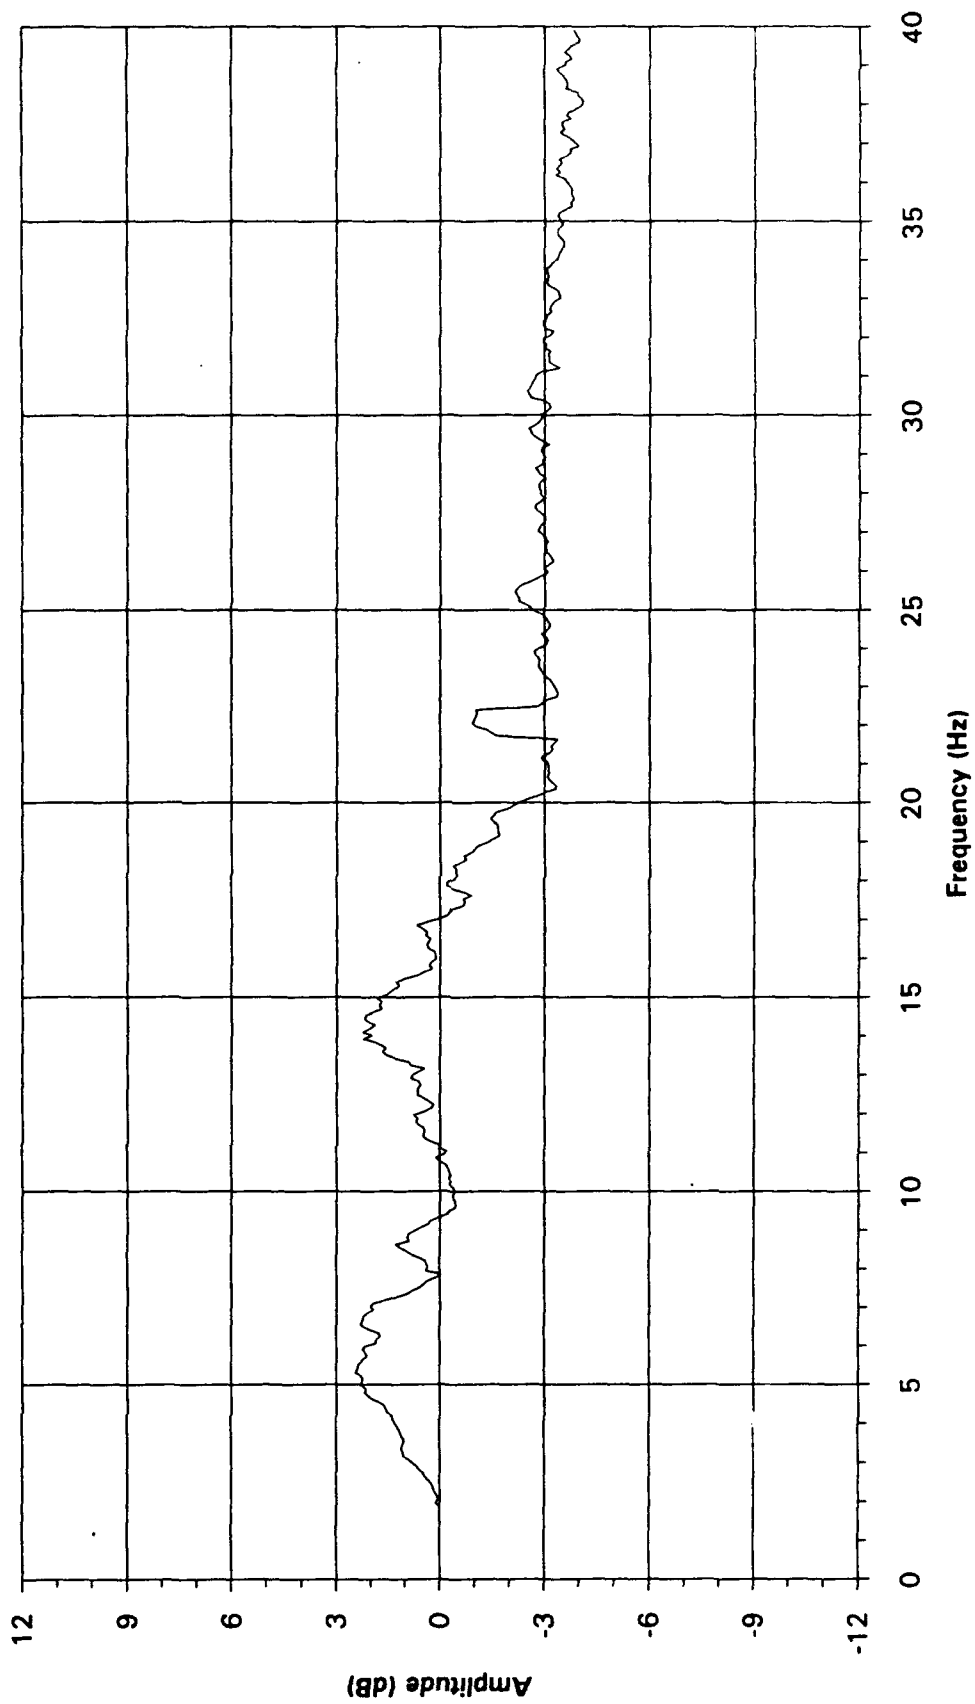


Figure 3-c. Transfer function for the foam cushion set: bottom cushion, Z-direction.

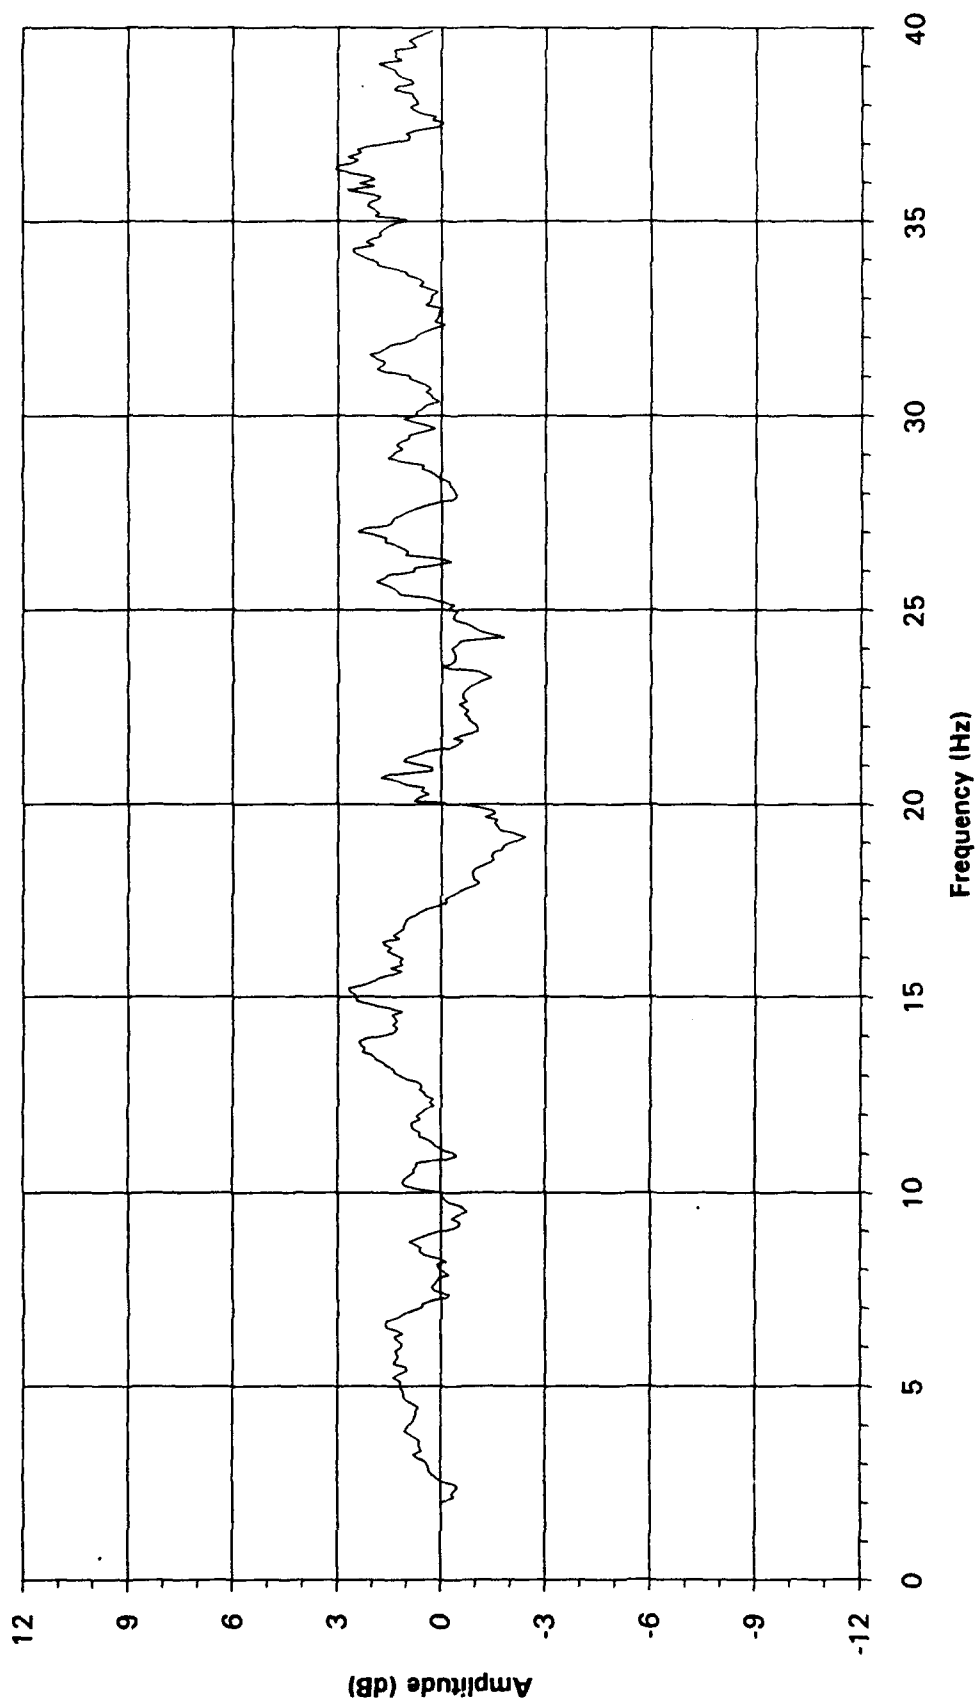


Figure 3-d. Transfer function for the foam cushion set: back cushion, X-direction.

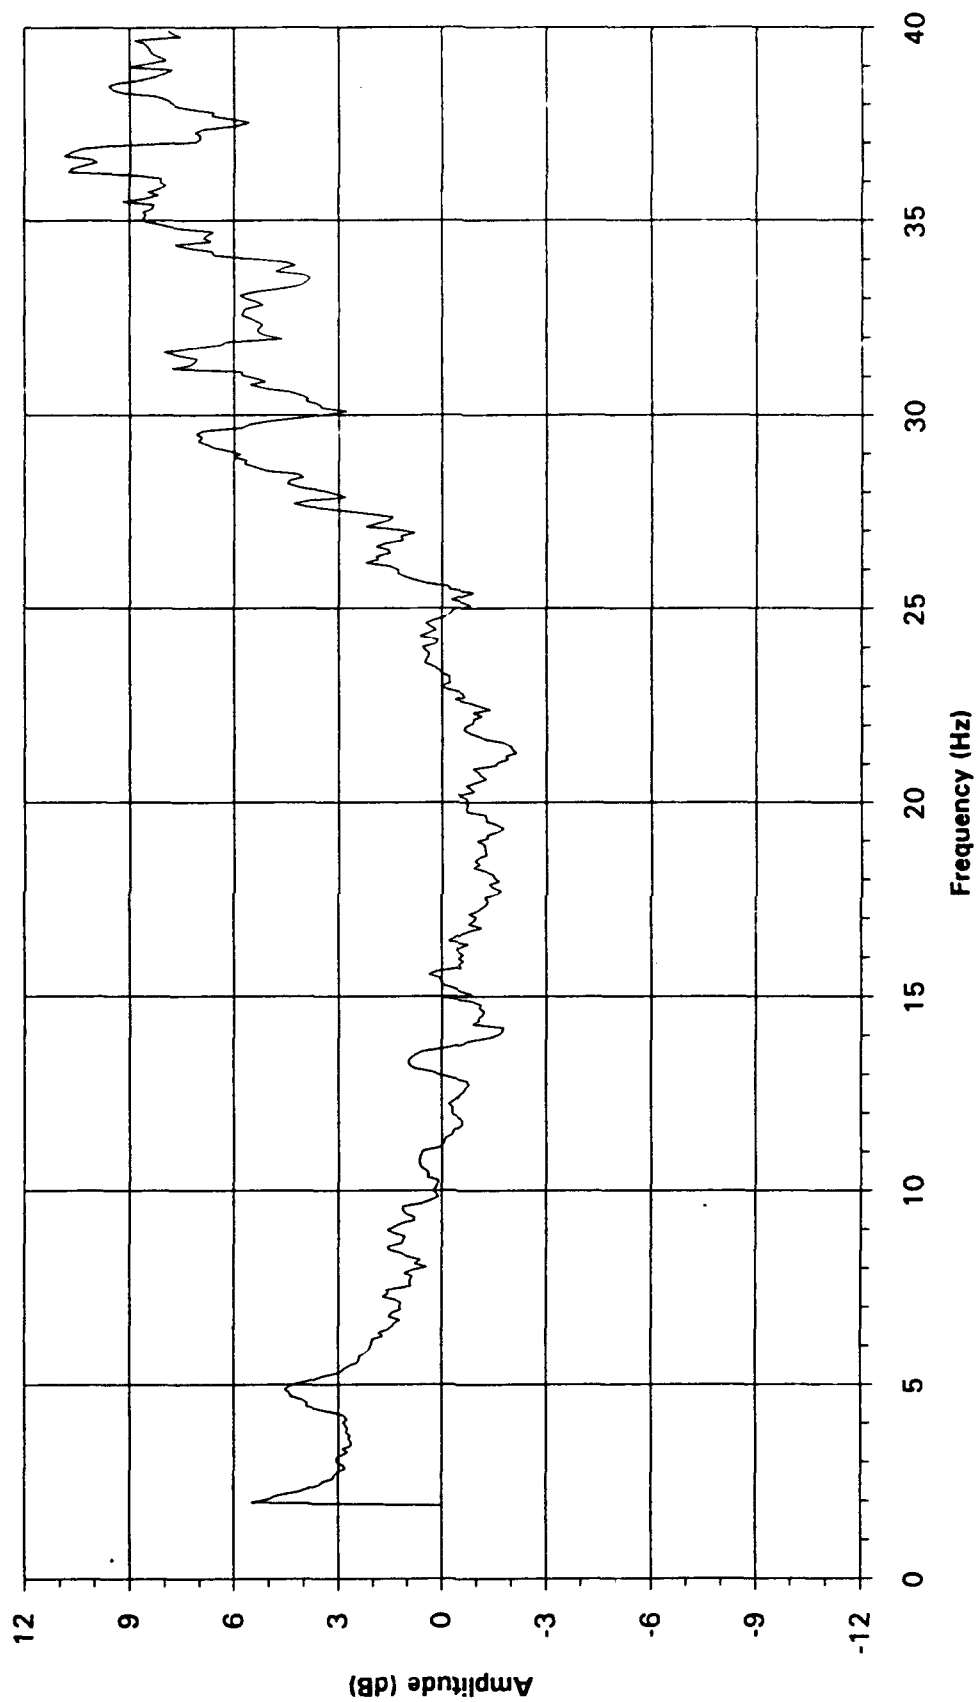


Figure 3-e. Transfer function for the foam cushion set: back cushion, Y-direction.

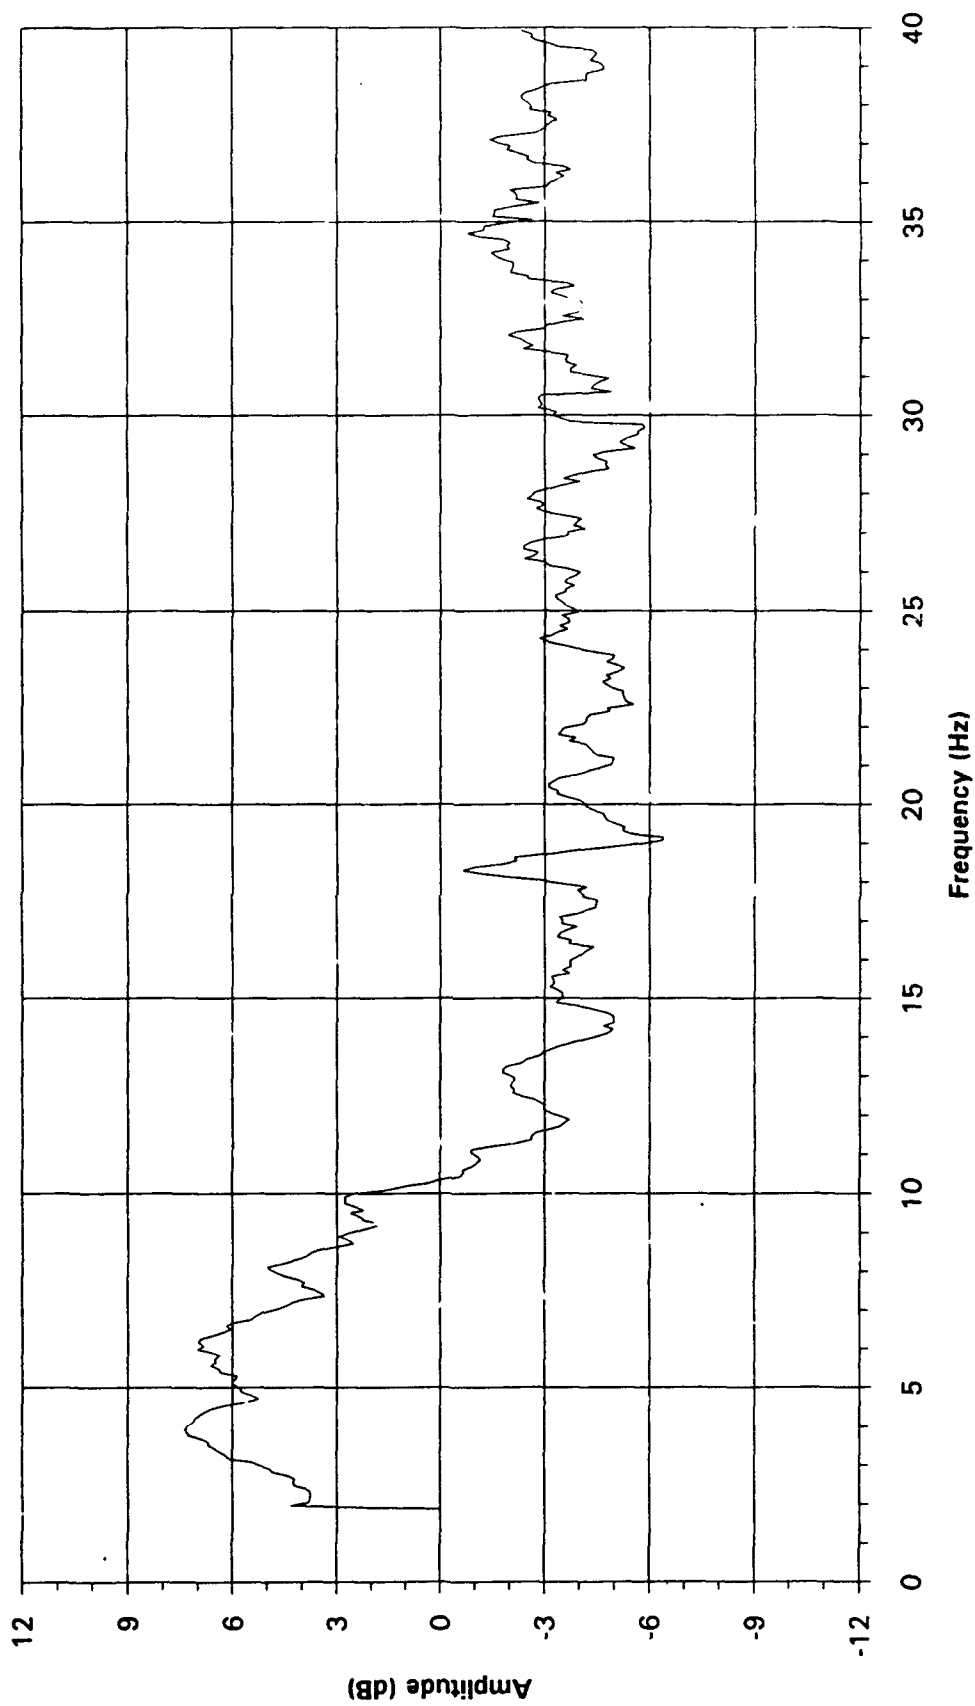


Figure 3-f. Transfer function for the foam cushion set: back cushion, Z-direction.

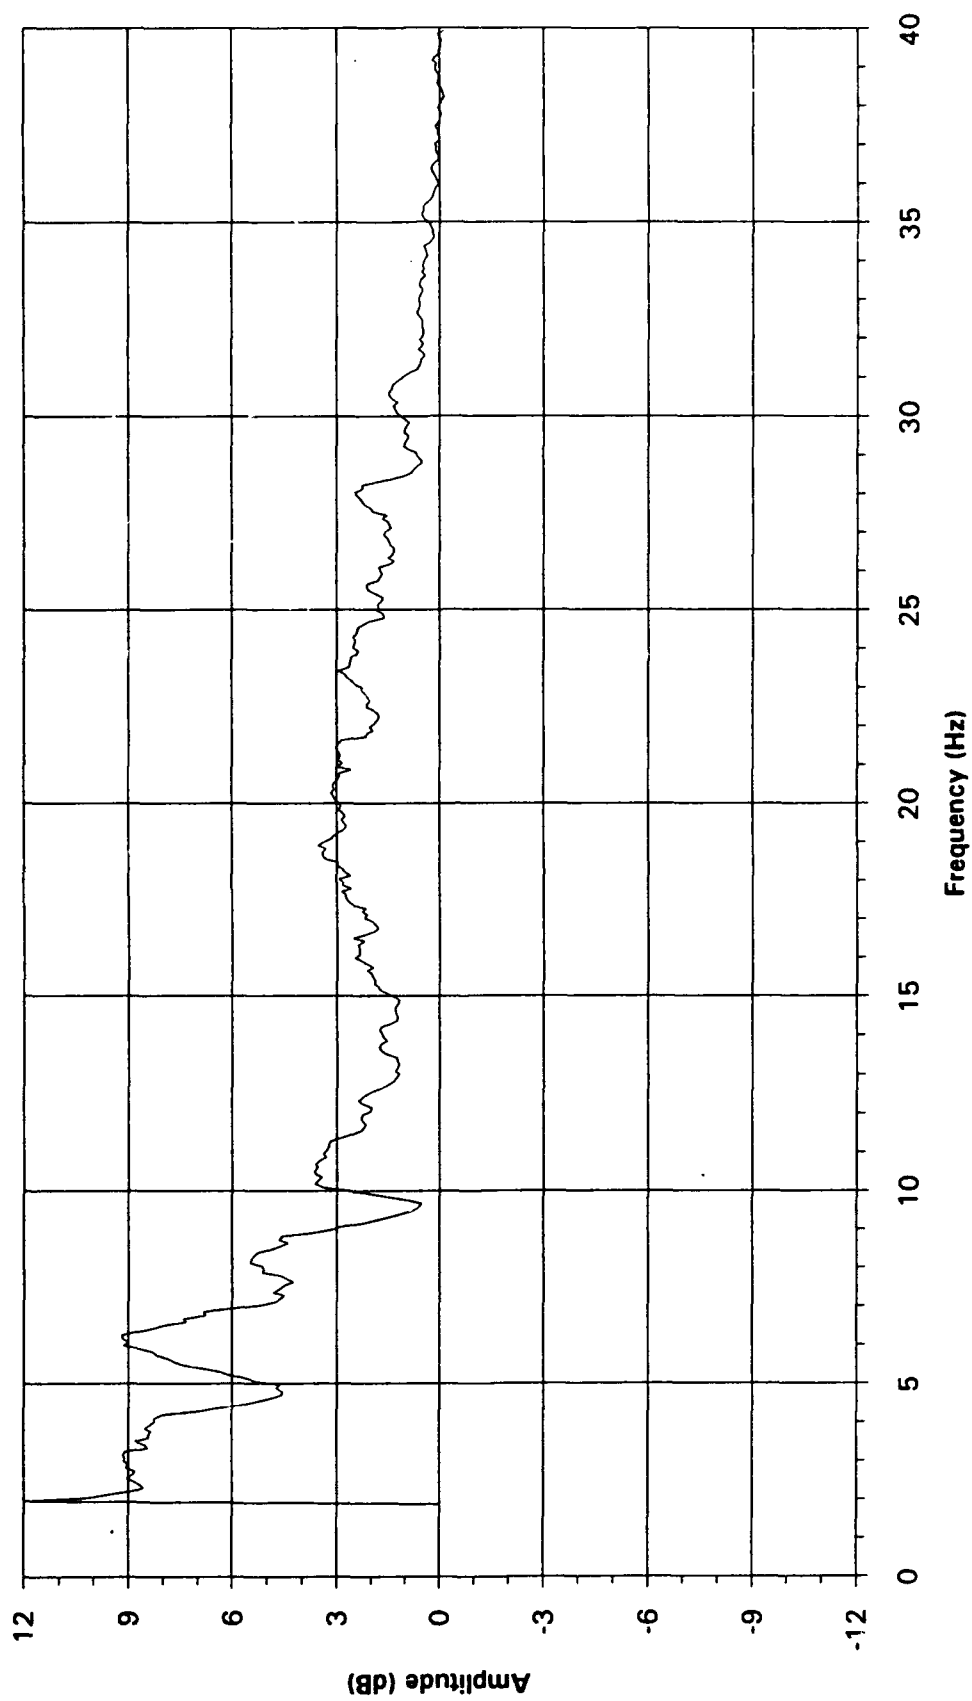


Figure 4-a. Transfer function for the standard set: bottom cushion, X-direction.

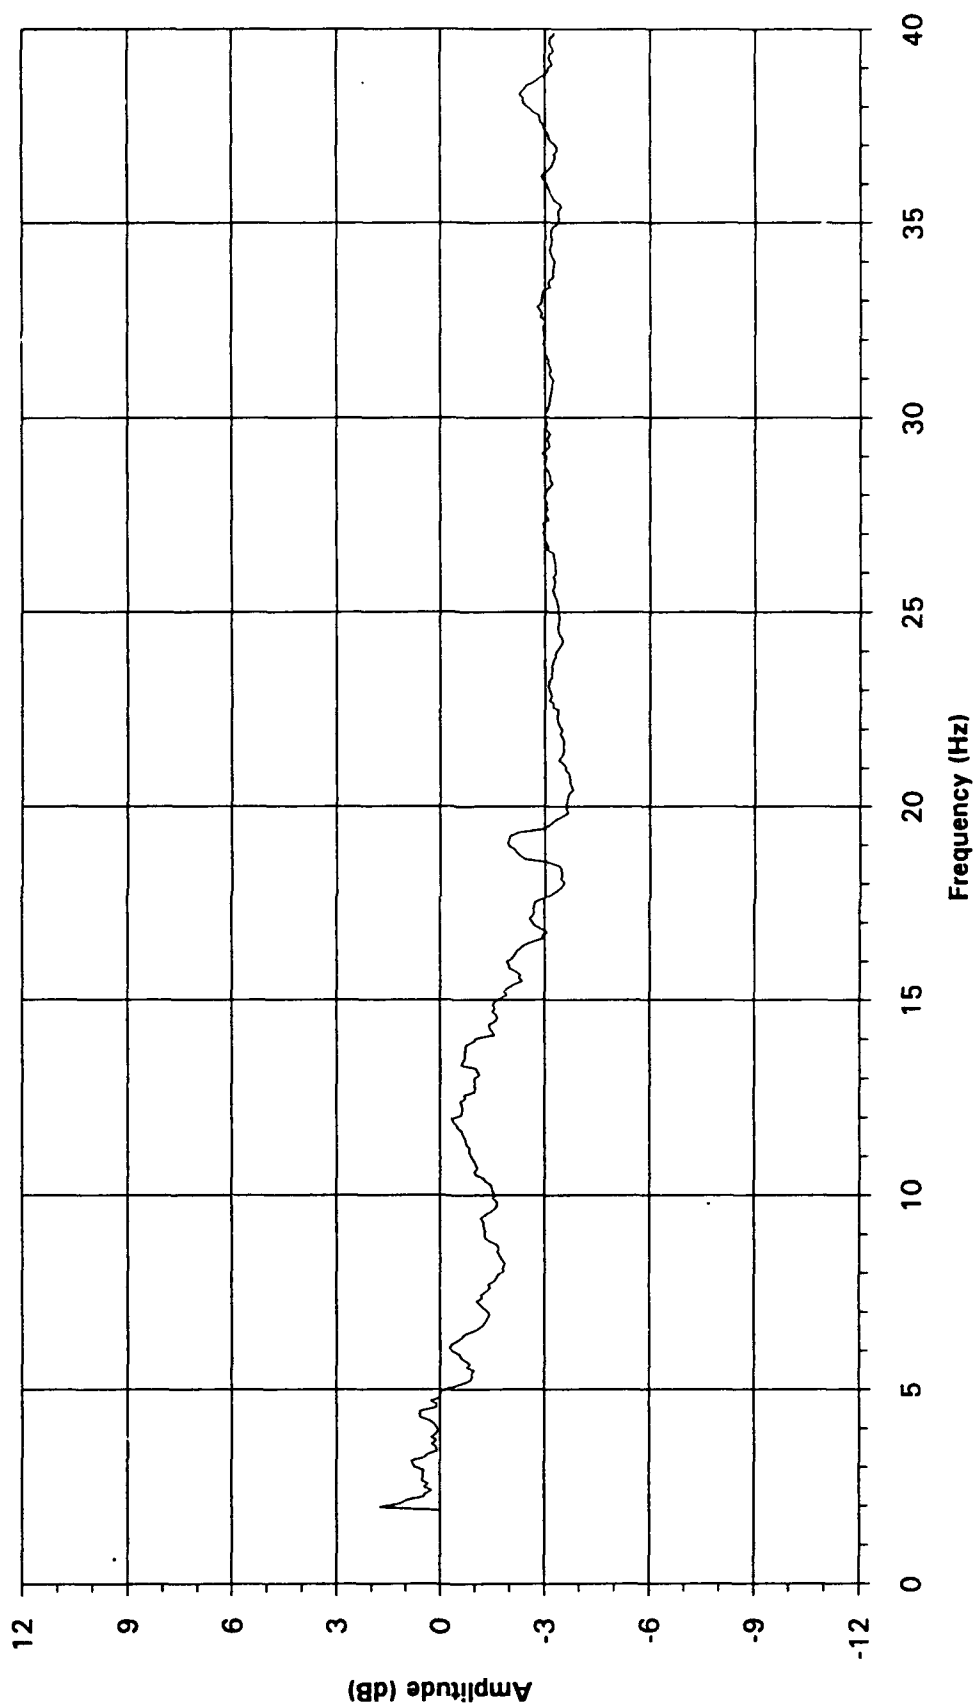


Figure 4-b. Transfer function for the standard set: bottom cushion, Y-direction.

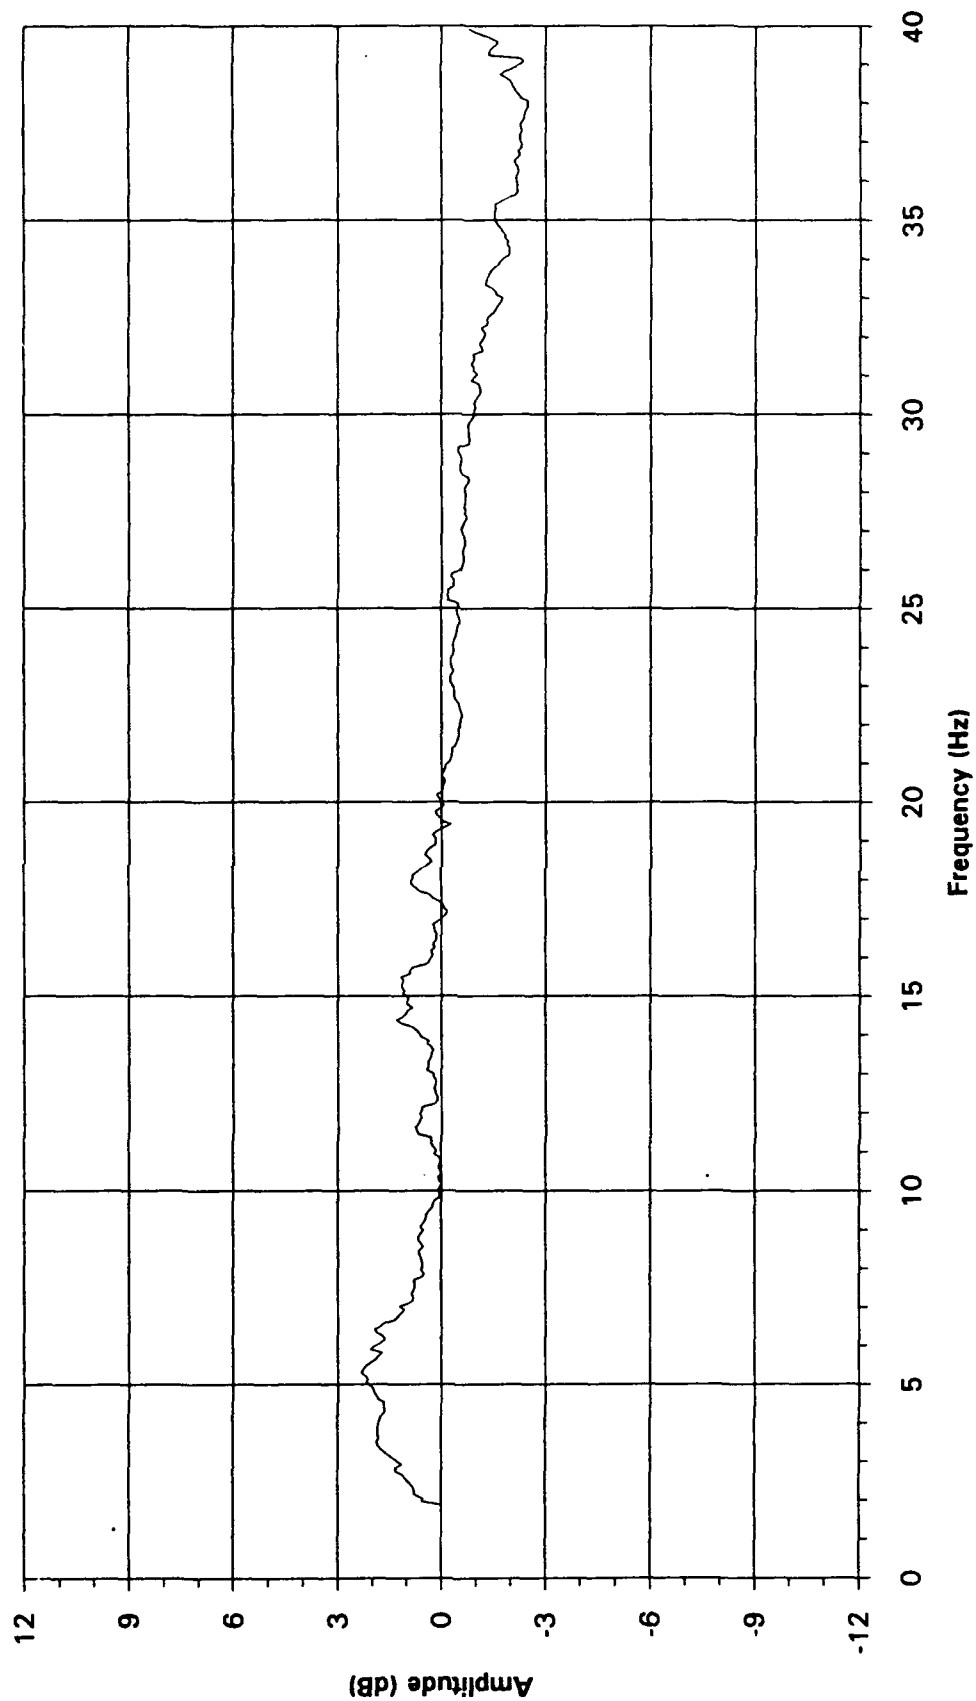


Figure 4-c. Transfer function for the standard set: bottom cushion, Z-direction.

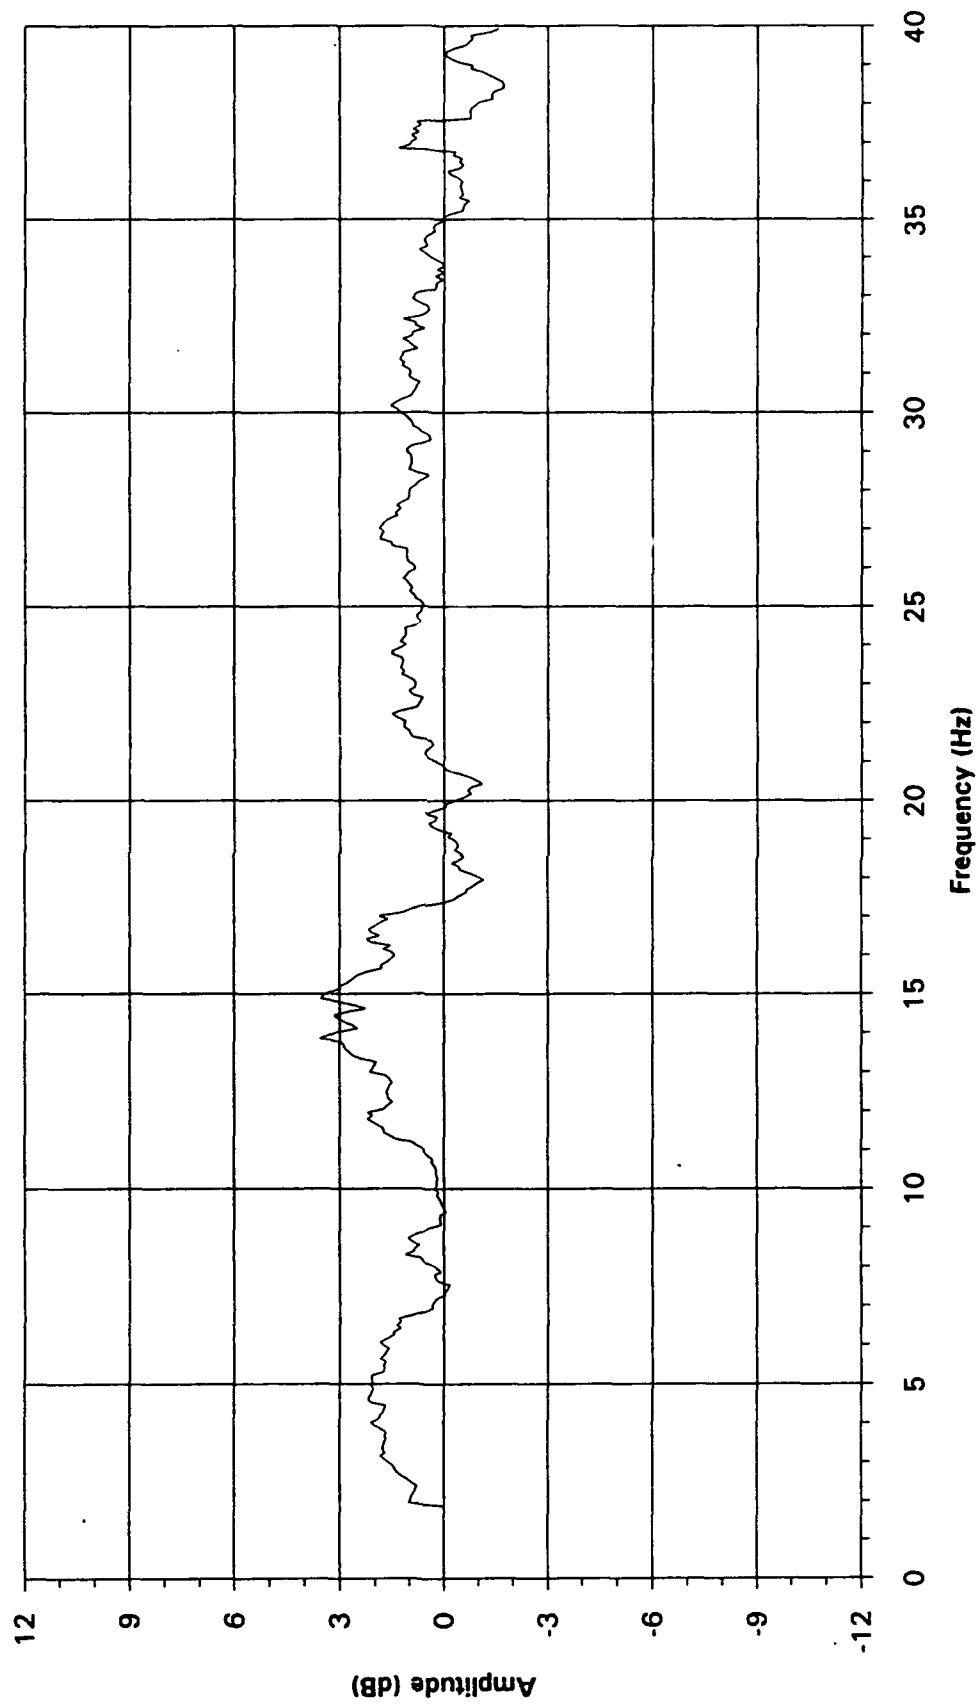


Figure 4-d. Transfer function for the standard set: back cushion, X-direction.

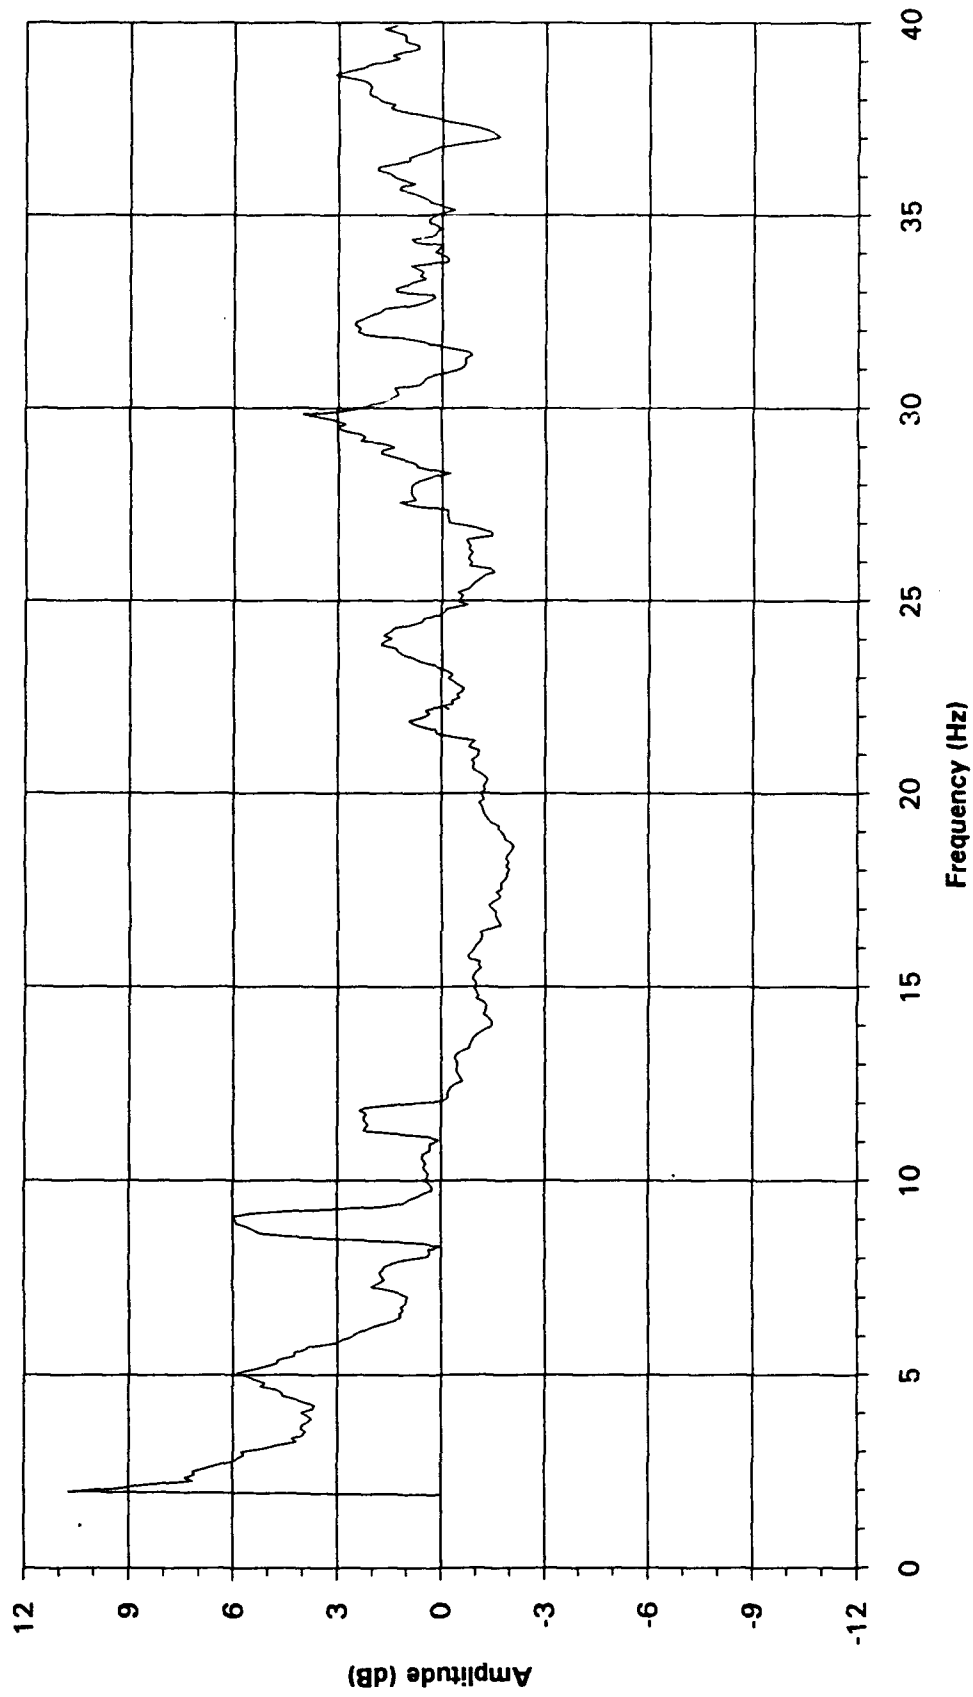


Figure 4-e. Transfer function for the standard set: back cushion, Y-direction.

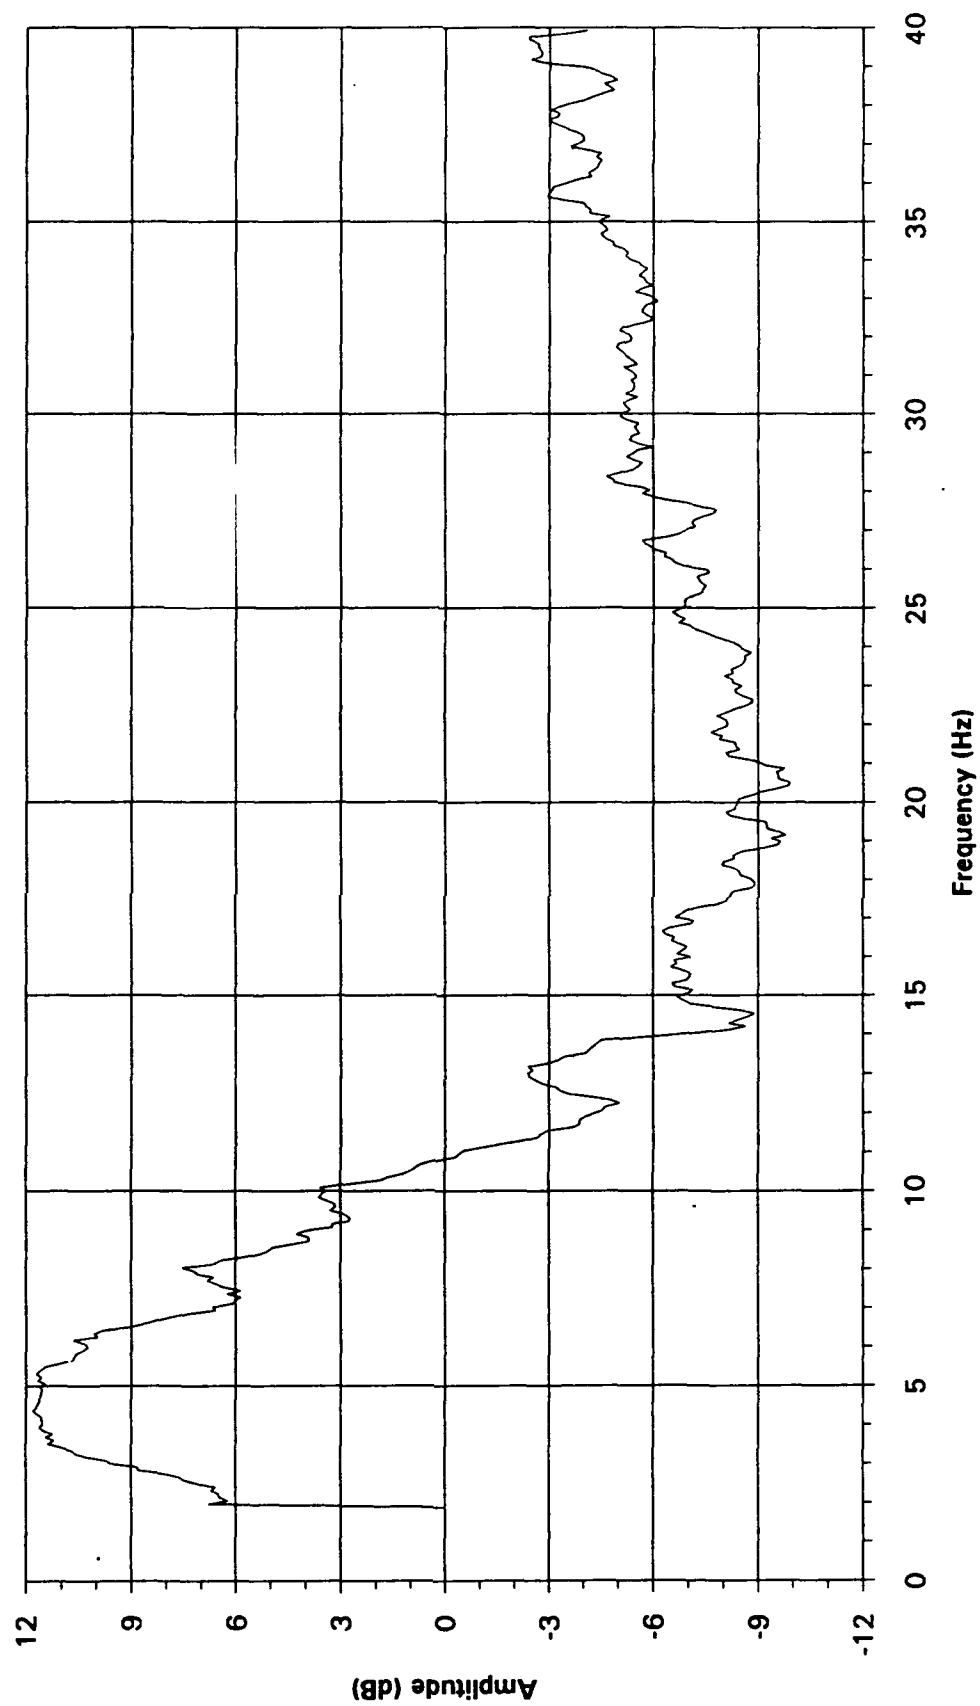


Figure 4-f. Transfer function for the standard set: back cushion, Z-direction.

Low frequency integrated response

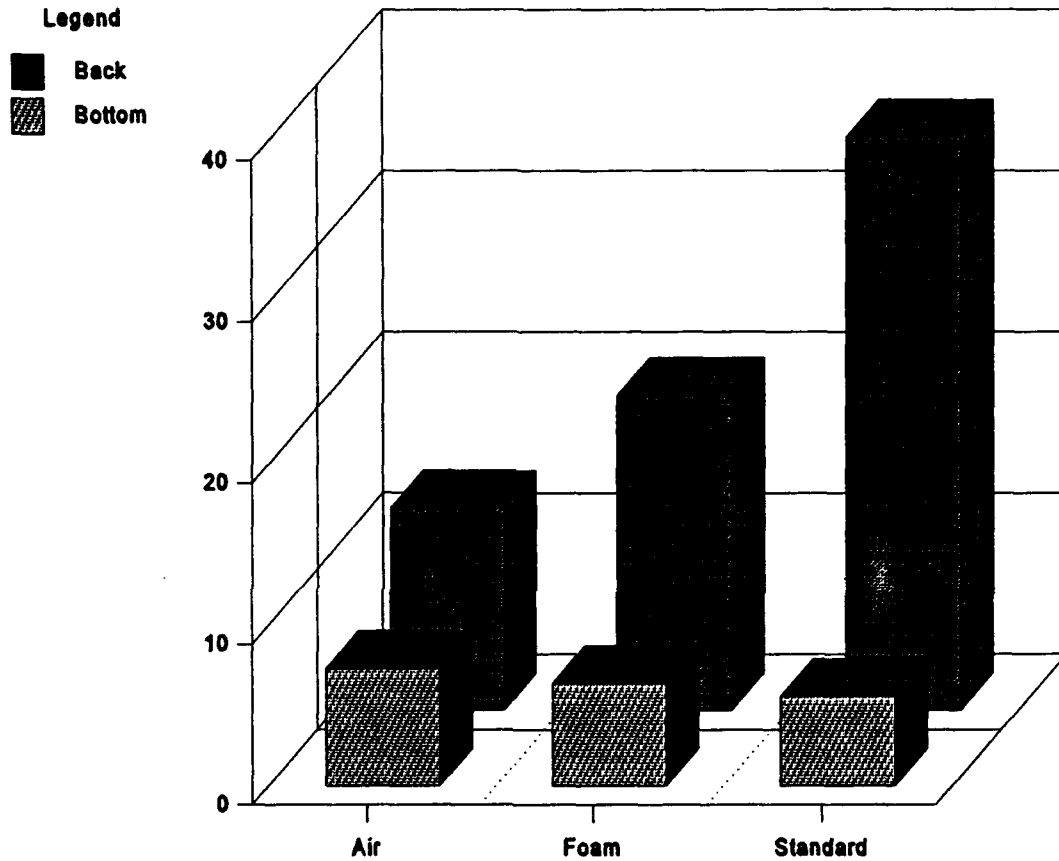


Figure 5. Low frequency integrated response for the seat back and seat bottom. Note that a positive response indicates an amplification.

High frequency integrated response

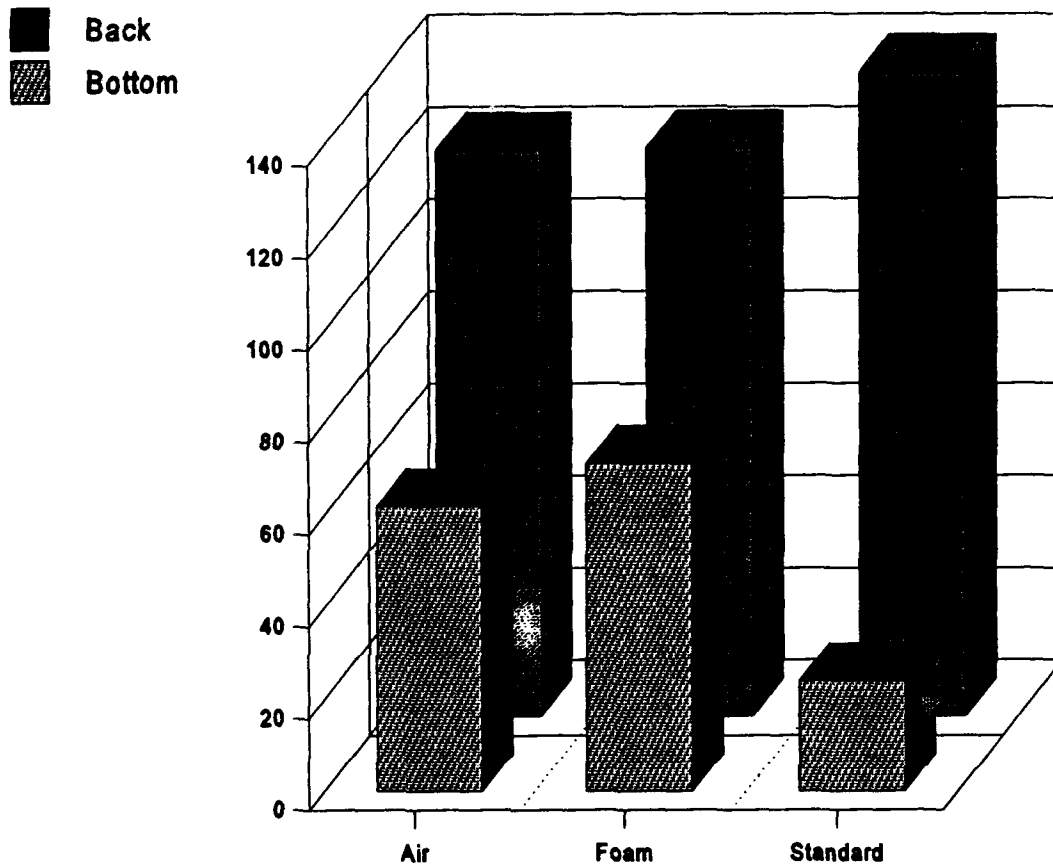


Figure 6. High frequency integrated response for the seat back and seat bottom. Note that a positive response indicates an attenuation.

Seat bottom subjective responses

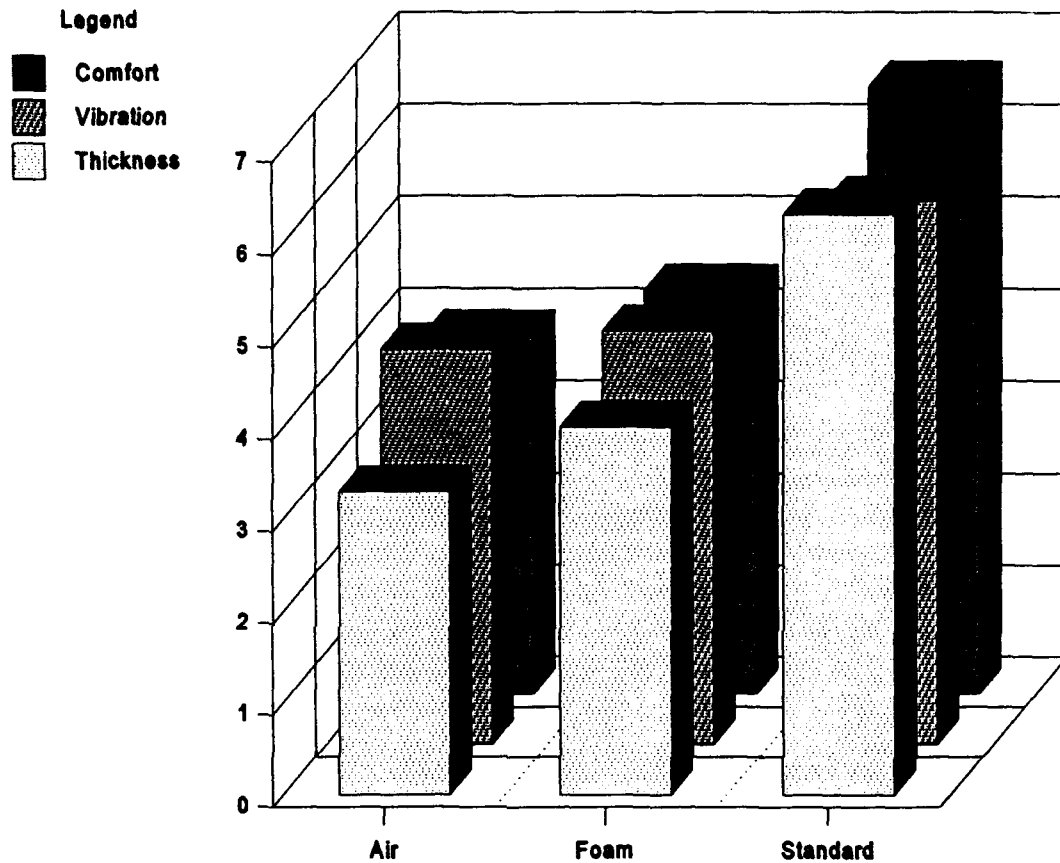


Figure 7. Subjective responses for the seat bottom. A lower score indicates a preference for the specified characteristic.

Seat back subjective responses

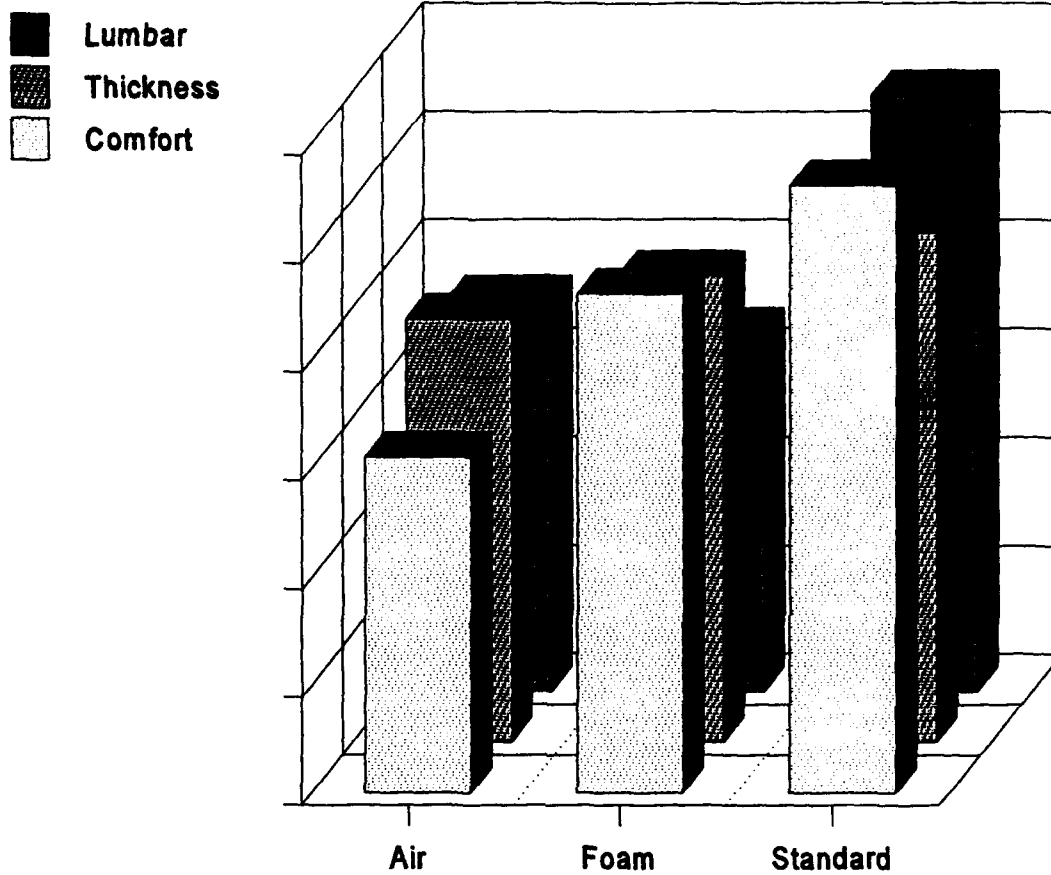


Figure 8. Subjective responses for the seat back. A lower scores indicates a preference for the specified characteristic.

Table 1.

Results of subjective evaluation of the armrests, lumbar supports, and thigh wedges.

Question	Response mean (SD)
Attachment method of the armrest to the seat bottom	4.8 (6.6)
Attachment method of the armrest to the thigh	5.0 (2.8)
Rate the interference of the <u>inflatable arm support</u> with the control stability of the cyclic	3.6 (2.1)
Rate the interference of the <u>bean bag</u> with the control stability of the cyclic	2.6 (2.3)
Rate the interference caused by the <u>thigh support wedges</u> with the operation of the cyclic	1.1 (0.4)
If you <u>do not use</u> the thigh support wedges, rate their interference (when stowed) with the operation of the cyclic	-- (--)
If you <u>do not use</u> the thigh support wedges, rate their interference (when stowed) with the seat height adjustment	-- (--)
Lumbar support: inflatable fixed	3.3 (2.1)
Lumbar support: inflatable adjustable	2.9 (3.5)
Lumbar support: adjustable foam	5.7 (1.4)
Armrest: bean bag	3.0 (2.4)
Armrest: foam	4.0 (1.9)

Appendix A.

List of manufacturers.

Accelerometers:

Bruel & Kjaer Instruments
185 Forest Street
Marlborough, MA 01752

Charge amplifiers:

Kistler Instrument Corporation
75 John Glenn Drive
Amherst, NY 14120

Windows & DOS:

MicroSoft Corporation
16011 NE 36th Way
P.O. Box 97107
Redmond, WA 98073-9717

Signal Processing Software:

HEM Data Corporation
17336 West 12 Mile Road
Southfield, MI 48076-2123

Tape recorder/playback:

TEAC Corporation of America
7733 Telegraph Road
Montebello, CA 90640

A/D Conversion PC card:

Keithly-Metrabyte Data Acquisition
440 Myles Standish Blvd
Tanton, MA 02780

Analog filters PC card:

Onsite Instruments, Inc.
855 Maude Avenue, #2
Mountain View, CA 94043

Statistical software:

Stystat, Inc.
1800 Sherman Avenue
Evanston, IL 60210

Appendix B.

List of contact addresses.

Commander
Aviation Applied Technology Directorate
ATTN: AMSAT-R-TV (Kevin Nolan)
Fort Eustis, VA, 23604

LME, Inc.
ATTN: Mr. Barry Shope
P. O. Box 6637
201 Defense Highway
Annapolis, MD 21401

Appendix C.

Medical screening questionnaire.

1. Name _____
Last First MI
2. SSN: _____
3. Date of Birth: _____
4. What was the date of your last medical (physical) examination? _____
5. What was the type of physical examination given?
Class __I__ __IA__ __II__ __III__ Army Entrance Physical __Other__
Don't Know
6. Do you have, or have you ever had, any of the following medical problems?

	Yes/No
a. High blood pressure	____
b. Other heart problems	____
c. Recent broken bone (within last 6 months)	____
d. Muscle spasm	____
e. Back pain	____
f. Sprained or strained neck	____
g. Arthritis	____
h. Episodes of dizziness	____
i. Episodes of muscle weakness or paralysis	____
j. Headaches	____
k. Hormonal or glandular	____
l. Whip lash	____
7. Physical activities:
 - a. Are you actively engaged in any physical training program?
Yes No
If so, how many hours per week do you spend in the following activities?

Run or jog	____	hours
Swim	____	hours
Tennis	____	hours
Softball	____	hours
Work with weights	____	hours
Football	____	hours
Basketball	____	hours
Others	____	hours

Describe: _____

b. How many hours have you flown in a helicopter in the last month?

Type of aircraft? ☐ UH-1 ☐ UH-60 ☐ OH-58 ☐ AH-64
☐ CH-47 ☐ Other

8. Do you wear glasses or contact lenses to correct your vision?
☐ Yes ☐ No

If so, please remember to wear them during this testing.

The above subject exhibits no evidence of medical conditions that could be adversely affected by participating this research protocol.








Medical Monitor

Date

Appendix D.

Anthropometric measurements.

Dimension Descriptions	Design Values		
	Minimum	Mean	Maximum
12 BIDELTOID BREADTH: The maximum horizontal distance between the lateral margins of the upper arms and the deltoid muscles.	42.80 cm	49.57 cm	57.30 cm
27 BUTTOCK-POPLITEAL LENGTH: The horizontal distance between a buttock plate placed at the most posterior point on either buttock and the back of the knee.	44.40 cm	50.26 cm	57.70 cm
31 CERVICAL HEIGHT, SITTING: The vertical distance between a sitting surface and the cervicale landmark on the spine at the base of the neck.	59.00 cm	68.89 cm	76.50 cm
38 CROTCH HEIGHT: The vertical distance between the standing surface and the crotch.	73.00 cm	84.18 cm	95.50 cm
49 EYE HEIGHT, SITTING: The vertical distance between a sitting surface and the ectocanthus landmark on the outer corner of the right eye.	70.70 cm	80.99 cm	90.30 cm
55 FUNCTIONAL LEG LENGTH: The straight-line distance between the plane of the bottom of the right foot with the leg extended and the back of the body of a seated subject.	98.10 cm	108.73 cm	122.50 cm
66 HIP BREADTH, SITTING: The distance between the lateral points of the hips of thighs.	31.90 cm	37.18 cm	45.30 cm
93 SITTING HEIGHT: The vertical distance between a sitting surface and the tip of the head.	81.90 cm	92.95 cm	102.10 cm
99 STATURE: The vertical distance from a standing surface to the top of the head.	157.90 cm	177.10 cm	194.10 cm
106 THUMB TIP REACH: The horizontal distance from a back wall to the tip of the right thumb.	70.50 cm	80.48 cm	92.60 cm
124 WEIGHT: Measure of heaviness or mass of subject.	56.90 kg	79.97 kg	113.60 kg

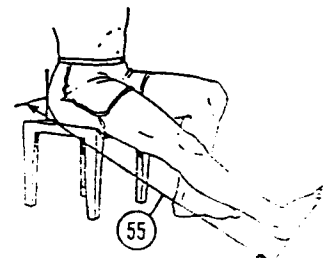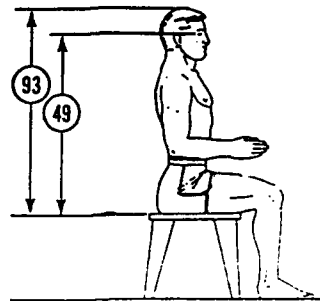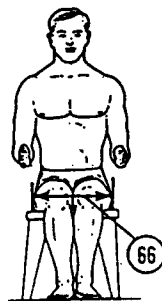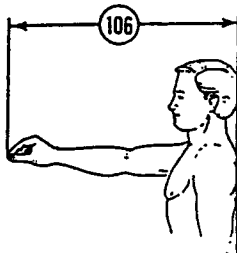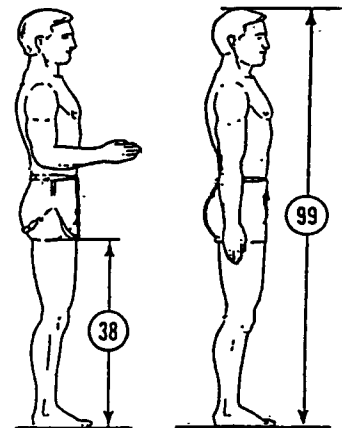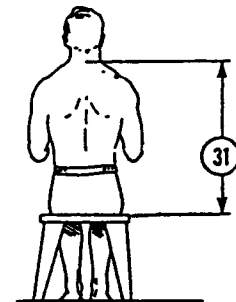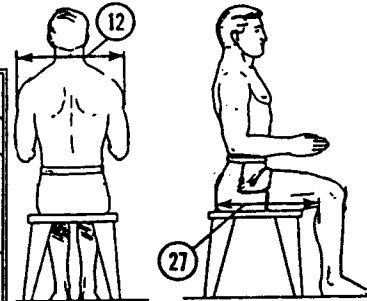

Subject number: _____

Date: _____

Subject's measurements.

Mean

Bideltoid breadth: _____	cm	49.57 cm
Buttock-popliteal length: _____	cm	50.26 cm
Cervicale height, sitting: _____	cm	68.89 cm
Crotch height: _____	cm	84.14 cm
Eye height, sitting: _____	cm	80.99 cm
Functional leg length: _____	cm	108.73 cm
Hip breadth, sitting: _____	cm	37.18 cm
Sitting height: _____	cm	92.95 cm
Stature: _____	cm	177.10 cm
Thumbtip reach: _____	cm	80.48 cm
Weight: _____	kg	79.97 kg

Appendix E.

Preride questionnaire.

Apache seat cushion study - Experience survey.

1.
Flight experience: How many
hours do you have in the
following categories?

Total rotary-wing _____
AH-64 _____
AH-64 past 90 days _____

2.
Do you have any history of
back pain injuries or back
problems that are NOT related
to flying?

No.
Yes.

If yes, describe.

3.
Do you have any back
discomfort that IS related to
flying?

No.
Yes.

If yes describe:

Aircraft:

Frequency:

Location of discomfort:

Duration of discomfort:

4. What problems have you noticed in the AH-64 seat cushion that may be corrected with a new seat cushion?

Cushion characteristics	Rating for seat bottom:						
	Too much			About right			Too little
Contour at buttocks							
Contour at inner knee							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat pan angle (too much = slide out)							
Vibration absorption							
Add your own criteria for the seat bottom cushion:							

Question 4 (Continued).

Cushion characteristics	Rating for seat back.						
	Too much			About right			Too little
Contour at lower back							
Contour at upper back							
Location of lumbar support (too much = too high)							
Thickness of lumbar support							
Location of headrest (too much = too high)							
Thickness of headrest							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat back angle (too much = leaning back)							
Vibration absorption							
Add your own criteria for the seat bottom cushion:							

5. If you designed a new seat cushion for the AH-64, what features would you change or include?

Cushion characteristics	Rating for seat bottom:						
	Add a lot more			About right			Take a lot out
Contour at buttocks							
Contour at inner knee							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat pan angle (add more = knees lower)							
Vibration absorption							
Add your own criteria for the seat bottom cushion:							

Question 5 (Continued).

Cushion characteristics	Rating for seat back.						
	Add a lot more			About right			Take a lot out
Contour at lower back							
Contour at upper back							
Location of lumbar support (add more = make higher)							
Thickness of lumbar support							
Location of headrest (add more = make higher)							
Thickness of headrest							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat back angle (add more = lean back)							
Vibration absorption							
Add your own criteria for the seat back cushion:							

Appendix F.

Apache seat cushion study - postride survey.

Subject number _____

You were just exposed to a candidate seat cushion. Please rate the overall performance of that seat cushion.

Cushion characteristics	Rating for seat bottom:						
	Too much			About right			Too little
Contour at buttocks							
Contour at inner knee							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat pan angle (too much = slide out)							
Vibration absorption							
Overall comfort (change your rating here): Too much = very good Too little = very poor							
Add your own criteria for the seat bottom cushion:							

Postride survey (Continued).

Cushion characteristics	Rating for seat back.						
	Too much			About right			Too little
Contour at lower back							
Contour at upper back							
Location of lumbar support (add more = make higher)							
Thickness of lumbar support							
Location of headrest (add more = make higher)							
Thickness of headrest							
Overall thickness							
Length							
Width							
Firmness							
Covering material coarseness							
Covering material thickness							
Air circulation							
Hotness							
Seat back angle (too much = lean back)							
Vibration absorption							
Overall comfort (change your rating here) Too much = very good Too little = Very poor							
Add your own criteria for the seat back cushion:							

Appendix G.

Interference questionnaire.

Cushion characteristic	Rating						
	Like very much			Indif- fer- ent			Dis- like
Attachment method of the armrest to the seat bottom cushion							
Attachment method of the armrest to the thigh							

What is your preferred location for the thigh support inflator
bulb? _____ Right side of seat bucket _____ Left side of seat
bucket _____ Other: _____

What is your preferred location for the lumbar support inflator
bulb? _____ Right side of seat bucket _____ Left side of seat
bucket _____ Other: _____

Cushion characteristic	Rating						
	No inter- fer- ence			Minor but toler- able			Un- accept- able
Rate the interference of the <u>inflatable arm support</u> with the control stability of the cyclic							
Rate the interference of the <u>"bean bag" arm support</u> with the control stability of the cyclic							
Rate the interference caused by the <u>thigh support wedges</u> with the operation of the cyclic							
If you <u>do not use</u> the thigh support wedges, rate their interference (when stowed) with the operation of the cyclic							
If you <u>do not use</u> the thigh support wedges, rate their interference (when stowed) with the seat height adjustment							

You have completed an independent evaluation of two candidate seat cushion sets along with the standard Apache seat cushion set. We would now like to know how you would compare the lumbar supports and the arm rests against each other. We will introduce a third candidate seat cushion at this time with an integral inflatable lumbar support. The lumbar supports you will compare are:

- inflatable fixed
- inflatable adjustable
- foam adjustable

Similarly, we have three arm rests that we would like you to compare to each other. The three arm rests are:

- bean bag
- inflatable
- foam

Please let us know if you would like to see the equipment, or try them out on the seat, without ride motion, to help you make your evaluation.

Cushion accessories	Rating						
	Like very much			Indifferent			Dislike
Lumbar supports:							
Inflatable fixed							
Inflatable adjustable							
Adjustable foam							
Armrests:							
Bean bag							
Inflatable							
Foam							

Appendix H.

Data tables.

Table 1.

Low frequency integrated response for the seat back and seat bottom. Note that a positive response indicates an amplification. Standard deviations given in parenthesis.

Cushion location	Cushion type		
	Air	Foam	Standard
Back	12.3(6.9)	19.6(7.5)	35.6(8.1)
Bottom	7.3(3.1)	6.3(5.0)	5.6(2.8)

Table 2.

High frequency inetgrated response for the seat back and seat bottom. Note that a positive response indicates an attenuation. Standard deviations given in parenthesis.

Cushion location	Cushion type		
	Air	Foam	Standard
Back	122.9(70.8)	123.3(111.6)	139.7(56.4)
Bottom	61.9(39.9)	71.3(33.5)	24.1(18.5)

Table 3.

Subjective responses for the seat bottom. A lower score indicates a preference for the specified characteristic. Standard deviations given in parenthesis.

Cushion characteristic	Cushion type		
	Air	Foam	Standard
Comfort	3.9(0.4)	4.4(1.3)	6.6(0.7)
Vibration	4.3(1.3)	4.5(1.1)	5.9(1.1)
Thickness	3.3(2.0)	4.0(2.2)	6.3(1.5)

Table 4.

Subjective responses for the seat bottom. A lower score indicates a preference for the specified characteristic. Standard deviations given in parenthesis.

Cushion characteristic	Cushion type		
	Air	Foam	Standard
Comfort	3.6(1.1)	3.3(1.7)	5.5(1.1)
Vibration	3.9(0.4)	4.3(0.8)	4.7(0.9)
Thickness	3.1(1.4)	4.6(1.5)	5.6(1.4)

Initial distribution

Commander, U.S. Army Natick Research,
Development and Engineering Center
ATTN: SATNC-MIL (Documents
Librarian)
Natick, MA 01760-5040

Library
Naval Submarine Medical Research Lab
Box 900, Naval Sub Base
Groton, CT 06349-5900

Chairman
National Transportation Safety Board
800 Independence Avenue, S.W.
Washington, DC 20594

Executive Director, U.S. Army Human
Research and Engineering Directorate
ATTN: Technical Library
Aberdeen Proving Ground, MD 21005

Commander
10th Medical Laboratory
ATTN: Audiologist
APO New York 09180

Commander
Man-Machine Integration System
Code 602
Naval Air Development Center
Warminster, PA 18974

Naval Air Development Center
Technical Information Division
Technical Support Detachment
Warminster, PA 18974

Commander
Naval Air Development Center
ATTN: Code 602-B
Warminster, PA 18974

Commanding Officer, Naval Medical
Research and Development Command
National Naval Medical Center
Bethesda, MD 20814-5044

Commanding Officer
Armstrong Laboratory
Wright-Patterson
Air Force Base, OH 45433-6573

Deputy Director, Defense Research
and Engineering
ATTN: Military Assistant
for Medical and Life Sciences
Washington, DC 20301-3080

Director
Army Audiology and Speech Center
Walter Reed Army Medical Center
Washington, DC 20307-5001

Commander, U.S. Army Research
Institute of Environmental Medicine
Natick, MA 01760

Commander/Director
U.S. Army Combat Surveillance
and Target Acquisition Lab
ATTN: SFAE-IEW-JS
Fort Monmouth, NJ 07703-5305

Director
Federal Aviation Administration
FAA Technical Center
Atlantic City, NJ 08405

Commander, U.S. Army Test
and Evaluation Command
ATTN: AMSTE-AD-H
Aberdeen Proving Ground, MD 21005

Naval Air Systems Command
Technical Air Library 950D
Room 278, Jefferson Plaza II
Department of the Navy
Washington, DC 20361

Director
U.S. Army Ballistic
Research Laboratory
ATTN: DRXBR-OD-ST Tech Reports
Aberdeen Proving Ground, MD 21005

Commander
U.S. Army Medical Research
Institute of Chemical Defense
ATTN: SGRD-UV-AO
Aberdeen Proving Ground,
MD 21010-5425

Commander
USAMRDALC
ATTN: SGRD-RMS
Fort Detrick, Frederick, MD 21702-5012

Director
Walter Reed Army Institute of Research
Washington, DC 20307-5100

HQ DA (DASG-PSP-O)
5109 Leesburg Pike
Falls Church, VA 22041-3258

Harry Diamond Laboratories
ATTN: Technical Information Branch
2800 Powder Mill Road
Adelphi, MD 20783-1197

U.S. Army Materiel Systems
Analysis Agency
ATTN: AMXSY-PA (Reports Processing)
Aberdeen Proving Ground
MD 21005-5071

U.S. Army Ordnance Center
and School Library
Simpson Hall, Building 3071
Aberdeen Proving Ground, MD 21005

U.S. Army Environmental
Hygiene Agency
ATTN: HSHB-MO-A
Aberdeen Proving Ground, MD 21010

Technical Library Chemical Research
and Development Center
Aberdeen Proving Ground, MD
21010-5423

Commander
U.S. Army Medical Research
Institute of Infectious Disease
ATTN: SGRD-UIZ-C
Fort Detrick, Frederick, MD 21702

Director, Biological
Sciences Division
Office of Naval Research
600 North Quincy Street
Arlington, VA 22217

Commander
U.S. Army Materiel Command
ATTN: AMCDE-XS
5001 Eisenhower Avenue
Alexandria, VA 22333

Commandant
U.S. Army Aviation
Logistics School ATTN: ATSQ-TDN
Fort Eustis, VA 23604

Headquarters (ATMD)
U.S. Army Training
and Doctrine Command
ATTN: ATBO-M
Fort Monroe, VA 23651

IAF Liaison Officer for Safety
USAF Safety Agency/SEFF
9750 Avenue G, SE
Kirtland Air Force Base
NM 87117-5671

Naval Aerospace Medical
Institute Library
Building 1953, Code 03L
Pensacola, FL 32508-5600

Command Surgeon
HQ USCENTCOM (CCSG)
U.S. Central Command
MacDill Air Force Base, FL 33608

Air University Library
(AUL/LSE)
Maxwell Air Force Base, AL 36112

U.S. Air Force Institute
of Technology (AFIT/LDEE)
Building 640, Area B
Wright-Patterson
Air Force Base, OH 45433

Henry L. Taylor
Director, Institute of Aviation
University of Illinois-Willard Airport
Savoy, IL 61874

Chief, National Guard Bureau
ATTN: NGB-ARS
Arlington Hall Station
111 South George Mason Drive
Arlington, VA 22204-1382

Commander
U.S. Army Aviation and Troop Command
ATTN: AMSAT-R-ES
4300 Goodfellow Bouvelard
St. Louis, MO 63120-1798

U.S. Army Aviation and Troop Command
Library and Information Center Branch
ATTN: AMSAV-DIL
4300 Goodfellow Boulevard
St. Louis, MO 63120

Federal Aviation Administration
Civil Aeromedical Institute
Library AAM-400A
P.O. Box 25082
Oklahoma City, OK 73125

Commander
U.S. Army Medical Department
and School
ATTN: Library
Fort Sam Houston, TX 78234

Commander
U.S. Army Institute of Surgical Research
ATTN: SGRD-USM
Fort Sam Houston, TX 78234-6200

AAMRL/HEX
Wright-Patterson
Air Force Base, OH 45433

Product Manager
Aviation Life Support Equipment
ATTN: SFAE-AV-LSE
4300 Goodfellow Boulevard
St. Louis, MO 63120-1798

Commander and Director
USAE Waterways Experiment Station
ATTN: CEWES-IM-MI-R,
CD Department
3909 Halls Ferry Road
Vicksburg, MS 39180-6199

Commanding Officer
Naval Biodynamics Laboratory
P.O. Box 24907
New Orleans, LA 70189-0407

Assistant Commandant
U.S. Army Field Artillery School
ATTN: Morris Swott Technical Library
Fort Sill, OK 73503-0312

Mr. Peter Seib
Human Engineering Crew Station
Box 266
Westland Helicopters Limited
Yeovil, Somerset BA20 2YB UK

U.S. Army Dugway Proving Ground
Technical Library, Building 5330
Dugway, UT 84022

U.S. Army Yuma Proving Ground
Technical Library
Yuma, AZ 85364

AFFTC Technical Library
6510 TW/TSTL
Edwards Air Force Base,
CA 93523-5000

Commander
Code 3431
Naval Weapons Center
China Lake, CA 93555

Aeromechanics Laboratory
U.S. Army Research and Technical Labs
Ames Research Center, M/S 215-1
Moffett Field, CA 94035

Sixth U.S. Army
ATTN: SMA
Presidio of San Francisco, CA 94129

Commander
U.S. Army Aeromedical Center
Fort Rucker, AL 36362

Strughold Aeromedical Library
Document Service Section
2511 Kennedy Circle
Brooks Air Force Base, TX 78235-5122

Dr. Diane Damos
Department of Human Factors
ISSM, USC
Los Angeles, CA 90089-0021

U.S. Army White Sands
Missile Range
ATTN: STEWS-IM-ST
White Sands Missile Range, NM 88002

U.S. Army Aviation Engineering
Flight Activity
ATTN: SAVTE-M (Tech Lib) Stop 217
Edwards Air Force Base, CA 93523-5000

Ms. Sandra G. Hart
Ames Research Center
MS 262-3
Moffett Field, CA 94035

Commander
USAMRDALC
ATTN: SGRD-UMZ
Fort Detrick, Frederick, MD 21702-5009

Commander
U.S. Army Health Services Command
ATTN: HSOP-SO
Fort Sam Houston, TX 78234-6000

U. S. Army Research Institute
Aviation R&D Activity
ATTN: PERI-IR
Fort Rucker, AL 36362

Commander
U.S. Army Safety Center
Fort Rucker, AL 36362

U.S. Army Aircraft Development
Test Activity
ATTN: STEBG-MP-P
Cairns Army Air Field
Fort Rucker, AL 36362

Commander
USAMRDALC
ATTN: SGRD-PLC (COL R. Gifford)
Fort Detrick, Frederick, MD 21702

TRADOC Aviation LO
Unit 21551, Box A-209-A
APO AE 09777

Netherlands Army Liaison Office
Building 602
Fort Rucker, AL 36362

British Army Liaison Office
Building 602
Fort Rucker, AL 36362

Italian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Directorate of Training Development
Building 502
Fort Rucker, AL 36362

Chief
USAHEL/USAAVNC Field Office
P. O. Box 716
Fort Rucker, AL 36362-5349

Commander, U.S. Army Aviation Center
and Fort Rucker
ATTN: ATZQ-CG
Fort Rucker, AL 36362

Chief
Test & Evaluation Coordinating Board
Cairns Army Air Field
Fort Rucker, AL 36362

Canadian Army Liaison Office
Building 602
Fort Rucker, AL 36362

German Army Liaison Office
Building 602
Fort Rucker, AL 36362

French Army Liaison Office
USAAVNC (Building 602)
Fort Rucker, AL 36362-5021

Australian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Dr. Garrison Rapmund
6 Burning Tree Court
Bethesda, MD 20817

Commandant, Royal Air Force
Institute of Aviation Medicine
Farnborough, Hampshire GU14 6SZ UK

Defense Technical Information
Cameron Station, Building 5
Alexandra, VA 22304-6145

Commander, U.S. Army Foreign Science
and Technology Center
AIFRTA (Davis)
220 7th Street, NE
Charlottesville, VA 22901-5396

Commander
Applied Technology Laboratory
USARTL-ATCOM
ATTN: Library, Building 401
Fort Eustis, VA 23604

Commander, U.S. Air Force
Development Test Center
101 West D Avenue, Suite 117
Eglin Air Force Base, FL 32542-5495

Aviation Medicine Clinic
TMC #22, SAAF
Fort Bragg, NC 28305

Dr. H. Dix Christensen
Bio-Medical Science Building, Room 753
Post Office Box 26901
Oklahoma City, OK 73190

Commander, U.S. Army Missile
Command
Redstone Scientific Information Center
ATTN: AMSMI-RD-CS-R
/ILL Documents
Redstone Arsenal, AL 35898

Director
Army Personnel Research Establishment
Farnborough, Hants GU14 6SZ UK

U.S. Army Research and Technology
Laboratories (AVSCOM)
Propulsion Laboratory MS 302-2
NASA Lewis Research Center
Cleveland, OH 44135

Commander
USAMRDALC
ATTN: SGRD-ZC (COL John F. Glenn)
Fort Detrick, Frederick, MD 21702-5012

Dr. Eugene S. Channing
166 Baughman's Lane
Frederick, MD 21702-4083

U.S. Army Medical Department
and School
USAMRDALC Liaison
ATTN: HSMC-FR
Fort Sam Houston, TX 78234

Dr. A. Kornfield
895 Head Street
San Francisco, CA 94132-2813

NVESD
AMSEL-RD-NV-ASID-PST
(Attn: Trang Bui)
10221 Burbeck Road
Fort Belvoir, VA 22060-5806

CA Av Med
HQ DAAC
Middle Wallop
Stockbridge, Hants S020 8DY UK

Dr. Christine Schlichting
Behavioral Sciences Department
Box 900, NAVUBASE NLON
Groton, CT 06349-5900

Commander, HQ AAC/SGPA
Aerospace Medicine Branch
162 Dodd Boulevard, Suite 100
Langley Air Force Base,
VA 23665-1995

Commander
Aviation Applied Technology Directorate
ATTN: AMSAT-R-TV
Fort Eustis, VA 23604-5577

COL Yehezkel G. Caine, MD
Surgeon General, Israel Air Force
Aeromedical Center Library
P. O. Box 02166 I.D.F.
Israel

Director
Aviation Research, Development
and Engineering Center
ATTN: AMSAT-R-Z
4300 Goodfellow Boulevard
St. Louis, MO 63120-1798

Commander
USAMRDALC
ATTN: SGRD-ZB (COL C. Fred Tyner)
Fort Detrick, Frederick, MD 21702-5012

Director
Directorate of Combat Developments
ATTN: ATZQ-CD
Building 515
Fort Rucker, AL 36362