

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

Form Approved
OMB No. 0704-0188

1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE 08/15/77		3. REPORT TYPE AND DATES COVERED	
4. TITLE AND SUBTITLE WATER MONITORING AT ROCKY MOUNTAIN ARSENAL (A REVIEW OF THE 360 DEGREE MONITORING PROGRAM)				5. FUNDING NUMBERS	
6. AUTHOR(S)				8. PERFORMING ORGANIZATION REPORT NUMBER 82160R08	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) ROCKY MOUNTAIN ARSENAL (CO.) COMMERCE CITY, CO				10. SPONSORING/MONITORING AGENCY REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) DTIC ELECTE NOV 1 1994 S G D				11. SUPPLEMENTARY NOTES 18P 94-35031 	
12a. DISTRIBUTION/AVAILABILITY STATEMENT APPROVED FOR PUBLIC RELEASE; DISTRIBUTION IS UNLIMITED				13. ABSTRACT (Maximum 200 words) THIS DOCUMENT PROVIDES SUMMARY INFORMATION ON THE 360 DEGREE WATER QUALITY MONITORING PROGRAM INCLUDING HISTORY AND EVOLUTION OF THE PROJECT, THE NECESSITY OF A LONGTERM MONITORING PROGRAM, AND THE FUTURE OF THE PROGRAM.	
4. SUBJECT TERMS WATER QUALITY, CHEMICALS 24 111				15. NUMBER OF PAGES 16. PRICE CODE	
7. SECURITY CLASSIFICATION OF REPORT UNCLASSIFIED		18. SECURITY CLASSIFICATION OF THIS PAGE		19. SECURITY CLASSIFICATION OF ABSTRACT	
				20. LIMITATION OF ABSTRACT	

82160R08

~~Original~~

2ND COPY

DEPARTMENT OF THE ARMY
ROCKY MOUNTAIN ARSENAL
COMMERCE CITY, COLORADO

WATER MONITORING AT ROCKY MOUNTAIN ARSENAL
(A Review of the 360° Monitoring Program)

Rocky Mountain Arsenal
Information Center
Commerce City, Colorado

PREPARED BY:

GEOHYDROLOGY DIVISION
INSTALLATION RESTORATION DIRECTORATE

Accession For	
NTIS CRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution /	
Availability Codes	
Dist	Avail and/or Special
A-1	.

15 AUG 77

FILE COPY

TABLE OF CONTENTS

1. Introduction
2. History of Water Quality Monitoring at RMA
3. Evolution of the 360° Monitoring Program
4. Water Quality at RMA
5. Future of the 360° Monitoring Program
6. Summary
7. Appendix A - 360° Monitoring Program Sampling Schedule

ILLUSTRATIONS

- | | |
|----------|---|
| Figure 1 | 360° Water Sampling Sites |
| Figure 2 | Relative Distribution of DIMP in 360° Wells -
Second Quarter, Phase II |
| Figure 3 | Relative Distribution of DIMP in 360° Wells -
Phase I |
| Figure 4 | Relative Distribution of DCPD in 360° Wells -
Second Quarter, Phase II |
| Figure 5 | Relative Distribution of DCPD in 360° Wells -
Phase I |

TABLES

- | | |
|---------|---|
| Table 1 | Parameters for Sample Analyses |
| Table 2 | 360° Sampling Parameters |
| Table 3 | Average DIMP and DCPD in 360° Water Monitoring
Wells - Phase I |
| Table 4 | DIMP and DCPD Levels in 360° Water Monitoring
Wells - Phase II, Second Quarter |

WATER MONITORING AT ROCKY MOUNTAIN ARSENAL

1. Introduction

a. The purpose of this paper is to provide summary information on the water quality monitoring program being conducted by the IR Directorate at RMA and to examine this information in terms of future program directions. Paragraphs 2 and 3 of the paper give a brief historical review of how the water quality monitoring program came about and its evolution into its present structure. Paragraphs 4 and 5 discuss the present program, the future trends, and the direction that the program should pursue.

b. The water quality monitoring program has as its principal aim to provide information as to water quality (concentration of contaminants) at selected on-post and off-post sites in response to a Cease and Desist Order issued by the State of Colorado; to provide additional information/indicators as to water quality and water levels appropriate for use in comprehensive survey contaminant identification and migration study; and to monitor for contaminants in groundwater flowing from sources off the Arsenal on to the Arsenal. Monitoring of water quality distribution may be used as one of the inputs into simulation modeling to predict future changes of groundwater quality as control measures are implemented (i.e., north boundary containment system).

2. History of Water Quality Monitoring at RMA

a. In May of 1975, two water sampling plans were initiated at RMA. One plan was in response to a series of lawsuits against RMA and Shell Chemical Company (SCC) by residents north of the Arsenal complaining of domestic water supplies. The other plan was in response to a Cease and Desist Order issued by the State of Colorado ordering that RMA and SCC stop contaminating the State waters of Colorado. Two months later, these two plans were melded into one, resulting in the establishment of 42 sampling sites on and off the Arsenal.

b. The design and implementation of this sampling scheme was carried out in coordination with the PM-CDIR and with the cooperation of SCC and the Colorado Department of Health. It was intended that these 42 sites would be sampled on a monthly basis for the 14 parameters shown in Table 1. In Oct 75, the Colorado Department of Health detected the

presence of organic solvents and phthlate esters in isolated RMA well water samples.

c. The discovery of these organic compounds in well samples led to a major shift in the water quality monitoring program. It was felt that because these newly detected compounds are associated with materials available to the public, these contaminants detected in groundwater from RMA could come from sources off the Arsenal. The initial sampling program was restricted to the central and north part of RMA, as well as off-post to the north. In order for RMA to unequivocally declare what has been contributed to groundwater contamination, the antecedent water quality flowing on to the Arsenal had to be determined.

3. Evolution of the 360° Monitoring Program

a. The 360° water-monitoring program, which began in Jan 76, can be divided into two phases. Phase I of the program covers the period of time from the beginning of the program in January up to and including Oct 76. Phase II of the program covers the period of time since 1 Nov 76 up to the present time.

b. In Phase I of the program, 124 sampling sites, both surface and subsurface, were selected on the Arsenal. An additional 24 off-post sites, collected by the Tri-County Health Department, were also selected. Water samples from on-post were collected on a monthly basis, and analyses were by the Colorado Department of Health and SCC, as well as RMA (Table 2). The off-post samples were collected on a quarterly basis and analyzed by all three parties for the same parameters as on post.

c. In Aug 76, a review of the program was begun by PM-CDIR and RMA, with a view toward upgrading sampling procedures and methodology and upon analyzing the water sampling points with specific reference to groundwater samples. For many of the wells in use, the well bore logs were not complete; and in some instances, not maintained. In other instances, sampling wells were so close to each other as to be redundant. Sampling methods used required better quality control.

d. In terms of attempting to understand the groundwater-flow system at RMA and its relationship to contamination patterns, it is necessary to know as much as possible about the physical medium through which groundwater flows. Therefore, a good boring log of the subsurface conditions in which a well is set is necessary. Wells with multiple screens

may provide variable water quality data because of the possibility for chemical stratification. Chemical stratification in groundwater is a common phenomenon and has been known to occur at RMA on the basis of early data results from the comprehensive survey. In order to arrive at consistent data, or to show that variations are in fact occurring, it is important that the same zones are sampled each time.

e. As a result of this coordinated PM-CDIR/RMA review, several changes in the water quality monitoring program were proposed. These proposed changes were submitted to Governor Lamm's Technical Review Committee (comprised of working representatives from RMA, Colorado State Health Department, and SCC) for comment and decision. These changes were approved by all interested parties and adopted by the Technical Review Committee. The result was the implementation of Phase II of the 360° water-monitoring program at RMA on Nov 76.

f. Phase II of this program established the Geohydrology Division as the principal element responsible for collection of water samples to be submitted to the Material Analysis Lab Division (MALD), IR Directorate, for analyses. The Geohydrology Division is also responsible for analyzing the data and verifying its accuracy prior to public release. This new 360° program set up 55 well sites and 12 surface sites on the Arsenal to be sampled on a quarterly basis beginning 1 Nov 76 (Appendix A). The off-post monitoring sites stayed essentially the same, utilizing 22 wells and 10 surface sites. Figure 1 shows the distribution of on- and off-post sampling sites. The responsibility for sampling the off-post sites remains with the Tri-County Health Department. The quality parameters analyzed in Phase II remain the same as in Phase I (Table 2). In addition to collecting water quality data on wells on a quarterly basis, Phase II also sets up a monthly water-level monitoring schedule.

4. Water Quality at RMA

a. Monitoring of water quality over relatively long periods of time is necessary to establish baselines to which changes can be compared and interpreted. For example, water quality may change with seasonal variations or other periods of time during which precipitation, run-off, and infiltration vary. Large variations of some chemical constituents, particularly in groundwater occur; therefore, monitoring over a period of time to establish baseline groundwater quality is necessary for the proper interpretation of apparent changes in that water quality.

b. Evaluation of potential contamination by measuring surface water quality is subject to more variables than groundwater. This is particularly true at RMA where many of the surface sampling points only contain water at intermittent times during the year. Extended dry periods followed by precipitation or extended rainy periods significantly affect water quality because of concentration and dilution effects. Groundwater, because it is much less subject to minor variations, tends to be more useful as a measure of water quality and the changes that may take place.

c. Data from Phase I of the 360° program has not been subject to the rigorous quality control that is being used in Phase II. Therefore, Phase I data has been chosen to use principally as background or indicator data and to establish a temporary baseline until Phase II has been evaluated for a longer period of time. For comparative purposes and because they are known contaminants from Arsenal operations, DIMP and DCPD have been chosen for comparison between Phase I (Table 3) and the second quarter of Phase II (Table 4). The second quarter of Phase II (31 Jan - 25 Apr 77) is used because the data for that quarter has all been received and verified.

d. The areal distribution of DIMP and DCPD in groundwater, based on the 360° wells, is compared between Phase I and second quarter Phase II in Figures 2, 3, 4, and 5. These maps are meant only to show the relative distribution of the two contaminants and no implication is intended as to their source or the actual groundwater-flow conditions resulting in their migration. The distributions shown, however, do indicate changes in the migration pattern. The concentration of DIMP (Figure 2) appears to increase towards the northwest boundary, as compared to the monitoring period covered in Phase I (Figure 3). The distribution of DCPD between the two periods also appears to show a slight shift towards higher concentrations over a wider area (Figures 4 and 5). The simulation modeling study by the USGS (digital model study of DIMP groundwater contamination at RMA by S. G. Robson in preparation) indicated that contamination of the groundwater is not continuous but moves through the system as discrete slugs. The data shown on Figures 2, 3, 4, and 5 would seem to support this conclusion. The highest DCPD concentration is shown as a continuous plume in Figure 5 (Phase I) and appears as two discrete units in Figure 4 (second quarter, Phase II). If these phenomena of discrete contaminated slugs of groundwater do in fact occur, then the need for additional monitoring becomes absolutely

necessary. On the other hand, it may be that the monitoring program has not been in existence long enough to understand the kinds and degrees of variation that may occur naturally. It is common practice in groundwater studies to monitor water quality and water level changes over three to five years so that seasonal and other fluctuations can be accumulated and analyzed. The 360° water-monitoring program has only been in existence less than two years, and the data recorded is not sufficient to warrant any firm conclusions. In addition, the lack of a rigorous quality control program during Phase I limits the utility of that part of the data base.

e. It again must be stressed very strongly that the contamination patterns shown on these maps are based on present 360° wells. The presence or absence of other, as yet undetermined, areas of contamination is not implied. Present distribution of monitoring wells, particularly toward the northwest part of the Arsenal, is not sufficient to evaluate potential concerns regarding groundwater contamination located there. The same can be said for other parts of the Arsenal where the well distribution is sparse. Whether groundwater contamination from a source is continuous or occurs in discrete units requires both longer monitoring time and additional wells. The 360° program needs a longer period of time to establish necessary baselines. In addition, the program is being continuously evaluated and additional monitoring wells have been identified and are being installed as time and manpower permits.

5. Future of the 360° Monitoring Program

a. In terms of the northern part of the Arsenal, the extent of pollution of groundwater has been reasonably defined. Because of the Cease and Desist Order which directed attention to the north boundary area, most of the 360° wells are located in the north and central part of the Arsenal; so that other areas of contamination, if they exist, still need to be identified. The present monitoring program, in conjunction with work being done in the comprehensive survey task, will help to better define the groundwater-flow system and, in turn, identify these other areas of contamination.

b. Groundwater chemistry data, particularly from Phase I has been used in simulation modeling efforts by the USGS. The DIMP transport model developed by S. G. Robson of the USGS used Phase I data. A more recent simulation model for the pilot containment system used data in

part from Phase II. The reliability of simulation models of ground-water flow systems and its water quality are dependent upon the accuracy of the impact data and the assumptions made to calibrate the model. A more comprehensive input on water quality can only improve such a model, which can then be used as an input into contaminated source and area treatment plants.

c. Finally, any water quality treatment operations undertaken at RMA require monitoring of changes in water quality and water levels.

d. The 360° water-monitoring program will be an integral function of IR activities at RMA until contamination of water flowing under and across the Arsenal is deemed no longer to be the result of Arsenal activities. Details of the program, however, may change as the informational needs change. Sampling points may be added or deleted; and the frequency of sampling, as well as the types of analyses, will reflect changes needed in the program to provide maximum information.

6. Summary - In summary, two tasks should be examined in the immediate future as the 360° monitoring program progresses. These are as follows:

a. The requirement for future analysis so as to determine the need and specific location for a denser network of monitoring wells designed to fill in existing data gaps.

b. Evaluation of reliability of existing wells as representatives of the true character of groundwater quality and, where warranted, the upgrading of the wells.

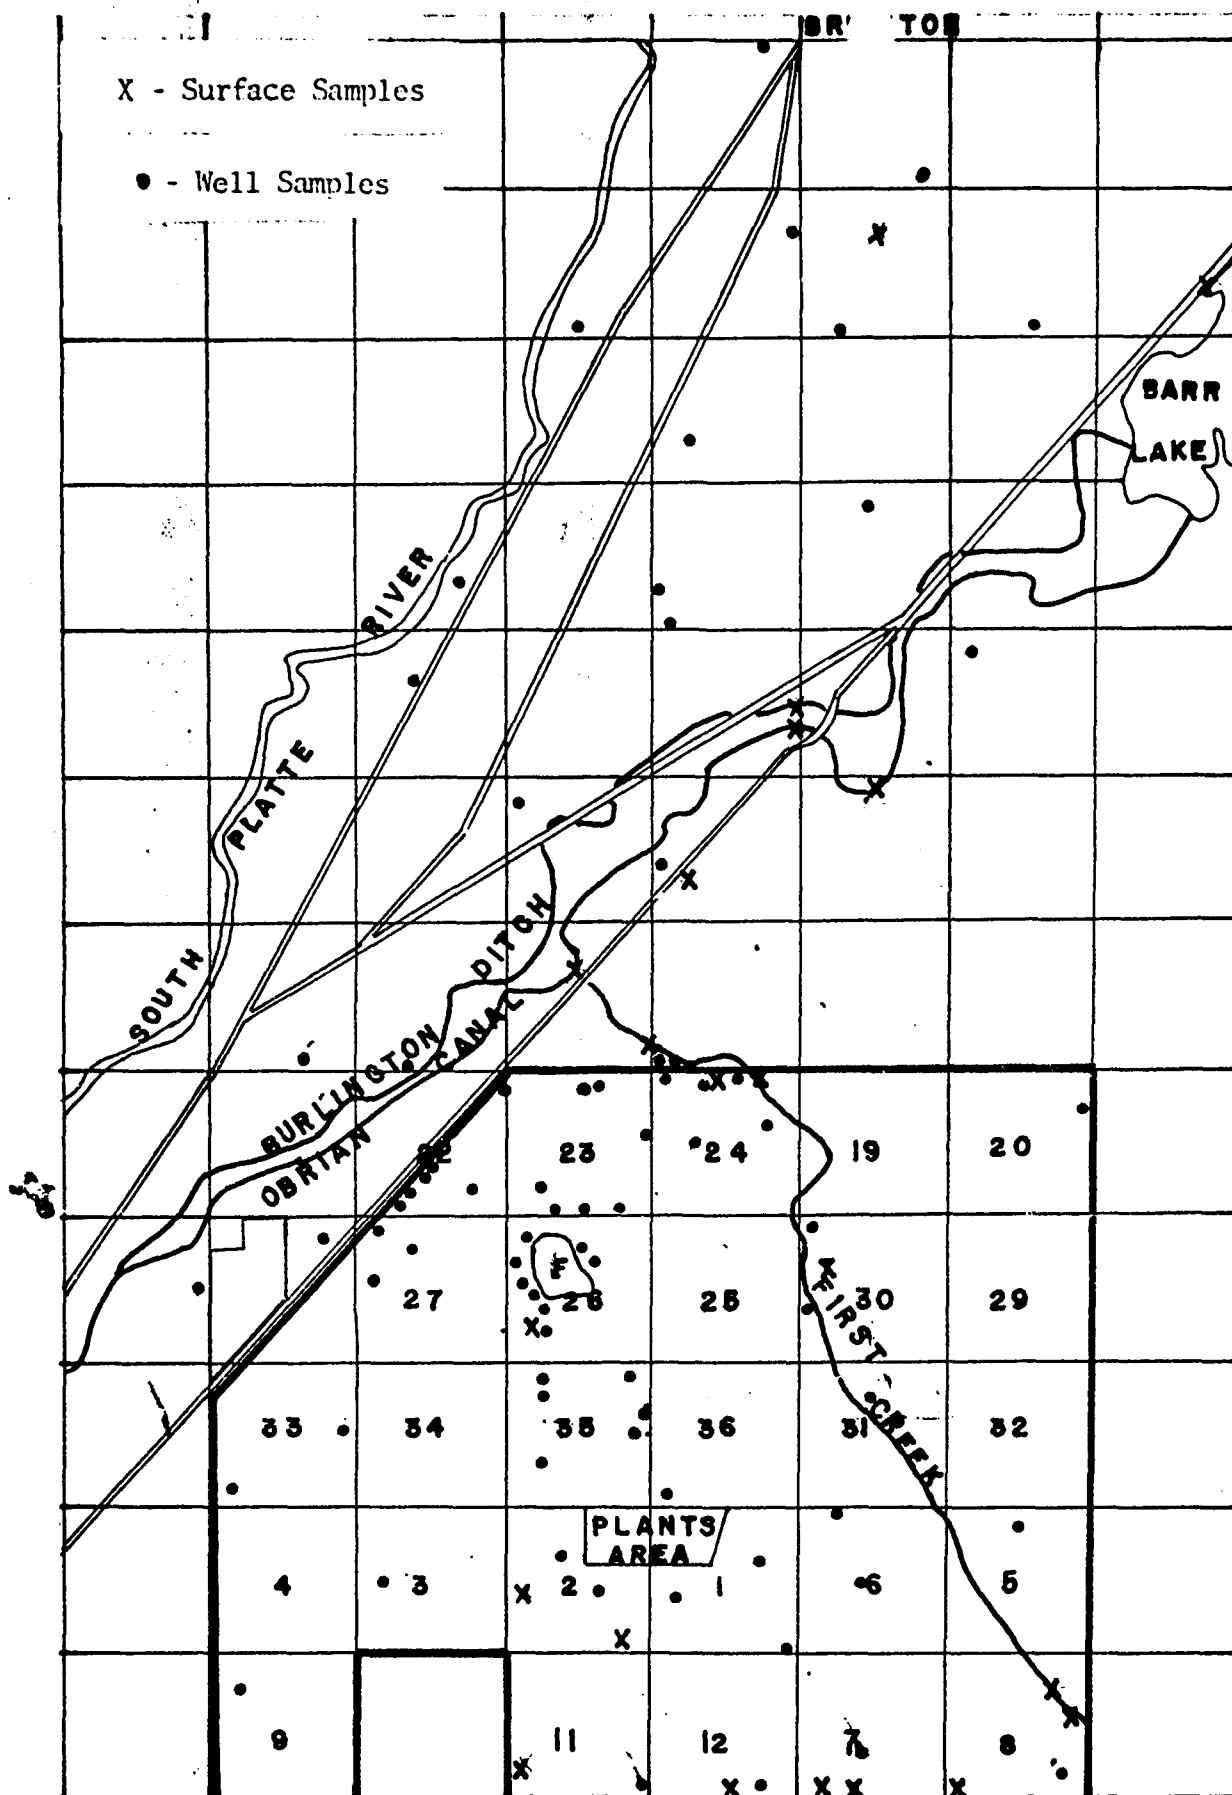


FIGURE 1 360° WATER SAMPLING SITES

FIGURE 2

RELATIVE DISTRIBUTION OF
DIMP IN 360 WELLS -
2ND QTR - PHASE II

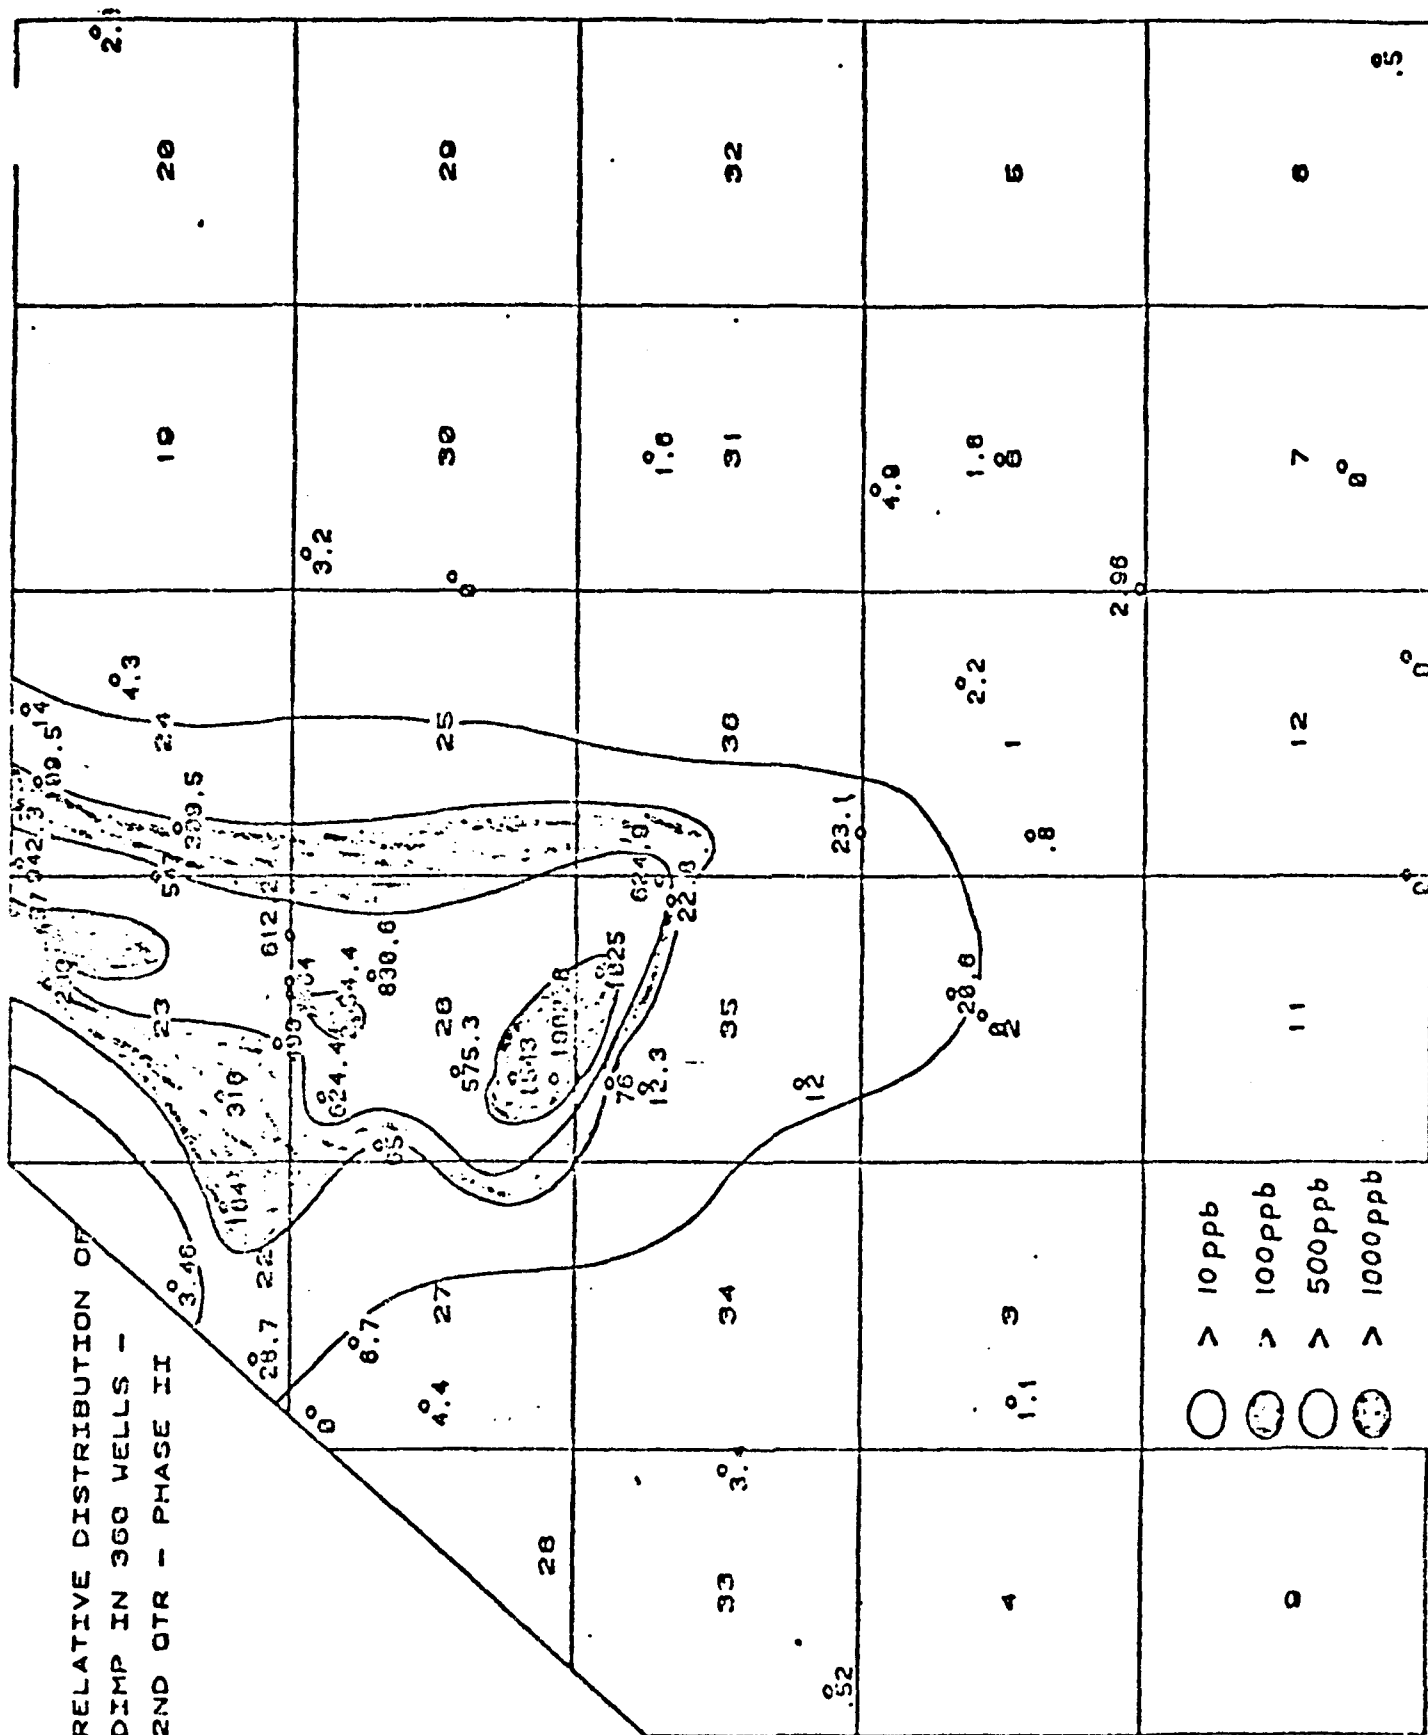


FIGURE 3

VIEWGRAPH = 3

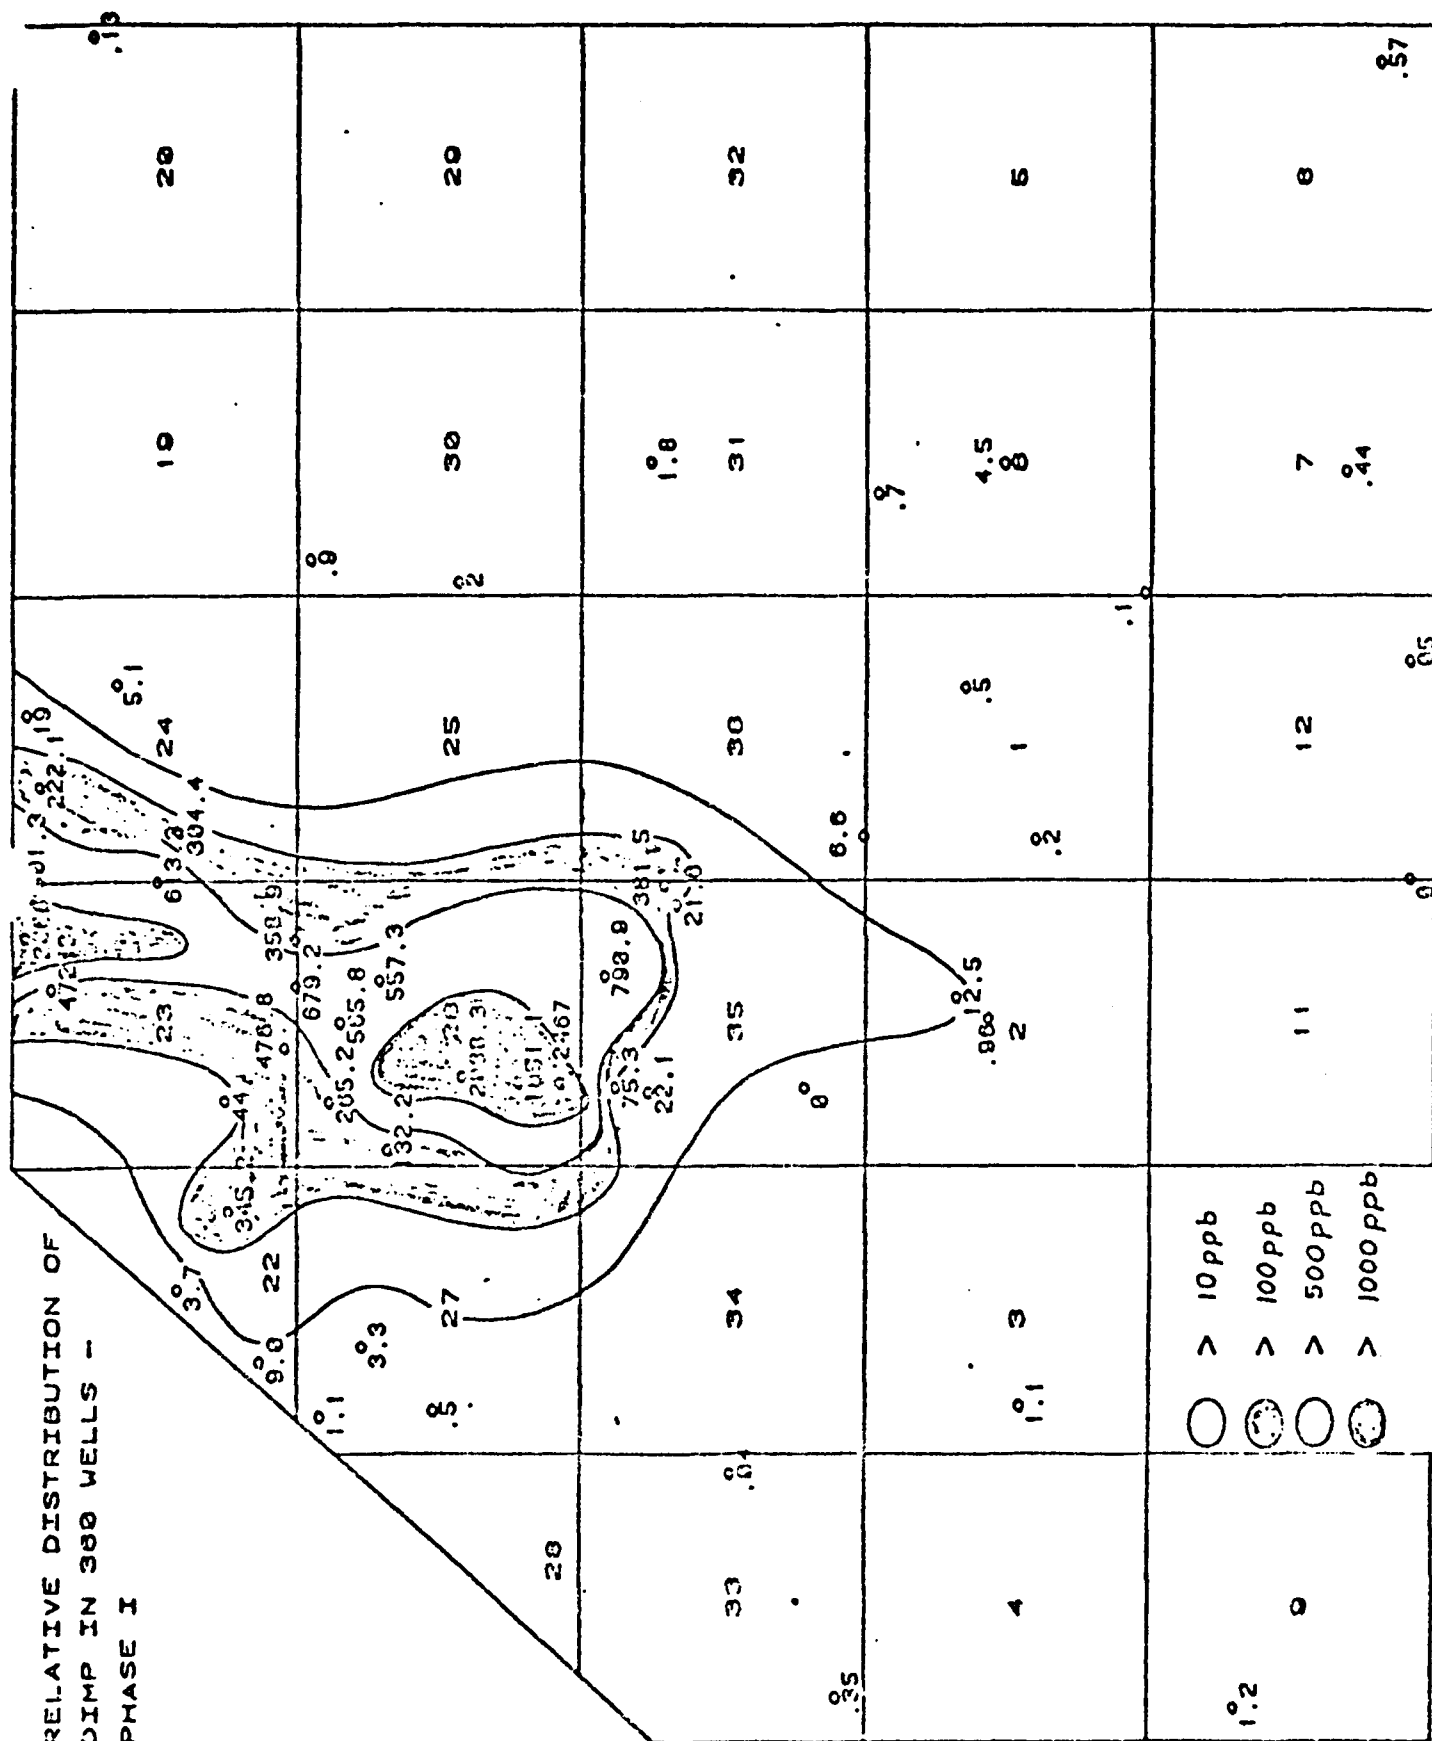


FIGURE 4

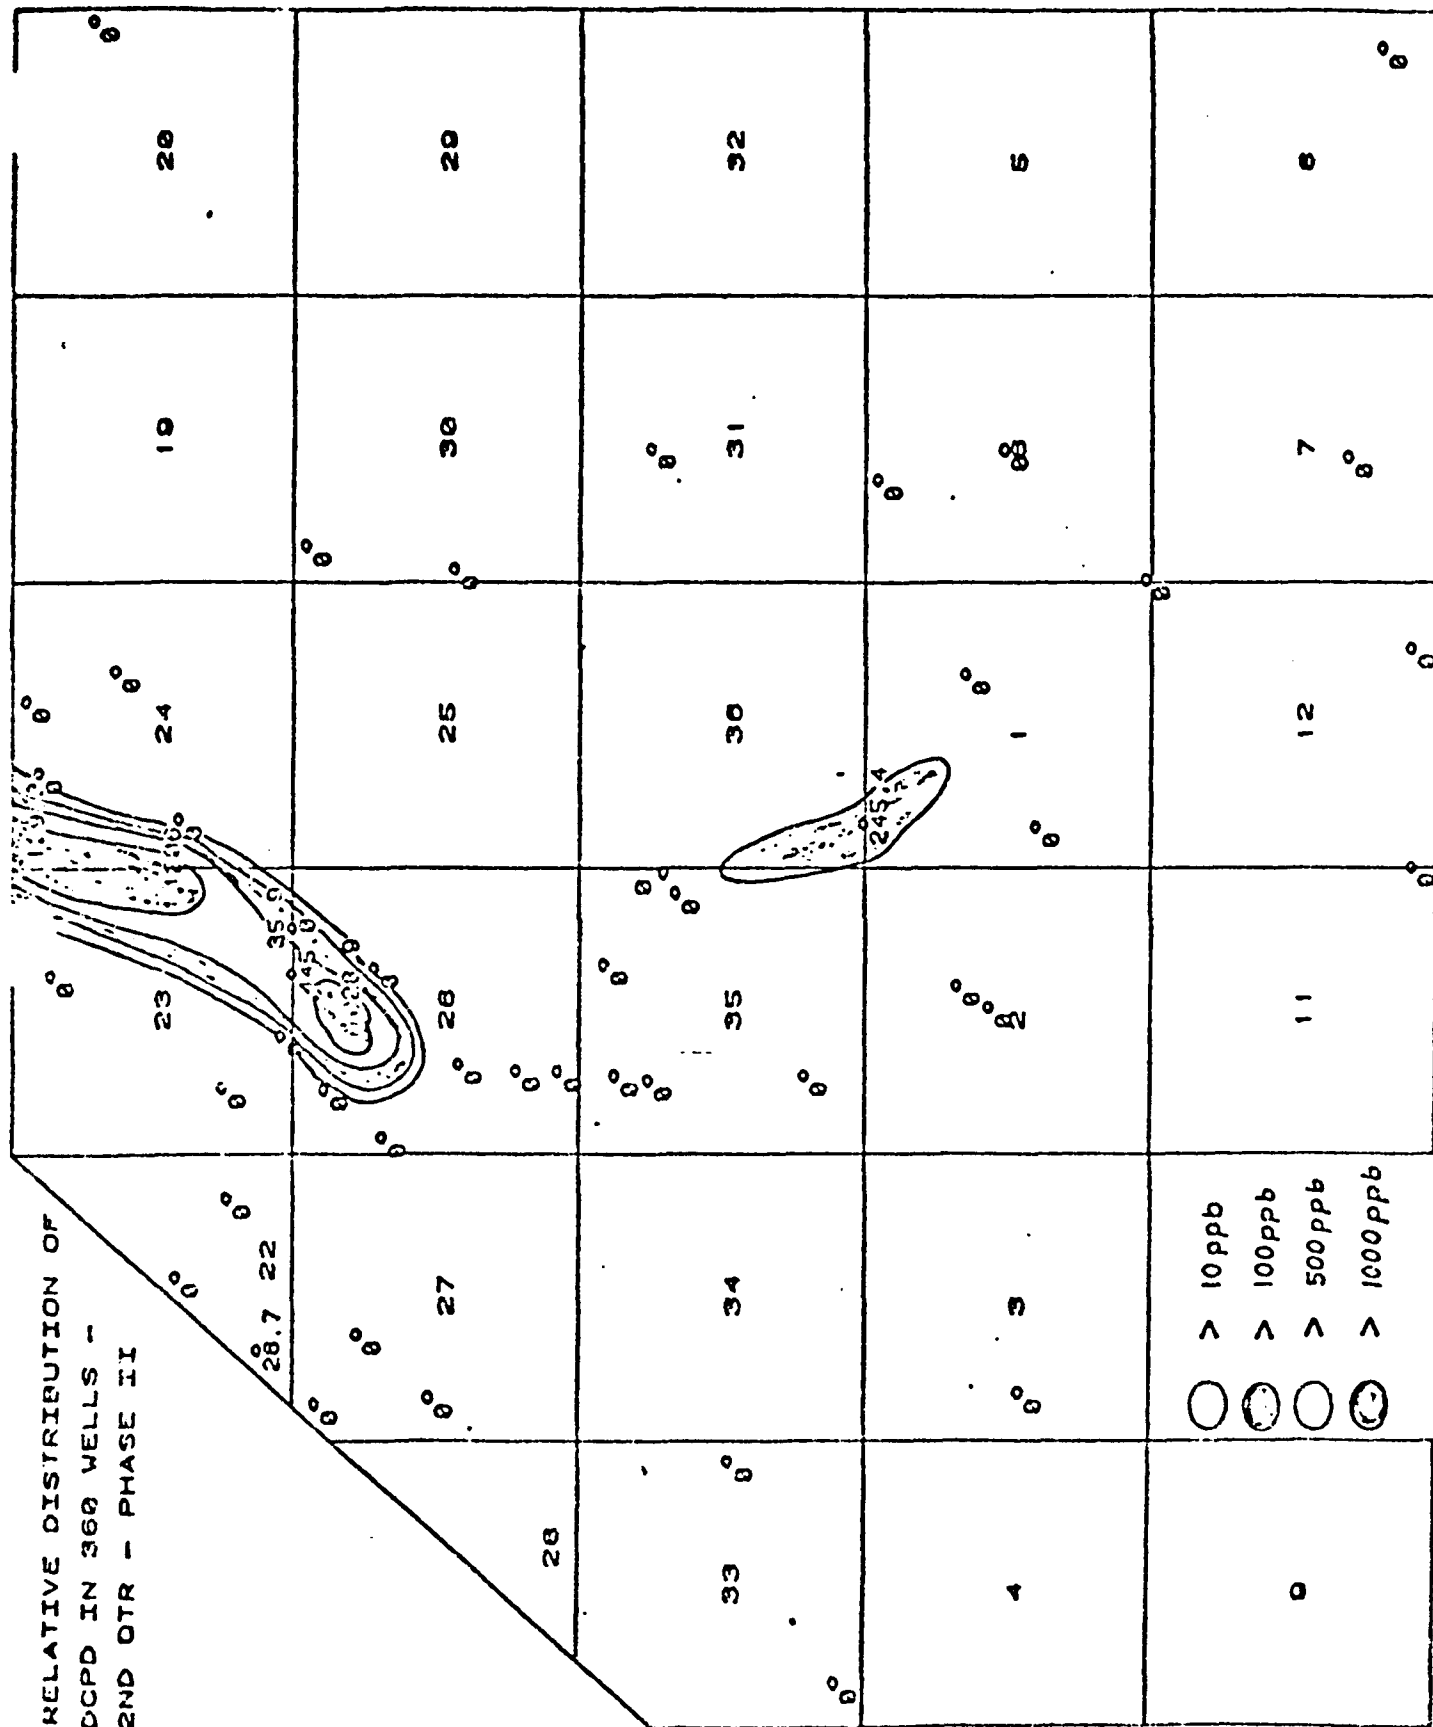


FIGURE 5

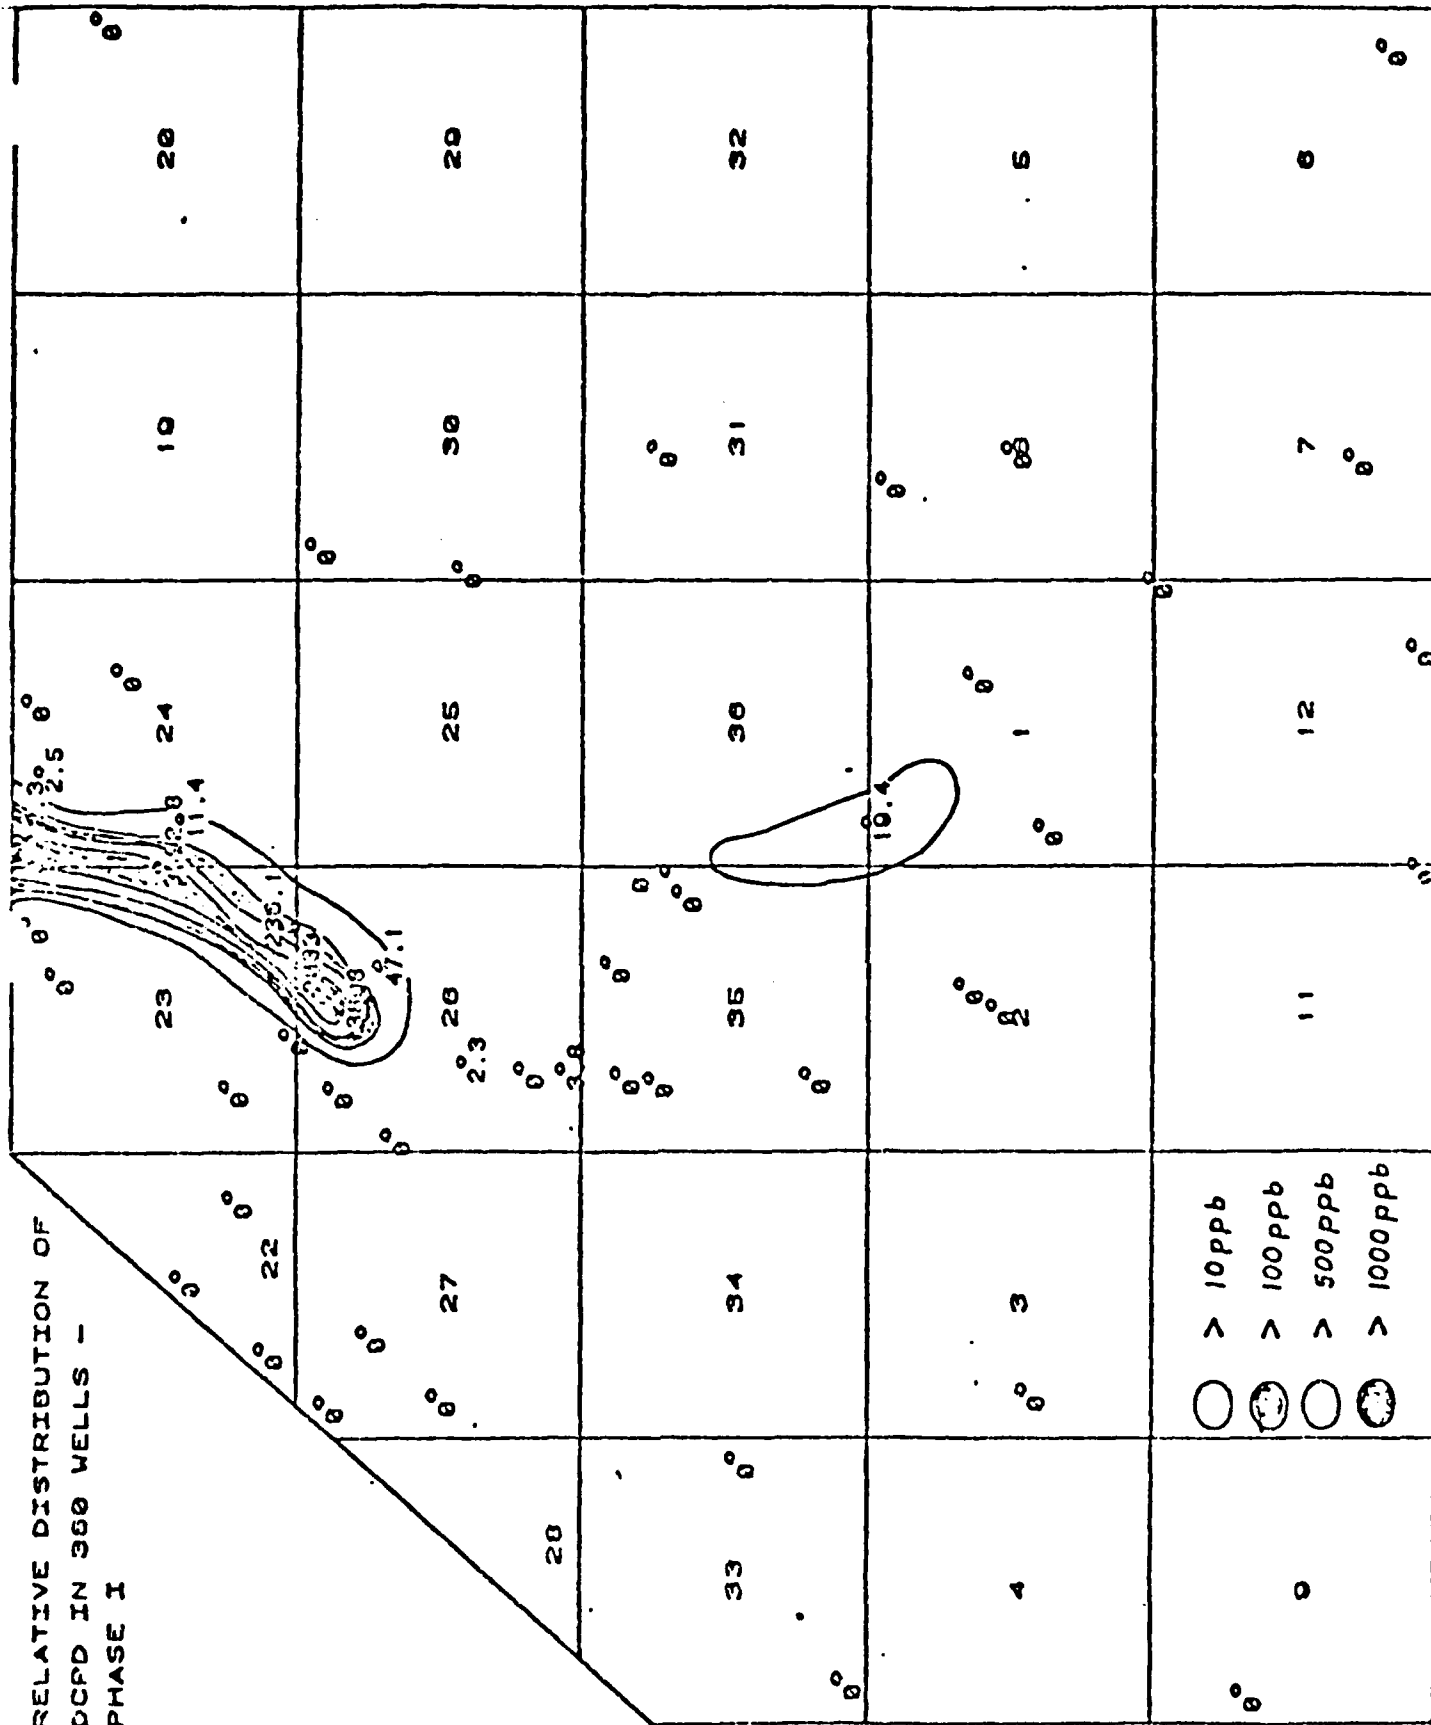


TABLE 1. Parameters for Sample Analyses

<u>Parameter</u>	<u>RMA</u>	<u>CDH</u>	<u>SOC</u>
Aldrin		<u>X</u>	<u>X</u>
Chloride	X	X	
DCPD	X	X	X
Dieldrin		<u>X</u>	<u>X</u>
DMP	X	X	X
Endrin		<u>X</u>	<u>X</u>
Fluoride	X	X	
Nitrate/Nitrite	X		
pH	X	X	
Sodium		<u>X</u>	
Sulfate	X	X	
TOTAL Hardness	X	X	
Chlorate	X	X	
Copper	X	X	

TABLE 2. 360° Sampling Parameters

<u>Parameter</u>	<u>RMA</u>	<u>CDH</u>	<u>SCC</u>
pH	X		X
DCPD (Odor Elim)	X	X	X
DIMP	X	X	
Chlorinated Hydrocarbons (i.e., Aldrin, Dieldin, Endrin)		X	X
Total Hardness	X		
Sodium	X	X	
Sulfate	X		
Chloride	X		
Conductivity		X	
Nitrate/Nitrite	X	X	
Dissolved Solids		X	
Chlorate		X	
Fluoride	X		
Phosphate		X	
Total Phosphate		X	

TABLE 3 Average DIMP and DCPD in
360° Water Monitoring Wells - Phase 1

Well No.	D I M P			D C P D				D I M P			D C P D		
	Avg	Min	Max	Avg	Min	Max		Avg	Min	Max	Avg	Min	Max
2	345.21	15	825	0	0	0	139	75.3	54	87	0	0	0
6	21.58	4.0	92	0	0	0	141	2467	1400	3724	3.87	0	46.4
9	.49	0	3.25	0	0	0	142	132.2	34	299	0	0	
10	.09	0	1.0	0	0	0	145	790.0	512	1094	0	0	
13	.22	0	1.5	0	0	0	OFF 58	1390	942	1700	0	0	0
15	0	0	0	0	0	0	Post						
17	22.05	10.3	1.4	0	0	0	84	8.68	3.7	15.4	0	0	0
20	1.82	0	14	0	0	0	IV	3.46	2.2	5.7	0	0	0
21	.68	0	3.2	0	0	0	VI	.10	0	.6	0	0	0
22	.20	0	2.75	0	0	0	VIII	4.72	2.64	6.5	0	0	0
23	12.54	6.4	16.7	0	0	0	XII	8.25	2.59	19.2	0	0	0
24	.49	0	4.5	0	0	0	XIX	95.10	13.8	194	0	0	0
25	472.27	260	1700	0	0	0	XX	19.94	3.6	89.4	0	0	0
33	.44	0	2.2	0	0	0	XII	50.8	0	178	0	0	0
34	.05	0	.6	0	0	0	XXIV	.12	0	.7	0	0	0
35	0	0	0	0	0	0	XXV	0	0	0	0	0	0
37	1.09	0	9.9	0	0	0	XXIII	1.17	0	4.4	0	0	0
38	.04	0	.62	0	0	0	XXI	0	0	0	0	0	0
41	2088.3	1111	3937	2.25	0	27	XXII	0	0	0	0	0	0
45	222.08	120	305	2.48	0	18	LIII	262.8	57	628	14.4	0	40
46	1.48	0	52	0	0	0	LIV	1119.4	717	1074	2074	1320	2556
47	.13	0	1.9	0	0	0	LV	32.2	18.4	40	0	0	0
49	1.15	0	5.2	0	0	0	LVII	75.5	0	113	0	0	0
50	.35	0	1.8	0	0	0	LVIII	1.27	0	2.5	0	0	0
51	.57	0	6.0	0	0	0	LXIX	25.95	20.7	32	0	0	0
60	901.25	96.2	1481	3512.3	2083	8679	LXXI	1.04	0	2.7	0	0	0
62	265.21	190	310	0	0	0	LXIII	5.5	0	12	0	0	0
65A	381.5	81	630	2.13	0	17	LXIV	.17	0	.69	0	0	0
71	.44	44	44	0	0	0	holes	84.52	60	104	0	0	0
72	476.8	253	726	0	0	0							
73	557.26	310	809	47.1	10	106							
78	5.08	2.2	9.2	0	0	0							
79	.90	0	13	0	0	0							
93	1851.1	1380	2430	0	0	0							
99	3.3	.9	8.4	0	0	0							
103	1.10	0	9.5	0	0	0							
104	9.01	.7	83	0	0	0							
105	3.67	2.5	4.7	0	0	0							
109	.96	0	4.5	0	0	0							
115	615.3	390	1044	3592.8	1912	11774							
118	555.8	171	2200	3803.0	1100	6827							
119	19	31.2	30.4	0	0	0							
121	2056	221	5000	0	0	0							
122	304.4	212	556	11.35	0	44							
125	256.7	103	370	1.03	0	15							
126	6.55	0	19.5	19.4	0	54							
132	679.2	190	790	2033	1120	4050							
135	355.91	247	520	230.13	89.5	600							

TABLE 4. DMP and DCPD Levels in
360° Water Monitoring Wells - Phase 2, Second Quarter

<u>Well No.</u>	<u>DMP</u>	<u>DCPD</u>	<u>Well No.</u>	<u>DMP</u>	<u>DCPD</u>
2	164	0	139	76	0
6	22.8	0	141	1902.82	0
9	2.23	0	142	65	0
10	2.96	0	145	1025	0
13	0	0	Off 58		
15	12	0	Post		
17	12.29	0	84		
20	1.64	0	IV	5	0
21	4.93	0	VI	1	0
22	0.8	0	VIII	5.6	0
23	20.57	0	XII	8.2	0
24	4.38	0	XIX	99	0
25	290	0	XX	4.9	0
33	0	0	XXI	49	0
34	0	0	XXIV	0	0
35	0	0	XXV	0	0
37	1.07		XXVIII	0	0
38	3.44	0	XXXI	0	0
41	575.3		XXXII	0	0
45	109.47	0	LIII		
46	1.77	0	LIV	1021	2141
47	2.34	0	LV	40	0
50	.52	0	LVII	43	0
51	.54	0	LVIII	1.4	0
60	942.31	1129.23	LVIX	29	0
62	624.37	0	LVXI	4.7	
65A	624.92	0	LXIII	.5	0
71	316	0	LXIV	0	0
72	490.78	0	Bollers	41.7	0
73	830.6				
78	4.33	0			
79	3.16	0			
98	1543	0			
99	6.74	0			
103	0	0			
104	28.7				
105	3.46	0 0			
109	0	0			
115	547	- 1206			
118	2954.35	1028.89			
119	14				
121	2457				
122	309.5	0			
126	23.07	245.43			
132	664	445.02			
133	612.16	35.93			