


ARMY RESEARCH LABORATORY

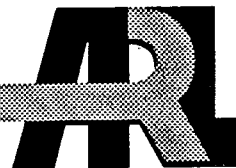


# Poisson's Ratio for Cubic Crystals

Arthur Ballato

ARL-TR-425

March 1995

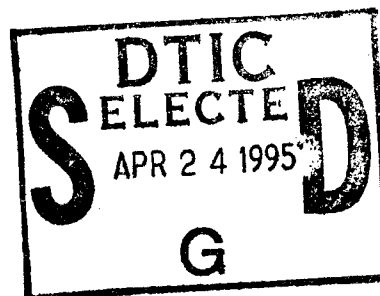

19950421 091

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION IS UNLIMITED.

## **NOTICES**

### **Disclaimers**

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

The citation of trade names and names of manufacturers in this report is not to be construed as official Government endorsement or approval of commercial products or services referenced herein.

# REPORT DOCUMENTATION PAGE

Form Approved  
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

<b>1. AGENCY USE ONLY (Leave blank)</b>	<b>2. REPORT DATE</b> March 1995	<b>3. REPORT TYPE AND DATES COVERED</b> Technical Report	
<b>4. TITLE AND SUBTITLE</b> POISSON'S RATIO FOR CUBIC CRYSTALS		<b>5. FUNDING NUMBERS</b>	
<b>6. AUTHOR(S)</b> Arthur Ballato		<b>8. PERFORMING ORGANIZATION REPORT NUMBER</b> ARL-TR-425	
<b>7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)</b> US Army Research Laboratory (ARL) Electronics and Power Sources Directorate (EPSD) ATTN: AMSRL-EP Fort Monmouth, NJ 07703-5601		<b>10. SPONSORING / MONITORING AGENCY REPORT NUMBER</b>	
<b>9. SPONSORING / MONITORING AGENCY NAME(S) AND ADDRESS(ES)</b>		<b>11. SUPPLEMENTARY NOTES</b>	
<b>12a. DISTRIBUTION / AVAILABILITY STATEMENT</b> Approved for public release; distribution is unlimited.		<b>12b. DISTRIBUTION CODE</b>	
<b>13. ABSTRACT (Maximum 200 words)</b> General expressions for Poisson's ratio are derived for cubic crystals; simplified forms are given for cases involving symmetry directions.			
<b>14. SUBJECT TERMS</b> Crystals; piezoelectric zinblende structure; isotropic substances			<b>15. NUMBER OF PAGES</b> 14
			<b>16. PRICE CODE</b>
<b>17. SECURITY CLASSIFICATION OF REPORT</b> Unclassified	<b>18. SECURITY CLASSIFICATION OF THIS PAGE</b> Unclassified	<b>19. SECURITY CLASSIFICATION OF ABSTRACT</b> Unclassified	<b>20. LIMITATION OF ABSTRACT</b> UL

# Table of Contents

Section	Page
Abstract	1
Introduction	1
Expressions Relating Cubic Stiffnesses and Compliances	2
Definition of Poisson's Ratio for Crystals	2
Relations for Rotated Cubic Compliances - General	3
Single-Axis Rotations	3
Transformation Matrix for General Rotations	4
Poisson's Ratios for Specific Orientations	4
Conclusions	7
Bibliography	8

Accession For	
NTIS CRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification .....	
By .....	
Distribution /	
Availability Codes	
Dist	Avail and/or Special
A-1	

## POISSON'S RATIO FOR CUBIC CRYSTALS

### Abstract

General expressions for Poisson's ratio are derived for cubic crystals; simplified forms are given for cases involving symmetry directions.

### Introduction

Poisson's ratio,  $\nu$ , is defined for isotropic media as the quotient of lateral contraction to longitudinal extension arising from application of a simple tensile stress; in most materials, this dimensionless number is positive. In crystals,  $\nu$  takes on different values, depending on the directions of stress and strain chosen. The ratio finds application in a variety of areas of applied elasticity and solid mechanics, for example, as indication of the mechanical coupling between various vibrational modes of motion.

The maximum value of  $\nu = +1/2$  is obtained in the incompressible medium limit, where volume is preserved; for ordinary materials, values of  $+1/4$  to  $+1/3$  are typical, but in crystals  $\nu$  may vanish, or take on negative values. Analytical formulas for Poisson's ratio are expressed in terms of elastic constants. For the case of crystals of general anisotropy, these expressions are quite unwieldy, but for cubic crystals the symmetry elements reduce the complexity considerably.

Crystals of cubic symmetry include many of the binary semiconductor systems with the piezoelectric zincblende structure, such as GaAs and related alloys. These are extremely important for high technology applications such as cellular radio and microwave collision avoidance radar. All cubic classes have the same elastic matrix scheme, so for our purposes it is not necessary to distinguish between the cubic point groups. The cubic elastic matrix scheme is identical in form to that of isotropic substances; the difference is that for isotropic materials the shear coefficient ( $s_{44}$  or  $c_{44}$ ) is related to the two other independent coefficients, whereas in cubic crystals it is a third independent quantity.

## Expressions Relating Cubic Stiffnesses and Compliances

Relations for Poisson's ratio are most simply expressed in terms of the elastic compliances  $[s_{\lambda\mu}]$ . It is often the case, however, that the most accurate determinations of the elastic constants (resonator and transit-time methods) yield values for the stiffnesses  $[c_{\lambda\mu}]$  directly; the conversion relations are given below. For the cubic system, the elastic stiffness and compliance matrices have identical form. Referred to the [100], [010], and [001] directions, the matrices are:

$c_{11}$	$c_{12}$	$c_{12}$	0	0	0	$s_{11}$	$s_{12}$	$s_{12}$	0	0	0
$c_{12}$	$c_{11}$	$c_{12}$	0	0	0	$s_{12}$	$s_{11}$	$s_{12}$	0	0	0
$c_{12}$	$c_{12}$	$c_{11}$	0	0	0	$s_{12}$	$s_{12}$	$s_{11}$	0	0	0
0	0	0	$c_{44}$	0	0	0	0	0	$s_{44}$	0	0
0	0	0	0	$c_{44}$	0	0	0	0	0	$s_{44}$	0
0	0	0	0	0	$c_{44}$	0	0	0	0	0	$s_{44}$

Stiffness and compliance are matrix reciprocals; the three independent components of each are related by:

$$c_{11} = (s_{11} + s_{12}) / [(s_{11} - s_{12})(s_{11} + 2s_{12})]$$

$$c_{12} = (-s_{12}) / [(s_{11} - s_{12})(s_{11} + 2s_{12})]$$

$$c_{44} = 1 / s_{44}$$

These are inverted simply by an interchange of symbols  $c_{\lambda\mu}$  and  $s_{\lambda\mu}$ . For the case of isotropy, one has the further relations  $s_{44} = 2(s_{11} - s_{12})$  and  $c_{44} = (c_{11} - c_{12})/2$ . For cubic crystals, anisotropy factors  $s = (s_{11} - s_{12} - s_{44}/2)$  and  $c = (c_{11} - c_{12} - 2c_{44})$  are defined, in terms of which the departure from isotropy may be quantized. The Poisson's ratios are simply expressed in terms of  $s_{11}$ ,  $s_{12}$ , and  $s$ .

## Definition of Poisson's Ratio for Crystals

Poisson's ratio for crystals is defined in general as  $\nu_{ji} = s_{ij}' / s_{jj}'$ , where  $x_j$  is the direction of the longitudinal extension,  $x_i$  is the direction of the accompanying lateral contraction, and the  $s_{ij}'$  and  $s_{jj}'$  are the appropriate elastic compliances referred to this right-handed axial set. It suffices to take  $x_1$  as the direction of the longitudinal extension; then two Poisson's ratios are defined by the orientations of the lateral axes  $x_2$  and  $x_3$ :  $\nu_{21} = s_{12}' / s_{11}'$  and  $\nu_{31} = s_{13}' / s_{11}'$ . Application of the definition requires

specification of the orientation of the  $x_k$  coordinate set with respect to the crystallographic directions, and transformation of the compliances accordingly.

### Relations for Rotated Cubic Compliances - General

The unprimed compliances  $s_{11}$ ,  $s_{44}$ , and  $s_{12}$  are referred to a set of right-handed cubic crystallographic axes aligned with the [100], [010], and [001] directions. Direction cosines  $a_{mn}$  relate the transformation from these axes to the set specifying the directions of the longitudinal extension ( $x_1$ ), and the lateral contractions ( $x_2$  and  $x_3$ ). General expressions for the transformed compliances that enter the formulas for  $v_{21}$  and  $v_{31}$  are:

$$s_{11}' = s_{11} [a_{11}^4 + a_{12}^4 + a_{13}^4] + (s_{44} + 2 s_{12}) [a_{11}^2 a_{12}^2 + a_{12}^2 a_{13}^2 + a_{13}^2 a_{11}^2]$$

$$s_{12}' = s_{11} [a_{11}^2 a_{21}^2 + a_{12}^2 a_{22}^2 + a_{13}^2 a_{23}^2] + \\ s_{44} [a_{12} a_{13} a_{22} a_{23} + a_{13} a_{11} a_{23} a_{21} + a_{11} a_{12} a_{21} a_{22}] + \\ s_{12} [a_{11}^2 a_{22}^2 + a_{12}^2 a_{21}^2 + a_{11}^2 a_{23}^2 + a_{13}^2 a_{21}^2 + a_{12}^2 a_{23}^2 + a_{13}^2 a_{22}^2]$$

$$s_{13}' = s_{11} [a_{11}^2 a_{31}^2 + a_{12}^2 a_{32}^2 + a_{13}^2 a_{33}^2] + \\ s_{44} [a_{12} a_{13} a_{32} a_{33} + a_{13} a_{11} a_{33} a_{31} + a_{11} a_{12} a_{31} a_{32}] + \\ s_{12} [a_{11}^2 a_{32}^2 + a_{12}^2 a_{31}^2 + a_{11}^2 a_{33}^2 + a_{13}^2 a_{31}^2 + a_{12}^2 a_{33}^2 + a_{13}^2 a_{32}^2]$$

### Single-Axis Rotations

The general rotation relations given above for  $s_{11}'$ ,  $s_{12}'$ , and  $s_{13}'$  simplify considerably for single-axis rotations, and use of the anisotropy factor  $s = (s_{11} - s_{12} - s_{44}/2)$ . Longitudinal extension is along the  $x_1$  axis, and abbreviations  $c(\varphi)$  and  $s(\varphi)$  stand for  $\cos(\varphi)$  and  $\sin(\varphi)$ , etc.:

(A) Rotation about  $x_1$ :  $s_{11}' = s_{11}$ ;  $s_{12}' = s_{13}' = s_{12}$ ;  $v_{21} = v_{31} = s_{12} / s_{11}$

(B) Rotation about  $x_2$ :  $s_{11}' = s_{11} - 2 s [c^2(\psi) s^2(\psi)]$ ;  $s_{12}' = s_{12}$

$$s_{13}' = s_{12} + 2 s [c^2(\psi) s^2(\psi)]; v_{21} = s_{12} / s_{11}'; v_{31} = s_{13}' / s_{11}'$$

(C) Rotation about  $x_3$ :  $s_{11}' = s_{11} - 2 s [c^2(\varphi) s^2(\varphi)]$

$$s_{12}' = s_{12} + 2 s [c^2(\varphi) s^2(\varphi)]; s_{13}' = s_{12}; v_{21} = s_{12}' / s_{11}'; v_{31} = s_{12} / s_{11}'$$

## Transformation Matrix for General Rotations

In order to derive the Poisson's ratio for the most general case, we consider the transformation matrix for a combination of three coordinate rotations: a first rotation about  $x_3$  by angle  $\varphi$ , a second rotation about the new  $x_1$  by angle  $\theta$ , and a third rotation about the resulting  $x_2$  by angle  $\psi$ . When these angles are set to zero, the  $x_1$ ,  $x_2$ ,  $x_3$  axes coincide respectively with the [100], [010], and [001] crystallographic directions. For nonzero angles, the direction cosines  $a_{mn}$  are as follows:

$$\begin{bmatrix} c(\varphi)c(\psi) - s(\varphi)s(\theta)s(\psi) & [s(\varphi)c(\psi) + c(\varphi)s(\theta)s(\psi)] & [-c(\theta)s(\psi)] \\ [-s(\varphi)c(\theta)] & [c(\varphi)c(\theta)] & [s(\theta)] \\ [c(\varphi)s(\psi) + s(\varphi)s(\theta)c(\psi)] & [s(\varphi)s(\psi) - c(\varphi)s(\theta)c(\psi)] & [c(\theta)c(\psi)] \end{bmatrix}$$

Substitution of these  $a_{mn}$  into the expressions for  $s_{11}'$ ,  $s_{12}'$ , and  $s_{13}'$ , and thence into the formulas  $\nu_{21} = s_{12}' / s_{11}'$  and  $\nu_{31} = s_{13}' / s_{11}'$  formally solves the problem for specified values of  $\varphi$ ,  $\theta$ , and  $\psi$ .

## Poisson's Ratios for Specific Orientations

- 1) Longitudinal extension along [100]:  $\varphi = \psi = 0$ ;  $\theta$  arbitrary. This is the same as case (A) above.  $\nu_{21} = \nu_{31} = s_{12} / s_{11}$ , independent of angle  $\theta$ .
- 2) Longitudinal extension along an axis normal to [001]:  $\psi = 0$ ;  $\varphi$  and  $\theta$  arbitrary. Direction cosines are:

$$\begin{bmatrix} c(\varphi) & [s(\varphi)] & [0] \\ [-s(\varphi)c(\theta)] & [c(\varphi)c(\theta)] & [s(\theta)] \\ [s(\varphi)s(\theta)] & [-c(\varphi)s(\theta)] & [c(\theta)] \end{bmatrix}$$

Rotated compliances are:

$$s_{11}' = s_{11} - 2s [c^2(\varphi) s^2(\varphi)]$$

$$s_{12}' = s_{12} + 2s [c^2(\varphi) s^2(\varphi) c^2(\theta)]$$

$$s_{13}' = s_{12} + 2s [c^2(\varphi) s^2(\varphi) s^2(\theta)]$$

$$\nu_{21} = s_{12}' / s_{11}'; \nu_{31} = s_{13}' / s_{11}'$$

2a) When both  $\theta$  and  $\psi = 0$ , but  $\varphi$  is arbitrary, this reduces to case (C) above:

$$s_{11}' = s_{11} - 2s [c^2(\varphi) s^2(\varphi)]$$

$$s_{12}' = s_{12} + 2s [c^2(\varphi) s^2(\varphi)]$$

$$s_{13}' = s_{12} ; v_{21} = s_{12}' / s_{11}' ; v_{31} = s_{12} / s_{11}'$$

2b) When  $\varphi = \pi/4$ ,  $\theta$  is arbitrary, and  $\psi = 0$ , the  $x_1$  axis (direction of longitudinal extension) coincides with the [110] direction; the rotated compliances become:

$$s_{11}' = s_{11} - s (1/2) ; s_{12}' = s_{12} + s (1/2)[c^2(\theta)] ; s_{13}' = s_{12} + s (1/2)[s^2(\theta)]$$

$$v_{21} = s_{12}' / s_{11}' = (2s_{12} + s [c^2(\theta)]) / (2s_{11} - s)$$

$$v_{31} = s_{13}' / s_{11}' = (2s_{12} + s [s^2(\theta)]) / (2s_{11} - s)$$

2c) When  $\varphi = \pi/4$ ,  $\theta = 0$ , and  $\psi = 0$ , the  $x_1$  axis (direction of longitudinal extension) coincides with the [110] direction, and the  $x_2$  and  $x_3$  axes coincide respectively with the [-110] and [001] directions. The rotated compliances then become:

$$s_{11}' = s_{11} - s (1/2) ; s_{12}' = s_{12} + s (1/2) ; s_{13}' = s_{12}$$

The Poisson's ratios are thus:

$$v_{21} = s_{12}' / s_{11}' = (2s_{12} + s) / (2s_{11} - s) \text{ and}$$

$$v_{31} = s_{13}' / s_{11}' = (2s_{12}) / (2s_{11} - s)$$

When  $\theta = \pi/2$  instead of 0,  $v_{21}$  and  $v_{31}$  are simply interchanged.

3) Longitudinal extension in the plane containing [110] and [111]:  
 $\varphi = \pi/4$ ,  $\theta = 0$ ,  $\psi$  arbitrary. The  $x_2$  axis coincides with the [-110] direction. Direction cosines are:

$c(\psi)/\sqrt{2}$	$c(\psi)/\sqrt{2}$	$-s(\psi)$
$-1/\sqrt{2}$	$1/\sqrt{2}$	$0$
$s(\psi)/\sqrt{2}$	$s(\psi)/\sqrt{2}$	$c(\psi)$

Rotated compliances are:

$$s_{11}' = s_{11} - 2s [c^2(\psi)] [1 - (3/4)c^2(\psi)]$$

$$s_{12}' = s_{12} + (1/2)s [c^2(\psi)]$$

$$s_{13}' = s_{12} + (3/2)s [c^2(\psi) s^2(\psi)]$$

The Poisson's ratios are:  $\nu_{21} = s_{12}' / s_{11}'$ ;  $\nu_{31} = s_{13}' / s_{11}'$ . When  $\psi = 0$ , this reduces to case 2c) above; when  $\psi = \pi/2$ , it is equivalent to case (A) with extension along [001].

4) Longitudinal extension along [-11-1]:  $\phi = \pi/4$ ,  $\theta = 0$ , and  $\psi = \arcsin(1/\sqrt{3})$ . The  $x_2$  and  $x_3$  axes coincide, respectively, with the [-110] and [112] directions. Direction cosines  $a_{mn}$  are:

$1/\sqrt{3}$	$1/\sqrt{3}$	$-1/\sqrt{3}$
$-1/\sqrt{2}$	$1/\sqrt{2}$	$0$
$1/\sqrt{6}$	$1/\sqrt{6}$	$\sqrt{(2/3)}$

Rotated compliances are:

$$s_{11}' = s_{11} - (2/3)s$$

$$s_{12}' = s_{13}' = s_{12} + (1/3)s$$

The Poisson's ratios are:  $\nu_{21} = \nu_{31} = s_{12}' / s_{11}' = (3s_{12} + s) / (3s_{11} - 2s)$

5) Longitudinal extension along [-11-1]:  $\phi = \pi/4$  and  $\psi = \arcsin(1/\sqrt{3})$ . Provision is made for rotating the lateral axes by adding a third rotation, about the resulting  $x_1$  (i.e., about [-11-1]), by angle  $\theta$ , subsequent to the  $\phi$  and  $\psi$  rotations.

Direction cosines  $a_{mn}$  are now:

$1/\sqrt{3}$	$1/\sqrt{3}$	$-1/\sqrt{3}$
$1/\sqrt{2} [-c(\theta) + s(\theta)/\sqrt{3}]$	$1/\sqrt{2} [c(\theta) + s(\theta)/\sqrt{3}]$	$\sqrt{(2/3)} s(\theta)$
$1/\sqrt{2} [s(\theta) + c(\theta)/\sqrt{3}]$	$1/\sqrt{2} [-s(\theta) + c(\theta)/\sqrt{3}]$	$\sqrt{(2/3)} c(\theta)$

Rotated compliances computed from these direction cosines turn out to be independent of angle  $\theta$ , and are identical to those of case 4) above:

$$s_{11}' = s_{11} - (2/3) s$$

$$s_{12}' = s_{13}' = s_{12} + (1/3) s$$

The Poisson's ratios are:  $\nu_{21} = \nu_{31} = s_{12}' / s_{11}' = (3 s_{12} + s) / (3 s_{11} - 2 s)$

### Conclusions

Poisson's ratio, with respect to rotated coordinate axes for cubic materials, has been obtained. Three cases are of particular interest:

- For longitudinal extension along [100] (along the cube axis),  $\nu_{21} = \nu_{31} = s_{12} / s_{11}$ , independent of lateral directions. Case (A).
- For longitudinal extension along [110] (along the face diagonal; normal to the dodecahedral planes (110)), with  $s = (s_{11} - s_{12} - s_{44}/2)$ ,

$$\nu_{21} = (2 s_{12} + s [c^2(\theta)]) / (2 s_{11} - s)$$

$$\nu_{31} = (2 s_{12} + s [s^2(\theta)]) / (2 s_{11} - s)$$

When  $\theta = 0$ , the  $x_2$  and  $x_3$  axes coincide, respectively, with the [-110] and [001] directions. Case 2c). Poisson's ratios are:

$$\nu_{21} = (2 s_{12} + s) / (2 s_{11} - s)$$

$$\nu_{31} = (2 s_{12}) / (2 s_{11} - s)$$

- For longitudinal extension along [111] (along the body diagonal; normal to the octahedral planes (111)). Case 5). Poisson's ratios are independent of the lateral directions:

$$\nu_{21} = \nu_{31} = [3 s_{12} + s] / [3 s_{11} - 2 s]$$

## Bibliography

- [1] W G Cady, Piezoelectricity, McGraw-Hill, New York, 1946; Dover, New York, 1964.
- [2] J F Nye, Physical Properties of Crystals, Clarendon Press, Oxford, 1957; Oxford University Press, 1985.
- [3] R F S Hearmon, An Introduction to Applied Anisotropic Elasticity, Oxford University Press, 1961.
- [4] M J P Musgrave, Crystal Acoustics, Holden-Day, San Francisco, 1970.

ARMY RESEARCH LABORATORY  
ELECTRONICS AND POWER SOURCES DIRECTORATE  
CONTRACT OR IN-HOUSE TECHNICAL REPORTS  
MANDATORY DISTRIBUTION LIST

February 1995  
Page 1 of 2

- Defense Technical Information Center\*  
ATTN: DTIC-OCC  
Cameron Station (Bldg 5)  
Alexandria, VA 22304-6145  
(\*Note: Two copies will be sent from  
STINFO office, Fort Monmouth, NJ)
- Commander, CECOM  
R&D Technical Library  
Fort Monmouth, NJ 07703-5703  
(1) AMSEL-IM-BM-I-L-R (Tech Library)  
(3) AMSEL-IM-BM-I-L-R (STINFO ofc)
- Director  
US Army Material Systems Analysis Actv  
ATTN: DRXSY-MP  
(1) Aberdeen Proving Ground, MD 21005
- Director, Army Research Laboratory  
2800 Powder Mill Road  
Adelphi, MD 20783-1145  
(1) AMSRL-OP-SD-TP (Debbie Lehtinen)
- Commander, AMC  
ATTN: AMCDE-SC  
5001 Eisenhower Ave.  
(1) Alexandria, VA 22333-0001
- Director  
Army Research Laboratory  
ATTN: AMSRL-D (John W. Lyons)  
2800 Powder Mill Road  
(1) Adelphi, MD 20783-1145
- Director  
Army Research Laboratory  
ATTN: AMSRL-DD (COL Thomas A. Dunn)  
2800 Powder Mill Road  
(1) Adelphi, MD 20783-1145
- Director  
Army Research Laboratory  
2800 Powder Mill Road  
Adelphi, MD 20783-1145  
(1) AMSRL-OP-SD-TA (ARL Records Mgt)  
(1) AMSRL-OP-SD-TL (ARL Tech Library)  
(1) AMSRL-OP-SD-TP (ARL Tech Publ Br)
- Directorate Executive  
Army Research Laboratory  
Electronics and Power Sources Directorate  
Fort Monmouth, NJ 07703-5601  
(1) AMSRL-EP  
(1) AMSRL-EP-T (M. Hayes)  
(1) AMSRL-OP-RM-FM  
(22) Originating Office
- Advisory Group on Electron Devices  
ATTN: Documents  
2011 Crystal Drive, Suite 307  
(2) Arlington, VA 22202

ARMY RESEARCH LABORATORY  
ELECTRONICS AND POWER SOURCES DIRECTORATE  
SUPPLEMENTAL DISTRIBUTION LIST  
(ELECTIVE)

February 1995  
Page 2 of 2

- (1) Deputy for Science & Technology  
Office, Asst Sec Army (R&D)  
Washington, DC 20310
- (1) Cdr, Marine Corps Liaison Office  
ATTN: AMSEL-LN-MC  
Fort Monmouth, NJ 07703-5033
- (1) HQDA (DAMA-ARZ-D/  
Dr. F.D. Verderame)  
Washington, DC 20310
- (1) Director  
Naval Research Laboratory  
ATTN: Code 2627  
Washington, DC 20375-5000
- (1) USAF Rome Laboratory  
Technical Library, FL2810  
ATTN: Documents Library  
Corridor W, STE 262, RL/SUL  
26 Electronics Parkway, Bldg 106  
Griffiss Air Force Base  
NY 13441-4514
- (1) Dir, ARL Battlefield  
Environment Directorate  
ATTN: AMSRL-BE  
White Sands Missile Range  
NM 88002-5501
- (1) Dir, ARL Sensors, Signatures,  
Signal & Information Processing  
Directorate (S3I)  
ATTN: AMSRL-SS  
2800 Powder Mill Road  
Adelphi, MD 20783-1145
- (1) Dir, CECOM Night Vision/  
Electronic Sensors Directorate  
ATTN: AMSEL-RD-NV-D  
Fort Belvoir, VA 22060-5677
- (1) Dir, CECOM Intelligence and  
Electronic Warfare Directorate  
ATTN: AMSEL-RD-IEW-D  
Vint Hill Farms Station  
Warrenton, VA 22186-5100