



Carnegie Mellon
Software Engineering Institute

Pittsburgh, PA 15213-3890

Data Analysis Dynamics

Jeannine M. Siviy
William A. Florac
Software Engineering Institute

Sponsored by the U.S. Department of Defense
© 2003 by Carnegie Mellon University

Report Documentation Page

Form Approved
OMB No. 0704-0188

Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.

1. REPORT DATE FEB 2003		2. REPORT TYPE		3. DATES COVERED 00-00-2003 to 00-00-2003	
4. TITLE AND SUBTITLE Data Analysis Dynamics				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S)				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) Carnegie Mellon University, Software Engineering Institute, Pittsburgh, PA, 15213				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution unlimited					
13. SUPPLEMENTARY NOTES					
14. ABSTRACT					
15. SUBJECT TERMS					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT	18. NUMBER OF PAGES	19a. NAME OF RESPONSIBLE PERSON
a. REPORT unclassified	b. ABSTRACT unclassified	c. THIS PAGE unclassified			



Tutorial Outline

Section I – Understanding Data

- How to use data
- Understanding variation
- Requirements for success
- Common risks and pitfalls

Section II – Data Analysis Dynamics

- Learning from our experiences
- Useful tips for making measurement work
- Thread together methods, tools, processes



Carnegie Mellon
Software Engineering Institute

Tutorial Outline

Section III – Case Study

Summary

Addenda

- Additional vignettes
- Tool tips



Tutorial Focus

Tools, tips, and techniques your organization can use for analyzing software data and taking action

Specifically we will focus on

- day-to-day practices
- activities that lead to breakthroughs
- why the problem, not management, should drive your measurement program

Remember:

There is no “cookie-cutter” approach to doing good measurement, but there are some best practices.



Section I: Understanding Data

Data can help you

- Identify root causes of variability, off-target performance
- Better predict plans and commitments
- Make better decisions and take action
- Monitor activities to keep projects on cost, schedule

Data is the means to an end, not the end itself.



Process Performance Data

Data allows you to access/analyze process performance.

Process performance is behavior that can be described or measured using attributes of

- process operation or execution
- resultant products or services

Process performance measures answer the question:
“How is the process performing with respect to
quality, quantity, effort (cost) and time?”

All process behavior is variable.



Getting at the Cause of Variation

Shewhart divides variation into two types:

- Common Cause Variation
 - variation in process performance due to normal or inherent interaction among process components (people, machines, material, environment, and methods).
- Assignable Cause (Special Cause) Variation
 - variation in process performance due to events that are not part of the normal process.
 - represents sudden or persistent abnormal changes to one or more of the process components.




Understanding Variation

Everything is a process.

All processes have inherent variability.


Data is used to understand variation and to drive decisions to improve the processes.

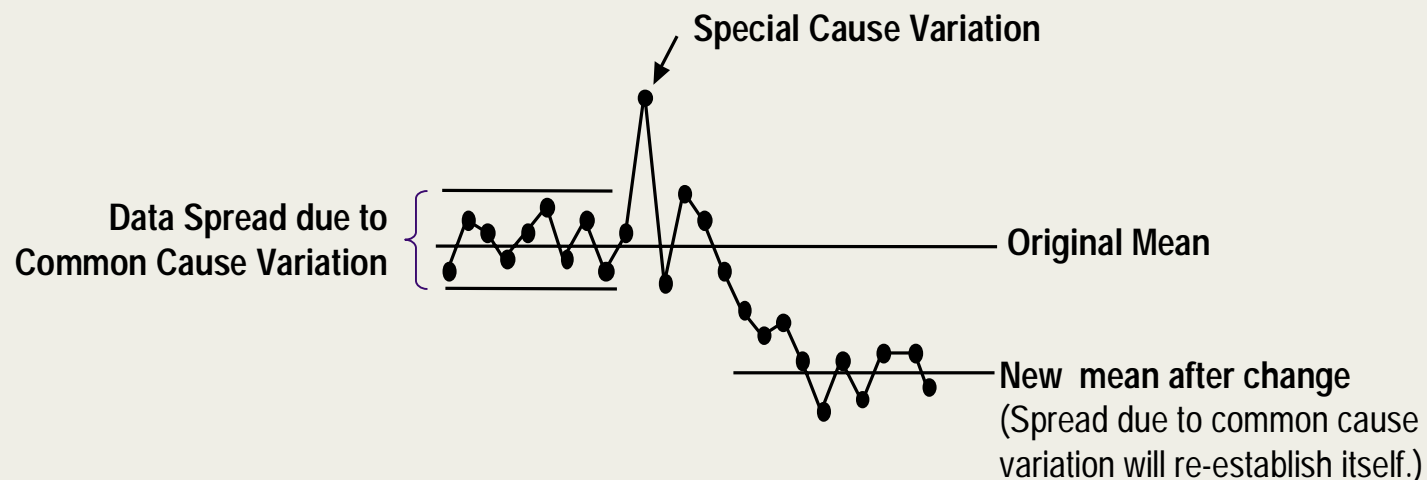

[ASQ 00], [ASA 01]




In Other Words...

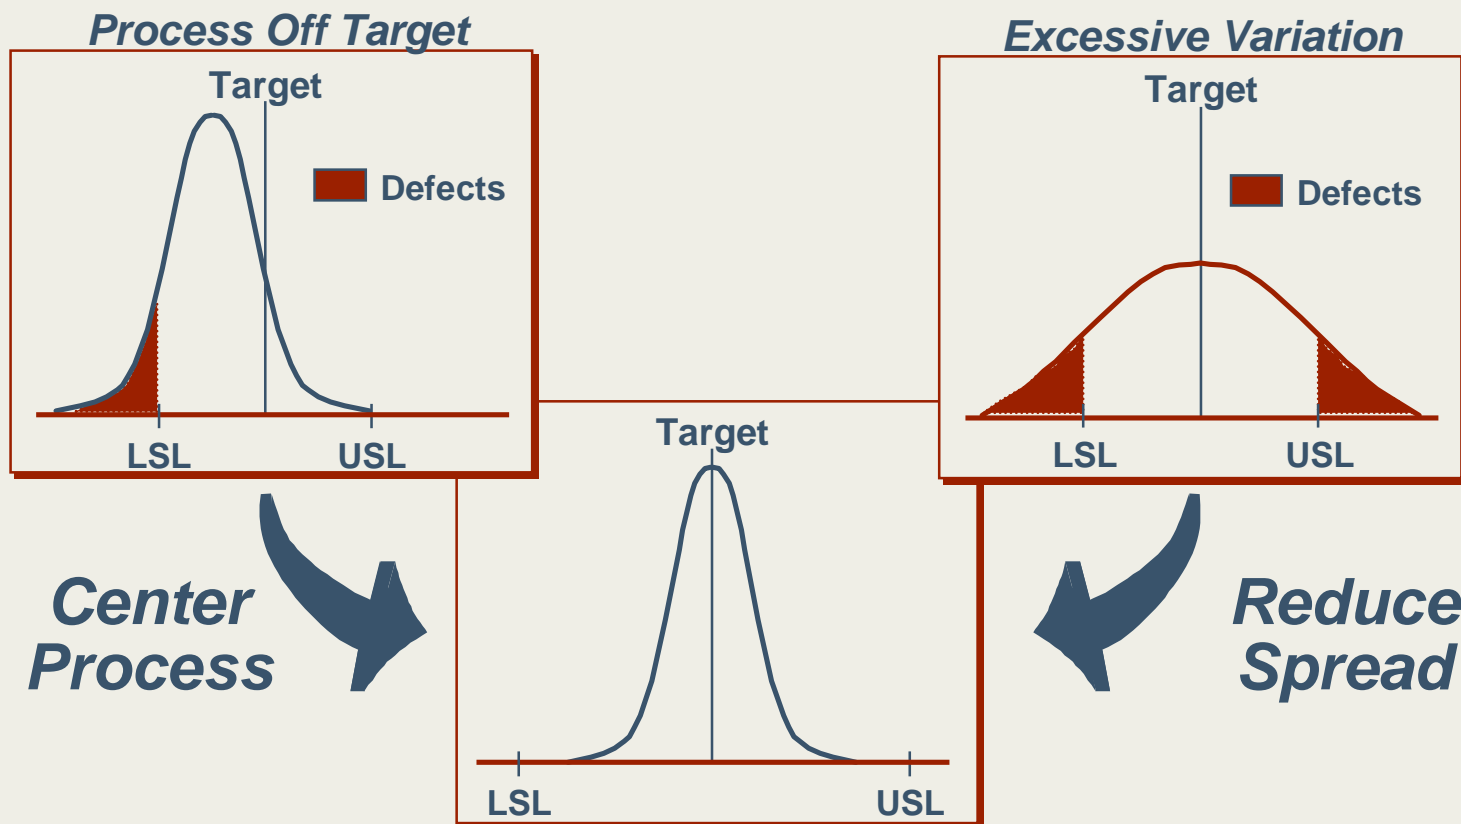



Measurement Data Requires Analysis and Interpretation

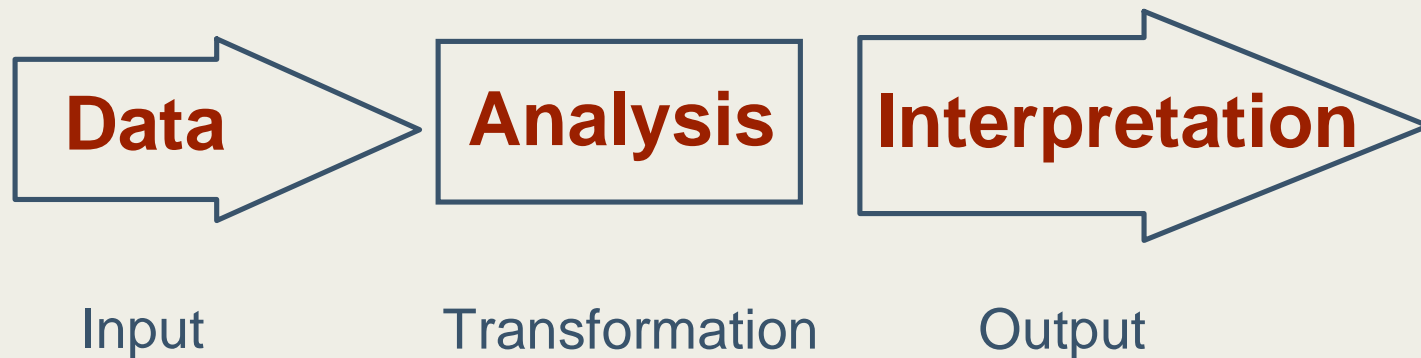

Separating signal from noise requires rigorous analysis procedures.

This allows quantitatively based inferences to be drawn to guide decisions and actions.



Data Analysis Studies

Remember what you are trying to accomplish. There are two approaches to data analysis to consider:

- Enumerative
 - aim is descriptive
 - determines “How many?” - not - “Why so many?”
- Analytic
 - aim is to predict or improve product attributes and/or the behavior of the process in the future



Enumerative Studies

An enumerative study answers questions such as:

- How many defects were found inspecting product code?
- How many problem reports have customers filed?
- What percent of staff have been trained in object-oriented design methods?
- How large were the last five products we delivered?
- What were the average sizes of our code-inspection teams last year?
- How many staff hours were spent on software rework last month?



Analytic Studies

Software engineering examples of analytical studies include:

- measuring software product attributes for the purpose of making changes to future products
- evaluating defect discovery profiles to identify focal areas for process improvement
- predicting schedules, costs, or operational reliability
- evaluating/comparing software tools, technologies, or methods—for the purpose of selecting among them for future use
- stabilizing and improving software processes or to assess process capability



Enumerative vs. Analytic


Undertake an **enumerative** study if: action is to be taken on the subject based on data that is already collected


Undertake an **analytic** study if: action is to be taken on the process that produced the data

Analytic studies utilize statistical process control tools to draw inferences about future process performance.



Basic Data Analysis Paradigm

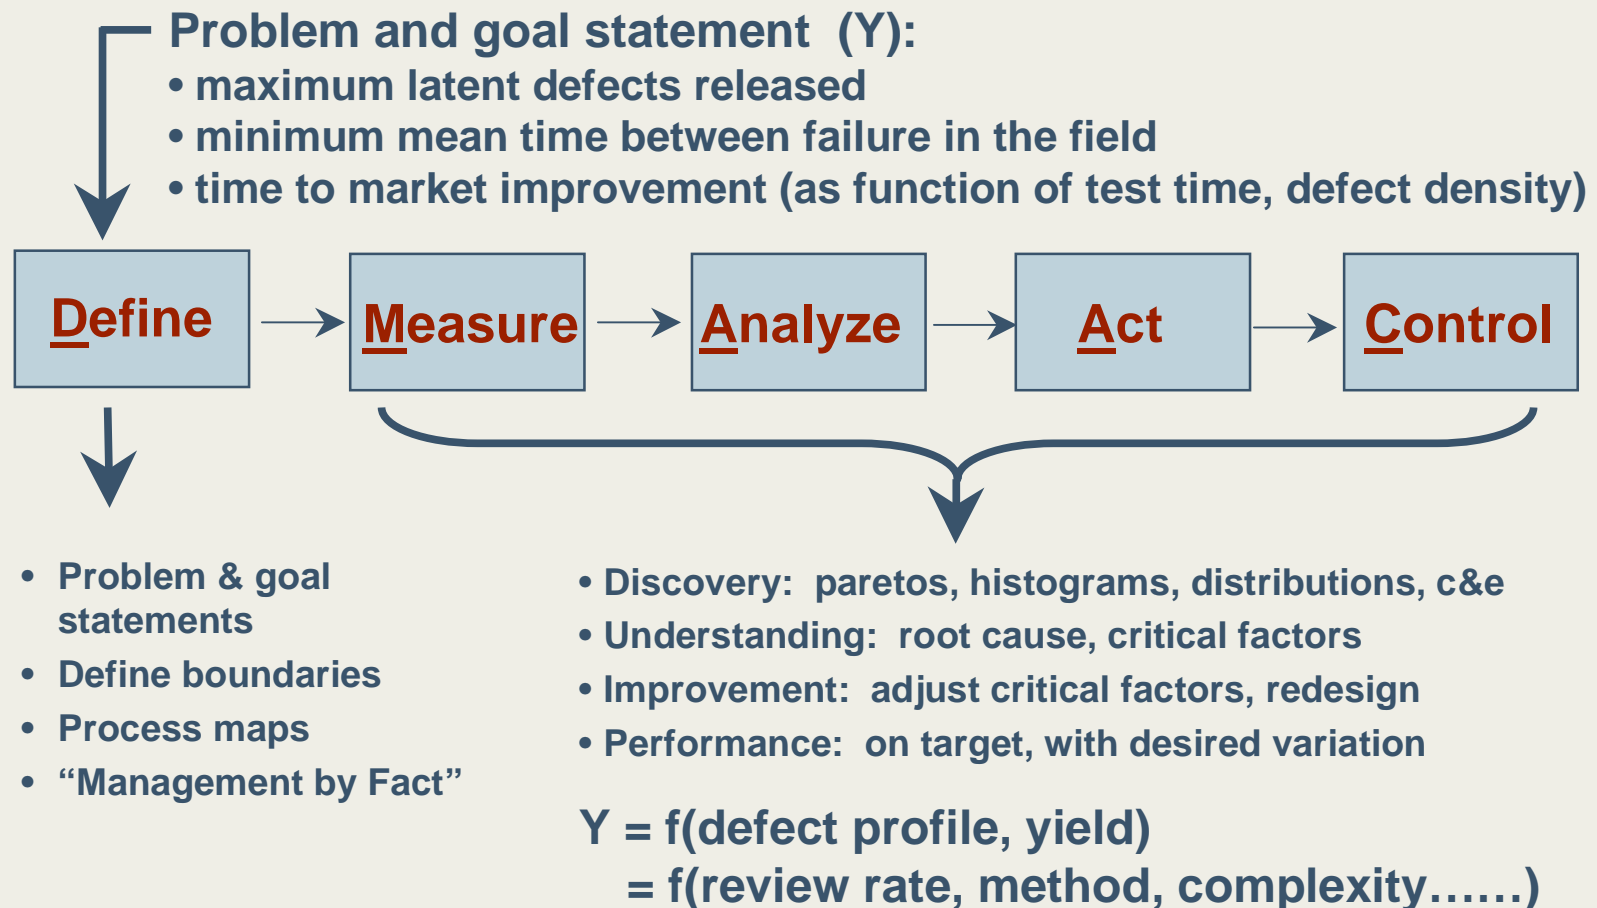




Tips for Good Measures

Measures used to characterize products or processes

- relate closely to the issue under study
- have high information content
- pass a reality and validity test
- permit easy and economical collection of data
- permit consistently collected, well-defined data
- show measurable variation as a set
- have diagnostic value

[Wheeler 92]



Tips for Better Data Analysis


Verified: accuracy of format, type, range, completeness, and type

Valid and Reliable: clear, consistent definitions

Accurate and Precise: precise counting method

Based on operational definitions, you should know

- What does this measure mean?
- What are the rules for assigning values?
- What is the data recording procedure?




Tips for Operational Definitions ₁

Three criteria for creating operational definitions

- Communication - will others know precisely what was measured, how it was measured, and what was included or excluded?
- Repeatability - could others, armed with the definition, repeat the measurements and get essentially the same results?
- Traceability - are the origins of the data identified in terms of time, source, sequence, activity, product, status, environment, tools used, and collector.

[Deming]




Tips for Operational Definitions ₂

Operational definitions also help pinpoint training needs for data collection.

The cost of data collection also bears on

- When the data will be collected
- Where the data will be collected
- Who will collect the data



Tips for Better Data Analysis


Why should we care about the data details?

Validity - apples to apples comparisons

Reliability - understand the impact of variation

Accuracy - knowing that there is a signal

Precision - level of certainty for responding to the signal




Tips for Analyzing Data

Critical inputs

- Knowledge of product or process being measured
- Driven by business/ technical issues or goals
- Quality of measurement data

Critical aspects of the analysis process


- Acknowledgement of and accounting for variation
- Appropriate use of analysis tools and techniques
- Resources and references (people, books)



Take the Data Deeper

To reduce variation pursue three investigative directions:


- Identify the assignable causes of instability and take steps to prevent the causes from recurring.
- If the process is stable but not capable (not meeting organizational or customer needs), then identify, design, and implement necessary changes that will make the process capable.
- Continually improve the process, so that variability is reduced and quality, cost, or cycle time are improved.



Tips for Finding and Correcting Assignable Causes

No formula or transformation algorithm is applicable. Just like debugging software – it requires good detective work.

- thorough knowledge of the process
- sufficient contextual data
- re-check assumptions, interpretations, and data accuracy
- pick up on clues provided by behavior patterns
- suspect everything
- relate chart signals to process events and activities
- check process compliance




Methods to Change the Process

Improving a stable process requires making changes to common cause entities and variables. Selecting the right change involves examination of:

- process decomposition and evaluation
- technology change
- cause and effect relationships
- products and by-products from other processes
- business strategies and management policies

These factors may well be the drivers for changing the process!



Tips for Changing the Process

Agree on process performance issues.

- What needs improvement, why, and how much?

Select process performance variables, target means, and variability.

Determine required changes to common cause entities and variables.

Select pilot process.

Execute and measure the changed process.

Compare new process performance data to historical baseline.

Make conclusions and recommendations.



Common Data Risks and Pitfalls

Analysis misses the “big picture”

Charts are colorful, but meaningless

Data set lacks robustness

No baseline for comparing current performance

Infrequent comprehensive rechecks of the data

Comparing or predicting process results without ensuring stability of processes



A Process Improvement Toolkit

Define	Measure	Analyze	Improve	Control
Benchmark Baseline Contract/Charter Kano Model Voice of the Customer Voice of the Business Quality Function Deployment Process Flow Map Project Management "Management by Fact"	Defect Metrics Data Collection Methods Sampling Techniques Measurement Sys. Evaluation Quality of Data	7 Basic Tools Cause & Effect Diagrams, Matrix Failure Modes & Effects Analysis Statistical Inference Reliability Analysis Root Cause Analysis 4 Whats 5 Whys Hypothesis Test ANOVA	Design of Experiments Modeling Tolerancing Robust Design Systems Thinking Decision & Risk Analysis	<u>Statistical Controls:</u> <ul style="list-style-type: none">• Control Charts• Time Series methods <u>Non-Statistical Controls:</u> <ul style="list-style-type: none">• Procedural adherence• Performance Mgmt• Preventive activities



Section II: From Data to Decisions

This concludes our introduction to understanding data and getting the most use out of your analyses.

In Section II: Data Analysis Dynamics we will

- share our experiences
- provide useful tips for how to make measurement work
- thread together methods, tools, processes
- provide a path for action





Analysis Dynamics ₁

Getting Started

- Identify the goals
- Black box process view
- Is the data right?
- Do I have the right data?

Decision point:

- If the data is not perfect, do I move forward or obtain better data?

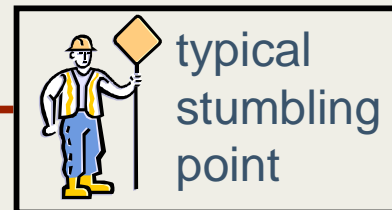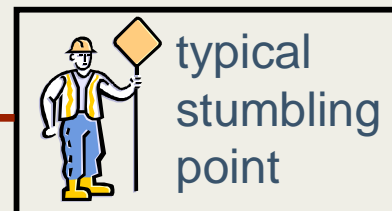





Analysis Dynamics ₂

Initial Evaluation

- What should the data look like?
- What does the data look like?
- Can I characterize the process and problem?

Decision point:

- Can I address my goals right now?
- Or is additional analysis necessary? at the same or deeper level of detail?
- Can I move forward?

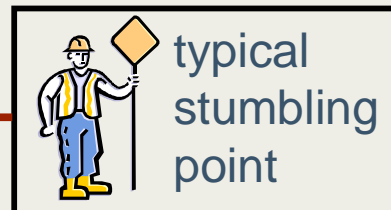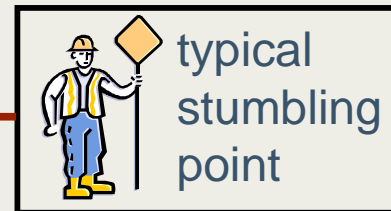



Analysis Dynamics ₃

Moving Forward


- Further evaluation
- Decompose the data
- Decompose the process


Decision point:

- Do I take action?
- What action do I take?

Repeat until

- root cause found
- at target with desired variation

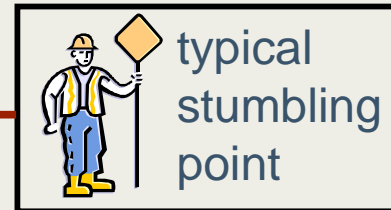

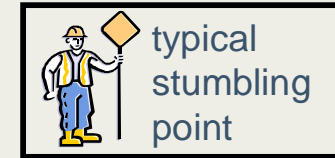

Identify the Goals ₁

Goals should be continuously generated.

Without data, goals are stated at a conceptual level.

By quantifying performance

- problems are characterized
- true customer specifications are understood
- quantitative goals statements can be made

Typical problems

- goals do not exist or have not been explicitly stated
- goals at different levels are disconnected




Identify the Goals ₂

Relevant tools and methods

- Voice of the Client
- Quality Function Deployment
- Management by Fact
- 4 Whats
- SMART goals
- FAST diagrams (Function Analysis Systems Technique)



Identify the Goals: Example

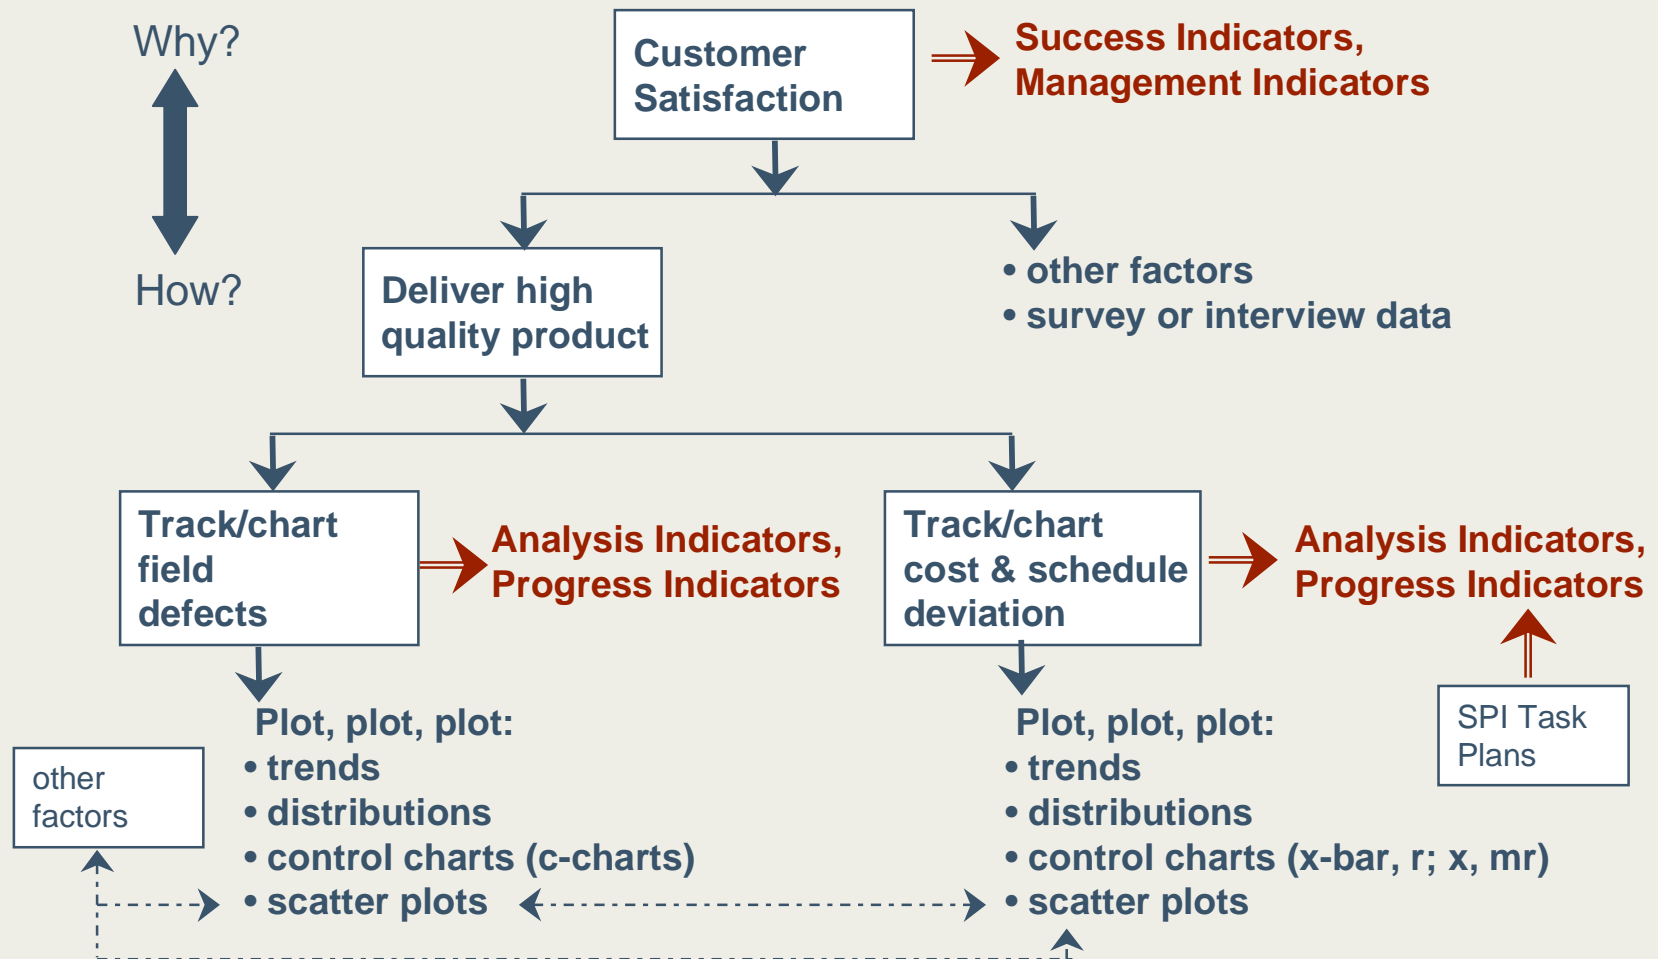



What if there are no “Business Goals”?

Without high-level business goals, data-driven improvement efforts quickly become fragmented.

Articulate business goals by

- Brainstorming with leadership
- Organizing results into strategic, operational goals
 - add in any tactics that emerged during brainstorming
- Performing hierarchical structure check
 - “How?” answered top to bottom
 - “Why?” answered bottom to top

Verify that tactics drive impact and success.



Black Box Process View

What are the key inputs and outputs to your process?
What are key in-process variables over which you have control?

Typical problems

- Omitting this step - avoids examination of your assumptions and understanding of the process
- Selecting a view that matches the issue or study level
- Constructing a view that does not match reality


Relevant tools & methods

- Process Mapping
- Mental Model




What is a Process?

- Any set of conditions or causes that work together to produce a given result
- A system of causes which includes people, materials, energy, equipment, and procedures necessary to produce a product or service

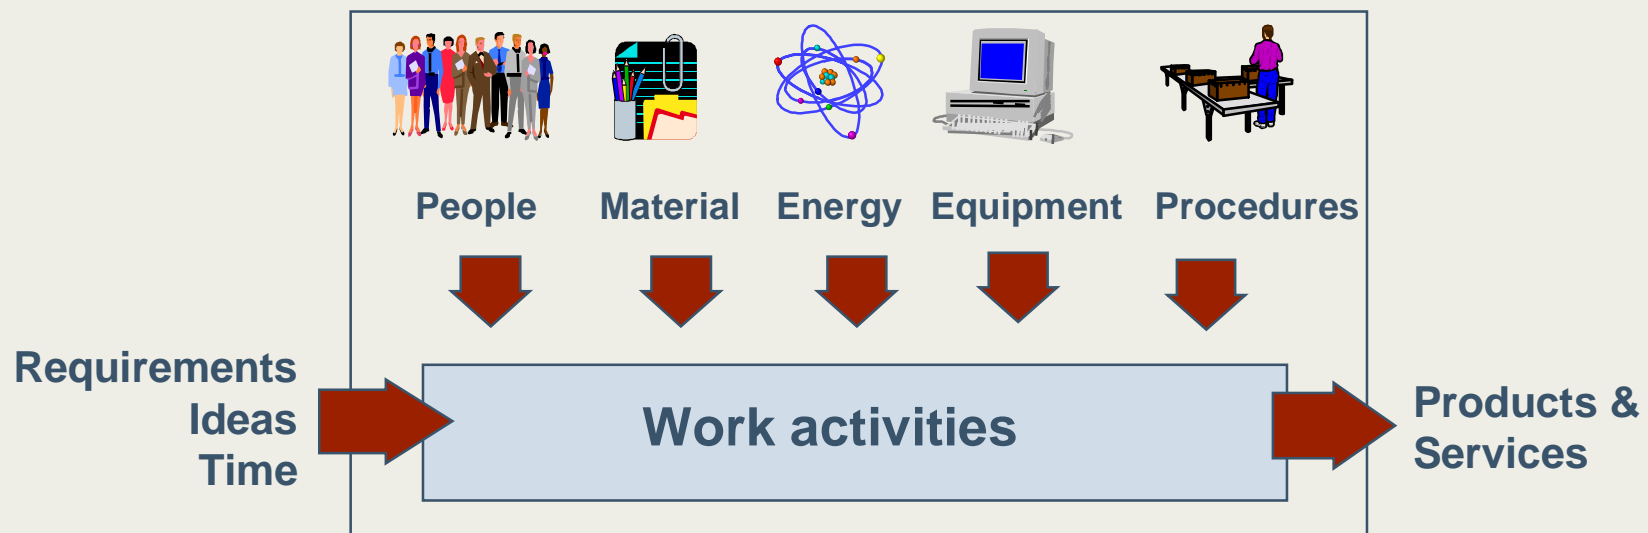





Problem Management Process

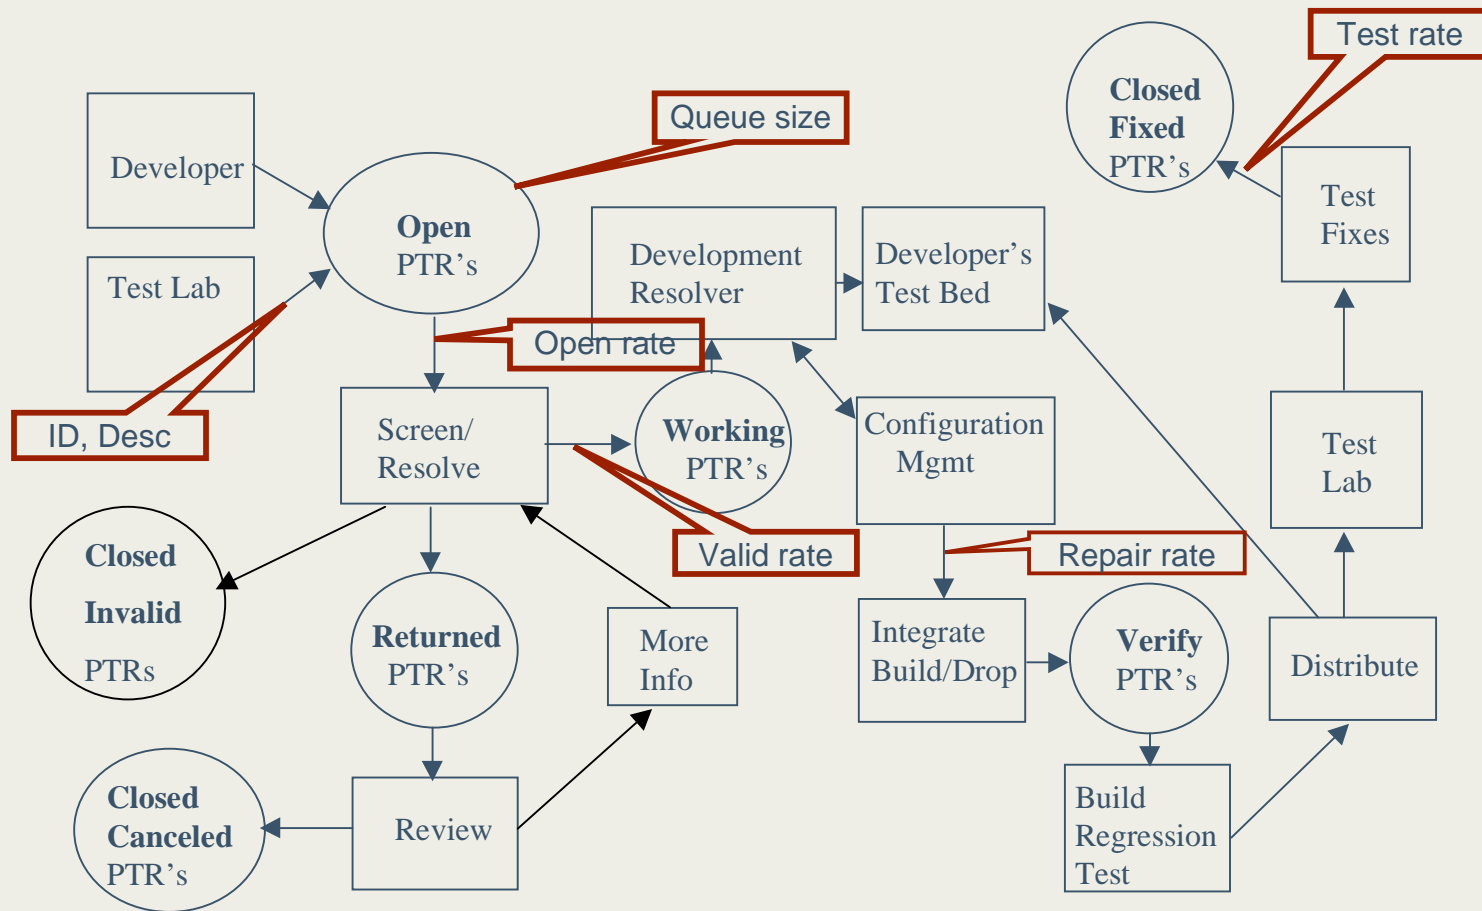



Development Process Map

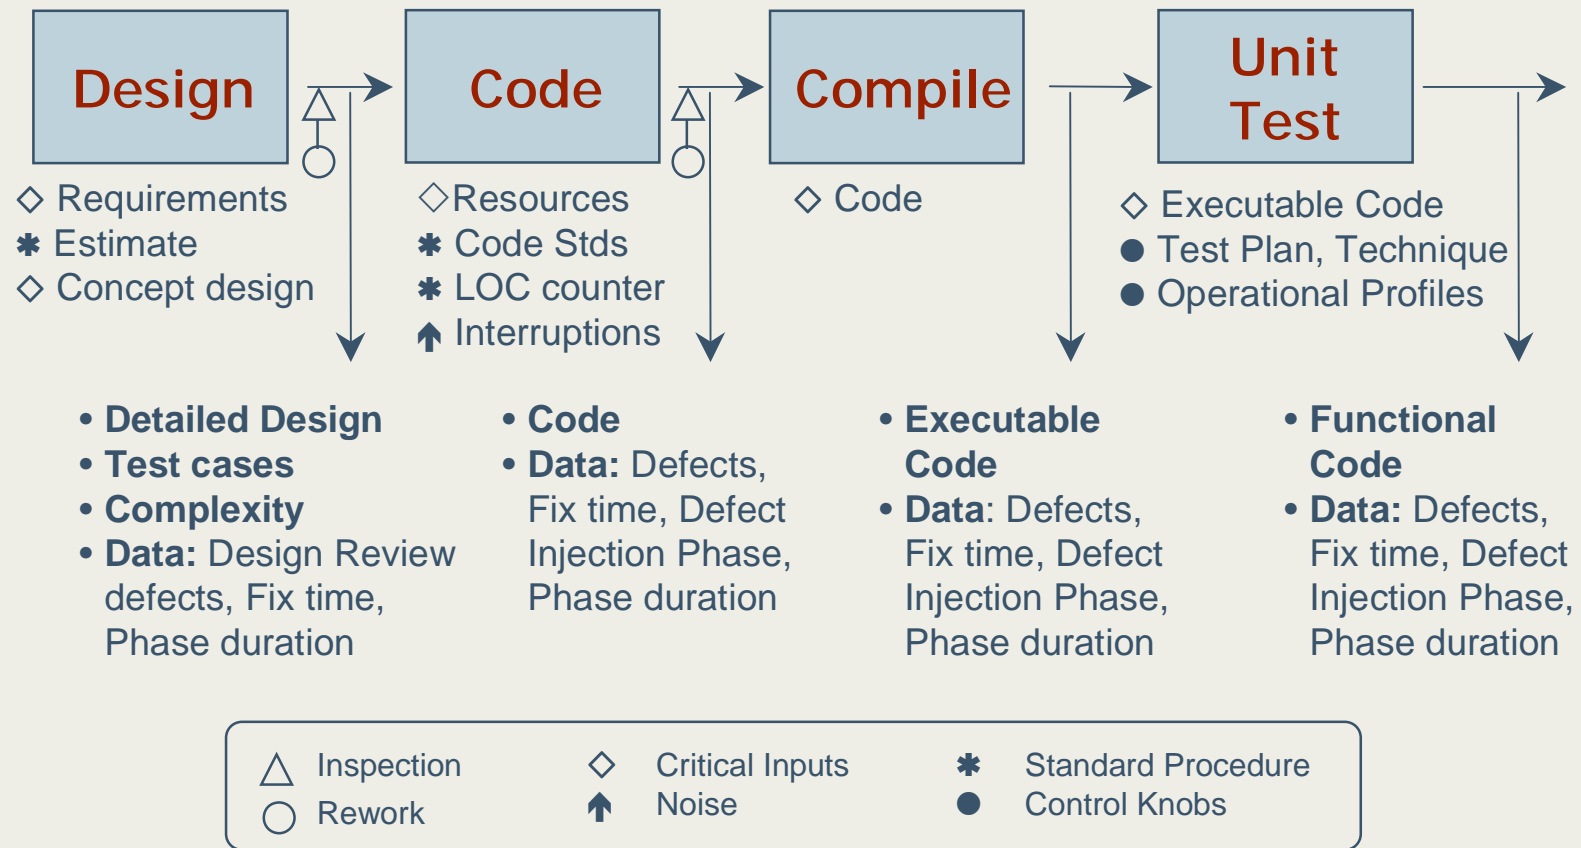

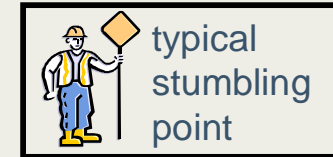

Is the Data Right ?

Understand the data source and the reliability of the process that created it.

Typical problems

- wrong data
- missing data
- accuracy
- veracity
- credibility
- skewed

Data transformations

- ratios of bad data still equal bad data
- increasing the number of decimal places does not improve the data



Is the data right? - Example

Inspection Data Set 1


# of People	Preparation Effort	Size (SLOC)
5	3.7	2070
6	21.0	555
6	5.1	102
8	18.0	260
6	12.0	101
8	22.1	165
6	11.8	1764
8	9.2	348
5	7.3	76
8	16.5	1575
5	12.5	2441
6	18.3	126
5	6.5	88
6	7.1	383
8	10.2	111
8	11.5	192
6	5.2	212
7	9.3	401
7	8.8	815
5	31.0	551
5	4.9	429
8	12.7	883
9	30.3	1017
8	26.4	2116

Inspection Data Set 2

# of People	Preparation Effort	Size (SLOC)
4	2.0	350
3	1.5	210
3	2.0	333
3	2.0	430
3	2.0	400
1	2.5	400
4	3.0	440
3	2.5	450
3	3.5	440
3	3.0	255
3	2.8	470
4	2.8	500
3	1.5	253
2	0.7	78
4	7.0	900
3	3.5	400
3	4.8	1014
3	1.5	120
5	15.0	1495
4	4.0	200
4	4.0	200
4	4.0	200
4	4.0	200
3	4.5	200
4	4.0	200

Which set of data appears to be more credible?

Why?

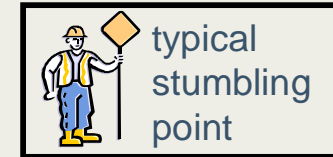

Do I Have the Right Data? ₁

Analyses can get off on the wrong track if the data is misunderstood, or implicit assumptions are made about it.

Analyst must ask questions:

- “Do I have measurements of all the significant and relevant factors?”
- “Does this data represent what I think it does?”

Typical examples

- total SLOC count in place of new/changed SLOC count
- date recorded is often not the same as date observed
- use of averages based on unstable processes (as in normalization)




Do I Have the Right Data? ₂

Frequently the answers to these questions can not be answered by a simple “eyeball” test, then an initial evaluation must be made using various tools and methods.

Relevant tools & methods

- Process Mapping
- Goal-Driven Measurement templates
- Operational definitions
- Initial evaluation/exploration assessment using statistical tools

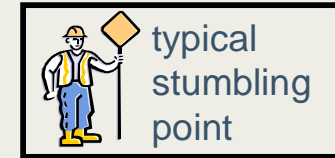


Initial Evaluation / Exploration ₁

What should the data look like?

- first principles or relationships
- mental model of process (refer to that black box)
- what do we expect

What does the data look like?

- Magnitude, range, and frequency
- look at absolute and percentages
- the shape of the curve

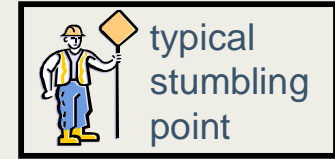

Initial Evaluation / Exploration ₂

Relevant tools & methods

- descriptive statistics
- run charts or SPC charts
- time series
- boxplots
- correlation plots – first scan of relationships



Exploration Example₁

Is this the right data?

- unexpected high inspection rate
- unusually large SLOC per inspection
- How many inspectors contributed to the prep-hr effort?


Review ID	Defects	SLOC	SLOC/RevHr	Rev PREP	Defect/KSLOC	Defects/hour
30	9	9,800	933.3	10.5	0.918	0.857
32	5	16,091	804.6	20	0.311	0.250
34	45	73,344	2,716.4	27	0.613	1.667
36	45	32,352	808.8	40	1.390	1.125
37	12	51,525	5,725.0	9	0.233	1.333
41	13	98,207	4,214.9	23.3	0.132	0.558
43	19	16,091	707.3	22.75	1.180	0.835
44	13	204,216	8,168.6	25	0.064	0.520
45	14	80,775	4,895.5	16.5	0.173	0.848
47	2	72,747	5,914.4	12.3	0.027	0.163
48	14	10,901	681.3	16	1.284	0.875
50	11	11,468	1,146.8	10	0.959	1.100
52	31	16,909	573.2	29.5	1.833	1.051
53	17	28,538	1,902.5	15	0.596	1.133
57	22	18,136	824.4	22	1.213	1.000



Exploration Example₂

Little to no
correlation
between
SLOC size
and
inspection
effort

$R = 0.04549$
 $R^2 = 0.00207$

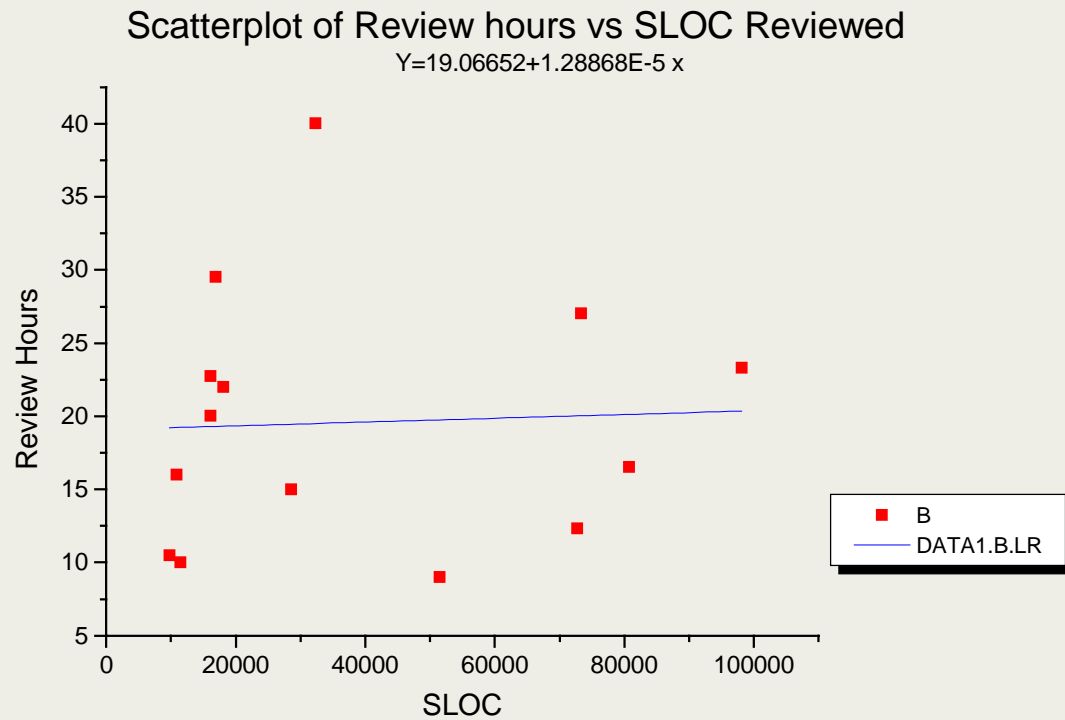




Evaluation Example₃

Given there is no correlation between review time and the amount of SLOC reviewed,

What questions can be raised about the

- SLOC count?
- review time?
- number of defect?
- defect density?
- defects discovered per review hour?

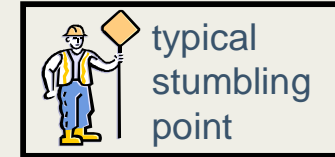

Can I Move Forward?


Does the initial evaluation/exploration of data support the critical assumptions?

What are your assumptions?

- are they explicitly articulated?
- for process, for data?

What are the risks you are taking if you move forward with the assumptions you have made?

Is the variability or presence of process issues so significant that they overshadow data issues?

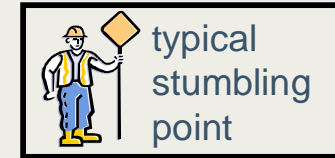

Moving Forward ₁

Moving forward is often a judgment call

- can proceed with further data and process analysis in parallel with improving data
 - it's a tradeoff and a matter of balancing risks
- else get the “right” data before proceeding

Types of actions

- removing assignable causes
- reducing common cause variation
- testing hypotheses
- further decomposing data and process



Moving Forward ₂

This is the “heart” of the analysis

- Explore, establish/confirm cause-effect relationships
- Plot trends over time
- Look for and identify the “drivers” or dominant factors
- Gauge the variation of the variables
- Find assignable causes
- Determine stability and capability of processes
- Decompose to find root cause

Relevant tools & methods

- The “Basic Tools”



Moving Forward- Basic Tools

Fundamental data plotting and diagramming tools


- Cause & Effect Diagram
- Histogram
- Scatter Plot
- Run Chart
- Box and Whisker Plots
- Pareto Chart
- Control chart

The list varies with source. Alternatives include

- Bar charts
- Flow Charts
- Descriptive Statistics (mean, median and so on)
- Check Sheets




Moving Forward- Establish Relationships

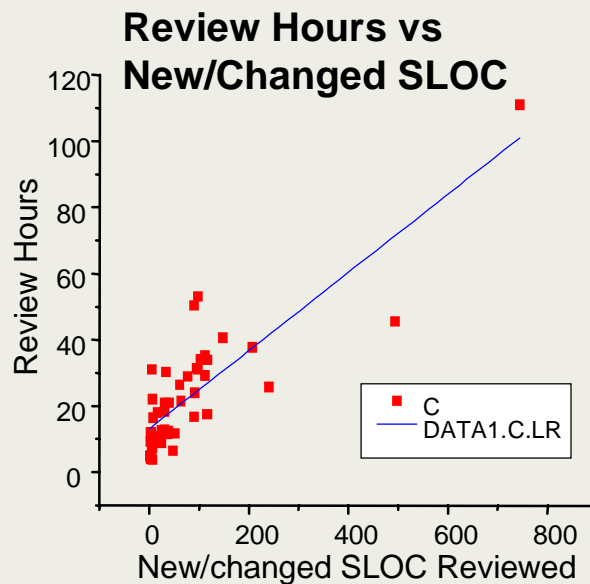

$$R = 0.83569$$

$$R^2 = 0.69838$$

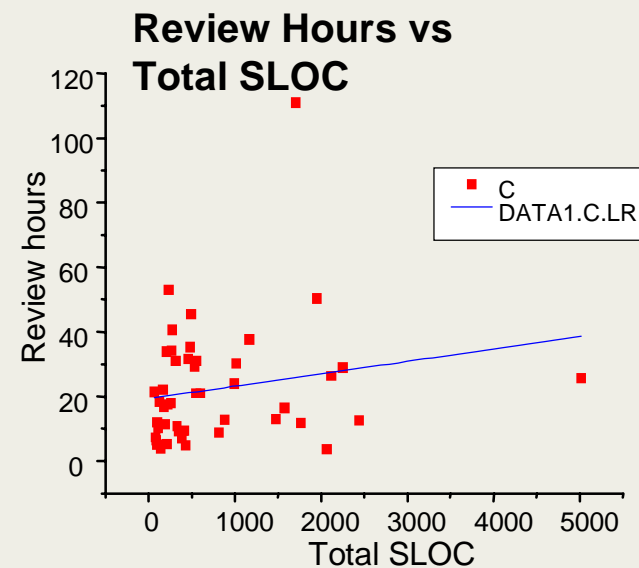


$$R = 0.19244$$

$$R^2 = 0.03703$$




Moving Forward- Identify Dominant Factors

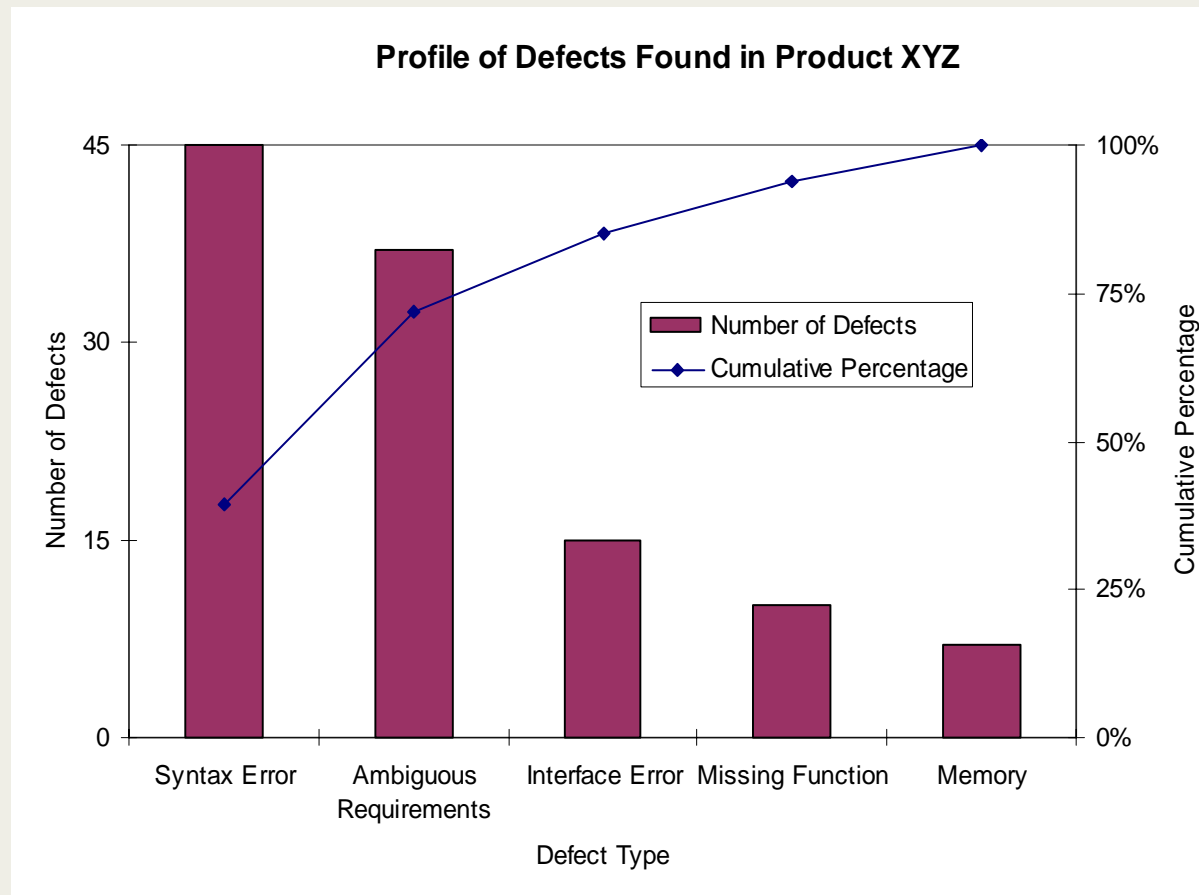




Moving Forward- Determine Extent of Variability ₁

Basic Histogram shows
distribution, spread.

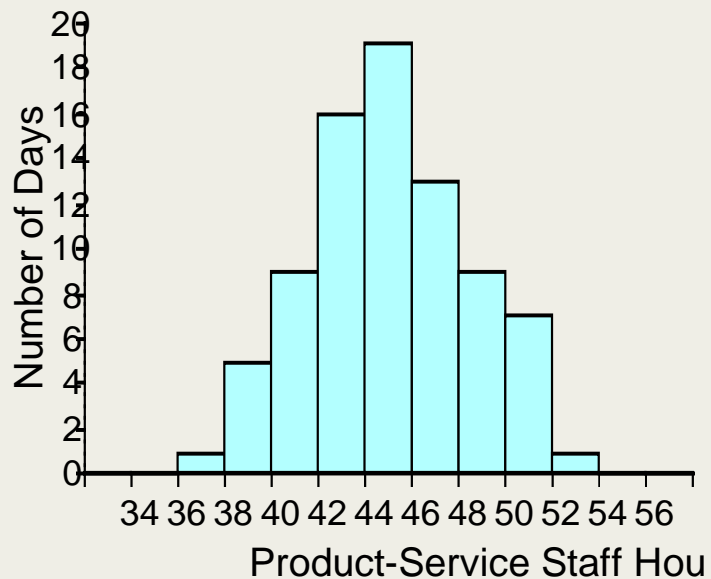


Look for multimodal distributions.
They point to multiple processes.

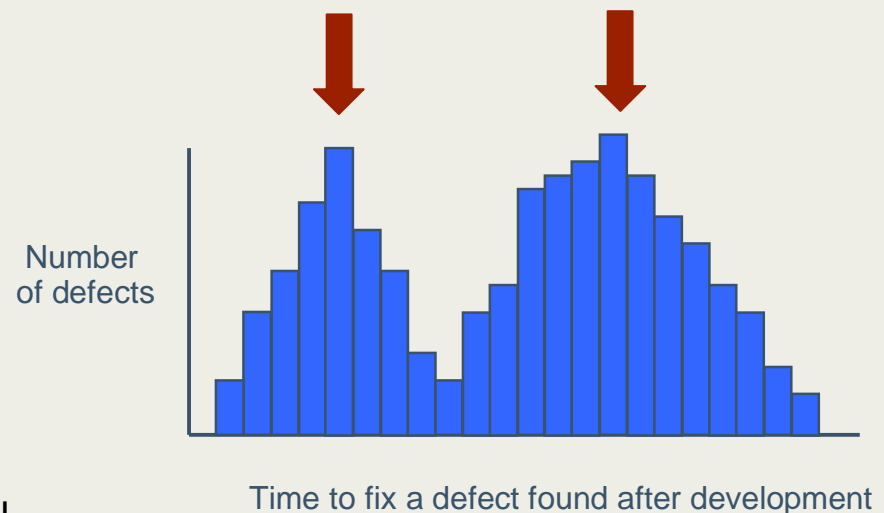



Moving Forward- Determine Extent of Variability ₂

Add control
limits to reflect
process
capability

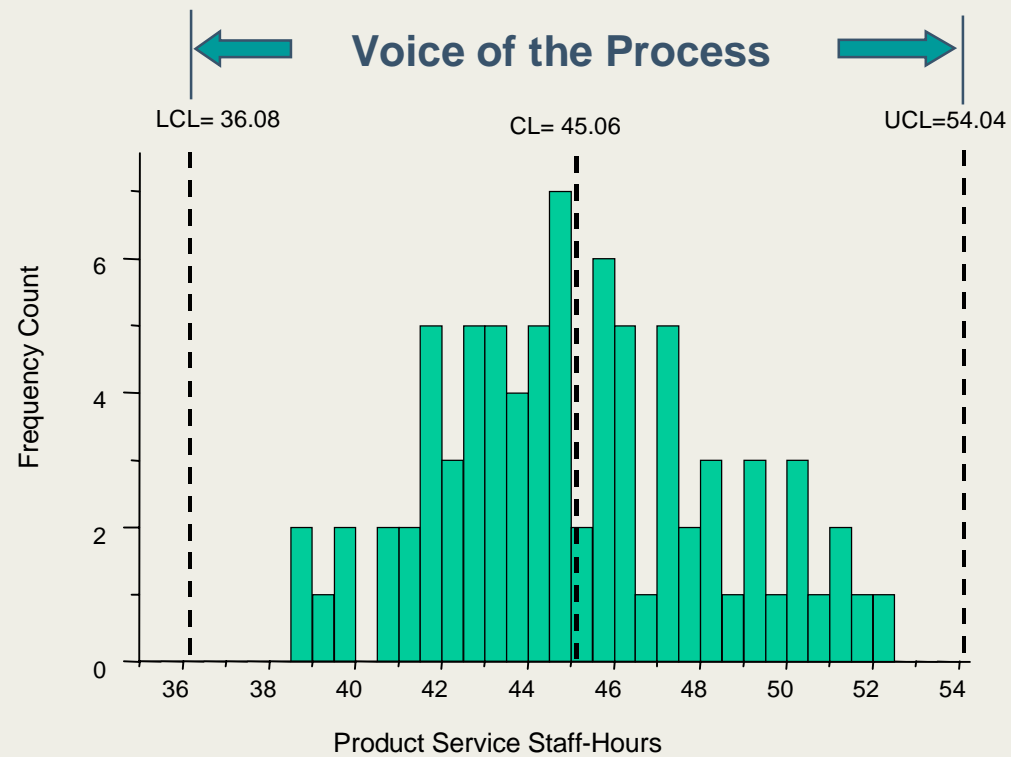




Moving Forward- Determine Extent of Variability ³

Add
specification
limits:

Process
Capability

vs.

Capable
Process

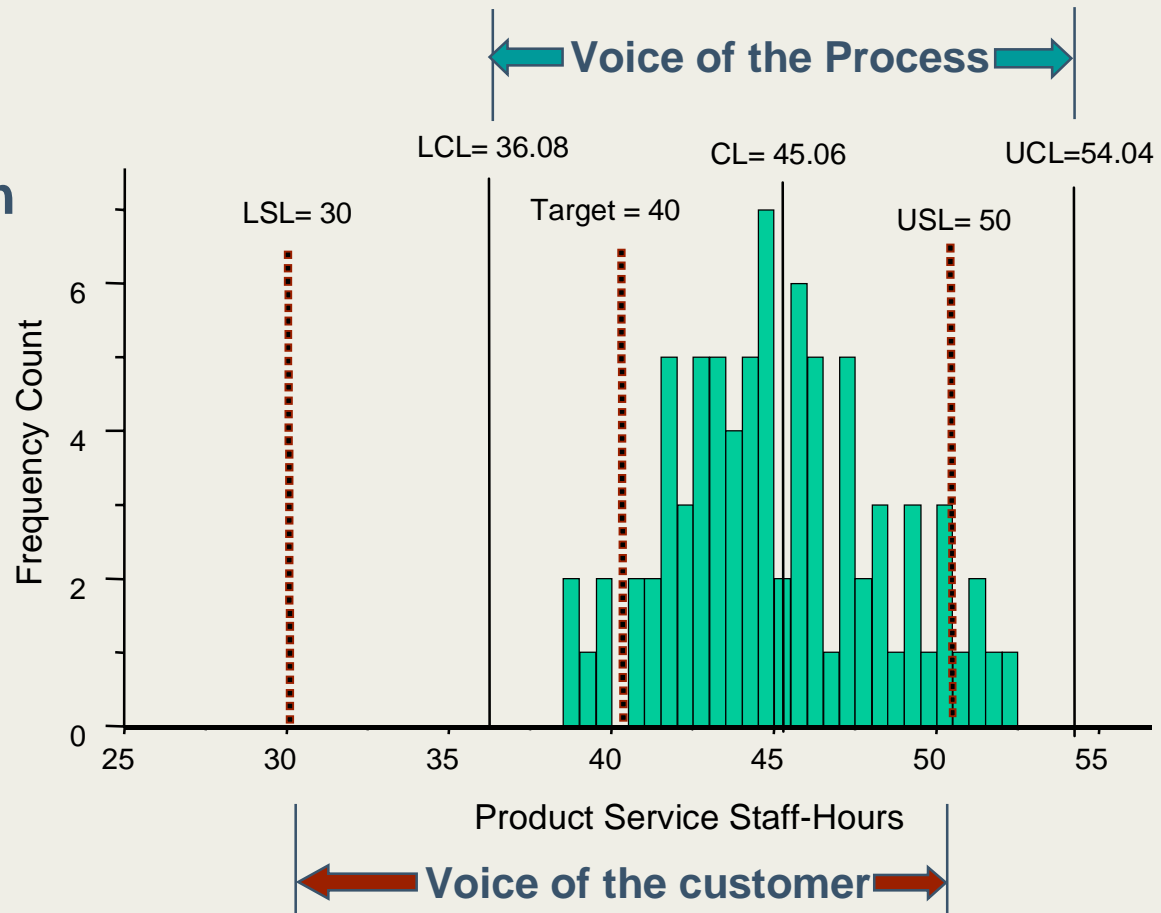




Moving Forward- Find Assignable Causes

Problem Repair- Wait time

- Issue: Delays in repairing software test sets
- Control chart indicates process unpredictable
- Pattern suggests mixture of cause systems

2nd Qtr and 3rd Qtr Problem Closures

Wait time-days

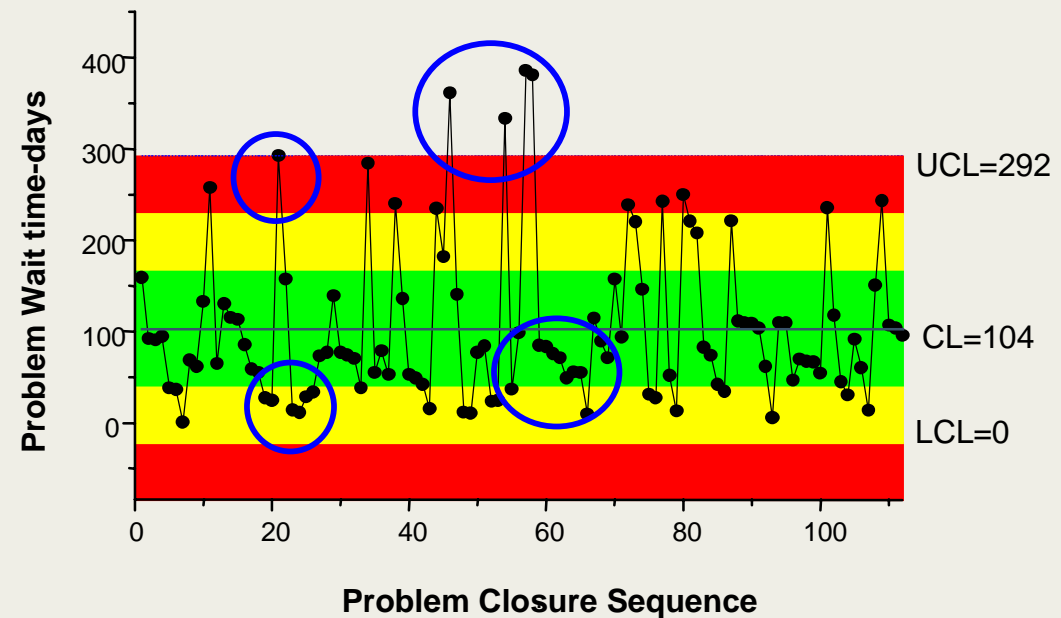




Moving Forward- Finding Assignable Causes

Problem Repair- Wait time

Histogram indicates data includes possible mixture of cause systems


- One process for problems up to 150 wait days
- A second process involving more than 150 wait days

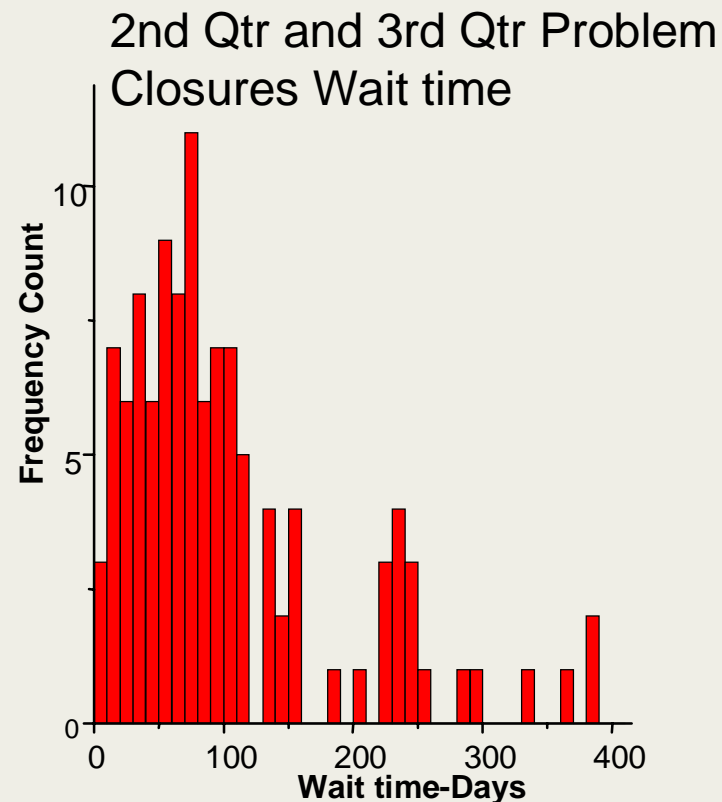



Moving Forward- Find Assignable Causes

Problem repair Wait time < 150 days

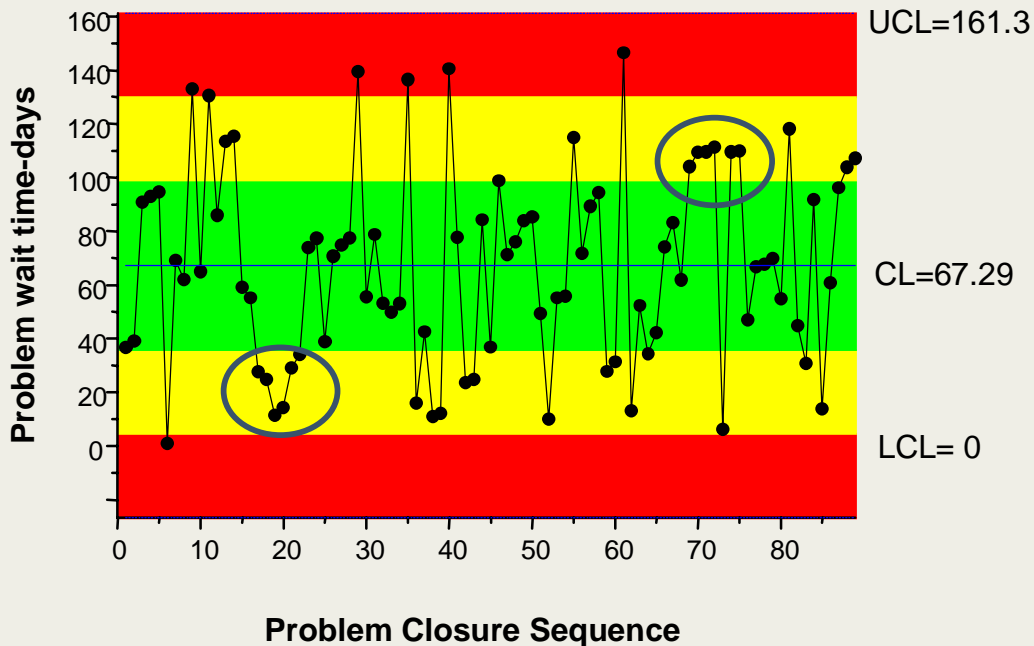


One process with 67-day average wait time

- Near stable
- Investigate cause system for driving factors

- § nature of defect
- § staffing
- § equipment
- § test set type



Moving Forward- Find Assignable Causes

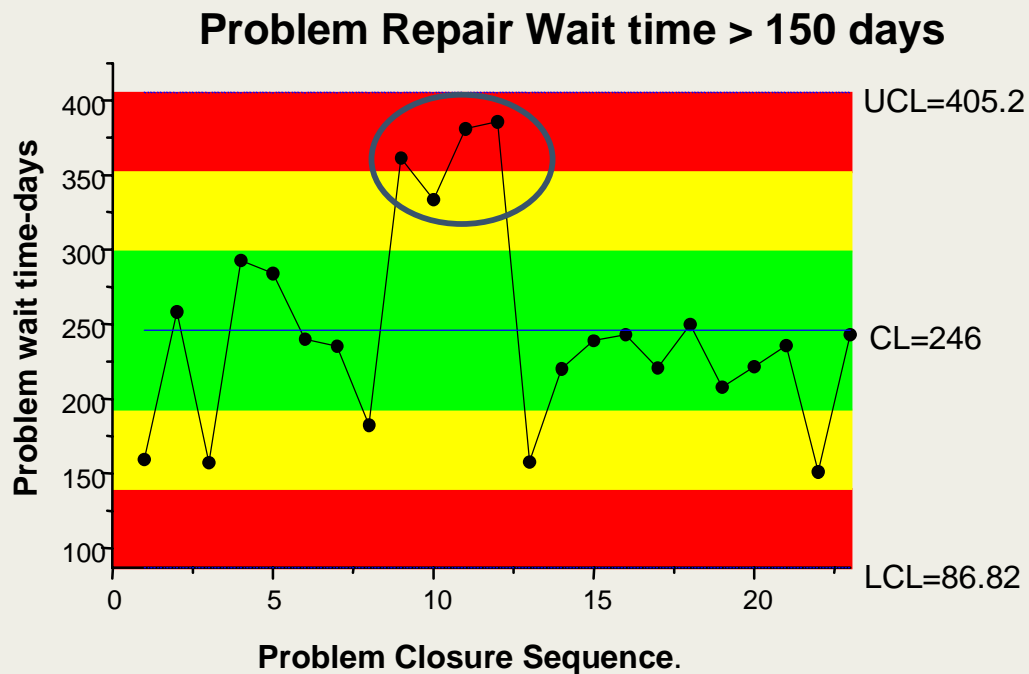

Another process
with average wait
time of **246** days



Moving Forward- Find Assignable Causes

Problem Repair-Wait time

- Determined that there were two processes in operation
- Since both were (near) stable, necessary to examine cause systems for components that may be the driving contributors to wide variation and make appropriate changes to each process
- Activities undertaken:
 - Classification of problems (defects) reported and found
 - Classification of test sets
 - Evaluation of test equipment availability
 - Availability of necessary skills



Decomposition

Decomposition is separating the process into its component parts or data by one or more of its attributes

- Makes sources of variation visible
- Provides opportunity for process improvement


This approach is useful

- when process is stable and process change is needed to reduce variation
- for highlighting unusual data attributes that may be the source of variation



Decompose Data

- Defect data decomposed by year
- May also decompose by project type, organizational slices, and so on

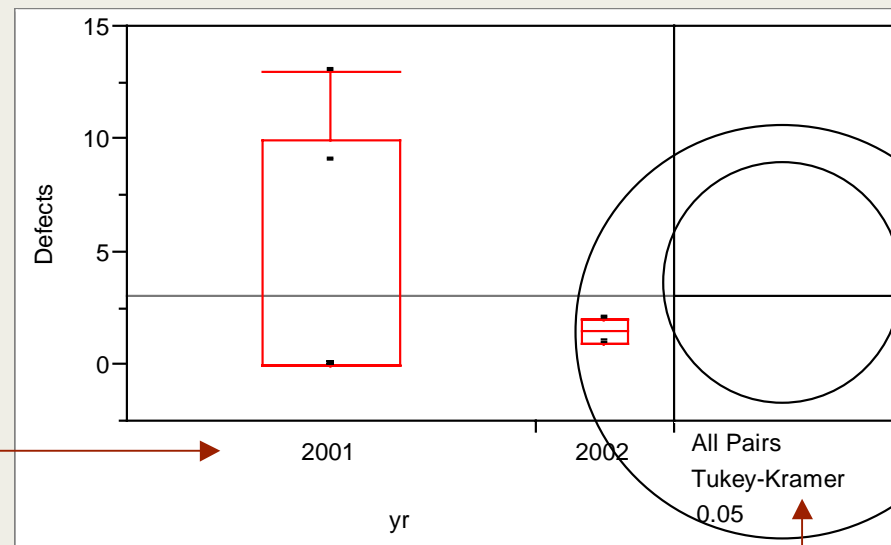

- Means comparison test determines if data groupings are statistically different. **These groups are not different.**
- Values and sample size are accounted for in the test.



Decompose Process Data ₁

Twenty one components from same product, same team

- approximately same size
- approximately same complexity

Defects found in design inspection are:


Component	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	Totals
Defects	12	16	18	32	22	16	23	35	15	27	16	25	20	26	20	23	23	36	22	27	17	471
Defect Type	Number of Defects per Type per Component																					
Function	3	5	4	4	4	3	3	20	4	11	2	3	3	5	3	7	4	5	5	15	2	115
Interface	2	2	4	4	3	4	2	3	3	4	2	3	5	3	3	3	2	16	6	2	4	80
Timing	1	1	0	1	1	0	2	1	0	0	2	0	1	1	1	1	1	0	1	0	0	15
Algorithm	0	0	1	14	2	0	0	0	0	0	0	1	5	2	7	6	5	1	2	0	1	47
Checking	1	1	5	1	7	1	1	2	0	1	6	3	1	12	1	0	2	4	3	5	2	59
Assignment	0	2	0	4	1	2	1	3	2	3	2	8	1	0	2	1	2	1	0	1	1	37
Build/Pkg.	3	1	1	2	1	0	0	4	3	6	1	0	2	1	1	1	3	2	2	2	1	37
Document	2	4	3	2	3	6	14	2	3	2	1	7	2	2	2	4	4	7	3	2	6	81



Decompose Process Data ₂

Apparent stable process behavior

- But, defect rate too high and too much variation
- Explore examination of defects by type

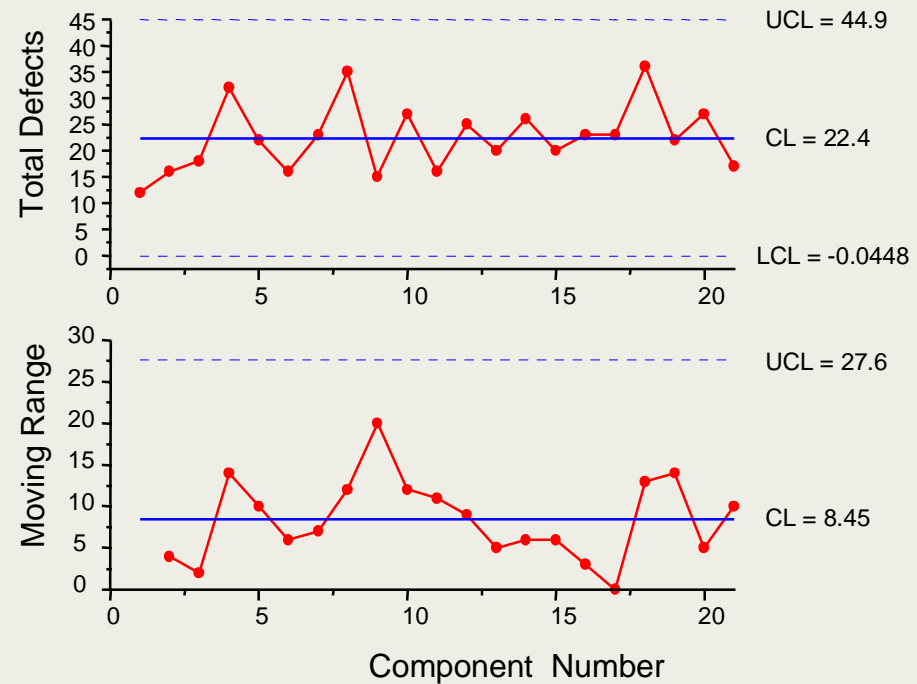




Decompose Process Data₃

Establish process stability
by defect type


X's mark assignable
causes by defect type

Elimination of assignable
causes will reduce variation

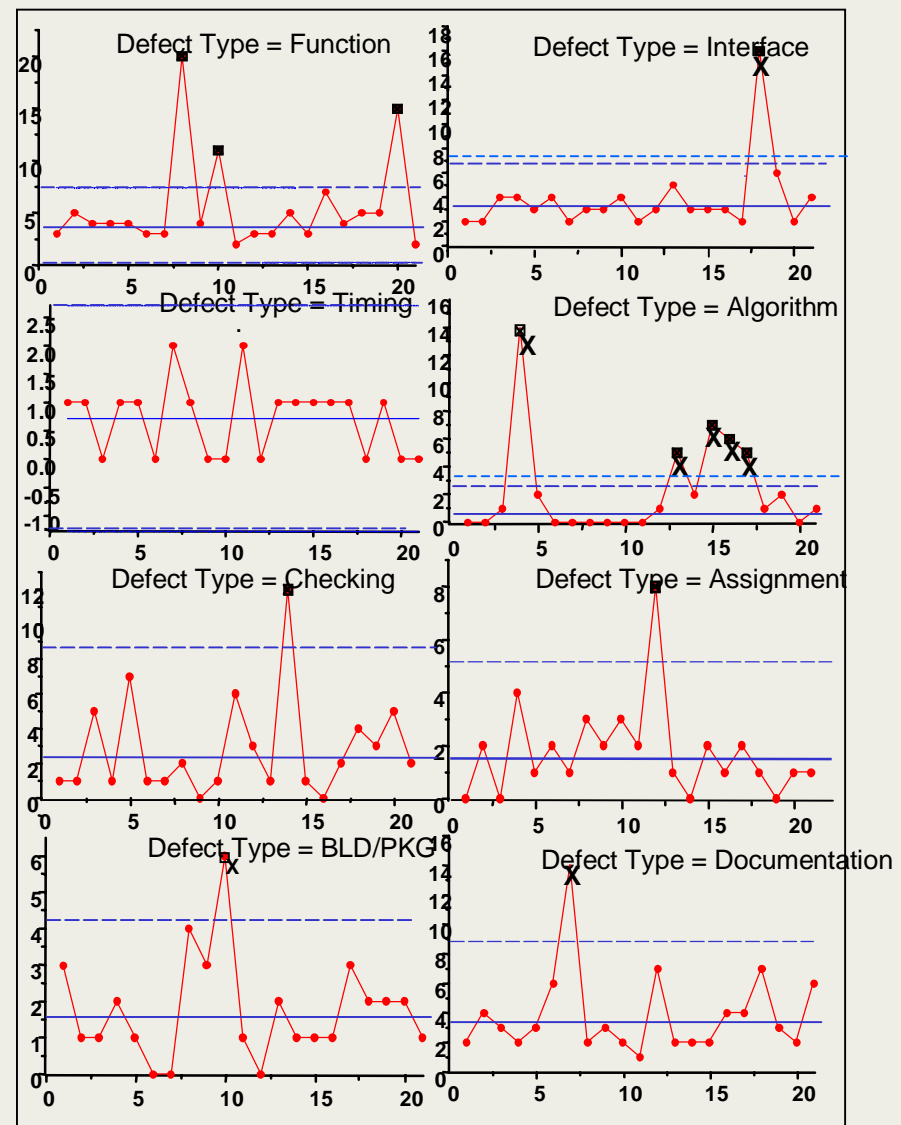



Potential Process Improvement

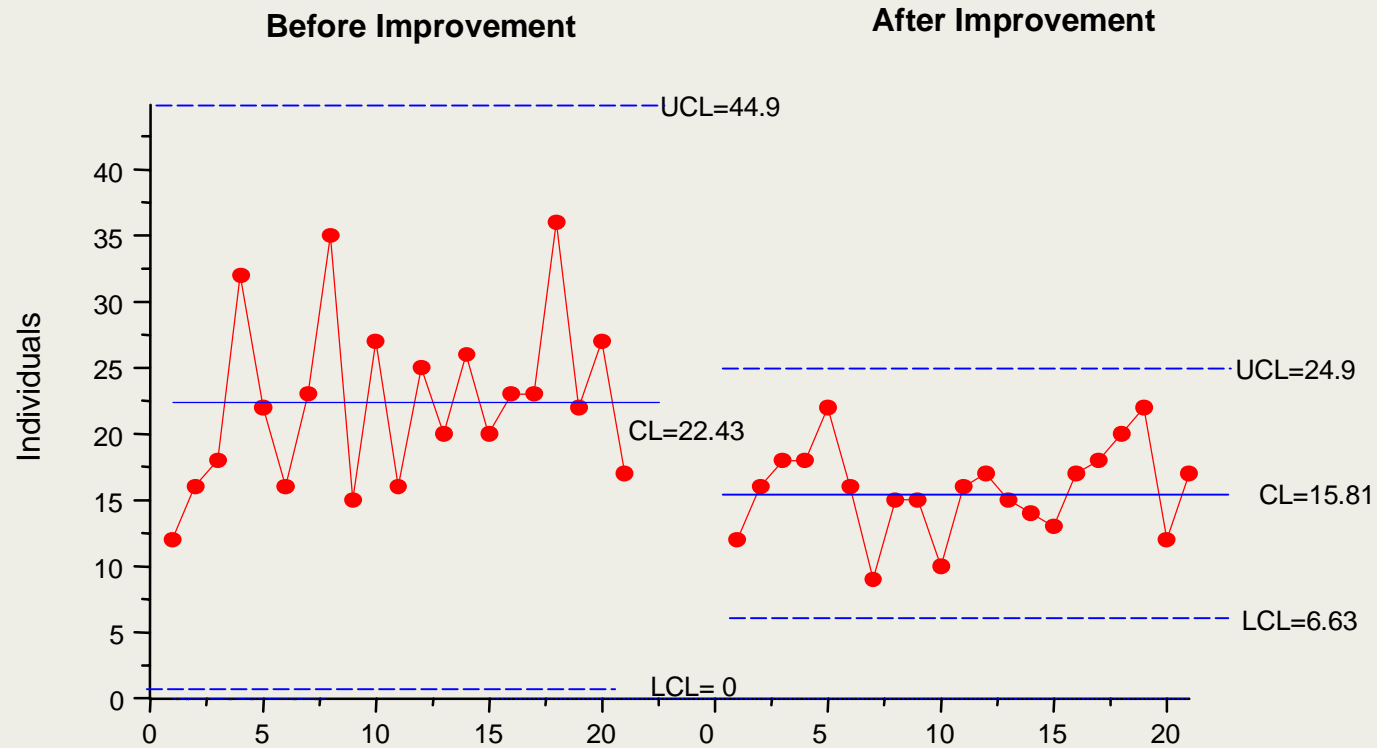

Control chart on right reflects potential improvement if all assignable causes removed



Repeat until.....

Root cause(s) found

The process is at target, with desired variability

Other process performance data has not suffered

- I.e. the process has not been suboptimized

Relevant tools & methods

- Management by Fact
- 5 Whys
- Dashboard



Number-Crunching Tools

Analysis done in....	Comment
Spreadsheet (Excel)	<ul style="list-style-type: none">• Most people have a copy• OK for some basic charts• Nice for presentations• Otherwise quite limited
Excel Addin	<ul style="list-style-type: none">• Many new add-ins available• Enables a wider variety of charts
Standalone SPC Package	<ul style="list-style-type: none">• May be better suited for charts which an organization is routinely monitoring than for exploration
Statistical Package	<ul style="list-style-type: none">• Higher learning curve than others• Best for those doing data-driven improvement as large part of their workload



Section III: Case Study

This concludes our introduction to analysis dynamics.

In Section III we will showcase these dynamics through a case study.

Context:

- organization project portfolio includes both new development and maintenance
- project size and complexity varies significantly
- project schedules vary from <1 month to >18 months



Case Study Overview

This case study features the following:

- pursuit of customer satisfaction
 - via proxies of defects and effort & schedule variance
- initial data evaluation and exploration
- initial data and process decomposition
- separation of goals into “monitor” and “improvement”
- first iteration of root cause analysis for improvement goals



Along the way, we will use this stop sign

- to pause and generalize,
- to ask probing questions,
- to extend the topic



Analysis Dynamics ₁

Getting Started

- Identify the goals
- Black box process view
- Is the data right?
- Do I have the right data?

Decision point:

- If the data is not perfect, do I move forward or obtain better data?

Sound bytes

“We didn’t stumble here—there were goals from the beginning—but it took time to clarify them, to make them quantitative, and to separate *monitoring* from *improvement*.”

“We had a lot of missing data. We conducted “data archaeology” as much as possible to backfill the data set. Learnings were used to improve the automation of data collection.”

“Our data wasn’t perfect, but no matter how we sliced it, there were clear improvements to pursue.”



Analysis Dynamics ₂

Sound bytes

Initial Evaluation

- What should the data look like?
- What does the data look like?
- Can I characterize the process and problem?

Decision point:

- Can I address my goals right now?
- Or is additional analysis necessary? at the same or deeper level of detail?
- Can I move forward

• “We were able to identify many of the “data rightness” issues without exploring the data. But, in some cases, it was necessary to dive into the data to identify the issues.”

• “For earned value data, we found the process to be consistently “out of spec,” yet the external customers seemed satisfied. Reconciling the ‘voices’ of the process, external customers and internal management is part of the process.”



Analysis Dynamics ₃

Moving Forward

- Further evaluation
- Decompose the data
- Decompose the process

Decision point:

- Do I take action?
- What action do I take?

Repeat until

- root cause found
- at target with desired variation

Sound bytes


“Initial iterations of decomposition will be shown. Because of risks associated with imperfect data, each conclusion needs to be carefully weighed against the need for additional verifying data.”



Business Objectives

Goals from the beginning of effort

Project: What are leading in-process indicators of success? Where are improvements needed?

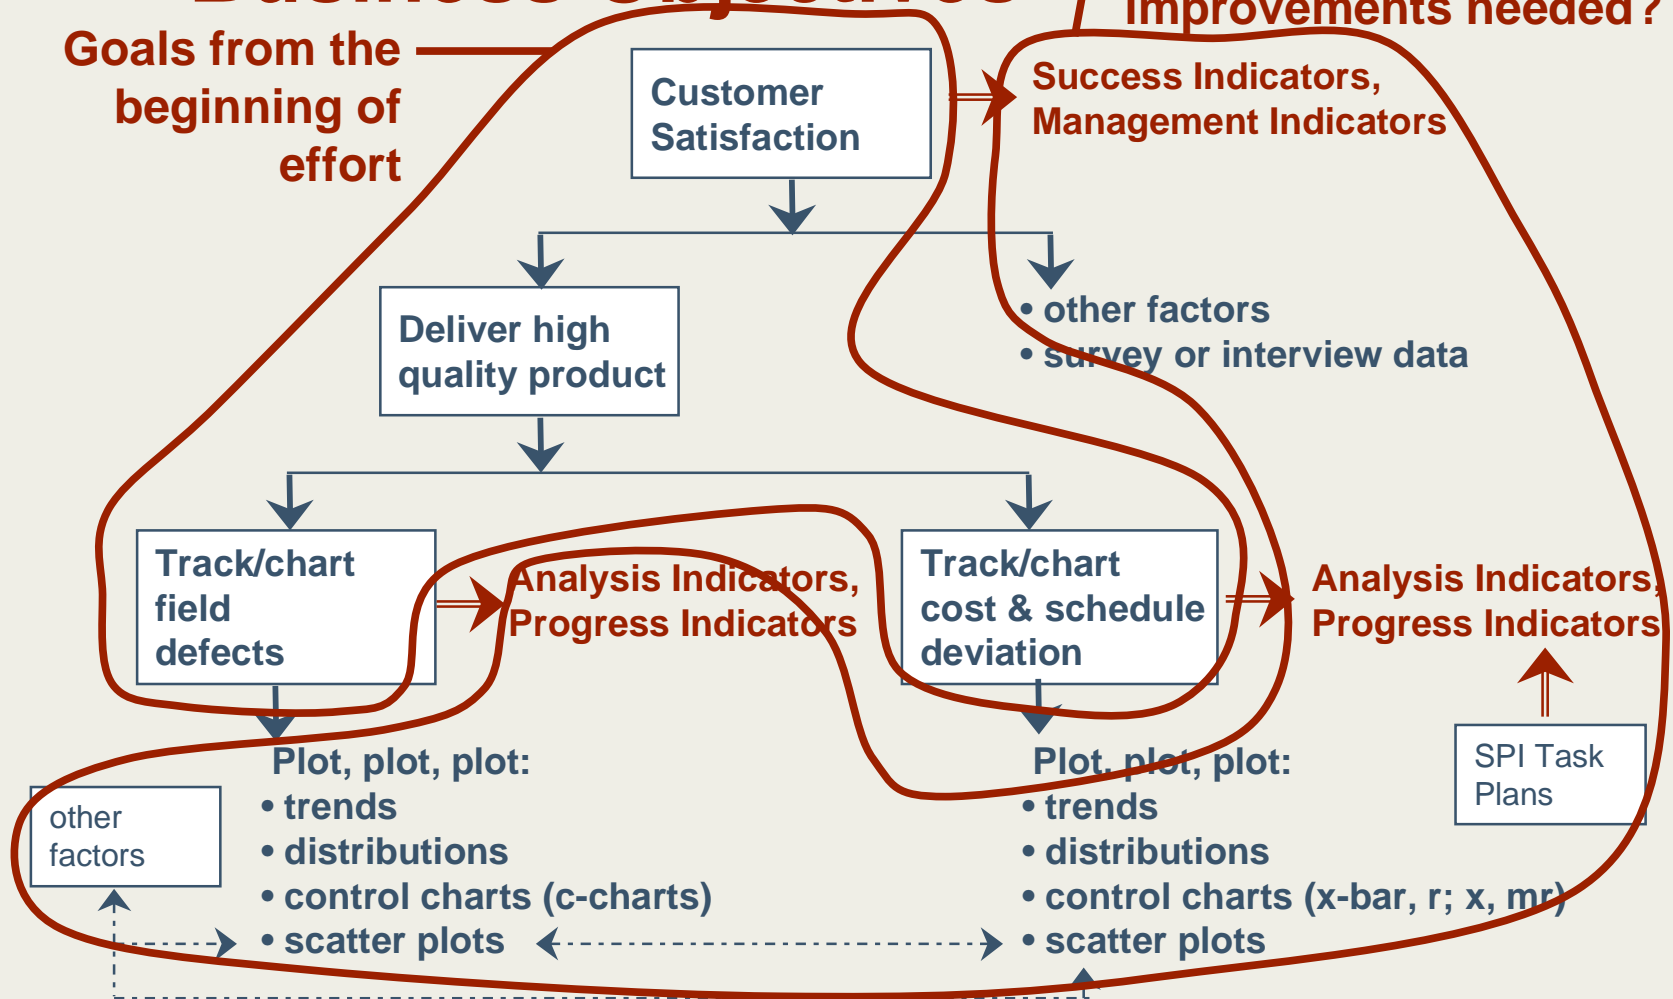



Customer Data

- What data are readily available data?
 - post-project surveys
- Data archeology
 - What has been communicated via emails, phone calls
- Is the data “perfect”? **NO**
 - few responses
 - qualitative responses
- New data collection needed:
 - updated, routine customer survey



By the way, is data **ever** perfect? Can you afford to wait for perfect data?



Customer Data - Sample

Qualitative comments, all positive:

- Pleasure to work with!
- Outstanding in all aspects!!
- If this team had been on this project from the start a lot of things may have gone smoother.
- Really good to work with. Have been working with them 2-3 years now. They do a good job and we get along well.

Quantitative comments

- Finished testing without having to create any additional builds.
- We were able to save three flights.



Defect Data

- What data are readily available data?
 - peer review inspection data
- Data archeology
 - field defects and confirmation of in-process defects
- Is the data “perfect”? **NO**
 - missing data
 - defect data skewed toward low priority defects
 - variations in operational definitions
 - feedback loops at group level, not org level
- New data collection needed:
 - confirmed operational definitions
 - improved automation of data collection process



Field Defect Data Baseline



Organizational goal: 0 field defects

Field defects

	Field Defects
FY 01	4
FY 02	4

In-process defect detection

- # of defects vs. development life cycle

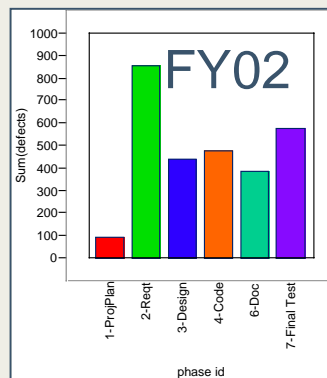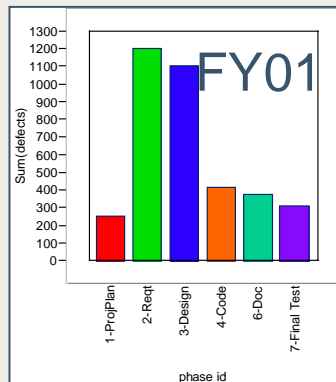

When your “count for the year” is 4, how useful are control charts?

And, if your counts are higher?

Leading in-process indicators are what you should consider for control charting.



Earned Value Data

Readily available data

- monthly process effort, cost, schedule
- compared to specification
 - with text entry for out of spec causes

Data “archaeology”:

- completed project data
 - final vs. original with differences categorized



Is the data “perfect”? **NO**

- losing track of replanning impact on performance
- monthly data uses non-homogeneous sample
- sparse data – some parts of organization better represented
- not sure if “extreme” outliers can be excluded



Completed Project Data Baseline

	% effort variance	% sched variance
average	-66.1%	-15.0%
standard deviation	415.9%	38.3%
median	0.9%	-8.1%
min to max	-2689.9% to 50.1%	-99.8% to 128.0%
n	42	42
capability notes (spec = +/- 20%)	45.2% outside spec	40.4% outside spec

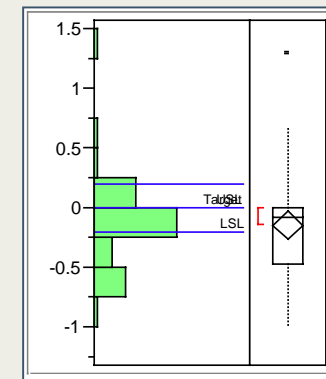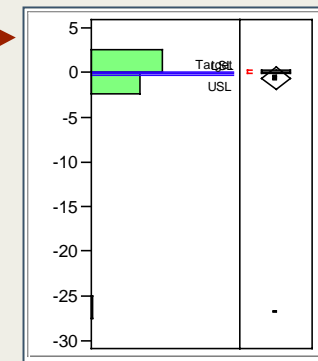

This represents (initial plan – final actual)

- negative numbers are overruns
- schedule is in terms of calendar days

It is the total cumulative variance

- customer-requested/approved changes are included
- one way or another, this is what the customer sees



Completed Project Data - Decomposed

Contribution to total variance, by internal/external categories

internal/external categories	median contribution toward total effort (cost) variance	# of projects reporting	median contribution toward total schedule variance	# of projects reporting
internal project	-30.83%	7	-34.32%	4
internal organization, outside project	-1.25%	5	-73.77%	3
external, reqt	-22.48%	10	-20.20%	10
external, sched	0.00%	15	-98.36%	17

“Internal” and “external” taxonomy selected based on “sphere of influence and control”

Risk: while “internal causes” seem to be a significant opportunity, a small number of projects reported such causes



Explore, Evaluate (Plot, Plot, Plot) ₁

	% effort variance	% sched variance
avg	-2%	13%
std dev	33%	36%
median	2%	7%
min to max	-95% to 50%	-128% to 71%
capability notes (spec = +/- 20%)	43.8% outside spec	39% outside spec



When flyers are removed

- Averages closer to target, spread narrowed
- Medians minimally affected
- Still nearly as many outside specs
- Small “second peak” more visible

• What are guidelines for removing flyers?




• Average vs. median

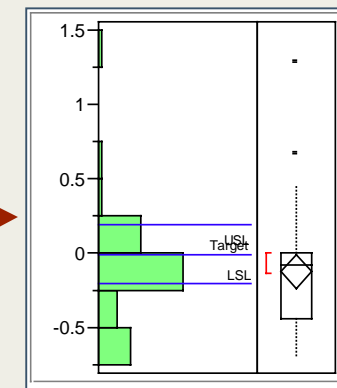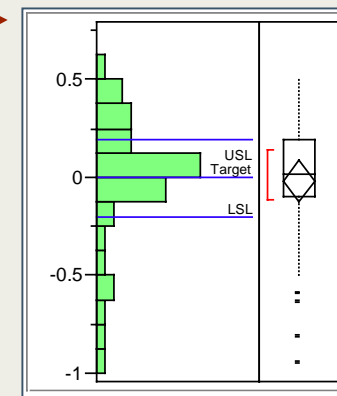




Explore, Evaluate (Plot, Plot, Plot) ₂

Schedule Variance Distribution to Time Series

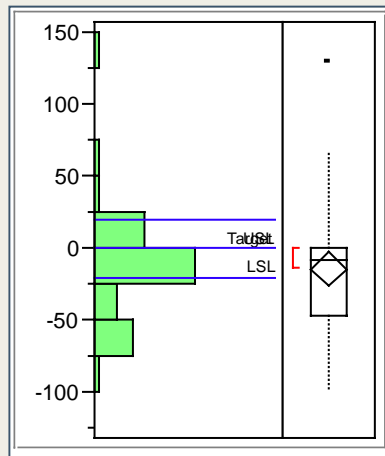

same
data

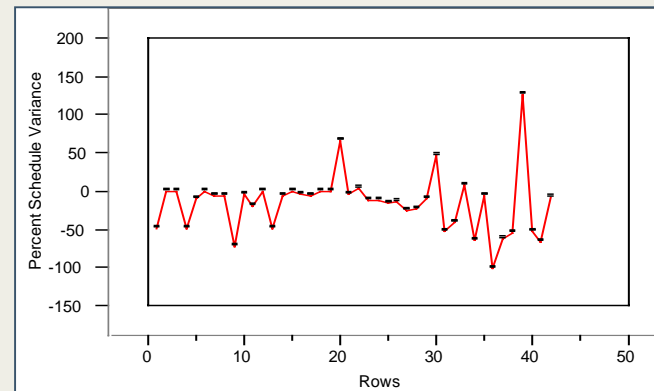

Time series plot shows

- where in time the contributions to overall high variability occur
- possible change in variability over time
- where in time the points of the possible “second population” occur




Why not a control chart?




Explore, Evaluate (Plot, Plot, Plot) ₃

Schedule Variance Time Series to Control Chart

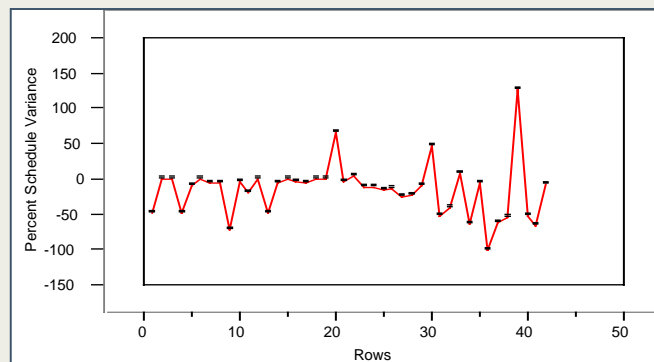

same
data

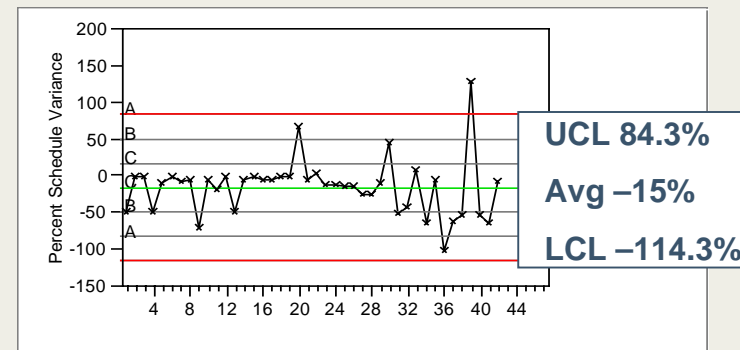


Control charts also show

- possible second “population”
- wide variability

But,

- process may just not be stat. control
(if 2 populations, assumption violated)
- wide limits have limited practical value
(use for off-line analysis only at this stage)
- control charts geared for monitoring sustainment not improvement

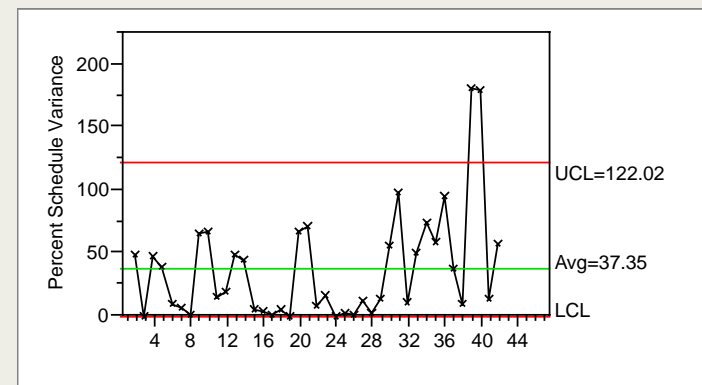



In-Process Cost/Schedule Data Baseline

Organizational goal (specification): +/-20%

In process effort/cost data

- all life cycle phases, all projects, Oct – June (770+ pts)

	all data	extreme values excluded
mean +/- 3 standard deviations	-32 +/- 3*423 or -1301 to 1237	-2 +/- 3*25 or -77 to 73
schedule capability spec = +/- 20%	18% of values outside spec	17% of values outside spec


In process schedule data

- all life cycle phases, all projects, Oct – June (770+ pts)

mean +/- 3 standard deviations	-7.2654498 +/- 19.23 or -64.96 to 50.43
capability notes spec = +/- 20%	17% of values outside spec




In-Process Schedule Variance Boxplot

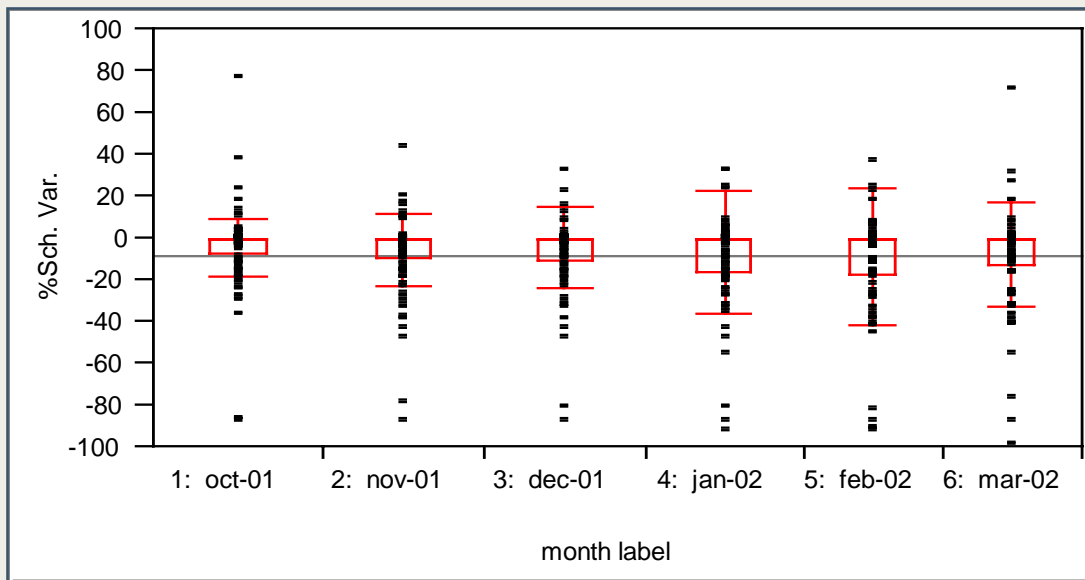

Why a boxplot
and not an SPC
chart?


Data reported monthly for all projects, cycle phases

Conclusion: need to address variability

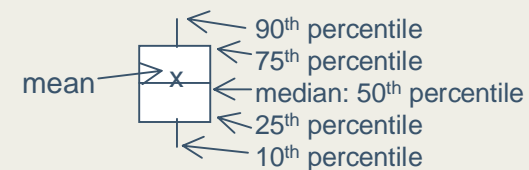



Are There Group Differences?

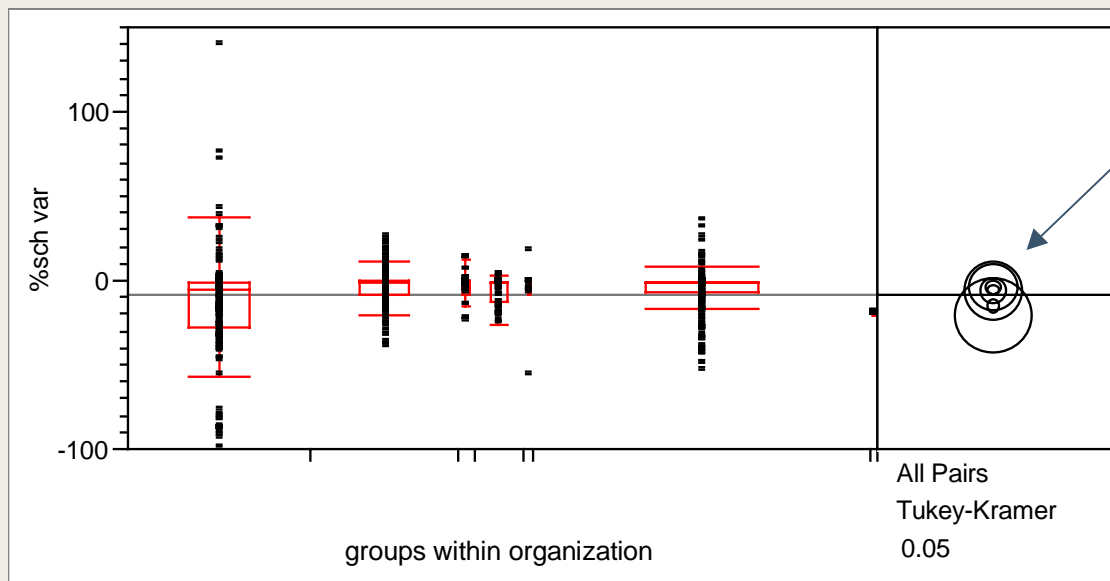


Schedule Variance, all projects, Oct 01 to Jun 02

Boxes influenced by quantity of data, and numbers themselves

Are there statistically significant group to group differences: **NO**



Are There Project Differences?

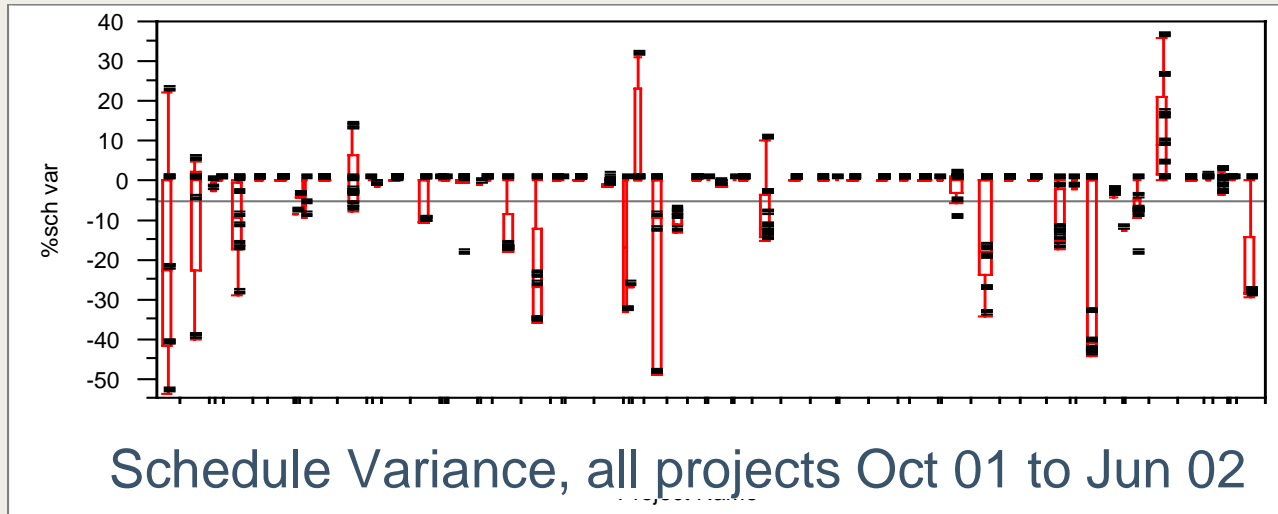

Each box represents the timeline of an individual project

Are there statistically significant project to project differences: **YES**,
in some cases (Tukey-Kramer test not shown)

Conclusion: Non-homogeneous sample (data from all points along
“project timeline”) was a major contributor to the “significant
differences” and to the overall variability



Improving Sampling & Analysis


Overall rollup:

- group the data by project milestones


Within project:

- identify different control limits for each development phase
- compare each project's phase against the history of similar projects in that same phase
- robust sample for limit calculations is critical

wider limits
for projects
in planning
phase

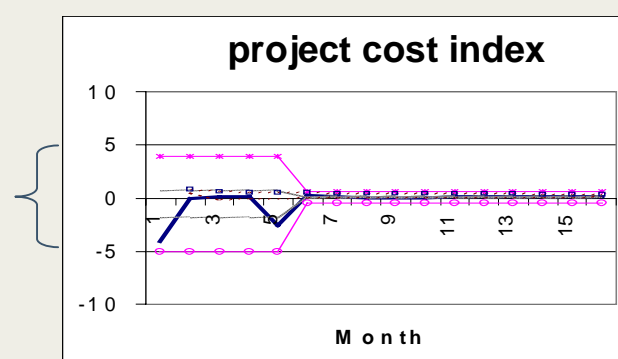

narrower limits
for projects in
execution phase

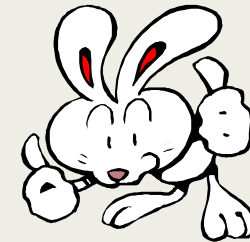

Our Improvement Focus

Two performance improvement priorities, for two different portions of the organization

- effort variation reduction
- schedule variation reduction

Additionally, a specific improvement effort to efficiently gather more complete, more consistent data

- needed to more fully understand the magnitude of variability
- needed to set exact (SMART) improvement goals
(Specific, Measurable, Agreed upon, Realistic, Timely)



Can We Address the Goals?

This is a decision point in the analysis dynamics.

Do we have enough understanding of our data and process? **NO**

Key questions at this stage

- What are the root sources of the variability?
- How does the in-process variability provide an early view of the end-of-project result?



Data and Process Decomposition

Brainstormed root causes of variance

Decomposed process into 4 main subprocesses

- mapped cause codes to process
- identified cause codes that are resolved in-process

Data archaeology

- evaluated cause codes using historical data



risks of data
archaeology vs.
starting anew



Cause Codes

Transformed original brainstorm list

- initial experiential assessment of frequency, impact of each cause code
- refined “operational definitions” and regrouped brainstorm list
- tagged causes to historical data
- refined again

Final list included such things as

- Missed requirements
- Underestimated task
- Over commitment of personnel
- Skills mismatch
- Tools unavailable
- EV Method problem
- Planned work not performed
- External
- Other

Direct Cause vs.
Root Cause



Causes resolved in-
process vs. causes
that affect final
performance




Four High-Level Processes that Influence Final Performance

Project Management <ul style="list-style-type: none">-Workload Proposal-Planning-Requirements Management-Configuration Management-Decision Analysis and Resolution-Training	Organizational Management <ul style="list-style-type: none">-Workload Agreements-Resource Allocation-Funding-Training
Project Monitoring and Control <ul style="list-style-type: none">-Measurement-Quality Assurance-Peer Review	Technical Processes <ul style="list-style-type: none">-Design-Implement-Formal Test-Release

Cause Codes were mapped to these processes



Prioritizing the Causes

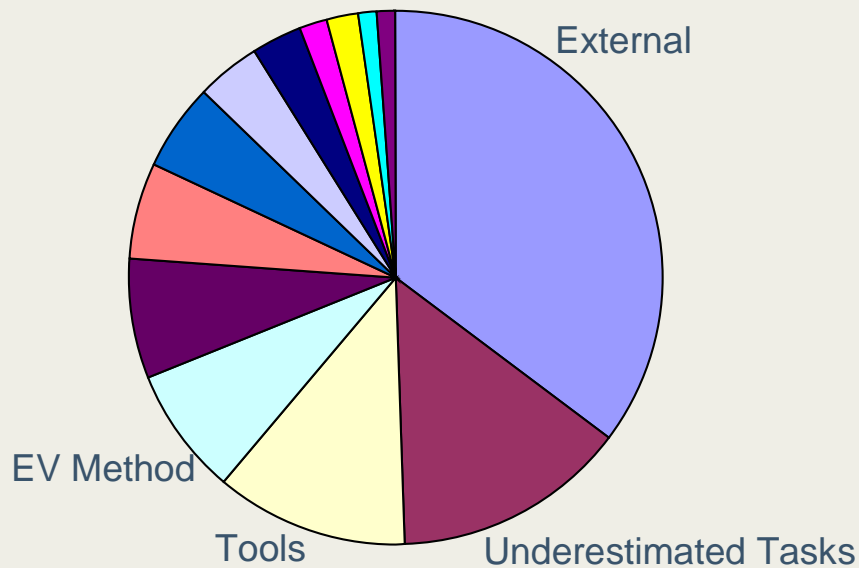

Algorithms and Assumptions

- frequency & impact of occurrences – and which occurrences?

Cause Codes

- Which are resolved in process?

Sphere of Influence

- internal vs. external
- degree of “process understanding”
- degree of “process control”



- Pie Chart vs. Pareto?
- Does everyone understand where the data came from?
- Are the algorithms and assumptions valid?
- What are the risks?



Data Treatments

Project	Month	Cause Code	Variance	Repeat?
A	1	4	4	
A	2	4	3	Y
A	3	5	7	
B	1	2	2	
B	2			
B	3	4	4	
C	1	5	8	
C	2			
C	3			




Cause Code	frequency	impact (average)	frequency x impact (or sum)
2	1	2	2
4	2	4	8
5	2	7.5	15



Might also use median

Cause Code data may be summarized by frequency (f), impact (i), or $f \times i$.

Usage of the latter resembles methods used to evaluate, mitigate risk



Risk Mitigation Analogy	
frequency	impact
H	H
M	M
L	L



Co-Optimizing Across the Organization – Internal Causes

Impact # (from Pareto)	Schedule	Effort	Organization Slice 1 Schedule	Organization Slice 1 Effort	Organization Slice 2 Schedule	Organization Slice 2 Effort
1	Under estimated Task	Tools	Under estimated Task	Under estimated Task	Tools	Tools
2	Tools	Assets not available	EV Problems	Under planned rework	Skills mismatch	Under estimated Task
3	EV Problems	Under planned rework	Missed requirements	Missed requirements	Under estimated Task	Missed requirements
4	Missed requirements	Planned work not performed	Under planned rework	EV Problems	Missed Requirements	Unexpected departure of personnel
5	Skills Mismatch	Under estimated task	Asset availability	Planned work not performed	Unexpected departure	EV Problems



In-process data as leading indicator

internal/external categories	median contribution toward total effort (cost) variance	# of projects reporting	median contribution toward total schedule variance	# of projects reporting	In-process data		
					freq	impact	f x i
internal project	-30.83%	7	-34.32%	4			
internal organization, outside project	-1.25%	5	-73.77%	3			
external, reqt	-22.48%	10	-20.20%	10			
external, sched	0.00%	15	-98.36%	17			

Join the views of completed project performance and in-process performance.



Since “cause categories” differ between the data sets, the first iteration is not trivial



SMART Schedule Variance Goal

Reduce the total variance by decreasing the variance of the top 3 internal causes by 50% in 1 year

Reduce the impact of external causes by 50%

Indicators:

- Trend for each cause independently
- Trend for total variance



Will focus on these causes
give us bottom line results?



Schedule Variance Root Cause ₁

Cause Code: Underestimated tasks

Process: Project Management

Subprocesses: Planning

- Establish requirements
- Define project process
- Perform detailed planning

Requirements Management

As subprocesses are explored, process mapping techniques may be used with (or based on) ETVX diagrams



Schedule Variance Root Cause ₂

Root Causes of Common Cause Variation

- Inexperience in Estimation process
- Flawed resource allocation.
- Inexperience in product (system) for estimator
- Requirements not understood

Root causes of Special Cause Variation

- Too much multitasking
- Budget issues

A list of possible countermeasures was developed

Pros/Cons of doing this retrospectively vs. real time



What is needed before executing the countermeasures?

Could the “special causes” also be “common causes”?



Putting it all Together

Dashboard to monitor “the whole picture”

- customer satisfaction
- defects
- effort and schedule variance

Management by Fact* to monitor improvement efforts

- effort variance reduction
- schedule variance reduction
- measurement quality improvement

Reference process documentation
and project management principles
in use.



Who uses the
dashboards
and MBFs?


*Tooltip for Management by Fact (MBF) in the Addendum



Notional Management by Fact (MBF)


Reduce the total schedule variance by decreasing the variance of the top 3 internal causes by 50% in 1 year.

Total variance w/ mean comparison

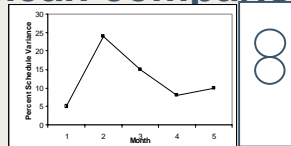

Variance for top 3 causes:

- Underestimated Tasks
- EV Method Problem
- Missed Requirements

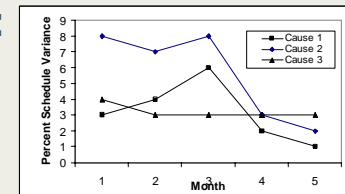

Prioritization & Root Cause

- Inexperience
- Resource Allocation
- Requirements not understood
-

Counter Measures

First: Gather realtime data and verify "data archaeology"

Then:

-
- ...

Impact, Capability

In total, these countermeasures will remove 15% of typical variance.
(as possible, list impact of each countermeasure)

Still needed: Relate in process and completed project data




Notional Dashboard

Earned Value Data


In-process data:

- monthly schedule index, cost index by project milestones

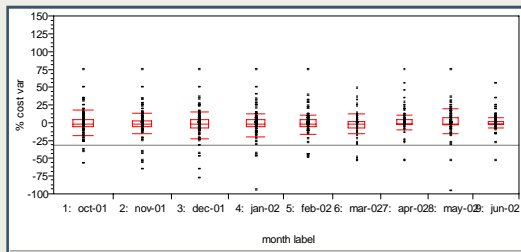

Completed projects data:


- control chart
- % outside spec
- contribution of internal causes to completed project variance

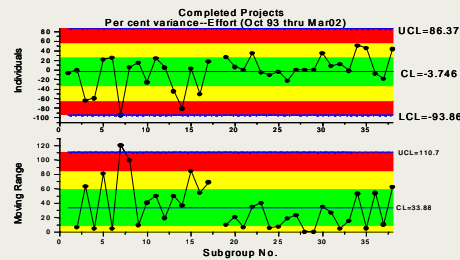

Customer Satisfaction



Return on Investment

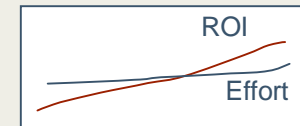

“return” = variance reduction translated into \$\$

Defect Data: Tally of Field Defects

Note: In-process profiles to be shown on “group level” dashboards

Other possible inclusions:


- Engineering process procedural adherence (as a leading indicator for EV, defect and measurement quality performance)

Measurement Quality

- Completeness
- Accuracy
- Procedural Adherence



Organization Specific Process

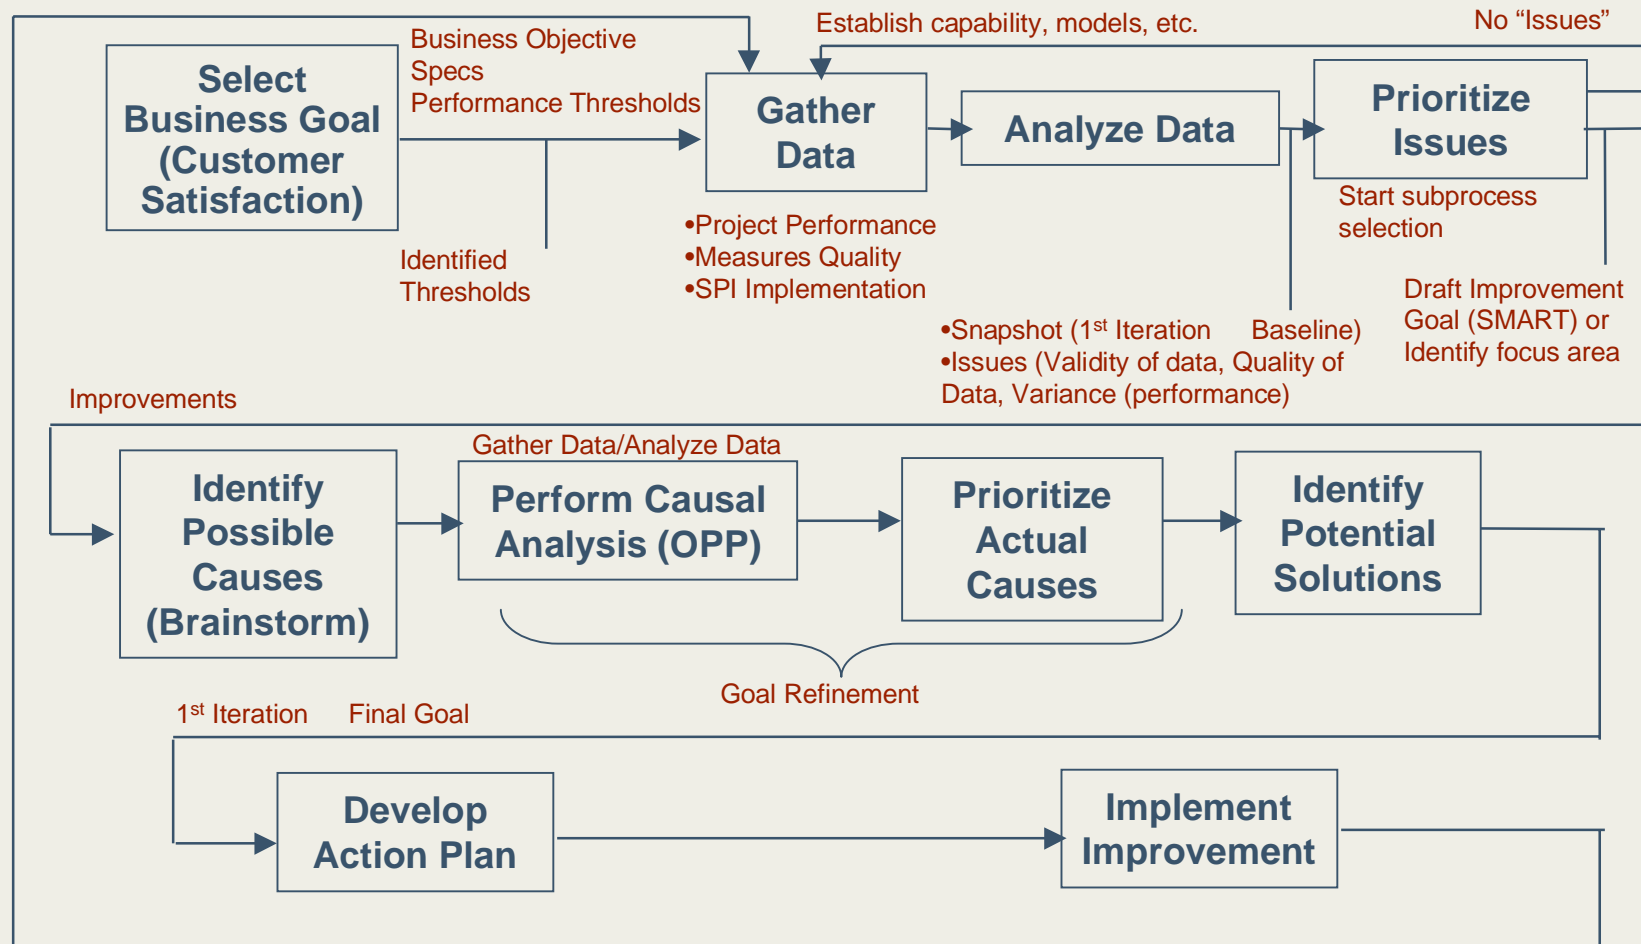



Case Study Summary ₁

- Goal: Customer satisfaction via effort, schedule, field defects
- Black Box Process: not explicitly dealt with until root cause
- Right Data:
 - in-process data available
 - needed to “data mine” for completed data
 - some “new data needs” identified
- Data is Right
 - multiple iterations to correct some data (is this in slides?)
- Explore/Evaluate
 - key to determining need for “data archaeology”
 - put field defects into “monitor” mode
 - focus on improving effort, schedule variability (or change specs)
 - focus on improving measurement quality
 - focus on improving sampling schemes

goals get
SMARTer,
more
quantitative

iterative,
the
“dynamics”
overlap



Case Study Summary ₂

- Explore/Evaluate continued
 - extent of variability characterized
 - some decomposition conducted to distinguish overall variability vs. multiple populations
- Data & Process Decomposition
 - Sub processes of interest selected based on pareto analysis of “cause codes
- Root Cause Analysis:
 - many direct causes identified
 - separating common and special causes of variability
 - we’re getting there....

decomposition
starts in “initial
exploration”



Case Study Summary - Tools Used

control charts for limited analysis NOT as control mech.

Define	Measure	Analyze	Improve	Control
Benchmark Baseline Contract/Charter Kano Model Voice of the Customer Voice of the Business Quality Function Deployment Process Flow Map Project Management "Management by Fact"	Defect Metrics Data Collection Methods Sampling Techniques Measurement Sys. Evaluation Quality of Data <i>adapted technique for impact evaluation</i>	7 Basic Tools Cause & Effect Diagrams, Matrix Failure Modes & Effects Analysis Statistical Inference Reliability Analysis Root Cause Analysis 4 Whats 5 Whys Hypothesis Test ANOVA	Design of Experiments Modeling Tolerancing Robust Design Systems Thinking Decision & Risk Analysis <i>anticipate future use for these improvement efforts</i>	<u>Statistical Controls:</u> • Control Charts • Time Series methods <u>Non-Statistical Controls:</u> • Procedural adherence • Performance Mgmt • Preventive activities bold = tool used



Summary – Key Points

Show me the data! Follow the data!

Couple data analysis with your knowledge of the process.

If your number-crunching is not adding value, then **STOP!**

- Have a goal: a monitoring goal, an improvement goal

This isn't that hard.

- Slow down, think about your process and proceed methodically

But it isn't that easy either. (If it were, we'd all be out of a job).

- Don't be afraid to explore your data, to pursue your ideas. Use your goals and your data as your guides.

You can get yourself into a chicken-and-egg argument with data.

- Sometimes, you need to just dive in with what you have.



Carnegie Mellon
Software Engineering Institute

Contact Information

Bill Florac
Software Engineering Institute
Software Engineering Measurement and Analysis
Email: waf@sei.cmu.edu
434-978-7780

Jeannine Siviyy
Software Engineering Institute
Measurement & Analysis Initiative
Email: jmsiviyy@sei.cmu.edu
412-268-7994

Contact us for a copy of the slides.
Or, leave a business card with Jeannine or Bill.
Also, they will be posted on the SEMA web pages
<http://www.sei.cmu.edu/sema>



References

Note: URL's subject to change without notice

- [ASA 01] American Statistical Association, Quality & Productivity Section, *Enabling Broad Application of Statistical Thinking*, <http://web.utk.edu/~asaqp/thinking.html>, 2001
- [ASQ 00] ASQ Statistics Division, *Improving Performance Through Statistical Thinking*, Milwaukee: ASQ Quality Press, 2000. H1060
- [Deming] Deming, W. Edwards, *Out of the Crisis*. Cambridge, Mass.: Massachusetts Institute of Technology, Center for Advanced Engineering, 1986
- [Wheeler 92] Wheeler, Donald, and David S. Chambers, *Understanding Statistical Process Control*, SPC Press, 1992



Additional Reading

References on statistics and analytical tools (URL's subject to change without notice)

General Statistics and Tools

Davis, Wallace III, *Using Corrective Action to Make Matters Worse*, Quality Progress, October 2000

Gonick, Larry and Smith, Woolcott, *The Cartoon Guide to Statistics*, HarperPerennial, 1993

The Memory Jogger, Goal/QPC, <http://www.goalqpc.com>

Wheeler, Donald, J. *Understanding Variation – The Key to Managing Chaos*, SPC Press, 1993

Statistical Process Control

AT&T / Western Electric Co., *Statistical Quality Control Handbook*, Delmar Printing Company

Chrysler, Ford, General Motors Corp., *Statistical Process Control – SPC*, A.I.A.G. 1995

Florac, William A., and Anita D. Carleton, *Measuring the Software Process*, Addison-Wesley, 1999

Wheeler, Donald, and David S. Chambers, *Understanding Statistical Process Control*, SPC Press, 1992

Wheeler, Donald and Polling, Sheila, *Building Continual Improvement*, SPC Press, 1998

Bayesian Modeling:

Fenton, Norman and Martin Neil, *Software Metrics: Roadmap*, International Conference on Software Engineering, 2000, available at <http://www.softwaresystems.org/future.html>



Carnegie Mellon
Software Engineering Institute

Addenda

Additional vignettes

Tool tips



Example of an Aid
for Operational
Definitions using
Orthogonal
Classification



Reference
Page 33

Problem Status	Include	Exclude	Value Count	Array Count
Open	✓		✓	
Recognized				✓
Evaluated				✓
Resolved				✓
Closed	✓		✓	
Problem Type	Include	Exclude	Value Count	Array Count
Software defect				
Requirements defect	✓		✓	
Design defect	✓		✓	
Code defect	✓		✓	
Operational document defect	✓		✓	
Test case defect		✓		
Other work product defect		✓		
Other problems				
Hardware problem		✓		
Operating system problem		✓		
User mistake		✓		
Operations mistake		✓		
New requirement/enhancement		✓		
Undetermined				
Not repeatable/Cause unknown		✓		
Value not identified		✓		
Uniqueness	Include	Exclude	Value Count	Array Count
Original	✓			
Duplicate		✓	✓	
Value not identified		✓		
Criticality	Include	Exclude	Value Count	Array Count
1st level (most critical)	✓			✓
2nd level	✓			✓
3rd level	✓			✓
4th level	✓			✓
5th level	✓			✓
Value not identified		✓		
Urgency	Include	Exclude	Value Count	Array Count
1st (most urgent)	✓			
2nd	✓			
3rd	✓			
4th	✓			
Value not identified		✓		



Compliance Issues


May be basis for
assignable causes

Compliance Issues	Things to Examine When Seeking Reasons for Noncompliance
Adherence to the process	awareness and understanding of the process existence of explicit standards adequate and effective training appropriate and adequate tools conflicting or excessively aggressive goals or schedules
Fitness and use of people, tools, technology, and procedures	availability of qualified people, tools, and technology experience education training assimilation
Fitness and use of support systems	availability capacity responsiveness reliability
Organizational factors	lack of management support personnel turnover organizational changes relocation downsizing disruptive personnel morale problems



Initial Control Chart of Inspection Package Review Rate (SLOC/Prep-Hr)

Inspection Package Review Rate
All Product Components

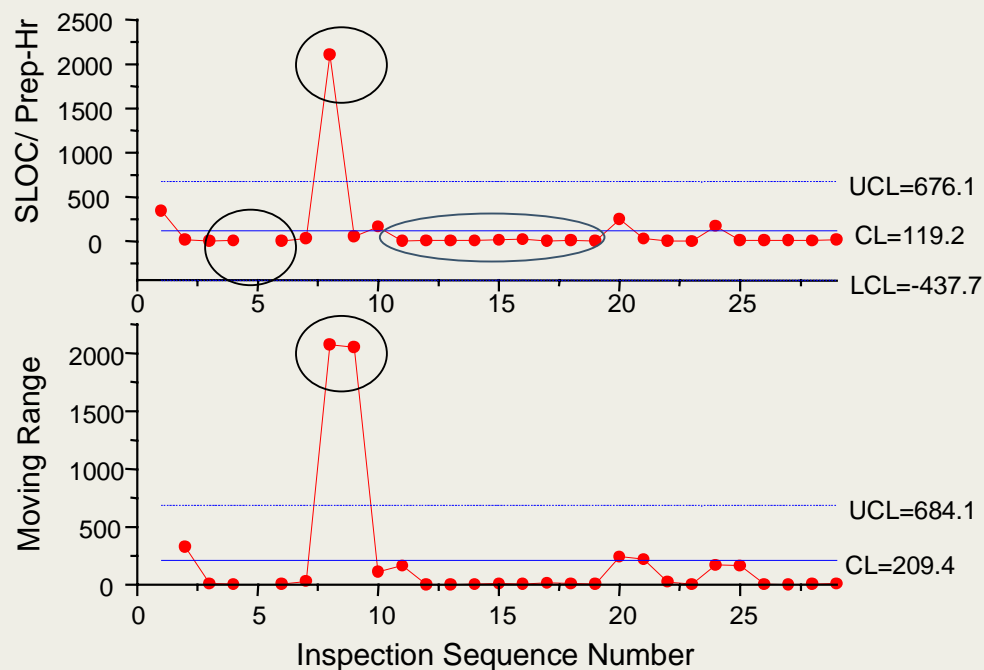


Assignable
causes due to:

- Erroneous and Missing Data
- Multiple Cause Systems (six components each with own development team)



Inspection Package Review Rate for Component A

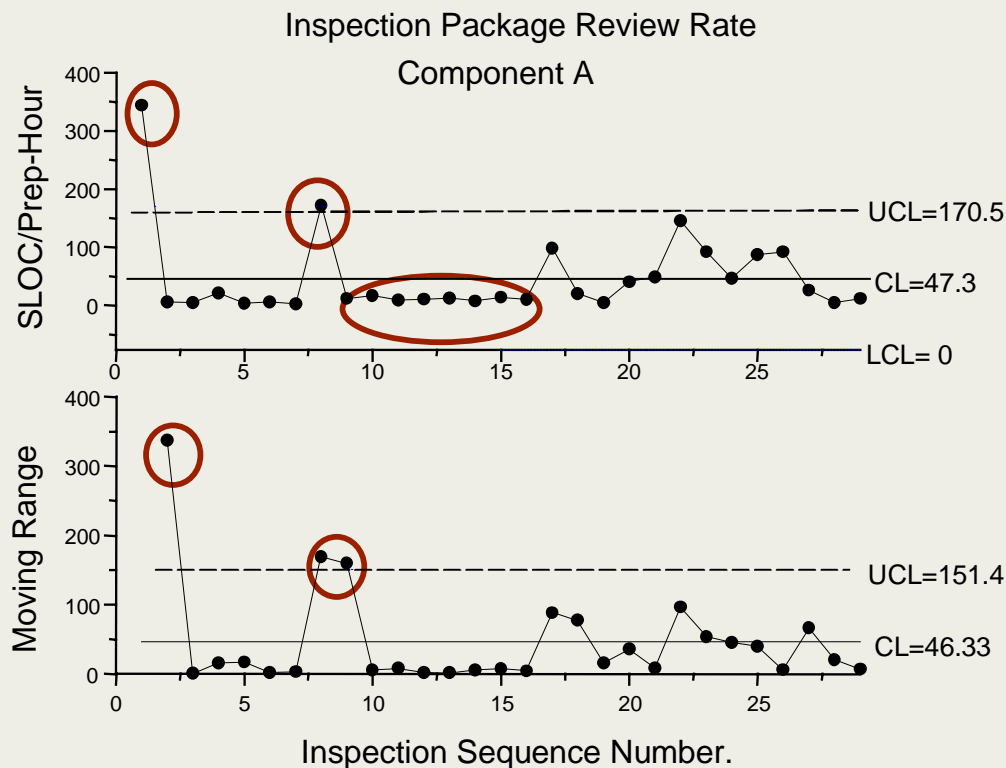


Re-analyzed data

- Data errors eliminated
- Consider single major cause system at a time
- Control chart for one component
- Several assignable causes apparent



Component A Review Rate

Inspection Package Review Rate
Component A

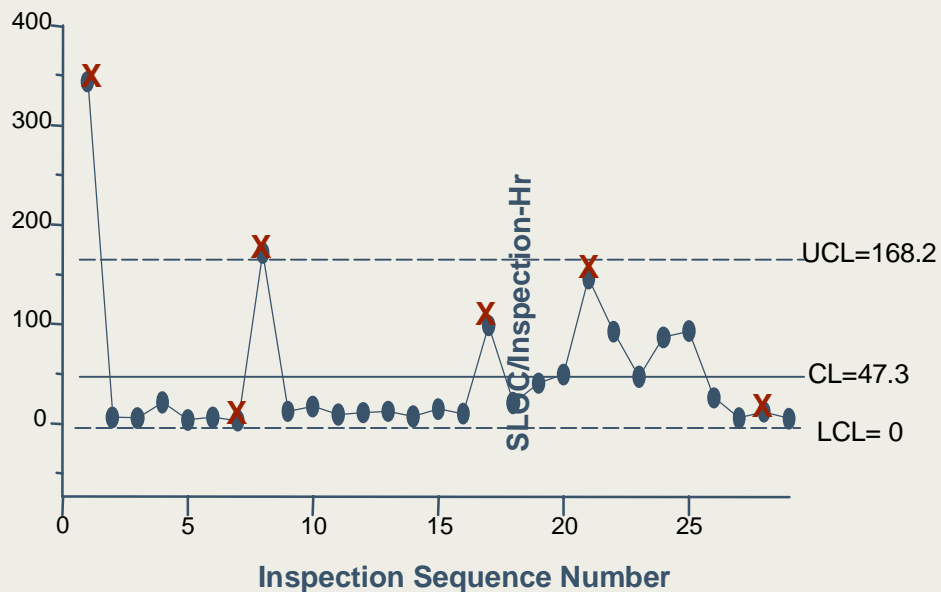


Investigation resulted in removal of separate cause systems included in inspection packages:

- data tables
- lists
- arrays
- different review process



Component A Revision

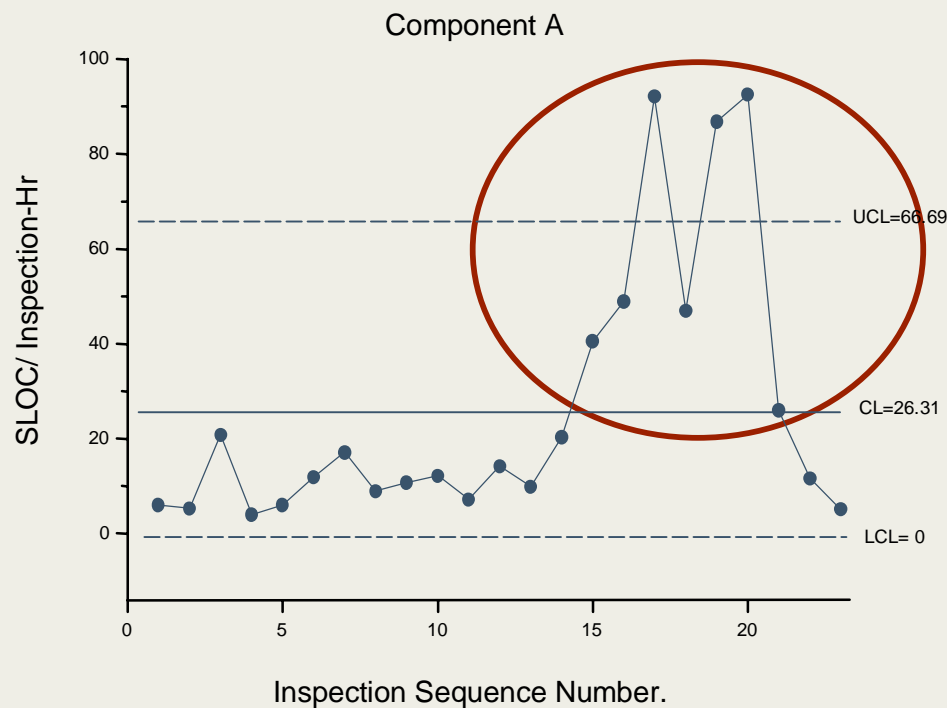


Process Instability:
Apparent shift of
process performance
after #15

Leads to investigation
of changes in process
cause systems



Cause-and-Effect Relationships

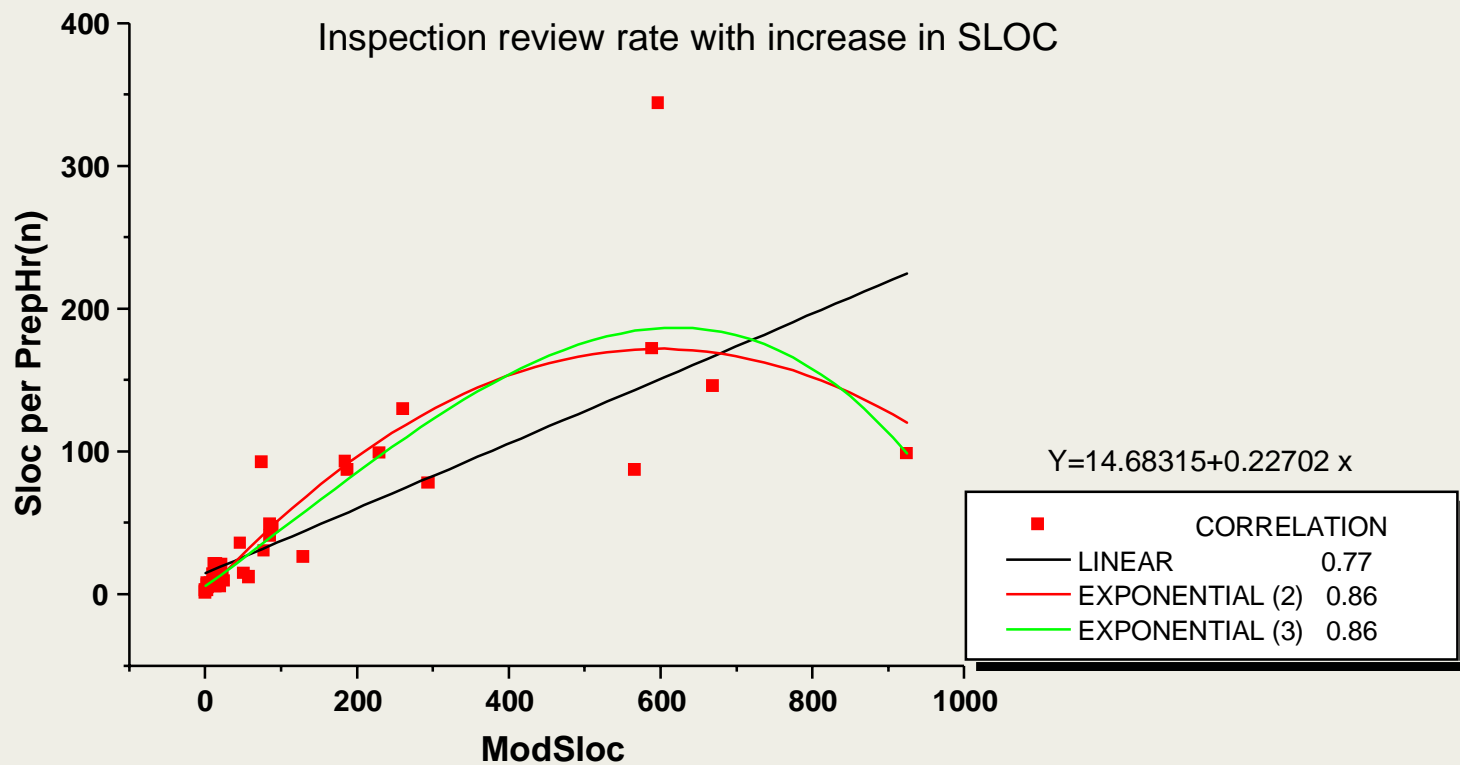




Component A Review Rate


Distribution of review rates by SLOC size

Amount of SLOC in review package is key driver of review time spent

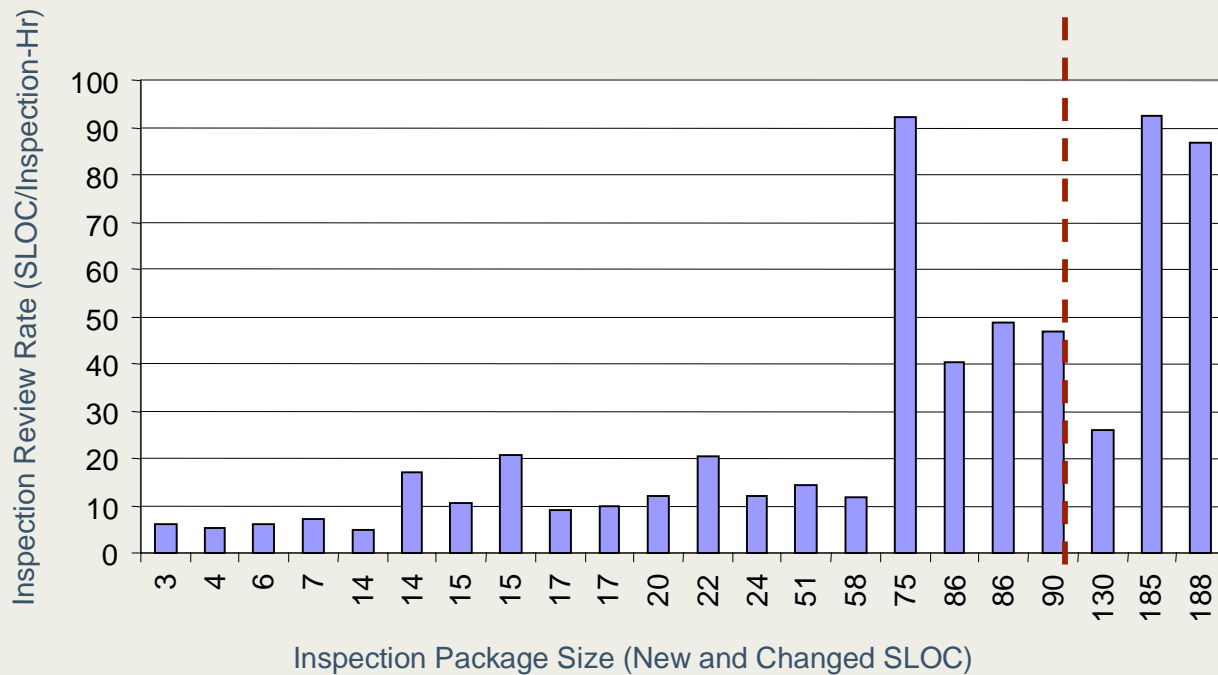




Component A Review Rate

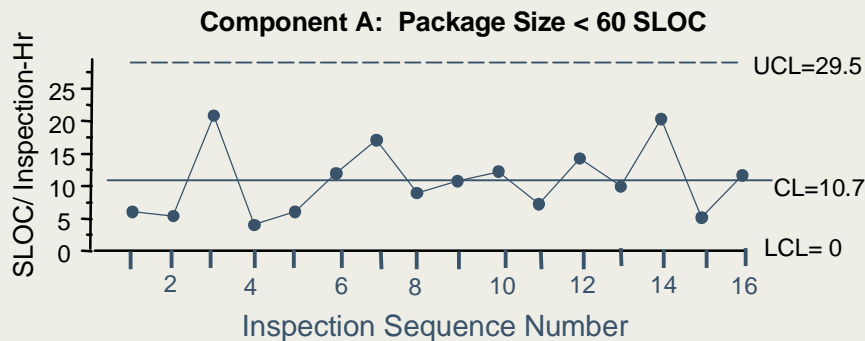

Replot data using two charts:

- Rates for Inspection <60 SLOC
- Rates for Inspection >60 SLOC

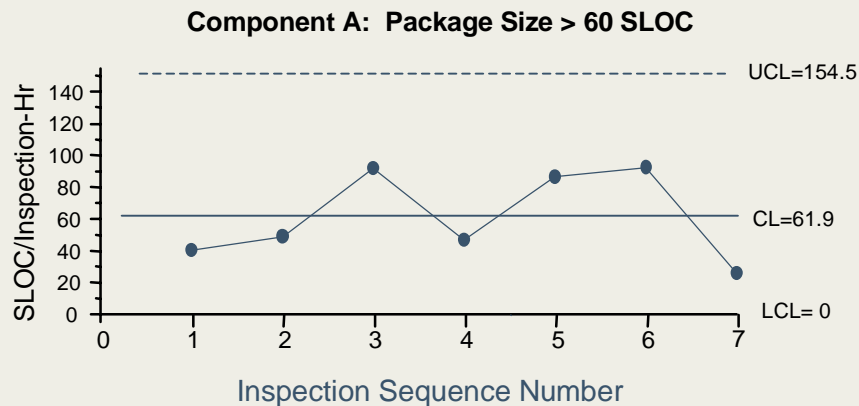


Indicates two processes in operation depending on size of Inspection package


Establish Trial Limits for each subprocess



Component A Review Rate

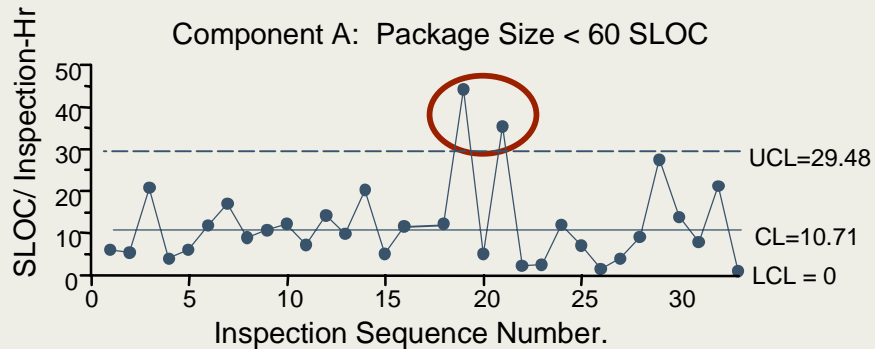



Additional observations identify more assignable causes

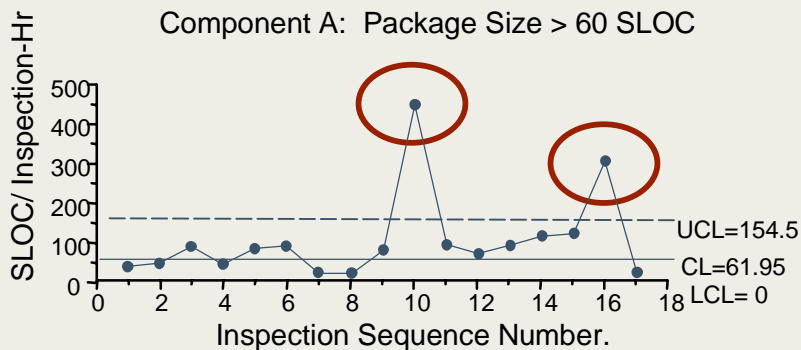

Investigation determines that assignable cause observations from re-inspection process



Component A Review Rate

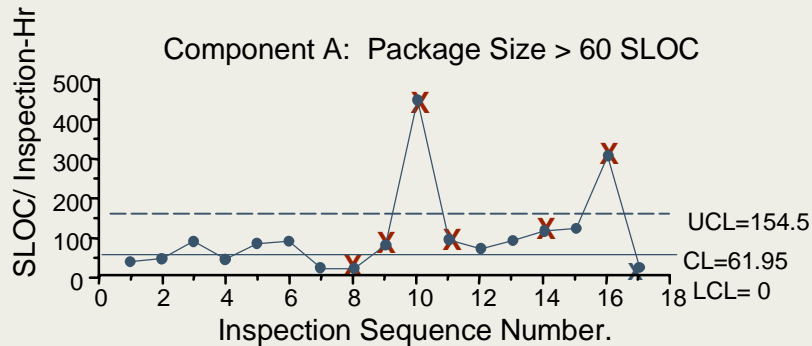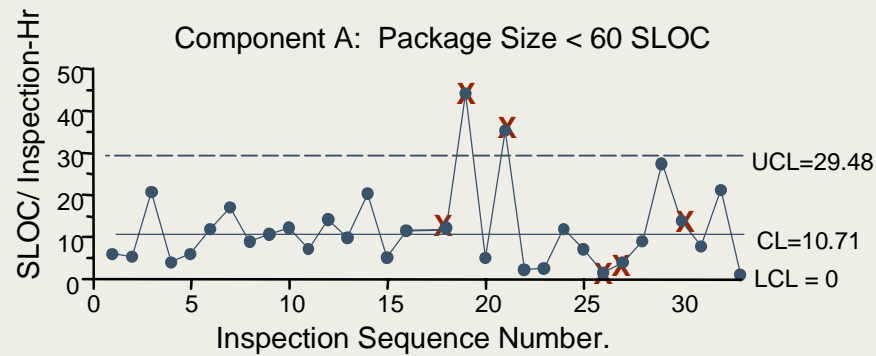


All re-inspection data identified and removed from control chart since they represent a different process (different cause system)




Component A Review Rate

Component A: Package Size < 60 SLOC

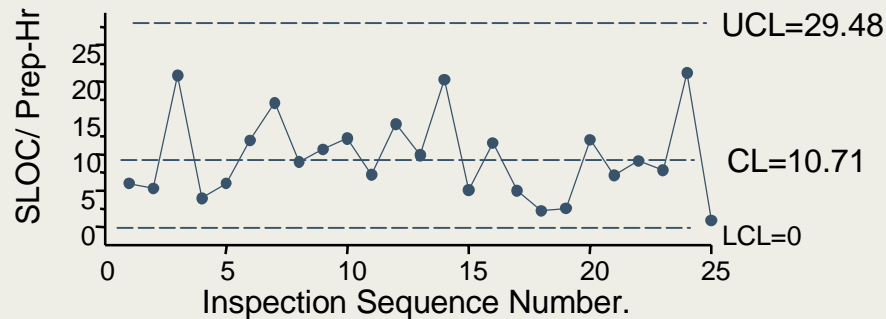

Charts plotted with remaining data (single cause system)

Component A: Package Size > 60 SLOC

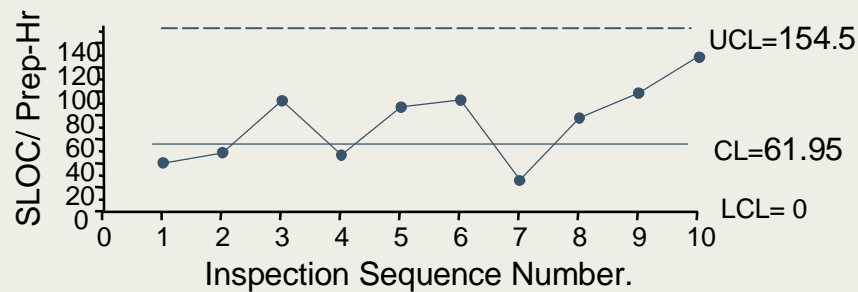

Additional data points reinforce trial limits hypothesis



Component A Review Rate

Analysis summary:

- Inspection process consists of several (3) undocumented subprocesses
- Review rate appears to be stable within two categories (< and > 60 SLOC)
- Inspection packages of 60 SLOC or more reviewed about 6X faster than those with <60 SLOC

Key questions requiring more study:

- Why difference in review rates?
- Is there a difference in effectiveness (rate of escaped defects)?
- Do other components behave similarly?
- How do rates compare from release to release?



Tool Tips Part 1: The Basic Tools

Overview (description, procedure, tips, examples) for

- run charts
- spc charts
- boxplots
 - including pareto boxes
- scatter plots
- histograms, distributions and capability
 - twist: rayleigh, weibull distributions
- bar charts
- pareto charts
- cause&effect diagram
 - including cause & effect matrix



Tooltip: 7 Basic Tools

Description

- Fundamental data plotting and diagramming tools
 - Cause & Effect Diagram
 - Histogram
 - Scatter Plot
 - Run Chart
 - Flow Chart
 - Brainstorming
 - Pareto Chart
- The list varies with source. Alternatives include
 - Statistical Process Control Charts
 - Descriptive Statistics (mean, median and so on)
 - Check Sheets



7 Basic Tools: Usage

Plot trends over time

Examine relationships among measures


Explore cause-effect relationships

Prioritize issues

Determine stability and capability of processes




7 Basic Tools: Chart Examples ₁

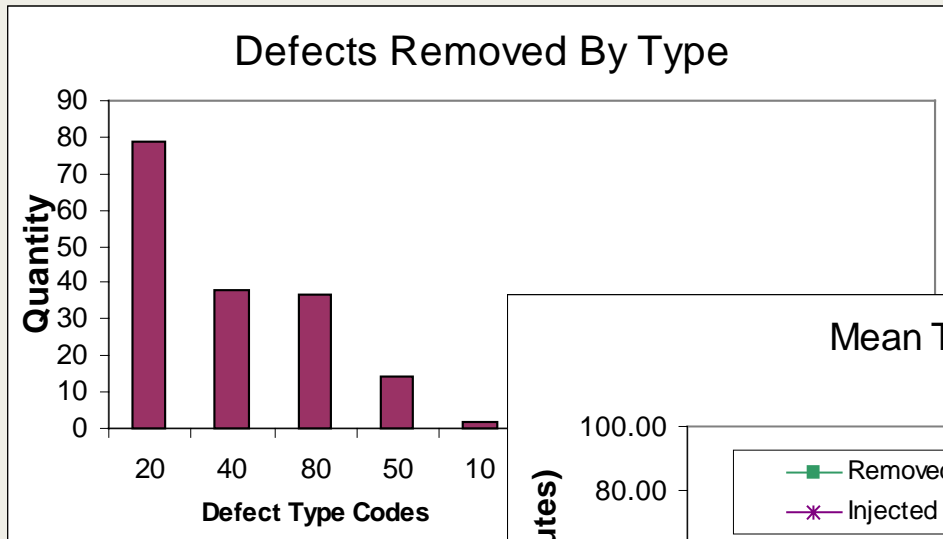

Pareto Chart




Run Chart

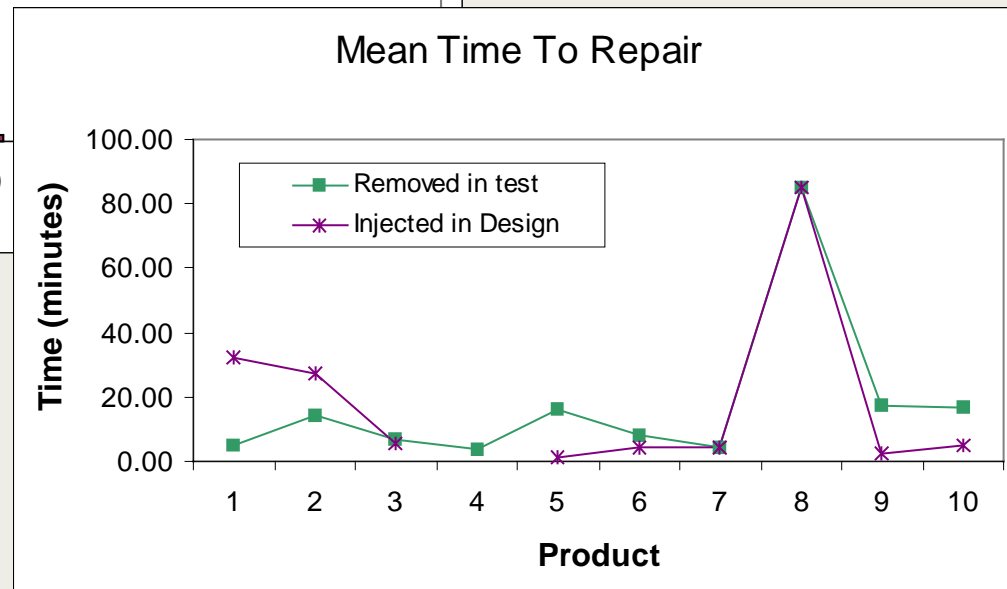




7 Basic Tools: Chart Examples ₂

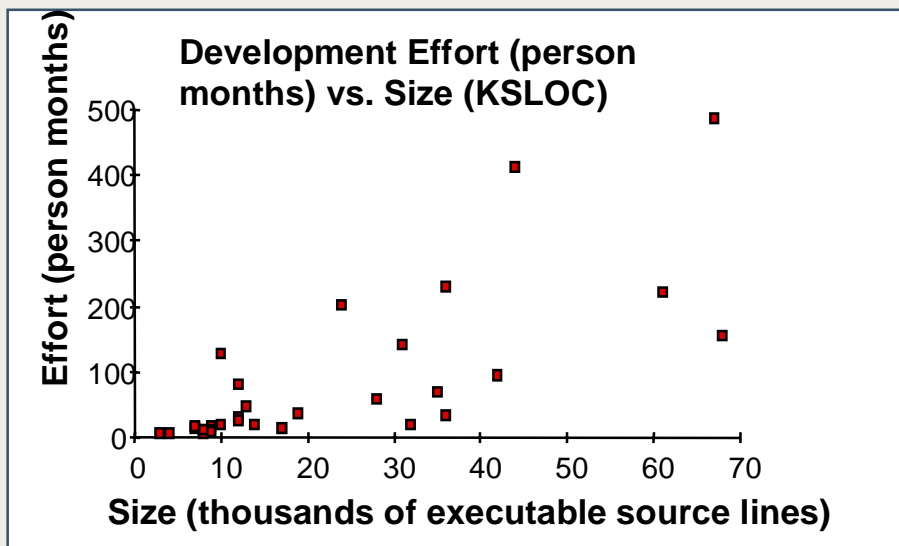

Scatter Plot




Histogram

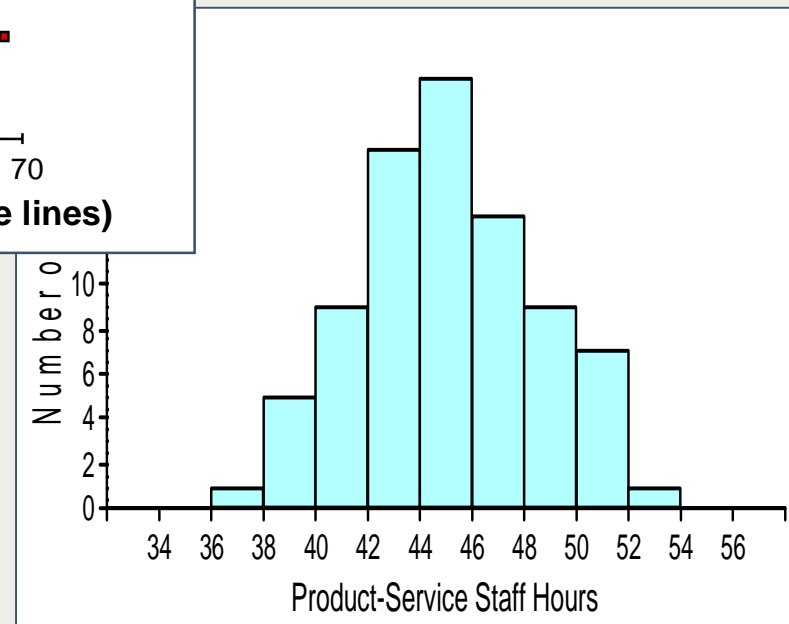



7 Basic Tools: Cause & Effect


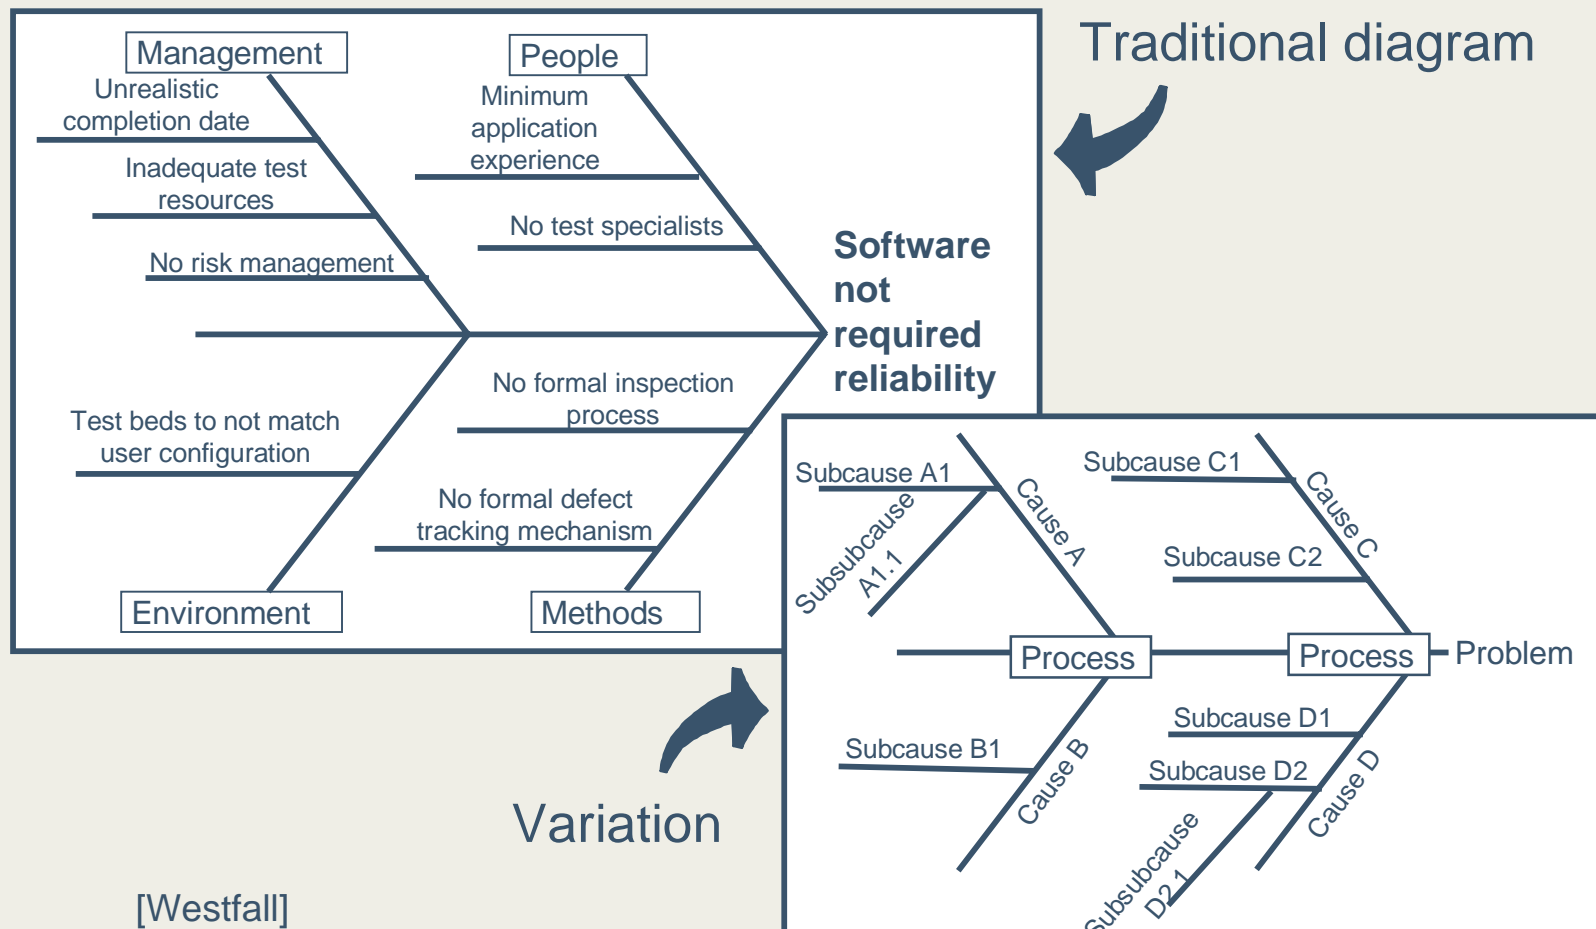


[Westfall]



7 Basic Tools: Chart Variations

Box & Whisker Plot
for assessment data

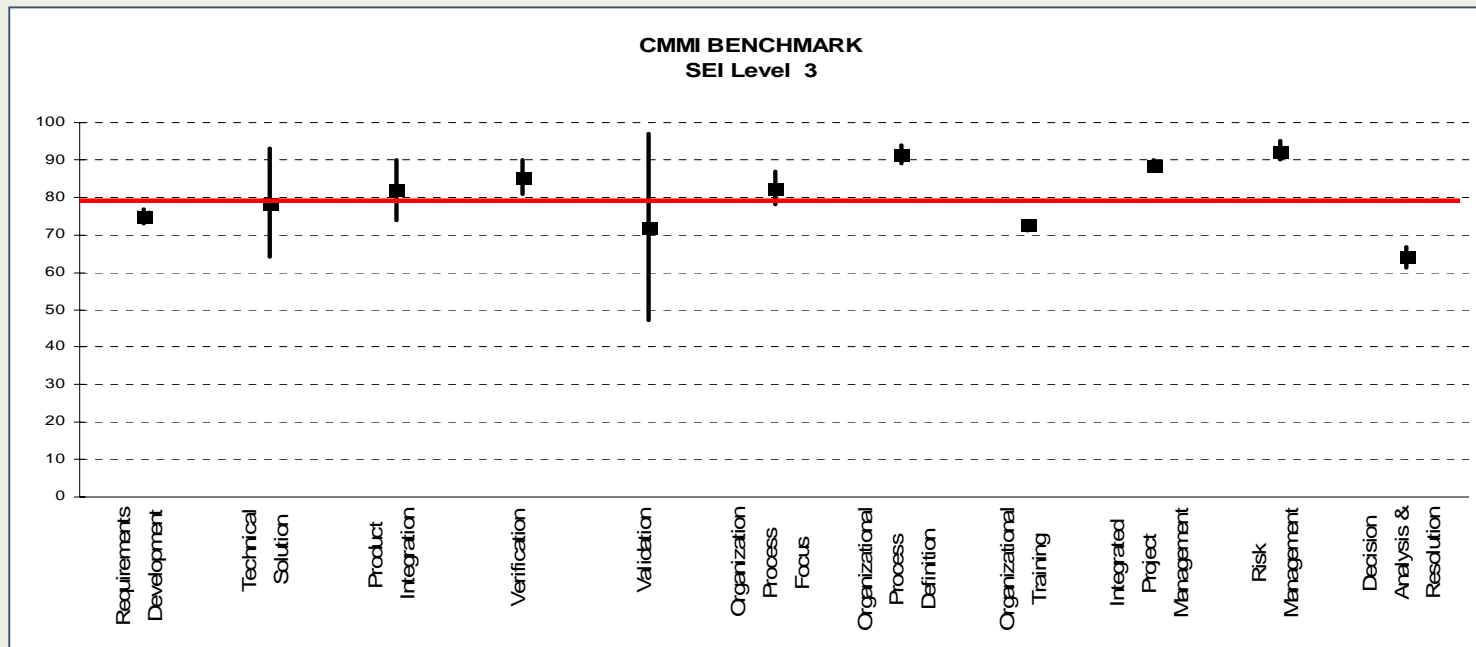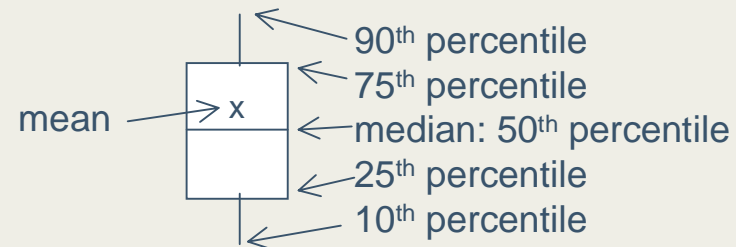




7 Basic Tools: Chart Variations

Boxplot variations:

- cost and schedule variance over time to show organizational average and also variability
- prioritized features for a new process technology rollout: a combination “pareto-boxplot”

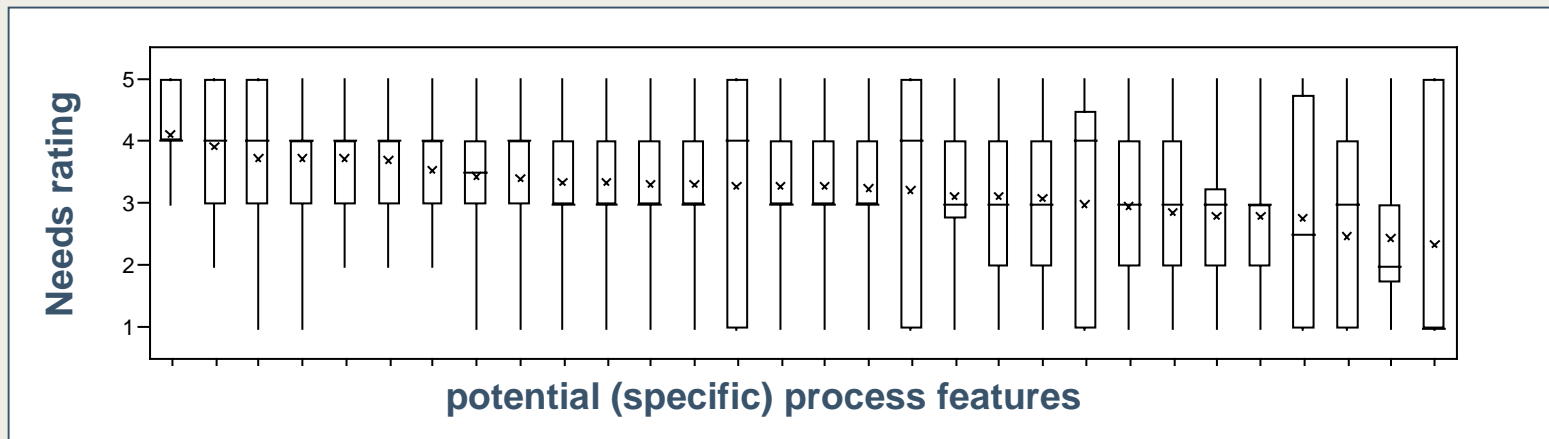



Tool Tip: Run Charts

Description


- Time series plot that can be used to examine data quickly and informally for trends or other patterns that occur over time.

Tips

- Run charts are not control charts - don't over-interpret them.
- If observations are not all similarly spaced in time, there may be more than one process influencing what appears to be a single run.



Run Charts: Example

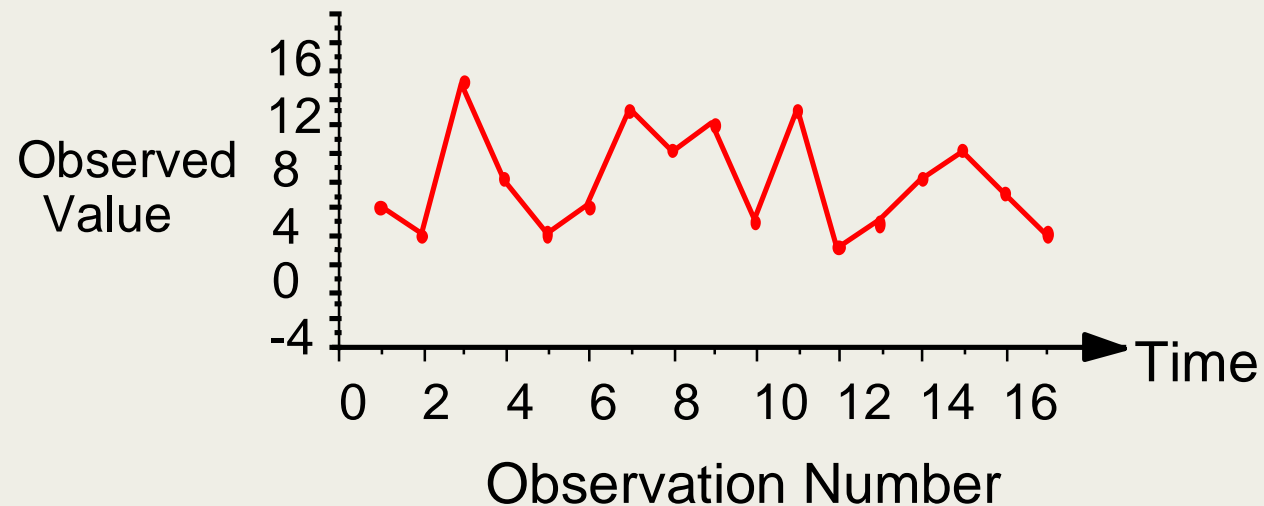

Assumptions

- ordered by time
- single underlying process
- consistent operational definitions



Tool Tip: Statistical Process Control (SPC) Charts

Description


- run chart with statistical limits

Usage

- let you know what your processes can do, so that you can set achievable goals.
- provide the evidence of stability that justifies predicting process performance.
- separate signal from noise, so that you can recognize a process change when it occurs.
- distinguishes common cause variation from special cause variation
- point you to fixable problems and to potential process improvements



Control Chart Basics

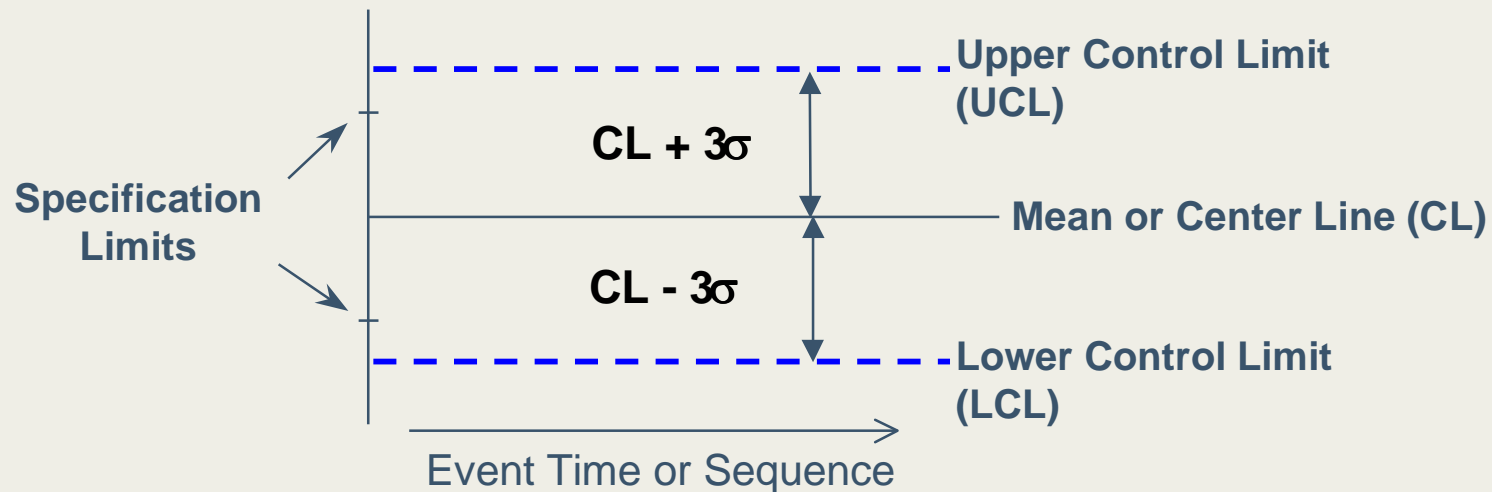

Limits

Control Limits → Determined by Process Performance Measurements
(Voice of the process)

Specification Limits → Set by customer, engineer, etc.
(Voice of the customer)



SPC: Tips

Reacting to Common Cause Variation as if it were Special Cause Variation cannot improve the process and will result in increased variability.

Check your data distributions!

- Defect counts are never negative and may not be normally distributed.


Set specification limits based on statistics, engineering knowledge and risk of escaping defects.

Implement charts “in the field” only when you have corrective action guidelines. Otherwise, work the charts offline.

Always look at the average (or individual) and range charts!




SPC: Example

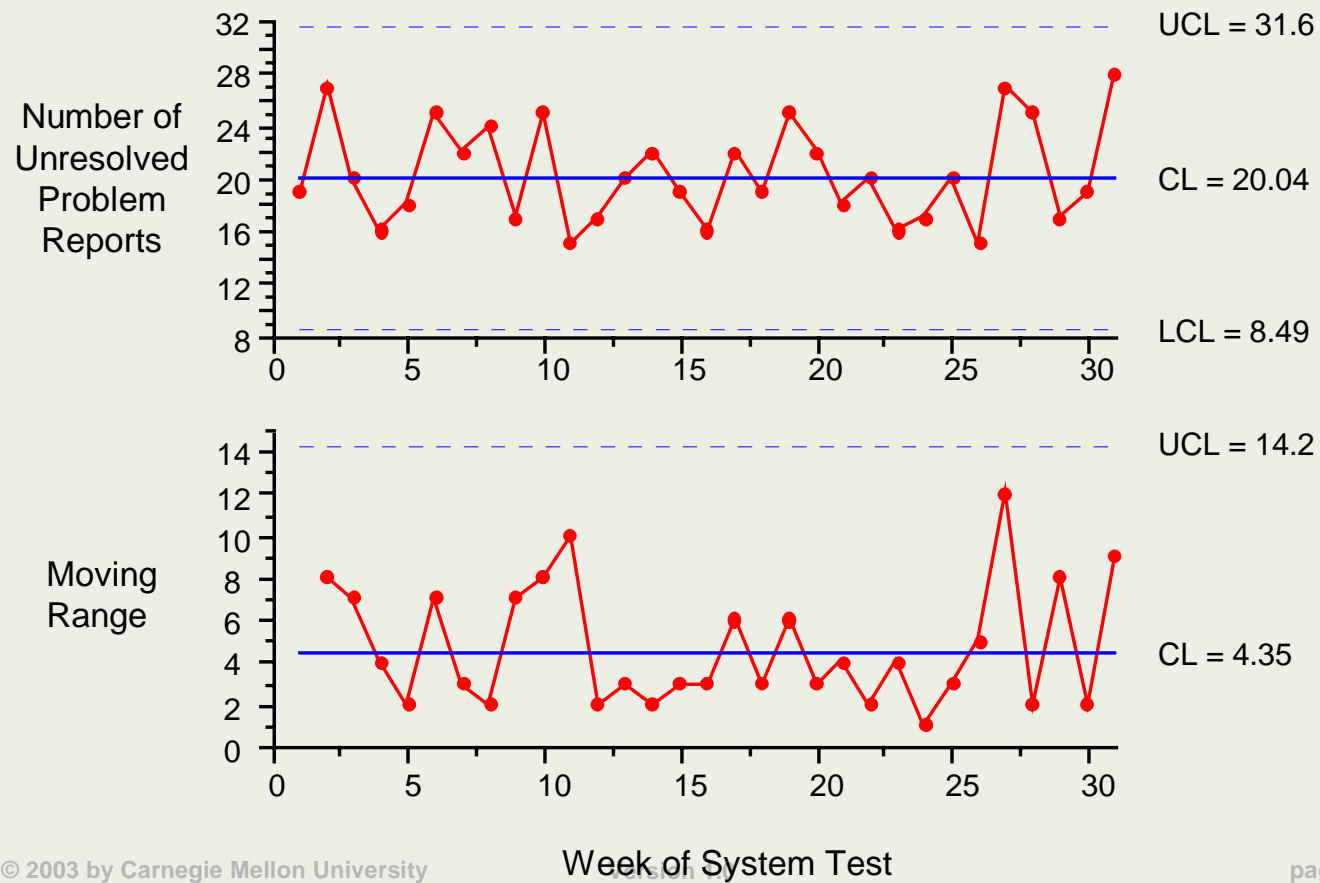




SPC: Rules for Detecting Process Instabilities

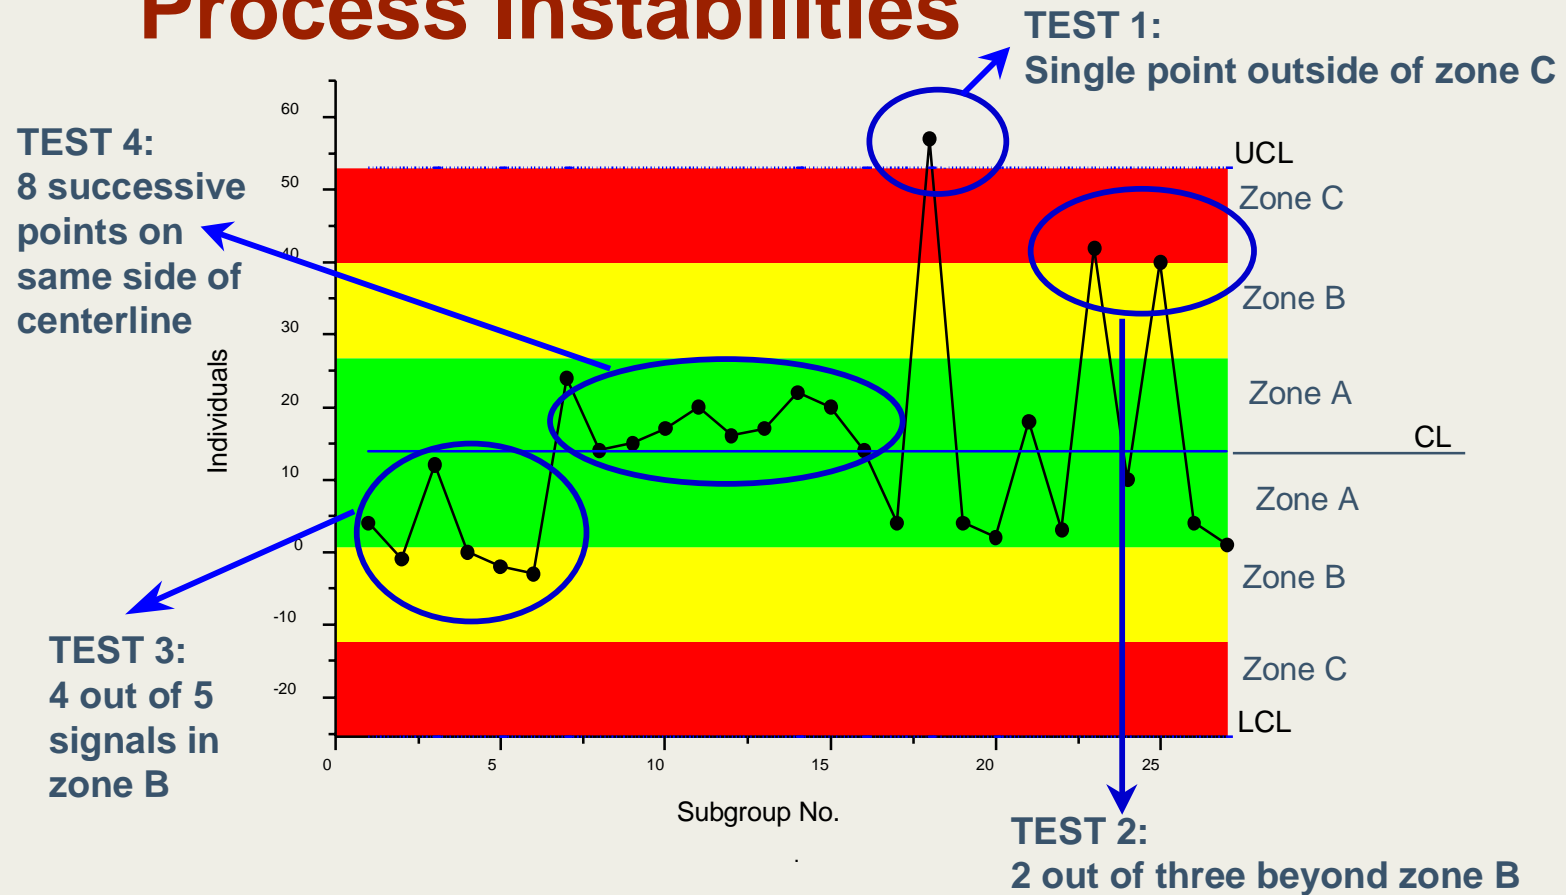




SPC: Anomalous Patterns


Rapid Shift in Level

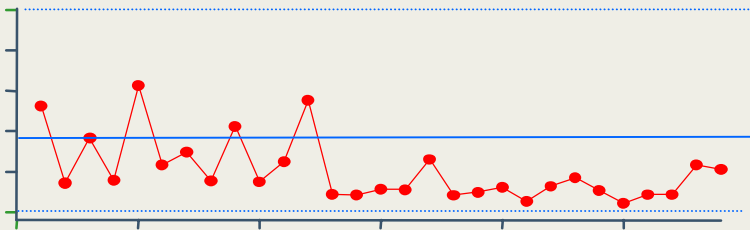


Unstable Mixture

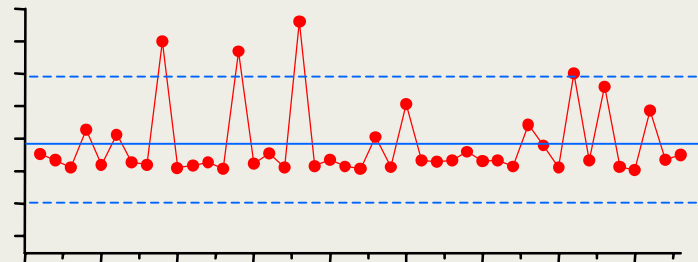


Stratification

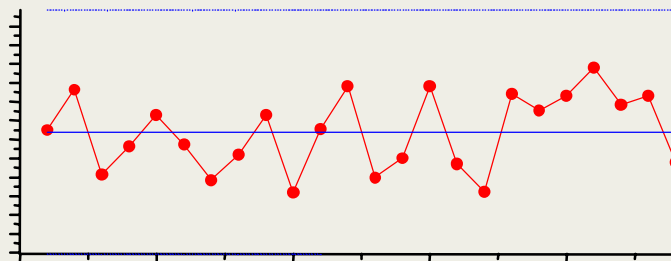


Trends

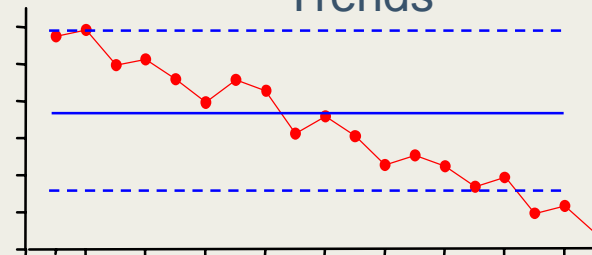

Cycles Pattern

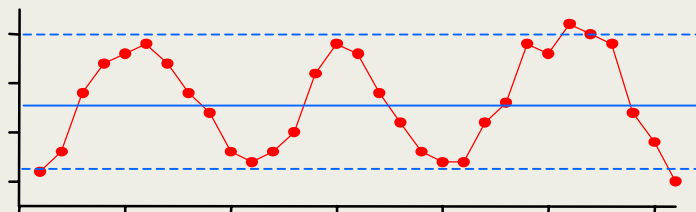

Bunching or Grouping

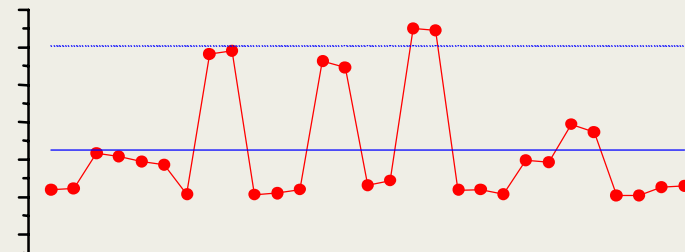



Tooltip: Scatter Plots

Description

- Display empirically observed relationships between two measures.


Usage

- A pattern in the plotted points may suggest that the two measures are associated.
- When the conditions warrant, scatter diagrams are natural precursors to regression analyses.
- Scatter diagrams are rarely used as the only means of characterizing the relationship between two measures.
- Does not predict cause and effect relationships



Scatter Plot: Example with Line

Inspection Effort versus Inspected Sloc

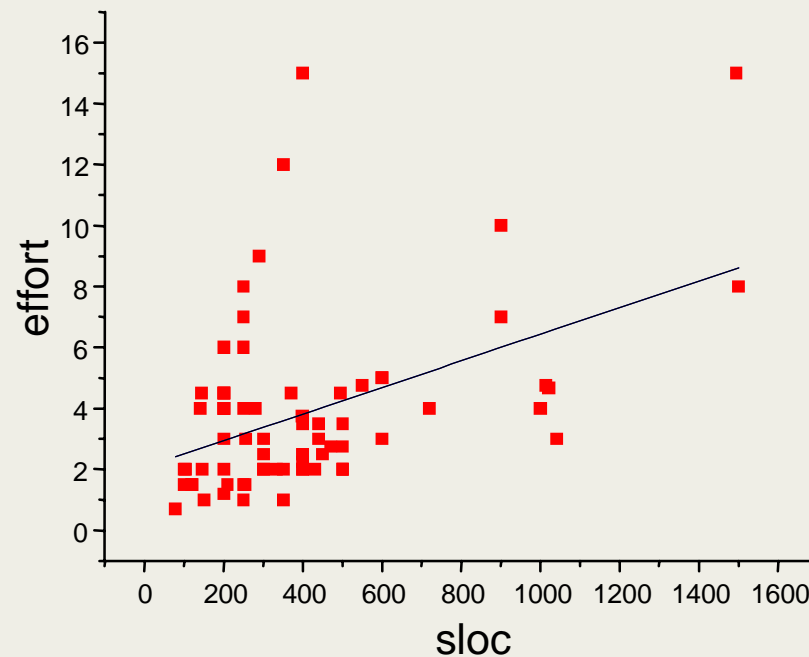

$$Y=2.08112+0.00435 x$$

$$R = 0.45031$$

$$R\text{-Squared} = 0.20278$$

R = Correlation Coefficient

R-Squared = Fraction of variability explained by the model



Tooltip: Histograms

Description:


- Display the empirically observed distribution for values of a measure.
- Show the frequency of each value and the range of values observed.

Usage:


- Inappropriate unless the measure can be treated as a continuous scale.



Histograms - Examples

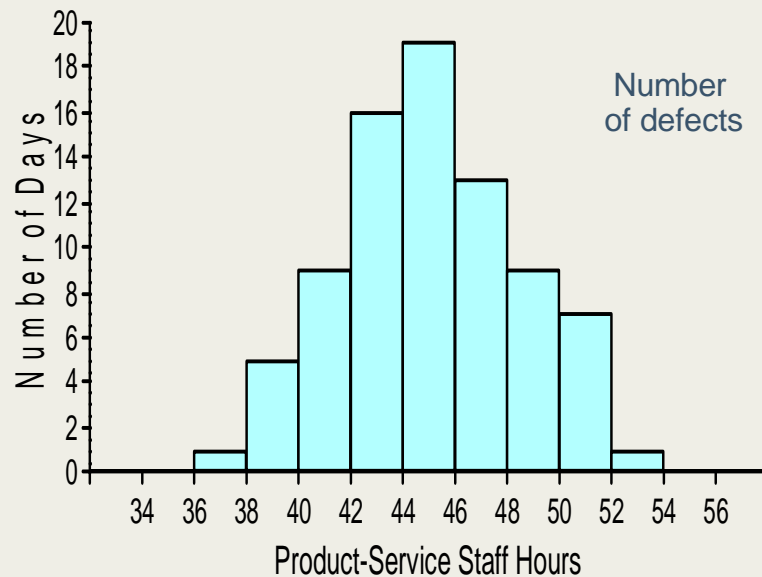

Number of defects

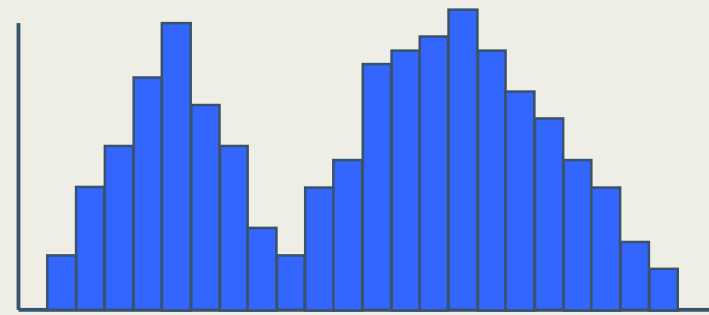

Time to fix a defect found after development

Look for multimodal distributions

May point to multiple processes



Tooltip: Bar Charts


Description

Usage

- Similar in many ways to histograms
- Do not require that the measure be treated as a continuous variable.
- Bar charts are much more frequently used than histograms.




Bar Charts: Example

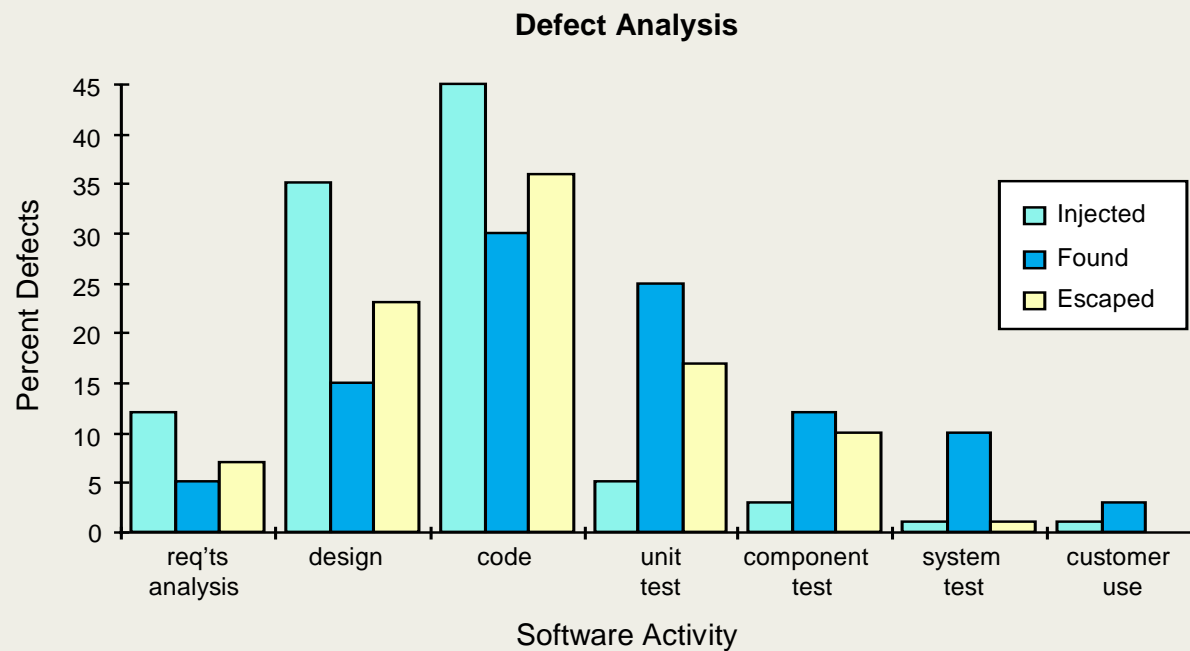



Bar Charts: A Word of Caution

Because they are so flexible, it is easy to get carried away with bar charts.

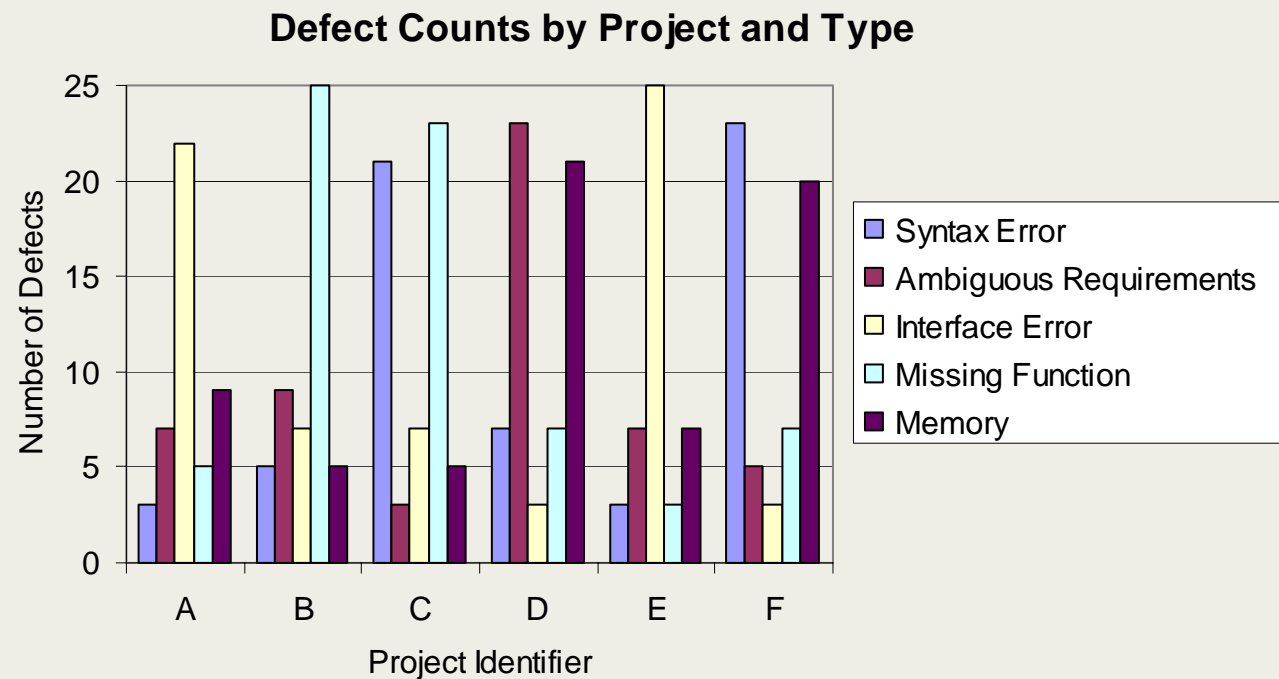



Tooltip: Pareto Charts

Description:

- Special form of a bar chart that ranks categories of data in terms of their amounts, frequency of occurrence, or economic consequences.

Usage:


- Ranking of problems, causes, or actions, etc., must be orthogonal
- Interpretation based on the “80/20 rule”

If the 80/20 rule does not apply

- Consider counting a different attribute, while maintaining the same stratification.
- Consider re-stratifying - use a different classification scheme.
- Consider a different attribute of the process under study.



Pareto Charts: Example

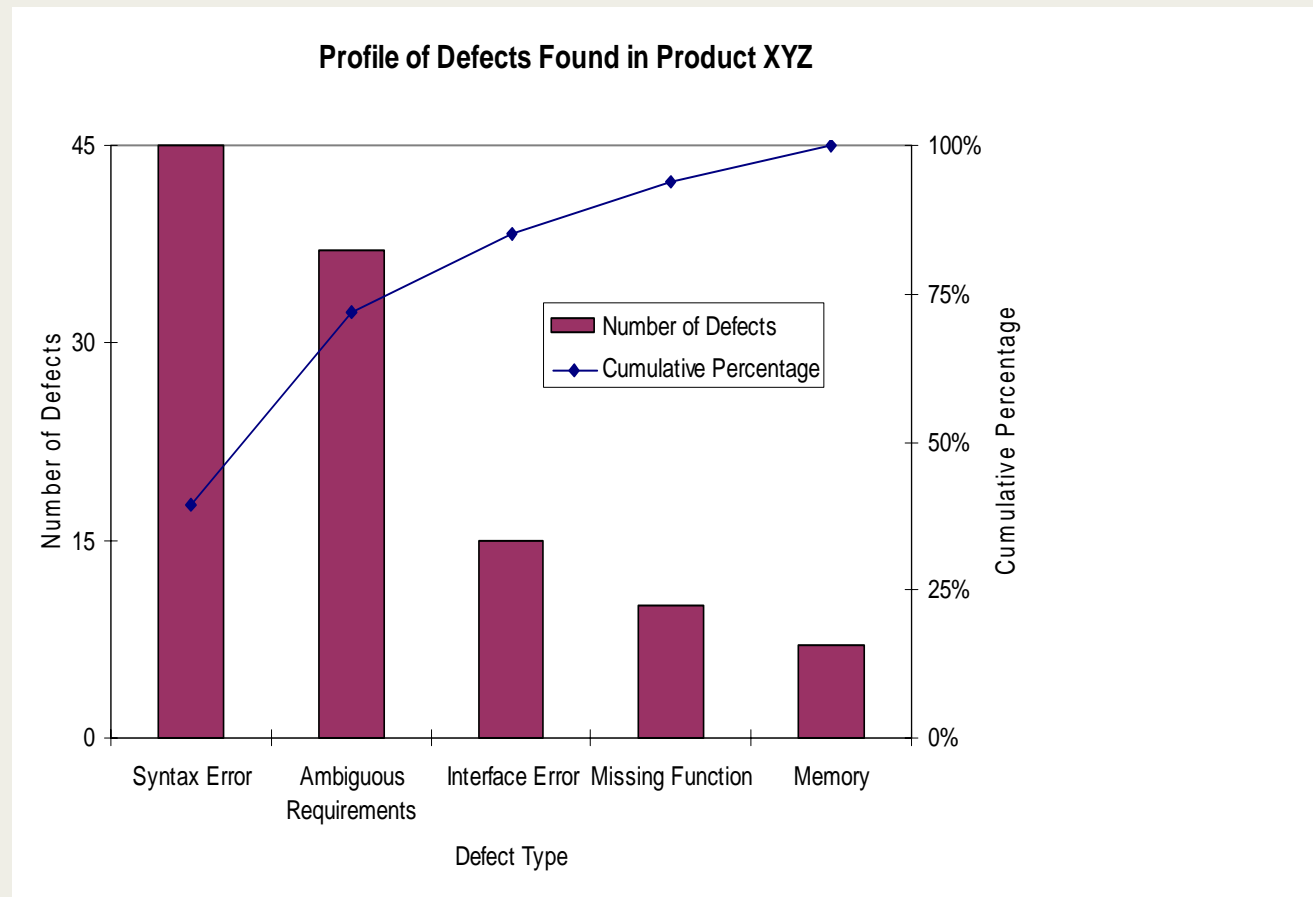



Tooltip: Cause & Effect Diagrams

Description

*Also called “Fishbone” or “Ishikawa” diagrams)

Usage

- Allow you to probe for, map, and prioritize a set of factors that are thought to affect a particular process, problem, or outcome.
- Help elicit and organize information from people who work within a process and know what might be causing it to perform the way it does.




Cause & Effect Diagram: Tips

You can spend a lot of time discussing what the principal causes should be (the main branches) if you are not careful.

- May need to work on the categorization of causes in advance
- May want to just use generic cause categories like; Materials, Equipment, Operators, Procedures and Environment.




Cause & Effect Diagram: Example

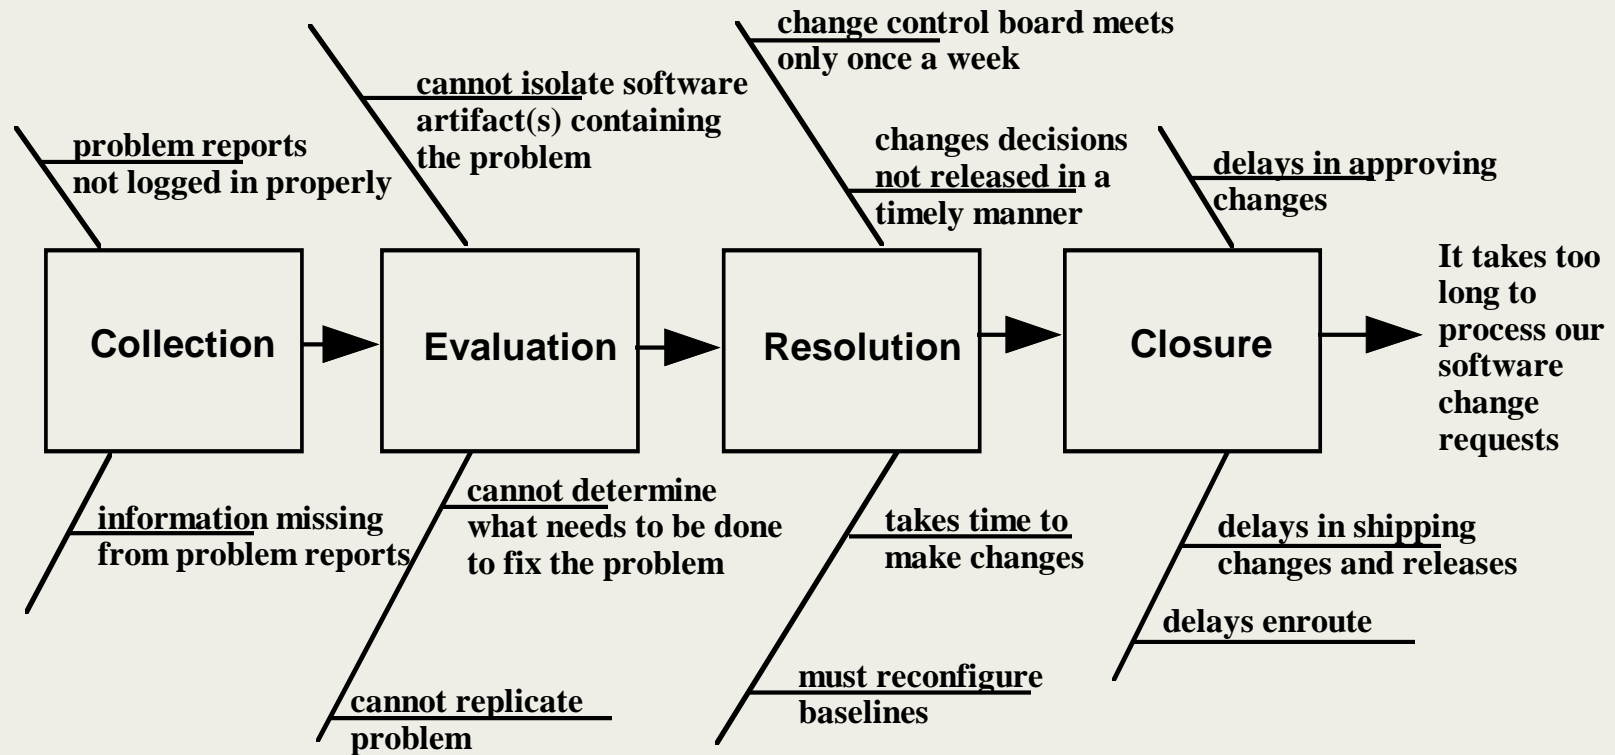



Basic Tools: Cause & Effect

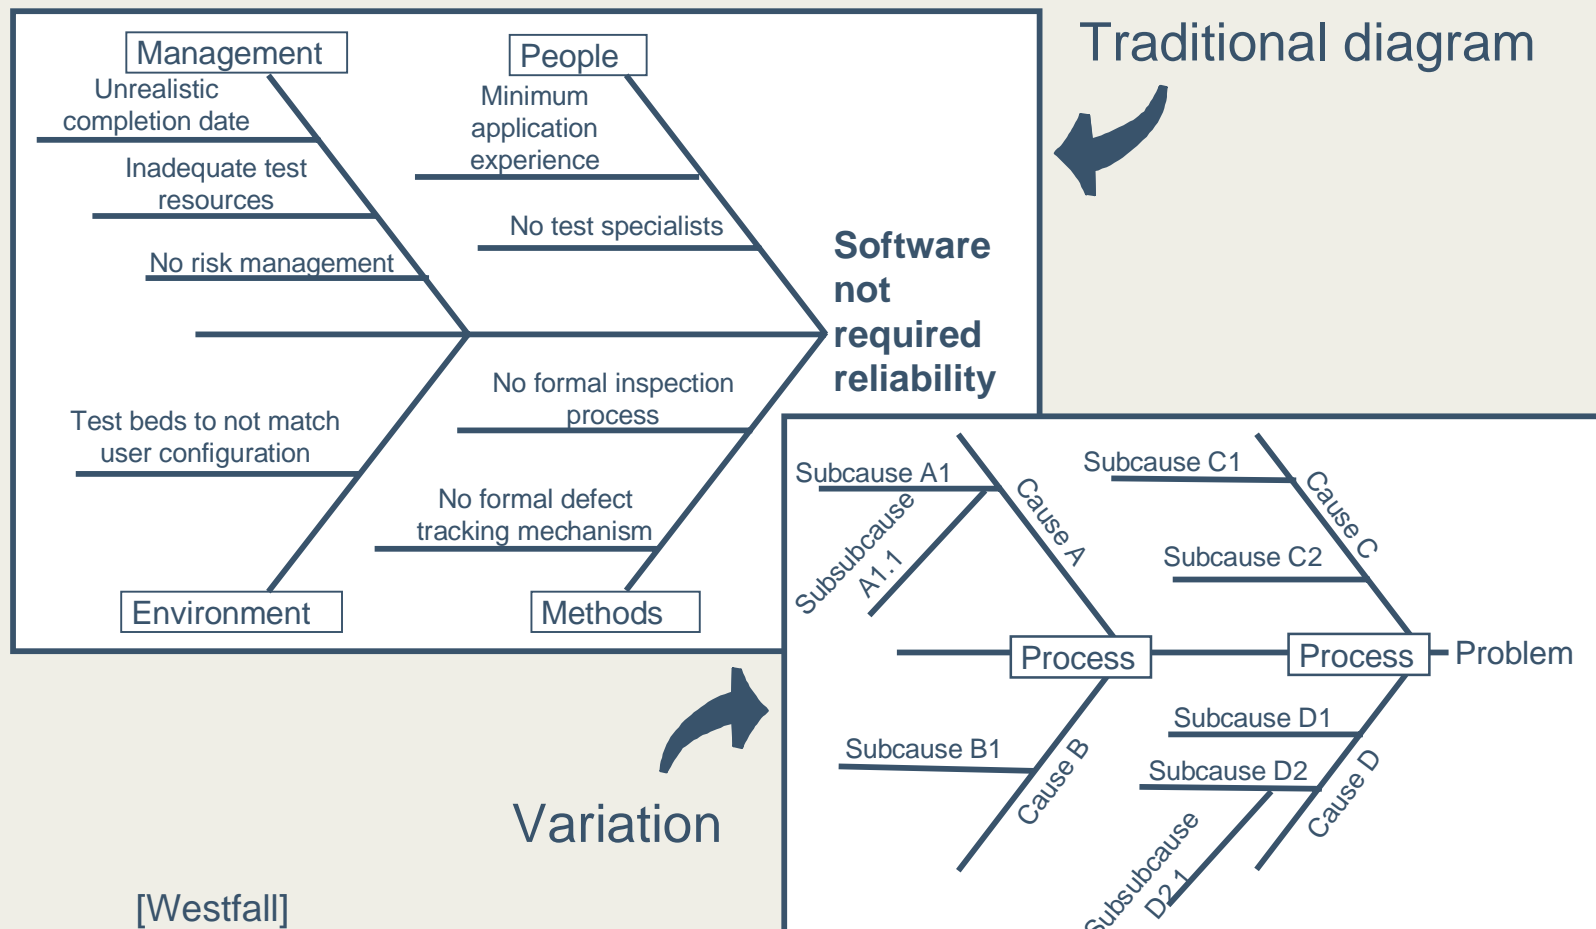

[Westfall]



Tool Tip: Cause & Effect Matrix

Description

- method to determine possible causes of variation in the process and to feed future experimental designs

Purpose

- to organize problem-solving efforts when there are multiple responses involved
- to prioritize the number of factors to study
- to build team consensus about what is to be studied



Cause & Effect Matrix: Usage

When to use:

- team is overwhelmed with the number of variables affecting process
- not possible to experiment with **all** of the variables – need to narrow down the list
- team is struggling with which factors may have the biggest impact
- it is not clear how each factor impacts customer requirements

Feeds other tools:

- Failure Mode and Effects Analysis
- Data collection plans
- Experimentation
- Control plans

[Hexsab 02]



Cause & Effect Matrix: Terms

Process: The combination of people, equipment, materials, methods and environment that produce output (product or service). It is a repeatable sequence of activities with measurable inputs and outputs.

Parameter: A measurable characteristic of a product or process.

Process Parameter: A measurable characteristic of a process that may impact product performance but may not be measured on the product. (The “x.”)

End-Product Parameter: A parameter that characterizes the product at the finished product stage. (The “Big Y.”)

In-Process Product Parameter: A parameter that characterizes the product prior to the finished product stage. It is measured on the product upstream and is the result of a process step. (The “little y.”)

Input Variable: An output from other processes. (Neither x’s or y’s.)

[Hexsab 02]



Cause & Effect Matrix: Procedure

Identify the y's from process map.

Rate the y's on a scale from 1-10.

- Involve the “customers” to determine the ratings.
- Ratings are relative.

List the process steps and all of the x's from the process map.

Rate the relationship of each x to each y on a 0, 1, 3, 9 scale.

- 0 = No relationship between x and y
- 1 = Remote relationship between x and y
- 3 = Moderate relationship between x and y
- 9 = Strong relationship between x and y

For each x

- Multiply each relationship rating by the corresponding y rating
- Sum the products

Use the summations to rank and select x's for future experiments or focused efforts

[Hexsab 02]



Cause & Effect Matrix: Format

Y's:

--	--	--	--	--	--	--	--

Y ratings:

--	--	--	--	--	--	--	--

Process steps	X's	X relationship to Y						Sum



Tool Tips Part 2: Beyond Basics

Overview (description, procedure, tips, examples) for

- capability
- voice of the customer
- management by fact
- process mapping



Tooltip: Process Capability

Description


- When a process is in statistical control with respect to a given set of attributes, we have a valid basis for predicting, within limits, how the process will perform in the future.

Usage

- Addresses predictable performance of a process under statistical control.
- For a process to be capable, it must meet two criteria:
 - The process must be brought into a state of statistical control for a period of time sufficient to detect any unusual behavior.
 - The capability of the process must meet or exceed the specifications that have to be satisfied to meet business or customer requirements.




Histogram Reflecting Process Capability

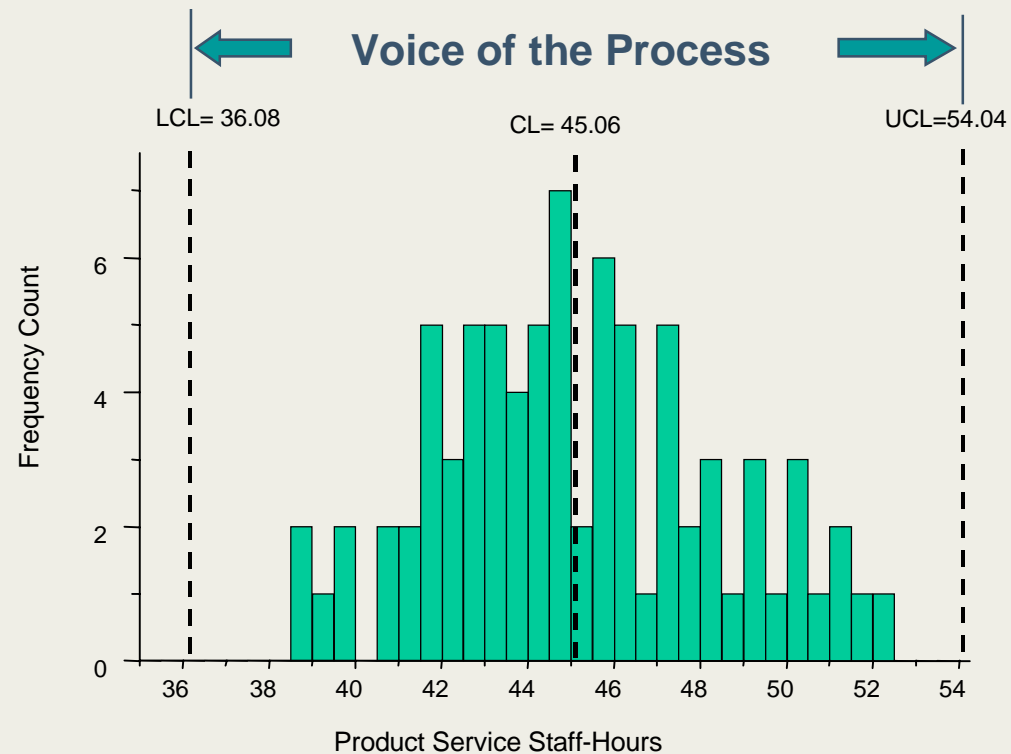



Process Capability vs. Capable Process

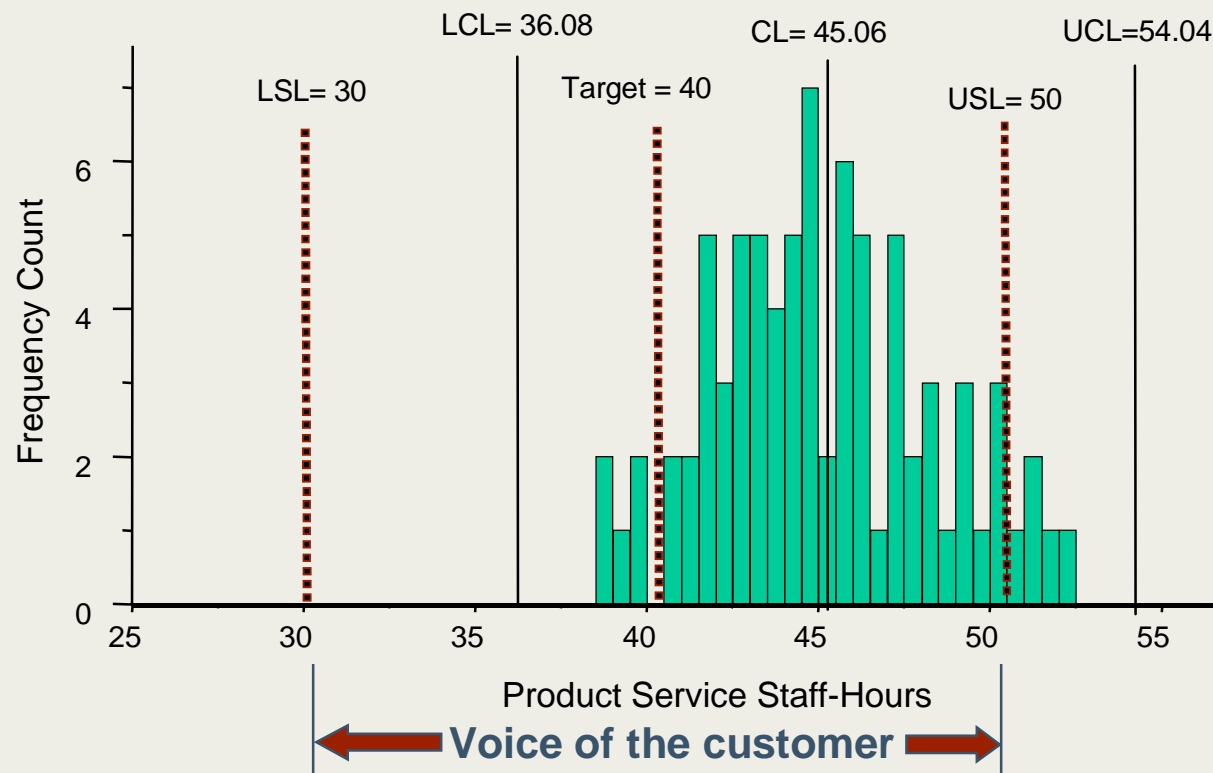



Tool Tip: Voice of the Client (VOC)

Description

- a method to describe the stated and unstated needs or requirements of the customer
- can captured in a variety of ways: direct discussion or interviews, surveys, focus groups, customer specifications, observation, warranty data, field reports, complaint logs, etc.



VOC: Usage

Feeds Quality Function Deployment (QFD)

Risks

- anecdotal, not quantitative
- difficult to get “the right answer”
- humans are PERFECT FILTERS!
- it is very easy to induce bias in VOC

Tips

- use existing information with care – it may be biased or too narrowly focused
- always use more than one source
- customer visits allow direct discussion and observation
- customer visits allow immediate follow-up questions and unexpected lines of inquiry



VOC Interviews: Procedure ₁

- Define the customer
- Select customers to interview
 - Always interview more than one
- Plan interview
 - Develop a checklist/guideline
 - Teams of 3: “Moderator,” “Scribe,” “Observer”
- Conduct interviews
 - Customer statements & observations need to be recorded VERBATIM
 - Keep asking “why”



VOC Interviews: Procedure ₂

Create VOC table.

- Interpret verbatim statements into new meanings.
- Document source of VOC or re-worked VOC.
 - “I” if internally changed or generated (by team)
 - “E” if externally generated (by customer) or not changed by team
- Classify each statement as:
 - a real need \perp feeds QFD
 - a technical solution
 - a feature requirement \perp feeds QFD
 - not a true need (e.g., cost issue, complaint, technology, hopes dreams, etc.)
- Quantify, Analyze, Prioritize



VOC: Example Table

New process initiative under consideration

- interview statements recorded verbatim and classified
- column added for keyword sorting

Further development

- “interpreted” comments about the organization’s true goals, the overlap of initiatives (and so on)
- evaluation for common themes
- additional data collection may be needed

Customer comment	Interpreted, reworded	I/E	Classification					Keyword for sorting
			perception, experience, context	barrier	root issue?	results, success	need	
We are already at maturity level x, so why do more?		E	✓	✓				competing initiatives



VOC: Analysis

Prioritization Method	Customer Time	Preparation Complexity	Analysis Complexity	Quality of Resulting Prioritization	Number of customers needed	Number of Needs to Prioritize	Recommend
Frequency of Response	short	low	low	low	large	large	NO
Constant Sum	medium	medium	medium	medium	medium	small	Yes
Rating	short	low	low	medium	medium	med-large	Yes
Simple Ranking	medium	low	low	medium	medium	small-med	Yes
Q-Sort	short	low	low	medium	medium	large	Yes
Paired Comparison	long	medium	high	high	large	small	Yes
Regression	short	medium	high	high	large	small-med	Yes



Tool Tip: Management by Fact (MBF)

Description

- a concise summary of quantified problem statement, performance history, prioritized root causes and corresponding countermeasures for the purpose of data-driven project and process management

Management by Fact

- uses the facts
- eliminates bias
- tightly couples resources and effort to problem-solving



MBF: Procedure

Identify and select problem

- use “4 Whats” to help quantify the problem statement
- quantify gap between actual and desired performance

Determine root cause

- separate beliefs from facts
- use “7 Basic Tools”
- use “5 Whys”

Generate potential solutions and select action plan

- Must be measurable/sustainable
- Specific/assignable ownership
- Understand expected results from each action

Implement solutions and evaluate

- Compare data before and after solution
- Document actuals and side effects
- Compare with desired benchmark



MBF: 4 Whats

Customer satisfaction scores are too low.

- What is too low?

Compared to best-in-class benchmark of 81%, we are at 63%.

- What is the impact of this gap?

It represents lost revenue and earnings potential?

- What is the correlation between customer satisfaction and revenue?

Each percent of customer satisfaction translates to 0.25 percent of market share which equals \$100M US revenue.

- What is the lost potential?

Final problem statement:

Customer satisfaction is 18% lower than best-in-class benchmark, which corresponds to a potential lost revenue of \$1.8B US.



MBF: 5 Whys

The marble in the Jefferson Memorial was deteriorating.

Why?

The deterioration was due to frequent cleanings with detergent.

Why?

The detergent was used to clean bird droppings from local sparrows.

Why?

The sparrows were attracted by spiders.

Why?

The spiders were attracted by midges.

Why?

The midges were attracted by the lights.

Solution: **Delay turning on the lights until later at dusk.**



MBF: Format

FACTUAL STATEMENT OF PROBLEM, PERFORMANCE TRENDS & OBJECTIVES

Graph of performance over time

Graph of supportive or more detailed information

Prioritization & Root Cause

List of gaps in performance and true root cause

Counter Measures & Activities

List of specific actions, who has ownership and due date

Impact, Capability




List of expected benefits and impact of **each** countermeasure



MBF: Example

Problem Statement

Customers A, B and C, representing x% of market share, are facing budget/cost constraints and require a 10% cost reduction in our product line XYZ in order to continue doing business with us. Baseline data shows that 33% of software development time is spent detecting and correcting defects.

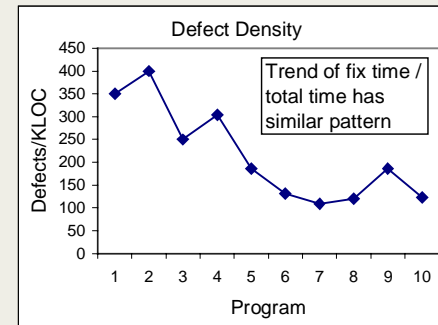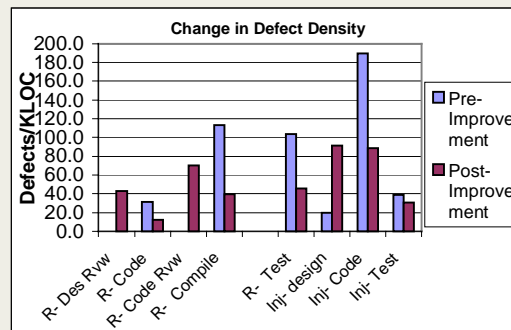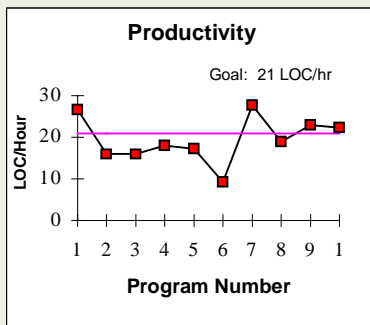

Prioritization & Root Cause	Counter Measures & Activities	Who	When	
Large Quantity of Syntax & Similar defects that are repaired in <10 minutes on avg <i>Goal is 50% reduction in time, relative to historical data</i>	Clarify type definitions	jms	✓ 4/30/2001	
	Improve subcategory data collection	jms	✓ 4/30/2001	
	Build a cause & effect diagram to be used for next round of analysis, improvement planning	jms		
	Increase correction efficiency by seeking all occurrences of a defect upon the detection of the first occurrence	jms	✓ 4/30/2001	
	Increase and log (new) usage of off-line programs to test small pieces of functionality	jms		
	Create & Use a syntax checklist	jms	✓ 4/30/2001	
	"Big Hitter" (>10 minutes) defects involve a variety of errors that escape to testing. Design-injected and Test-removed errors fall into this category <i>Goal is 25% reduction in time, relative to historical data</i>	Time breaks: phase completion & every hour	jms	✓ 4/30/2001
		Conduct a phase check prior to moving on	jms	✓ 4/30/2001
		Increase and log (new) usage of off-line programs to test small pieces of functionality	jms	✓ 4/30/2001
		Improve subcategory data collection to use for developing a more directed design review	jms	✓ 4/30/2001
	Build a cause & effect diagram to be used for next round of analysis, improvement planning	jms		


Expected Benefit/Impact
About 1/2 of goal. In normalized terms, ~1 LOC/hr increase
About 1/2 of goal. In normalized terms, ~1 LOC/hr increase.



Tool Tip: Process Mapping

Description

- representation of major activities/tasks, subprocesses, process boundaries, key process inputs, and outputs

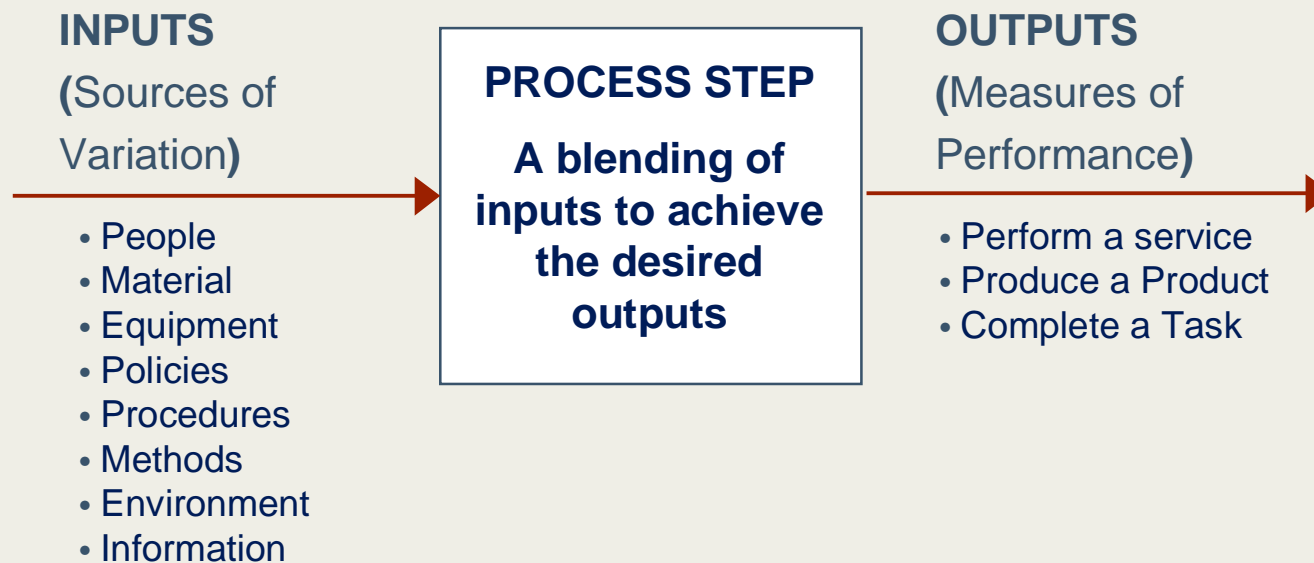



Mapping: Usage

Feeds other tools

- Cause and Effects Matrix
- Failure Modes and Effects Analysis (FMEA)
- Control Plan Summary
- Design of Experiments (DOE) planning

Tips for mapping current processes

- Go to the **actual place** where the process is performed.
- Talk to the **actual people** involved in the process and get the real facts.
- Observe and chart the **actual process**.
- Consider creating “as is” and then “to be” maps.

Reality is invariably different from perception - few processes work the way we think they do!



Process Mapping: Basic Procedure

List inputs and outputs

Identify all steps in the process: value-added and non-value-added

Show key outputs at each step (process and product)



List key inputs and classify process inputs

Add the operating specifications and process targets for the controllable and critical inputs



Process Mapping: Example

Inspection process from earlier illustration

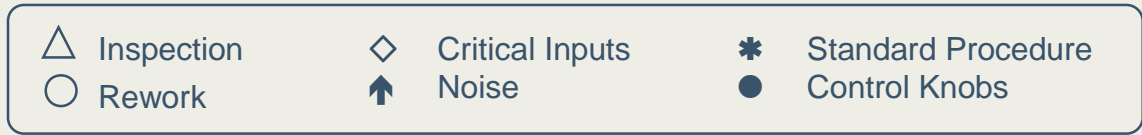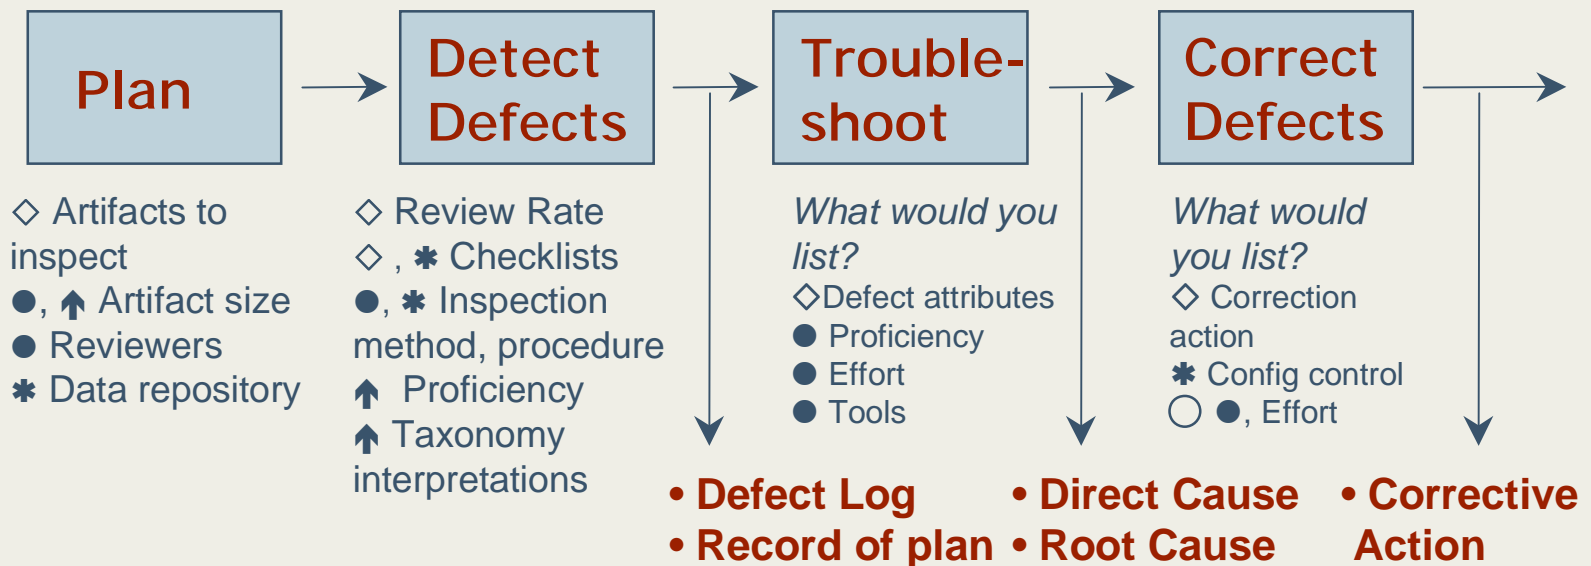



Process Mapping: Value Map

Identify the process to map

Identify the boundaries

Create input-process-output for the critical processes

Create the process map

Color code each step identifying value

- green = value added
- red = non value added
- yellow = non value added but necessary
- Identify hand-off points, queues, storage, and rework loops in the process
- Quantitatively measure the map (throughput, cycle time, and cost)
- Validate map with process owners



Value Mapping: Change Request

