

UNCLASSIFIED

AD 299 397

*Reproduced
by the*

ARMED SERVICES TECHNICAL INFORMATION AGENCY
ARLINGTON HALL STATION
ARLINGTON 12, VIRGINIA



UNCLASSIFIED

NOTICE: When government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U. S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

299 397

CATALOGED BY ASTIA
AS AD NO. _____

299397

63-2-4
UNCLASSIFIED

INVESTIGATION OF ULTRASONIC WELDING OF REFRACTORY METALS AND ALLOYS

January 1963

Prepared under Navy Bureau of Naval Weapons
Contract No. N0w 63-0125-c

Bimonthly Progress Report No. 2
16 October 1962 through 16 December 1962

THE INFORMATION CONTAINED IN THIS
PROGRESS REPORT IS PRELIMINARY AND
SUBJECT TO REVISION OR MODIFICATION.

AEROPROJECTS INCORPORATED
WEST CHESTER, PENNSYLVANIA

UNCLASSIFIED

UNCLASSIFIED

INVESTIGATION OF ULTRASONIC WELDING
OF REFRACTORY METALS AND ALLOYS

January 1963

Prepared under Navy Bureau of Naval Weapons
Contract No. N0w 63-0125-c

Bimonthly Progress Report No. 2
16 October through 16 December 1962

AEROPROJECTS INCORPORATED
WEST CHESTER, PENNSYLVANIA

UNCLASSIFIED

INVESTIGATION OF ULTRASONIC WELDING
OF REFRACTORY METALS AND ALLOYS

ABSTRACT

The programming of ultrasonic welding power is shown to be straightforward. Similar control of clamping force involved employment of various hydraulic circuitry prior to achievement of acceptable response time. Use of an alternate valve component in the hydraulic system is to be investigated for result comparison purposes. Problems relative to establishment of specifications for quality refractory metals are mentioned.

TABLE OF CONTENTS

	<u>Page</u>
ABSTRACT	ii
 <u>INVESTIGATION OF ULTRASONIC WELDING OF REFRACTORY METALS AND ALLOYS</u>	
Power-Force Programming Equipment	1
A. Power Programming	1
B. Force Programming	1
Weldment Materials	2
Miscellaneous	3
Program Planning and Execution	3
Future Work	3
REFERENCES	3

LIST OF FIGURES

<u>Figure</u>		<u>Page</u>
1A	Hydraulic Circuit for Standard Ultrasonic Welder	4
1B	Force Response Curves	4
2	Typical Force Response Curve to Single Step Control Function with 60-Cycle Pacing Signal	5
3	Investigation of Ultrasonic Welding of Refractory Metals with Power-Force Programming	6

INVESTIGATION OF ULTRASONIC WELDING OF REFRACTORY METALS AND ALLOYS

The ultrasonic welding cycle involves an induction period wherein the sonotrode tip slips during the establishment of coupling, and an interval wherein tip amplitude may decrease as the weld is generated. The slip interval produces heat that is probably unnecessary, and the interval of amplitude decline seems to be associated with high cyclic stresses in the weldment. The programming of power and clamping force will operate to reduce power, to improve welding control, and to extend the utility of the process. Thus, the work here discussed is concerned with power-force programming and to the specific objective of joining refractory metals.

The division of the work and development effort is presented in the program control chart included elsewhere in this report.

A summary of the work executed during this period follows:

Power-Force Programming Equipment

A. Power Programming

The output power level of a standard 4-kilowatt ultrasonic spot welder is controlled by varying the amplitude of the high-frequency signal supplied to the power amplifier stages of the generator. Step control of this signal level is straightforward. Measurements show that output power follows variations in amplitude of the applied signal faithfully, and that the response, from the instant the control signal is applied until the output power has actually changed, is less than 0.002 second.

This response is within the presently envisioned requirements, and a power-programming control circuit is being assembled on this basis.

B. Force Programming

The hydraulic system of a 4-kilowatt welder has been modified so that the applied clamping force can be rapidly increased or decreased by varying the oil pressure on the welder's primary force pistons. Figure 1A schematically illustrates the system. The rapid force-changes implicit in force-programming will be effected by controlling by-pass oil flow (see dotted line of Figure 1A) thus increasing or decreasing oil pressure, beyond the manually adjustable pressure valve (Q), that is delivered by the motor and hydraulic pump (Z).

Figure 1B summarizes response data already obtained on three flow-control valves.

Curve A summarizes data obtained with a standard General Controls magnetic, solenoid-controlled, tapered-seat-type valve. A part of the delay (up to 0.050 second) is the time required to overcome the hydraulic pressure which normally aids in the sealing or closing of this valve type.

Curve B presents summary response data on the performance of a high-response, shear-seal valve (Barksdale Valve Co.), and Curve C shows similar information realized when a standard continuous by-pass valve (designated Q in Figure 1) was replaced with a Republic Manufacturing Co. Model G50, 2-1/2-inch pressure-control ball-check valve.

Figure 2 shows an actual strip-chart oscillogram of the variation of the force when a step signal is applied. The high-response, shear-seal valve responded between 0.016 and 0.020 second after application of the electrical signal, and the drop in force occurred about 0.008 second later. The response on the rise was again 0.020 second after removal of the electrical signal, with pressure build-up in about 0.060 second.

A second approach, presently in test, involves control of the necessary force by a servo-valve. This valve is controlled by a servo amplifier which responds to command signals from the program control circuit.

The response with the use of the servo-valve will be compared to that realized with the shear-seal valves. The better of the two methods will be used.

Weldment Materials

An intensive study of available refractory metals information shows that the quality of these newer metals, and in particular their sub-surface contamination, probably contributes greatly to difficulties encountered in the ultrasonic welding thereof.

Efforts to establish procurement specifications for refractory metals of satisfactory quality are continuing. Letters requesting assistance in this work have been sent to the various suppliers. The General Electric Company, Cleveland, Ohio, was visited to discuss methods of material process control. The conclusions of this conference were:

1. General Electric has experienced non-uniformity and impurity problems with both molybdenum and Mo-0.5Ti.
2. General Electric will supply test materials of considerably more uniform quality, as free from surface contamination as possible.

Quotations for the necessary quantities of each material in the highest quality attainable have been solicited. To date, replies have been received from two vendors only.

MiscellaneousProgram Planning and Execution

A schedule incorporating the important elements of this development has been established (Figure 3). The interval between the date of the contract documents and the receipt thereof necessitates a considerable consolidation of effort during the April, May, and June work period. Every attempt will be made to adhere to the established control schedule, and modifications will be made thereto only if essential.

Future Work

1. PFP circuitry, for both the time base control and power and force control, will continue to be assembled and tested.
2. Efforts to obtain the highest quality materials will continue. Orders will be placed for limited quantities of each alloy of interest.
3. Preliminary non-PFP welding of the control alloys (stainless steel and Inconel X) will be initiated.

REFERENCES

1. Aeroprojects Incorporated, "Ultrasonic Welding of Refractory Metals", under Navy Contract No. N0w-61-0410-c.
2. Aeroprojects Incorporated, "Development of Ultrasonic Welding Equipment for Refractory Metals - Phase II", under Air Force Contract No. AF 33(600)-43026.

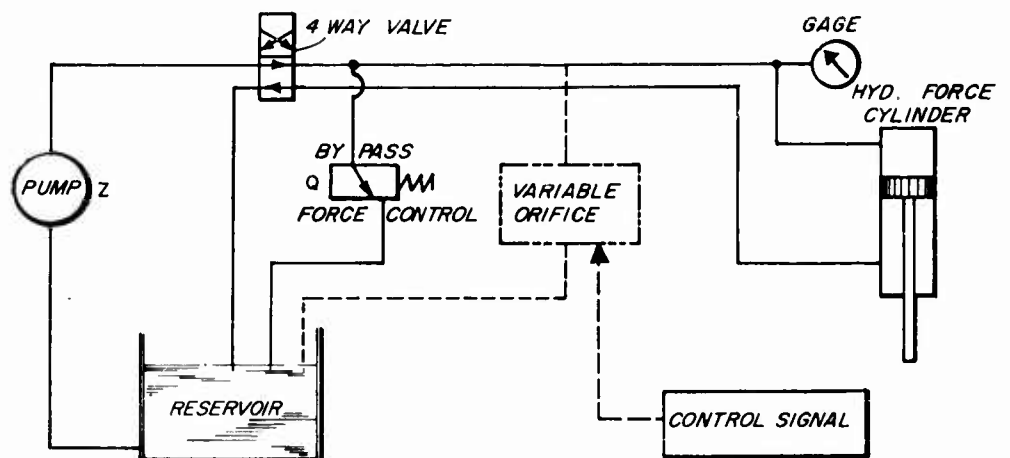


Figure 1A

HYDRAULIC CIRCUIT FOR STANDARD ULTRASONIC WELDER

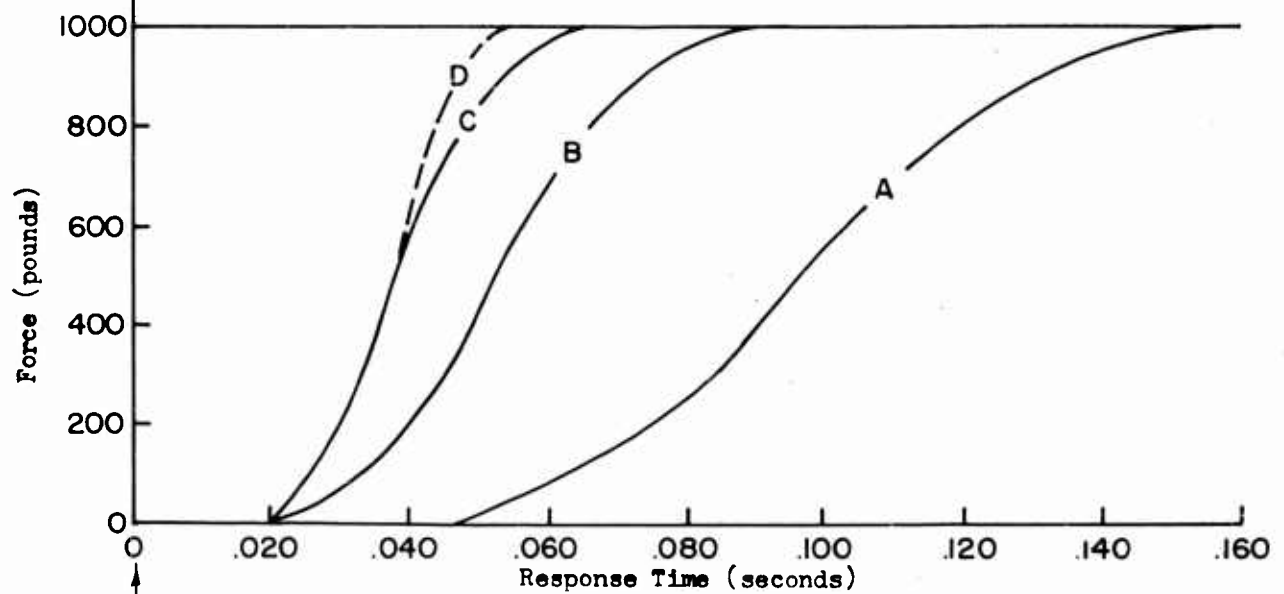


Figure 1B

FORCE RESPONSE CURVES

- Curve A: Solenoid-Controlled Tapered-Seat-Type Valve
- Curve B: Solenoid-Controlled High-Response Shear-Seal Valve
- Curve C: Addition of Low Pressure Cut-off in Control Line
- Curve D: Estimated Response with Addition of Pressure Accumulator


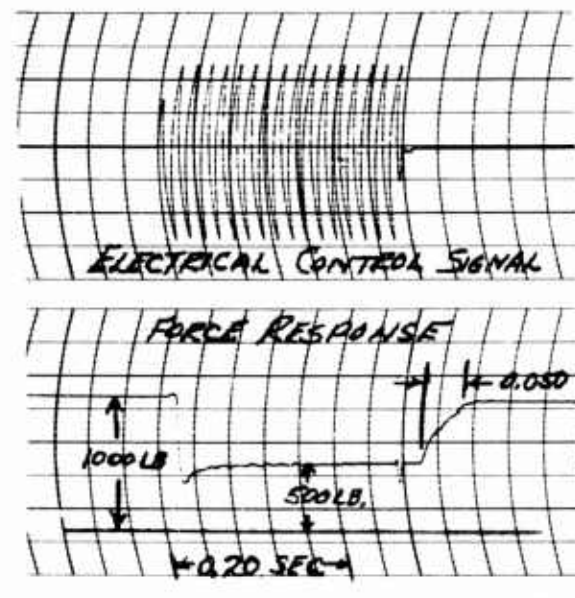


Figure 2

TYPICAL FORCE RESPONSE CURVE TO SINGLE
STEP CONTROL FUNCTION WITH
60-CYCLE PACING SIGNAL

FINAL SUMMARY TECHNICAL REPORT

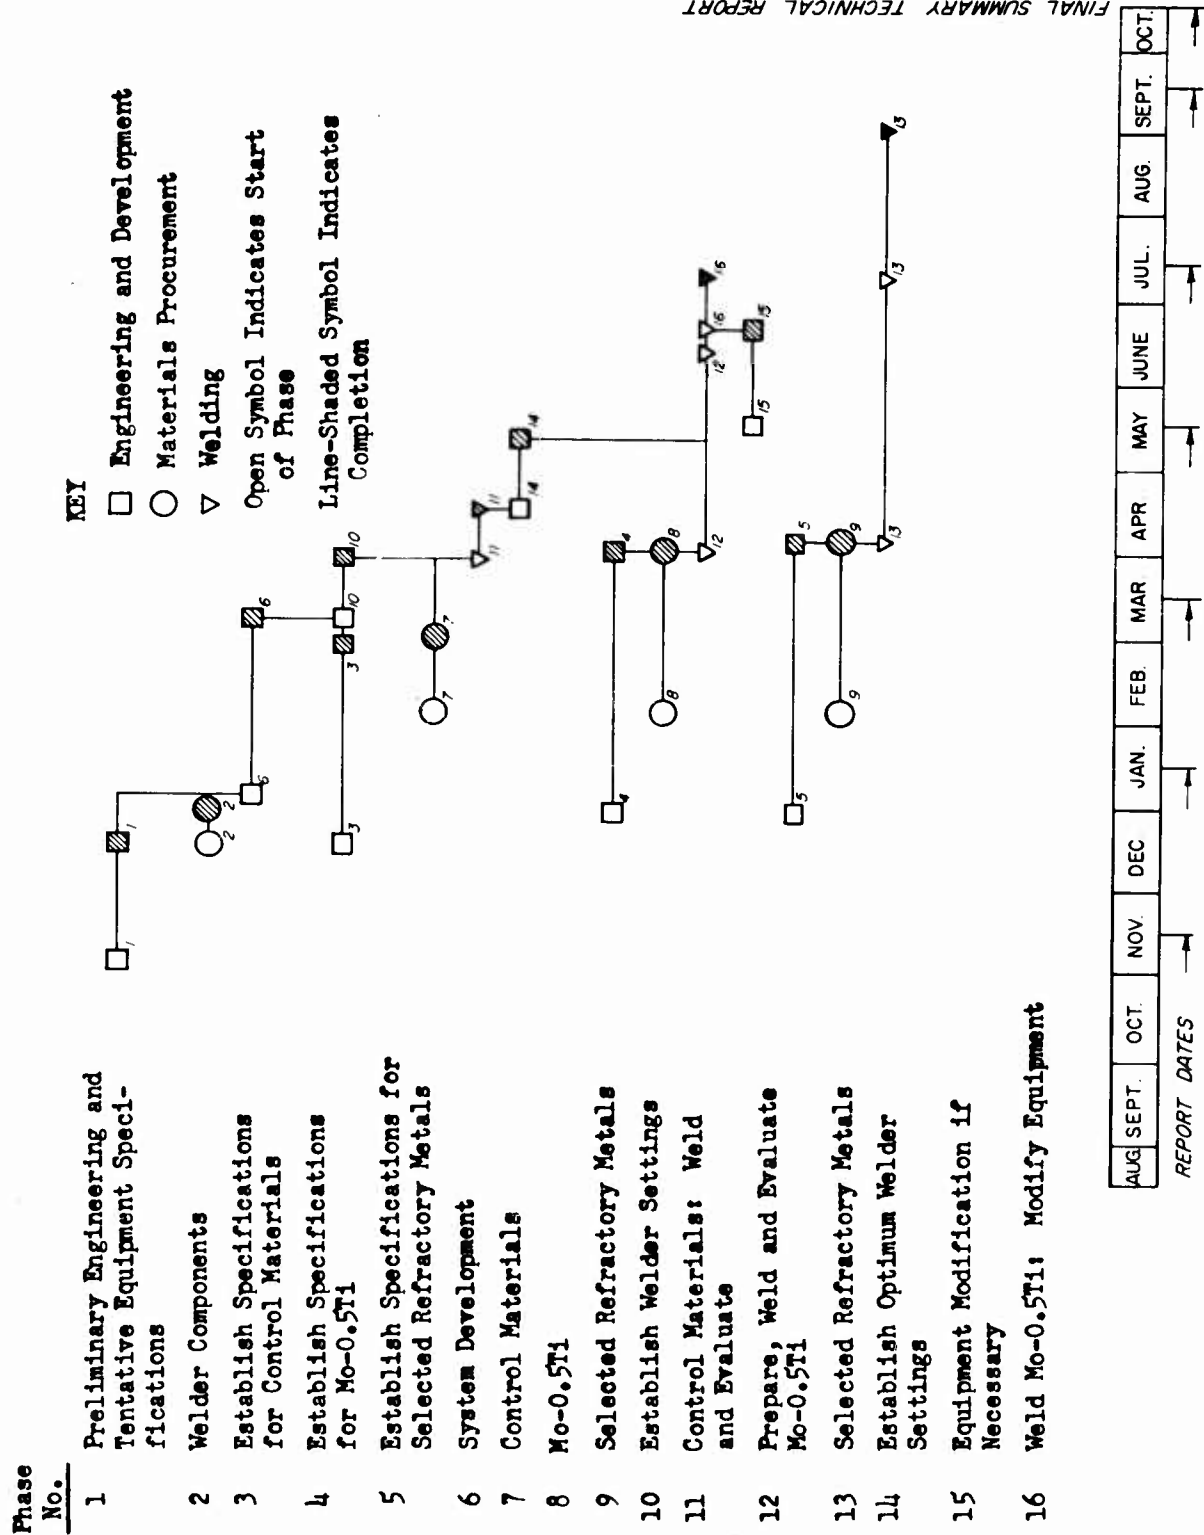

INVESTIGATION OF ULTRASONIC WELDING OF REFRACTORY METALS WITH POWER-FORCE PROGRAMMING

DISTRIBUTION COPIES

<u>Number of Copies</u>		<u>Number of Copies</u>	
12 and 1 repro	Chief, Bureau of Naval Weapons Washington 25, D. C. Attention: DLI-31 RRMA-24 (6) PID-2 (1) NFR-531 (1) SP-27 (1) RMMP-23 (1) DLI-31 (2)	1	Commanding Officer Naval Ordnance Test Station China Lake, California Attn: Code 55
		1	U. S. Army Research Office 3045 Columbia Pike Arlington 4, Virginia Attn: Mr. A. L. Tarr
10	Armed Services Tech. Info. Agency Arlington Hall Station Arlington 12, Virginia Attn: Document Service Center (TICSCP)	1	Headquarters, Army Material Command Washington 25, D. C. Attn: AMCRD-RS-CM
2	Office of Technical Service Department of Commerce Washington 25, D. C.	1	Commanding Officer Watertown Arsenal Watertown, Massachusetts Attn: Mr. N. L. Reed, Ordnance Materials Research Office
1	Chief, Bureau of Ships Department of the Navy Attn: Code 634B Washington 25, D. C.	1	Commanding General Frankford Arsenal Philadelphia 37, Pennsylvania Attn: Mr. J. J. Power, Jr. (ORDBA-IMJ)
1	Commanding Officer Naval Ordnance Laboratory White Oak, Silver Spring Maryland Attn: Technical Library	1	Army Ballistic Missile Agency Redstone Arsenal Huntsville, Alabama Attn: Chief, Materials Branch Development Operations Division
1	Chief, Naval Research Laboratory Department of the Navy Washington 25, D. C. Attn: Mr. W. Pellini, Supt. Metallurgy Dept.	1	Commanding Officer Watertown Arsenal Laboratories Watertown 72, Massachusetts Attn: Mr. S. V. Arnold, Associate Director
1	Chief, Office of Naval Research Department of the Navy Washington 25, D. C. Attn: Metallurgy Section	1	Commanding Officer Army Rocket and Missile Agency Redstone Arsenal, Alabama Attn: Technical Library (ORDXR-OTC)
1	Commanding Officer Naval Air Engineering Center Philadelphia 12, Pennsylvania Attn: Metallurgy Division, AML		

DISTRIBUTION LIST (Continued)

- | | | | |
|---|---|---|--|
| 1 | Commanding Officer
Army Chemical Corps Command
Munitions Division
Army Chemical Center, Maryland
Attn: Mr. Joseph Trost | 1 | U. S. Atomic Energy Commission
Attn: Technical Information Service
Oak Ridge, Tennessee |
| 1 | Commanding Officer
Engineering Res. & Dev. Lab.
Department of the Army
Fort Belvoir, Virginia
Attn: Metallurgical Dept. | 1 | National Academy of Sciences
2101 Constitution Avenue, N. W.
Washington 25, D. C.
Attn: Dr. J. Lane, Metallurgist
Materials Advisory Board |
| 1 | Commander
Aeronautical Systems Division
Attn: Metals & Ceramics Laboratory
(ASRCM)
Wright-Patterson Air Force Base, Ohio | 3 | Aerospace Industries Association
Technical Services Division
Shoreham Building
Washington 5, D. C. |
| 1 | Commander
Aeronautical Systems Division
Attn: Applications Lab. (ASRCE)
Wright-Patterson Air Force Base, Ohio | 1 | Welding Research Council of the
Engineering Foundation
345 East 47th Street
New York 17, New York |
| 2 | Commander
Aeronautical Systems Division
Attn: Manufacturing Technology
Laboratory (ASRCT) | 2 | Battelle Memorial Institute
Defense Metals Information Center
Attn: Mr. C. S. DuMont
505 King Avenue
Columbus 1, Ohio |
| 3 | Director
National Aeronautics and Space Admin.
1520 H Street, N. W.
Washington 25, D. C. | 1 | Battelle Memorial Institute
505 King Avenue
Columbus 1, Ohio
Attn: Mr. M. J. Rieppel
Chief, Metals Joining Division |
| 1 | The Arnold Engineering Company
P. O. Box C
Marengo, Illinois
Attn: Mr. Benjamin Falk | 1 | Armour Research Foundation
Illinois Institute of Technology
Metals Research Dept.
3350 S. Federal Street
Chicago 16, Illinois
Attn: Dr. W. Rostoker |
| 1 | Atomic Energy Commission
Germantown, Maryland
Attn: Mr. J. Simmons, Div. of
Reactor Development | 1 | Rensselaer Polytechnic Institute
Department of Metallurgical Eng.
110 Eight Street
Troy, New York
Attn: Dr. Earnest Nippes |
| 2 | Brookhaven National Laboratory
Information and Publication Service
Uptown, New York
Attn: Miss Mary Weismann, Document Section | | |

DISTRIBUTION LIST (Continued)

- | | | | |
|---|---|---|---|
| 1 | Ohio State University
Department of Welding Engineering
Columbus, Ohio
Attn: Prof. R. B. McCauley | 1 | North American Aviation, Inc.
Los Angeles Division
International Airport
Los Angeles, California
Attn: Mr. H. D. Mason,
Engineering Section |
| 1 | Massachusetts Institute of Technology
Metallurgy Department
Cambridge 39, Massachusetts
Attn: Dr. Clyde Adams | 1 | North American Aviation, Inc.
Columbus Division
1310 N. 5th Avenue
Columbus, Ohio
Attn: Mr. Paul Maynard, Chief of
Materials |
| 1 | New York University
College of Engineering
New York 53, New York
Attn: Dr. C. C. Goetzel, Res. Div. | 1 | Westinghouse Electric Corporation
Research Laboratories
Beulah Road, Churchill Boro
Pittsburgh 35, Pennsylvania
Attn: Chief, Metals Joining Section |
| 1 | University of California
Los Alamos Scientific Laboratory
Los Alamos, New Mexico
Attn: Mr. J. R. Taub, Group Leader | 1 | Gulton Industries, Inc.
212 Durham Avenue
Metuchen, New Jersey
Attn: Director, Research & Dev. |
| 1 | Pratt & Whitney Division
United Aircraft Corporation
Connecticut Aircraft Nuclear
Engines Laboratory
Middletown, Connecticut
Attn: Mr. L. M. Raring, Chief
Metallurgist | 1 | Circo Ultrasonic Corporation
Attn: Mr. R. Carlin, Vice-President
51 Terminal Avenue
Clark, New Jersey |
| 1 | The Martin Company
Attn: Chief, Manufacturing Res. &
Development Laboratory
Denver 1, Colorado | 1 | The Budd Company
Defense Division
2450 Hunting Park Avenue
Philadelphia 32, Pennsylvania
Attn: Chief, Metallurgy Dept. |
| 1 | Crucible Steel Company
Titanium Division
Midland, Pennsylvania
Attn: Dr. Walter L. Finley | 1 | Sciaky Brothers, Inc.
4915 W. 67th Street
Chicago 38, Illinois
Attn: Mr. W. J. Farrell, Chief
Applications Engineer |
| 2 | Mallory Sharon Titanium Corporation
Niles, Ohio
Attn: Dr. L. S. McCoy
Dr. L. S. Busch | 1 | Climax Molybdenum Company
1410 Woodrow Wilson Avenue
Detroit 3, Michigan
Attn: Mr. A. J. Herzig |

DISTRIBUTION LIST (Continued)

- | | | | |
|---|--|---|---|
| 1 | Universal-Cyclops Steel Corporation
Refractomet Division
Bridgeville, Pennsylvania
Attn: Mr. C. Mueller, Mgr. | 1 | Lockheed Aircraft Corporation
Missile and Space Division
3251 Hanover Street
Palo Alto, California
Attn: Mr. R. A. Perkins
Metallurgist & Ceramic Res. |
| 1 | General Electric Company
Applied Research Operations
Flight Propulsion Laboratory Dept.
Cincinnati 15, Ohio
Attn: Mr. Louis P. Jahnke, Mgr.
Metallurgical Engineering | 1 | General Telephone and Electronics
Laboratories, Inc.
P. O. Box 59
Bayside, New York
Attn: Dr. L. L. Seigle, Mgr.
Metallurgical Lab. |
| 1 | General Electric Company
Missile and Ordnance Systems Dept.
3750 D Street
Philadelphia 24, Pennsylvania
Attn: Aerosciences Laboratory | 1 | National Aeronautics & Space Admin.
Lewis Research Center
21000 Brookpark Road
Cleveland 35, Ohio
Attn: Mr. Mervin Ault, Asst. Chief
Materials & Structures Div. |
| 1 | Boeing Airplane Company
P. O. Box 3707
Seattle 34, Washington
Attn: Mr. John T. Stacey, Senior
Group Engineer, Aerospace Div. | 1 | Boeing Airplane Company
Seattle 24, Washington
Attn: Dr. Edward Czarnecki, Mgr.
Materials Mechanics & Structures
Branch
Systems Management Office |
| 2 | Republic Aviation Corporation
Farmingdale, Long Island, New York
Attn: Dr. S. Korman, Chief,
Materials Dev., R.A.C
Attn: Mr. T. F. Imholtz,
Manufacturing Research | 1 | Fansteel Metallurgical Corporation
North Chicago, Illinois
Attn: Mr. Alan F. Busto, Technical
Administrator |
| 1 | Lockheed Aircraft Corporation
Burbank, California
Attn: Mr. E. Green, Mgr.,
Production Engineering Dept. | 1 | Massachusetts Institute of Technology
Cambridge 39, Massachusetts
Attn: Dr. Walter A. Backofen
Associate Prof. of Metallurgy |
| 1 | Lockheed Aircraft Corporation
Missiles and Space Division
Sunnyvale, California
Attn: Mr. Alfred Peterson, Mgr.,
Production Eng. Dept. 83-31 | 1 | Grumman Aircraft Engineering Corp.
Bethpage, Long Island, New York
Attn: Mr. Earl Morris, Materials
Engineering |
| 1 | Aerojet General Corporation
Solid Rocket Plant
Sacramento, California
Attn: Mr. Alan V. Levy
Head, Materials R&D Dept.(4610) | | |

DISTRIBUTION LIST (Concluded)

- 1 Commanding Officer
 Picatinny Arsenal
 Dover, New Jersey
 Attn: Mr. George Van Syckle
 Building 65, TAWC
- 1 Massachusetts Institute of Technology
 Department of Aeronautics and Astronautics
 Instrumentation Laboratory
 Cambridge 39, Massachusetts
 Attn: Miss Betty Robinson
 Ass't. Librarian
- 1 Delco Remy Division
 General Motors Corporation
 Anderson, Indiana
 Attn: Mr. J. R. West, Piress Dept.
- 1 Inspector of Naval Material
 10 North 8th Street
 Reading, Pennsylvania
- 1 Branson Instruments, Incorporated
 37 Brown House Road
 Stamford, Connecticut
- 1 P. R. Mallory and Company, Inc.
 Indianapolis 6, Indiana
 Attn: Mr. A. S. Doty, Director,
 Technical Services Laboratories

UNCLASSIFIED

UNCLASSIFIED