

UNCLASSIFIED

AD NUMBER
AD337281
CLASSIFICATION CHANGES
TO: unclassified
FROM: restricted
LIMITATION CHANGES
TO: Approved for public release, distribution unlimited
FROM: Distribution authorized to U.S. Gov't. agencies only; Foreign Government Information; 28 JAN 1963. Other requests shall be referred to British Embassy, 3100 Massachusetts Avenue, NW, Washington, DC 20008.
AUTHORITY
DSTL, AVIA 18/3956, 13 Feb 2009; DSTL, AVIA 18/3956, 13 Feb 2009

THIS PAGE IS UNCLASSIFIED

CONFIDENTIAL
MODIFIED HANDLING AUTHORIZED

AD 337 281L

DEFENSE DOCUMENTATION CENTER

FOR

SCIENTIFIC AND TECHNICAL INFORMATION

CAMERON STATION, ALEXANDRIA, VIRGINIA



CONFIDENTIAL
MODIFIED HANDLING AUTHORIZED

NOTICE: When government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U. S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

NOTICE:

THIS DOCUMENT CONTAINS INFORMATION
AFFECTING THE NATIONAL DEFENSE OF
THE UNITED STATES WITHIN THE MEAN-
ING OF THE ESPIONAGE LAWS, TITLE 18,
U.S.C., SECTIONS 793 and 794. THE
TRANSMISSION OR THE REVELATION OF
ITS CONTENTS IN ANY MANNER TO AN
UNAUTHORIZED PERSON IS PROHIBITED
BY LAW.

U.K. CONFIDENTIAL - Modified Handling Authorized
U.K. RESTRICTED

33rd Part of Report No. AAE/866/1

~~RESTRICTED~~



MINISTRY OF AVIATION

AEROPLANE AND ARMAMENT EXPERIMENTAL ESTABLISHMENT

BOSCOMBE DOWN

SHACKLETON M.K. 2. 1 R. 953
RADIO ACCEPTANCE TRIALS OF A.D. 742 RADIO COMPASS

[U]

PRESENTED BY

FG. OFF. E. J. MILLER
NAVIGATION AND RADIO DIVISION

1. TO THE COMMANDER
2. TO THE CHIEF OF THE
3. TO THE CHIEF OF THE
4. TO THE CHIEF OF THE
5. TO THE CHIEF OF THE
6. TO THE CHIEF OF THE
7. TO THE CHIEF OF THE
8. TO THE CHIEF OF THE
9. TO THE CHIEF OF THE
10. TO THE CHIEF OF THE
11. TO THE CHIEF OF THE
12. TO THE CHIEF OF THE
13. TO THE CHIEF OF THE
14. TO THE CHIEF OF THE
15. TO THE CHIEF OF THE
16. TO THE CHIEF OF THE
17. TO THE CHIEF OF THE
18. TO THE CHIEF OF THE
19. TO THE CHIEF OF THE
20. TO THE CHIEF OF THE
21. TO THE CHIEF OF THE
22. TO THE CHIEF OF THE
23. TO THE CHIEF OF THE
24. TO THE CHIEF OF THE
25. TO THE CHIEF OF THE
26. TO THE CHIEF OF THE
27. TO THE CHIEF OF THE
28. TO THE CHIEF OF THE
29. TO THE CHIEF OF THE
30. TO THE CHIEF OF THE
31. TO THE CHIEF OF THE
32. TO THE CHIEF OF THE
33. TO THE CHIEF OF THE
34. TO THE CHIEF OF THE
35. TO THE CHIEF OF THE
36. TO THE CHIEF OF THE
37. TO THE CHIEF OF THE
38. TO THE CHIEF OF THE
39. TO THE CHIEF OF THE
40. TO THE CHIEF OF THE
41. TO THE CHIEF OF THE
42. TO THE CHIEF OF THE
43. TO THE CHIEF OF THE
44. TO THE CHIEF OF THE
45. TO THE CHIEF OF THE
46. TO THE CHIEF OF THE
47. TO THE CHIEF OF THE
48. TO THE CHIEF OF THE
49. TO THE CHIEF OF THE
50. TO THE CHIEF OF THE
51. TO THE CHIEF OF THE
52. TO THE CHIEF OF THE
53. TO THE CHIEF OF THE
54. TO THE CHIEF OF THE
55. TO THE CHIEF OF THE
56. TO THE CHIEF OF THE
57. TO THE CHIEF OF THE
58. TO THE CHIEF OF THE
59. TO THE CHIEF OF THE
60. TO THE CHIEF OF THE
61. TO THE CHIEF OF THE
62. TO THE CHIEF OF THE
63. TO THE CHIEF OF THE
64. TO THE CHIEF OF THE
65. TO THE CHIEF OF THE
66. TO THE CHIEF OF THE
67. TO THE CHIEF OF THE
68. TO THE CHIEF OF THE
69. TO THE CHIEF OF THE
70. TO THE CHIEF OF THE
71. TO THE CHIEF OF THE
72. TO THE CHIEF OF THE
73. TO THE CHIEF OF THE
74. TO THE CHIEF OF THE
75. TO THE CHIEF OF THE
76. TO THE CHIEF OF THE
77. TO THE CHIEF OF THE
78. TO THE CHIEF OF THE
79. TO THE CHIEF OF THE
80. TO THE CHIEF OF THE
81. TO THE CHIEF OF THE
82. TO THE CHIEF OF THE
83. TO THE CHIEF OF THE
84. TO THE CHIEF OF THE
85. TO THE CHIEF OF THE
86. TO THE CHIEF OF THE
87. TO THE CHIEF OF THE
88. TO THE CHIEF OF THE
89. TO THE CHIEF OF THE
90. TO THE CHIEF OF THE
91. TO THE CHIEF OF THE
92. TO THE CHIEF OF THE
93. TO THE CHIEF OF THE
94. TO THE CHIEF OF THE
95. TO THE CHIEF OF THE
96. TO THE CHIEF OF THE
97. TO THE CHIEF OF THE
98. TO THE CHIEF OF THE
99. TO THE CHIEF OF THE
100. TO THE CHIEF OF THE

MINISTRY OF AVIATION

THIS DOCUMENT IS THE PROPERTY OF H.M. GOVERNMENT AND
ATTENTION IS CALLED TO THE PENALTIES ATTACHING TO
ANY BREACH OF THE OFFICIAL SECRETS ACT, 1911

It is intended for the use of the recipient only, and for communication to such officers
under him as may require to be acquainted with its contents in the course of their
duties. The officers exercising this power of communication are responsible that
such information is imparted with due caution and reserve. Any person other than
the authorized holder, upon obtaining possession of this document, by finding or
otherwise, should forward it, together with his name and address, in a closed envelope
to:-

THE SECRETARY, MINISTRY OF AVIATION, LONDON, W.C.2

Letter postage need not be prepaid, other postage will be refunded. All persons are
sorely warned that the unauthorized retention or destruction of this document is an
offence against the Official Secrets Act

EXCLUDED FROM AUTOMATIC
RECLASSIFICATION; DO NOT
CLASSIFY

1003
RESTRICTED
JISA R

CATALOGUED BY DDG
33rd Part of Report No. AAE/866/1
AS AD No. 337281L

337 281L

U. S. CONFIDENTIAL
MODIFIED RESTRICTED AUTHORIZED

33rd Part of Report No. AAEE/866/1

28 JAN 1963

AEROPLANE AND ARMAMENT EXPERIMENTAL ESTABLISHMENT
BOSCOMBE DOWN

Shackleton Mk. 2. WR.953
Radio Acceptance Trials of A.D.712 Radio Compass

Presented by

. Pq.Off. P. J. Miller
Navigation and Radio Division

A. & A.E.E. Ref: ANR/2J3/PJ'
H.Q. Ref : D.L.R.D.(A) A.L.10(B)
Period of Trial: February - March, 1962.

Summary

1. Radio Acceptance Trials have been completed on the radio compass A.D.712 installation in Shackleton Mk.2, WR.953.
2. It is recommended that the sense aerial, which underwent trials sited in two positions on the aircraft, be sited on the starboard bomb door.
3. Service Release for use of this equipment in temperate and tropical climates is recommended to an O.A.T. of 40°C at M.S.L.

"This document is the property of the National
Defense Research Establishment and is to be
returned to the Department of Defense
upon completion of the project. It is to be
kept in a secure place and its contents
are not to be disclosed to anyone other than
those authorized by the Department."

This report is issued with the authority of


Air Commodore,
Commandant, A. & A.E.E.

U. S. CONFIDENTIAL
MODIFIED RESTRICTED AUTHORIZED

List of Contents

	<u>Page</u>
1. Introduction	3
2. Reports Issued	3
3. Details of the Installation	3
4. Comments on the Installation	3
5. Compatibility Trials	3
6. Ground Swings	4
7. Overhead Performance	4
8. Range Checks	5
9. Speed Dives	5
10. Temperature Checks	5
11. Conclusions	5

List of Tables

	<u>Table</u>
Compatibility Trials	1
S.T.R. 18B Interference on Radio Compass A.D.712	2

List of Illustrations

	<u>Figure</u>
Radio Compass Ground Swings	1
Overhead Performance of the Radio Compass A.D.712	2
Radio Compass A.D.712 Ambient Air Temperatures	3

1. Introduction

Radio acceptance trials have been carried out on the Radio Compass AD.742 installation in Shackleton M.R. Mk.2 WR.953. Alternative positions of the sense aerial were provided and assessments made to determine the more suitable position.

2. Reports Issued

There are no other reports that are related to these trials. This report covers the equipment introduced by Mod.988 (Phase II radio modification).

3. Details of the Installation

(a) The installation consisted of a single AD.742 system with dual control. The loop aerial type No. 2829 was mounted above the fuselage in place of the ARI.5428 loop originally fitted, just aft of the escape hatch.

(b) The Q.E. Corrector Unit type No. 4368 was installed on a bracket facing downwards with good accessibility immediately below the loop aerial.

(c) The receiver type No. 2830 was installed on the top radio shelf above the navigator's table at the forward end, aft of the Gee receiver.

(d) Two Remote Control Units type No. 3028 were fitted, one mounted on the pilot's canopy control panel and the other at the navigator's station. The change over switch unit type No. 2834 was mounted on the forward bulkhead '2'.

(e) The two sense aerials were fitted one on the top surface of the fuselage and the other on the starboard bomb door.

4. Comments on the Installation

The installation was satisfactory for ease of operation and servicing and the only criticism was that of the position of the goniometer which was not immediately visible to the navigator in this arrangement.

5. Compatibility Trials

(a) Ground and air compatibility trials were carried out with the following installations serviceable and the AD.742 coverage was searched for any induced noise:-

- (i) U.H.F. and Channel Change.
- (ii) S.T.R. 48B and channel change.
- (iii) Tacan.
- (iv) Intercom ARI.18089
- (v) V.H.F. and channel change.
- (vi) Blue Silk.
- (vii) Orange Harvest.
- (viii) Sonebuoy IC and blowers.
- (ix) Gee
- (x) I.L.S.
- (xi) Sarah (1st wave)
- (xii) G&B Compass
- (xiii) Auto Pilot
- (xiv) A.Y.F.
- (xv) ASV.24
- (xvi) All other noise producing electrical equipment.

The results of these trials are shown in Table 1.

(b) During the ground compatibility trials, interference was present on the radio compass AD.712 from the S.T.R. 18B (H.F.). Further and more detailed trials were carried out on these installations when the aircraft was airborne, and Table 2 shows that interference on the radio compass AD.712 from the S.T.R. 18B was present throughout the H.F. band with the upper sense aerial selected. With the lower sense aerial selected interference was only present on four spot frequencies between 7.7 mc/s and 11.15 mc/s. This interference should be brought to the attention of the operating authority.

(c) Slight interference was present on the radio compass during a Sonobuoy IC channel change and from the G4B compass below 250 kc/s only, but these are not considered to be of operational significance.

6. Ground Swings

(a) Ground Swings were carried out with the Q.E. corrector shorted out on frequencies 200, 746, 908 and 1007 kc/s. Those for 200 kc/s and 1007 kc/s are plotted in Figure 1. These swings were difficult to interpret although a semi-circular error was apparent on 200 kc/s. The discrepancies on 746 kc/s and 1007 kc/s were probably due to "Night Effect" - February, the period of the trials, is a particularly bad time of year, the effect extending into the hours of daylight for a longer period than normal.

(b) Results on 200 kc/s clearly indicate the necessity for 2 degrees negative correction and check swings were carried out with -2 degree correction applied. As the stated accuracy of the AD.712 is $\pm 2^\circ$ it is considered that setting in a Q.E. correction of -2° is acceptable.

(c) Flight trials were carried out upto the ground swing as detailed below and throughout these trials the performances of the radio compass with the correction of -2 degrees set in was satisfactory.

7. Overhead Performance

The overhead performance of the AD.712 was checked using Langar N.D.B. on 372 kc/s and the results are shown plotted in Fig. 2 and tabulated below:-

(a) Lower Sense Aerial

Altitude in Feet	Groundspeed Kts.	Time in Seconds		
		Start of Turn/Round	Overhead Beacon (Visual)	Finish Turn/Round
2,000'	180	0	8	12
	140	0	4	7
4,000'	180	0	0	9
	140	0	0	6
6,000'	175	2	0	9
	135	0	1	10
10,000' (Gee)	170	0	6	16

(b) Upper Sense Aerial

Altitude in Feet	Groundspeed Kts.	Time in Seconds		
		Start of Turn/Round	Overhead Beacon (Visual)	Finish Turn/Round
2,000'	140	0	0	6
4,000'	180	0	0	10
	140	0		
6,000'	175	0	12	25
10,000'	170	0	10	15
	130	0	10	19

/Satisfactory ...

Satisfactory turn-rounds were achieved on both aerials although difficulty occurred in navigating accurately over a pin point. It was found that only a small offset from directly overhead the beacon caused considerable error in the turn-found time. This effect decreased as the altitude increased but greater difficulties were experienced at higher altitudes in obtaining an accurate pin point, and thus the errors themselves increased.

8. Range Checks

These were made at an altitude of 4,000 ft. on Brookmans Park beacon whose range of power is stated as 50 n.m. Ranges in excess of four times this rated value were obtained.

9. Speed Dives.

Maximum speed dives were made with bomb doors both open and closed and the A.S.V.24 scanner radome in the attack position. After landing an inspection was made of the lower sense aerial and this was found intact.

10. Temperature Checks

(a) The radio compass A.D.712 was instrumentated as follows:-

- (i) Air Exhaust Temperature.
- (ii) Ambient air temperature - top of receiver.
- (iii) I.F. can - internal temperature.

These temperatures were recorded during a low level flight until stabilisation occurred.

(b) The units of the AD.712 installation are cleared for operation in ambient temperatures of up to 55°C. The results of these trials, considered in conjunction with the Shackleton Mk. 2 WB.833 tropical trials data (32nd Part of Replrt No. AARE/866/1 refers), provide a basis for extrapolation of results up to an O.A.T. of 45°C at M.S.L.

(c) The rise above O.A.T. of the ambient air temperature of the receiver unit is 15°C. Release of this equipment is therefore recommended to an O.A.T. of 40°C. Fig. 3 shows the ambient air temperature corrected for an O.A.T. of 40°C at M.S.L.

11. Conclusions

The following conclusions may be drawn from the above results:-

(a) Although there was little difference in the performance of the AD.712 with the sense aerial sited in either position on the aircraft, it is recommended that the sense aerial be sited on the starboard bomb door in which position much less interference from the S.T.R.18B will be present, para. 4(b) refers.

(b) The performance of the radio compass AD.712 was satisfactory and subject to action to para. (a) above Service Release for use in temperate climates is recommended.

(c) Release of this equipment is recommended for use in tropical climates up to an O.A.T. of 40°C at M.S.L.

/Circulation List ...

Circulation List

DLRDA/AL.10	3 Copies 1 for Action
AD/RAF/ C	2 Copies (for information of DPO)
CASLO	1 Copy
RDT3	1 Copy
TIL	70 Copies
R.A.E.	6 Copies
R.A.E. Bedford	2 "
R.T.O., A. V. Roe & Co. Ltd.	2 "



TABLE I
COMPATIBILITY TRIALS

Equipment	Interference on AD.712 249/723/368 KC/S
U.H.F. 399 mc/s	Nil
250 "	Nil
200 "	Nil
S.T.R. 18B	See Fig. 2
TACAN	Nil
Intercom ARI.18089	Nil
V.H.F. 122.5 mc/s	Nil
123.3 "	"
117.9 "	"
121.5 "	"
103.86 "	"
190.58 "	"
132.2 "	"
Blue Silk	Nil
Orange Harvest	Nil
Sonobuoy IC	SLIGHT during channel change
Gee	Nil
I.I.S.	Nil
Sarah	Nil
G4B Compass	Interference on loop only below 250 kc/s
Autopilot	Nil
A.Y.F.	Nil
A.S.V. 21	Nil
Fuel Pumps	Nil
De-icing wings and tail leading edge	Nil
Galley	Nil
Gun Turrets	Nil
Radiator Flaps	Nil

TABLE 2

S.T.R. 18B INTERFERENCE ON RADIO COMPASS A.D.712

STR. 18B Frequency mc/s	AD.712 Frequency kc/s	Port H.F. Aerial		Stbd. H.F. Aerial	
		Bottom Sense Aerial	Top Sense Aerial	Bottom Sense Aerial	Top Sense Aerial
6.58	249 344 723.5	Nil		Slight	Heavy " "
5.589	249 344 723.5				Heavy " "
3.022	249 344 723.5				Heavy "
15.8	249 344 723.5		Slight Slight Slight	Slight	Heavy " "
2.442	249 344 723.5		Heavy Heavy Heavy		Heavy " "
4.025	249 344 797		Heavy Some		Slight " Some
5.252	249 344 797				Heavy Heavy
7.755	249 344 797	Some Some	Some Some	Some Slight	Some " "
11.15	249 344 797	Some " "	 Some	Slight	Heavy " "
8.82	249 344 797	Key clicks	Key clicks		Heavy " "
9.505	249 344 797	Some Some	Some Some Some	Some	Heavy Some

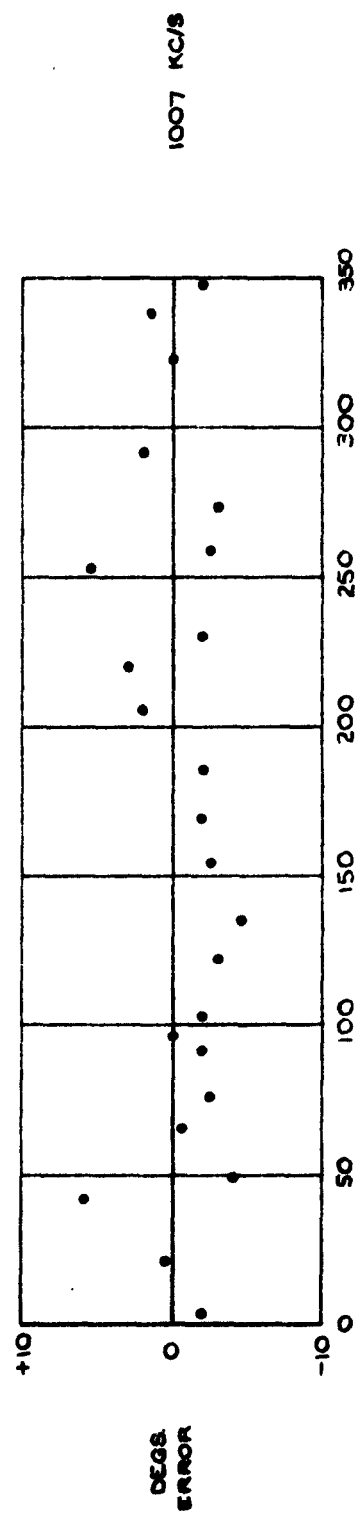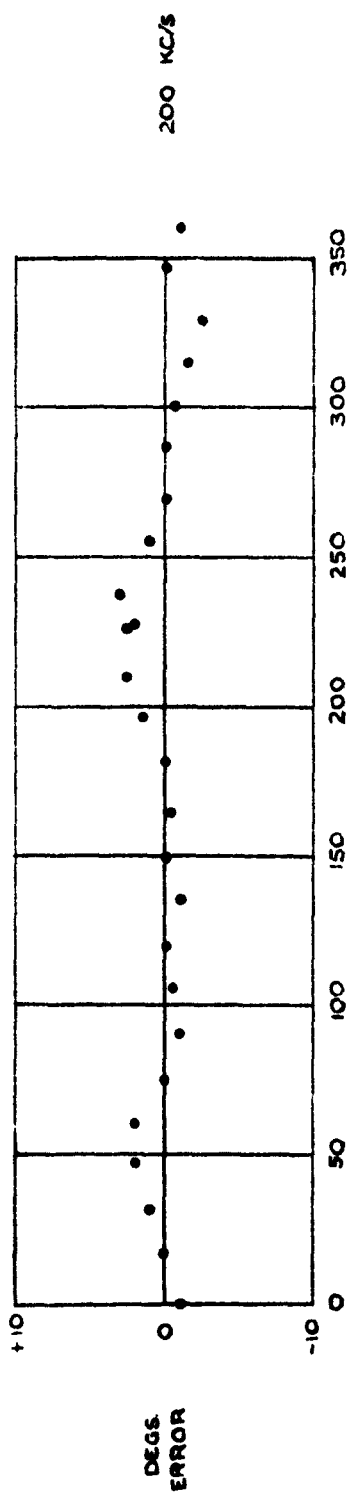

RADIO COMPASS GROUND SWINGS.

FIG. I.



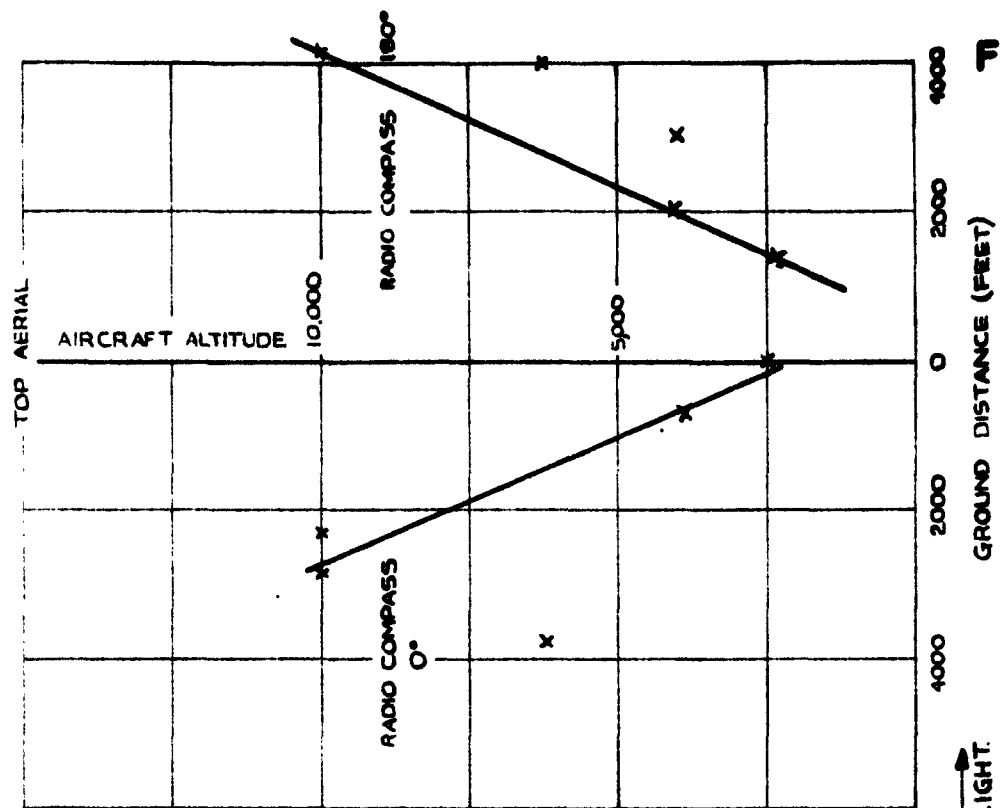


FIG.2

SKN081426 3349 PART OF REPORT N° 86A E E / 866 / 1 SHACKLETON MIN MK2 WR953 TR 5 J H CH F / C MILLER APP *Cal. for S of YK* 15 1 63

FIG. 3.

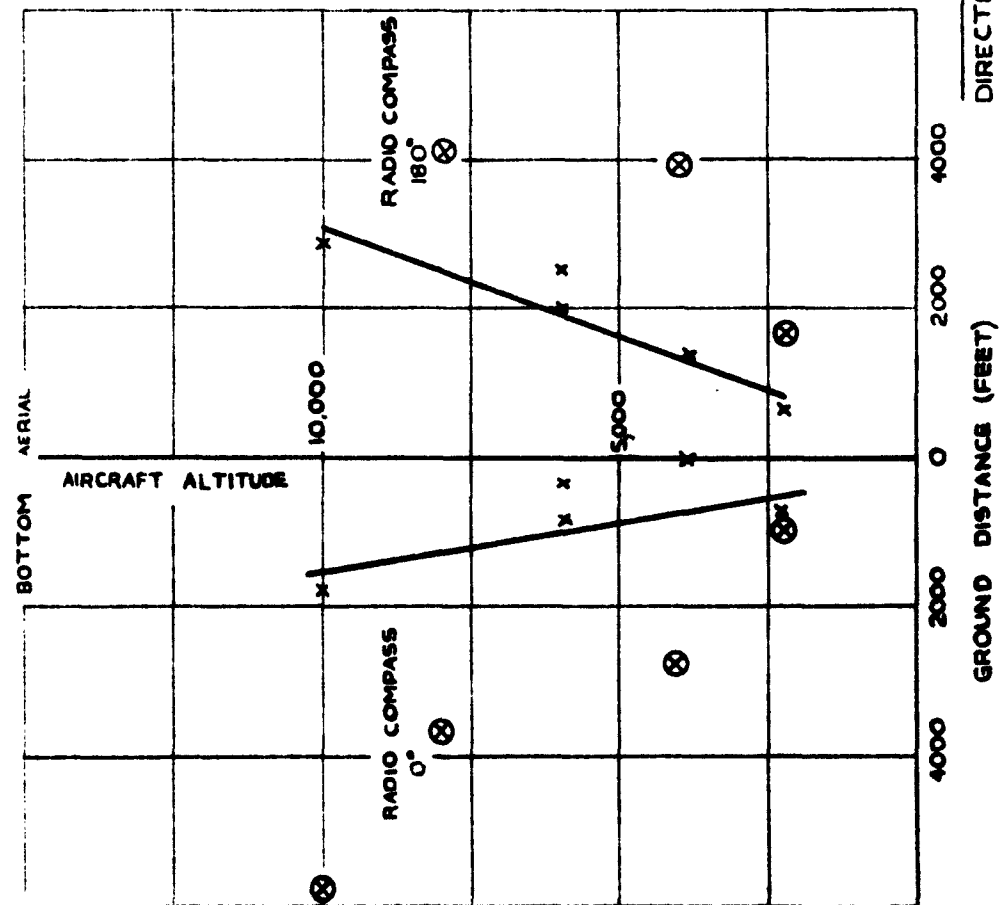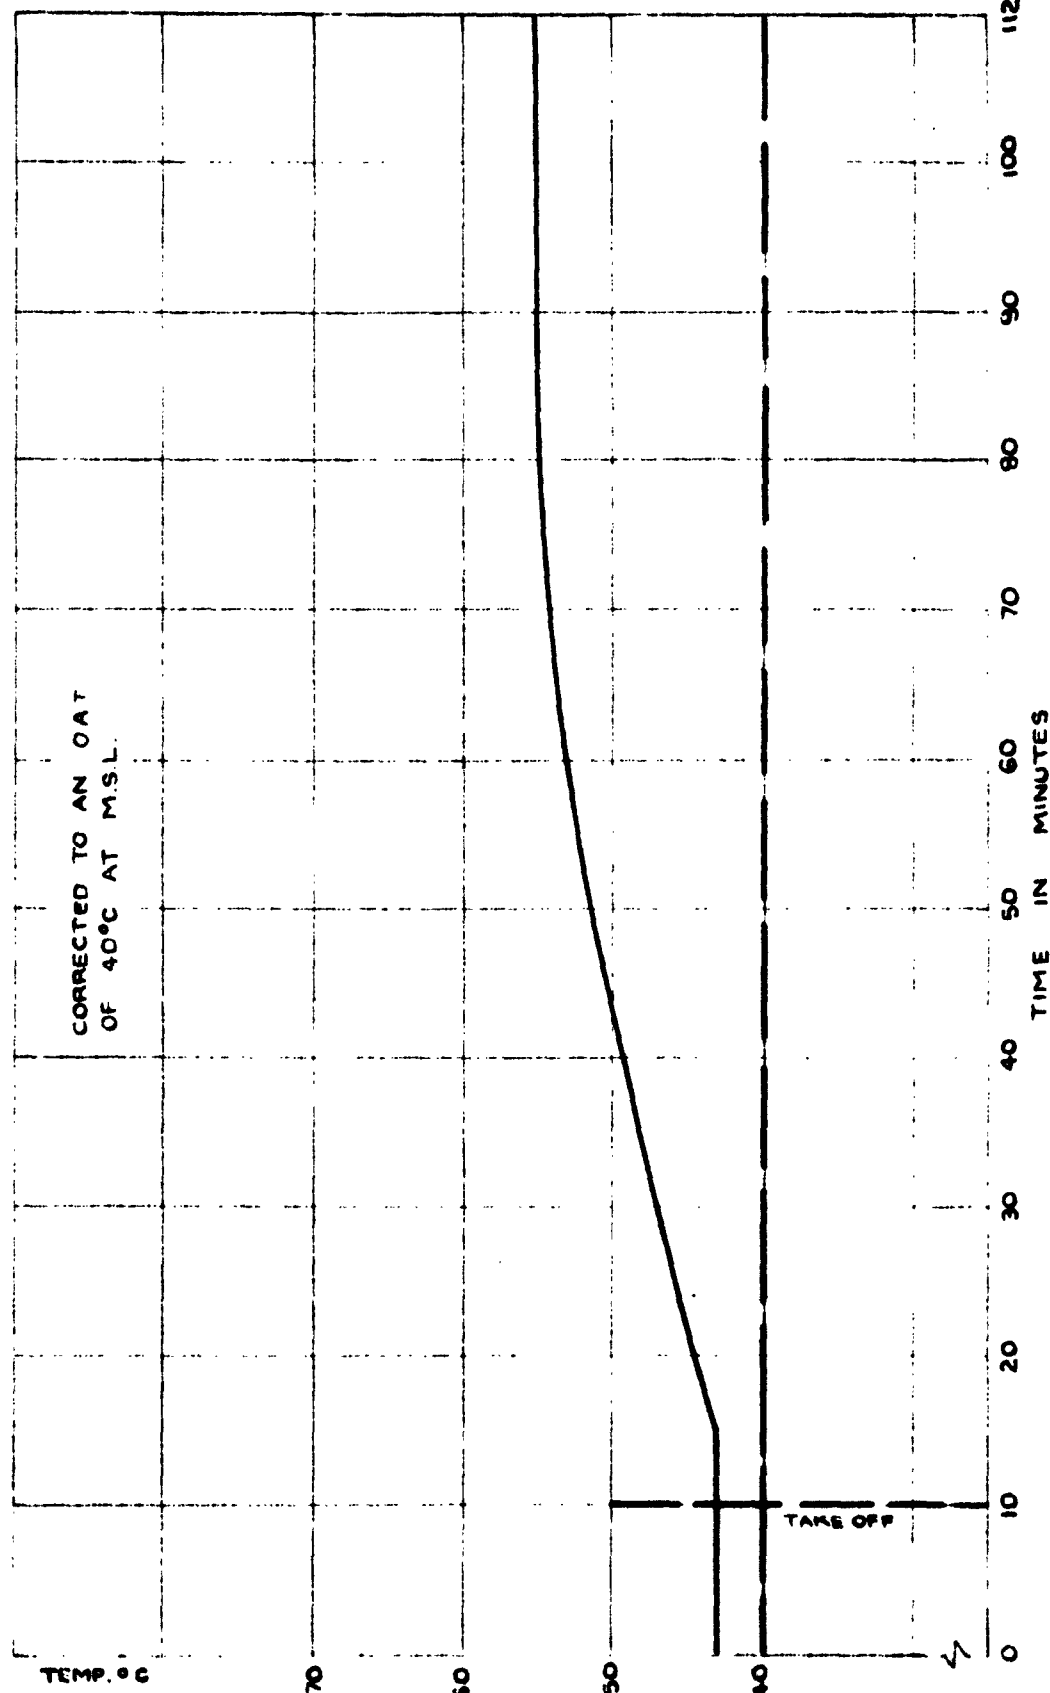

RADIO COMPASS AD. 712
AMBIENT AIR TEMPERATURE



*Information Centre
Knowledge Services
[dstl] Porton Down
Salisbury
Wilt.
SP4 7HQ
22060-6218
Tel: 01980-613753
Fax: 01980-613970*

Defense Technical Information Center (DTIC)
8725 John J. Kingman Road, Suit 0944
Fort Belvoir, VA 22060-6218
U.S.A.

AD#: AD337281

Date of Search: 13 February 2009

Record Summary: AVIA 18/3956
Shackleton Mk 2 WR.953: radio acceptance trials of AD 712 radio compass
Former reference (Department): 866/1 Pt 33
Held by The National Archives, Kew

This document is now available at the National Archives, Kew, Surrey, United Kingdom.

DTIC has checked the National Archives Catalogue website (<http://www.nationalarchives.gov.uk>) and found the document is available and releasable to the public.

Access to UK public records is governed by statute, namely the Public Records Act, 1958, and the Public Records Act, 1967.
The document has been released under the 30 year rule.
(The vast majority of records selected for permanent preservation are made available to the public when they are 30 years old. This is commonly referred to as the 30 year rule and was established by the Public Records Act of 1967).

This document may be treated as **UNLIMITED**.