

AD-A215 730

4

OFFICE OF NAVAL RESEARCH

Contract: N00014-85-K-0222

Work Unit: 4327-555

Scientific Officer: Dr. Richard S. Miller

Technical Report No. 22


BLOW-OUT OF RUBBER BLOCKS DUE TO INTERNAL HEATING

by

A.N. Gent and M. Hindi

Polymer Engineering Center
The University of Akron
Akron, Ohio 44325

November, 1989

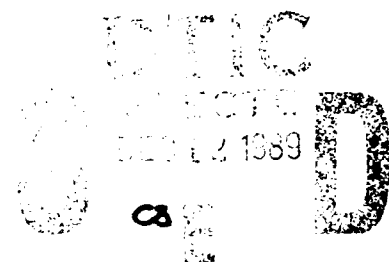

Reproduction in whole or in part is permitted for
any purpose of the United States Government
Approved for public release; distribution unrestricted

89 12 1

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER Technical Report No. 22	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Blow-out of Rubber Blocks Due to Internal Heating		5. TYPE OF REPORT & PERIOD COVERED Technical Report
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s) A.N. Gent and M. Hindi		8. CONTRACT OR GRANT NUMBER(s) N00014-85-K-0222
9. PERFORMING ORGANIZATION NAME AND ADDRESS Polymer Engineering Center The University of Akron Akron, Ohio 44325		10. PROGRAM ELEMENT PROJECT, TASK AREA & WORK UNIT NUMBERS 4327-555
11. CONTROLLING OFFICE NAME AND ADDRESS Office of Naval Research Power Program Arlington, VA 22217-5000		12. REPORT DATE November 1989
		13. NUMBER OF PAGES 17
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) According to attached distribution list. Approved for public release; distribution unrestricted.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Submitted to: Journal of Applied Polymer Science		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Blow-out, Bursting, Decomposition, Elastomers, Fatigue, Heat Build-Up Rubber, Thermal Decomposition		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Rubber blocks undergo explosive blow-out when heated in a microwave oven. The process appears to be the same as the blow-out caused by repeatedly-applied, severe compressive loads. It is attributed to high internal pressures generated by a volatile product of thermal decomposition. (over)		

Bursting took place at lower temperatures for softer compounds and for compounds that softened markedly upon heating. The blow-out temperature was also quite different for different elastomers, being low for butyl rubber, about 180 degrees C. and somewhat higher for SBR and NBR compounds, over 200 degrees C. Polybutadiene compounds did not blow-out at all, probably because the products of thermal decomposition were less volatile.

Accession For	
NTIS GRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution	
Availability Codes	
Distribution	
Dist	
A-1	

Blow-Out of Rubber Blocks Due to Internal Heating

A. N. Gent and M. Hindi

Institute of Polymer Science and Polymer Engineering Center

The University of Akron, Akron, Ohio 44325

1. Introduction

When rubber is deformed, part of the work of deformation is transformed into heat. Because rubber is a rather poor conductor of heat, the internal temperature under repeatedly-applied deformations can reach high values, especially for thick articles. Tire treads and tank track pads can become so hot in the interior that they explode. This phenomenon is known as "blow-out." But the mechanism of failure is not well understood. It has been attributed to mechanical fatigue [1], and biaxial tensile fracture aggravated by high temperature [2,3]. In contrast, it is attributed here to high internal pressure of volatile substances, sufficient to burst open the surrounding material. The volatiles are thought to be a product of thermal decomposition. We show that blow-out can be produced by direct heating of rubber compounds in a microwave oven, and to some extent by internal heating of rubber sheets by embedded resistance heating wires, without any mechanical stressing.

2. Experimental details

Vulcanized rubber cylinders, 25mm high and 17.5mm in diameter, and sheets of various thicknesses were made in a compression mold using conventional recipes. A typical mix formulation was as follows: in parts by weight: SBR 1502, 100; carbon black (N330, Vulcan 3, Cabot Corp.), 50; zinc oxide, 5; stearic acid, 2; processing oil (Sundex 790T, Sun Petroleum Co.), 5; sulfur, 1; accelerator (Santocure MOR, Monsanto Co.), 0.5. Vulcanization was effected by heating for 50 min at 150°C.

Values of Young's modulus E were determined from stress-strain relations in compression, at ambient and elevated temperatures.

Cylindrical specimens were subjected to repeated compression using a Goodrich Flexometer, as described in ASTM D623 - 67 [4]. The frequency of loading was 30 Hz and the double-amplitude of oscillation was 6.35mm. Static compressive loads of either 32 or 43 kg were applied to the sample by attaching weights to the machine beam. Experiments were terminated when the sample failed by blow-out, typically within 15 min. Measurements of blow-out temperature were made by means of a probe thermocouple inserted into the sample immediately after blow-out.

Other samples were heated in a microwave oven without imposing any deformation. Blow-out similar to that obtained with the Goodrich Flexometer occurred in less than one minute.

Some vulcanized sheets, about 6mm thick, were heated by passing an electric current through a fine straight copper wire, about 125mm long and 160 μ m in diameter, embedded in the center of the sheet before vulcanization. The power input was adjusted to heat the sample at about the same rate as in the microwave oven, 3-5°C/sec. Internal temperatures were determined from the measured resistance of the wire and the temperature coefficient of resistance of copper. At temperatures between 200 and 300°C, the rubber sheet showed surface discoloration, followed soon afterwards by appearance of a blister, which is considered equivalent to blow-out.

Thermogravimetric analysis was carried out on some compounds and the volatiles released by blow-out were isolated and analyzed by gas chromatography and mass spectrometry.

3. Results and discussion

(i) Blow-out from repeated compression and solely from heating

Blow-out temperatures for Goodrich flexometer samples are given in Table 1. They reached values of 200°C or more, suggesting that blow-out is a consequence of thermal decomposition of the polymer.

Blow-out temperatures for samples subjected to direct heating in the microwave oven were approximately the same, Table 1, and the appearance of the failed samples was also quite similar, Figure 1. Thus, the criterion for blow-out seems to be a simple one: the interior of the sample must reach a critical temperature. Mechanical working is only a means of generating heat internally; it is not essential for blow-out.

Significant differences were noted in the appearance of samples. Flexed samples became barrel-shaped, due to compression set, Figure 1, and decomposition was concentrated in the center. In contrast, microwave samples decomposed over larger internal regions, wherever severe heating had occurred.

(ii) Blow-out temperatures for typical rubber compounds

Blow-out temperatures are given in Table 1. They ranged from about 160°C to about 250°C, depending upon the polymer and the mix formulation.

Two general features were noted. First, the blow-out temperature was higher for harder materials. For example, compounds SBR2 and SBR3 had different amounts of sulfur and accelerator, while SBR1 and SBR3 differed in carbon black content, giving vulcanizates of the same polymer with markedly different elastic modulus. Blow-out took place at higher temperatures for the higher modulus compounds.

Values of Young's modulus E at temperatures close to the

blow-out temperature are included in Table 1; they confirm this general conclusion. Moreover, this feature is consistent with the proposed mechanism of blow-out. The critical pressure at which a small internal cavity in a rubber block will expand indefinitely is given approximately by $SE/6$ [5,6]. Thus, a harder material would be expected to withstand higher internal pressures without rupturing.

Some materials appeared to soften markedly at high temperatures and undergo blow-out at the same time. For example, butyl rubber compounds turned into a soft, buttery consistency at the blow-out temperature, about 180°C. In contrast, NBR and SBR compounds were found to be stiffer than others initially and to retain their stiffness at high temperatures. They were found to have higher blow-out temperatures also.

Natural rubber compounds became soft and sticky as a result of thermal decomposition, whereas NBR and SBR compounds remained relatively dry. In both cases, however, blow-out took place explosively, especially for NR materials with C-C or monosulfide crosslinks (NR2 and NR4) which blew out at relatively high temperatures, Table 1.

Polybutadiene compounds did not undergo blow-out, even after long periods of heating in the microwave oven. Instead, the samples softened, swelled, and became porous in the interior, Figure 2. Apparently, the vapor pressure of the products of decomposition is significantly lower for this polymer. "Blow-out" temperatures were taken as the temperatures at which pronounced swelling occurred.

Thus, two factors appear to govern the susceptibility of rubber compounds to blow-out. The first is their propensity to generate high-vapor-pressure volatiles. The second is their

tendency to soften on heating and thus lose resistance to expansion of a pressurized internal cavity.

(iii) Possible nature of volatiles causing blow-out

Certain ingredients in rubber formulations would be expected to volatilize at high temperatures and create a high internal pressure. For example, if water is present, high internal pressures would be generated at temperatures much above 100°C. In order to test this possibility, 0.5 percent of salt was included in several mix formulations and the vulcanized samples were soaked in water for several days before testing, so that they absorbed 1-2% by weight of water. Blow-out took place at virtually the same temperature as for dry samples, indicating that absorbed water is not the main cause of blow-out.

Another possible volatile ingredient of many rubber compounds is a hydrocarbon processing oil. However, when an otherwise identical formulation was prepared with no processing oil, blow-out took place at about the same temperature as before. Thus, the processing oil itself was not responsible for blow-out.

Another possibility is dissolved air. Samples that had been stored in vacuo for four weeks were found to have significantly higher blow-out temperatures, by about 30°C, Table 2. On exposing them to air again for several weeks, the blow-out temperatures were reduced almost back to the original values. These results suggest that air is at least partially responsible for blow-out, probably by catalyzing thermal decomposition.

Different formulations are known to differ in susceptibility to thermal decomposition. For example, vulcanizates with polysulfide crosslinks will soften at lower temperatures than those with monosulfide or with carbon-carbon crosslinks because of the lower strength of such linkages. If crosslink rupture is also

accompanied by the production of a volatile substance, then blow-out will take place when a significant degree of crosslink rupture occurs. In accord with this hypothesis, peroxide recipes, yielding C-C crosslinks, and monosulfide ("sulfurless") recipes gave the highest blow-out temperatures, Table 1, approaching the temperatures at which polymer decomposition would be expected. And differences observed between elastomers can be attributed to differences in stability of the crosslinks formed within them.

Thus, although the exact nature of the volatile constituent is not clear, the hypothesis that it is a gaseous product of the decomposition of crosslinks accounts for the main features of blow-out, namely, the general temperature range in which it occurs, its close relationship with softening temperatures, the lower blow-out temperatures for materials containing polysulfidic crosslinks in comparison with C-C crosslinks, and the marked differences observed between different polymers.

(iv) Decomposition by heating with an embedded resistance wire

Temperatures of surface discoloration are given in Table 1. Flistering, occurred somewhat later, at temperatures of the order of 500°C. These temperatures are much higher than those for blow-out but they are considered to be over-estimates of the actual rubber temperature because of heat losses through the rubber and severe decomposition of rubber in the immediate vicinity of the wire.

Decomposition temperatures measured in this way were found to be less reproducible than microwave blow-out temperatures and they depended strongly on the rate of heating. Thus, although the wire-heating method is appealingly simple, it proved to be less satisfactory than microwave heating for determining

susceptibility to thermal decomposition.

(iv) Unresolved issues

Measured blow-out temperatures were surprisingly low, at most 250°C, whereas rapid thermal decomposition was not found by TGA and by direct heating with resistance wires below about 300°C. It is possible that the blow-out temperatures were too low, because of delay in inserting the thermocouple and difficulty in obtaining good thermal contact with fractured rubber surfaces. Improved experimental techniques are needed to determine blow-out temperatures precisely.

A second unknown is the nature of the volatiles. Vapors emitted by blow-out samples were collected and analyzed. They were found to consist of low-molecular-weight hydrocarbons, including monomer, but no substance characteristic of the particular crosslinking system could be detected. And yet large differences were found in blow-out temperatures for different vulcanizates of the same polymer. Again, improved experimental techniques are needed to determine the decomposition products completely.

4. Conclusions

Explosive "blow-out" of thick rubber blocks under repeatedly-applied, severe compressive loads is due entirely to the development of high internal temperatures. If the compound is electrically conductive, the phenomenon can be duplicated in a microwave oven without imposing any mechanical loads.

The principal cause of blow-out is the generation of a volatile decomposition product. Pressurized cavities within the rubber then expand and burst. Bursting is easier in some compounds because they soften markedly at high temperatures and thus lose resistance to cavity expansion.

Different elastomers have strikingly different blow-out

temperatures. Butyl rubber compounds blow out at relatively low temperatures, about 180°C, whereas NBR and SBR compounds blow out at temperatures of about 200°C or higher. Polybutadiene compounds did not blow out at all. Instead, they developed internal cavities that grew in size and number but never burst open to the exterior, probably because the vapor pressure never reached sufficiently high levels.

Acknowledgements

This work was supported by The Office of Naval Research (Contract N00014-65-K-0222) and a grant-in-aid from Lord Corporation. The authors are also indebted to Drs. M. Porter, E. Friedman and R. W. Strozier for helpful comments. A preliminary account was presented at the Spring Meeting of the Rubber Division, American Chemical Society, Dallas, April 19-22, 1968 [7].

References

1. V. E. Sough and D. Parkinson, Trans. Instn. Rubb. Ind. 17, 168 (1941).
2. D. J. Buckley, Paper No. 34, Spring Meeting, Rubb. Div., Am. Chem. Soc., Toronto, May 6-10, 1974.
3. J. Mead, S. Singh, D. Boylance and J. Patt, Polym. Eng. Sci. 27, 131 (1987).
4. Am. Soc. Test. Matls., "Standard Methods of Test for Compression Fatigue of Vulcanized Rubber, D623-67," ASTM, Phila., PA, 1967.
5. A. N. Gent and R. B. Lindley, Proc. Roy. Soc. (Lond.), Ser. A 242, 135 (1958).
6. A. N. Gent and D. A. Torpkins, J. Appl. Phys. 40, 1510 (1969).
7. A. N. Gent and M. Hindi, Rubb. Chem. Technol., in press.

Table 1: Flexometer and Microwave Blow-out Temperatures T_b , T_d , T_{bl} and Discoloration and Blistering Temperatures T_d , T_{bl} (°C) for Electrically Heated Rubber Sheets

Material	E(MPa) at 25°C	E(MPa) at 190°C	T_b Flexom- eter	T_b Micro- wave	T_d Discolor- ation	T_{bl} Blistering
NR1	4.5	3.2	180	175±15	255±15	350±50
NR2 (monosul- fide cure)	6.1	4.5	--	215	--	--
NR4 (peroxide cure)	4.5	4.3	--	222±7	--	--
NR5	--	--	--	--	340±15	595±55
SBR1	4.5	3.4	--	196±6	--	--
SBR2	3.6	--	--	173±10	--	--
SBR3	8.1	4.5	215	228±10	217±25	--
SBR4 (per- oxide cure)	4.5	5.1	--	252±5	--	--
BR1	1.3	--	--	200±3	295±75	610±80
IIR1	7.7	1.2	182±2	182±4	--	--
IIR2	6.3	0.8	184±2	185±5	365±50	580±80
NBR1	8.6	5.5	--	256±10	--	--
NBR2	4.2	3.1	--	242±15	--	--

Table 2: Effect of Removing Air on Blow-out Temperatures (°C)

Material	As Molded	After Degassing	After Standing in Air
NR1	195±8	220±4	184±4
NR4 (per- oxide cure)	225±8	257±4	240±6
SBR3	240±10	260±10	250±7
IIR2	183±7	185±7	180±10

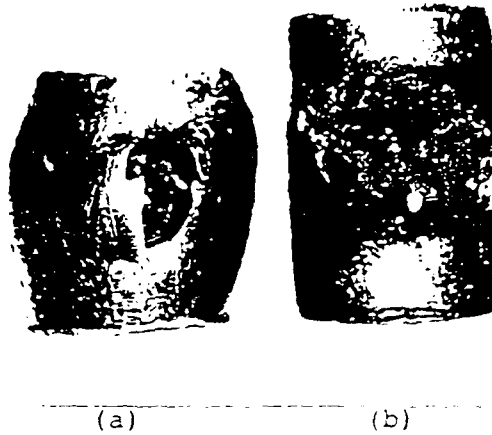


Figure 1. Samples of NR2 after blow-out. (a) Flexometer,
(b) Microwave heating.



Figure 2. Cross-section of PB sample after microwave heating.

(DYN)

DISTRIBUTION LIST

Dr. R.S. Miller
Office of Naval Research
Code 432P
Arlington, VA 22217
(10 copies)

Dr. J. Pastine
Naval Sea Systems Command
Code 06R
Washington, DC 20362

Dr. Kenneth D. Hartman
Hercules Aerospace Division
Hercules Incorporated
Alleghany Ballistic Lab
P.O. Box 210
Cumberland, MD 20502

Mr. Otto K. Heiney
AFATL-DLJG
Elgin AFB, FL 32542

Dr. Merrill K. King
Atlantic Research Corp.
5390 Cherokee Avenue
Alexandria, VA 22312

Dr. R.L. Lou
Aerojet Strategic Propulsion Co.
Bldg. 05025 - Dept 5400 - MS 167
P.O. Box 15699C
Sacramento, CA 95813

Dr. R. Olsen
Aerojet Strategic Propulsion Co.
Bldg. 05025 - Dept 5400 - MS 167
P.O. Box 15699C
Sacramento, CA 95813

Dr. Randy Peters
Aerojet Strategic Propulsion Co.
Bldg. 05025 - Dept 5400 - MS 167
P.O. Box 15699C
Sacramento, CA 95813

Dr. D. Mann
U.S. Army Research Office
Engineering Division
Box 12211
Research Triangle Park, NC 27709-2211

Dr. L.V. Schmidt
Office of Naval Technology
Code 07CT
Arlington, VA 22217

JHU Applied Physics Laboratory
ATTN: CPIA (Mr. T.W. Christian)
Johns Hopkins Rd.
Laurel, MD 20707

Dr. R. McGuire
Lawrence Livermore Laboratory
University of California
Code L-324
Livermore, CA 94550

P.A. Miller
736 Leavenworth Street, #6
San Francisco, CA 94109

Dr. W. Moniz
Naval Research Lab.
Code 6120
Washington, DC 20375

Dr. K.F. Mueller
Naval Surface Weapons Center
Code R11
White Oak
Silver Spring, MD 20910

Prof. M. Nicol
Dept. of Chemistry & Biochemistry
University of California
Los Angeles, CA 90024

Mr. L. Roslund
Naval Surface Weapons Center
Code R10C
White Oak, Silver Spring, MD 20910

Dr. David C. Sayles
Ballistic Missile Defense
Advanced Technology Center
P.O. Box 1500
Huntsville, AL 35807

(DYN)

DISTRIBUTION LIST

Mr. R. Geisler
ATTN: DY/MS-24
AFRPL
Edwards AFB, CA 93523

Naval Air Systems Command
ATTN: Mr. Bertram P. Sobers
NAVAIR-320G
Jefferson Plaza 1, RM 472
Washington, DC 20361

R.B. Steele
Aerojet Strategic Propulsion Co.
P.O. Box 15699C
Sacramento, CA 95813

Mr. M. Stosz
Naval Surface Weapons Center
Code R10B
White Oak
Silver Spring, MD 20910

Mr. E.S. Sutton
Thiokol Corporation
Elkton Division
P.O. Box 241
Elkton, MD 21921

Dr. Grant Thompson
Morton Thiokol, Inc.
Wasatch Division
MS 240 P.O. Box 524
Brigham City, UT 84302

Dr. R.S. Valentini
United Technologies Chemical Systems
P.O. Box 50015
San Jose, CA 95150-0015

Dr. R.F. Walker
Chief, Energetic Materials Division
DRSMC-LCE (D), B-3022
USA ARDC
Dover, NJ 07801

Dr. Janet Wall
Code 012
Director, Research Administration
Naval Postgraduate School
Monterey, CA 93943

Director
US Army Ballistic Research Lab.
ATTN: DRXBR-IBD
Aberdeen Proving Ground, MD 21005

Commander
US Army Missile Command
ATTN: DRSMI-RKL
Walter W. Wharton
Redstone Arsenal, AL 35898

Dr. Ingo W. May
Army Ballistic Research Lab.
ARRADCOM
Code DRXBR - 1BD
Aberdeen Proving Ground, MD 21005

Dr. E. Zimet
Office of Naval Technology
Code 071
Arlington, VA 22217

Dr. Ronald L. Derr
Naval Weapons Center
Code 389
China Lake, CA 93555

T. Boggs
Naval Weapons Center
Code 389
China Lake, CA 93555

Lee C. Estabrook, P.E.
Morton Thiokol, Inc.
P.O. Box 30058
Shreveport, Louisiana 71130

Dr. J.R. West
Morton Thiokol, Inc.
P.O. Box 30058
Shreveport, Louisiana 71130

Dr. D.D. Dillehay
Morton Thiokol, Inc.
Longhorn Division
Marshall, TX 75670

G.T. Bowman
Atlantic Research Corp.
7511 Wellington Road
Gainesville, VA 22065

(DYN)

DISTRIBUTION LIST

R.E. Shenton
Atlantic Research Corp.
7511 Wellington Road
Gainesville, VA 22065

Mike Barnes
Atlantic Research Corp.
7511 Wellington Road
Gainesville, VA 22065

Dr. Lionel Dickinson
Naval Explosive Ordnance
Disposal Tech. Center
Code D
Indian Head, MD 20340

Prof. J.T. Dickinson
Washington State University
Dept. of Physics 4
Pullman, WA 99164-2814

M.H. Miles
Dept. of Physics
Washington State University
Pullman, WA 99164-2814

Dr. T.F. Davidson
Vice President, Technical
Morton Thiokol, Inc.
Aerospace Group
3340 Airport Rd.
Ogden, UT 84405

Mr. J. Consaga
Naval Surface Weapons Center
Code R-16
Indian Head, MD 20640

Naval Sea Systems Command
ATTN: Mr. Charles M. Christensen
NAVSEA-62R2
Crystal Plaza, Bldg. 6, Rm 806
Washington, DC 20362

Mr. R. Beauregard
Naval Sea Systems Command
SEA 64E
Washington, DC 20362

Brian Wheatley
Atlantic Research Corp.
7511 Wellington Road
Gainesville, VA 22065

Mr. G. Edwards
Naval Sea Systems Command
Code 62R32
Washington, DC 20362

C. Dickinson
Naval Surface Weapons Center
White Oak, Code R-13
Silver Spring, MD 20910

Prof. John Deutch
MIT
Department of Chemistry
Cambridge, MA 02139

Dr. E.H. deButts
Hercules Aerospace Co.
P.O. Box 27408
Salt Lake City, UT 84127

David A. Flanigan
Director, Advanced Technology
Morton Thiokol, Inc.
Aerospace Group
3340 Airport Rd.
Ogden, UT 84405

Dr. L.H. Caveny
Air Force Office of Scientific
Research
Directorate of Aerospace Sciences
Bolling Air Force Base
Washington, DC 20332

W.G. Roger
Code 5253
Naval Ordnance Station
Indian Head, MD 20640

Dr. Donald L. Ball
Air Force Office of Scientific
Research
Directorate of Chemical &
Atmospheric Sciences
Bolling Air Force Base
Washington, DC 20332

(DYN)

DISTRIBUTION LIST

Dr. Anthony J. Maruszko
Air Force Office of Scientific Research
Directorate of Chemical & Atmospheric
Sciences
Bolling Air Force Base
Washington, DC 20332

Dr. Michael Chaykovsky
Naval Surface Weapons Center
Code R11
White Oak
Silver Spring, MD 20910

J.J. Rocchio
USA Ballistic Research Lab.
Aberdeen Proving Ground, MD 21005-5066

B. Swanson
INC-4 MS C-346
Los Alamos National Laboratory
Los Alamos, New Mexico 87545

Dr. James T. Bryant
Naval Weapons Center
Code 3205B
China Lake, CA 93555

Dr. L. Rothstein
Assistant Director
Naval Explosives Dev. Engineering Dept.
Naval Weapons Station
Yorktown, VA 23691

Dr. M.J. Kamlet
Naval Surface Weapons Center
Code R11
White Oak, Silver Spring, MD 20910

Dr. Henry Webster, III
Manager, Chemical Sciences Branch
ATTN: Code 5063
Crane, IN 47522

Dr. A.L. Slafkosky
Scientific Advisor
Commandant of the Marine Corps
Code RD-1
Washington, DC 20380

Dr. H.G. Adolph
Naval Surface Weapons Center
Code R11
White Oak
Silver Spring, MD 20910

U.S. Army Research Office
Chemical & Biological Sciences
Division
P.O. Box 12211
Research Triangle Park, NC 27709

Dr. John S. Wilkes, Jr.
FJSRL/NC
USAF Academy, CO 80840

Dr. H. Rosenwasser
AIR-320R
Naval Air Systems Command
Washington, DC 20361

Dr. Joyce J. Kaufman
The Johns Hopkins University
Department of Chemistry
Baltimore, MD 21218

Dr. A. Nielsen
Naval Weapons Center
Code 385
China Lake, CA 93555

(DYN)

DISTRIBUTION LIST

K.D. Pae
High Pressure Materials Research Lab.
Rutgers University
P.O. Box 909
Piscataway, NJ 08854

Dr. John K. Dienes
T-3, B216
Los Alamos National Lab.
P.O. Box 1663
Los Alamos, NM 87544

A.N. Gent
Institute Polymer Science
University of Akron
Akron, OH 44325

Dr. D.A. Shockey
SRI International
333 Ravenswood Ave.
Menlo Park, CA 94025

Dr. R.B. Kruse
Morton Thiokol, Inc.
Huntsville Division
Huntsville, AL 35807-7501

G. Butcher
Hercules, Inc.
P.O. Box 98
Magna, UT 84044

W. Waesche
Atlantic Research Corp.
7511 Wellington Road
Gainesville, VA 22065

Dr. R. Bernecker
Naval Surface Weapons Center
Code R13
White Oak
Silver Spring, MD 20910

Prof. Edward Price
Georgia Institute of Tech.
School of Aerospace Engineering
Atlanta, GA 30332

J.A. Birkett
Naval Ordnance Station
Code 5253K
Indian Head, MD 20640

Prof. R.W. Armstrong
University of Maryland
Dept. of Mechanical Engineering
College Park, MD 20742

Herb Richter
Code 385
Naval Weapons Center
China Lake, CA 93555

J.T. Rosenberg
SRI International
333 Ravenswood Ave.
Menlo Park, CA 94025

G.A. Zimmerman
Aeroject Tactical Systems
P.O. Box 13400
Sacramento, CA 95813

Prof. Kenneth Kuo
Pennsylvania State University
Dept. of Mechanical Engineering
University Park, PA 16802

T.L. Boggs
Naval Weapons Center
Code 3891
China Lake, CA 93555

(DYN)

DISTRIBUTION LIST

Dr. C.S. Coffey Naval Surface Weapons Center Code R13 White Oak Silver Spring, MD 20910	J.M. Culver Strategic Systems Projects Office SSPO/SP-2731 Crystal Mall #3, RM 1048 Washington, DC 20376
D. Curran SRI International 333 Ravenswood Avenue Menlo Park, CA 94025	Prof. G.D. Duvall Washington State University Department of Physics Pullman, WA 99163
E.L. Throckmorton Code SP-2731 Strategic Systems Program Office Crystal Mall #3, RM 1048 Washington, DC 23076	Dr. E. Martin Naval Weapons Center Code 3858 China Lake, CA 93555
R.G. Rosemeier Brimrose Corporation 7720 Belair Road Baltimore, MD 20742	Dr. M. Farber 135 W. Maple Avenue Monnovia, CA 91016
C. Gotzmer Naval Surface Weapons Center Code R-11 White Oak Silver Spring, MD 20910	W.L. Elban Naval Surface Weapons Center White Oak, Bldg. 343 Silver Spring, MD 20910
G.A. Lo 3251 Hanover Street B204 Lockheed Palo Alto Research Lab Palo Alto, CA 94304	Defense Technical Information Center Bldg. 5, Cameron Station Alexandria, VA 22314 (12 copies)
R.A. Schapery Civil Engineering Department Texas A&M University College Station, TX 77843	Dr. Robert Polvani National Bureau of Standards Metallurgy Division Washington, D.C. 20234
Dr. Y. Gupta Washington State University Department of Physics Pullman, WA 99163	Director Naval Research Laboratory Attn: Code 2627 Washington, DC 20375 (6 copies)
	Administrative Contracting Officer (see contract for address) (1 copy)