

2

**AD-A239 861**



**MICROSTRUCTURAL STABILITY AND CREEP  
RESPONSE OF A NEW Al-Fe-W-Si ALLOY**

Dr. John Benci and Dr. William Frazier  
Air Vehicle and Crew Systems Technology Department (Code 60634)  
NAVAL AIR DEVELOPMENT CENTER  
Warminster, PA 18974-5000

**1 APRIL 1991**

FINAL REPORT  
Period Covering September 1989 to December 1990  
Task No. 1B  
Project No. WS34-A58

*Approved for Public Release; Distribution is Unlimited*

DTIC  
ELECTE  
AUG 27 1991  
S B D

Prepared for  
Air Vehicle and Crew Systems Technology Department (Code 60C)  
NAVAL AIR DEVELOPMENT CENTER  
Warminster, PA 18974-5000

91 8 26 008

**91-08866**

## NOTICES

**REPORT NUMBERING SYSTEM** — The numbering of technical project reports issued by the Naval Air Development Center is arranged for specific identification purposes. Each number consists of the Center acronym, the calendar year in which the number was assigned, the sequence number of the report within the specific calendar year, and the official 2-digit correspondence code of the Command Officer or the Functional Department responsible for the report. For example: Report No. NADC-88020-60 indicates the twentieth Center report for the year 1988 and prepared by the Air Vehicle and Crew Systems Technology Department. The numerical codes are as follows:

CODE	OFFICE OR DEPARTMENT
00	Commander, Naval Air Development Center
01	Technical Director, Naval Air Development Center
05	Computer Department
10	AntiSubmarine Warfare Systems Department
20	Tactical Air Systems Department
30	Warfare Systems Analysis Department
40	Communication Navigation Technology Department
50	Mission Avionics Technology Department
60	Air Vehicle & Crew Systems Technology Department
70	Systems & Software Technology Department
80	Engineering Support Group
90	Test & Evaluation Group

**PRODUCT ENDORSEMENT** — The discussion or instructions concerning commercial products herein do not constitute an endorsement by the Government nor do they convey or imply the license or right to use such products.

Reviewed By: Jeffrey Waldman Date: 5/17/91  
Branch Head

Reviewed By: Steve Schuff Date: 5/31/91  
Division Head


Reviewed By: Al Smith Date: 6/4/91  
Director/Deputy Director

**REPORT DOCUMENTATION PAGE**

1a REPORT SECURITY CLASSIFICATION <b>Unclassified</b>		1b RESTRICTIVE MARKINGS	
2a SECURITY CLASSIFICATION AUTHORITY		3 DISTRIBUTION / AVAILABILITY OF REPORT <b>Approved for Public Release; Distribution is Unlimited</b>	
2b DECLASSIFICATION / DOWNGRADING SCHEDULE		4 PERFORMING ORGANIZATION REPORT NUMBER(S) <b>NADC-91030-60</b>	
4 PERFORMING ORGANIZATION REPORT NUMBER(S) <b>NADC-91030-60</b>		5 MONITORING ORGANIZATION REPORT NUMBER(S)	
6a NAME OF PERFORMING ORGANIZATION <b>Air Vehicle and Crew Systems Technology Department</b>	6b OFFICE SYMBOL (If applicable) <b>60634</b>	7a NAME OF MONITORING ORGANIZATION	
6c ADDRESS (City, State, and ZIP Code) <b>NAVAL AIR DEVELOPMENT CENTER Warminster, PA 18974-5000</b>		7b ADDRESS (City, State, and ZIP Code)	
8a NAME OF FUNDING / SPONSORING ORGANIZATION <b>Air Vehicle and Crew Systems Technology Dept.</b>	8b OFFICE SYMBOL (If applicable) <b>60C</b>	9 PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c ADDRESS (City, State, and ZIP Code) <b>NAVAL AIR DEVELOPMENT CENTER Warminster, PA 18974-5000</b>		10 SOURCE OF FUNDING NUMBERS	
		PROGRAM ELEMENT NO	PROJECT NO <b>WS34-A58</b>
		TASK NO <b>1B</b>	WORK UNIT ACCESSION NO
11 TITLE (Include Security Classification) <b>Microstructural Stability And Creep Response Of A New Al-Fe-W-Si Alloy</b>			
12 PERSONAL AUTHOR(S) <b>Dr. John Benci and Dr. William Frazier</b>			
13a TYPE OF REPORT <b>Final</b>	13b TIME COVERED FROM <b>9/89</b> TO <b>12/90</b>	14 DATE OF REPORT (Year, Month, Day) <b>1991 April 1</b>	15 PAGE COUNT
16 SUPPLEMENTARY NOTATION			
17 COSATI CODES		18 SUBJECT TERMS (Continue on reverse if necessary and identify by block number)	
FIELD	GROUP	SUB-GROUP	
<b>11</b>	<b>06</b>		
<b>11</b>	<b>06</b>	<b>02</b>	
19 ABSTRACT (Continue on reverse if necessary and identify by block number) The microstructural stability and creep properties of a new aluminum alloy for potential aerospace applications at service temperatures up to 700°F (371°C) were evaluated. The Al alloy composition is 11.50% Fe, 3.75% W and 2.25% Si by weight. The material was rapidly solidified via planar flow casting, vacuum hot-pressed, and then extruded into bar form. The room temperature yield strength and ultimate tensile strength are 603 MPa and 626 MPa, respectively, with an 11.3% elongation and a 33.0% reduction of area at fracture. A series of creep experiments were performed on this alloy at 700°F (371°C), and the results were compared to alloys FVS0812 (8009) and FVS1212. A change in creep deformation mechanism was discovered at a stress level of approximately 85 MPa defining the maximum allowable stress for components made from this material. The microstructural stability was evaluated by aging samples at either 700°F (371°C) or 900°F (482°C) and measuring the average grain and dispersoid sizes as a function of aging time with transmission electron microscopy. Upon aging at 371°C, the room temperature hardness did not change even after times greater than 1000 hrs., indicating the microstructure is stable at this temperature. The hardness decreased slightly during 482°C aging over a period of 670 hrs. indicating minor microstructural changes (e.g., dispersoid coarsening) were occurring over long periods of time.			
20 DISTRIBUTION / AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT <input type="checkbox"/> DTIC USERS		21 ABSTRACT SECURITY CLASSIFICATION <b>Unclassified</b>	
22a NAME OF RESPONSIBLE INDIVIDUAL <b>Dr. William E. Frazier</b>		22b TELEPHONE (Include Area Code) <b>215-441-1301</b>	22c OFFICE SYMBOL <b>60634</b>

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE



NADC-91030-60

CONTENTS

	Page
FIGURES .....	iv
TABLES .....	v
ACKNOWLEDGEMENTS .....	vi
INTRODUCTION .....	1
EXPERIMENTAL .....	1
RESULTS .....	1
CREEP TESTING .....	1
AGING STUDIES .....	6
TRANSMISSION ELECTRON MICROSCOPY .....	7
DISCUSSION .....	10
CONCLUSIONS .....	13
REFERENCES .....	13



<b>Accession For</b>	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

**NADC-91030-60**

**FIGURES**

Figure		Page
1	Minimum Creep Rate as a Function of Applied Stress .....	3
2	TEM Micrographs Illustrating the "Average" Microstructure of Alloy in the (a) As-received Condition, and (b) After Aging for 128 Hours at 371° .....	8
3	TEM Micrographs Illustrating the Inhomogeneous Microstructure of Alloy 102 in Samples Aged for 128 Hours at 371°C. (a) Bimodal Dispersoid Size Distribution and (b) Dispersoid Poor Regions .....	9
4	Grain Size of Alloy 102 Aged at 371°C, 482°C, and Creep Tested at 371°C with an Applied Stress of 60 MPa. ....	11

NADC-91030-60

TABLES

Table		Page
I	Minimum Creep Strain Rate at 371°C as a Function of Applied Stress from Variable Load Creep Tests .....	4
II	Values for the Constant n in the Power Law Creep Equation from Variable Load Creep Tests .....	4
III	Test Schedule for Creep Experiments on Alloy 102 at 371°C .....	5
IV	Minimum Creep Strain of Alloy 102 at 371° as a Function of Applied Stress .....	6
V	Hardness of Alloys as a Function of Aging Time at 371°C .....	7
VI	Hardness of Alloys as a Function of Aging Time at 482°C .....	7

**NADC-91030-60**  
**Acknowledgements**

This work was performed while J.E. Benci was supported by the Office of Naval Technology through a post-doctoral fellowship at the Naval Air Development Center. The room temperature strength and ductility values for alloy 102 were supplied by Allied-Signal. The authors acknowledge the support provided from the IHPTET program, NAPC, and NAVAIR.

Introduction

High temperature aluminum (HTA) alloys have been the subject of intense research and development activity in the aerospace community. The objective of this work is to enhance the performance and reduce the cost of advanced aircraft. This would be accomplished by replacing components made from heavy and difficult to machine titanium and steel alloys, used at temperatures between 150 and 375°C, with HTA alloy components.

The Navy, under the Intergrated High Performance Turbine Engine Technology (IHPTET) Program, is currently pursuing the development of HTA alloys for applications to 700°F (371°C). One approach has been to augment the properties of the "FVS1212 type" alloys, produced by Allied Signal, through compositional changes, e.g., replacing V with W.

The excellent ambient and elevated temperature strength of FVS1212 is attributable to the alloy's fine grain size (0.5 microns), and to the high volume fraction (36 to 37 vol. %) and fine size (30-80nm) of the metastable silicide dispersoids, viz.,  $\alpha\text{-Al}_{12}(\text{Fe},\text{V})_3\text{Si}$  [1,2]. The silicide is isostructural with  $\text{Al}_{15}\text{Mn}_3\text{Si}$ ; it is bcc (Im3) with 138 atoms per unit cell [3]. The addition of V stabilizes the  $\alpha\text{-Al}_{12}(\text{Fe},\text{V})_3\text{Si}$  structure sufficiently so that during planar flow casting it forms in preference to the thermodynamically more stable hexagonal  $\text{Al}_8\text{Fe}_2\text{Si}$  and monoclinic  $\text{Al}_3\text{Fe}$  phases [4]. W and other transition elements are able to substitute for V in the silicide's structure; the composition of the silicide phase is known to affect its coarsening rate [5]. W was added in order to curtail the coarsening rate and enhance the modulus of the silicide. The low diffusivity, limited solid state solubility, and high melting temperature of W made it attractive for this application.

The focus of this investigation was two-fold: (i) assess the creep behavior of a W bearing alloy at 371°C (700°F), and (ii) assess the effect of stress on microstructural coarsening. The combined effect of stress and temperature is known to alter the coarsening behavior of HTA alloys. For example, creep significantly increased particle coarsening in Al-Fe-Ce alloys by activating dislocation and grain boundary diffusion mechanisms [6]. At 550°C, alloy FVS1212 also experiences rapid growth of the  $\alpha\text{-Al}_{12}(\text{Fe},\text{V})_3\text{Si}$  dispersoids located at grain boundaries [1].

### Experimental

One of the experimental, advanced, aluminum alloys developed under the IHPTET program by Allied Signal was selected as the material to be used in this study. This alloy was designated 102. Alloy 102 was chosen because it had the best combination of room temperature properties, i.e., strength and ductility. This alloy contains approximately 11.50% Fe, 3.75% W, and 2.25% Si by weight. Alloy 102 has the following room temperature properties: Yield Strength - 603 MPa (87.5 ksi); Ultimate Tensile Strength - 626 MPa (90.8 ksi); elongation to failure - 11.3%; reduction of area at fracture - 33%. The density of this alloy is calculated to be approximately  $3.1 \text{ gcm}^{-3}$ .

Standard creep specimens were machined from alloy 102 and from two of Allied Signal's commercial alloys, FVS0812 (8009) and FVS1212, which have compositions, processing conditions, and microstructures similar to alloy 102. One sample each of FVS0812, FVS1212 and alloy 102 was creep tested at  $371^{\circ}\text{C}$  ( $700^{\circ}\text{F}$ ) with step increases in load over a large stress range. The strain in the samples was recorded as a function of time using a dual LVDT extensometer. The Young's moduli at room temperature and  $371^{\circ}\text{C}$  were determined for these three alloys by increasing the load on the specimen in an abrupt manner and measuring the instantaneous elongation using lvdt's. Based on the results from the alloy 102 variable load creep test, a test schedule for further creep experiments on this alloy at  $371^{\circ}\text{C}$  was formulated. The minimum creep strain rate of each sample was measured. Interrupting the tests at predetermined times allowed the evaluation of the time and stress magnitude effects on any stress induced microstructural changes.

Samples of alloys FVS0812, FVS1212 and 102, 10mm x 13mm x 3mm, were cut from extruded bar and used in the aging study. Samples of each alloy were placed in a furnace at  $371^{\circ}\text{C}$  or  $482^{\circ}\text{C}$  and aged for various times. The room temperature hardness of these samples was then measured as a function of aging time and temperature. TEM specimens were prepared from each sample for microstructural characterization. The dispersoid sizes and grain sizes were measured in the specimens examined.

### Results

#### Creep Testing

One sample each of FVS0812, FVS1212 and alloy 102 was creep tested at  $371^{\circ}\text{C}$  ( $700^{\circ}\text{F}$ ) with step increases in load over a large stress range. The strain rate vs. applied stress data are tabulated in Table I. The creep response of the three samples at  $371^{\circ}\text{C}$  is shown graphically in fig. 1.

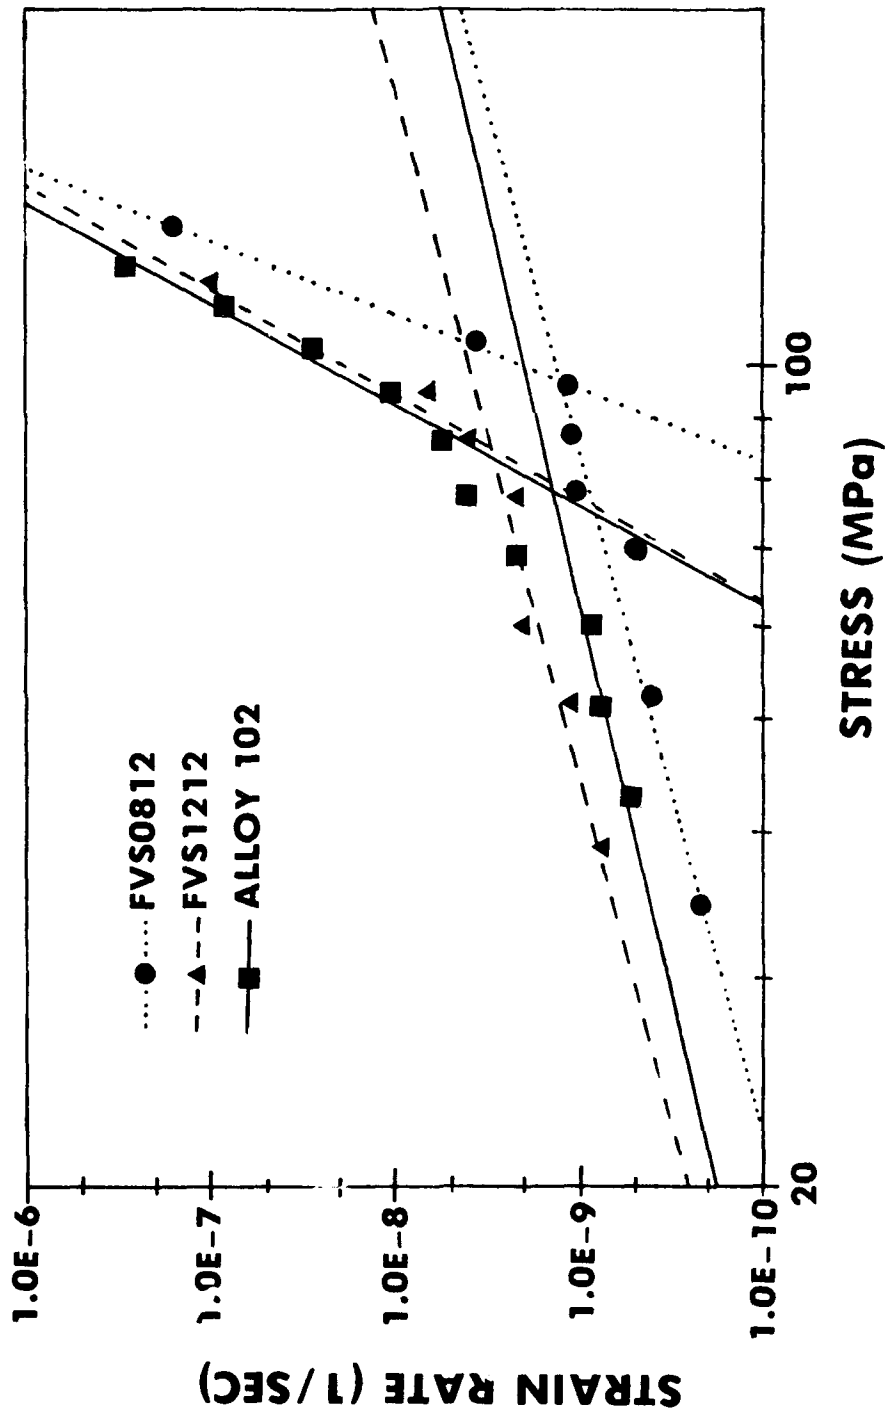


Figure 1 - Minimum creep rate as a function of applied stress.

The curves for all three samples exhibit a "knee" at about 80-100 MPa applied stress. The power law creep equation:

$$e_{\min} = B\sigma^n$$

where  $e_{\min}$  is the minimum creep strain rate,  $\sigma$  is the applied stress, and B and n are constants, was fit to the two segments of the curve for each sample. The values of n from the best fit curves for the three alloys are given in Table II. The "average" value of the stress exponent for the three alloys is about  $n = 1.7$  for  $\sigma < 80$  MPa and  $n = 12$  for  $\sigma > 90$  MPa. The creep behavior of alloy 102 at 371°C is fairly similar to that of alloy FVS1212.

**Table I Minimum creep strain rate at 371°C as a function of applied stress from variable load creep tests.**

<u>FVS0812</u>		<u>FVS1212</u>		<u>102</u>	
$\sigma$ (MPa)	$e_{\min}$ (s <sup>-1</sup> )	$\sigma$ (MPa)	$e_{\min}$ (s <sup>-1</sup> )	$\sigma$ (MPa)	$e_{\min}$ (s <sup>-1</sup> )
34.79	2.33x10 <sup>-10</sup>	38.70	7.64x10 <sup>-10</sup>	43.00	5.31x10 <sup>-10</sup>
52.19	4.11x10 <sup>-10</sup>	51.60	1.15x10 <sup>-9</sup>	51.60	7.84x10 <sup>-10</sup>
-----	-----	60.20	2.17x10 <sup>-9</sup>	60.20	8.75x10 <sup>-10</sup>
69.59	5.25x10 <sup>-10</sup>	-----	-----	68.80	2.24x10 <sup>-9</sup>
78.29	1.05x10 <sup>-9</sup>	77.40	2.28x10 <sup>-9</sup>	77.40	4.28x10 <sup>-9</sup>
86.99	1.14x10 <sup>-9</sup>	86.00	4.26x10 <sup>-9</sup>	86.00	5.80x10 <sup>-9</sup>
95.69	1.22x10 <sup>-9</sup>	94.60	7.12x10 <sup>-9</sup>	94.60	1.14x10 <sup>-8</sup>
104.4	3.81x10 <sup>-9</sup>	103.2	3.35x10 <sup>-8</sup>	103.2	2.90x10 <sup>-8</sup>
-----	-----	116.1	1.11x10 <sup>-7</sup>	111.8	9.01x10 <sup>-8</sup>
130.5	1.69x10 <sup>-7</sup>	-----	-----	120.4	3.18x10 <sup>-7</sup>

**Table II: Values for the constant n in the power law creep equation from variable load creep tests.**

Alloy	Low Stress	High Stress
	n	n
FVS0812	1.72	16.11
FVS1212	1.71	11.45
102	1.50	11.90

## NADC-91030-60

The Young's moduli at room temperature and 371°C were determined for these three alloys by increasing the load on the specimen in an abrupt manner and measuring the instantaneous elongation using lvdt's. The moduli for alloys FVS0812, FVS1212 and 102 at room temperature are 84.1 GPa, 89.0 GPa, and 91.0 GPa, respectively, and are 63.4 GPa, 70.3 GPa, and 68.3 GPa, respectively, at 371°C.

Based on the results from the alloy 102 variable load creep test, a test schedule for further creep experiments on this alloy at 371°C was formulated. The test schedule is shown in Table III. The minimum creep strain rate of each sample was measured. Interrupting the tests at the indicated times allowed the determination of the time and stress magnitude effects on any stress induced microstructural changes. The 100 hour test with an applied stress of 110 MPa was initiated, however the sample failed after a test time of only 32.5 hrs. The 95 MPa test scheduled for 100 hrs. was therefore interrupted after 32.5 hrs. to maintain a constant test time for the two stress levels. The minimum creep strain rates of the six tests performed are shown under the heading of Constant Load in Table IV. The minimum strain rate results from the alloy 102 sample which was creep tested under variable load conditions are also presented in Table IV. The results from the two types of tests match fairly well. TEM specimens were made from each creep sample to determine time and stress magnitude effects on any stress induced microstructural changes.

**Table III: Test schedule for creep experiments on alloy 102 at 371°C.**

Applied Stress (MPa)	Test Time (hrs)
40.0	500
60.0	500
60.0	200
95.0	200
95.0	100 (32.5)
110.0	*100 (32.5)

\* Sample failed after only 32.5 hours.

**Table IV: Minimum creep strain rate of alloy 102 at 371°C as a function of applied stress.**

<u>CONSTANT LOAD</u>		<u>VARIABLE LOAD</u>	
(MPa)	$e_{min} (s^{-1})$	(MPa)	$e_{min} (s^{-1})$
40.00	$1.9 \times 10^{-10}$	43.00	$5.31 \times 10^{-10}$
60.00	$8.15 \times 10^{-10}$	51.60	$7.84 \times 10^{-10}$
60.00	$8.80 \times 10^{-10}$	60.20	$8.75 \times 10^{-10}$
95.00	$1.29 \times 10^{-8}$	68.80	$2.24 \times 10^{-9}$
110.0	$9.91 \times 10^{-8}$	77.40	$4.28 \times 10^{-9}$
		86.00	$5.80 \times 10^{-9}$
		94.60	$1.14 \times 10^{-8}$
		103.2	$2.90 \times 10^{-8}$
		111.8	$9.01 \times 10^{-8}$
		120.4	$3.18 \times 10^{-7}$

**Aging Studies**

Aging studies were conducted on alloy 102 to determine the suitability of this alloy for extended use at elevated temperatures. Alloys FVS0812 and FVS1212 were included in this study for comparison purposes. Samples of alloys FVS0812, FVS1212 and 102, 10mm x 13mm x 3mm, were placed in a furnace at 371°C (700°F) and aged for various times between 4 and 1024 hours. The samples were removed from the furnace at predetermined times and were air cooled. Hardness measurements were taken from each of the aged samples and from two unaged "as-received" samples of each alloy. The hardness measurements are tabulated in Table V as a function of aging time. The hardness of all three alloys does not change as a function of aging time at 371°C up to at least 1024 hrs. This result indicates that the microstructure is stable at this temperature. TEM measurements were made to verify this thesis. The hardness of alloy 102 ( $R_B$  92.0) is slightly greater than alloy FVS1212 ( $R_B$  89.2) which is harder than alloy FVS0812 ( $R_B$  77.4).

**Table V: Hardness of alloys as a function of aging time at 371°C**

Aging Time		Hardness (Rockwell B)		
HOURS	FVS0812	FVS1212	102	
0	76.7	89.1	91.2	
4	-	-	92.1	
8	76.4	89.0	92.1	
16	77.2	89.3	92.1	
32	77.7	89.3	92.0	
64	78.0	89.3	92.2	
128	78.2	89.6	91.8	
256	76.8	89.2	92.1	
512	77.9	89.4	91.6	
768	77.8	89.0	-	
1024	77.9	89.4	91.3	


Samples of alloys FVS0812, FVS1212 and 102, 10mm x 13mm x 3mm, were placed in a furnace at 482°C (900°F) and aged for various times. The room temperature hardness of these samples was then measured. Table VI lists the hardness of these alloys as a function of aging time. The hardness of all three alloys decreased upon aging at 482°C, compared to no change in hardness when aged at 371°C (700°F). However, for alloy 102, the changes in hardness resulting from the 482°C aging were relatively small, even after 671 hours, indicating that the microstructure of this alloy is relatively stable even at this elevated temperature.

**Table VI: Hardness of alloys as a function of aging time at 482°C.**

Aging Time		Hardness (Rockwell B)		
HOURS	FVS0812	FVS1212	102	
0	76.7	89.1	91.2	
168	74.3	87.3	89.7	
352	73.0	87.2	88.7	
502	-	-	87.8	
671	-	-	87.8	

**Transmission Electron Microscopy**

Two micrographs showing the "average" or "typical" microstructure of alloy 102 are presented in fig. 2. Figure 2(a) is a micrograph of alloy 102 in the as-received

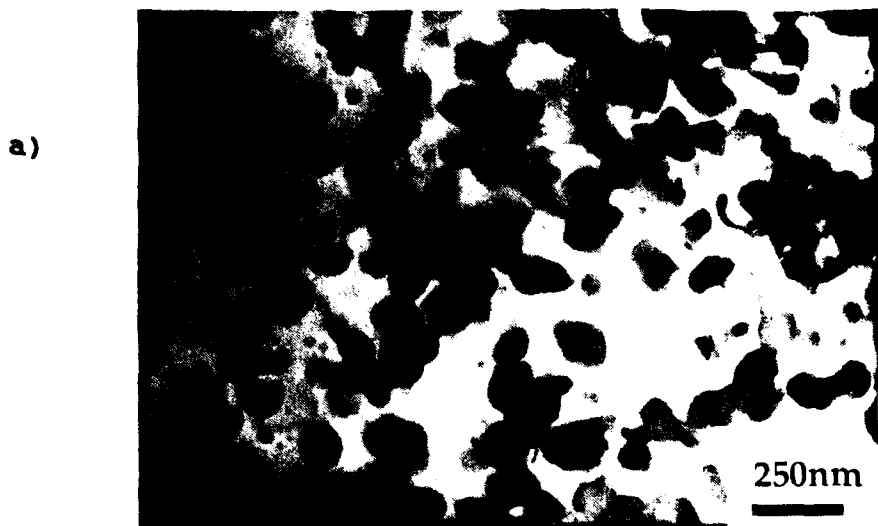


As-Received




Aged for 128 hrs. at 371°C

Figure 2 - TEM micrographs illustrating the "average" microstructure of alloy 102 in the (a) as-received condition, and (b) after aging for 128 hrs at 371°C.

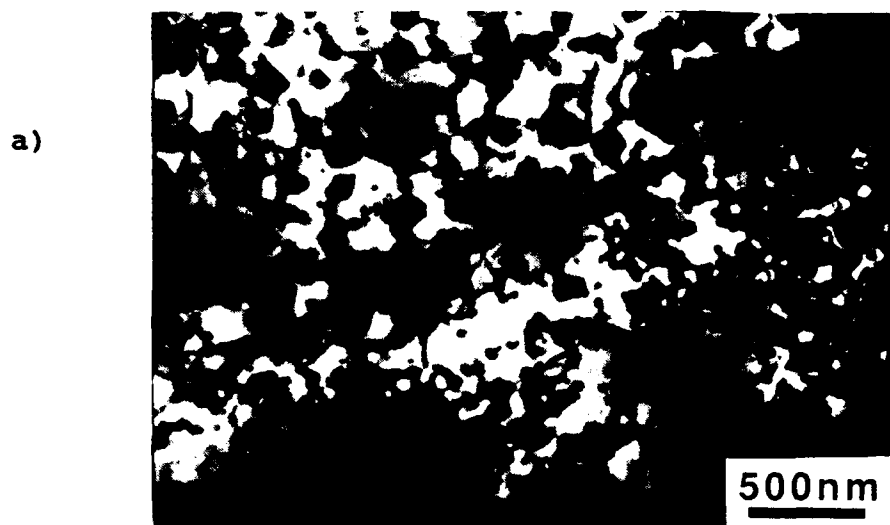

Bimodal Dispersoid Sizes

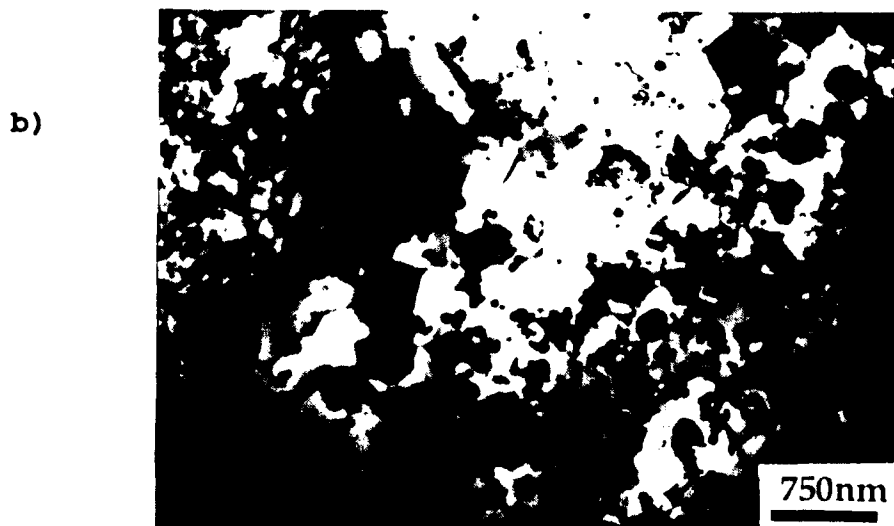

Dispersoid Lean Region

Figure 3 - TEM micrographs illustrating the inhomogeneous microstructure of alloy 102 in samples aged for 128 hrs at 371°C. (a) Bimodal dispersoid size distribution and (b) dispersoid poor regions.

condition. The micrograph in fig. 2(b) is from a sample which had been aged at 371°C for 128 hrs. The average dispersoid size is about 0.08 microns in diameter and the average grain diameter is about 0.3 microns in the as-received condition. The microstructure of alloy 102 was very inhomogeneous and this is illustrated by the micrographs in fig. 3. There is a bimodal dispersoid size distribution in this alloy, and the distribution of dispersoids is nonuniform, leading to dispersoid poor regions.

Results from the TEM investigation indicate fairly large distributions in the dispersoid and grain sizes within a given specimen, making quantitative measurements laborious and difficult. The one set of quantitative results we would like to present concerns the effects of temperature and stress on grain coarsening. Figure 4 is a plot of grain size of alloy 102 samples which had been aged at 371°C, 482°C and creep tested (aged under stress) at 371°C with an applied stress of 60 MPa. Grain coarsening appears to occur in all three sets of experiments with 371°C aging exhibiting the least coarsening, 371°C with 60 MPa applied stress exhibiting slightly faster coarsening rates, and 482°C aging exhibiting the most coarsening. A word of caution however, although the mean values of grain size for all three conditions appear to increase with test time, the changes in mean grain size are small compared to the standard deviation of grain sizes within a given sample.

### Discussion

The goal of the Navy sponsored HTA alloy development program was to develop a monolithic aluminum alloy for elevated temperature applications to replace heavier existing alloys, such as titanium alloys and steels, currently used to fabricate aircraft components subject to moderate elevated temperature operating conditions, resulting in weight, and possibly cost, savings. Starting with aluminum alloys FVS0812 (8009) and FVS1212, the objective was to develop an alloy which had higher strength and modulus than alloy FVS0812, and a higher room temperature ductility and fracture toughness than alloy FVS1212. Microstructurally, the alloy must be relatively stable at elevated temperatures 371°C.

The approach taken was to modify the alloy chemistry and dispersoid volume fraction; develop a series of experimental alloy compositions; and measure the room temperature mechanical properties of the experimental alloys. One of the experimental alloys developed under the HTA alloy development program which had the best combination of room temperature properties was selected to be the focus of the present work. This alloy, designated 102, had the

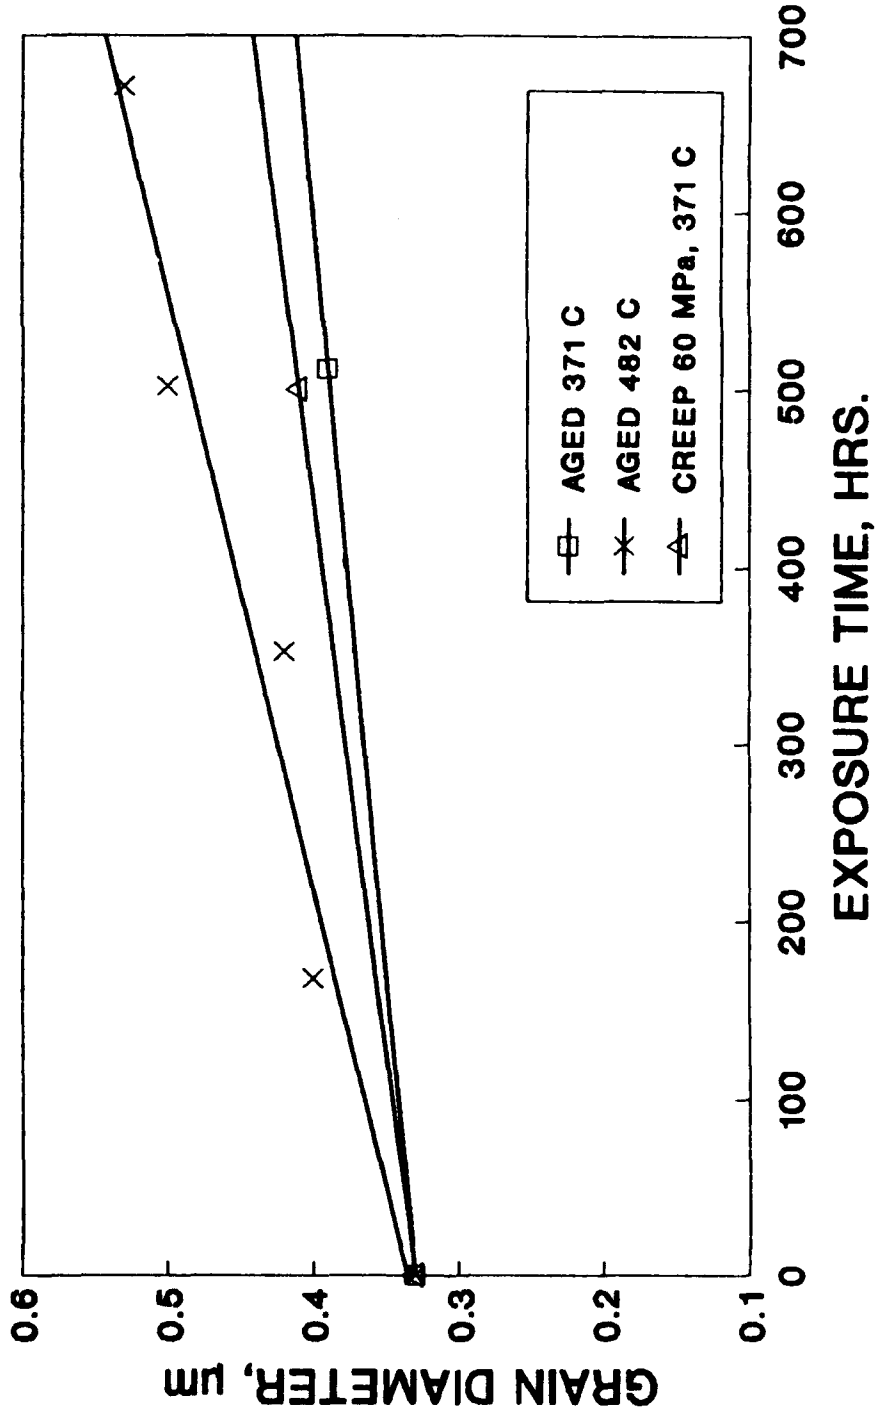


Figure 4 - Grain size of alloy 102 aged at 371°C, 482°C, and creep tested at 371°C with an applied stress of 60 MPa.

vanadium in the FVS-type alloys replaced with tungsten. The composition of alloy 102 is approximately 11.50% Fe, 3.75% W, and 2.25% Si by weight. This alloy has good room temperature strength 603 MPa while maintaining reasonable ductility (11.3% elongation to failure). The low diffusivity, limited solid state solubility, and high melting temperature of W lead one to anticipate slow dispersoid coarsening rates resulting in a relatively stable microstructure during elevated temperature exposure. The dispersoid volume fraction in alloy 102 is about 36%, and the Fe:W ratio is 9.2:1. Increasing the Fe:V ratio in the FVS-type alloys from 5:1 to 10:1 resulted in a factor of 3.5 decrease in dispersoid coarsening rates at 425°C [5]. The relatively high Fe:W ratio in alloy 102 would again lead one to expect slow dispersoid coarsening rates in this alloy.

The results from the creep testing performed on alloy 102 at 371°C were presented in fig. 1 and Tables I, II, and IV. The creep behavior of alloy 102 is fairly similar to that of alloy FVS1212 at 371°C. The alloy 102 creep curve exhibits a knee at an applied stress of about 80 MPa, corresponding to a minimum strain rate of approximately  $1.5 \times 10^{-9}$ /s. The stress exponent,  $n$ , increases from a value of about 1.5 for stresses less than 80 MPa, to a value of 12 at applied stresses greater than 80 MPa. This type of creep behavior is also seen in Al-Fe-Ce alloys. A knee in the Al-Fe-Ce creep strain rate vs. stress curve has been observed, and it moves to lower stresses and higher strain rates as the temperature is increased [7]. At a test temperature of 350°C, the knee occurs at about 45 MPa applied stress, corresponding to a minimum strain rate of about  $8 \times 10^{-7}$ /s; the creep exponent at 350°C is equal to 1.7 at low stresses and 8.7 at high stresses [7].

Two data points from the alloy 102 creep testing results shown in fig. 1 do not lie close to the drawn curves. These points correspond to applied stresses of 69 and 77 MPa, very close to the knee in the curve, and the measured strain rates are higher than the corresponding points on the drawn curves. This positive deviation in minimum creep strain rates is probably a result of the inhomogeneous microstructure in this alloy and due to larger creep strains occurring in dispersoid poor regions of the sample.

The results from the aging and TEM studies on alloy 102 were presented in Tables V and VI and fig. 4. The room temperature hardness of alloy 102 is  $R_B$  92 and does not change upon aging at 371°C for up to 1000 hrs. The hardness of alloy 102 did decrease upon aging at 482°C, however the change in hardness was relatively small for aging times up to 670 hrs. The hardness results suggest that the microstructure of alloy 102 is relatively stable with respect to long term elevated temperature exposure at

temperatures up to 482°C. TEM specimens were prepared from each of the aged samples and each of the creep tested samples. The goal was to measure the dispersoid and grain coarsening rates as a function of temperature and applied stress to determine if the microstructure of alloy 102 is indeed relatively stable, as the hardness results indicate. As mentioned previously, the inhomogeneous microstructure of alloy 102 does not permit quantitative measurements to be performed easily. The variations in grain and dispersoid sizes within a specimen were much larger than the expected changes in average sizes between specimens. Based on qualitative observations, the average grain and dispersoid sizes did increase with aging time; however, the increases were not large, even for the samples aged at 482°C for the longest times.

### Conclusions

1. At 371°C, a change in creep deformation mechanisms occurs at approximately 80 MPa, defining the maximum practical operating stress for components made from this alloy.
2. There is a bimodal distribution of dispersoid and grain sizes in this heat of alloy 102. Also, the dispersoids are nonuniformly distributed through the material.
3. The room temperature hardness of alloy 102 did not change after aging at 371°C for greater than 1000 hrs indicating that the microstructure is stable at this alloy's intended use temperature.
4. Results from 482°C aging show a gradual decrease in hardness with aging time indicating that the microstructure is relatively stable even at this elevated temperature. TEM observations confirm that extensive coarsening does not occur in this alloy at temperatures up to 482°C.

### References

1. R.E. Franck and J.A. Hawk, "Effect of Very High Temperatures on the Mechanical Properties of Al-Fe-V-Si Alloy," Scripta Met. 23(1989), 113-118.
2. D.J. Skinner, "The Physical Metallurgy of Dispersion Strengthened Al-Fe-V-Si Alloys," Dispersion Strengthened Aluminum Alloys, ed. Y-W Kim and W.M. Griffith. (Warrendale, PA: TMS, Jan 1988), 181.

3. P.S. Gilman and M.S. Zedalis, "High Temperature Aluminum Alloys," Symposium on Advanced Aluminum Alloy Technology for Cryogenic Tank Applications, NASA-Langley, Hampton, VA, August 12, 1987.
4. G.M. Pharr, M.S. Zedalis, D.J. Skinner, and P.S. Gilman, "High Temperature Creep Deformation of a Rapidly Solidified Al-Fe-V-Si Alloy," Dispersion Strengthened Aluminum Alloys, ed. Y-W Kim and W.M. Griffith. (Warrendale, PA: TMS, Jan 1988), 309.
5. D.J. Skinner, R.L. Bye, D. Raybould, and A.M. Brown, "Dispersion Strengthened Al-Fe-V-Si Alloys," Scripta Met. 20(1986), 867-872.
6. D. Legzdina and T.A. Parthasarathy, "Deformation Mechanisms of a Rapidly Solidified Al-8.8Fe-3.7Ce Alloy," Met. Trans. A., 18(Oct 1987), 1713.
7. L. Angers, M.E. Fine, and J.R. Wertman, "Effect of Plastic Deformation on the Coarsening of Dispersoids in Rapidly Solidified Al-Fe-Ce alloy," Met. Trans. A 18A(April 1987), 555.

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
University of California ..... Dept. of Mechanical Engineering Irvine, CA 92717 E. J. Lavernia	1
University of California ..... Dept. of Materials Science Berkeley, CA 94720 J. Morris, Jr., R. O. Richie	2
University of California ..... Santa Barbara, CA 93106 C.G. Levi	1
University of Michigan ..... H.H. Dow Building Ann Arbor, MI 48109-2136 A. Ghosh	1
University of Pennsylvania ..... School of Engineering and Applied Science 109 Town Building Philadelphia, PA 19104-6391 D. Pope	1
University of Virginia ..... Light Metals Center Charlottesville, VA 22901 J. Wawner, J. Wert, H.N.G. Wadley, E.A. Starke, Jr.	4
USAF Systems Command ..... WPAFB, OH 45331	1
Wayne State University ..... Detroit, MI 48202 J. Benci	1

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
Oak Ridge National Laboratory ..... P.O. Box 2008 Oak Ridge, TN 37831-6077 R.H. Cooper	1
Office of Naval Research ..... 800 Quincy St. Arlington, VA 22217-5000 S. Fishman, Code 12 G. Yoder, Code 11 J. Kelly, Code OCNR-225	3
Pratt and Whitney ..... P.O. Box 109600 West Palm Beach, FL 33410-9600 B.H. Walker, R. Anderson	2
Reynolds Metals Co. .... Fourth and Canal St. P.O. Box 27003 Richmond, VA 23261-7003 A. Cho, D. Thompson	2
Rockwell International, Science Center ..... 1049 Camino Dos Rios P.O. Box 1085 Thousand Oaks, CA 91360	1
Sandia National Laboratory ..... Albuquerque, NM 87185 Div. 1822 and 1832	2
Textron ..... 2 Industrial Ave. Lowell, MA 01851 M. Mitnick	1
The Wichita State University ..... Wichita, KS 67208 J.E. Talia	1
TRW, Inc. .... 23555 Euclid Ave. Cleveland, OH 44117	10
U.S. Army Air Mobility R&D Laboratory ..... Fort Eustis, VA 23064 SAVDL-EU-SS	1

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
Naval Surface Warfare Center ..... Silver Spring, MD 20903-5000 D. Divecha	1
NAVAVNDEP, MCAS ..... Cherry Point, CA Code 340	1
NAVAVNDEP, NAS ..... Alameda, CA Code 340	1
NAVAVNDEP, NAS ..... Jacksonville, FL Code 340	1
NAVAVNDEP, NAS ..... Norfolk, VA Code 340	1
NAVAVNDEP, NAS ..... North Island, CA Code 340	1
NAVAVNDEP, NAS ..... Pensacola, FL Code 340	1
NAVAVNSAFECEN, NAS ..... Norfolk, VA	1
NAVSEASYSKOM ..... Washington, DC 20362	1
NAVSHIPRANDCEN ..... Annapolis, MD 21402	1
NAVSHIPRANDCEN ..... Bethesda, MD 20034	1
Northrop, Aircraft Division ..... One Northrop Ave. Hawthorne, CA 90250 S.P. Agrawal and G.R. Chanani	2

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
NAVAIRSYSCOM . . . . . Washington, DC 20361 J. Collins Air-5304	1
NAVAIRTECEN . . . . . Patuxent River, MD	1
Naval Air Engineering Center . . . . . Lakehurst, NJ 08733-5100 Richard Celin (AV624-2173) Regina Jablonski (AV624-2174) Greg Fisher (SESD) (AV624-1179)	3
Naval Air Propulsion Test Center . . . . . P.O. Box 7176 Trenton, NJ 08628-0176 Frank Warvolis (PE34) Andy Culbertson R. Mahortor	3
Naval Air System Command . . . . . Washington, DC 20361-5140 Richard A. Retta (AIR-51412) Jennifer Jarrett (AIR-51412J) Lew Slotter (AIR-931A)	3
Naval Industrial Resources Support Activity . . . . . Bldg. 75-2 Naval Base Philadelphia, PA 19112-5078 Leo Plonsky (NAVIRSA-203) David Fabry (NAVIRSA-204)	2
Naval Post Graduate School . . . . . Mechanical Engineering Department Monterey, CA 93943 T. McNelly	1
Naval Research Laboratory . . . . . Washington, DC 20375 Code 6120, Code 6306	2
Naval Ship Engineering Center . . . . . Washington, DC 20360 Code 6101E	1
Naval Surface Warfare Center . . . . . Dahlgren, VA 22448-5000	1

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
MCIC, Battelle Memorial Institute ..... Columbus, OH	1
Metal Working News ..... 201 King of Prussia Rd. Radnor, PA 19089 R.R. Irving	1
Metal Working Technology Inc. .... 1450 Scalp Avenue Johnstown, PA 15904 W.L. Otto	1
Metcut-Materials Research Group ..... P.O. Box 33511 Wright Patterson AFB, OH 45433 Y.W. Kim	1
Michigan Technological University ..... Houghton, MI 49931 M. McKimpson	1
NASA Headquarters ..... 600 Independence Ave. Washington, DC 20546 N. Mayer, S. Vennesi	2
NASA Langley Research Center ..... Hampton, VA 23365 L. Blackburn, J. Wagner, D. Roysten, D. Tenney	4
National Bureau of Standards ..... Gaithersburg, MD 20899 R. Shaffer, J. R. Manning	2
National Science Foundation ..... Office of Science and Technology Centers Division 1800 G. Street Washington, DC 20550	1
NAVAIRDEVCON ..... Warminster, PA 18974-5000 Library, Code 8131 (2 Copies) W.E. Frazier, Code 6063 (15 Copies) Gil London, Code 606 (10 Copies)	27

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
Kaiser Aluminum ..... P.O. Box 877 Pleasonton, CA 94566 K. Brown	1
Kaiser Aluminum ..... Ravenswood Works Ravenwood, WV 26164 J.M. Hunter	1
Lockheed California Co. .... Burbank, CA 91520-7631 D. J. Chellman, D. Yaney	2
Lockheed Missiles and Space Co. .... Metallurgy Dept. 93-10/204 3251 Hanover St. Palo Alto, CA 94304 R. Lewis and J. Wadworth	2
Marko Materials Inc. .... 144 Rangeway Rd. N. Billerica, MA 01862 R. Ray	1
Martin Marietta Laboratories ..... 1450 South Rolling Rd. Baltimore, MD 21227-3898 J. Venables, K.S. Kumar	2
Martin Marietta, Michoud Division ..... P.O. Box 29304 New Orleans, LA 70189 J. Hackett	1
Massachusetts Institute of Technology ..... 77 Massachusetts Ave. Cambridge, MA 20139 J. Cornie	1
Material Science Corporation ..... 1777 Walton Rd. Blue Bell, PA 19422	1
McDonnell Aircraft Co. .... Box 516 Saint Louis, MO 63166 K.K. Sankaran	1

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
Garrett Auxiliary Power Division ..... 111 South 34th St. Phoenix, AZ 85010	1
Garrett Auxiliary Power Division ..... 2739 East Washington Street P.O. Box 5227 Phoenix, AZ 85010 Carolyn McCormick	1
General Electric Co. .... Valley Forge Space Center Philadelphia, PA 19101	1
Grumman Aerospace Corp ..... Bethpage, NY 11714 P.N. Adler	1
Howmet Corp. .... 1500 South Warner St. Whitall, MI 49461-1895 B. London	1
Idaho National Engineering Laboratory ..... P.O. Box 1625 Idaho Falls, ID 83415 J.R. Knibloe	1
Inco Alloys International ..... P.O. Box 1958 Huntington, WV 25720 J. deBarbadillo	1
Industrial Materials Technology ..... P.O. Box 565 155 River St. Andover, MA 01810 R. Widmer	1
Innovare Inc. .... Airport Road, Commonwealth Park 7277 Park Drive Bath, PA 18014 A.R. Austin	1

DISTRIBUTION LIST (Continued)  
Report No. NADC-91030-60

	No. of Copies
British Alcan Aluminum Ltd. .... Alcan International Southam Rd. Bambury, Orfordshire OX 167SP, United Kingdom R. Grines	1
Brookhaven National Laboratory .... Department of Applied Science/PSD Building 526 Upton, NY 11973	1
Center for Naval Analyses .... 4401 Front Ave P.O. Box 16268 Alexandria, VA 22302-0268	1
Clemson University .... Dept. of Mechanical Engineering Riggs Hall Clemson, SC 29634-0921 H.J. Rack	1
DARPA .... 1400 Wilson Blvd. Arlington, VA 22209 W. Barker, B. Wilcox	2
Defense Technical Information Center .... Bldg. # 5, Cameron Station Alexandria, VA 22314 (Attn. Administrator)	2
Department of Energy .... 100 Independence Ave. SW Washington, DC 20585 Code CE142	1
Drexel University .... Dept. of Materials Engineering 32nd and Chestnut St. Philadelphia, PA 19104 M.J. Koczak	1
E.I. DuPont De Nemours & Co. .... Government Program Development Chestnut Run Plaza P.O. Box 80702 Wilmington, DE 19880-0702	1

**DISTRIBUTION LIST**  
**Report No. NADC-91030-60**

	No. of Copies
Air Force Wright Aeronautical Lab. .... Wright Patterson AFB, OH 45433 W. Griffith (MLTM), J. Kleek (WL/MLLM), and R.L. Kennard (MTM)	3
Alcan Rolled Products Co. .... 100 Erieview Plaza Cleveland, OH 44114	1
ALCOA ..... 1501 Alcoa Building Pittsburgh, PA 15219 F.R. Billman, R. Bucci and G. J. Hildeman	3
ALCOA ..... 1615 M. Street, N.W. Suite 500 Washington, DC 20036 P. Patrick	1
Allied-Signal Corp. .... P.O. Box 1021R Morristown, NJ 07960 S.K. Das and P. Gilman	2
Army Materials Technology Laboratory ..... Watertown, MA	1
Avco Corp ..... Applied Technology Division Lowell, MA 01851	1
Battelle Memorial Institute ..... Columbus Laboratories 505 King Ave. Columbus, OH 43201	1
Boeing Commercial Airplane ..... Seattle, WA W. Quist	1
Boeing Corp. .... Aerospace Division P.O. Box 3707 Seattle, WA 98124	1