

①


USAARL Report No. 92-12

DTIC

ELECTE

APR 28 1992

AD-A249 634

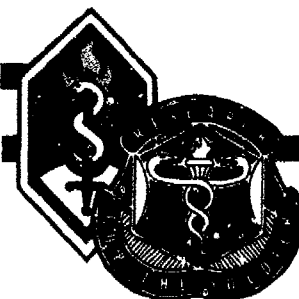

Radiated Electric Field Measurements in U.S. Army Helicopters

By

James E. Bruckart (Project Officer)

Biodynamics Research Division

February 1992

92-10638

02

4

24

114

Approved for public release; distribution unlimited.

United States Army Aeromedical Research Laboratory
Fort Rucker, Alabama 36362-5292

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.


Disposition


Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer


The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:


DENNIS F. SHANAHAN
LTC, MC, MFS
Director, Biodynamics
Research Division

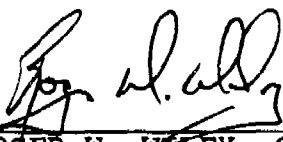
ROGER W. WILEY, O.D., Ph.D.
Chairman, Scientific
Review Committee

Released for publication:

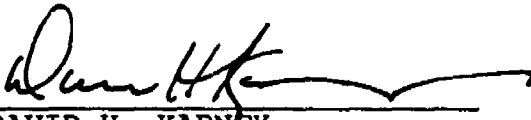
DAVID H. KARNEY
Colonel, MC, SFS
Commanding

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

1a. REPORT SECURITY CLASSIFICATION UNCLASSIFIED			1b. RESTRICTIVE MARKINGS		
2a. SECURITY CLASSIFICATION AUTHORITY			3. DISTRIBUTION/AVAILABILITY OF REPORT Approved for public release, distribution unlimited		
2b. DECLASSIFICATION/DOWNGRADING SCHEDULE					
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 92-12			5. MONITORING ORGANIZATION REPORT NUMBER(S)		
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory		6b. OFFICE SYMBOL (If applicable) SGRD-UAD-IE	7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Development Command		
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 577 Fort Rucker, AL 36362-5292			7b. ADDRESS (City, State, and ZIP Code) Fort Detrick Frederick, MD 21702-5012		
8a. NAME OF FUNDING/SPONSORING ORGANIZATION		8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER		
8c. ADDRESS (City, State, and ZIP Code)			10. SOURCE OF FUNDING NUMBERS		
			PROGRAM ELEMENT NO. 0603807A	PROJECT NO. 3M463807D8	TASK NO. 6 LC
					WORK UNIT ACCESSION NO. 201
11. TITLE (Include Security Classification) (U) Radiated Electric Field Measurements in U.S. Army Helicopters					
12. PERSONAL AUTHOR(S) James E. Bruckart					
13a. TYPE OF REPORT Final		13b. TIME COVERED FROM _____ TO _____		14. DATE OF REPORT (Year, Month, Day) 1992 February	
				15. PAGE COUNT 17	
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES			18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
			Electromagnetic interference, electric fields, medical equipment, EMI, EMC		
19. ABSTRACT (Continue on reverse if necessary and identify by block number)					
Aircraft systems and medical devices generate electromagnetic fields. Electromagnetic interference (EMI) can cause faulty operation of aircraft systems or medical devices and endanger patients or aircraft crewmembers. An in-flight study was conducted to describe the electromagnetic fields in typical operations with U.S. Army helicopters. Broadband isotropic field sensors measured electric fields from 5 kHz to 3 MHz, 3 to 500 MHz, and 0.5 MHz to 6 GHz. Fields were measured at 0.5 m intervals in JOH-58A, JUH-1H, and JUH-60A helicopters with systems off, operating RPM, 5-foot hover, 50-foot hover, and cruise. Environment electric fields were homogeneous and less than 0.1 V/m. Helicopter fields increased during ascent, but remained less than 2 V/m except during radio transmissions. EMI was demonstrated during FM radio transmission on the Physio Control Lifepak® 8. The results are useful in evaluating electromagnetic emissions from medical devices and predicting operations that may result in in-flight malfunction of a medical device.					
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT ☒ UNCLASSIFIED/UNLIMITED ☐ SAME AS RPT. ☐ DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION UNCLASSIFIED		
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Scientific Information Center			22b. TELEPHONE (Include Area Code) (205) 255-6907		22c. OFFICE SYMBOL SGRD-UAX-SI

Acknowledgment

The author would like to acknowledge the invaluable assistance of CPT Al Moran, Biomedical Engineer Officer, USAARL; and the research aviators of the U.S. Army Aeromedical Research Laboratory for their contributions to this report.

Table of contents

	Page
List of figures.....	2
List of tables.....	2
Introduction.....	3
Background.....	3
Materials and methods.....	6
Equipment.....	6
Environment grid.....	7
Aircraft grids.....	7
Phases of flight.....	9
Power density errors.....	9
Results.....	10
Discussion.....	12
Conclusions.....	14
References.....	15
Appendix A. Aircraft radio equipment list.....	16
Appendix B. List of manufacturers.....	17
Distribution list.....	18



Accession For	
NTIS GRA&I	☒
DTIC TAB	☐
Unannounced	☐
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

List of figures

Figure	Page
1. Electromagnetic frequency spectrum.....	4
2. Comparison of health and HERO limits.....	6
3. JOH-58A helicopter grid reference.....	7
4. JUH-1H helicopter grid reference.....	8
5. JUH-60A helicopter grid reference.....	9
6. Measured electric field strength - 5 kHz to 3 MHz.....	11
7. Example of electromagnetic interference in an ECG monitor.....	13

List of tables

Table	Page
1. Conversion of field intensity measures.....	5
2. Range of environment electric field strengths.....	10
3. Electric field increase when transmitter keyed.....	11

Introduction

Aircraft systems and medical devices generate electromagnetic fields and are sensitive to interference from electrical fields found throughout the environment. The sudden failure or faulty operation of an aircraft system or medical device due to electromagnetic interference (EMI) can endanger the lives of patients or aircraft crewmembers.

This report describes a study to evaluate the electromagnetic fields found during typical operations in U.S. Army helicopters. This information can be used to identify operations and positions in the aircraft where interference between medical equipment and aircraft systems is likely to be encountered.

Background

The electromagnetic spectrum extends from the extremely short cosmic rays with wavelengths of 10^{-16} m to long radio waves that are several kilometers in length. The portion of the spectrum from 1 to 300 MHz shown in Figure 1 is of particular concern because this is the area of greatest sensitivity for aircraft wiring and medical equipment. Radio frequency noise is inefficiently received on a wire below 1 MHz and the induced voltages from noise above 300 MHz is reduced (Clarke, 1986).

Electromagnetic interference in aircraft comes from a variety of sources: (1) Transmitters of radio frequencies, including those on the aircraft for HF, UHF, or VHF communication and those on the ground for FM radio or VHF television broadcasts, (2) aircraft power line (400 Hz) electrical and magnetic fields, (3) computer and avionics timing and control circuits that generate radio frequencies of 1 MHz or higher, (4) aircraft power regulators, (5) electrical switching transients from turning on and off aircraft lights, fans, or flaps, and (6) electrostatic discharges including lightning. These transients and electromagnetic waves may transfer into wiring and cause electromagnetic interference to other aircraft systems or medical equipment used in the aircraft (Clarke, 1986).

Over 50 years ago, the U.S. Army discovered the ignition systems of military vehicles interfered with communication receivers and began setting standards for the measurement and suppression of electromagnetic interference. Currently, U.S. Government equipment for procurement is tested for electromagnetic compatibility in accordance with standards established by MIL-STD-461C, "Electromagnetic emission and susceptibility requirements for the control of electromagnetic interference" and MIL-STD-462, "Electromagnetic Interference Characteristics, Measurement of," (Bronaugh and Lambdin, 1988).

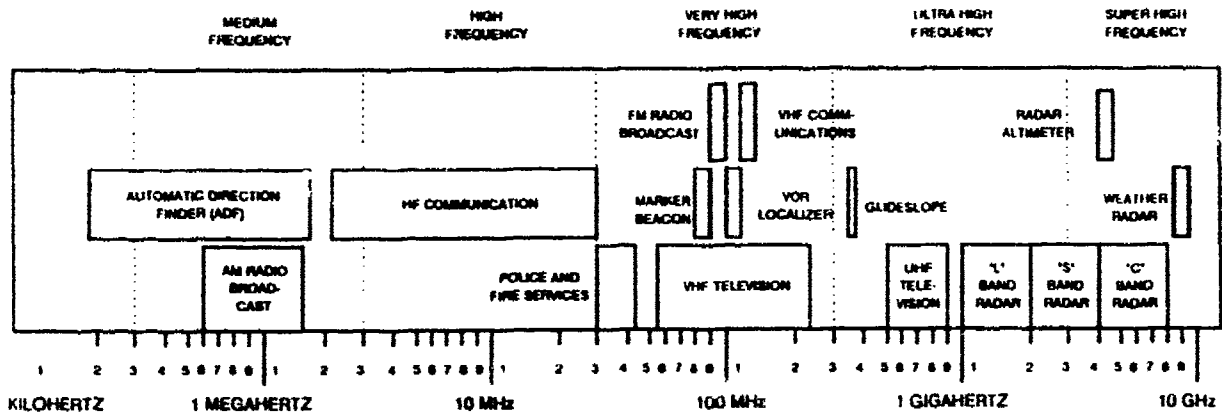


Figure 1. Electromagnetic frequency spectrum.

Another area of concern is the hazards of electromagnetic radiation to personnel (HEHP). The rationale for determining the radio frequency (RF) limits for human exposure is based on the body heating effects. Research is being done to define the possible effects of low-level electrical fields on health. The current American National Standards Institute (ANSI) standard is based on the specific absorption rate (SAR), which is the rate of energy absorption per mass of tissue. The SAR depends on the density of the tissue, tissue conductivity, and magnitude of the electrical field in the tissue. The ANSI standard is based on an average SAR limit of 0.4 W/kg, which is 1/10 the value thought to be the threshold of adverse affects. The current military standard is the same as the ANSI limits with the exception of 5 mW/cm² relaxed level above 1 GHz for military operations. Electric fields usually are measured in milliwatts per centimeter square for human exposure studies and volts per meter for electromagnetic compatibility (EMC) work. Table 1 provides a rapid conversion scale where free space impedance is 377 ohms.

Table 1.

Conversion of field intensity measures.

<u>mW/cm²</u>	<u>V/m</u>
1	61.4
2	86.8
5	137.3
10	194.2
20	274.5
100	614.0

A rough idea of the magnitude of these levels can be gained by comparing the energy of the sun's radiation at the earth's surface which is approximately 100 mW/cm² to the microwave radar on an aircraft carrier that produces electromagnetic fields of 26,500 mW/cm².

Energy that is dangerous to human health also can be detrimental to certain weapon systems and associated equipment. Radiated fields can cause dudding or premature actuation of sensitive electrically initiated explosive elements. Ordnance may be more sensitive than humans because there is no mechanism to dissipate internal heat among the electrical circuits. Operations that involve fuel handling near a transmitting antenna also may prove hazardous if an induced spark ignites the fuel-air mixture. As a result, RF field limits due to the Hazards of Electromagnetic Radiation to Ordnance (HERO) or Fuel (HERF) are lower than the human exposure limits. The ANSI human exposure limit and HERO limits are detailed in Figure 2 (Barge, 1989).

The U.S. Army program for testing and evaluation of equipment for aeromedical operations has been established to test and evaluate medical equipment for in-flight use aboard Army medical evacuation (MEDEVAC) and military assistance to safety and traffic (MAST) aircraft. Each medical device is evaluated to determine its compatibility and performance in various temperature, altitude, and humidity environments. In addition, the medical device is tested to determine its maximum levels of electromagnetic emissions and the minimum levels of electromagnetic interference to which the item is susceptible. Each item is also evaluated to discover human factors problems that may be exacerbated in aviation medical service (Mitchell and Adams, 1988).

This study was initiated to identify the actual electric field strengths typically encountered in U.S. Army helicopters during various modes of operation. This information will assist future in-flight evaluations of medical devices by clarifying flight profiles and aircraft systems where most EMI problems are likely to be encountered. Persons using medical equipment in MEDEVAC operations also may benefit by recognizing the conditions

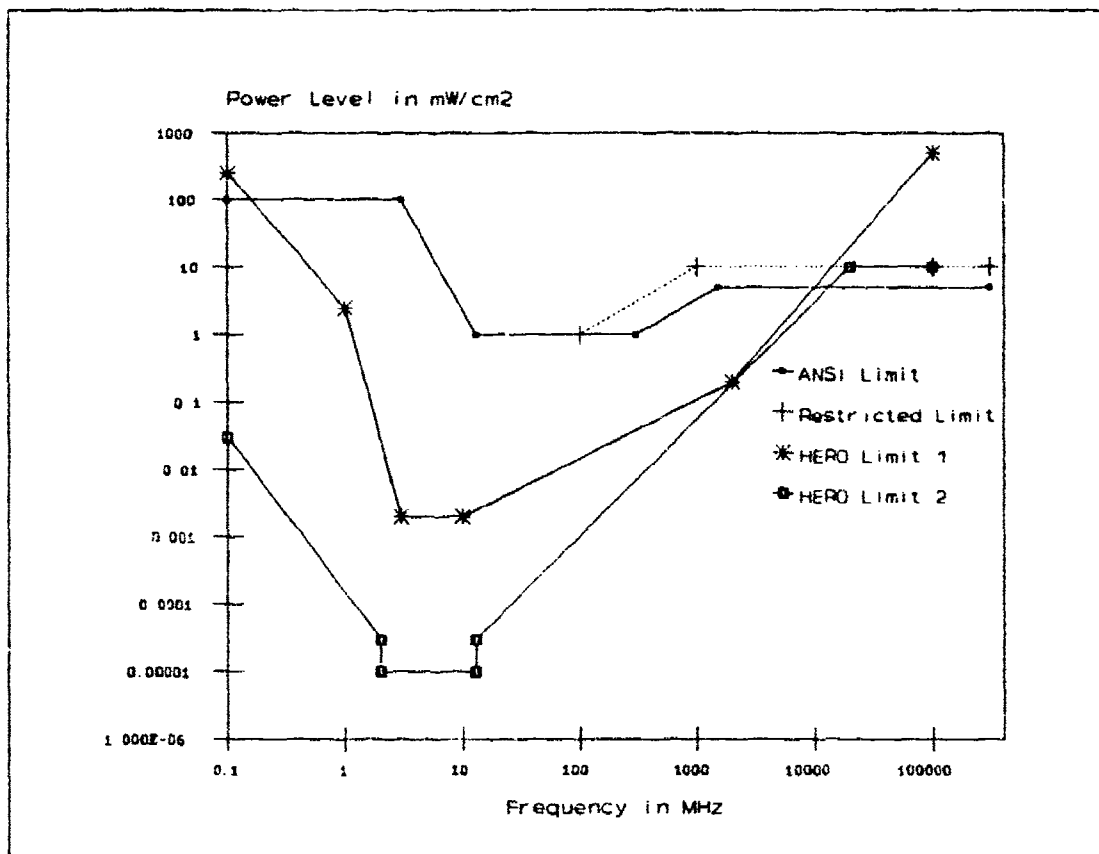


Figure 2. Comparison of health and HERO limits.

that contribute to electromagnetic interference and result in sudden failure of a medical device.

Materials and methods

Equipment

An Aeritalia electric and magnetic field sensor system, type SB08, was used to measure broadband electric fields from 5 kHz to 500 MHz in two frequency bands. This system includes the Aeritalia model TE 307 monitor* and 19R1001-2 isotropic field sensor* used to measure electric field strength in the 5 kHz to 3 MHz frequency band and the TE 307 and 13R1001-1 isotropic field sensor used to measure electric field strength in the 3 to 500 MHz frequency band. A Holaday model HI-3001 Isotropic Broadband Field Strength Meter* was used with the red electric field probe to measure electric field strength from 0.5 MHz to 6 GHz.

* See Appendix B.

Environment grid

A tape measure and chalk were used to draw an 8 by 8 meter grid marked in 0.5 meter increments on the helipad at the U.S. Army Aeromedical Research Laboratory (USAARL), Fort Rucker, Alabama. Vertical increments from the ground to 2.5 meters height were judged by using a ladder and plumb line marked with 0.5-meter increments. Electric field strengths were measured using each of the three probe systems at each 0.5 meter horizontal and vertical point in the environment grid for the initial environment monitoring. Subsequent environment monitoring on the helipad was done with a 1 meter increment within the confines of the original 8 x 8 x 2.5 meter grid.

Aircraft grids

A 0.5 meter increment grid was drawn in the passenger compartment of the JOH-58A helicopter, SN 71-20778. The right front corner of the passenger seat was designated as the grid reference point and the front edge of the seat the horizontal reference line. Vertical increments of 0.5 meters yielded 33 data points in the passenger area of the JOH-58A helicopter. Figure 3 shows the grid drawn in the JOH-58A aircraft cabin oriented in the 8 x 8 m environment grid. Appendix A shows the aircraft equipment list at the time of testing.

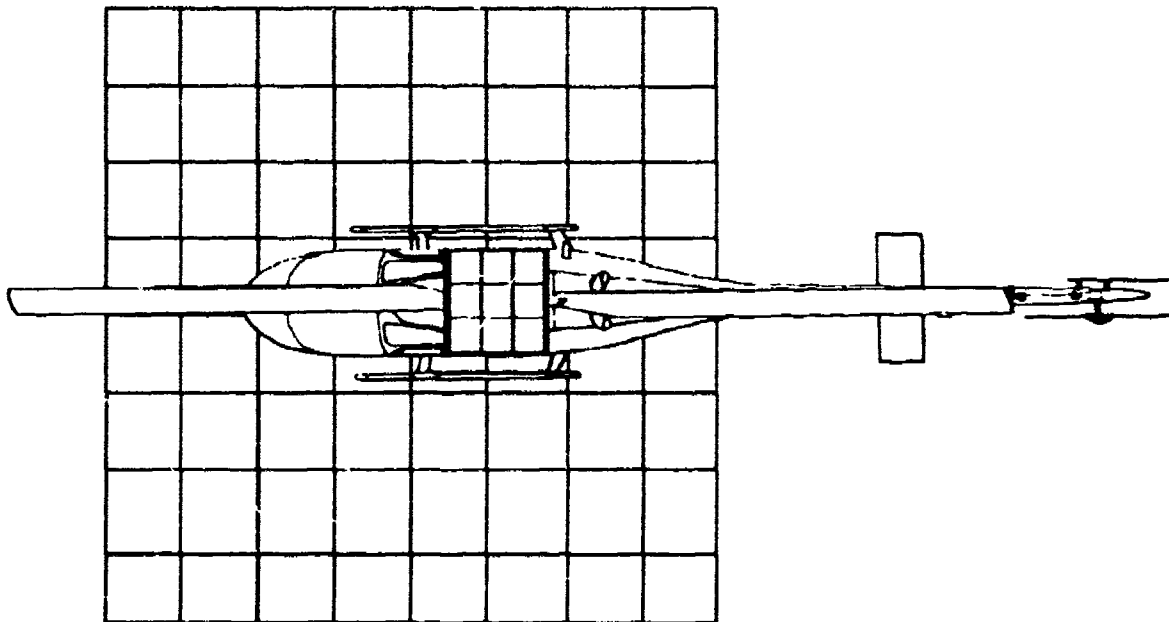


Figure 3. JOH-58A helicopter grid reference.

A 0.5 meter increment grid was drawn in the passenger compartment of the JUH-1H helicopter, SN 71-20033. The right front corner of the transmission housing at the floor was designated as the grid reference point and the front edge of the transmission the horizontal reference line. Vertical increments of 0.5 meters yielded 84 data points in the passenger area of the JUH-1H helicopter. Figure 4 shows the grid in the JUH-1H aircraft cabin oriented in the 8 x 8 m environment grid. Appendix A shows the aircraft equipment list at the time of testing.

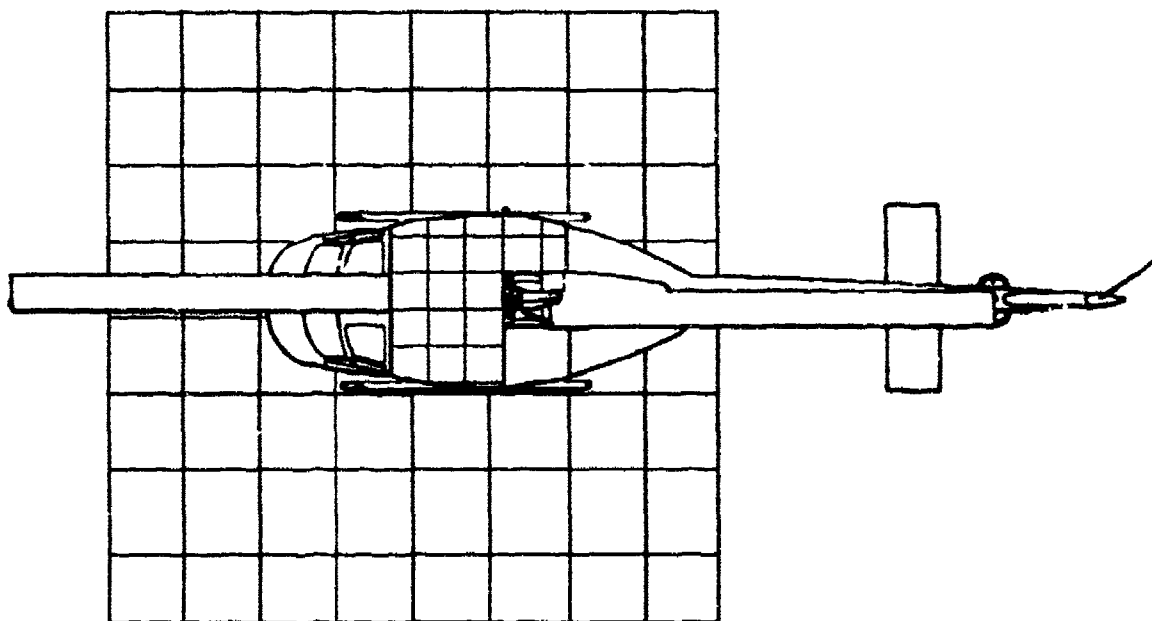


Figure 4. JUH-1H helicopter grid reference.

A 0.5 meter increment grid was drawn in the passenger compartment of the JUH-60A helicopter, SN 88-26069. The right rear corner of the cargo compartment was designated as the grid reference point and the back wall of the cargo area formed the horizontal reference line. The patient evacuation carousel in the fore-aft position prevented measurement along the aircraft midline. Vertical increments of 0.5 meters yielded 112 data points in the passenger area of the JUH-60A helicopter. Figure 5 shows the grid drawn in the JUH-60A aircraft cabin oriented in the 8 x 8 m environment grid. Appendix A shows the aircraft equipment list at the time of testing.

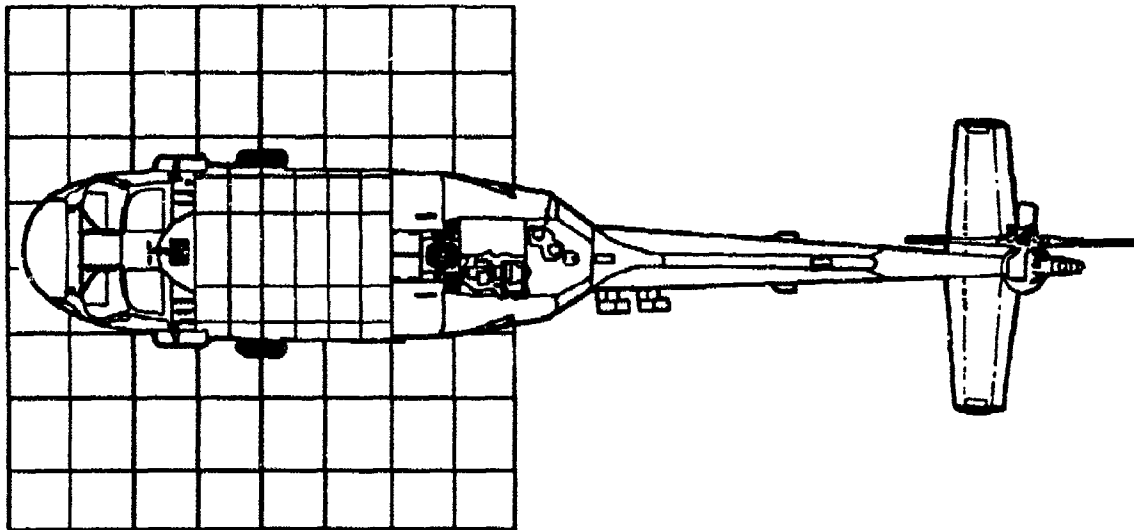


Figure 5. JUH-60A helicopter grid reference.

Phases of flight

The electric field strength at each data point was measured for each test aircraft in various modes of operation. These included sitting on the ground with the engine and all equipment turned off, sitting on the ground with navigation and communication equipment on, and operating rotor RPM, 5-foot hover, 50-foot hover, and cruise flight. A second flight was performed in the JUH-1H aircraft to determine the variability in measurements for the same aircraft on two different flights.

Power density errors

The ability of an electromagnetic field to cause a medical device to fail is determined by the power density in the field. The power flux flow or power density (P_0) is measured in watts per square meter and determined by the interaction of the electric field and magnetic field intensity.

$$P_0 = E \times H$$

where,

E = electric field intensity in volts per meter

H = magnetic field intensity in amps per meter

The electric and magnetic field intensities are related by the wave impedance Z in ohms:

$$Z = E/H$$

For electromagnetic fields measured far from the radiation source, the electric and magnetic fields are related by 377Ω . These fields are designated as far fields, but such a relation does not exist close to the object generating the fields. In the near field, the wave impedance is determined by both electric and magnetic fields. The power density in a high impedance field, such as a low current through a monopole antenna, is predominantly the electric field component. In a low impedance field, such as high current through an electric motor, the magnetic field component predominates and electric field strength measurements would be expected to underestimate the power density (Duff, 1988).

Results

The strength of the electric fields for the 5 kHz to 3 MHz band is presented for each aircraft and phase of flight in Figure 6. The electric fields measured in the 3 to 500 MHz band averaged less than .02 V/m in the JOH-58A helicopter and 0 for all phases of flight and locations within the JUH-1H and JUH-60A aircraft. No electric fields were detected with the 0.5 MHz to 6 GHz broadband receiver in the environment or during aircraft operations. All electric field measurements repeated during a second flight in the JUH-1H helicopter were within one standard deviation of the measurements recorded on the initial flight.

The environmental field strength did not change significantly among the different aircraft testing days as shown in Table 2. In addition, there was no specific area within the passenger compartment of any aircraft where greater than average electric field strengths were measured in each phase of flight.

Table 2.

Range of environment electric field strengths (5 kHz to 3 MHz).

Date	Average strength (V/m)	Standard deviation (V/m)
21 Aug 91	.075	.029
4 Sep 91	.078	.030
27 Sep 91	.069	.025

The strongest electric fields were measured when FM, UHF, or VHF transmitters were keyed. These frequently resulted in measurements exceeding the capacity of the sensor (>100 V/m) in the 5 kHz to 3 MHz band as detailed in Table 3.

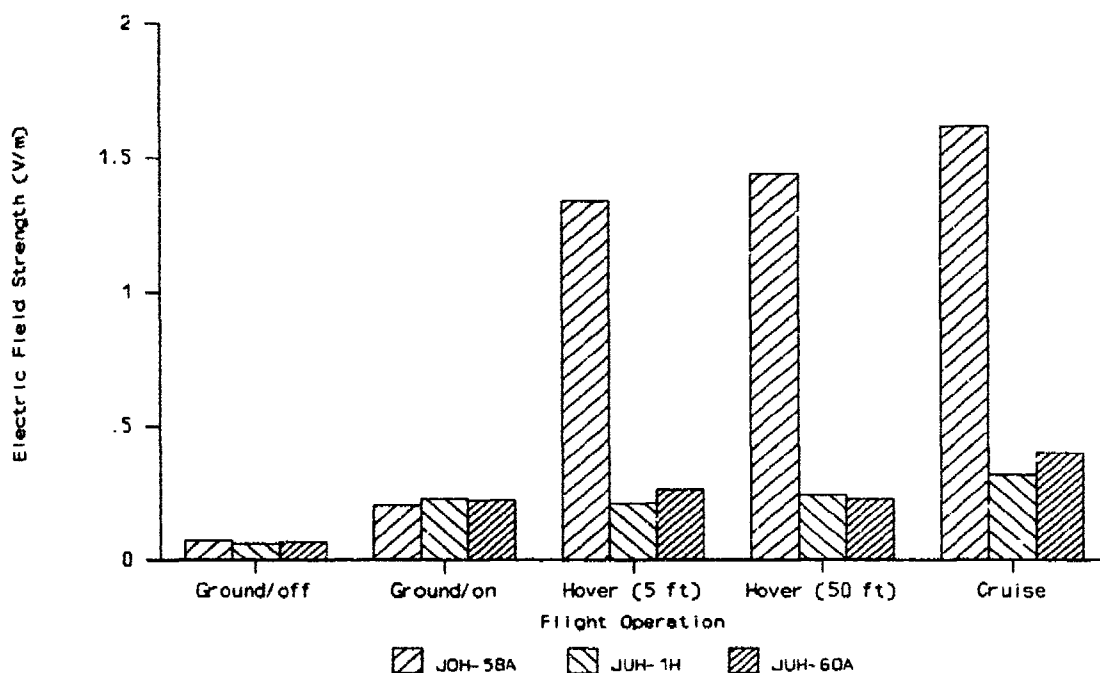


Figure 6. Measured electric field strength - 5 kHz to 3 MHz.

Table 3.

Electric field increase when transmitter keyed (V/m).

Radio	Aircraft	0.5 kHz-3 MHz	3-500 MHz
FM	JOH-58	0	0
	JUH-1H	0.2	1.2
	JUH-60	0	0
VHF	JOH-58	10.0	0.3
	JUH-1H	>100.0**	2.9
	JUH-60	.2	0
UHF	JOH-58	>100.0**	2.5
	JUH-1H	>100.0**	5.4
	JUH-60	>100.0**	1.0

** Measurement exceeds the maximum reading for the sensor.

Discussion

The electric fields encountered in the environment were very low and homogeneous among the days tested. This is consistent with rural levels of less than .1 V/m and much less than levels of 20 V/m described by Clarke (1986) near high power broadcast stations. By the year 2000, Larsen (1988) predicts that worst case environmental fields can reach 1000 V/m in the ultra-high frequency band.

The greatest electric fields measured in this study were present in the 5 kHz to 3 MHz range when the aircraft transmitters were keyed. The FM transmitters operate in the range of 30 to 75.95 MHz, the VHF radio transmits at 116.0 to 149.975 MHz, and the UHF radio transmits at 225.0 to 399.9 MHz. These radio transmitters produce a strong electric field (10 to 15 watts power output) within a narrow frequency band. A narrowband emission may not contribute significantly to a broadband signal, but harmonics produced by the emission may cause high readings in sensitive receivers. The receiver selectivity determines the amount of attenuation or rejection provided to off-tuned signals by the receiver (Duff, 1988). In this case, the lower frequency band sensor-receiver system is not able to attenuate the communication transmissions. The electric fields caused by off-tuned narrowband signals and harmonics do not have the same potential to cause interference in the frequency band because they do not produce the same power flux as a primary field.


Several trends were noted in the measured electric fields of the helicopters tested. First, no specific area in any helicopter was found to have higher electric field strength in all operations. The homogeneity of the electric fields suggests that the in-flight testing of medical devices does not require a special test location to simulate the worst case. Second, the electric fields measured in the aircraft increased in intensity when aircraft systems and the engine operate. This suggests that some fields result from operation of the engine and generators in the aircraft. Third, the electric field measurements increase in intensity as the aircraft climbs. Since the monitored frequency bands include commercial broadcast and line-of-sight VHF communication frequencies, the aircraft is exposed to a stronger environmental electrical field at 1500-foot cruising altitude than on the ground.

Medical devices are tested in the laboratory at USAARL to determine their susceptibility to radiated emissions, as specified in MIL-STD-462, Notice 3, Method RS03. This involves observing the device for malfunctions while exposed to narrowband electromagnetic fields of 1 V/m from 10 kHz to 2 MHz, 5 V/m from 2 to 30 MHz, 10 V/m from 30 MHz to 2 GHz, and 5 V/m from 2 to 10 GHz.

The Physio-Control LIFEPAK® 8 monitor/defibrillator* has been evaluated in the laboratory and found susceptible to radiated emissions. Evidence of susceptibility included service alerts and erratic monitor displays and recordings. The frequency and electric field strengths where malfunctions occurred are listed below.

<u>Frequency range</u>	<u>Minimum field causing malfunction</u>
20 MHz - 20.8 MHz	1.50 - 2.00 V/m
30 MHz - 40.2 MHz	0.84 - 3.77 V/m

The LIFEPAK® 8 monitor was operated in the passenger compartment of the JOH-58A and JUH-1H helicopters with a test signal from a Valmet ECG Simulator*. When the FM transmitter was keyed (34.75 MHz), the electrocardiograph (ECG) baseline changed as noted in Figure 7. There was no change in the ECG signal when VHF or UHF transmitters were keyed. There was no interference when the LIFEPAK® 8 was tested in the JUH-60A helicopter. This example of electromagnetic interference in the LIFEPAK® 8 supports the laboratory's finding of radiated electric field susceptibility within the FM broadcast band, but not in VHF or UHF transmission bands for the device (Haun et al, 1991).

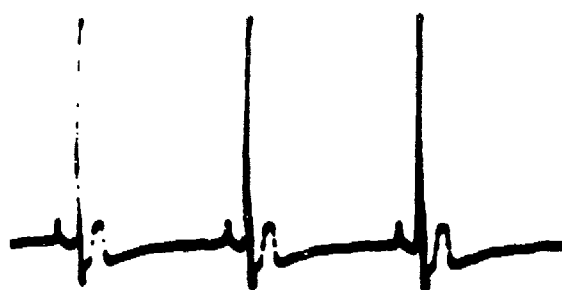

Normal ECG tracing



ECG tracing during FM transmission

Figure 7. Example of electromagnetic interference in an ECG monitor.

This study examined broadband radiated electric fields measured in U.S. Army helicopters. Narrowband radiated emissions or current conducted through a medical device's power cables or case also may cause the device to malfunction or fail. Each aircraft system and medical device must be checked to ensure electromagnetic compatibility.

Conclusions

The electric fields measured in this study were homogeneous and averaged less than 0.1 V/m in the ground environment. Electric fields measured in the aircraft were homogeneous and averaged less than 2 V/m except during aircraft radio transmissions. Electric fields increased in intensity as the helicopter climbed. This is most likely a result of increased exposure to commercial broadcast and other aircraft transmissions.

When the aircraft transmitted on FM, VHF, or UHF radios, the measurements in the 5 kHz to 3 MHz frequency band frequently exceeded the capacity of the receiver. This resulted from penetration of the higher frequency transmission signal and did not correlate with higher field strength when a medical device was introduced into the test environment.

The Physio Control LIFEPAK® 8 defibrillator/monitor showed a performance decrement when the JOH-58 or JUH-1H helicopter transmitted in the FM frequency band, but not during VHF or UHF transmissions. This correlates with the laboratory test findings for this device and models the electromagnetic interference that may be seen in operation aboard medical evacuation aircraft.

The electric field strengths measured in these aircraft and operating conditions may not be valid in other aircraft or flight areas. Narrowband emissions also must be considered since they can interfere with operation of medical devices. Tests to determine the susceptibility profile of a medical device and information about the electromagnetic fields in the operating area and aircraft are useful in predicting the potential for radiated field interference.

References

- Barge, J.M. 1989. Warning: RADHAZ! EMC technology. May-June: 21-27.
- Bronaugh, E. L., and Lambdin, W. S. 1988. Electromagnetic interference test methodology and procedures, volume 6. Gainesville, VA: Interference Control Technologies, Inc.
- Clarke, C. A. 1986. Avionics electromagnetic interference immunity and environment. In Proceedings - IEEE/AIAA 7th Digital Avionics Systems Conference. 633-40. Fort Worth, TX.
- Department of Defense. 1986. Electromagnetic emission and susceptibility requirements for the control of electromagnetic interference. Washington, D.C. MIL-STD-461C, Notice 2. August.
- Department of Defense. 1971. EMI characteristics, measurement of. Washington, D.C. MIL-STD-462, Notice 3. February.
- Duff, W. G. 1988. Fundamentals of electromagnetic compatibility, volume 1. Gainesville, VA: Interference Control Technologies, Inc.
- Haun, J. D., Licina, J. R., Olding, B., and Quattlebaum, M. 1991. Test and evaluation report of the Physio Control defibrillator/monitor, model LifePak 8. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. In press.
- Larsen, W. E. 1988. Digital avionics susceptibility to high energy radio frequency fields. In Proceedings of the IEEE National Aerospace and Electronics Conference. Volume 3, 1098-1107. Dayton, OH.
- Mitchell, G. W., and Adams, J. E. 1988. Technical test and evaluation of aeromedical equipment. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL Letter Report LR-88-16-1-2.
- Physio Control. 1987. Operating instructions, LIFEPAK® 8 monitor defibrillator. Redmond, WA.

Appendix A.

Aircraft radio equipment list

JUH-1H, SN 71-2003

Item	Description
ARC-51	UHF radio set
ARC 54	VHF-FM transmitter/receiver
AN/ARC-115	VHF-AM transmitter/receiver (VHF-AM and FM radio)
AN/ARC-83	ADF receiver
APX-72	Transponder

JOH-58A, SN 71-20778

Item	Description
AN/ARC-114	VHF-FM transmitter/receiver
AN/ARC-116	UHF radio set
AN/ARC-186	VHF-AM transmitter/receiver (VHF-AM and FM radio)
AN/ARN-89	ADF receiver
APX-72	Transponder

JUH-60A, SN 88-26029

Item	Description
AN/ARC-164	UHF radio set
AN/ARC-186	VHF-AM transmitter/receiver (VHF-AM and FM radio)
AN/ARN-89	ADF receiver
APN-209	Radar altimeter transmitter/receiver
APX-100	Transponder
ASN-128	Doppler navigation system

Appendix B.

List of Manufacturers

1. Amplifier Research, Aeritalia-Avionics
160 School House Road
Sounderton, PA 18934-9990
2. Holaday Industries, Inc.
14825 Martin Drive
Eden Prairie, MN 55344
3. Physio Control Corporation
11811 Willows Road N.E.
Redmond, WA 98052-1013
4. Valmedix ECG Simulator
32303 Howard Street
Madison Heights, MI 48071

Initial distribution

Commander, U.S. Army Natick Research,
Development and Evaluation Center
ATTN: STRNC-MIL (Documents
Librarian)
Natick, MA 01760-5040

Col. Otto Schramm Filho
c/o Brazilian Army Commission
Office-CEBW
4632 Wisconsin Avenue NW
Washington, DC 20016

Commander/Director
U.S. Army Combat Surveillance
and Target Acquisition Lab
ATTN: DELCS-D
Fort Monmouth, NJ 07703-5304

Commander
10th Medical Laboratory
ATTN: Audiologist
APO New York 09180

Naval Air Development Center
Technical Information Division
Technical Support Detachment
Warminster, PA 18974

Commanding Officer, Naval Medical
Research and Development Command
National Naval Medical Center
Bethesda, MD 20814-5044

Deputy Director, Defense Research
and Engineering
ATTN: Military Assistant
for Medical and Life Sciences
Washington, DC 20301-3080

Commander, U.S. Army Research
Institute of Environmental Medicine
Natick, MA 01760

U.S. Army Avionics Research
and Development Activity
ATTN: SAVAA-P-TP
Fort Monmouth, NJ 07703-5401

U.S. Army Communications-Electronics
Command
ATTN: AMSEL-RD-ESA-D
Fort Monmouth, NJ 07703

Library
Naval Submarine Medical Research Lab
Box 900, Naval Sub Base
Groton, CT 06349-5900

Commander
Man-Machine Integration System
Code 602
Naval Air Development Center
Warminster, PA 18974

Commander
Naval Air Development Center
ATTN: Code 602-B (Mr. Brindle)
Warminster, PA 18974

Commanding Officer
Harry G. Armstrong Aerospace
Medical Research Laboratory
Wright-Patterson
Air Force Base, OH 45433

Director
Army Audiology and Speech Center
Walter Reed Army Medical Center
Washington, DC 20307-5001

Commander, U.S. Army Institute
of Dental Research
ATTN: Jean A. Setterstrom, Ph. D.
Walter Reed Army Medical Center
Washington, DC 20307-5300

Naval Air Systems Command
Technical Air Library 950D
Room 278, Jefferson Plaza II
Department of the Navy
Washington, DC 20361

Director, U.S. Army Human
Engineering Laboratory
ATTN: Technical Library
Aberdeen Proving Ground, MD 21005

Commander, U.S. Army Test
and Evaluation Command
ATTN: AMSTE-AD-H
Aberdeen Proving Ground, MD 21005

Director
U.S. Army Ballistic
Research Laboratory
ATTN: DRXBR-OD-ST Tech Reports
Aberdeen Proving Ground, MD 21005

Commander
U.S. Army Medical Research
Institute of Chemical Defense
ATTN: SGRD-UV-AO
Aberdeen Proving Ground,
MD 21010-5425

Commander, U.S. Army Medical
Research and Development Command
ATTN: SGRD-RMS (Ms. Madigan)
Fort Detrick, Frederick, MD 21702-5012

Director
Walter Reed Army Institute of Research
Washington, DC 20307-5100

HQ DA (DASG-PSP-O)
5109 Leesburg Pike
Falls Church, VA 22041-3258

Harry Diamond Laboratories
ATTN: Technical Information Branch
2800 Powder Mill Road
Adelphi, MD 20783-1197

U.S. Army Materiel Systems
Analysis Agency
ATTN: AMXS-PA (Reports Processing)
Aberdeen Proving Ground
MD 21005-5071

U.S. Army Ordnance Center
and School Library
Simpson Hall, Building 3071
Aberdeen Proving Ground, MD 21005

U.S. Army Environmental
Hygiene Agency
Building E2100
Aberdeen Proving Ground, MD 21010

Technical Library Chemical Research
and Development Center
Aberdeen Proving Ground, MD
21010-5423

Commander
U.S. Army Medical Research
Institute of Infectious Disease
SGRD-UIZ-C
Fort Detrick, Frederick, MD 21702

Director, Biological
Sciences Division
Office of Naval Research
600 North Quincy Street
Arlington, VA 22217

Commander
U.S. Army Materiel Command
ATTN: AMCDE-XS
5001 Eisenhower Avenue
Alexandria, VA 22333

Commandant
U.S. Army Aviation
Logistics School ATTN: ATSQ-TDN
Fort Eustis, VA 23604

Headquarters (ATMD)
U.S. Army Training
and Doctrine Command
ATTN: ATBO-M
Fort Monroe, VA 23651

Structures Laboratory Library
USARTL-AVSCOM
NASA Langley Research Center
Mail Stop 266
Hampton, VA 23665

Naval Aerospace Medical
Institute Library
Building 1953, Code 03L
Pensacola, FL 32508-5600

Command Surgeon
HQ USCENTCOM (CCSG)
U.S. Central Command
MacDill Air Force Base FL 33608

Air University Library
(AUL/LSE)
Maxwell Air Force Base, AL 36112

U.S. Air Force Institute
of Technology (AFTT/LDEE)
Building 640, Area B
Wright-Patterson
Air Force Base, OH 45433

Henry L. Taylor
Director, Institute of Aviation
University of Illinois-Willard Airport
Savoy, IL 61874

Chief, Nation Guard Bureau
ATTN: NGB-ARS (COL Urbauer)
Room 410, Park Center 4
4501 Ford Avenue
Alexandria, VA 22302-1451

Commander
U.S. Army Aviation Systems Command
ATTN: SGRD-UAX-AL (MAJ Gillette)
4300 Goodfellow Blvd., Building 105
St. Louis, MO 63120

U.S. Army Aviation Systems Command
Library and Information Center Branch
ATTN: AMSAV-DIL
4300 Goodfellow Boulevard
St. Louis, MO 63120

Federal Aviation Administration
Civil Aeromedical Institute
Library AAM-400A
P.O. Box 25082
Oklahoma City, OK 73125

Commander
U.S. Army Academy
of Health Sciences
ATTN: Library
Fort Sam Houston, TX 78234

Commander
U.S. Army Institute of Surgical Research
ATTN: SGRD-USM (Jan Duke)
Fort Sam Houston, TX 78234-6200

AAMRL/HEX
Wright-Patterson
Air Force Base, OH 45433

John A. Dellinger,
Southwest Research Institute
P. O. Box 28510
San Antonio, TX 78284

Product Manager
Aviation Life Support Equipment
ATTN: AMCPM-ALSE
4300 Goodfellow Boulevard
St. Louis, MO 63120-1798

Commander
U.S. Army Aviation
Systems Command
ATTN: AMSAV-ED
4300 Goodfellow Boulevard
St. Louis, MO 63120

Commanding Officer
Naval Biodynamics Laboratory
P.O. Box 24907
New Orleans, LA 70189-0407

Assistant Commandant
U.S. Army Field Artillery School
ATTN: Morris Swott Technical Library
Fort Sill, OK 73503-0312

Commander
U.S. Army Health Services Command
ATTN: HSOP-SO
Fort Sam Houston, TX 78234-6000

HQ USAF/SGPT
Bolling Air Force Base, DC 20332-6188

U.S. Army Dugway Proving Ground
Technical Library, Building 5330
Dugway, UT 84022

U.S. Army Yuma Proving Ground
Technical Library
Yuma, AZ 85364

AFFTC Technical Library
6510 TW/TSTL
Edwards Air Force Base,
CA 93523-5000

Commander
Code 3431
Naval Weapons Center
China Lake, CA 93555

Aeromechanics Laboratory
U.S. Army Research and Technical Labs
Ames Research Center, M/S 215-1
Moffett Field, CA 94035

Sixth U.S. Army
ATTN: SMA
Presidio of San Francisco, CA 94129

Commander
U.S. Army Aeromedical Center
Fort Rucker, AL 36362

U.S. Air Force School
of Aerospace Medicine
Strughold Aeromedical Library Technical
Reports Section (TSKD)
Brooks Air Force Base, TX 78235-5301

Dr. Diane Damos
Department of Human Factors
ISSM, USC
Los Angeles, CA 90089-0021

U.S. Army White Sands
Missile Range
ATTN: STEWS-IM-ST
White Sands Missile Range, NM 88002

U.S. Army Aviation Engineering
Flight Activity
ATTN: SAVTE-M (Tech Lib) Stop 217
Edwards Air Force Base, CA 93523-5000

Ms. Sandra G. Hart
Ames Research Center
MS 262-3
Moffett Field, CA 94035

Commander, Letterman Army Institute
of Research
ATTN: Medical Research Library
Presidio of San Francisco, CA 94129

Commander
U.S. Army Medical Materiel
Development Activity
Fort Detrick, Frederick, MD 21702-5009

Commander
U.S. Army Aviation Center
Directorate of Combat Developments
Building 507
Fort Rucker, AL 36362

U. S. Army Research Institute
Aviation R&D Activity
ATTN: PERI-IR
Fort Rucker, AL 36362

Commander
U.S. Army Safety Center
Fort Rucker, AL 36362

U.S. Army Aircraft Development
Test Activity
ATTN: STEBG-MP-P
Cairns Army Air Field
Fort Rucker, AL 36362

Commander U.S. Army Medical Research
and Development Command
ATTN: SGRD-PLC (COL Sedge)
Fort Detrick, Frederick, MD 21702

MAJ John Wilson
TRADOC Aviation LO
Embassy of the United States
APO New York 09777

Netherlands Army Liaison Office
Building 602
Fort Rucker, AL 36362

British Army Liaison Office
Building 602
Fort Rucker, AL 36362

Italian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Directorate of Training Development
Building 502
Fort Rucker, AL 36362

Chief
USAHEL/USAAVNC Field Office
P. O. Box 716
Fort Rucker, AL 36362-5349

Commander U.S. Army Aviation Center
and Fort Rucker
ATTN: ATZQ-CG
Fort Rucker, AL 36362

Commander/President
TEXCOM Aviation Board
Cairns Army Air Field
Fort Rucker, AL 36362

MAJ Terry Newman
Canadian Army Liaison Office
Building 602
Fort Rucker, AL 36362

German Army Liaison Office
Building 602
Fort Rucker, AL 36362

LTC Patrice Cottebrune
French Army Liaison Office
USAAVNC (Building 602)
Fort Rucker, AL 36362-5021

Australian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Dr. Garrison Rapmund
6 Burning Tree Court
Bethesda, MD 20817

Commandant Royal Air Force
Institute of Aviation Medicine
Farnborough Hampshire GU14 6SZ UK

Commander
U.S. Army Biomedical Research
and Development Laboratory
ATTN: SGRD-UBZ-J
Fort Detrick, Frederick, MD 21702

Defense Technical Information Center
Cameron Station
Alexandra, VA 22313

Commander, U.S. Army Foreign Science
and Technology Center
AIFRTA (Davis)
220 7th Street, NE
Charlottesville, VA 22901-5396

Director,
Applied Technology Laboratory
USARTL-AVSCOM
ATTN: Library, Building 401
Fort Eustis, VA 23604

U.S. Air Force Armament
Development and Test Center
Eglin Air Force Base, FL 32542

Commander, U.S. Army Missile
Command
Redstone Scientific Information Center
ATTN: AMSMI-RD-CS-R
/ILL Documents
Redstone Arsenal, AL 35898

Dr. H. Dix Christensen
Bio-Medical Science Building, Room 753
Post Office Box 26901
Oklahoma City, OK 73190

U.S. Army Research and Technology
Laboratories (AVSCOM)
Propulsion Laboratory MS 302-2
NASA Lewis Research Center
Cleveland, OH 44135

Dr. Christine Schlichting
Behavioral Sciences Department
Box 900, NAVUBASE NLON
Groton, CT 06349-5900

COL Eugene S. Channing, O.D.
Brooke Army Medical Center
ATTN: HSHE-EAH-O
Fort Sam Houston, TX 78234-6200

LTC Gaylord Lindsey (5)
USAMRDC Liaison at Academy
of Health Sciences
ATTN: HSHA-ZAC-F
Fort Sam Houston, TX 78234

Aviation Medicine Clinic
TMC #22, SAAF
Fort Bragg, NC 28305

Dr. A. Kornfield, President
Biosearch Company
3016 Revere Road
Drexel Hill, PA 20926

NVEOD
AMSEL-RD-ASID
(Attn: Trang Bui)
Fort Belvoir, VA 22060