

AD-A109 965

NEW YORK STATE DEPT OF ENVIRONMENTAL CONSERVATION ALBANY F/6 13/13
NATIONAL DAM SAFETY PROGRAM. OTISCO LAKE DAM (INVENTORY NUMBER --ETC(U)
SEP 81 G KOCH

DACW51-79-C-0001


NL


UNCLASSIFIED

1 of 2

AD-A

500000

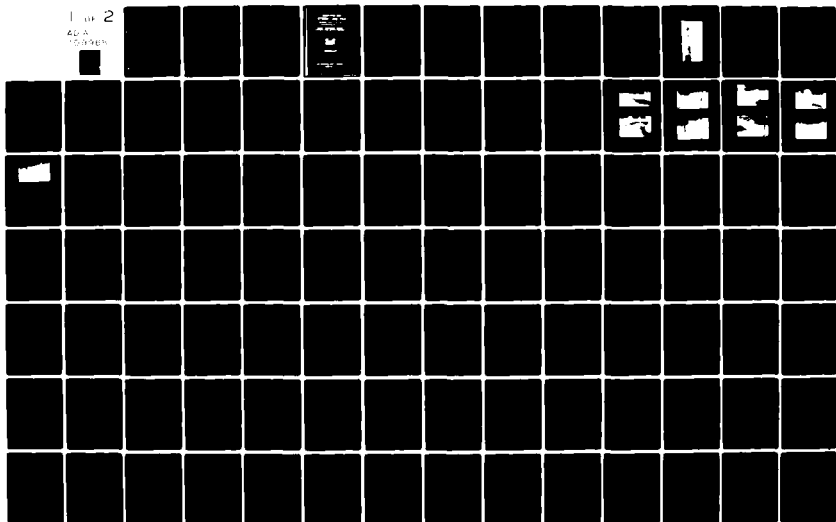

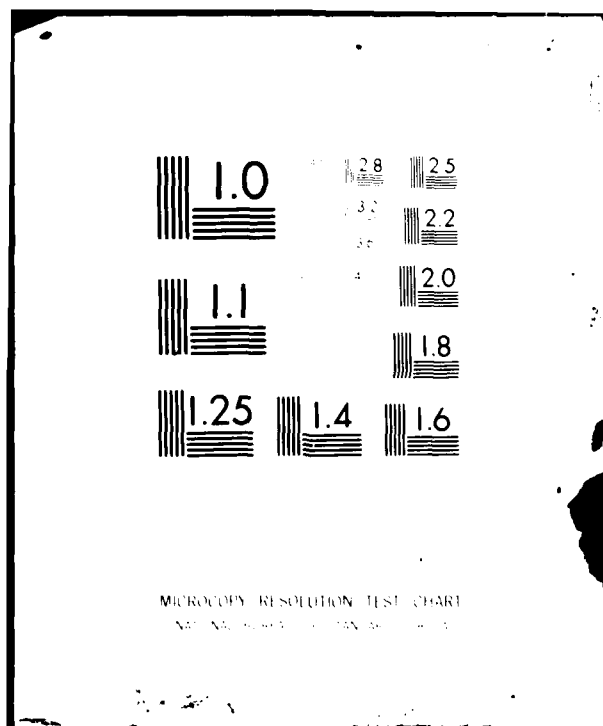

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
	AD-A109905	
4. TITLE (and Subtitle) Phase I Inspection Report Otisco Lake Dam, Oswego River Basin, Onondaga County, NY Inventory No. NY00753		5. TYPE OF REPORT & PERIOD COVERED Phase I Inspection Report National Dam Safety Program
7. AUTHOR(s) GEORGE KOCH		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS New York State Department of Environmental Conservation 50 Wolf Road Albany, New York 12233		8. CONTRACT OR GRANT NUMBER(s) DACW51-79-C-0001
11. CONTROLLING OFFICE NAME AND ADDRESS Department of the Army 26 Federal Plaza New York District, CofE New York, New York 10287		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 1
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) Department of the Army 26 Federal Plaza New York District, CofE New York, NY 10287		12. REPORT DATE 17 September 1981
		13. NUMBER OF PAGES
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; Distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) DTIC JAN 25 1982		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continued on reverse side if necessary and identify by block number) Dam Safety National Dam Safety Program Visual Inspection Hydrology, Structural Stability Otisco Lake Dam Onondaga County, NY Oswego River Basin		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report provides information and analysis on the physical condition of the dam as of the report date. Information and analysis are based on visual inspection of the dam by the performing organization. The examination of documents and the visual inspection of Otisco Lake Dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies which require further investigation and remedial action.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

393970

0.1 18 82 C15

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

AD A109965


DAG FILE COPY

Further investigations are required to assess the stability of the spillway section. Analysis performed indicated that the structure is only marginally stable under normal loading conditions and is unstable when subjected to severe loading conditions (such as flood flows or ice loading).

The spillway has sufficient capacity to discharge the Probable Maximum Flood (PMF) therefore, it has been assessed as "Adequate" according to the Corps of Engineers screening criteria.

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DTIC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**

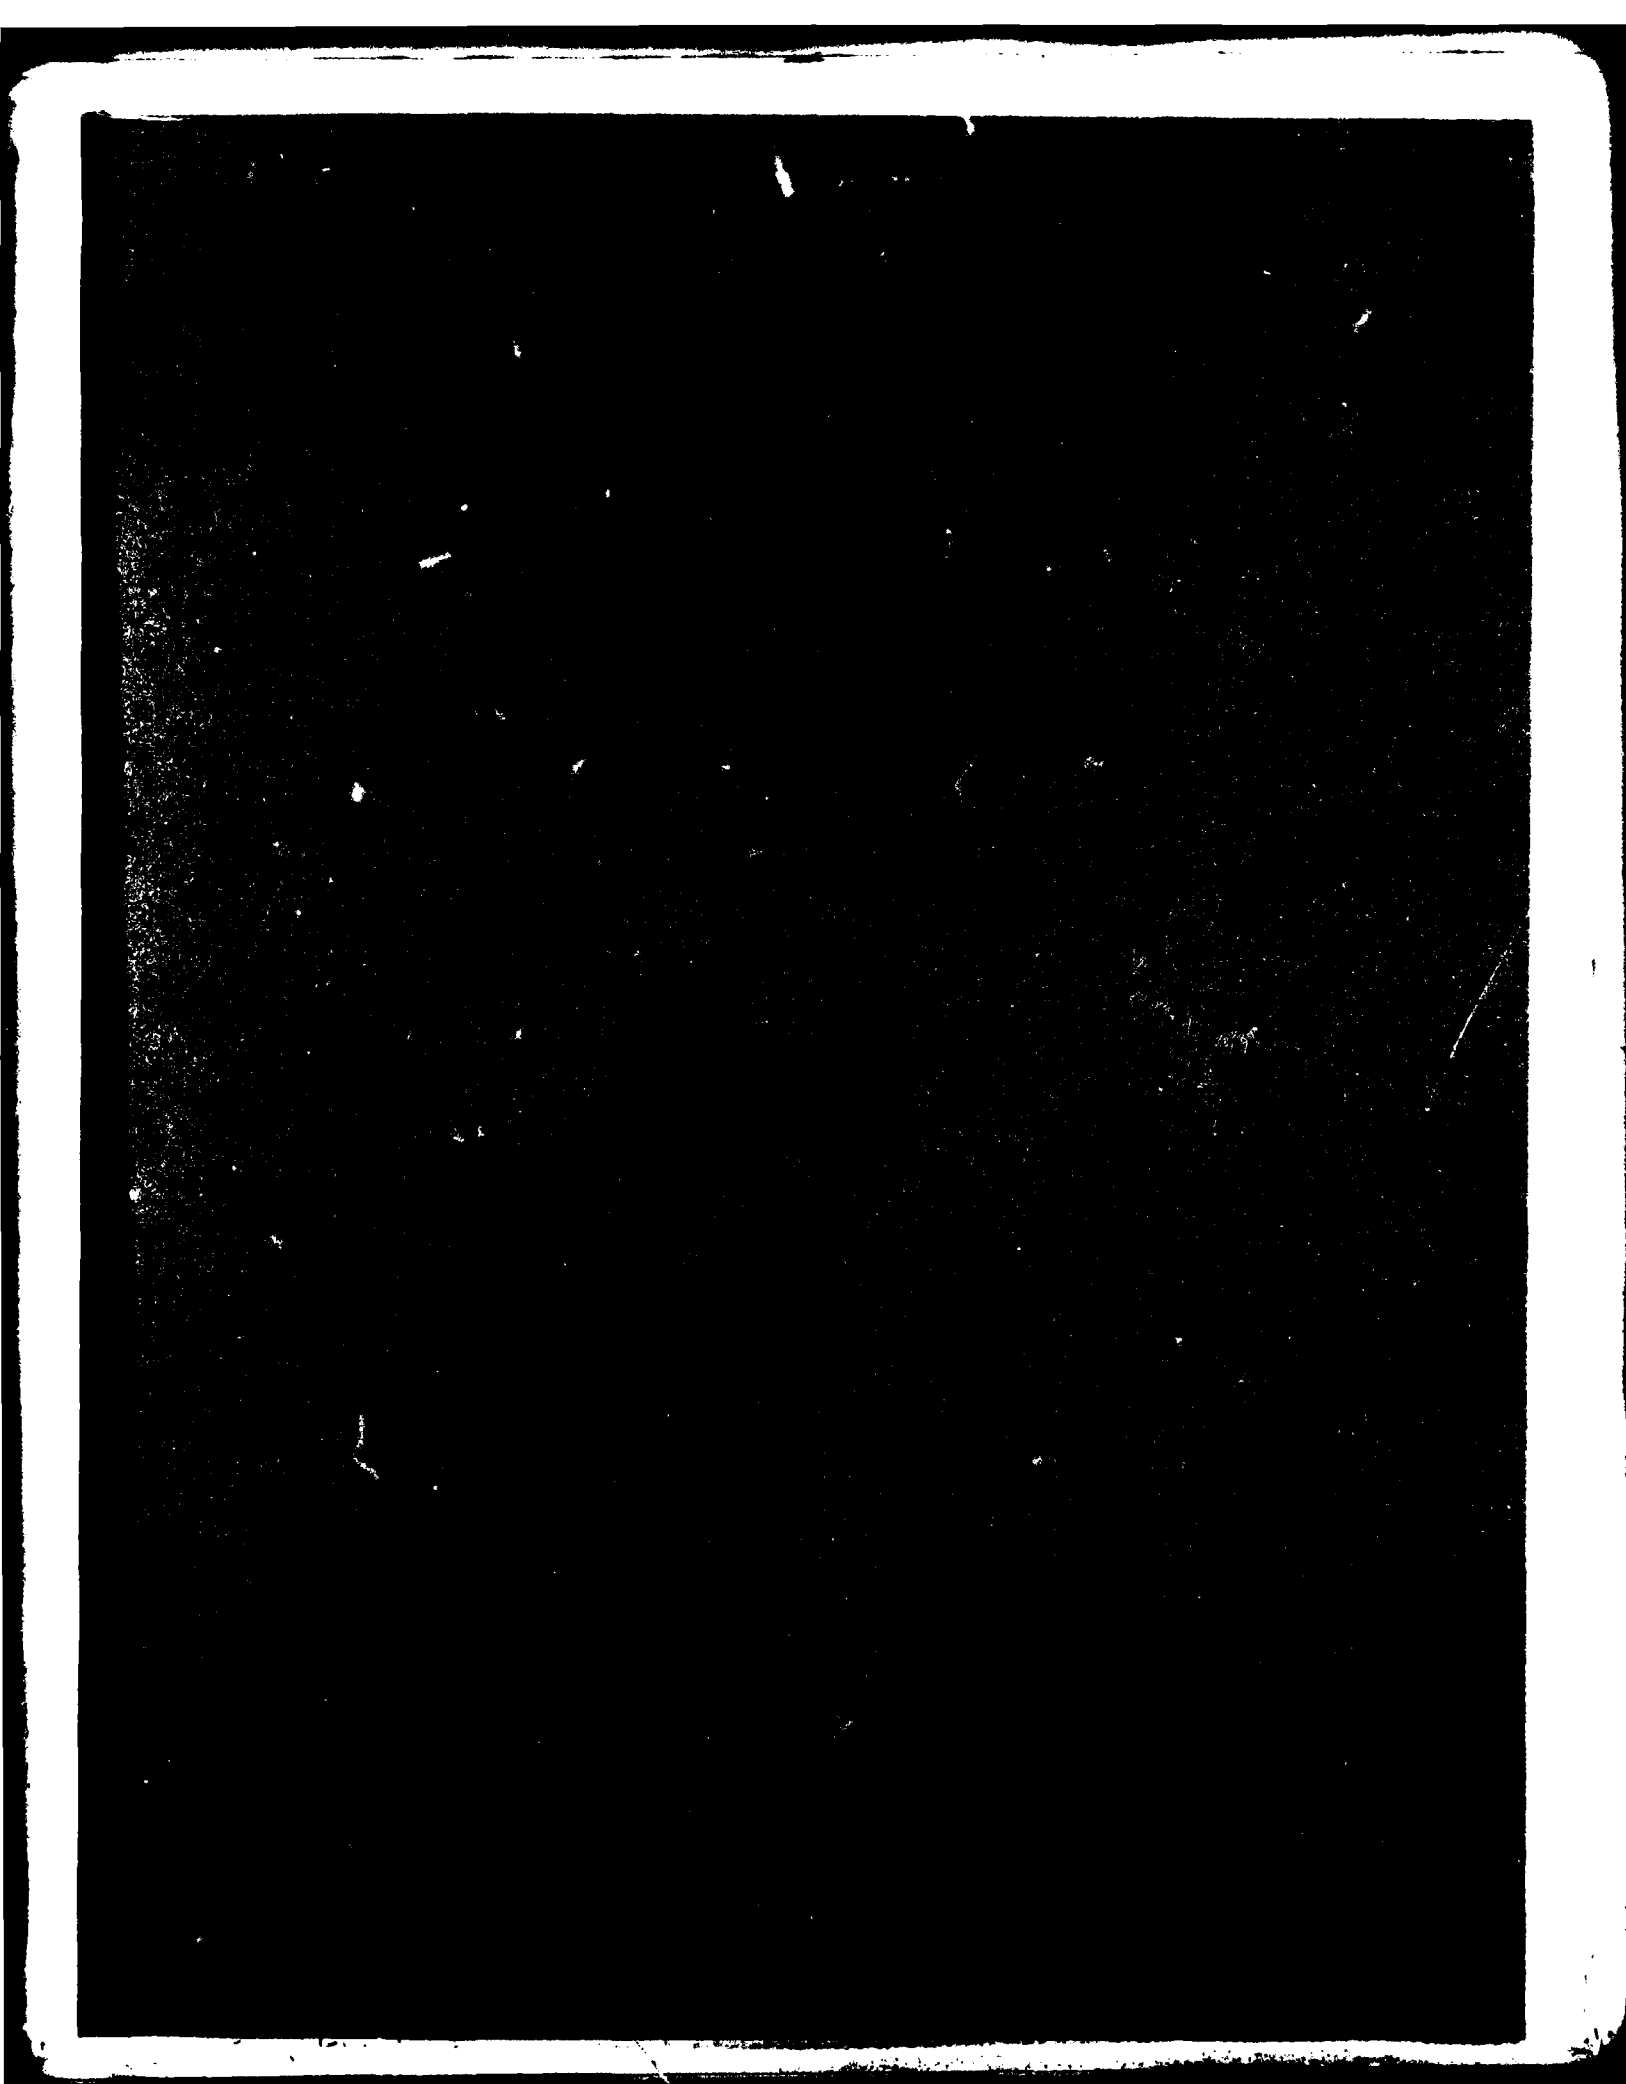

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I Investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through frequent inspections can unsafe conditions be detected and only through continued care and maintenance can these conditions be prevented or corrected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

[illegible]

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
OTISCO LAKE DAM
I.D. NO. NY-753
DEC #73B-2751A
OSWEGO RIVER BASIN
ONONDAGA COUNTY

TABLE OF CONTENTS

		<u>PAGE NO.</u>
-	ASSESSMENT	-
-	OVERVIEW PHOTOGRAPH	-
1	PROJECT INFORMATION	1
1.1	GENERAL	1
1.2	DESCRIPTION OF PROJECT	1
1.3	PERTINENT DATA	2
2	ENGINEERING DATA	5
2.1	GEOTECHNICAL DATA	4
2.2	CONSTRUCTION RECORDS	4
2.3	OPERATION RECORDS	4
2.4	EVALUATION OF DATA	4
3	VISUAL INSPECTION	5
3.1	FINDINGS	5
3.2	EVALUATION OF OBSERVATIONS	5
4	OPERATION AND MAINTENANCE PROCEDURES	6
4.1	PROCEDURES	6
4.2	MAINTENANCE OF DAM	6
4.3	WARNING SYSTEM	6
4.4	EVALUATION	6

		<u>PAGE NO.</u>
5	HYDROLOGIC/HYDRAULIC	7
5.1	DRAINAGE AREA CHARACTERISTICS	7
5.2	ANALYSIS CRITERIA	7
5.3	SPILLWAY CAPACITY	7
5.4	RESERVOIR CAPACITY	7
5.5	FLOODS OF RECORD	7
5.6	OVERTOPPING POTENTIAL	7
5.7	EVALUATION	7
6	STRUCTURAL STABILITY	7
6.1	EVALUATION OF STRUCTURAL STABILITY	8
6.2	STRUCTURAL STABILITY ANALYSIS	8
7	ASSESSMENT/RECOMMENDATIONS	10
7.1	ASSESSMENT	10
7.2	RECOMMENDED MEASURES	11

APPENDICES

- A. PHOTOGRAPHS
- B. VISUAL INSPECTION CHECKLIST
- C. HYDROLOGIC/HYDRAULIC
- D. STABILITY COMPUTATIONS
- E. REFERENCES
- F. DRAWINGS

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

Name of Dam:	Otisco Lake Dam I.D. No. NY 753
State Located:	New York
County:	Onandaga
Watershed:	Oswego River Basin
Stream:	Ninemile Creek; tributary to Onandaga Lake
Date of Inspection:	June 12, 1981

ASSESSMENT:

The examination of documents and the visual inspection of Otisco Lake Dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies which require further investigation and remedial action.

Further investigations are required to assess the stability of the spillway section. Analysis performed indicated that the structure is only marginally stable under normal loading conditions and is unstable when subjected to severe loading conditions, (such as flood flows or ice loading).

The spillway has sufficient capacity to discharge the Probable Maximum Flood (PMF) therefore, it has been assessed as "Adequate" according to the Corps of Engineers screening criteria.

In addition, the dam has several problem areas which if left uncorrected, have the potential for the development of hazardous conditions and must be corrected within 1 year. These areas are:

1. Repair the deteriorated portions of the concrete on the downstream edges of the concrete paving.
2. Repair the undermining of the concrete paving.
3. Provide a program of periodic inspection and maintenance of the dam and appurtenances, Document this information for future reference.
4. An emergency action plan must be developed and maintained during the life of the structure.

DATE
P.D.

George Koch

George Koch
Chief, Dam Safety Section
New York State Department
of Environmental Conservation
NY License No. 45937

member
tribe

Reviewed by:

Richard E. Mayo, Jr., D.E.
Col. W. M. Smith, Jr.
New York District Engineer

DATE
P.D.
P.D.
P.D.
P.D.

18 SEPT 1987

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.


DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

DATE
P.D.
P.D.

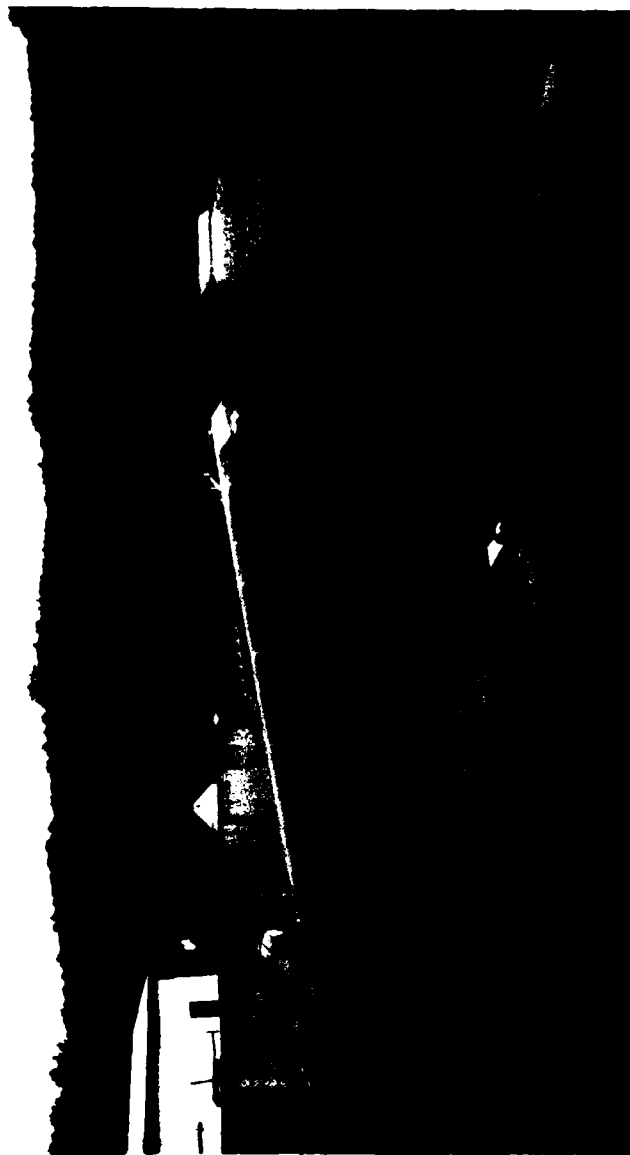

OTISCO LAKE DAM OVERVIEW

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
OTISCO LAKE DAM I.D. NO. NY753
DEC # 73B-2751A OSWEGO RIVER BASIN
ONONDAGA COUNTY

SECTION 1: PROJECT INFORMATION

1.1 GENERAL

a. Authority

The Phase I inspection reported herein was authorized by the Department of the Army, New York District, Corps of Engineers, to fulfill the requirements of the National Dam Inspection Act, Public Law 92-367.

b. Purpose of Inspection

This inspection was conducted to evaluate the existing conditions of the dam, to identify deficiencies and hazardous conditions, to determine if these deficiencies constitute hazards to life and property, and to recommend remedial measures where required.

1.2 DESCRIPTION OF PROJECT

a. Description of Dam and Appurtenances

The Otisco Lake Dam is a 300 feet long earth dam which has an ogee masonry/concrete primary spillway and a concrete paved secondary spillway abutted by reinforced concrete training walls. The masonry/concrete spillway is 18 feet high and has 55 feet of ogee weir length. The secondary spillway has a total length of 336 feet of uncontrolled overflow section. The secondary spillway channel within the training walls is directed into the natural channel by the training walls. There is a concrete core wall located under the overflow section and around the abutment walls. There are three 4' x 4' low level outlets located adjacent to the primary spillway section.

b. Location

The dam is located on Ninemile Creek, which is tributary to Onondaga Lake, Seneca River and finally the Oswego River. The village of Marietta, New York is downstream of the dam, within one mile.

c. Size

The dam is 18 feet high and impounds 26,000 acre feet at normal pool elevation. The dam is classified as "intermediate" in size.

d. Hazard Classification

The dam is classified as high hazard due to its location, above several low lying homes in the area between the dam and the village of Marietta, New York.

e. Ownership

The dam is owned by Onondaga County Water Authority, P.O. Box 9, Northern

Concourse, Syracuse, New York 13211. The person responsible for operation and maintenance, who was contacted to make the inspection of the dam was Mr. Joseph DeVoldre, (315) 455-7061.

f. Purpose of Dam

The dam was built to increase storage for water supply.

g. Design and Construction History

In 1857, a feeder dam for the Erie Canal was constructed at the site of the present dam. By 1872 the dam had been raised another ten feet for more storage for canal use. In 1907, a new dam of masonry construction (which now makes up the lower portion of the primary spillway) was completed adding another four feet of storage and providing a domestic water source. The dam as it now exists was completed in 1962.

h. Normal Operating Conditions

All flows in excess of the Onondaga County Water Authority requirements are passed over the uncontrolled spillway. The three low level outlets are operable and in good working condition.

1.3 PERTINENT DATA

a. Drainage Area (sq.mi.)

39.15

b. Elevations (ft., USGS datum)

Top of Dam	798.1
Secondary Spillway	790.1
Primary Spillway	786.6
Low Level Outlets	768.6
Original Stream Channel	768. ±

c. Reservoir

Surface Area @ spillway crest (acres)	2291.
Storage @ Top of dam (acre-feet)	47,890.
Storage @ Spillway Crest (acre-feet)	26,067.

d. Dam

Type: Earth fill with reinforced concrete paving on the downstream slope and concrete core wall, an earth embankment makes up the right portion of the dam.

Length (ft)

Concrete paved overflow section	336.
Earth embankment	300.

Height (ft)

Upstream Slope, Earth embankment	3H:1V
Downstream Slope, Earth Embankment	3H:1V
Crest Width, Earth Embankment	10.

e. Spillway

Type: Masonry/concrete ogee section

Weir length (ft) 55.

Spillway Capacity (cfs)

@ Secondary Spillway Crest 1,369.

@ Top of Dam 31,345.

f. Reservoir Drain

Type: Three - 4' x 4' sluiceways with manually controlled gate.

Capacity @ Normal Pool Elevation (cfs) 750.

SECTION 2: ENGINEERING DATA

2.1 GEOTECHNICAL DATA

a. Geology

The Otisco Lake Dam is located in the "Alleghany Plateau" physiographic province of New York State. The hills are smoothly sloping and generally well drained. The deep soils of the area are of the Honeoye-Lima Association.

b. Subsurface Investigation

No information about foundation conditions or borings could be found other than some description from the 1958 Dam Reconstruction Application. This stated the character of the stream bed and banks as "silty sand with traces of gravel, compact sand and gravel, and silty clay in various parts".

c. Design Records

There are no design records for the original dam constructed at the site. The only records available on the most recent reconstruction are plans which are included in App.F. Drawings or can be obtained from O'Brien and Gere, Engineers at 1304 Buckley Road, Syracuse, N.Y. (315) 451-4700.

2.2 CONSTRUCTION RECORDS

There are no construction records available for the original construction or reconstruction of Otisco Lake Dam.

2.3 OPERATION RECORDS

Operating records are available at the water station located adjacent to the dam. Any other data available regarding water levels, usage, or quality can be obtained from Mr. Joseph DeVoldre, Water Plant Manager, (315) 455-7061.

2.4 EVALUATION OF DATA

The data presented in this report is compiled from information contained in the files of Department of Environmental Conservation, drawings from O'Brien and Gere, Engineers, and data gained from the visual inspection. This information appears to be adequate and reliable for Phase I Inspection purposes.

SECTION 3: VISUAL INSPECTION

3.1 FINDINGS

a. General

Visual inspection of the Otisco Lake Dam and surrounding watershed was conducted on June 12, 1981. The weather was cloudy and the temperature ranged in the seventies. The reservoir water surface was at the primary spillway crest.

b. Dam

Both the earth embankments and the concrete paved section of the embankment appear to be in very good condition and well maintained. The vertical and horizontal alignments of the embankments are good. Some minor deterioration of concrete and minor undermining were found at the downstream edge of the secondary spillway (Photos 6 & 7). There is a roadway that passes between the spillway training wall and the right earth embankment. (See Photo #5). The road elevation is approximately 2.5 feet above the secondary spillway crest, therefore, under extreme flooding conditions, it would be possible for flow to pass over the dam on the roadway before overtopping occurs. There are stop logs available at the dam to block off the road, preventing erosion and hazard due to extreme floods. However, there is no emergency action plan detailing how or when to implement a plan.

c. Seepage

There was no seepage or sloughing found at the toe or any of the slopes.

d. Spillway

The overflow spillway is in good condition. Both the masonry and concrete are well maintained. The secondary spillway concrete paving is also in good condition.

e. Reservoir Drain

There are three 4' x 4' sluiceways located adjacent to the primary spillway. The manually operated valves are in good working condition, located at the secondary spillway elevation. A 36 inch and 24 inch pipe are also available to draw off water into the supply system.

f. Reservoir

Originally a naturally occurring lake, the area around it appears very stable. Sedimentation is not a problem with the dam at present.

3.2 EVALUATION OF OBSERVATIONS

The only deficiencies that could be found with the visual inspection was the small amount of concrete deterioration and slight undermining of the concrete paving on the left side of the spillway channel.

SECTION 4: OPERATION AND MAINTENANCE PROCEDURES

4.1 PROCEDURES

The normal water surface is approximated by the uncontrolled overflow primary spillway. The other draw from the reservoir is through a 36 inch or 24 inch pipeline to the Onondaga County Water Authority distribution system.

4.2 MAINTENANCE OF THE DAM

The dam is maintained by the Onondaga County Water Authority. Maintenance is considered satisfactory. All valves and gates are operated and lubricated annually.

4.3 WARNING SYSTEM

There is no warning system in effect.

4.4 EVALUATION

The dam and appurtenances have been maintained in a satisfactory condition, except for the minor maintenance noted in this report.

SECTION 5: HYDROLOGIC/HYDRAULIC

5.1 DRAINAGE AREA CHARACTERISTICS

Otisco Lake Dam is located about 3/4 mile southeast of the Village of Marietta. The lake is fed at its upper end by Spafford Creek, while downstream of the dam, the excess flow is discharged into Ninemile Creek. The total drainage area of the basin is 39.15 square miles and the surface area of the lake at normal pool is 3.71 square miles. The basin drains generally in a northerly direction. Its slope ranges from moderate to steep and, except for some marshy areas south of the lake, is fairly well drained. It was analysed as a single basin.

5.2 ANALYSIS CRITERIA

The analysis of the spillway capacity of the dam and storage of the reservoir was performed using the Corps of Engineers HEC-1 computer program incorporating the "Snyder Synthetic Unit Hydrograph" method and the "Modified Puls" flood routing procedure. The floods selected for analysis were the PMF and 1/2 the PMF in accordance with the recommended guidelines of the Corps of Engineers.

5.3 SPILLWAY CAPACITY

The spillway has a capacity of 31,345 cfs at the top of the dam. An inflow of 17,706 cfs generated by a storm equal to 1/2 the PMF will produce a maximum outflow of 8901 cfs. An inflow of 35,412 cfs resulting from the PMF will produce a maximum outflow of 22,719 cfs which is well below the spillway capacity of 31,345 cfs at top of dam.

5.4 RESERVOIR CAPACITY

The reservoir capacity to normal pool elevation is 26,067 acre-feet. Surcharge storage to top of dam is an additional 21,823 acre-feet, creating a total storage of 47,890 acre-feet. The surcharge storage between spillway and dam crests is equivalent to 10.5 inches of runoff.

5.5 FLOODS OF RECORD

The maximum known flood of record in Ninemile Creek occurred on June 23, 1972 at a point 1.8 miles downstream from Otisco Lake Dam. Ratiod by drainage area the estimated inflow at Otisco Lake Dam was 913 cfs. The resulting depth of flow over the spillway crest would be about 2.2 feet.

5.6 OVERTOPPING POTENTIAL

The PMF analysis indicates that the dam will not be overtopped by a storm equal to 1/2 the PMF nor by the PMF.

5.7 EVALUATION

The spillway is adequate to pass the flows produced by 1/2 the PMF as well as the PMF without overtopping of the dam. The structure is, therefore, assessed as "Adequate".

SECTION 6: STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

a. Visual Observation

Both the earth embankment and the masonry/concrete spillway section appeared stable. No sloughing or subsidence was found on the dam.

b. Design and Construction Data

No information regarding structural stability of the dam or spillway section was located.

c. Operating Records

Any data or information on operations of the Otisco Lake dam can be found at the pumping station located at the dam.

d. Post Construction Changes

The dam as it exists is a reconstruction of a masonry dam that was built in 1907. The overflow spillway was raised and the embankments were paved with concrete.

6.2 STRUCTURAL STABILITY ANALYSIS

A structural stability analysis was conducted for the masonry/concrete gravity spillway portion of the dam. The results of the analysis are as follows:

<u>Case</u>	<u>Overturning Safety Factor</u>	<u>Resultant in Middle Third</u>	<u>Sliding Safety Factor</u>
a. Normal conditions; water surface at spillway crest	1.73	Yes	1.03
b. Case a. plus ice load of 5,000 lb/ft	1.30	No	0.76
c. 1/2 PMF flows; water surface 6.4 ft above spillway crest	1.33	No	0.64
d. PMF flows; water surface 9.6 feet above spillway crest	1.19	No	0.54
e. Seismic loading; water surface at spillway crest	1.66	Yes	0.73

The analysis indicates that this portion of the dam is marginally stable under normal loading conditions and would be unstable under severe loading conditions (ice loading, flood flows). The analysis was based on available information and was done in accordance with Corps of Engineers "Recommended Guidelines", assuming full uplift pressure under the upstream toe decreasing to tailwater pressure under the downstream toe.

Further investigations are required to better assess the stability of the spillway section. Subsurface explorations and concrete cores are required to obtain information about the uplift forces acting on the dam. An accurate cross section of the spillway should be developed for the analysis. A revised stability analysis should then be performed using this data. Based on the results of these analyses, the need for modifications to the structure should be determined.

This structure is located in Seismic Zone 2. A seismic stability analysis was performed assuming a seismic coefficient of 0.1. The results of this analysis (shown on page 8) indicate that the safety factor against sliding fall below 1.0 when seismic considerations are included.

SECTION 7: ASSESSMENT/RECOMMENDATIONS

7.1 ASSESSMENT

a. Safety

The Phase I Inspection of Otisco Lake Dam revealed that the spillway is adequate to pass the Probable Maximum Flood according to the Corps of Engineers screening criteria.

The inspection also revealed that the stability of this structure is questionable. Analysis performed indicated that the structure is only marginally stable under normal loading conditions and is unstable when subjected to severe loading conditions (such as flood flows or ice loading).

b. Adequacy of Information

The information which was available for the preparation of this report presented a fairly complete history of the structure. Final plans of the most recent modification did not reveal the actual configuration of the foundation of the spillway. Therefore, some assumptions had to be made on the section of the spillway. Overall, the information is considered adequate for Phase I Inspection purposes.

c. Need for Additional Investigations

Further investigations are required to assess the stability of the spillway section. Subsurface explorations and concrete cores are required to obtain information about the uplift forces acting on the dam. An accurate cross section of the spillway should be developed for the analysis. A revised stability analysis should then be performed using this data. Based on the results of these analyses, the need for modifications to the structure should be determined.

d. Urgency

The additional stability investigation must be initiated within 6 months from the date of notification. Within 1 year of notification, remedial measures as a result of these investigations must be initiated, with completion of the measures during the following year. In the interim, develop an emergency action plan for the notification of downstream residents and proper governmental authorities in the event of overtopping and provide round-the-clock surveillance of the dam during periods of extreme run-off.

7.2 RECOMMENDED MEASURES

1. The results of the stability investigation will determine the appropriate remedial actions for the spillway section.
2. Repair the deterioration of the concrete on the downstream edges of the concrete pavement.
3. Repair the undermining of the concrete paving.
4. Provide a program of periodic inspection and maintenance of the dam and appurtenances. Document this information for future reference.
5. An emergency action plan must be developed and maintained during the life of the structure.

APPENDIX A
PHOTOGRAPHS

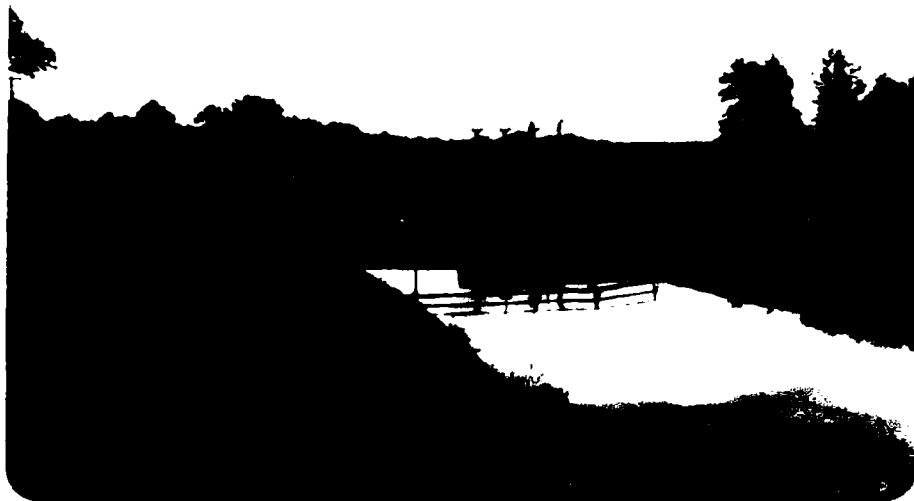


PHOTO #2 DOWNSTREAM VIEW OF DAM



PHOTO # 3 SPILLWAY CREST



PHOTO # 4 RESERVOIR DRAINS, VALVE CONTROLS



PHOTO # 5. ROADWAY LOCATED BETWEEN SPILLWAY ABUTMENT
AND LEFT EARTH EMBANKMENT

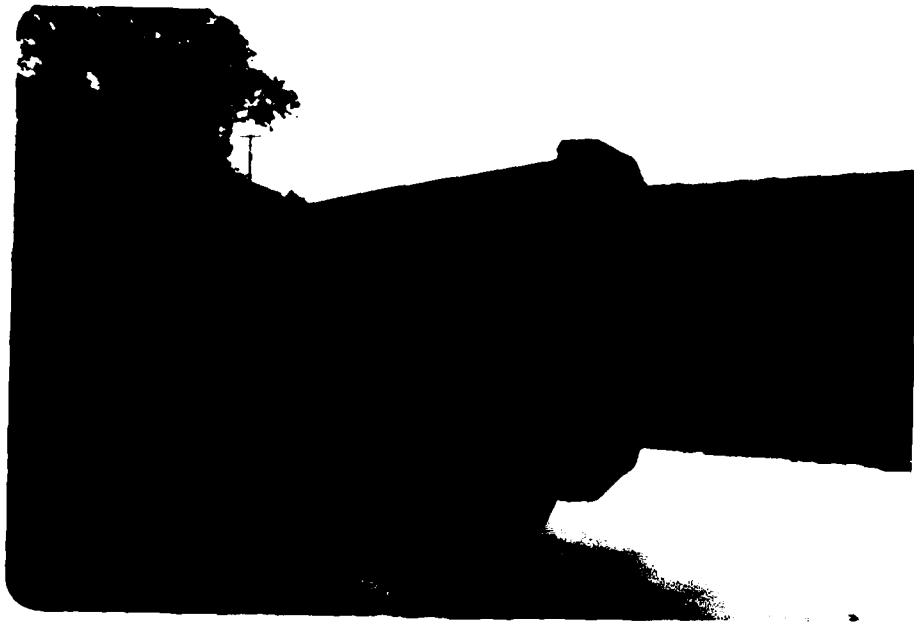


PHOTO # 6 MINOR DETERIORATION OF CONCRETE



PHOTO # 7 MINOR UNDERMINING OF CONCRETE PAVEMENT



PHOTO # 8 DOWNSTREAM VIEW OF SPILLWAY
AND NORMAL TAILWATER



PHOTO # 9 CONCRETE PAVING ON LEFT EMBANKMENT

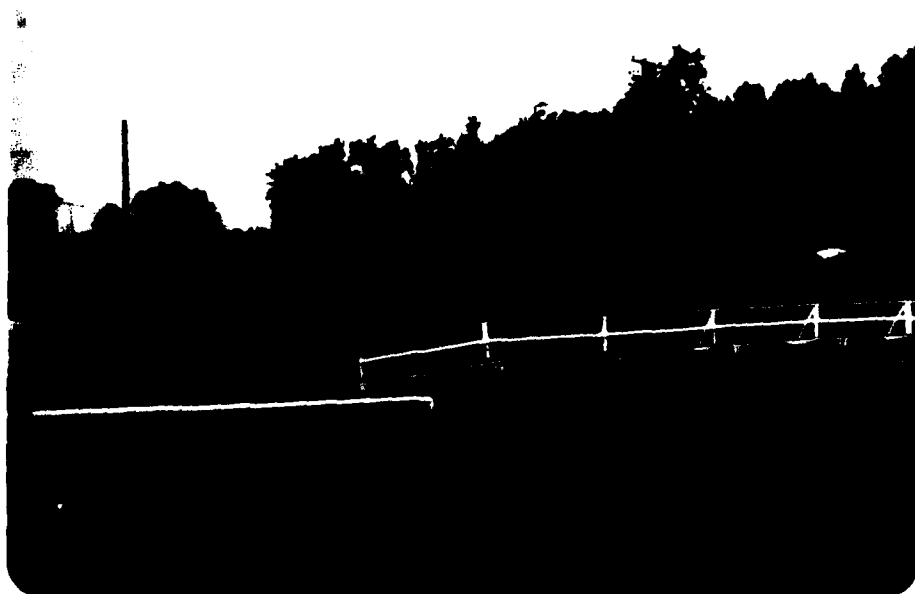


PHOTO # 10 DOWNSTREAM CHANNEL

APPENDIX B
VISUAL INSPECTION CHECKLIST

VISUAL INSPECTION CHECKLIST1) Basic Data

a. General

Name of Dam OTISCO LAKE DAM
Fed. I.D. # 753 DEC Dam No. 73B-2751
River Basin OSWEGO RIVER BASIN
Location: Town MARCELLUS County ONONDAGA
Stream Name NINE MILE CREEK
Tributary of ONONDAGA
Latitude (N) 42° 54.3' Longitude (W) 76° 18.8'
Type of Dam EARTH w/ concrete paving
Hazard Category high
Date(s) of Inspection JUNE 12, 1981
Weather Conditions cloudy, 70's
Reservoir Level at Time of Inspection AT PRIMARY SPILLWAY CREST

b. Inspection Personnel KEN HARMER, JAMIE VEITCH

c. Persons Contacted (Including Address & Phone No.)

MR. JOSEPH J. DeVoldre
WATER PLANT MANAGER, ONONDAGA CITY WATER AUTHORITY
P.O. BOX 9, NORTHERN CONCOURSE, SYRACUSE NY 13211
(315) 455-7061

d. History:

Date Constructed 1857 Date(s) Reconstructed 1872
1907
Designer (1962) O'Brien & Gere Engrs. Syracuse NY 1962
Constructed By ~ UNKNOWN ~
Owner ONONDAGA COUNTY WATER AUTHORITY

2) Embankment

a. Characteristics

- (1) Embankment Material EARTH EMBANKMENTS, CONCRETE
PAVED EARTH ABUTMENTS FORMING AUX. SPILLWAY
- (2) Cutoff Type CONCRETE
- (3) Impervious Core —
- (4) Internal Drainage System PIPED TO OUTLET CHANNEL - NO
FLOW @ TIME OF INSPECTION
- (5) Miscellaneous —

b. Crest

- (1) Vertical Alignment GOOD
- (2) Horizontal Alignment GOOD
- (3) Surface Cracks NONE
- (4) Miscellaneous —

c. Upstream Slope

- (1) Slope (Estimate) (V:H) 1:3 EARTH PORTION
- (2) Undesirable Growth or Debris, Animal Burrows NONE
- (3) Sloughing, Subsidence or Depressions NONE

(4) Slope Protection Vegetation

(5) Surface Cracks or Movement at Toe None

d. Downstream Slope

(1) Slope (Estimate - V:H) 1:3

(2) Undesirable Growth or Debris, Animal Burrows None

(3) Sloughing, Subsidence or Depressions None

(4) Surface Cracks or Movement at Toe None

(5) Seepage None

(6) External Drainage System (Ditches, Trenches; Blanket) NOT
Flowing

(7) Condition Around Outlet Structure excellent

(8) Seepage Beyond Toe None

e. Abutments - Embankment Contact

good no signs of erosion, seepage

(1) Erosion at Contact NONE

(2) Seepage Along Contact NONE

3) Drainage System

a. Description of System

b. Condition of System good

c. Discharge from Drainage System NONE

4) Instrumentation (Monumentation/Surveys, Observation Wells, Weirs, Piezometers, Etc.)

NONE

93-15-3(9/80)

5) Reservoir

- a. Slopes STABLE
- b. Sedimentation NOT A PROBLEM AROUND DAM
- c. Unusual Conditions Which Affect Dam NONE

6) Area Downstream of Dam

- a. Downstream Hazard (No. of Homes, Highways, etc.) Highway runs between embankment and abutment
- b. Seepage, Unusual Growth NONE
- c. Evidence of Movement Beyond Toe of Dam NONE
- d. Condition of Downstream Channel GOOD

7) Spillway(s) (Including Discharge Conveyance Channel)

- a. General masonry/concrete ogee section
- b. Condition of Service Spillway good condition

c. Condition of Auxiliary Spillway concrete pavement - very
good condition

d. Condition of Discharge Conveyance Channel good

8) Reservoir Drain/Outlet

Type: Pipe _____ Conduit _____ Other sluiceway

Material: Concrete ☒ Metal _____ Other _____

Size: 4' x 4' Length 17'

Invert Elevations: Entrance _____ Exit _____

Physical Condition (Describe): good Unobservable _____

Material: concrete

Joints: could not see Alignment _____

Structural Integrity: apparently sound

Hydraulic Capability: total 750 cfs at normal pool

Means of Control: Gate ☒ Valve _____ Uncontrolled _____

Operation: Operable ☒ Inoperable _____ Other _____

Present Condition (Describe): good

9) Structural

- a. Concrete Surfaces good
- b. Structural Cracking None
- c. Movement - Horizontal & Vertical Alignment (Settlement) None
- d. Junctions with Abutments or Embankments good
- e. Drains - Foundation, Joint, Face Not Flowing
- f. Water Passages, Conduits, Sluices good condition
- g. Seepage or Leakage NONE FOUND.

h. Joints - Construction, etc.

GOOD

i. Foundation APPARENTLY GOOD - NO SIGNS

SETTLEMENT OR MOVEMENT

j. Abutments GOOD

k. Control Gates OPERABLE

l. Approach & Outlet Channels GOOD

m. Energy Dissipators (Plunge Pool, etc.) GOOD CONDITION

n. Intake Structures GOOD

o. Stability GOOD

p. Miscellaneous WELL MAINTAINED STRUCTURE

10) Appurtenant Structures (Power House, Lock, Gatehouse, Other)a. Description and Condition PUMP STATION LOCATEDIMMEDIATELY DOWNSTREAM WELL
MAINTAINED.11) Operation Procedures (Lake Level Regulation):NO SET PROCEDURES, EXCEPT TO DRAW
WATER SUPPLY AND KEEP LAKE LEVEL
AT CREST.

APPENDIX C
HYDROLOGIC/HYDRAULIC
ENGINEERING DATA AND COMPUTATIONS

Otisco Lake

1 of 3

Drainage area = 39.15 mi²
(Planimetric from Aerial) = 25,056 acres

Lake Area (@ El. 788) = 3.71 mi²
(Planimetric from Aerial) = 2374 acres

Shoreline = 13.4 mi. (Gazetteer)
Max. length of Lake = 5.75 " } Feasibility Report for
Max. width " = 0.75 " } Oswego River Watershed,
Max. depth " = 70 feet } May 1978.
Normal pool elev. = 786.6" (From Plans as revised)
1-5-81

Stage - Capacity (From Fig. A-30, Feasibility Report May 1978)

<u>Elev.</u>	<u>Vol. (Acre-foot)</u>
722	0
780	13,600
785	23,000
788	28,750
790	32,500
795	42,000

Atisco LakePrecipitation : $\leq \text{PMP} = 21.0''$ (H.M. No. 33)

<u>DUR.</u>	<u>6</u>	<u>12</u>	<u>24</u>	<u>48</u>
%	94	108	118	126

Drainage area = 39.15 mi^2

$$L = 12.5 \times \frac{62,500}{12 \times 5280} = 12.33 \text{ mi.}$$

$$L_{ca} = 4.8 \times \frac{62,500}{12 \times 5280} = 4.73 \text{ mi.}$$

Assume $C_t = 2.2$ $C_p = 0.625$


$$\begin{aligned} t_p &= C_t (L \times L_{ca})^{0.3} \\ &= 2.2 (12.33 \times 4.73)^{0.3} = 7.45 \text{ hr.} \end{aligned}$$

$$\begin{aligned} t_+ &= \frac{t_p}{5.5} = \frac{7.45}{5.5} = 1.35 \text{ hrs} \\ &= 1 \text{ hr } 21 \text{ min.} \quad \text{Use } \underline{1 \text{ hr } 30 \text{ min.}} \end{aligned}$$

$$\begin{aligned} T_p &= t_p + 0.25(t_R - t_+) \\ &= 7.45 + 0.25(1.50 - 1.35) \\ &= 7.45 + 0.04 = 7.49 \text{ hr.} \end{aligned}$$

Piseco Lake

3 of 3

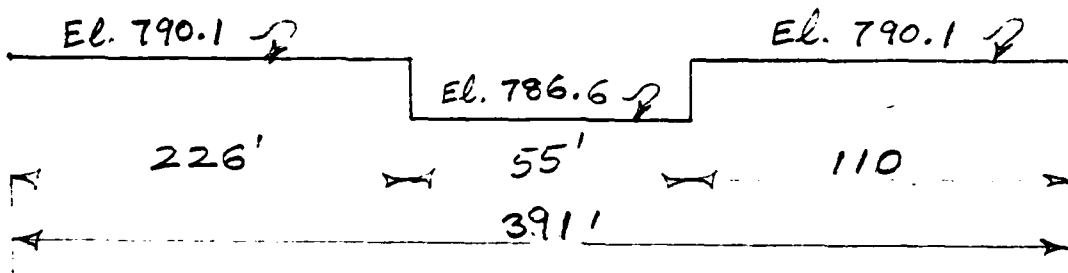

Total spillway Length = 391'

Spillway crest elev. = 786.6 (From Plans as revised 1-5-81)

Assume C = 3.8 (Ogee Section)

C = 3.4 (Dam)

EL	L ₁	C ₁	H ₁	L ₂	C ₂	H ₂	Q ₁	Q ₂	Q
786.6	55	3.8	0	-	-	-	0	-	0
788	55	3.8	1.4	-	-	-	347	-	347
789	55	3.8	2.4	-	-	-	777	-	777
790.1	55	3.8	3.5	-	-	-	1369	-	1369
791	55	3.8	4.4	336	3.4	0.9	1929	975	2904
792	55	3.8	5.4	336	3.4	1.9	2623	2992	5615
793	55	3.8	6.4	336	3.4	2.9	3384	5642	9026
794	55	3.8	7.4	336	3.4	3.9	4207	8799	13006
795	55	3.8	8.4	336	3.4	4.9	5088	12391	17479

CHECK LIST FOR DAMS
HYDROLOGIC AND HYDRAULIC
ENGINEERING DATA

1

AREA-CAPACITY DATA:

	<u>Elevation</u> (ft.)	<u>Surface Area</u> (acres)	<u>Storage Capacity</u> (acre-ft.)
1) Top of Dam	<u>798.1</u>	<u>2973</u>	<u>47890</u>
2) Design High Water (Max. Design Pool)	<u>-</u>	<u>-</u>	<u>-</u>
3) Auxiliary Spillway Crest	<u>790.1</u>	<u>-</u>	<u>-</u>
4) Pool Level with Flashboards	<u>-</u>	<u>-</u>	<u>-</u>
5) Service Spillway Crest	<u>786.6</u>	<u>2291</u>	<u>26067</u>

DISCHARGES

	<u>Volume</u> (cfs)
1) Average Daily	<u>-</u>
2) Spillway @ Maximum High Water	<u>31345</u>
3) Spillway @ Design High Water	<u>-</u>
4) Spillway @ Auxiliary Spillway Crest Elevation	<u>-</u>
5) Low Level Outlet	<u>750</u>
6) Total (of all facilities) @ Maximum High Water	<u>32096</u>
7) Maximum Known Flood	<u>913</u>
8) At Time of Inspection	<u>0</u>

CREST:

ELEVATION: 798.1Type: Masonry, broad crestedWidth: _____ Length: 336Spillover —Location —

SPILLWAY:

SERVICE

AUXILIARY

786.6 Elevation NoneOgee Type —— Width —Type of Control✓ Uncontrolled —

Controlled:

— Type —
(Flashboards; gate)— Number —— Size/Length —Invert Material —Anticipated Length
of operating service —— Chute Length —— Height Between Spillway Crest
& Approach Channel Invert
(Weir Flow) —

HYDROMETEROLOGICAL GAGES:

Type : Water-Stage recorder # 04240180Location: Ninemile Creek, 1.8 mi downstream from
Otisco Lake Dam.

Records:

Date - June 23, 1972Max. Reading - 1030 cfs (gage height-8.65 ft.)

FLOOD WATER CONTROL SYSTEM:

Warning System: _____

Method of Controlled Releases (mechanisms):

DRAINAGE AREA: 39.15 Sq. mi

DRAINAGE BASIN RUNOFF CHARACTERISTICS:

Land Use - Type: Woods, open fields, substantial residential devel.

Terrain - Relief: Moderate to steep slopes, generally well drained.

Surface - Soil: High to medium-fine, moderately well drained, soils of glacial till origin.

Runoff Potential (existing or planned extensive alterations to existing (surface or subsurface conditions)

No alterations planned or anticipated

Potential Sedimentation problem areas (natural or man-made; present or future)

Potential Backwater problem areas for levels at maximum storage capacity including surcharge storage:

Significant number of homes and cottages along and/or near the lake shore.

Dikes - Floodwalls (overflow & non-overflow) - Low reaches along the Reservoir perimeter:

Location: _____

Elevation: _____

Reservoir:

Length @ Maximum Pool 5.75 (Miles)

Length of Shoreline (@ Spillway Crest) 13.4 (Miles)

FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79
 MODIFIED FOR HONEYWELL APR 79

[illegible]

9 1 6 1 1

7 11 12 14 15 16 18 19

3
3
1
1
5

9 K1 INFLOW FROM BASIN

0 1 1 1 39.15

	P	21	94	.108	.118	.126
1						

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

100

2
2
-
-
2
1

KI ROUTE THROUGH RESERVOIR

—

3 1 1

9	Y4 786.6	788	789	790.1	791	792.
---	----------	-----	-----	-------	-----	------

C	VS	347	777	1369	2904	5615
---	----	-----	-----	------	------	------

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100

2	\$F	722	785	788	790	795

2007

100

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

9

00A

1. The first part of the document is a list of references. The references are listed in a standard format, with the author's name, the title of the work, and the publisher. The references are as follows:

1. J. H. Van Veen, *The History of the Netherlands*, 1910, 1911, 1912, 1913, 1914, 1915, 1916, 1917, 1918, 1919, 1920, 1921, 1922, 1923, 1924, 1925, 1926, 1927, 1928, 1929, 1930, 1931, 1932, 1933, 1934, 1935, 1936, 1937, 1938, 1939, 1940, 1941, 1942, 1943, 1944, 1945, 1946, 1947, 1948, 1949, 1950, 1951, 1952, 1953, 1954, 1955, 1956, 1957, 1958, 1959, 1960, 1961, 1962, 1963, 1964, 1965, 1966, 1967, 1968, 1969, 1970, 1971, 1972, 1973, 1974, 1975, 1976, 1977, 1978, 1979, 1980, 1981, 1982, 1983, 1984, 1985, 1986, 1987, 1988, 1989, 1990, 1991, 1992, 1993, 1994, 1995, 1996, 1997, 1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT 1
ROUTE HYDROGRAPH TO 1
END OF NETWORK

NEW YORK STATE
DEPT OF ENVIRONMENTAL CONSERVATION
FLOOD PROTECTION BUREAU

OTISCO LAKE
PHASE 1
PMF

JOB SPECIFICATION									
NQ	NHR	NMIN	IDAY	IHR	IMIN	METRC	IPLT	IPRT	NSTAN
200	1	30	0	0	0	0	0	0	0
			JOPER	NWT	LROPT	TRACE			
			5	0	0	0			

MULTI-PLAN ANALYSES TO BE PERFORMED

```
RTIOS= 0.20 0.40 0.50 0.60 0.80 1.00
```

```
*****  
*****  
***** SUB-AREA RUNOFF COMPUTATION *****  
*****  
*****
```

INFLOW FROM BASIN

ISTAQ	ICOMP	IFCON	ITAPE	JPLI	JPRI	INAME	ISTAGE	IAUTO
1	0	0	0	2	2	1	0	0

HYDROGRAPH DATA

	INVDG	IUHG	TARCA	SNAP	TRSDA	TRSPC	RATIO	ISNOW	ISAME	LOCAL
1	1	1	39.15	0.	39.15	0.	0.	0	0	0

PRECIP DATA

SPFE PMS
0. 21.00

TRSPC COMPUTED BY THE PROGRAM IS 0.843

LOSS DATA

LRPT	STRKR	DLTKR	RTIOL	ERAIN	'STAKS	RTIOK	STRTL	CNSTL	ALSMX	RTIMP
0	0.	0.	1.00	0.	0	1.00	1.00	0.10	0.	0.

UNIT HYDROGRAPH DATA

YP = 7.49 CP = 0.63 NTA = 0

RECESSION DATA

APPROXIMATE CLARK COEFFICIENTS FROM GIVEN SNYDER CP AND TP ARE TC= 5.79 AND R= 4.47 INTERVALS

EXP UNDERFLO AT LOCATION 230246

EXP UNDERFLO AT LOCATION 230246

UNIT HYDROGRAPH	27 END-OF-PERIOD ORDINATES,	LAG=	7.45 HOURS, CP=	0.62	VOL=	1.00
172.	1218.	2094.	1786.	1427.	1140.	910.
623.	1769.	2085.				
727.	581.	370.	236.	151.	120.	96.
	464.	370.	236.			
	49.	39.	25.			
77.	61.	31.	20.			

END-OF-PERIOD FLOW

[illegible]

1.01	1.30	1	0.01	0.01	71.	1.07	7.30	101	0.	0.	16.
1.01	3.00	2	0.01	0.01	65.	1.07	9.00	102	0.	0.	14.
1.01	4.30	3	0.01	0.01	59.	1.07	10.30	103	0.	0.	13.
1.01	6.00	4	0.01	0.	54.	1.07	12.00	104	0.	0.	12.
1.01	7.30	5	0.04	0.	50.	1.07	13.30	105	0.	0.	11.
1.01	9.00	6	0.04	0.	45.	1.07	15.00	106	0.	0.	10.
1.01	10.30	7	0.04	0.	41.	1.07	16.30	107	0.	0.	9.
1.01	12.00	8	0.04	0.	38.	1.07	18.00	108	0.	0.	8.
1.01	13.30	9	0.29	0.	34.	1.07	19.30	109	0.	0.	7.
1.01	15.00	10	0.52	0.08	45.	1.07	21.00	110	0.	0.	6.
1.01	16.30	11	0.24	0.09	94.	1.07	22.30	111	0.	0.	5.
1.01	18.00	12	0.00	0.00	178.	1.08	0.	112	0.	0.	4.
1.01	19.30	13	0.02	0.	272.	1.08	1.30	113	0.	0.	3.
1.01	21.00	14	0.02	0.	344.	1.08	3.00	114	0.	0.	2.
1.01	22.30	15	0.02	0.	369.	1.08	4.30	115	0.	0.	1.
1.02	0.	16	0.02	0.	343.	1.08	6.00	116	0.	0.	0.
1.02	1.30	17	0.18	0.03	291.	1.08	7.30	117	0.	0.	0.
1.02	3.00	18	0.18	0.03	252.	1.08	9.00	118	0.	0.	0.
1.02	4.30	19	0.18	0.03	240.	1.08	10.30	119	0.	0.	0.
1.02	6.00	20	0.18	0.03	252.	1.08	12.00	120	0.	0.	0.
1.02	7.30	21	0.52	0.47	356.	1.08	13.30	121	0.	0.	0.
1.02	9.00	22	0.62	0.47	665.	1.08	15.00	122	0.	0.	0.
1.02	10.30	23	0.62	0.47	1234.	1.08	16.30	123	0.	0.	0.
1.02	12.00	24	0.62	0.47	2040.	1.08	18.00	124	0.	0.	0.
1.02	13.30	25	4.33	4.18	3623.	1.08	19.30	125	0.	0.	0.
1.02	15.00	26	8.82	8.67	7643.	1.08	21.00	126	0.	0.	0.
1.02	16.30	27	3.49	3.34	14847.	1.08	22.30	127	0.	0.	0.
1.02	18.00	28	0.30	0.00	23624.	1.09	0.	128	0.	0.	0.
1.02	19.30	29	0.27	0.12	31290.	1.09	1.30	129	0.	0.	0.
1.02	21.00	30	0.27	0.12	35412.	1.09	3.00	130	0.	0.	0.
1.02	22.30	31	0.27	0.12	34804.	1.09	4.30	131	0.	0.	0.
1.03	0.	32	0.27	0.12	30482.	1.09	6.00	132	0.	0.	0.
1.03	1.30	33	0.	0.	25062.	1.09	7.30	133	0.	0.	0.
1.03	3.00	34	0.	0.	20318.	1.09	9.00	134	0.	0.	0.
1.03	4.30	35	0.	0.	16460.	1.09	10.30	135	0.	0.	0.
1.03	6.00	36	0.	0.	13287.	1.09	12.00	136	0.	0.	0.
1.03	7.30	37	0.	0.	10673.	1.09	13.30	137	0.	0.	0.
1.03	9.00	38	0.	0.	8537.	1.09	15.00	138	0.	0.	0.
1.03	10.30	39	0.	0.	6819.	1.09	16.30	139	0.	0.	0.
1.03	12.00	40	0.	0.	5446.	1.09	18.00	140	0.	0.	0.
1.03	13.30	41	0.	0.	4350.	1.09	19.30	141	0.	0.	0.
1.03	15.00	42	0.	0.	3518.	1.09	21.00	142	0.	0.	0.
1.03	16.30	43	0.	0.	3210.	1.09	22.30	143	0.	0.	0.
1.03	18.00	44	0.	0.	2929.	1.10	0.	144	0.	0.	0.
1.03	19.30	45	0.	0.	2672.	1.10	1.30	145	0.	0.	0.
1.03	21.00	46	0.	0.	2438.	1.10	3.00	146	0.	0.	0.
1.03	22.30	47	0.	0.	2225.	1.10	4.30	147	0.	0.	0.
1.04	0.	48	0.	0.	2030.	1.10	6.00	148	0.	0.	0.
1.04	1.30	49	0.	0.	1852.	1.10	7.30	149	0.	0.	0.
1.04	3.00	50	0.	0.	1690.	1.10	9.00	150	0.	0.	0.
1.04	4.30	51	0.	0.	1542.	1.10	10.30	151	0.	0.	0.
1.04	6.00	52	0.	0.	1407.	1.10	12.00	152	0.	0.	0.
1.04	7.30	53	0.	0.	1284.	1.10	13.30	153	0.	0.	0.
1.04	9.00	54	0.	0.	1171.	1.10	15.00	154	0.	0.	0.
1.04	10.30	55	0.	0.	1069.	1.10	16.30	155	0.	0.	0.
1.04	12.00	56	0.	0.	975.	1.10	18.00	156	0.	0.	0.
1.04	13.30	57	0.	0.	890.	1.12	19.30	157	0.	0.	0.
1.04	15.00	58	0.	0.	812.	1.12	21.00	158	0.	0.	0.
1.04	16.30	59	0.	0.	741.	1.12	22.30	159	0.	0.	0.
1.04	18.00	60	0.	0.	674.	1.12	24.00	160	0.	0.	0.
1.04	19.30	61	0.	0.	617.	1.12	25.30	161	0.	0.	0.
1.04	21.00	62	0.	0.	577.	1.12	27.00	162	0.	0.	0.

STATION 1

[illegible]

12.00 56.1
13.30 57.1
15.00 58.1
16.30 59.1
18.00 60.1
19.30 61.1
21.00 62.1
22.30 63.1
0. 64.1
1.30 65.1
3.00 66.1
4.30 67.1
5.00 68.1
7.30 69.1
9.30 70.1
10.30 71.1
12.00 72.1
13.30 73.1
15.30 74.1
16.30 75.1
18.00 76.1
19.30 77.1
21.00 78.1
22.30 79.1
0. 80.1
1.30 81.1
3.00 82.1
4.30 83.1
6.00 84.1
7.30 85.1
9.00 86.1
10.30 87.1
12.30 88.1
13.30 89.1
15.00 90.1
16.30 91.1
18.00 92.1
19.30 93.1
21.00 94.1
22.30 95.1
0. 96.1
1.30 97.1
3.00 98.1
4.30 99.1
6.00 100.1
7.30 101.1
9.00 102.1
10.30 103.1
12.30 104.1
13.30 105.1
15.00 106.1
16.30 107.1
18.00 108.1
19.30 109.1
21.00 110.1
22.30 111.1
0. 112.1
1.30 113.1
3.00 114.1
4.30 115.1
6.00 116.1
7.30 117.1

9.001191
10.301191
12.001201
13.301211
15.301221
16.301231
18.301241
19.301251
21.001261
22.301271
0. 1281
1.301291
3.001301
4.301311
6.001321
7.301331
9.301341
10.301351
12.001361
13.301371
15.001381
16.301391
18.301401
19.301411
21.001421
22.301431
0. 1441
1.301451
3.001461
4.301471
6.001481
7.301491
9.001501
10.301511
12.301521
13.301531
15.001541
16.301551
18.001561
19.301571
21.001581
22.301591
0. 1601
1.301611
3.001621
4.301631
6.301641
7.301651
9.001661
10.301671
12.001681
13.301691
15.301701
16.301711
18.301721
19.301731
21.001741
22.301751
0. 1761
1.301771
3.001781
4.301791

6.001801
7.301811
9.001821
10.301831
12.001841
13.301851
15.001861
16.301871
18.001881
19.301891
21.001901
22.301911
0. 1921
1.301931
3.001941
4.301951
6.001961
7.301971
9.001981
10.301991
12.002001

HYDROGRAPH AT STA 1 FOR PLAY 1, RTIO 1

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME	
CFS	7082.	6444.	3609.	1391.	68050.	
CMS	201.	192.	102.	39.	1927.	
INCHES		1.53	3.43	3.96	4.04	
"M		38.89	87.12	100.71	102.67	
AC-FT		3195.	7158.	8274.	8436.	
THOUS CU M		3941.	8829.	10206.	10406.	

HYDROGRAPH AT STA 1 FOR PLAN 1, RTIO 2

	20.	26.	24.	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	14165.	14165.	14165.	12887.	7217.	2781.	136100.
CMS	401.	401.	401.	365.	204.	79.	3854.
INCHES				5.06	6.86	7.93	8.08
MM				77.28	174.23	201.41	205.35
AC-FT				6320.	14315.	14569.	15872.
1-2-25 PM				7695.	17444.	2518.	27011.

HYDROGRAPH ROUTING

ROUTE THROUGH RESERVOIR

ISTAQ ICOMP 1 1
 IECON ITAPE JPLT JPRT INAME ISTAGE IAUTO
 0 0 2 2 1 0 0

ROUTING DATA

QLOSS CLOSS AVG IRES ISAME IOPT IPMP LSTR
 0. 0. 0. 1 1 0 0
 NSTPS NSTOL LAG AMSKK X TSK STORA ISPRAT
 1 0 0 0. 0. 0. -788. -1

STAGE	785.60	788.00	789.00	790.10	791.00	792.00	793.00	794.00	795.00
FLOW	0.	347.00	777.00	1369.00	2906.00	5615.00	9026.00	13006.00	17479.00
CAPACITY	0.	13600.	23000.	28750.	32500.	42000.			
ELEVATION	722.	780.	785.	788.	790.	795.			

CREL SPWID COQW EXPW ELEV COQL CAREA EXPL
 786.6 0. 0. 0. 0. 0. 0. 0.

DAM DATA

TOPEL COOD EXPD DAMWID
 798.1 3.8 1.5 50.

WARNING *** TOP OF DAM, BOTTOM OF BREACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSUMED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 1

END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW

342.	336.	331.	326.	321.	316.	311.	307.	302.	297.
293.	288.	285.	281.	278.	274.	271.	268.	264.	261.
258.	255.	254.	255.	260.	274.	305.	373.	516.	689.
888.	1086.	1242.	1356.	1575.	1723.	1794.	1807.	1779.	1720.
1642.	1552.	1459.	1370.	1342.	1313.	1283.	1253.	1223.	1193.
1162.	1132.	1102.	1072.	1042.	1013.	984.	956.	928.	900.
873.	847.	821.	796.	772.	753.	734.	715.	697.	679.
661.	644.	627.	611.	595.	579.	564.	549.	534.	520.
506.	492.	479.	466.	453.	441.	429.	417.	406.	394.
384.	373.	363.	353.	345.	334.	324.	319.	319.	319.
314.	309.	304.	293.	294.	290.	285.	281.	276.	272.
267.	263.	259.	255.	251.	247.	243.	239.	235.	232.
228.	224.	221.	217.	214.	210.	207.	204.	201.	197.
194.	191.	188.	185.	182.	179.	176.	174.	171.	168.
165.	163.	160.	158.	155.	153.	150.	148.	146.	143.
141.	139.	137.	134.	132.	130.	128.	126.	124.	122.
123.	118.	115.	114.	113.	111.	109.	107.	106.	104.
102.	101.	99.	97.	96.	94.	93.	91.	90.	89.
87.	86.	84.	83.	82.	80.	79.	78.	77.	75.
74.	73.	72.	71.	70.	69.	67.	66.	65.	64.

STORAGE

28709.	28669.	28529.	29590.	28551.	28475.	28437.	28400.	28364.
28330.	28297.	28267.	28240.	28214.	28162.	28136.	28109.	28083.
28058.	28039.	28031.	28040.	28078.	28085.	28062.	29483.	30240.
31013.	31700.	32244.	32646.	32920.	33084.	33178.	33146.	33081.
32994.	32894.	32791.	32691.	32593.	32492.	32285.	32179.	32074.
31968.	31862.	31757.	31653.	31550.	31448.	31347.	31151.	31055.
30961.	30969.	30779.	30691.	30605.	30520.	30437.	30276.	30198.
30121.	30046.	29973.	29901.	29830.	29762.	29695.	29565.	29503.
29442.	29382.	29324.	29267.	29212.	29159.	29106.	29005.	28957.
28910.	28864.	28819.	28775.	28733.	28691.	28650.	28569.	28530.
28491.	28453.	28416.	28379.	28342.	28306.	28271.	28236.	28168.
28135.	28102.	28070.	28033.	27997.	27976.	27946.	27886.	27858.
27829.	27801.	27774.	27747.	27720.	27694.	27668.	27617.	27593.
27569.	27545.	27521.	27498.	27475.	27453.	27431.	27388.	27367.
27346.	27326.	27306.	27286.	27267.	27248.	27229.	27192.	27174.
27157.	27139.	27122.	27106.	27089.	27073.	27057.	27026.	27010.
26995.	26980.	26966.	26952.	26938.	26924.	26910.	26884.	26871.
26858.	26845.	26833.	26821.	26809.	26797.	26785.	26774.	26751.
26741.	26730.	26719.	26709.	26699.	26689.	26679.	26659.	26650.
26641.	26632.	26623.	26614.	26605.	26597.	26588.	26572.	26564.

STAGE

788.0	788.0	787.9	787.9	787.9	787.9	787.8	787.8	787.8
787.8	787.8	787.7	787.7	787.7	787.7	787.7	787.7	787.7
787.6	787.6	787.6	787.6	787.6	787.6	787.6	787.6	787.6
789.2	789.6	789.9	790.1	790.2	790.3	790.4	790.3	790.3
790.3	790.2	790.2	790.1	790.0	790.0	789.9	789.8	789.8
789.7	789.7	789.6	789.5	789.5	789.4	789.3	789.2	789.2
789.2	789.1	789.0	789.0	788.9	788.9	788.9	788.8	788.8
788.7	788.7	788.6	788.6	788.5	788.5	788.5	788.4	788.4
788.4	788.3	788.3	788.3	788.2	788.2	788.2	788.1	788.1
788.1	788.1	788.0	788.0	788.0	787.9	787.9	787.9	787.9
787.9	787.8	787.8	787.8	787.7	787.7	787.7	787.7	787.7
787.7	787.7	787.6	787.6	787.6	787.6	787.6	787.5	787.5
787.5	787.5	787.5	787.5	787.4	787.4	787.4	787.4	787.4
787.4	787.4	787.4	787.3	787.3	787.3	787.3	787.3	787.3
787.3	787.3	787.2	787.2	787.2	787.2	787.2	787.2	787.2
787.2	787.2	787.2	787.1	787.1	787.1	787.1	787.1	787.1
787.1	787.1	787.1	787.1	787.0	787.0	787.0	787.0	787.0
787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0
787.0	786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9
786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9

PEAK OUTFLOW IS 1807. AT TIME 57.00 HOURS

PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
1807.	1775.	1513.	1074.	85371.
51.	50.	43.	30.	2417.
CFS	0.42	1.44	3.06	5.07
INCHES	10.71	36.52	77.75	128.81
AC-FT	880.	3000.	6388.	10583.
THOUS CU M	1086.	3701.	7879.	13054.

[illegible]

15.00 58.1 0
16.30 59.1 0
18.00 60.1 0
19.30 61.1 0
21.00 62.1 0
22.30 63.1 0
0. 64.1 0
1.30 65.1 0
3.00 66.1 0
4.30 67.1 0
6.00 68.1 0
7.30 69.1 0
9.00 70.1 0
10.30 71.1 0
12.30 72.1 0
13.30 73.1 0
15.00 74.1 0
16.30 75.1 0
18.00 76.1 0
19.30 77.1 0
21.00 78.1 0
22.30 79.1 0
0. 80.1 0
1.30 81.1 0
3.00 82.1 0
4.30 83.1 0
6.00 84.1 0
7.30 85.1 0
9.00 86.1 0
10.30 87.1 0
12.00 88.1 0
13.30 89.1 0
15.00 90.1 0
16.30 91.1 0
18.00 92.1 0
19.30 93.1 0
21.00 94.1 0
22.30 95.1 0
0. 96.1 0
1.30 97.1 0
3.00 98.1 0
4.30 99.1 0
6.00 100.1 0
7.30 101.1 0
9.00 102.1 0
10.30 103.1 0
12.00 104.1 0
13.30 105.1 0
15.00 106.1 0
16.30 107.1 0
18.00 108.1 0
19.30 109.1 0
21.00 110.1 0
22.30 111.1 0
0. 112.1 0
1.30 113.1 0
3.00 114.1 0
4.30 115.1 0
6.00 116.1 0
7.30 117.1 0
9.00 118.1 0
10.30 119.1 0
12.00 120.1 0
13.30 121.1 0
15.00 122.1 0
16.30 123.1 0
18.00 124.1 0
19.30 125.1 0
21.00 126.1 0
22.30 127.1 0
0. 128.1 0
1.30 129.1 0
3.00 130.1 0
4.30 131.1 0
6.00 132.1 0
7.30 133.1 0
9.00 134.1 0
10.30 135.1 0
12.00 136.1 0
13.30 137.1 0
15.00 138.1 0
16.30 139.1 0
18.00 140.1 0
19.30 141.1 0
21.00 142.1 0
22.30 143.1 0
0. 144.1 0
1.30 145.1 0
3.00 146.1 0
4.30 147.1 0
6.00 148.1 0
7.30 149.1 0
9.00 150.1 0
10.30 151.1 0
12.00 152.1 0
13.30 153.1 0
15.00 154.1 0
16.30 155.1 0
18.00 156.1 0
19.30 157.1 0
21.00 158.1 0
22.30 159.1 0
0. 160.1 0
1.30 161.1 0
3.00 162.1 0
4.30 163.1 0
6.00 164.1 0
7.30 165.1 0
9.00 166.1 0
10.30 167.1 0
12.00 168.1 0
13.30 169.1 0
15.00 170.1 0
16.30 171.1 0
18.00 172.1 0
19.30 173.1 0
21.00 174.1 0
22.30 175.1 0
0. 176.1 0
1.30 177.1 0
3.00 178.1 0
4.30 179.1 0
6.00 180.1 0
7.30 181.1 0
9.00 182.1 0
10.30 183.1 0
12.00 184.1 0
13.30 185.1 0
15.00 186.1 0
16.30 187.1 0
18.00 188.1 0
19.30 189.1 0
21.00 190.1 0
22.30 191.1 0
0. 192.1 0
1.30 193.1 0
3.00 194.1 0
4.30 195.1 0
6.00 196.1 0
7.30 197.1 0
9.00 198.1 0
10.30 199.1 0
12.00 200.1 0
13.30 201.1 0
15.00 202.1 0
16.30 203.1 0
18.00 204.1 0
19.30 205.1 0
21.00 206.1 0
22.30 207.1 0
0. 208.1 0
1.30 209.1 0
3.00 210.1 0
4.30 211.1 0
6.00 212.1 0
7.30 213.1 0
9.00 214.1 0
10.30 215.1 0
12.00 216.1 0
13.30 217.1 0
15.00 218.1 0
16.30 219.1 0
18.00 220.1 0
19.30 221.1 0
21.00 222.1 0
22.30 223.1 0
0. 224.1 0
1.30 225.1 0
3.00 226.1 0
4.30 227.1 0
6.00 228.1 0
7.30 229.1 0
9.00 230.1 0
10.30 231.1 0
12.00 232.1 0
13.30 233.1 0
15.00 234.1 0
16.30 235.1 0
18.00 236.1 0
19.30 237.1 0
21.00 238.1 0
22.30 239.1 0
0. 240.1 0
1.30 241.1 0
3.00 242.1 0
4.30 243.1 0
6.00 244.1 0
7.30 245.1 0
9.00 246.1 0
10.30 247.1 0
12.00 248.1 0
13.30 249.1 0
15.00 250.1 0
16.30 251.1 0
18.00 252.1 0
19.30 253.1 0
21.00 254.1 0
22.30 255.1 0
0. 256.1 0
1.30 257.1 0
3.00 258.1 0
4.30 259.1 0
6.00 260.1 0
7.30 261.1 0
9.00 262.1 0
10.30 263.1 0
12.00 264.1 0
13.30 265.1 0
15.00 266.1 0
16.30 267.1 0
18.00 268.1 0
19.30 269.1 0
21.00 270.1 0
22.30 271.1 0
0. 272.1 0
1.30 273.1 0
3.00 274.1 0
4.30 275.1 0
6.00 276.1 0
7.30 277.1 0
9.00 278.1 0
10.30 279.1 0
12.00 280.1 0
13.30 281.1 0
15.00 282.1 0
16.30 283.1 0
18.00 284.1 0
19.30 285.1 0
21.00 286.1 0
22.30 287.1 0
0. 288.1 0
1.30 289.1 0
3.00 290.1 0
4.30 291.1 0
6.00 292.1 0
7.30 293.1 0
9.00 294.1 0
10.30 295.1 0
12.00 296.1 0
13.30 297.1 0
15.00 298.1 0
16.30 299.1 0
18.00 300.1 0
19.30 301.1 0
21.00 302.1 0
22.30 303.1 0
0. 304.1 0
1.30 305.1 0
3.00 306.1 0
4.30 307.1 0
6.00 308.1 0
7.30 309.1 0
9.00 310.1 0
10.30 311.1 0
12.00 312.1 0
13.30 313.1 0
15.00 314.1 0
16.30 315.1 0
18.00 316.1 0
19.30 317.1 0
21.00 318.1 0
22.30 319.1 0
0. 320.1 0
1.30 321.1 0
3.00 322.1 0
4.30 323.1 0
6.00 324.1 0
7.30 325.1 0
9.00 326.1 0
10.30 327.1 0
12.00 328.1 0
13.30 329.1 0
15.00 330.1 0
16.30 331.1 0
18.00 332.1 0
19.30 333.1 0
21.00 334.1 0
22.30 335.1 0
0. 336.1 0
1.30 337.1 0
3.00 338.1 0
4.30 339.1 0
6.00 340.1 0
7.30 341.1 0
9.00 342.1 0
10.30 343.1 0
12.00 344.1 0
13.30 345.1 0
15.00 346.1 0
16.30 347.1 0
18.00 348.1 0
19.30 349.1 0
21.00 350.1 0
22.30 351.1 0
0. 352.1 0
1.30 353.1 0
3.00 354.1 0
4.30 355.1 0
6.00 356.1 0
7.30 357.1 0
9.00 358.1 0
10.30 359.1 0
12.00 360.1 0
13.30 361.1 0
15.00 362.1 0
16.30 363.1 0
18.00 364.1 0
19.30 365.1 0
21.00 366.1 0
22.30 367.1 0
0. 368.1 0
1.30 369.1 0
3.00 370.1 0
4.30 371.1 0
6.00 372.1 0
7.30 373.1 0
9.00 374.1 0
10.30 375.1 0
12.00 376.1 0
13.30 377.1 0
15.00 378.1 0
16.30 379.1 0
18.00 380.1 0
19.30 381.1 0
21.00 382.1 0
22.30 383.1 0
0. 384.1 0
1.30 385.1 0
3.00 386.1 0
4.30 387.1 0
6.00 388.1 0
7.30 389.1 0
9.00 390.1 0
10.30 391.1 0
12.00 392.1 0
13.30 393.1 0
15.00 394.1 0
16.30 395.1 0
18.00 396.1 0
19.30 397.1 0
21.00 398.1 0
22.30 399.1 0
0. 400.1 0
1.30 401.1 0
3.00 402.1 0
4.30 403.1 0
6.00 404.1 0
7.30 405.1 0
9.00 406.1 0
10.30 407.1 0
12.00 408.1 0
13.30 409.1 0
15.00 410.1 0
16.30 411.1 0
18.00 412.1 0
19.30 413.1 0
21.00 414.1 0
22.30 415.1 0
0. 416.1 0
1.30 417.1 0
3.00 418.1 0
4.30 419.1 0
6.00 420.1 0
7.30 421.1 0
9.00 422.1 0
10.30 423.1 0
12.00 424.1 0
13.30 425.1 0
15.00 426.1 0
16.30 427.1 0
18.00 428.1 0
19.30 429.1 0
21.00 430.1 0
22.30 431.1 0
0. 432.1 0
1.30 433.1 0
3.00 434.1 0
4.30 435.1 0
6.00 436.1 0
7.30 437.1 0
9.00 438.1 0
10.30 439.1 0
12.00 440.1 0
13.30 441.1 0
15.00 442.1 0
16.30 443.1 0
18.00 444.1 0
19.30 445.1 0
21.00 446.1 0
22.30 447.1 0
0. 448.1 0
1.30 449.1 0
3.00 450.1 0
4.30 451.1 0
6.00 452.1 0
7.30 453.1 0
9.00 454.1 0
10.30 455.1 0
12.00 456.1 0
13.30 457.1 0
15.00 458.1 0
16.30 459.1 0
18.00 460.1 0
19.30 461.1 0
21.00 462.1 0
22.30 463.1 0
0. 464.1 0
1.30 465.1 0
3.00 466.1 0
4.30 467.1 0
6.00 468.1 0
7.30 469.1 0
9.00 470.1 0
10.30 471.1 0
12.00 472.1 0
13.30 473.1 0
15.00 474.1 0
16.30 475.1 0
18.00 476.1 0
19.30 477.1 0
21.00 478.1 0
22.30 479.1 0
0. 480.1 0
1.30 481.1 0
3.00 482.1 0
4.30 483.1 0
6.00 484.1 0
7.30 485.1 0
9.00 486.1 0
10.30 487.1 0
12.00 488.1 0
13.30 489.1 0
15.00 490.1 0
16.30 491.1 0
18.00 492.1 0
19.30 493.1 0
21.00 494.1 0
22.30 495.1 0
0. 496.1 0
1.30 497.1 0
3.00 498.1 0
4.30 499.1 0
6.00 500.1 0
7.30 501.1 0
9.00 502.1 0
10.30 503.1 0
12.00 504.1 0
13.30 505.1 0
15.00 506.1 0
16.30 507.1 0
18.00 508.1 0
19.30 509.1 0
21.00 510.1 0
22.30 511.1 0
0. 512.1 0
1.30 513.1 0
3.00 514.1 0
4.30 515.1 0
6.00 516.1 0
7.30 517.1 0
9.00 518.1 0
10.30 519.1 0
12.00 520.1 0
13.30 521.1 0
15.00 522.1 0
16.30 523.1 0
18.00 524.1 0
19.30 525.1 0
21.00 526.1 0
22.30 527.1 0
0. 528.1 0
1.30 529.1 0
3.00 530.1 0
4.30 531.1 0
6.00 532.1 0
7.30 533.1 0
9.00 534.1 0
10.30 535.1 0
12.00 536.1 0
13.30 537.1 0
15.00 538.1 0
16.30 539.1 0
18.00 540.1 0
19.30 541.1 0
21.00 542.1 0
22.30 543.1 0
0. 544.1 0
1.30 545.1 0
3.00 546.1 0
4.30 547.1 0
6.00 548.1 0
7.30 549.1 0
9.00 550.1 0
10.30 551.1 0
12.00 552.1 0
13.30 553.1 0
15.00 554.1 0
16.30 555.1 0
18.00 556.1 0
19.30 557.1 0
21.00 558.1 0
22.30 559.1 0
0. 560.1 0
1.30 561.1 0
3.00 562.1 0
4.30 563.1 0
6.00 564.1 0
7.30 565.1 0
9.00 566.1 0
10.30 567.1 0
12.00 568.1 0
13.30 569.1 0
15.00 570.1 0
16.30 571.1 0
18.00 572.1 0
19.30 573.1 0
21.00 574.1 0
22.30 575.1 0
0. 576.1 0
1.30 577.1 0
3.00 578.1 0
4.30 579.1 0
6.00 580.1 0
7.30 581.1 0
9.00 582.1 0
10.30 583.1 0
12.00 584.1 0
13.30 585.1 0
15.00 586.1 0
16.30 587.1 0
18.00 588.1 0
19.30 589.1 0
21.00 590.1 0
22.30 591.1 0
0. 592.1 0
1.30 593.1 0
3.00 594.1 0
4.30 595.1 0
6.00 596.1 0
7.30 597.1 0
9.00 598.1 0
10.30 599.1 0
12.00 600.1 0
13.30 601.1 0
15.00 602.1 0
16.30 603.1 0
18.00 604.1 0
19.30 605.1 0
21.00 606.1 0
22.30 607.1 0
0. 608.1 0
1.30 609.1 0
3.00 610.1 0
4.30 611.1 0
6.00 612.1 0
7.30 613.1 0
9.00 614.1 0
10.30 615.1 0
12.00 616.1 0
13.30 617.1 0
15.00 618.1 0
16.30 619.1 0
18.00 620.1 0
19.30 621.1 0
21.00 622.1 0
22.30 623.1 0
0. 624.1 0
1.30 625.1 0
3.00 626.1 0
4.30 627.1 0
6.00 628.1 0
7.30 629.1 0
9.00 630.1 0
10.30 631.1 0
12.00 632.1 0
13.30 633.1 0
15.00 634.1 0
16.30 635.1 0
18.00 636.1 0
19.30 637.1 0
21.00 638.1 0
22.30 639.1 0
0. 640.1 0
1.30 641.1 0
3.00 642.1 0
4.30 643.1 0
6.00 644.1 0
7.30 645.1 0
9.00 646.1 0
10.30 647.1 0
12.00 648.1 0
13.30 649.1 0
15.00 650.1 0
16.30 651.1 0
18.00 652.1 0
19.30 653.1 0
21.00 654.1 0
22.30 655.1 0
0. 656.1 0
1.30 657.1 0
3.00 658.1 0
4.30 659.1 0
6.00 660.1 0
7.30 661.1 0
9.00 662.1 0
10.30 663.1 0
12.00 664.1 0
13.30 665.1 0
15.00 666.1 0
16.30 667.1 0
18.00 668.1 0
19.30 669.1 0
21.00 670.1 0
22.30 671.1 0
0. 672.1 0
1.30 673.1 0
3.00 674.1 0
4.30 675.1 0
6.00 676.1 0
7.30 677.1 0
9.00 678.1 0
10.30 679.1 0
12.00 680.1 0
13.30 681.1 0
15.00 682.1 0
16.30 683.1 0
18.00 684.1 0
19.30 685.1 0
21.00 686.1 0
22.30 687.1 0
0. 688.1 0
1.30 689.1 0
3.00 690.1 0
4.30 691.1 0
6.00 692.1 0
7.30 693.1 0
9.00 694.1 0
10.30 695.1 0
12.00 696.1 0
13.30 697.1 0
15.00 698.1 0
16.30 699.1 0
18.00 700.1 0
19.30 701.1 0
21.00 702.1 0
22.30 703.1 0
0. 704.1 0
1.30 705.1 0
3.00 706.1 0
4.30 707.1 0
6.00 708.1 0
7.30 709.1 0
9.00 710.1 0
10.30 711.1 0
12.00 712.1 0
13.30 713.1 0
15.00 714.1 0
16.30 715.1 0
18.00 716.1 0
19.30 717.1 0
21.00 718.1 0
22.30 719.1 0
0. 720.1 0
1.30 721.1 0
3.00 722.1 0
4.30 723.1 0
6.00 724.1 0
7.30 725.1 0
9.00 726.1 0
10.30 727.1 0
12.00 728.1 0
13.30 729.1 0
15.00 730.1 0
16.30 731.1 0
18.00 732.1 0
19.30 733.1 0
21.00 734.1 0
22.30 735.1 0
0. 736.1 0
1.30 737.1 0
3.00 738.1 0
4.30 739.1 0
6.00 740.1 0
7.30 741.1 0
9.00 742.1 0
10.30 743.1 0
12.00 744.1 0
13.30 745.1 0
15.00 746.1 0
16.30 747.1 0
18.00 748.1 0
19.30 749.1 0
21.00 750.1 0
22.30 751.1 0
0. 752.1 0
1.30 753.1 0
3.00 754.1 0
4.30 755.1 0
6.00 756.1 0
7.30 757.1 0
9.00 758.1 0
10.30 759.1 0
12.00 760.1 0
13.30 761.1 0
15.00 762.1 0
16.30 763.1 0
18.00 764.1 0
19.30 765.1 0
21.00 766.1 0
22.30 767.1 0
0. 768.1 0
1.30 769.1 0
3.00 770.1 0
4.30 771.1 0
6.00 772.1 0
7.30 773.1 0
9.00 774.1 0
10.30 775.1 0
12.00 776.1 0
13.30 777.1 0
15.00 778.1 0
16.30 779.1 0
18.00 780.1 0
19.30 781.1 0
21.00 782.1 0
22.30 783.1 0
0. 784.1 0
1.30 785.1 0
3.00 786.1 0
4.30 787.1 0
6.00 788.1 0
7.30 789.1 0
9.00 790.1 0
10.30 791.1 0
12.00 792.1 0
13.30 793.1 0
15.00 794.1 0
16.30 795.1 0
18.00 796.1 0
19.30 797.1 0
21.00 798.1 0
22.30 799.1 0
0. 800.1 0
1.30 801.1 0
3.00 802.1 0
4.30 803.1 0
6.00 804.1 0
7.30 805.1 0
9.00 806.1 0
10.30 807.1 0
12.00 808.1 0
13.30 809.1 0
15.00 810.1 0
16.30 811.1 0
18.00 812.1 0
19.30 813.1 0
21.00 814.1 0
22.30 815.1 0
0. 816.1 0
1.30 817.1 0
3.00 818.1 0
4.30 819.1 0
6.00 820.1 0
7.30 821.1 0
9.00 822.1 0
10.30 823.1 0
12.00 824.1 0
13.30 825.1 0
15.00 826.1 0
16.30 827.1 0
18.00 828.1 0
19.30 829.1 0
21.00 830.1 0
22.30 831.1 0
0. 832.1 0
1.30 833.1 0
3.00 834.1 0
4.30 835.1 0
6.00 836.1 0
7.30 837.1 0
9.00 838.1 0
10.30 839.1 0
12.00 840.1 0
13.30 841.1 0
15.00 842.1 0
16.30 843.1 0
18.00 844.1 0
19.30 845.1 0
21.00 846.1 0
22.30 847.1 0
0. 848.1 0
1.30 849.1 0
3.00 850.1 0
4.30 851.1 0
6.00 852.1 0
7.30 853.1 0
9.00 854.1 0
10.30 855.1 0
12.00 856.1 0
13.30 857.1 0
15.00 858.1 0
16.30 859.1 0
18.00 860.1 0
19.30 861.1 0
21.00 862.1 0
22.30 863.1 0
0. 864.1 0
1.30 865.1 0
3.00 866.1 0
4.30 867.1 0
6.00 868.1 0
7.30 869.1 0
9.00 870.1 0
10.30 871.1 0
12.00 872.1 0
13.30 873.1 0
15.00 874.1 0
16.30 875.1 0
18.00 876.1 0
19.30 877.1 0
21.00 878.1 0
22.30 879.1 0
0. 880.1 0
1.30 881.1 0
3.00 882.1 0
4.30 883.1 0
6.00 884.1 0
7.30 885.1 0
9.00 886.1 0
10.30 887.1 0
12.00 888.1 0
13.30 889.1 0
15.00 890.1 0
16.30 891.1 0
18.00 892.1 0
19.30 893.1 0
21.00 894.1 0
22.30 895.1 0
0. 896.1 0
1.30 897.1 0
3.00 898.1 0
4.30 899.1 0
6.00 900.1 0
7.30 901.1 0
9.00 902.1 0
10.30 903.1 0
12.00 904.1 0
13.30 905.1 0
15.00 906.1 0
16.30 907.1 0
18.00 908.1 0
19.30 909.1 0
21.00 910.1 0
22.30 911.1 0
0. 912.1 0
1.30 913.1 0
3.00 914.1 0
4.30 915.1 0
6.00 916.1 0

12.001201.0
13.301211.0
15.301221.0
16.301231.0
18.301241.0
19.301251.0
21.001261.0
22.301271.0
0.1281.0
1.301291.0
3.001301.0
4.301311.0
6.001321.0
7.301331.0
9.001341.0
10.301351.0
12.001361.0
13.301371.0
15.001381.0
16.301391.0
18.001401.0
19.301411.0
21.001421.0
22.301431.0
0.1441.0
1.301451.0
3.001461.0
4.301471.0
6.001481.0
7.301491.0
9.001501.0
10.301511.0
12.001521.0
13.301531.0
15.001541.0
16.301551.0
18.001561.0
19.301571.0
21.001581.0
22.301591.0
0.1601.0
1.301611.0
3.001621.0
4.301631.0
6.001641.0
7.301651.0
9.001661.0
10.301671.0
12.001681.0
13.301691.0
15.001701.0
16.301711.0
18.001721.0
19.301731.0
21.001741.0
22.301751.0
0.1761.0
1.301771.0
3.001781.0
4.301791.0
6.001801.0
7.301811.0

9.0018210
10.3013310
12.0018410
13.3018510
15.0018610
16.3018710
18.0018810
19.3018910
21.0019010
22.3019110
0. 19210
1.3019310
3.0019410
4.3019510
6.0019610
7.3019710
9.0019810
10.3019910
12.0020010

•OVN•

WARNING *** TOP OF DAM, BOTTOM OF BREACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSUMED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 2
 END-OF-PERIOD HYDROGRAPH ORDINATES

		OUTFLOW			
342.	357.	327.	317.	313.	308.
294.	291.	322.	280.	278.	275.
267.	265.	282.	319.	415.	619.
2721.	4301.	288.	6267.	5972.	5558.
4268.	3830.	6394.	2618.	2440.	2273.
1828.	1697.	3069.	1331.	1298.	1231.
1165.	1133.	1461.	1008.	978.	948.
864.	837.	1038.	744.	725.	706.
652.	635.	763.	570.	554.	539.
497.	483.	585.	433.	421.	409.
376.	366.	445.	341.	330.	325.
310.	305.	346.	286.	282.	277.
264.	260.	291.	244.	236.	229.
225.	222.	248.	205.	201.	195.
192.	189.	211.	177.	172.	169.
164.	161.	180.	151.	146.	142.
139.	137.	153.	129.	125.	121.
101.	100.	131.	110.	106.	103.
86.	85.	113.	93.	90.	88.
		95.	80.	78.	76.
		81.			

		STORAGE			
28711.	28672.	28558.	28521.	28484.	28447.
28343.	28313.	28251.	28234.	28215.	28194.
28133.	28125.	28292.	28346.	29046.	29936.
34196.	35379.	36708.	36663.	36490.	36260.
35356.	35049.	34290.	34081.	33883.	33521.
33201.	33056.	32673.	32556.	32440.	32324.
31978.	31865.	31643.	31428.	31324.	31221.
30927.	30833.	30565.	30480.	30397.	30315.
30079.	30004.	29859.	29721.	29554.	29589.
29403.	29344.	29287.	29176.	29072.	29021.
28878.	28833.	28704.	28662.	28622.	28581.
28464.	28426.	28316.	28281.	28246.	28211.
28111.	28079.	27985.	27954.	27924.	27895.
27809.	27781.	27727.	27675.	27649.	27624.
27551.	27528.	27459.	27437.	27415.	27394.
27331.	27311.	27253.	27234.	27215.	27197.
27144.	27127.	27094.	27061.	27045.	27030.
26985.	26970.	26926.	26914.	26900.	26887.
26849.	26836.	26800.	26788.	26777.	26766.
26733.	26722.	26691.	26682.	26672.	26662.
		26702.			

		STAGE			
788.0	788.0	787.9	787.9	787.9	787.8
787.8	787.8	787.7	787.7	787.7	787.7
787.7	787.7	787.7	787.7	787.7	787.7
790.9	791.5	787.7	787.9	788.2	788.6
791.5	791.3	792.1	792.2	792.1	792.0
790.4	790.3	791.2	790.9	790.8	790.6
790.3	790.3	790.2	790.1	790.0	789.9
790.2	790.2	790.2	790.1	790.0	789.8
790.1	790.1	790.1	790.0	790.0	789.7
790.0	790.0	790.0	790.0	790.0	789.6
789.9	789.9	789.9	789.8	789.7	789.5
789.8	789.8	789.8	789.7	789.6	789.4
789.7	789.7	789.7	789.6	789.5	789.3
789.6	789.6	789.6	789.5	789.4	789.2

789.2	789.1	789.1	789.0	789.0	788.9	788.9	788.8	788.8	788.7
788.7	788.7	783.6	788.6	788.6	788.5	788.5	788.4	788.4	788.4
788.3	788.3	783.3	788.2	788.2	788.2	788.2	788.1	788.1	788.1
788.1	788.0	783.0	788.0	788.0	788.0	787.9	787.9	787.9	787.9
787.9	787.8	787.8	787.8	787.8	787.8	787.7	787.7	787.7	787.7
787.7	787.6	787.6	787.6	787.6	787.6	787.6	787.6	787.5	787.5
787.5	787.5	787.5	787.5	787.5	787.4	787.4	787.4	787.4	787.4
787.4	787.4	787.4	787.3	787.3	787.3	787.3	787.3	787.3	787.3
787.3	787.2	787.2	787.2	787.2	787.2	787.2	787.2	787.2	787.2
787.2	787.2	787.1	787.1	787.1	787.1	787.1	787.1	787.1	787.1
787.1	787.1	787.1	787.0	787.0	787.0	787.0	787.0	787.0	787.0
787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0
786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9	786.9

PEAK OUTFLOW IS 6347. AT TIME 52.50 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	6347.	6103.	4527.	2352.	152798.
CMS	180.	173.	128.	67.	4327.
INCHES		1.45	4.30	6.71	9.08
MM		36.83	109.26	170.37	230.54
AC-FT		3026.	8977.	13998.	18942.
THOUS CU M		3733.	11073.	17266.	25364.

STATION 1

[illegible]

15.00 58.1 0
16.30 59.1 0
18.30 60.1 0
19.30 61.1 0
21.30 62.1 0
22.30 63.1 0
0. 64.1 0
1.30 65.1 0
3.00 66.1 0
4.30 67.1 0
5.30 68.1 0
7.30 69.1 0
9.00 70.1 0
10.30 71.1 0
12.00 72.1 0
13.30 73.1 0
15.30 74.1 0
16.30 75.1 0
18.00 76.1 0
19.30 77.1 0
21.00 78.1 0
22.30 79.1 0
0. 80.1 0
1.30 81.1 0
3.00 82.1 0
4.30 83.1 0
6.00 84.1 0
7.30 85.1 0
9.00 86.1 0
10.30 87.1 0
12.00 88.1 0
13.30 89.1 0
15.00 90.1 0
16.30 91.1 0
18.00 92.1 0
19.30 93.1 0
21.30 94.1 0
22.30 95.1 0
0. 96.1 0
1.30 97.1 0
3.00 98.1 0
4.30 99.1 0
6.00 100.1 0
7.30 101.1 0
9.00 102.1 0
10.30 103.1 0
12.00 104.1 0
13.30 105.1 0
15.00 106.1 0
16.30 107.1 0
18.00 108.1 0
19.30 109.1 0
21.00 110.1 0
22.30 111.1 0
0. 112.1 0
1.30 113.1 0
3.00 114.1 0
4.30 115.1 0
6.00 116.1 0
7.30 117.1 0
9.00 118.1 0
10.30 119.1 0

12.0012010.....
13.3012110.....
15.0012210.....
16.3012310.....
18.0012410.....
19.3012510.....
21.0012610.....
22.3012710.....
0. 12810.....
1.3012910.....
3.0013010.....
4.3013110.....
6.0013210.....
7.3013310.....
9.0013410.....
10.3013510.....
12.0013610.....
13.3013710.....
15.0013810.....
16.3013910.....
18.0014010.....
19.3014110.....
21.0014210.....
22.3014310.....
0. 14410.....
1.3014510.....
3.0014610.....
4.3014710.....
6.0014810.....
7.3014910.....
9.0015010.....
10.3015110.....
12.0015210.....
13.3015310.....
15.0015410.....
16.3015510.....
18.0015610.....
19.3015710.....
21.0015810.....
22.3015910.....
0. 16010.....
1.3016110.....
3.0016210.....
4.3016310.....
6.0016410.....
7.3016510.....
9.0016610.....
10.3016710.....
12.0016810.....
13.3016910.....
15.0017010.....
16.3017110.....
18.0017210.....
19.3017310.....
21.0017410.....
22.3017510.....
0. 17610.....
1.3017710.....
3.0017810.....
4.3017910.....
6.0018010.....
7.3018110.....

9.001821
10.301931
12.301841
13.301851
15.001861
16.301371
18.001881
19.301991
21.301901
22.301911
0. 1921
1.301931
3.001941
4.301951
5.001961
7.301971
9.001981
10.301991
12.002001

•OVN•

WARNING *** TOP OF DAM, BOTTOM OF BREACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSUMED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 3

END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW	
342.	337.
295.	292.
272.	272.
4659.	6772.
5337.	4739.
2138.	1991.
1240.	1207.
928.	899.
693.	675.
529.	515.
401.	390.
322.	317.
274.	270.
234.	230.
199.	196.
170.	167.
145.	142.
123.	121.
105.	103.
89.	88.
327.	332.
287.	289.
284.	275.
8827.	8197.
3837.	4284.
1721.	1852.
1141.	1174.
845.	872.
640.	675.
487.	501.
369.	380.
307.	312.
261.	266.
223.	226.
190.	193.
162.	164.
138.	140.
117.	119.
100.	102.
85.	87.
318.	313.
283.	281.
8608.	8084.
3090.	2822.
1484.	1377.
1078.	1047.
792.	769.
606.	590.
461.	474.
349.	343.
297.	292.
253.	249.
219.	212.
184.	181.
159.	154.
136.	133.
116.	112.
98.	95.
84.	81.
309.	304.
279.	276.
742.	1187.
7426.	6708.
2637.	2461.
1339.	1306.
1016.	986.
750.	730.
574.	559.
436.	424.
337.	332.
288.	283.
249.	241.
209.	206.
178.	175.
152.	149.
129.	127.
110.	108.
94.	92.
80.	79.

STORAGE

28712.	28674.	28536.	28562.	28525.	28489.	28453.	28417.	28382.
28349.	28321.	28299.	28269.	28256.	28241.	28223.	28204.	28185.
29170.	28168.	28193.	28260.	28399.	29354.	30470.	32053.	33894.
35630.	36945.	37738.	38089.	38130.	37967.	37309.	36909.	36503.
36105.	35721.	35367.	35054.	34777.	34530.	34102.	33907.	33722.
33547.	33383.	33228.	33082.	32946.	32818.	32583.	32468.	32352.
32237.	32122.	32008.	31895.	31783.	31673.	31564.	31353.	31250.
31149.	31051.	30954.	30860.	30768.	30679.	30505.	30421.	30339.
30258.	30179.	30102.	30027.	29953.	29881.	29741.	29674.	29609.
29545.	29482.	29422.	29362.	29304.	29248.	29140.	29088.	29037.
28987.	28939.	2892.	28847.	28802.	28759.	28675.	28634.	28594.
28554.	28515.	28476.	28439.	28401.	28364.	28292.	28257.	28222.
28148.	28154.	28121.	28089.	28057.	28025.	27964.	27933.	27904.
27875.	27846.	27818.	27790.	27763.	27736.	27683.	27657.	27632.
27379.	27353.	27359.	27335.	27312.	27289.	27244.	27222.	27200.
27195.	27167.	27150.	27132.	27115.	27099.	27066.	27050.	27035.
27019.	27004.	26989.	26975.	26960.	26946.	26918.	26905.	26891.
26878.	26865.	26853.	26840.	26828.	26816.	26792.	26780.	26769.
26758.	26747.	26736.	26726.	26715.	26705.	26685.	26675.	26665.

STAGE

722.0	788.0	787.9	787.9	787.9	787.9	787.8	787.8	787.8
787.9	787.9	787.8	787.7	787.7	787.7	787.7	787.7	787.7
787.6	787.7	787.7	787.8	788.0	788.3	788.9	789.8	790.7
791.6	792.3	792.9	793.0	792.9	792.7	792.5	792.3	792.1
791.9	791.7	791.5	791.2	791.1	791.0	790.8	790.7	790.6
790.6	790.5	790.4	790.3	790.2	790.1	790.0	790.0	789.9
789.9	789.8	789.7	789.7	789.6	789.5	789.4	789.4	789.3

789.3	789.2	789.1	789.0	788.9	788.8
788.8	788.7	788.6	788.5	788.4	788.3
788.4	788.3	788.2	788.1	788.0	787.9
788.1	788.0	787.9	787.8	787.7	787.6
787.9	787.8	787.7	787.6	787.5	787.4
787.7	787.6	787.5	787.4	787.3	787.2
787.5	787.4	787.3	787.2	787.1	787.0
787.4	787.3	787.2	787.1	787.0	786.9
787.3	787.2	787.1	787.0	786.9	786.8
787.2	787.1	787.0	786.9	786.8	786.7
787.1	787.0	786.9	786.8	786.7	786.6
787.0	786.9	786.8	786.7	786.6	786.5
787.0	786.9	786.8	786.7	786.6	786.5

PEAK OUTFLOW IS 8901. AT TIME 52.50 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	8901.	8619.	6164.	3029.	186657.
CMS	252.	244.	175.	86.	5286.
INCHES		2.05	5.86	8.61	11.09
MM		52.02	148.80	218.70	281.63
AC-FT		4274.	12226.	17969.	23139.
THOUS CU M		5272.	15080.	22165.	28542.

• QVF •

STATION 1

INFLOW(I), OUTFLOW(O) AND OBSERVED FLOW(*)

[illegible]

15.00 58.1 0
16.30 59.1 0
18.00 60.1 0
19.30 61.1 0
21.00 62.1 0
22.30 63.1 0
0. 64.1 0
1.30 65.1 0
3.00 66.1 0
4.30 67.1 0
6.00 68.1 0
7.30 69.1 0
9.00 70.1 0
10.30 71.1 0
12.00 72.1 0
13.30 73.1 0
15.00 74.1 0
16.30 75.1 0
18.00 76.1 0
19.30 77.1 0
21.00 78.1 0
22.30 79.1 0
0. 80.1 0
1.30 81.1 0
3.00 82.1 0
4.30 83.1 0
6.00 84.1 0
7.30 85.1 0
9.00 86.1 0
10.30 87.1 0
12.00 88.1 0
13.30 89.1 0
15.00 90.1 0
16.30 91.1 0
18.00 92.1 0
19.30 93.1 0
21.00 94.1 0
22.30 95.1 0
0. 96.1 0
1.30 97.1 0
3.00 98.1 0
4.30 99.1 0
6.00 100.1 0
7.30 101.1 0
9.00 102.1 0
10.30 103.1 0
12.00 104.1 0
13.30 105.1 0
15.00 106.1 0
16.30 107.1 0
18.00 108.1 0
19.30 109.1 0
21.00 110.1 0
22.30 111.1 0
0. 112.1 0
1.30 113.1 0
3.00 114.1 0
4.30 115.1 0
6.00 116.1 0
7.30 117.1 0
9.00 118.1 0
10.30 119.1 0
12.00 120.1 0

12.0012010.....
13.3012110.....
15.0012210.....
16.3012310.....
18.0012410.....
19.3012510.....
21.0012610.....
22.3012710.....
0. 12810.....
1.3012910.....
3.0013010.....
4.3013110.....
6.0013210.....
7.3013310.....
9.0013410.....
10.3013510.....
12.0013610.....
13.3013710.....
15.0013810.....
16.3013910.....
18.0014010.....
19.3014110.....
21.0014210.....
22.3014310.....
0. 14410.....
1.3014510.....
3.0014610.....
4.3014710.....
6.0014810.....
7.3014910.....
9.0015010.....
10.3015110.....
12.0015210.....
13.3015310.....
15.0015410.....
16.3015510.....
19.0015610.....
19.3015710.....
21.0015810.....
22.3015910.....
0. 16010.....
1.3016110.....
3.0016210.....
4.3016310.....
6.0016410.....
7.3016510.....
9.0016610.....
10.3016710.....
12.0016810.....
13.3016910.....
15.0017010.....
16.3017110.....
18.0017210.....
19.3017310.....
21.0017410.....
22.3017510.....
0. 17610.....
1.3017710.....
3.0017810.....
4.3017910.....
6.0018010.....
7.3018110.....

9.0018210
10.3018310
12.0015410
13.301451
15.001861
16.301971
18.301881
19.301891
21.001901
22.301911
0. 1921
1.301931
3.001941
4.301951
6.001961
7.301971
9.001981
10.301991
12.002001

•OVN•

WARNING *** TOP OF DAM, BOTTOM OF BREACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSUMED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 4
 END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW	
342.	337.
296.	293.
277.	277.
6255.	9461.
6410.	5602.
2399.	2240.
1298.	1265.
980.	951.
727.	708.
557.	542.
423.	411.
331.	326.
283.	278.
241.	237.
205.	202.
175.	172.
149.	147.
127.	125.
108.	106.
92.	91.
333.	328.
290.	288.
282.	293.
11116.	11690.
5020.	4503.
2089.	1946.
1232.	1200.
922.	894.
727.	690.
527.	513.
400.	389.
321.	316.
274.	269.
233.	230.
199.	196.
169.	167.
144.	142.
123.	121.
105.	103.
89.	88.
314.	318.
285.	286.
556.	377.
10076.	10938.
3273.	3637.
1567.	1686.
1103.	1135.
814.	840.
620.	637.
472.	485.
357.	368.
301.	306.
257.	261.
219.	222.
186.	189.
159.	161.
135.	137.
117.	119.
98.	100.
84.	85.
309.	314.
283.	285.
885.	556.
9085.	10076.
2948.	3273.
1456.	1567.
1072.	1103.
766.	814.
604.	620.
447.	472.
342.	357.
292.	301.
249.	257.
212.	219.
181.	186.
154.	159.
131.	135.
112.	117.
95.	98.
81.	84.

STORAGE	
28713.	28676.
28356.	28330.
28208.	28211.
36991.	38408.
36743.	36291.
33835.	33560.
32441.	32326.
31334.	31232.
30407.	30326.
29664.	29599.
29080.	29029.
28625.	28588.
28252.	28217.
27929.	27899.
27654.	27628.
27419.	27397.
27219.	27200.
27048.	27032.
26903.	26889.
26779.	26767.
28439.	28602.
28310.	28297.
28247.	28333.
39198.	39472.
35383.	35521.
33492.	33333.
32211.	32097.
31131.	31033.
30245.	30167.
29535.	29473.
28980.	28932.
28548.	28509.
28183.	28149.
27870.	27842.
27604.	27579.
27376.	27355.
27182.	27164.
27017.	27002.
26889.	26851.
26756.	26745.
28493.	28529.
28267.	28279.
29661.	28382.
38701.	39113.
34659.	34913.
32911.	33043.
31761.	31872.
30753.	30844.
29941.	30015.
29296.	29353.
28796.	28840.
28395.	28433.
28052.	28084.
27759.	27786.
27509.	27532.
27295.	27315.
27113.	27130.
26972.	26972.
26826.	26838.
26713.	26724.
28458.	28529.
28252.	28279.
31002.	28382.
38228.	39113.
34231.	34913.
32786.	33043.
31652.	31872.
30576.	30844.
29799.	30015.
29185.	29353.
28710.	28840.
28322.	28433.
27990.	28084.
27705.	27786.
27463.	27532.
27256.	27315.
27080.	27130.
26930.	26972.
26802.	26838.
26693.	26724.
28458.	28529.
28252.	28279.
31002.	28382.
38228.	39113.
34231.	34913.
32786.	33043.
31652.	31872.
30576.	30844.
29799.	30015.
29185.	29353.
28710.	28840.
28322.	28433.
27990.	28084.
27705.	27786.
27463.	27532.
27256.	27315.
27080.	27130.
26930.	26972.
26802.	26838.
26693.	26724.

STAGE	
788.0	788.0
787.8	787.8
787.7	787.7
792.4	793.1
792.2	792.0
790.7	790.6
790.0	789.9
789.8	789.8
787.9	787.9
787.8	787.8
787.7	787.7
793.7	793.5
791.3	791.3
790.5	790.5
789.8	789.8
787.9	787.9
787.8	787.8
787.7	787.7
790.2	790.2
791.3	791.3
792.5	792.5
790.8	790.8
790.0	790.0
789.4	789.4
789.5	789.5
787.8	787.8
787.7	787.7
790.2	790.2
791.3	791.3
792.5	792.5
790.8	790.8
790.0	790.0
789.4	789.4
789.5	789.5

789.4	789.3	789.3	789.2	789.2	789.1	789.0	788.9
788.9	788.8	788.8	788.8	788.7	788.6	788.6	788.5
788.5	788.5	788.4	788.4	788.3	788.3	788.2	788.2
788.2	788.1	788.1	788.1	788.0	788.0	788.0	788.0
787.9	787.9	787.9	787.9	787.8	787.8	787.8	787.8
787.7	787.7	787.7	787.7	787.6	787.6	787.6	787.6
787.6	787.6	787.5	787.5	787.5	787.5	787.5	787.4
787.4	787.4	787.4	787.4	787.4	787.4	787.3	787.3
787.3	787.3	787.3	787.3	787.2	787.2	787.2	787.2
787.2	787.2	787.2	787.2	787.1	787.1	787.1	787.1
787.1	787.1	787.1	787.1	787.0	787.0	787.0	787.0
787.0	787.0	787.0	787.0	786.9	786.9	786.9	786.9

PEAK OUTFLOW IS 11690. AT TIME 51.00 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	11690.	11191.	7846.	3692.	220545.
CMS	331.	317.	222.	105.	6245.
INCHES		2.66	7.46	10.53	13.10
MM		67.54	189.40	267.41	332.76
AC-FT		5549.	15561.	21971.	27340.
THOUS CU M		6845.	19195.	27101.	33724.

STATION 1

INFLOW(I), OUTFLOW(O) AND OBSERVED FLOW(+)

[illegible]

15.30 58.1 0
16.30 59.1 0
18.00 60.1 0
19.30 51.1 0
21.00 42.1 0
22.30 53.1 0
0. 64.1 0
1.30 65.1 0
3.00 66.1 0
4.30 67.1 0
6.00 68.1 0
7.30 69.1 0
9.00 70.1 0
10.30 71.1 0
12.00 72.1 0
13.30 73.1 0
15.00 74.1 0
16.30 75.1 0
18.00 76.1 0
19.30 77.1 0
21.00 78.1 0
22.30 79.1 0
0. 80.1 0
1.30 81.1 0
3.00 82.1 0
4.30 83.1 0
6.00 84.1 0
7.30 85.1 0
9.00 86.1 0
10.30 87.1 0
12.00 88.1 0
13.30 89.1 0
15.00 90.1 0
16.30 91.1 0
18.00 92.1 0
19.30 93.1 0
21.00 94.1 0
22.30 95.1 0
0. 96.1 0
1.30 97.1 0
3.00 98.1 0
4.30 99.1 0
6.00 100.1 0
7.30 101.1 0
9.00 102.1 0
10.30 103.1 0
12.00 104.1 0
13.30 105.1 0
15.00 106.1 0
16.30 107.1 0
18.00 108.1 0
19.30 109.1 0
21.00 110.1 0
22.30 111.1 0

12-0012010
13-3012110
15-3012210
16-3012310
18-3012410
19-3012510
21-0012610
22-3012710
0-12810
1-3012910
3-0013010
4-3013110
6-0013210
7-3013310
9-3013410
10-3013510
12-0013610
13-3013710
15-0013810
16-3013910
18-0014010
19-3014110
21-3014210
22-3014310
0-1441
1-301451
3-001461
4-301471
6-301481
7-301491
9-001501
10-301511
12-001521
13-301531
15-301541
16-301551
18-001561
19-301571
21-001581
22-301591
0-1601
1-301611
3-001621
4-301631
6-001641
7-301651
9-001661
10-301671
12-001681
13-301691
15-001701
16-301711
18-001721
19-301731
21-301741
22-301751
0-1761
1-301771
3-001781
4-301791
6-001801

9.001821
10.301831
12.001841
13.301851
15.001861
16.301871
18.001881
19.301891
21.001901
22.301911
0. 1921
1.301931
3.001941
4.301951
6.001961
7.301971
9.001981
10.301991
12.002001

•OVN•

WARNING *** TOP OF DAM, BOTTOM OF REACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSUMED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 5

END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW	329.	333.	338.	342.
324.	329.	333.	338.	342.
292.	292.	293.	295.	298.
343.	312.	296.	288.	287.
1657.	17322.	17338.	15269.	11745.
15445.	5611.	6400.	7329.	8376.
4573.	2324.	2482.	2648.	2821.
2031.	1290.	1323.	1355.	1426.
1225.	976.	1006.	1036.	1066.
890.	725.	744.	763.	785.
688.	555.	570.	586.	602.
511.	421.	433.	446.	458.
399.	331.	336.	341.	347.
320.	282.	287.	291.	295.
273.	240.	244.	249.	252.
233.	205.	208.	212.	215.
198.	175.	177.	180.	183.
169.	149.	151.	156.	158.
146.	127.	129.	131.	133.
123.	108.	110.	111.	113.
105.	90.	93.	95.	96.
89.				

STORAGE

STORAGE	28573.	28538.	28503.	28468.	28433.	28399.
28573.	28538.	28503.	28468.	28433.	28399.	28364.
28325.	28320.	28325.	28310.	28299.	28288.	28277.
28720.	29229.	30273.	32064.	34522.	37192.	39862.
41631.	41136.	40502.	39820.	39131.	38465.	37800.
35914.	35570.	35261.	34984.	34736.	34512.	34288.
33754.	33427.	33276.	33134.	32999.	32872.	32745.
32301.	32187.	32075.	31963.	31852.	31742.	31631.
31217.	31117.	31020.	30925.	30832.	30741.	30650.
30316.	30236.	30158.	30081.	30006.	29933.	29860.
29592.	29528.	29467.	29406.	29347.	29290.	29233.
29024.	28975.	28927.	28881.	28836.	28791.	28746.
28584.	2854.	28505.	28467.	28429.	28392.	28354.
28214.	28180.	28146.	28113.	28081.	28049.	28017.
27897.	27868.	27839.	27811.	27783.	27756.	27728.
27626.	27601.	27577.	27553.	27529.	27506.	27482.
27417.	27395.	27373.	27353.	27333.	27313.	27293.
27199.	27181.	27163.	27145.	27128.	27111.	27093.
27031.	27016.	27001.	26986.	26971.	26957.	26942.
26875.	26875.	26862.	26850.	26837.	26825.	26813.
26766.	26755.	26744.	26734.	26723.	26713.	26702.

STAGE

STAGE	787.9	787.9	787.9	787.9	787.9	787.8
787.9	787.9	787.9	787.9	787.9	787.8	787.8
787.8	787.8	787.8	787.8	787.8	787.8	787.8
788.0	788.0	788.0	788.0	788.0	788.0	788.0
794.9	794.9	794.9	794.9	794.9	794.9	794.9
792.2	792.2	792.2	792.2	792.2	792.2	792.2
790.8	790.8	790.8	790.8	790.8	790.8	790.8
790.1	790.1	790.1	790.1	790.1	790.1	790.1
790.0	790.0	790.0	790.0	790.0	790.0	790.0

739.5	739.5	739.4	789.4	789.3	789.3	789.2	789.1	789.1
739.0	739.0	738.9	788.9	788.8	788.8	788.7	788.7	788.6
738.6	738.6	738.5	788.5	788.4	788.4	788.3	788.3	788.3
738.3	738.2	738.2	788.2	788.1	788.1	788.1	788.0	788.0
738.0	738.0	738.0	788.0	787.9	787.9	787.9	787.8	787.8
737.8	737.8	737.8	787.8	787.7	787.7	787.7	787.7	787.6
737.6	737.6	737.6	787.6	787.6	787.5	787.5	787.5	787.5
737.5	737.5	737.4	787.4	787.4	787.4	787.4	787.4	787.4
737.3	737.3	737.3	787.3	787.3	787.3	787.3	787.3	787.2
737.2	737.2	737.2	787.2	787.2	787.2	787.2	787.2	787.1
737.1	737.1	737.1	787.1	787.1	787.1	787.1	787.1	787.1
737.0	737.0	737.0	787.0	787.0	787.0	787.0	787.0	787.0
737.0	737.0	737.0	787.0	787.0	787.0	786.9	786.9	786.9

PEAK OUTFLOW IS 17322. AT TIME 51.00 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	17322.	16594.	11213.	5047.	288373.
CMS	491.	470.	319.	143.	8166.
INCHES		3.94	10.66	14.39	17.13
AC-FT		100.15	270.69	365.50	435.10
THOUS CU M		8228.	22241.	30031.	35749.
		10149.	27434.	37042.	44095.

STATION 1

[illegible]

15.00 58.1 0
16.30 59.1 0
18.00 60.1 0
19.30 61.1 0
21.00 62.1 0
22.30 63.1 0
3. 64.1 0
1.30 65.1 0
3.00 66.1 0
4.30 67.1 0
6.00 68.1 0
7.30 69.1 0
9.00 70.1 0
10.30 71.1 0
12.00 72.1 0
13.30 73.1 0
15.00 74.1 0
16.30 75.1 0
18.00 76.1 0
19.30 77.1 0
21.00 78.1 0
22.30 79.1 0
0. 80.1 0
1.30 81.1 0
3.00 82.1 0
4.30 83.1 0
6.00 84.1 0
7.30 85.1 0
9.00 86.1 0
10.30 87.1 0
12.00 88.1 0
13.30 89.1 0
15.00 90.1 0
16.30 91.1 0
18.00 92.1 0
19.30 93.1 0
21.00 94.1 0
22.30 95.1 0
3. 96.1 0
1.30 97.1 0
3.00 98.1 0
4.30 99.1 0
6.00 100.1 0
7.30 101.1 0
9.00 102.1 0
10.30 103.1 0
12.00 104.1 0
13.30 105.1 0
15.00 106.1 0
16.30 107.1 0
18.00 108.1 0
19.30 109.1 0
21.00 110.1 0
22.30 111.1 0
0. 112.1 0
1.30 113.1 0
3.00 114.1 0
4.30 115.1 0
6.00 116.1 0
7.30 117.1 0
9.00 118.1 0
10.30 119.1 0
12.00 120.1 0
13.30 121.1 0
15.00 122.1 0
16.30 123.1 0
18.00 124.1 0
19.30 125.1 0
21.00 126.1 0
22.30 127.1 0
3. 128.1 0
1.30 129.1 0
3.00 130.1 0
4.30 131.1 0
6.00 132.1 0
7.30 133.1 0
9.00 134.1 0
10.30 135.1 0
12.00 136.1 0
13.30 137.1 0
15.00 138.1 0
16.30 139.1 0
18.00 140.1 0
19.30 141.1 0
21.00 142.1 0
22.30 143.1 0
3. 144.1 0
1.30 145.1 0
3.00 146.1 0
4.30 147.1 0
6.00 148.1 0
7.30 149.1 0
9.00 150.1 0
10.30 151.1 0
12.00 152.1 0
13.30 153.1 0
15.00 154.1 0
16.30 155.1 0
18.00 156.1 0
19.30 157.1 0
21.00 158.1 0
22.30 159.1 0
3. 160.1 0
1.30 161.1 0
3.00 162.1 0
4.30 163.1 0
6.00 164.1 0
7.30 165.1 0
9.00 166.1 0
10.30 167.1 0
12.00 168.1 0
13.30 169.1 0
15.00 170.1 0
16.30 171.1 0
18.00 172.1 0
19.30 173.1 0
21.00 174.1 0
22.30 175.1 0
3. 176.1 0
1.30 177.1 0
3.00 178.1 0
4.30 179.1 0
6.00 180.1 0
7.30 181.1 0
9.00 182.1 0
10.30 183.1 0
12.00 184.1 0
13.30 185.1 0
15.00 186.1 0
16.30 187.1 0
18.00 188.1 0
19.30 189.1 0
21.00 190.1 0
22.30 191.1 0
3. 192.1 0
1.30 193.1 0
3.00 194.1 0
4.30 195.1 0
6.00 196.1 0
7.30 197.1 0
9.00 198.1 0
10.30 199.1 0
12.00 200.1 0
13.30 201.1 0
15.00 202.1 0
16.30 203.1 0
18.00 204.1 0
19.30 205.1 0
21.00 206.1 0
22.30 207.1 0
3. 208.1 0
1.30 209.1 0
3.00 210.1 0
4.30 211.1 0
6.00 212.1 0
7.30 213.1 0
9.00 214.1 0
10.30 215.1 0
12.00 216.1 0
13.30 217.1 0
15.00 218.1 0
16.30 219.1 0
18.00 220.1 0
19.30 221.1 0
21.00 222.1 0
22.30 223.1 0
3. 224.1 0
1.30 225.1 0
3.00 226.1 0
4.30 227.1 0
6.00 228.1 0
7.30 229.1 0
9.00 230.1 0
10.30 231.1 0
12.00 232.1 0
13.30 233.1 0
15.00 234.1 0
16.30 235.1 0
18.00 236.1 0
19.30 237.1 0
21.00 238.1 0
22.30 239.1 0
3. 240.1 0
1.30 241.1 0
3.00 242.1 0
4.30 243.1 0
6.00 244.1 0
7.30 245.1 0
9.00 246.1 0
10.30 247.1 0
12.00 248.1 0
13.30 249.1 0
15.00 250.1 0
16.30 251.1 0
18.00 252.1 0
19.30 253.1 0
21.00 254.1 0
22.30 255.1 0
3. 256.1 0
1.30 257.1 0
3.00 258.1 0
4.30 259.1 0
6.00 260.1 0
7.30 261.1 0
9.00 262.1 0
10.30 263.1 0
12.00 264.1 0
13.30 265.1 0
15.00 266.1 0
16.30 267.1 0
18.00 268.1 0
19.30 269.1 0
21.00 270.1 0
22.30 271.1 0
3. 272.1 0
1.30 273.1 0
3.00 274.1 0
4.30 275.1 0
6.00 276.1 0
7.30 277.1 0
9.00 278.1 0
10.30 279.1 0
12.00 280.1 0
13.30 281.1 0
15.00 282.1 0
16.30 283.1 0
18.00 284.1 0
19.30 285.1 0
21.00 286.1 0
22.30 287.1 0
3. 288.1 0
1.30 289.1 0
3.00 290.1 0
4.30 291.1 0
6.00 292.1 0
7.30 293.1 0
9.00 294.1 0
10.30 295.1 0
12.00 296.1 0
13.30 297.1 0
15.00 298.1 0
16.30 299.1 0
18.00 300.1 0
19.30 301.1 0
21.00 302.1 0
22.30 303.1 0
3. 304.1 0
1.30 305.1 0
3.00 306.1 0
4.30 307.1 0
6.00 308.1 0
7.30 309.1 0
9.00 310.1 0
10.30 311.1 0
12.00 312.1 0
13.30 313.1 0
15.00 314.1 0
16.30 315.1 0
18.00 316.1 0
19.30 317.1 0
21.00 318.1 0
22.30 319.1 0
3. 320.1 0
1.30 321.1 0
3.00 322.1 0
4.30 323.1 0
6.00 324.1 0
7.30 325.1 0
9.00 326.1 0
10.30 327.1 0
12.00 328.1 0
13.30 329.1 0
15.00 330.1 0
16.30 331.1 0
18.00 332.1 0
19.30 333.1 0
21.00 334.1 0
22.30 335.1 0
3. 336.1 0
1.30 337.1 0
3.00 338.1 0
4.30 339.1 0
6.00 340.1 0
7.30 341.1 0
9.00 342.1 0
10.30 343.1 0
12.00 344.1 0
13.30 345.1 0
15.00 346.1 0
16.30 347.1 0
18.00 348.1 0
19.30 349.1 0
21.00 350.1 0
22.30 351.1 0
3. 352.1 0
1.30 353.1 0
3.00 354.1 0
4.30 355.1 0
6.00 356.1 0
7.30 357.1 0
9.00 358.1 0
10.30 359.1 0
12.00 360.1 0
13.30 361.1 0
15.00 362.1 0
16.30 363.1 0
18.00 364.1 0
19.30 365.1 0
21.00 366.1 0
22.30 367.1 0
3. 368.1 0
1.30 369.1 0
3.00 370.1 0
4.30 371.1 0
6.00 372.1 0
7.30 373.1 0
9.00 374.1 0
10.30 375.1 0
12.00 376.1 0
13.30 377.1 0
15.00 378.1 0
16.30 379.1 0
18.00 380.1 0
19.30 381.1 0
21.00 382.1 0
22.30 383.1 0
3. 384.1 0
1.30 385.1 0
3.00 386.1 0
4.30 387.1 0
6.00 388.1 0
7.30 389.1 0
9.00 390.1 0
10.30 391.1 0
12.00 392.1 0
13.30 393.1 0
15.00 394.1 0
16.30 395.1 0
18.00 396.1 0
19.30 397.1 0
21.00 398.1 0
22.30 399.1 0
3. 400.1 0
1.30 401.1 0
3.00 402.1 0
4.30 403.1 0
6.00 404.1 0
7.30 405.1 0
9.00 406.1 0
10.30 407.1 0
12.00 408.1 0
13.30 409.1 0
15.00 410.1 0
16.30 411.1 0
18.00 412.1 0
19.30 413.1 0
21.00 414.1 0
22.30 415.1 0
3. 416.1 0
1.30 417.1 0
3.00 418.1 0
4.30 419.1 0
6.00 420.1 0
7.30 421.1 0
9.00 422.1 0
10.30 423.1 0
12.00 424.1 0
13.30 425.1 0
15.00 426.1 0
16.30 427.1 0
18.00 428.1 0
19.30 429.1 0
21.00 430.1 0
22.30 431.1 0
3. 432.1 0
1.30 433.1 0
3.00 434.1 0
4.30 435.1 0
6.00 436.1 0
7.30 437.1 0
9.00 438.1 0
10.30 439.1 0
12.00 440.1 0
13.30 441.1 0
15.00 442.1 0
16.30 443.1 0
18.00 444.1 0
19.30 445.1 0
21.00 446.1 0
22.30 447.1 0
3. 448.1 0
1.30 449.1 0
3.00 450.1 0
4.30 451.1 0
6.00 452.1 0
7.30 453.1 0
9.00 454.1 0
10.30 455.1 0
12.00 456.1 0
13.30 457.1 0
15.00 458.1 0
16.30 459.1 0
18.00 460.1 0
19.30 461.1 0
21.00 462.1 0
22.30 463.1 0
3. 464.1 0
1.30 465.1 0
3.00 466.1 0
4.30 467.1 0
6.00 468.1 0
7.30 469.1 0
9.00 470.1 0
10.30 471.1 0
12.00 472.1 0
13.30 473.1 0
15.00 474.1 0
16.30 475.1 0
18.00 476.1 0
19.30 477.1 0
21.00 478.1 0
22.30 479.1 0
3. 480.1 0
1.30 481.1 0
3.00 482.1 0
4.30 483.1 0
6.00 484.1 0
7.30 485.1 0
9.00 486.1 0
10.30 487.1 0
12.00 488.1 0
13.30 489.1 0
15.00 490.1 0
16.30 491.1 0
18.00 492.1 0
19.30 493.1 0
21.00 494.1 0
22.30 495.1 0
3. 496.1 0
1.30 497.1 0
3.00 498.1 0
4.30 499.1 0
6.00 500.1 0
7.30 501.1 0
9.00 502.1 0
10.30 503.1 0
12.00 504.1 0
13.30 505.1 0
15.00 506.1 0
16.30 507.1 0
18.00 508.1 0
19.30 509.1 0
21.00 510.1 0
22.30 511.1 0
3. 512.1 0
1.30 513.1 0
3.00 514.1 0
4.30 515.1 0
6.00 516.1 0
7.30 517.1 0
9.00 518.1 0
10.30 519.1 0
12.00 520.1 0
13.30 521.1 0
15.00 522.1 0
16.30 523.1 0
18.00 524.1 0
19.30 525.1 0
21.00 526.1 0
22.30 527.1 0
3. 528.1 0
1.30 529.1 0
3.00 530.1 0
4.30 531.1 0
6.00 532.1 0
7.30 533.1 0
9.00 534.1 0
10.30 535.1 0
12.00 536.1 0
13.30 537.1 0
15.00 538.1 0
16.30 539.1 0
18.00 540.1 0
19.30 541.1 0
21.00 542.1 0
22.30 543.1 0
3. 544.1 0
1.30 545.1 0
3.00 546.1 0
4.30 547.1 0
6.00 548.1 0
7.30 549.1 0
9.00 550.1 0
10.30 551.1 0
12.00 552.1 0
13.30 553.1 0
15.00 554.1 0
16.30 555.1 0
18.00 556.1 0
19.30 557.1 0
21.00 558.1 0
22.30 559.1 0
3. 560.1 0
1.30 561.1 0
3.00 562.1 0
4.30 563.1 0
6.00 564.1 0
7.30 565.1 0
9.00 566.1 0
10.30 567.1 0
12.00 568.1 0
13.30 569.1 0
15.00 570.1 0
16.30 571.1 0
18.00 572.1 0
19.30 573.1 0
21.00 574.1 0
22.30 575.1 0
3. 576.1 0
1.30 577.1 0
3.00 578.1 0
4.30 579.1 0
6.00 580.1 0
7.30 581.1 0
9.00 582.1 0
10.30 583.1 0
12.00 584.1 0
13.30 585.1 0
15.00 586.1 0
16.30 587.1 0
18.00 588.1 0
19.30 589.1 0
21.00 590.1 0
22.30 591.1 0
3. 592.1 0
1.30 593.1 0
3.00 594.1 0
4.30 595.1 0
6.00 596.1 0
7.30 597.1 0
9.00 598.1 0
10.30 599.1 0
12.00 600.1 0
13.30 601.1 0
15.00 602.1 0
16.30 603.1 0
18.00 604.1 0
19.30 605.1 0
21.00 606.1 0
22.30 607.1 0
3. 608.1 0
1.30 609.1 0
3.00 610.1 0
4.30 611.1 0
6.00 612.1 0
7.30 613.1 0
9.00 614.1 0
10.30 615.1 0
12.00 616.1 0
13.30 617.1 0
15.00 618.1 0
16.30 619.1 0
18.00 620.1 0
19.30 621.1 0
21.00 622.1 0
22.30 623.1 0
3. 624.1 0
1.30 625.1 0
3.00 626.1 0
4.30 627.1 0
6.00 628.1 0
7.30 629.1 0
9.00 630.1 0
10.30 631.1 0
12.00 632.1 0
13.30 633.1 0
15.00 634.1 0
16.30 635.1 0
18.00 636.1 0
19.30 637.1 0
21.00 638.1 0
22.30 639.1 0
3. 640.1 0
1.30 641.1 0
3.00 642.1 0
4.30 643.1 0
6.00 644.1 0
7.30 645.1 0
9.00 646.1 0
10.30 647.1 0
12.00 648.1 0
13.30 649.1 0
15.00 650.1 0
16.30 651.1 0
18.00 652.1 0
19.30 653.1 0
21.00 654.1 0
22.30 655.1 0
3. 656.1 0
1.30 657.1 0
3.00 658.1 0
4.30 659.1 0
6.00 660.1 0
7.30 661.1 0
9.00 662.1 0
10.30 663.1 0
12.00 664.1 0
13.30 665.1 0
15.00 666.1 0
16.30 667.1 0
18.00 668.1 0
19.30 669.1 0
21.00 670.1 0
22.30 671.1 0
3. 672.1 0
1.30 673.1 0
3.00 674.1 0
4.30 675.1 0
6.00 676.1 0
7.30 677.1 0
9.00 678.1 0
10.30 679.1 0
12.00 680.1 0
13.30 681.1 0
15.00 682.1 0
16.30 683.1 0
18.00 684.1 0
19.30 685.1 0
21.00 686.1 0
22.30 687.1 0
3. 688.1 0
1.30 689.1 0
3.00 690.1 0
4.30 691.1 0
6.00 692.1 0
7.30 693.1 0
9.00 694.1 0
10.30 695.1 0
12.00 696.1 0
13.30 697.1 0
15.00 698.1 0
16.30 699.1 0
18.00 700.1 0
19.30 701.1 0
21.00 702.1 0
22.30 703.1 0
3. 704.1 0
1.30 705.1 0
3.00 706.1 0
4.30 707.1 0
6.00 708.1 0
7.30 709.1 0
9.00 710.1 0
10.30 711.1 0
12.00 712.1 0
13.30 713.1 0
15.00 714.1 0
16.30 715.1 0
18.00 716.1 0
19.30 717.1 0
21.00 718.1 0
22.30 719.1 0
3. 720.1 0
1.30 721.1 0
3.00 722.1 0
4.30 723.1 0
6.00 724.1 0
7.30 725.1 0
9.00 726.1 0
10.30 727.1 0
12.00 728.1 0
13.30 729.1 0
15.00 730.1 0
16.30 731.1 0
18.00 732.1 0
19.30 733.1 0
21.00 734.1 0
22.30 735.1 0
3. 736.1 0
1.30 737.1 0
3.00 738.1 0
4.30 739.1 0
6.00 740.1 0
7.30 741.1 0
9.00 742.1 0
10.30 743.1 0
12.00 744.1 0
13.30 745.1 0
15.00 746.1 0
16.30 747.1 0
18.00 748.1 0
19.30 749.1 0
21.00 750.1 0
22.30 751.1 0
3. 752.1 0
1.30 753.1 0
3.00 754.1 0
4.30 755.1 0
6.00 756.1 0
7.30 757.1 0
9.00 758.1 0
10.30 759.1 0
12.00 760.1 0
13.30 761.1 0
15.00 762.1 0
16.30 763.1 0
18.00 764.1 0
19.30 765.1 0
21.00 766.1 0
22.30 767.1 0
3. 768.1 0
1.30 769.1 0
3.00 770.1 0
4.30 771.1 0
6.00 772.1 0
7.30 773.1 0
9.00 774.1 0
10.30 775.1 0
12.00 776.1 0
13.30 777.1 0
15.00 778.1 0
16.30 779.1 0
18.00 780.1 0
19.30 781.1 0
21.00 782.1 0
22.30 783.1 0
3. 784.1 0
1.30 785.1 0
3.00 786.1 0
4.30 787.1 0
6.00 788.1 0
7.30 789.1 0
9.00 790.1 0
10.30 791.1 0
12.00 792.1 0
13.30 793.1 0
15.00 794.1 0
16.30 795.1 0
18.00 796.1 0
19.30 797.1 0
21.00 798.1 0
22.30 799.1 0
3. 800.1 0
1.30 801.1 0
3.00 802.1 0
4.30 803.1 0
6.00 804.1 0
7.30 805.1 0
9.00 806.1 0
10.30 807.1 0
12.00 808.1 0
13.30 809.1 0
15.00 810.1 0
16.30 811.1 0
18.00 812.1 0
19.30 813.1 0
21.00 814.1 0
22.30 815.1 0
3. 816.1 0
1.30 817.1 0
3.00 818.1 0
4.30 819.1 0
6.00 820.1 0
7.30 821.1 0
9.00 822.1 0
10.30 823.1 0
12.00 824.1 0
13.30 825.1 0
15.00 826.1 0
16.30 827.1 0
18.00 828.1 0
19.30 829.1 0
21.00 830.1 0
22.30 831.1 0
3. 832.1 0
1.30 833.1 0
3.00 834.1 0
4.30 835.1 0
6.00 836.1 0
7.30 837.1 0
9.00 838.1 0
10.30 839.1 0
12.00 840.1 0
13.30 841.1 0
15.00 842.1 0
16.30 843.1 0
18.00 844.1 0
19.30 845.1 0
21.00 846.1 0
22.30 847.1 0
3. 848.1 0
1.30 849.1 0
3.00 850.1 0
4.30 851.1 0
6.00 852.1 0
7.30 853.1 0
9.00 854.1 0
10.30 855.1 0
12.00 856.1 0
13.30 857.1 0
15.00 858.1 0
16.30 859.1 0
18.00 860.1 0
19.30 861.1 0
21.00 862.1 0
22.30 863.1 0
3. 864.1 0
1.30 865.1 0
3.00 866.1 0
4.30 867.1 0
6.00 868.1 0
7.30 869.1 0
9.00 870.1 0
10.30 871.1 0
12.00 872.1 0
13.30 873.1 0
15.00 874.1 0
16.30 875.1 0
18.00 876.1 0
19.30 877.1 0
21.00 878.1 0
22.30 879.1 0
3. 880.1 0
1.30 881.1 0
3.00 882.1 0
4.30 883.1 0
6.00 884.1 0
7.30 885.1 0
9.00 886.1 0
10.30 887.1 0
12.00 888.1 0
13.30 889.1 0
15.00 890.1 0
16.30 891.1 0
18.00 892.1 0
19.30 893.1 0
21.00 894.1 0
22.30 895.1 0
3. 896.1 0
1.30 897.1 0
3.00 898.1 0
4.30 899.1 0
6.00 900.1 0
7.30 901.1 0
9.00 902.1 0
10.30 903.1 0
12.00 904.1 0
13.30 905.1 0
15.00 906.1 0
16.30 907.1 0
18.00 908.1 0
19.30 909.1 0
21.00 910.1 0
22.30 911.1 0
3. 912.1 0
1.30 913.1 0
3.00 914.1 0
4.30 915.1 0
6.00 916.1 0

12.0012010
13.301210
15.001220
16.301230
18.001240
19.301250
21.001260
22.301270
0. 1280
1.301290
3.001300
4.301310
6.001320
7.301330
9.001340
10.301350
12.001360
13.301370
15.001380
16.301390
18.001400
19.301410
21.001420
22.301430
0. 1440
1.301450
3.001460
4.301470
6.001480
7.301490
9.001500
10.301510
12.001520
13.301530
15.001540
16.301550
18.001560
19.301570
21.001580
22.301590
0. 1600
1.301610
3.001620
4.301630
6.001640
7.301650
9.001660
10.301670
12.001680
13.301690
15.001700
16.301710
18.001720
19.301730
21.001740
22.301750
0. 1760
1.301770
3.001780
4.301790
6.001800
7.301810

9.001821
10.301831
12.001841
13.301851
15.001861
16.301871
18.001881
19.301891
21.001901
22.301911
0. 1921
1.301931
3.001941
4.301951
6.001961
7.301971
9.001981
10.301991
12.002001

•OVN•

WARNING *** TOP OF DAM, BOTTOM OF DREACH, OR LOW-LEVEL OUTLET IS NOT WITHIN RANGE OF GIVEN ELEVATIONS IN STORAGE-ELEVATION DATA
 BOTTOM OF RESERVOIR ASSIGNED TO BE AT 722.00
 STORAGE-ELEVATION DATA WILL BE EXTRAPOLATED ABOVE ELEVATION 795.00

STATION 1, PLAN 1, RATIO 6

END-OF-PERIOD HYDROGRAPH ORDINATES

OUTFLOW	
343.	338.
299.	297.
296.	300.
17011.	20993.
10291.	8855.
3329.	3229.
1661.	1548.
1136.	1105.
843.	817.
640.	623.
438.	474.
370.	359.
307.	302.
262.	258.
223.	219.
190.	187.
162.	159.
138.	136.
117.	116.
100.	99.
329.	334.
296.	296.
331.	310.
22712.	22719.
6817.	7756.
2641.	2807.
1360.	1442.
1043.	1074.
769.	791.
590.	606.
449.	462.
343.	349.
293.	297.
249.	253.
213.	216.
181.	184.
154.	157.
131.	134.
112.	114.
95.	97.
321.	316.
298.	298.
389.	851.
19895.	17879.
5376.	4881.
2327.	2180.
1329.	1264.
1013.	954.
749.	711.
575.	544.
437.	413.
338.	327.
283.	279.
245.	238.
209.	203.
178.	173.
152.	147.
129.	125.
110.	107.
94.	91.
325.	312.
297.	298.
359.	5292.
21611.	15772.
6013.	4434.
2481.	2040.
1329.	1200.
1013.	925.
749.	675.
575.	515.
437.	391.
338.	317.
283.	270.
245.	230.
209.	196.
178.	167.
152.	142.
129.	121.
110.	103.
94.	88.
329.	307.
296.	297.
331.	5292.
22712.	13710.
6817.	4029.
2641.	1907.
1360.	1780.
1043.	1168.
769.	870.
590.	657.
449.	501.
343.	380.
293.	312.
249.	266.
213.	227.
181.	193.
154.	165.
131.	140.
112.	119.
95.	102.
321.	303.
298.	296.
389.	11104.
19895.	11900.
5376.	3662.
2327.	1780.
1329.	1168.
1013.	870.
749.	657.
575.	501.
437.	380.
338.	312.
283.	266.
245.	227.
209.	193.
178.	165.
152.	140.
129.	119.
110.	102.
94.	87.

STORAGE

28716.	28682.	28648.	28614.	28580.	28546.	28512.	28478.	28444.	28411.
28352.	28353.	28355.	28355.	28362.	28370.	28372.	28369.	28362.	28356.
28383.	28463.	28627.	28933.	28933.	29574.	30382.	33106.	36074.	39192.
43492.	44226.	44223.	43755.	43755.	43026.	42170.	41275.	40399.	39572.
38105.	37492.	36970.	36522.	36522.	36132.	35786.	35672.	35188.	34931.
34698.	34887.	34707.	33928.	33928.	33757.	33593.	33437.	33289.	33148.
33015.	32771.	32653.	32547.	32547.	32435.	32323.	32211.	32099.	31987.
31276.	31659.	31552.	31447.	31447.	31343.	31242.	31142.	31044.	30949.
30856.	30764.	30588.	30503.	30503.	30420.	30338.	30258.	30179.	30102.
29953.	29881.	29811.	29742.	29742.	29675.	29610.	29546.	29484.	29423.
29306.	29250.	29195.	29141.	29141.	29089.	29038.	28989.	28941.	28894.
28804.	28761.	28718.	28677.	28677.	28636.	28595.	28556.	28516.	28478.
28402.	28365.	28329.	28293.	28293.	28258.	28224.	28189.	28156.	28123.
28090.	28027.	27996.	27965.	27965.	27935.	27905.	27876.	27847.	27819.
27764.	27737.	27710.	27684.	27684.	27659.	27633.	27608.	27584.	27560.
27513.	27490.	27467.	27445.	27445.	27423.	27401.	27380.	27359.	27339.
27299.	27279.	27260.	27241.	27241.	27222.	27204.	27186.	27168.	27150.
27116.	27100.	27083.	27067.	27067.	27051.	27035.	27020.	27005.	26990.
26961.	26947.	26933.	26919.	26919.	26905.	26892.	26879.	26866.	26853.
26828.	26804.	26779.	26753.	26753.	26781.	26793.	26759.	26748.	26737.

789.7	789.6	789.6	789.5	789.4	789.4	789.3	789.3	789.2	789.2
789.1	789.1	789.0	789.0	788.9	788.9	788.8	788.8	788.7	788.7
788.7	788.6	788.6	788.6	788.5	788.5	788.5	788.4	788.4	788.4
788.3	788.3	788.3	788.2	788.2	788.2	788.2	788.1	788.1	788.1
788.1	788.0	788.0	788.0	788.0	787.9	787.9	787.9	787.9	787.9
787.8	787.8	787.8	787.8	787.8	787.7	787.7	787.7	787.7	787.7
787.7	787.6	787.6	787.6	787.6	787.6	787.6	787.5	787.5	787.5
787.5	787.5	787.5	787.5	787.4	787.4	787.4	787.4	787.4	787.4
787.4	787.4	787.3	787.3	787.3	787.3	787.3	787.3	787.3	787.3
787.3	787.2	787.2	787.2	787.2	787.2	787.2	787.2	787.2	787.2
787.2	787.1	787.1	787.1	787.1	787.1	787.1	787.1	787.1	787.1
787.1	787.1	787.1	787.1	787.0	787.0	787.0	787.0	787.0	787.0
787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0	787.0	786.9

PEAK OUTFLOW IS 22719. AT TIME 49.50 HOURS

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	22719.	21871.	14667.	6412.	356242.
CMS	643.	619.	415.	182.	10088.
INCHES		5.20	13.94	18.28	21.16
AC-FT		132.00	354.08	464.35	537.50
THOUS CU M		10845.	29092.	38152.	44162.
		13377.	35885.	47060.	54473.

STATION 1

INFLOW(I), OUTFLOW(O) AND OBSERVED FLOW(*)

[illegible]

15.00 58. 1 0
16.30 59. 1 0
18.03 60. 1 0
19.30 61. 1 0
21.00 62. 1 0
22.33 63. 1 0
0. 64. 1 0
1.33 65. 1 0
3.00 66. 1 0
4.30 67. 1 0
6.00 68. 1 0
7.33 69. 1 0
9.00 70. 1 0
10.30 71. 1 0
12.00 72. 1 0
13.30 73. 1 0
15.00 74. 1 0
16.33 75. 1 0
18.00 76. 1 0
19.30 77. 1 0
21.03 78. 1 0
22.30 79. 1 0
0. 80. 1 0
1.33 81. 1 0
3.00 82. 1 0
4.33 83. 1 0
6.00 84. 1 0
7.33 85. 1 0
9.03 86. 1 0
10.30 87. 1 0
12.00 88. 1 0
13.30 89. 1 0
15.00 90. 1 0
16.30 91. 1 0
18.00 92. 1 0
19.30 93. 1 0
21.00 94. 1 0
22.33 95. 1 0
0. 96. 1 0
1.30 97. 1 0
3.00 98. 1 0
4.30 99. 1 0
6.00 100. 1 0
7.30 101. 1 0
9.00 102. 1 0
10.30 103. 1 0
12.00 104. 1 0
13.30 105. 1 0
15.00 106. 1 0
16.30 107. 1 0
18.00 108. 1 0
19.30 109. 1 0
21.00 110. 1 0
22.30 111. 1 0
0. 112. 1 0
1.30 113. 1 0
3.00 114. 1 0
4.30 115. 1 0
6.00 116. 1 0
7.30 117. 1 0
9.00 118. 1 0
10.30 119. 1 0

12.0012010.....
13.3012110.....
15.0012210.....
16.3012310.....
18.0012410.....
19.3012510.....
21.0012610.....
22.3012710.....
0. 12810.....
1.3012910.....
3.0013010.....
4.3013110.....
6.0013210.....
7.3013310.....
9.0013410.....
10.3013510.....
12.0013610.....
13.3013710.....
15.0013810.....
16.3013910.....
18.0014010.....
19.3014110.....
21.0014210.....
22.3014310.....
0. 14410.....
1.3014510.....
3.0014610.....
4.3014710.....
6.001481.....
7.301491.....
9.001501.....
10.301511.....
12.001521.....
13.301531.....
15.001541.....
16.301551.....
18.001561.....
19.301571.....
21.001581.....
22.301591.....
0. 1601.....
1.301611.....
3.001621.....
4.301631.....
6.001641.....
7.301651.....
9.001661.....
10.301671.....
12.001681.....
13.301691.....
15.001701.....
16.301711.....
18.001721.....
19.301731.....
21.001741.....
22.301751.....
0. 1761.....
1.301771.....
3.001781.....
4.301791.....
6.001801.....
7.301811.....

9.001821
10.301831
12.001841
13.301851
15.001861
16.301871
18.001881
19.301891
21.001901
22.301911
0.1921
1.301921
3.001941
4.301951
6.001961
7.301971
9.001981
10.301991
12.002001.

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FORMULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS					
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6
				0.20	0.40	0.50	0.60	0.80	1.00
HYDROGRAPH AT	1	39.15 (58842.09)	1	7082. (200.55)	14165. (401.10)	17706. (501.38)	21247. (601.66)	28330. (802.21)	35412. (1002.76)
ROUTED TO	1	39.15 (58842.09)	1	1807. (51.17)	6347. (179.72)	8901. (252.04)	11690. (331.03)	17322. (490.50)	22719. (643.33)

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1

ELEVATION		INITIAL VALUE		SPILLWAY CREST		TOP OF DAM	
STORAGE		788.00		786.60		798.10	
OUTFLOW		28750.		26067.		47890.	
		347.		0.		31345.	
RATIO OF PMF	MAXIMUM RESERVOIR W.S. ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF	
						MAX OUTFLOW HOURS	FAILURE HOURS
0.20	790.36	0.	33178.	1807.	0.	57.00	0.
0.40	792.21	0.	36708.	6347.	0.	52.50	0.
0.50	792.96	0.	38130.	8901.	0.	52.50	0.
0.60	793.67	0.	39472.	11690.	0.	51.00	0.
0.80	794.96	0.	41933.	17322.	0.	51.00	0.
1.00	796.17	0.	44226.	22719.	0.	49.50	0.

APPENDIX D
STABILITY ANALYSIS

NEW YORK STATE DEPT OF ENVIRONMENTAL CONSERVATION ALBANY F/G 13/13
NATIONAL DAM SAFETY PROGRAM. OTISCO LAKE DAM (INVENTORY NUMBER --ETC(U)
SEP 81 G KOCH DACW51-79-C-0001

NL

2 of 2

ALL 2

END

DATE

02-82

DTLC




MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

STRUCTURAL STABILITY ANALYSIS

The analysis of the spillway section was based on information shown on the plans and on measurements made at the time of the inspection. A normal analysis was performed including both overturning and sliding analyses. Due to unknown foundation conditions, full uplift was assumed at the upstream toe, decreasing to the tailwater pressure at the downstream toe. It was assumed that the base of the dam is at the same level as the bottom of the spillway apron (which is 3 feet thick).

ANALYSIS CONDITIONS

1. Normal conditions; water surface at spillway crest
2. Same as #1 plus ice load of 5,000 pounds per linear foot
3. 1/2 PMF flow; water surface 6.4 feet above the spillway crest
4. PMF flow; water surface 9.6 feet above spillway crest
5. Seismic Conditions - Water at Spillway Crest with seismic coefficient of 0.1.



STABILITY ANALYSIS PROGRAM - WORK SHEET

INPUT ENTRY

ANALYSIS CONDITION

		1	2	3	4	5
Unit Weight of Dam (K/ft ³)	0	0.15	0.15	0.15	0.15	0.15
Area of Segment No. 1 (ft ²)	1	30.75	30.75	30.75	30.75	30.75
Distance from Center of Gravity of Segment No. 1 to Downstream Toe (ft)	2	20.25	20.25	20.25	20.25	20.25
Area of Segment No. 2 (ft ²)	3	52.5	52.5	52.5	52.5	52.5
Distance from Center of Gravity of Segment No. 2 to Downstream Toe (ft)	4	18.25	18.25	18.25	18.25	18.25
Area of Segment No. 3 (ft ²)	5	90	90	90	90	90
Distance from Center of Gravity of Segment No. 3 to Downstream Toe (ft)	6	13	13	13	13	13
Base Width of Dam (Total) (ft)	7	21	21	21	21	21
Height of Dam (ft)	8	21	21	21	21	21
Ice Loading (K/ft)	9	—	5.0	—	—	—
Coefficient of Sliding	10	0.55	0.55	0.55	0.55	0.55
Unit Weight of Soil (K/ft ³) (does not include 18)	11	0.055	0.055	0.055	0.055	0.055
Active Soil Coefficient - Ka	12	0.33	0.33	0.33	0.33	0.33
Passive Soil Coefficient - Kp	13	3.00	3.0	3.0	3.0	3.0
Height of Water over Top of Dam or Spillway (ft)	14	—	—	6.36	9.57	—
Height of Soil for Active Pressure (ft)	15	3.0	3.0	3.0	3.0	3.0
Height of Soil for Passive Pressure (ft)	16	3.0	3.0	3.0	3.0	3.0
Height of Water in Tailrace Channel (ft)	17	5.0	5.0	7.0	7.0	5.0
Weight of Water (K/ft ³)	18	0.0624	0.0624	0.0624	0.0624	0.0624
Area of Segment No. 4 (ft ²)	19	72	72	72	72	72
Distance from Center of Gravity of Segment No. 4 to Downstream Toe (ft)	20	11	11	11	11	11
Height of Ice Load or Active Water (ft) (does not include 14)	46	21	21	21	21	21
Seismic Coefficient (g)	50	—	—	—	—	0.1
AREA OF SEG. 5 →	21	22.5	22.5	22.5	22.5	22.5
DIST. TO CENT. OF GRAVITY TO D.S. TOE SEG. 5 →	22	2.25	2.25	2.25	2.25	2.25
<u>RESULTS OF ANALYSIS</u>						
Factor of Safety vs. Overturning		1.73	1.30	1.33	1.19	1.66
Distance From Toe to Resultant		9.91	5.37	6.12	4.15	9.33
Factor of Safety vs. Sliding		1.03	0.76	0.64	0.54	0.73

APPENDIX E
REFERENCES

E

APPENDIX E

REFERENCES


- 1) U.S. Department of Commerce, Technical Paper No. 40, Rainfall Frequency Atlas of the United States, May 1961,
- 2) U.S. Department of Commerce, Hydrometeorological Report No. 33, Seasonal Variation of the Probable Maximum Precipitation East of the 105th Meridian for Areas from 10 to 1,000 Square Miles and Durations of 6, 12, 24, and 48 Hours; April 1956.
- 3) Soil Conservation Service, National Engineering Handbook, Section 4, Hydrology, August 1972 (U.S. Department of Agriculture),
- 4) H.W. King and E.F. Brater, Handbook of Hydraulics, 5th edition, McGraw-Hill, 1963.
- 5) T.W. Lambe and R.V. Whitman, Soil Mechanics, John Wiley and Sons, 1965.
- 6) W.D. Thornbury, Principles of Geomorphology, John Wiley and Sons, 1969.
- 7) University of the State of New York; Geology of New York, Education Leaflet 20, Reprinted 1973.
- 8) Cornell University Agriculture Experiment Station (compiled by M.G. Cline and R.L. Marshall), General Soil Map of New York State and Soils of New York Landscapes, Information Bulletin 119, 1977,

APPENDIX F


DRAWINGS




VICINITY MAP

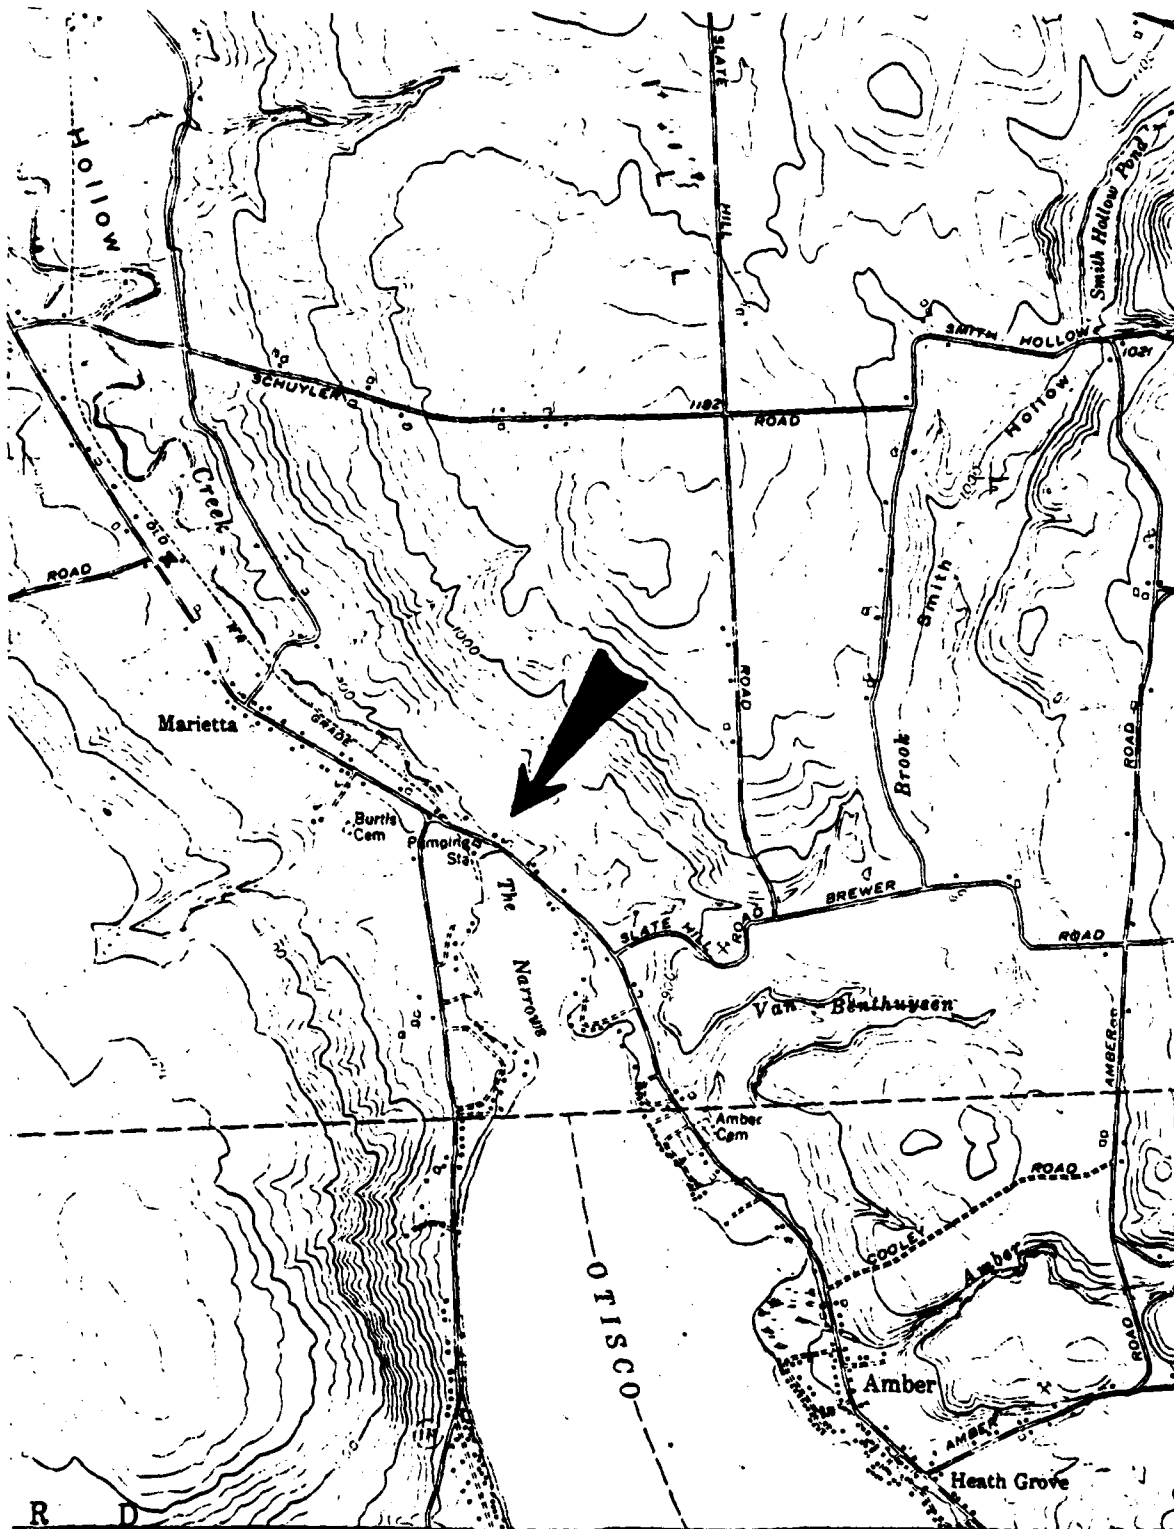

TOPOGRAPHIC MAP

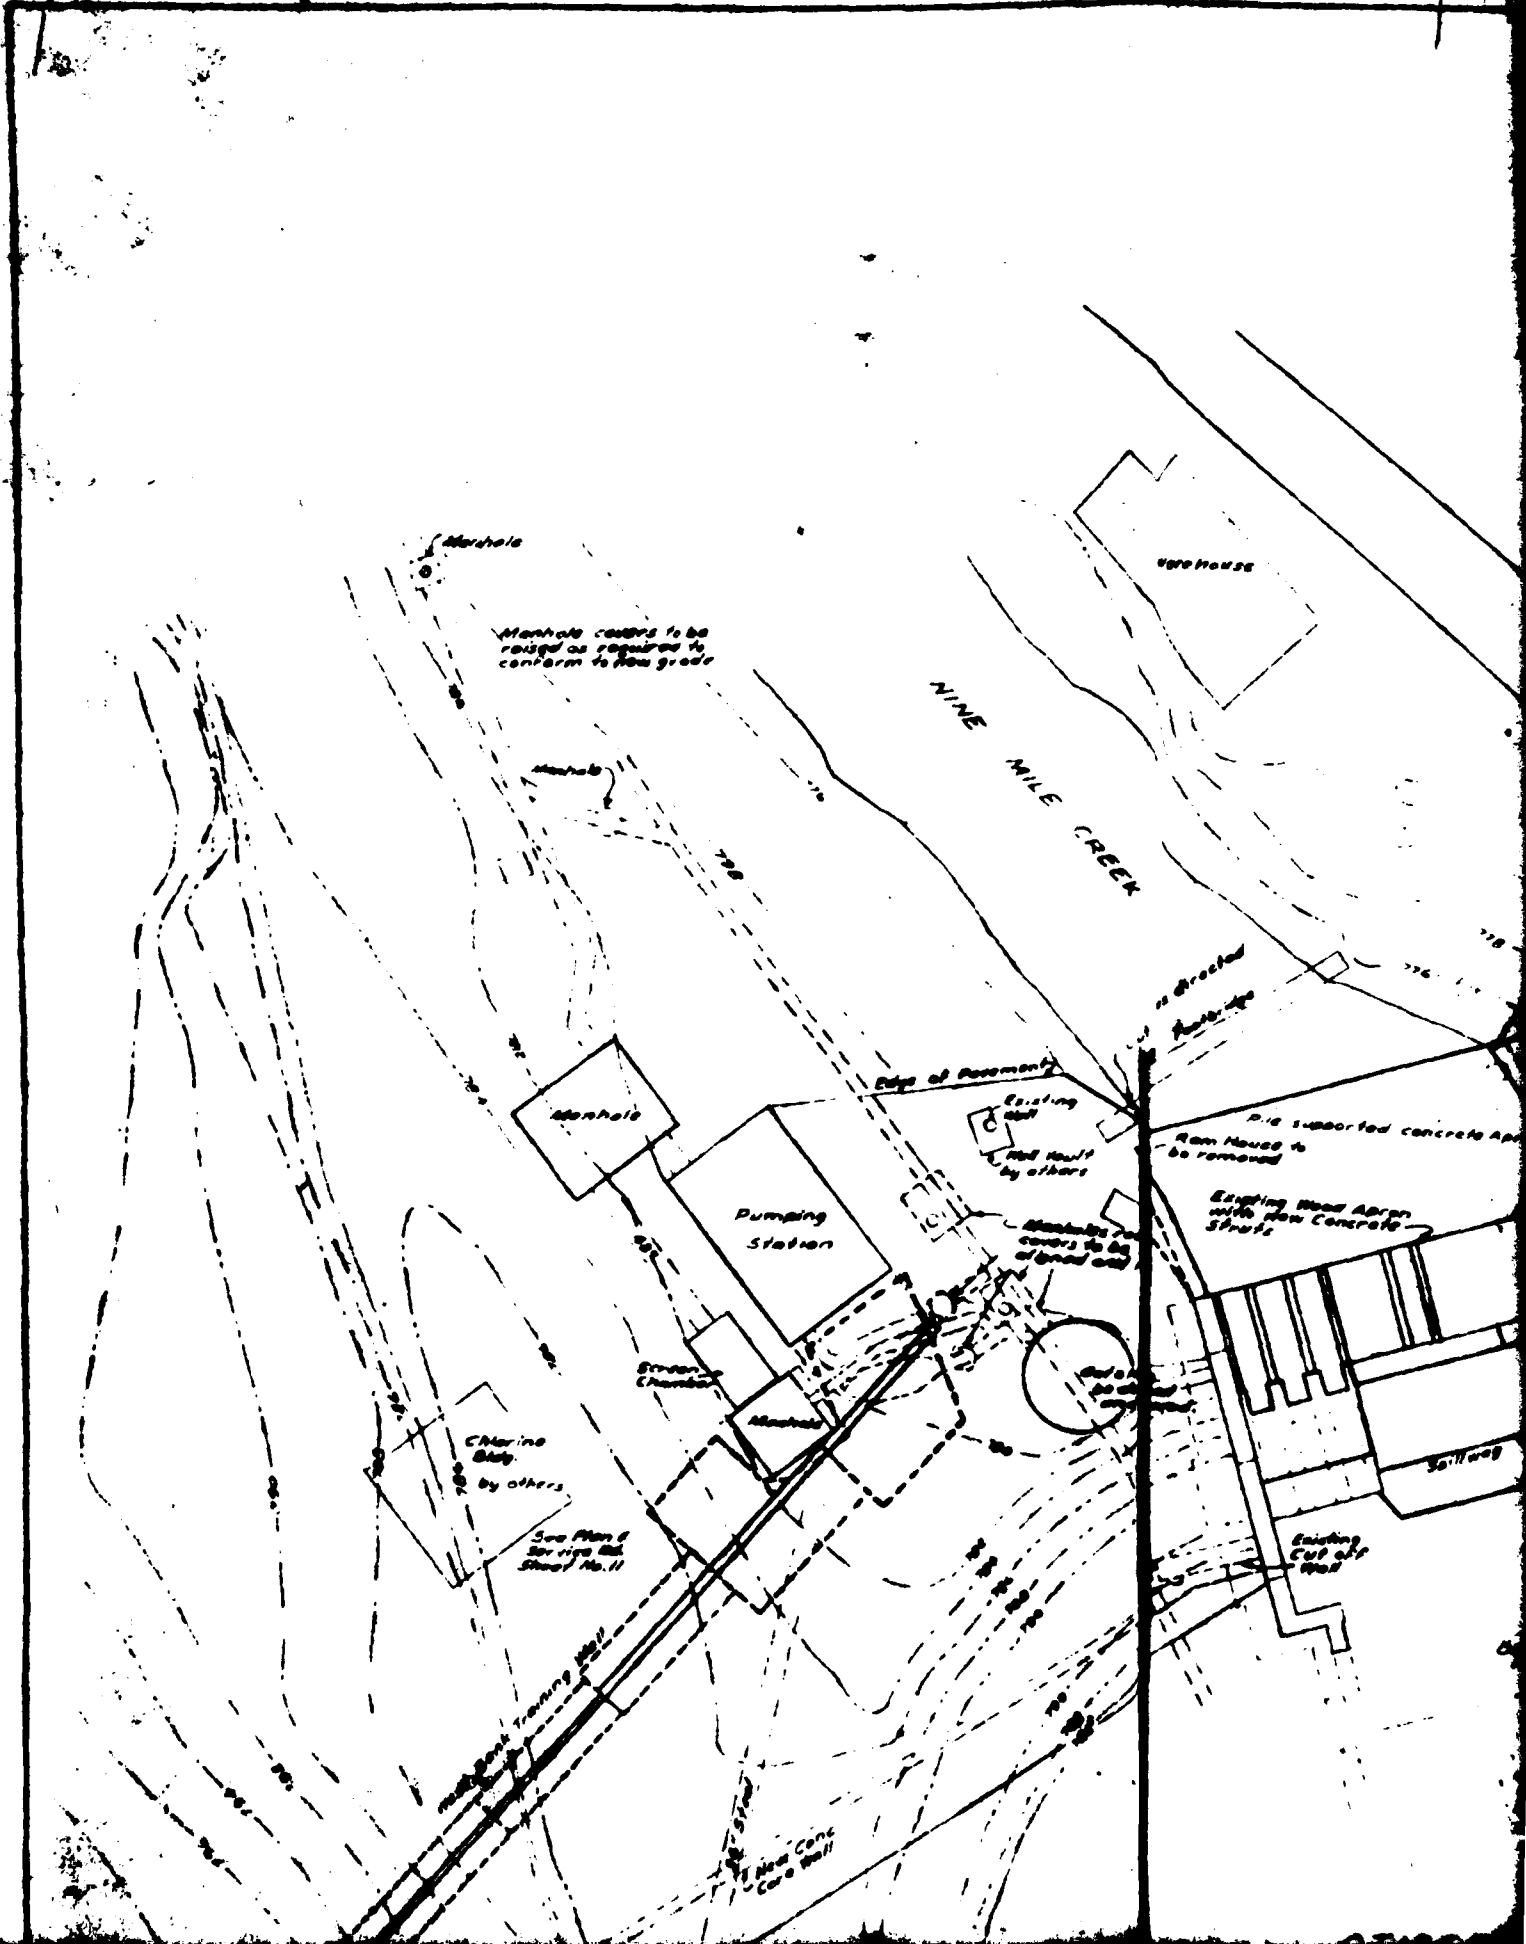

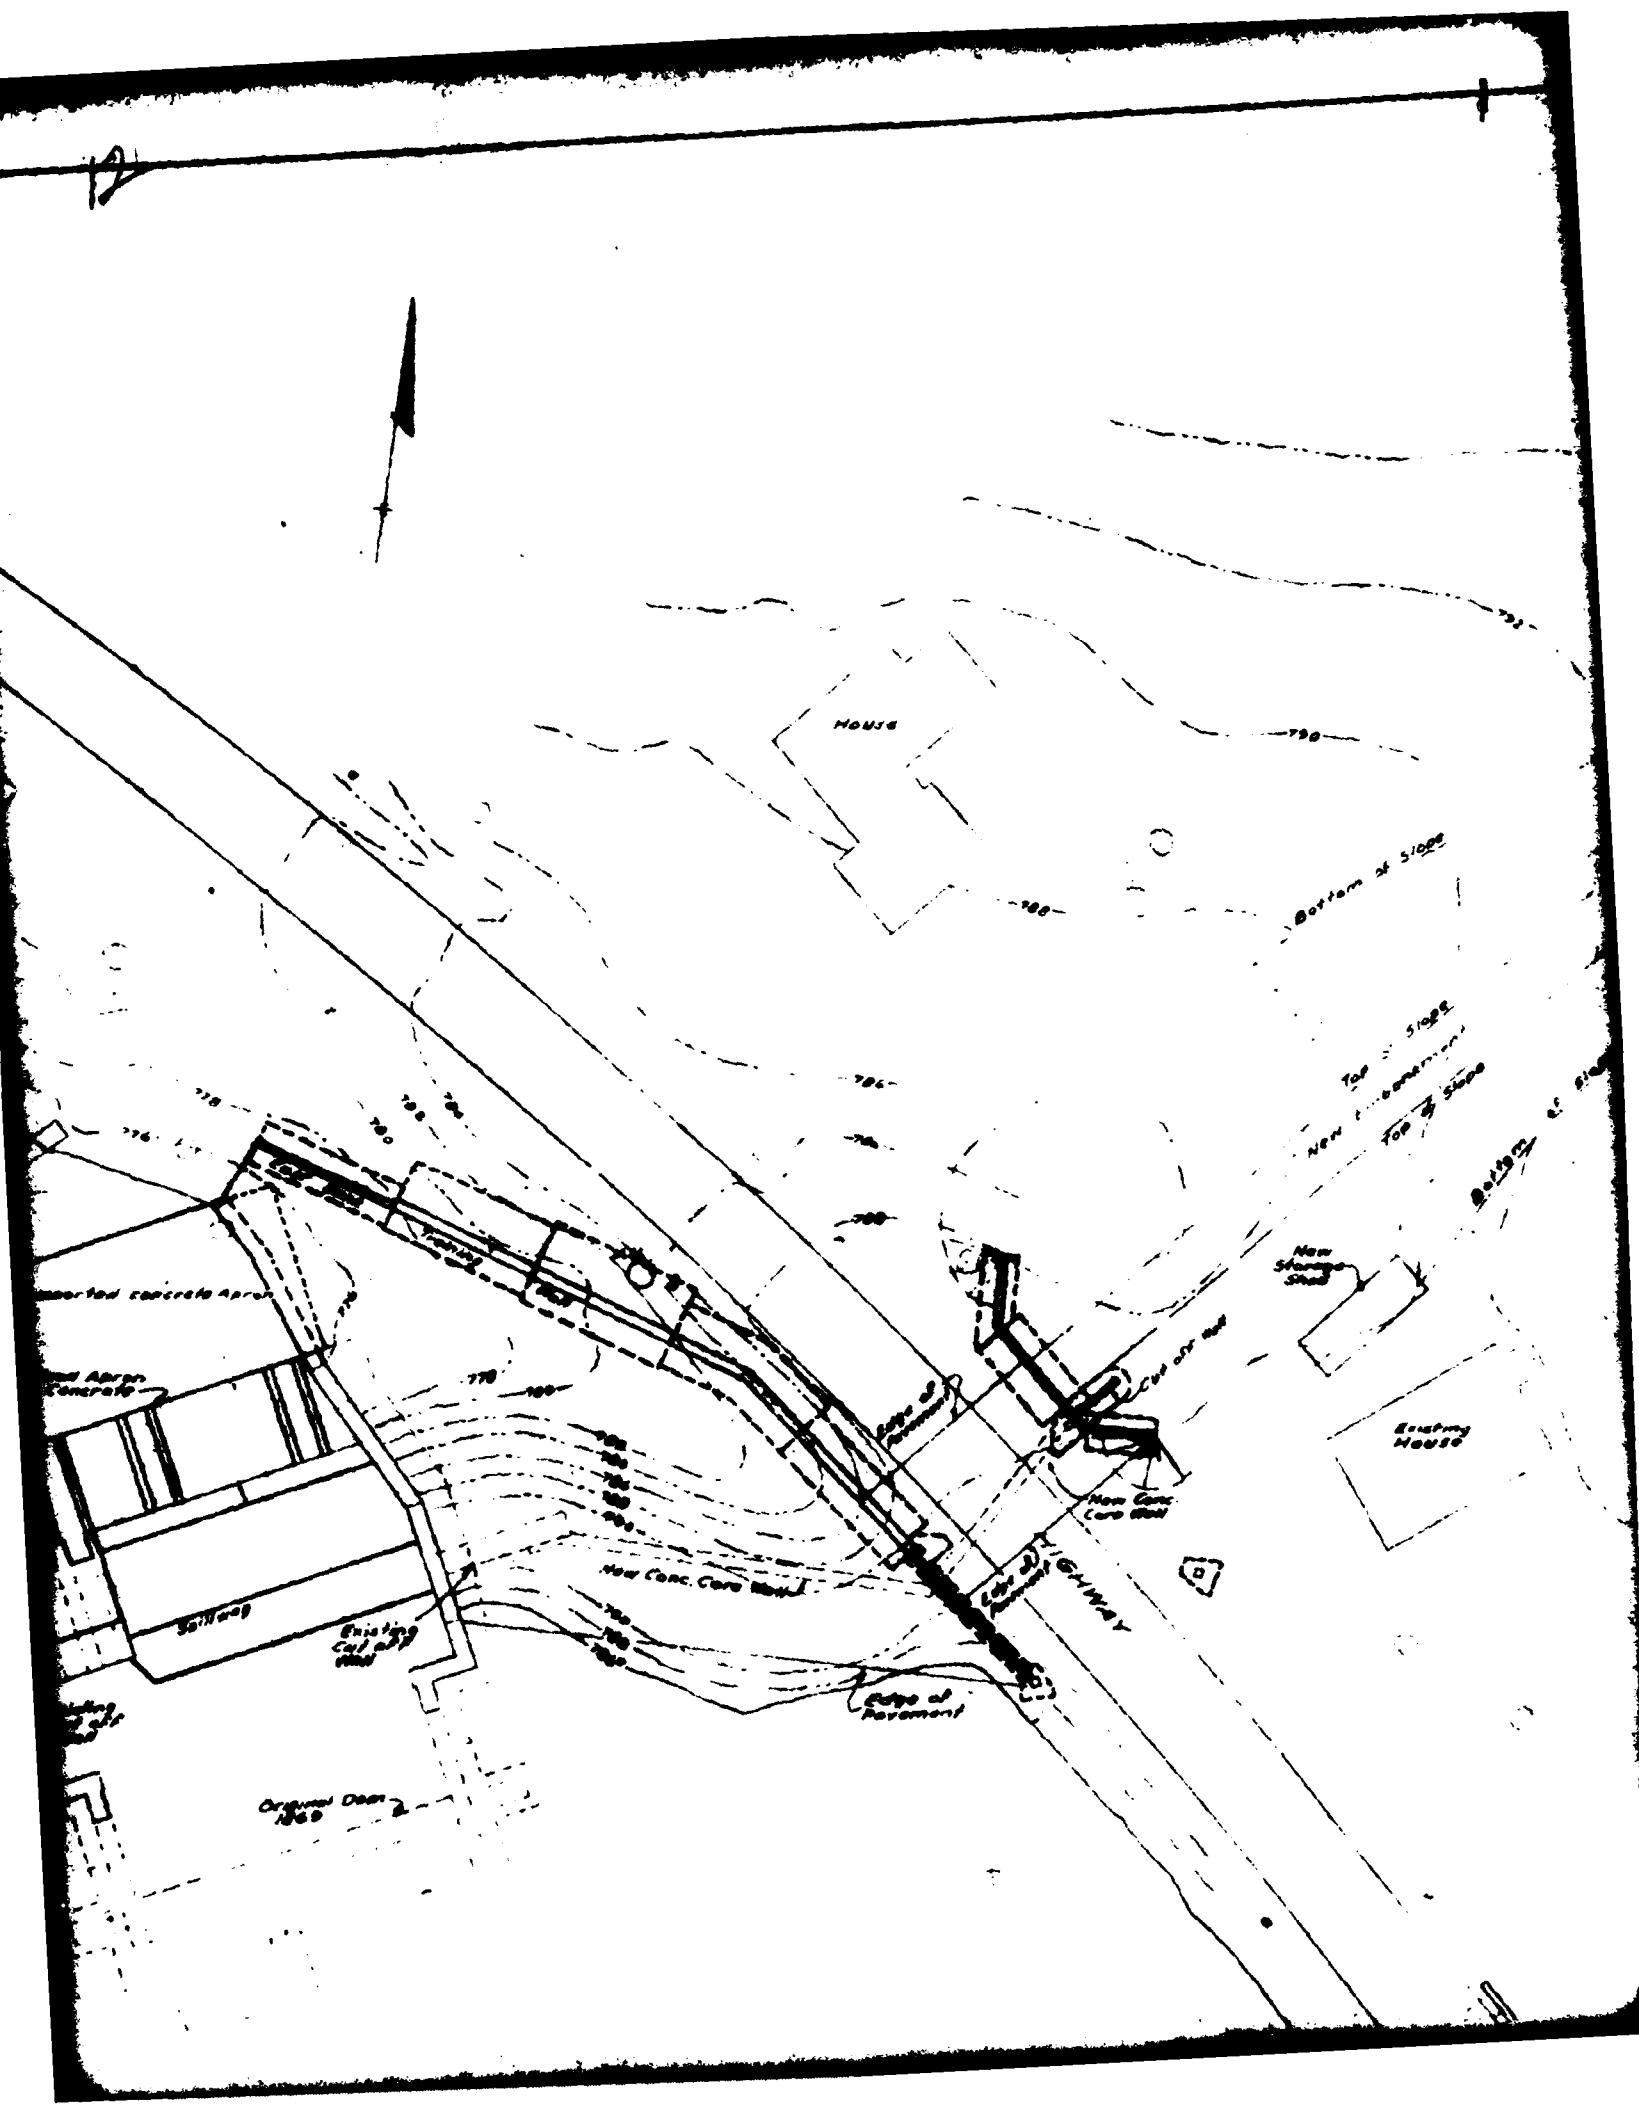

13

Bottom of Slope


Top of Slope


Top of Embankment

Top of Slope

Bottom of Slope

Grading House

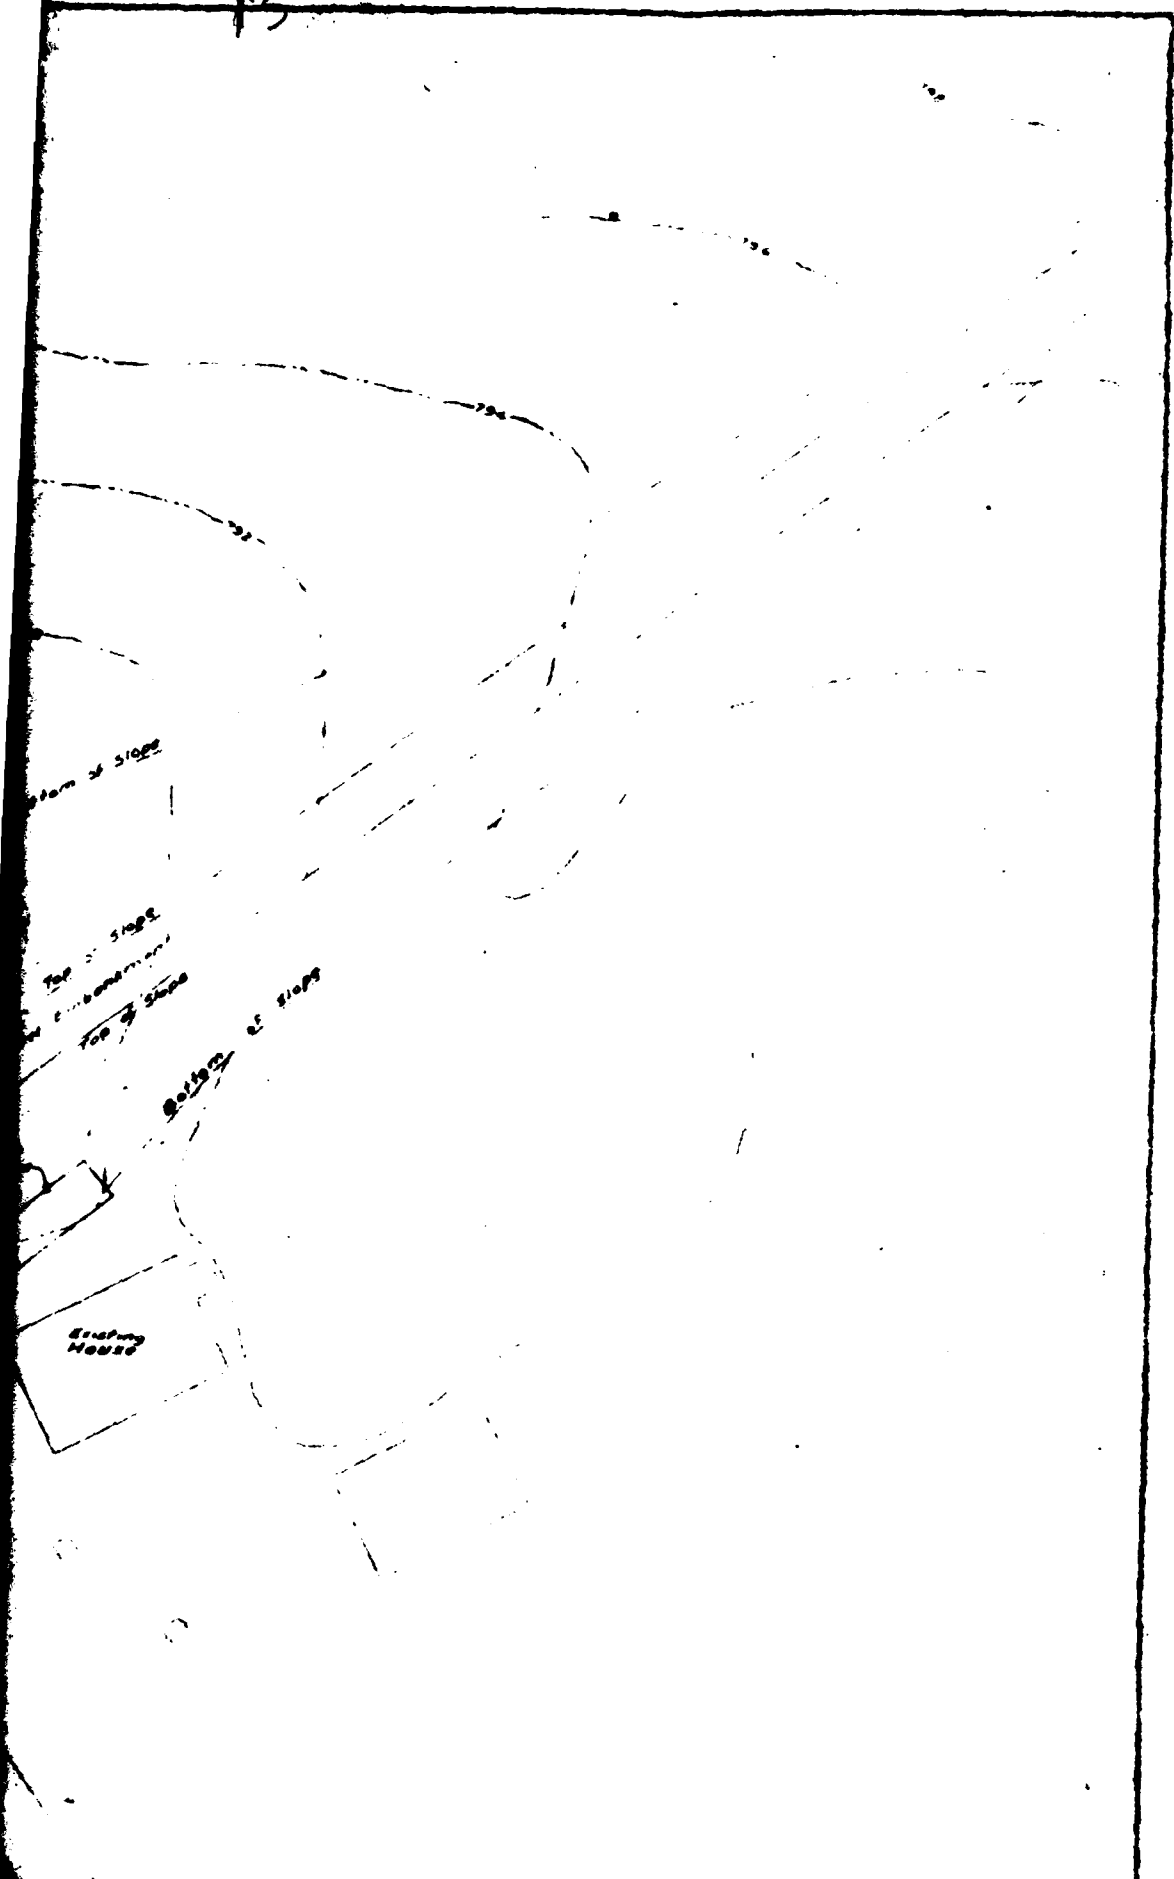


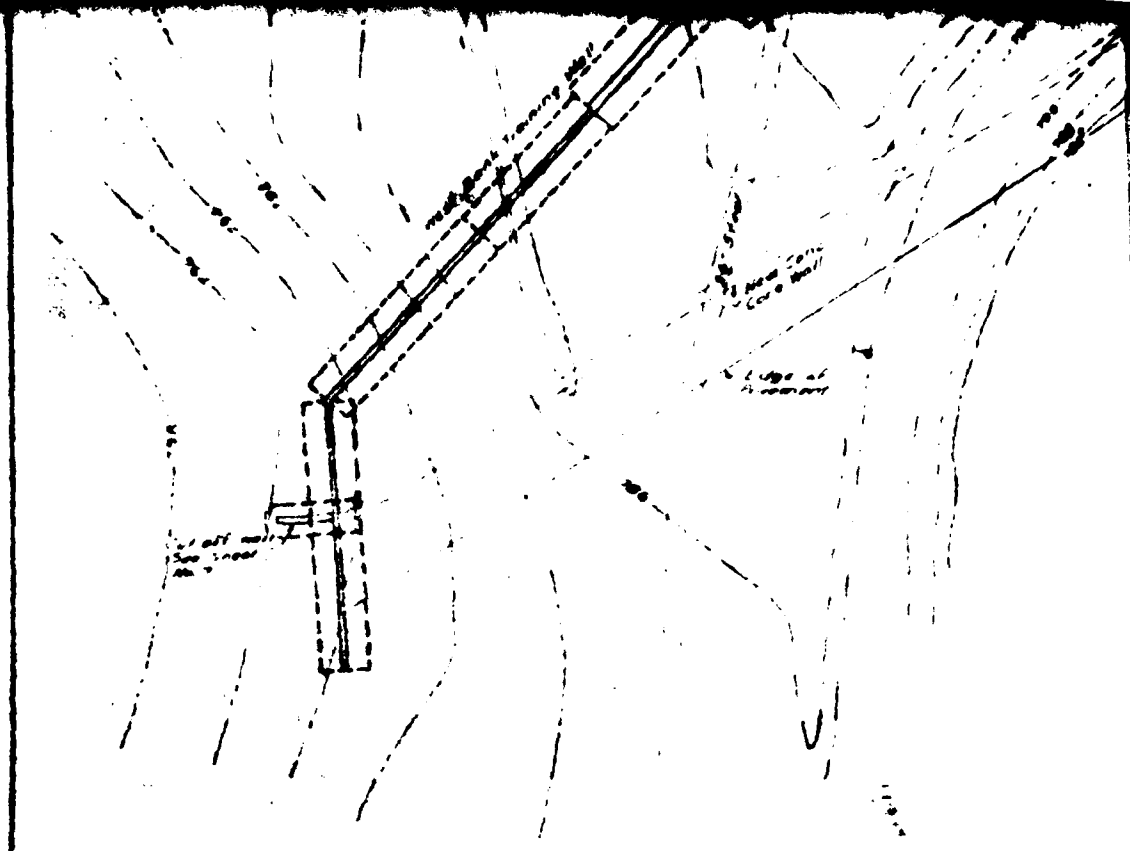


OTISCO

IN CHARGE OF W.E.N.
DESIGNED BY J.J.H.
MADE IN A.J.B.E.D.
DRAWN BY

4

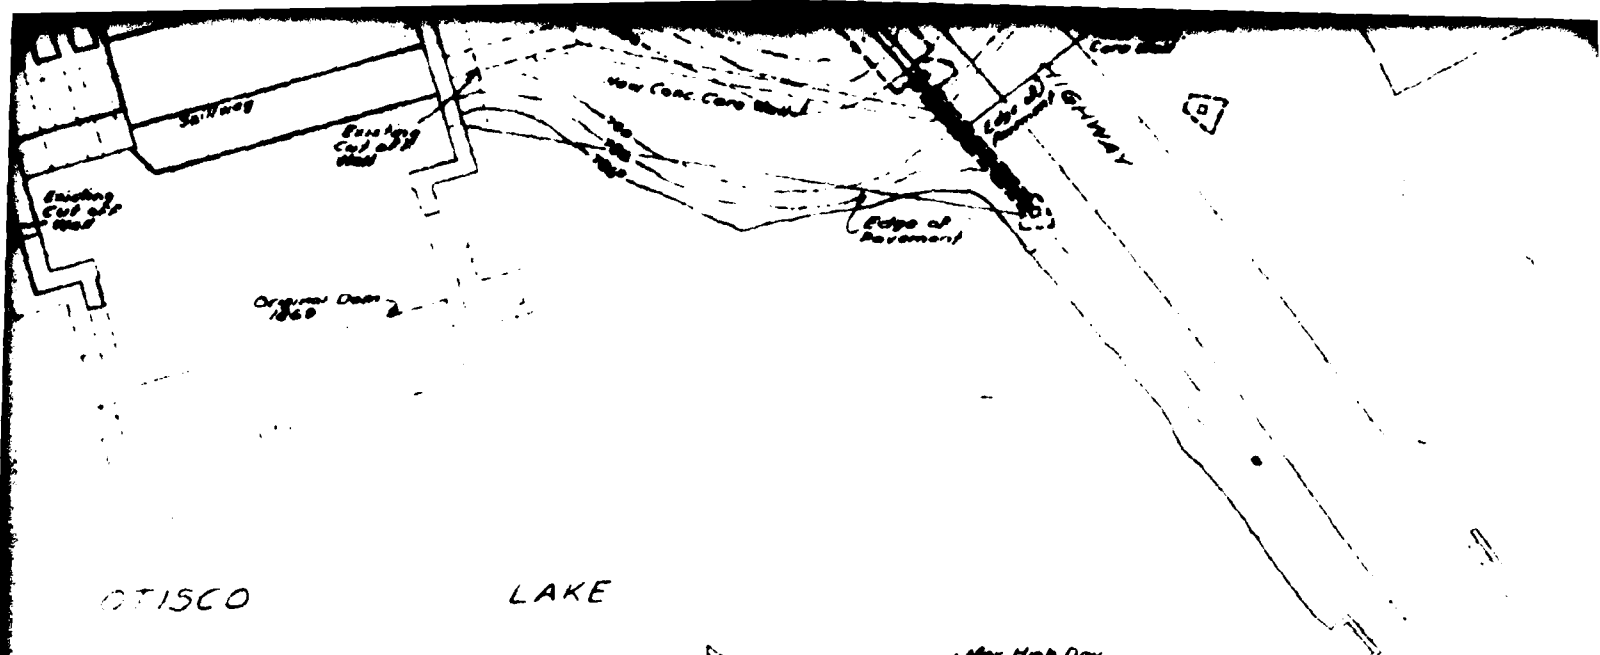

OTISCO LAKE

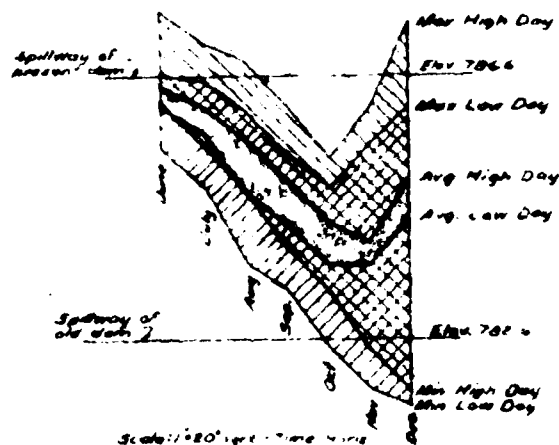

Scale 1" = 80' vert. Time 1 hr
OTISCO LAKE LEVELS
 Maximum + Minimum Daily Levels
 By Months
 1948 - 1959

15

Engineering
House

ONONDAGA COUNTY WATER AUTHORITY
OTISCO LAKE DAM MODIFICATIONS
GENERAL PLAN

O'BRIEN & GERE
CONSULTING ENGINEERS & LAND SURVEYORS
SYRACUSE, NEW YORK


DATE: MAY 5, 1961

SCALE: 1" = 20'


FILE NO: 2095 15-081


B 1


16

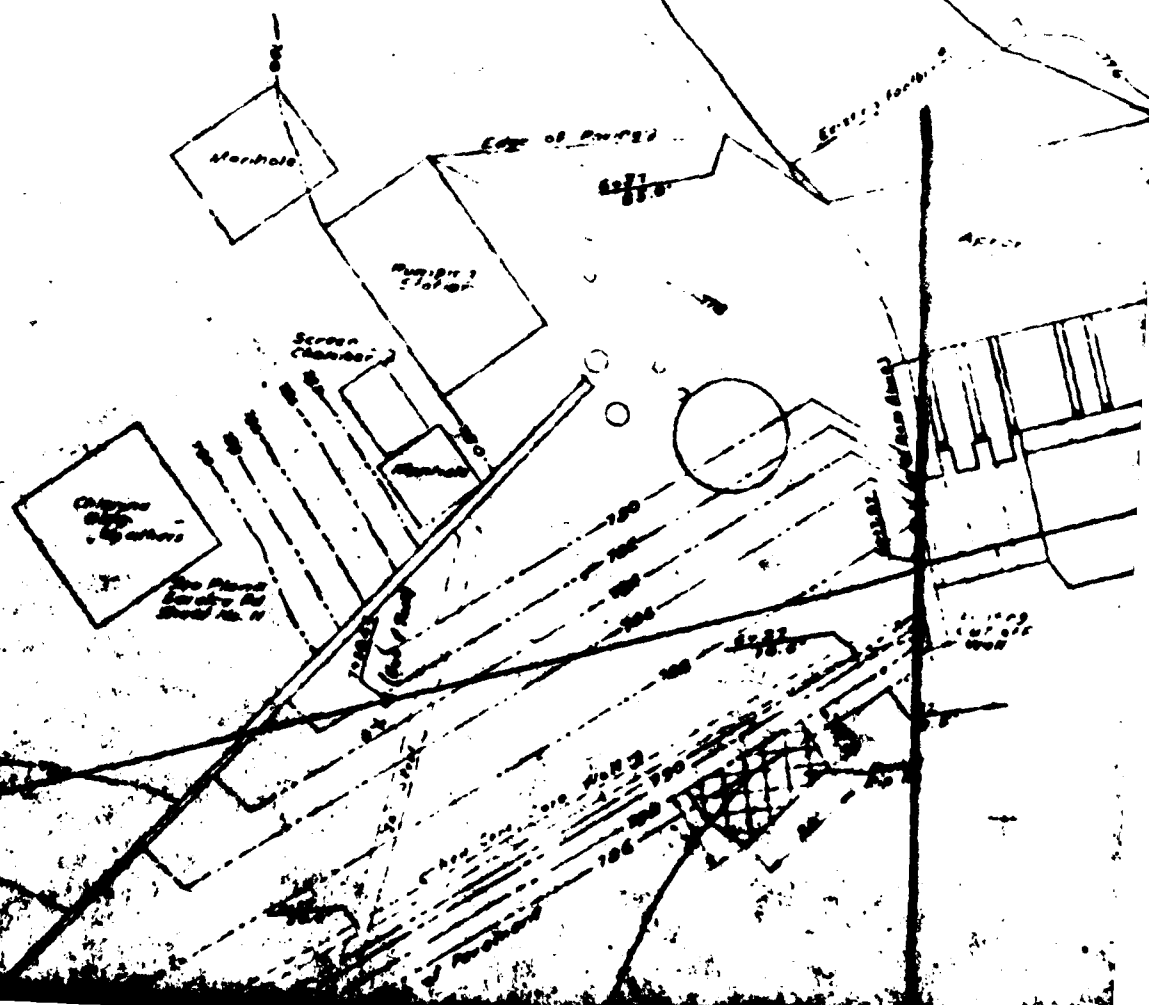

13

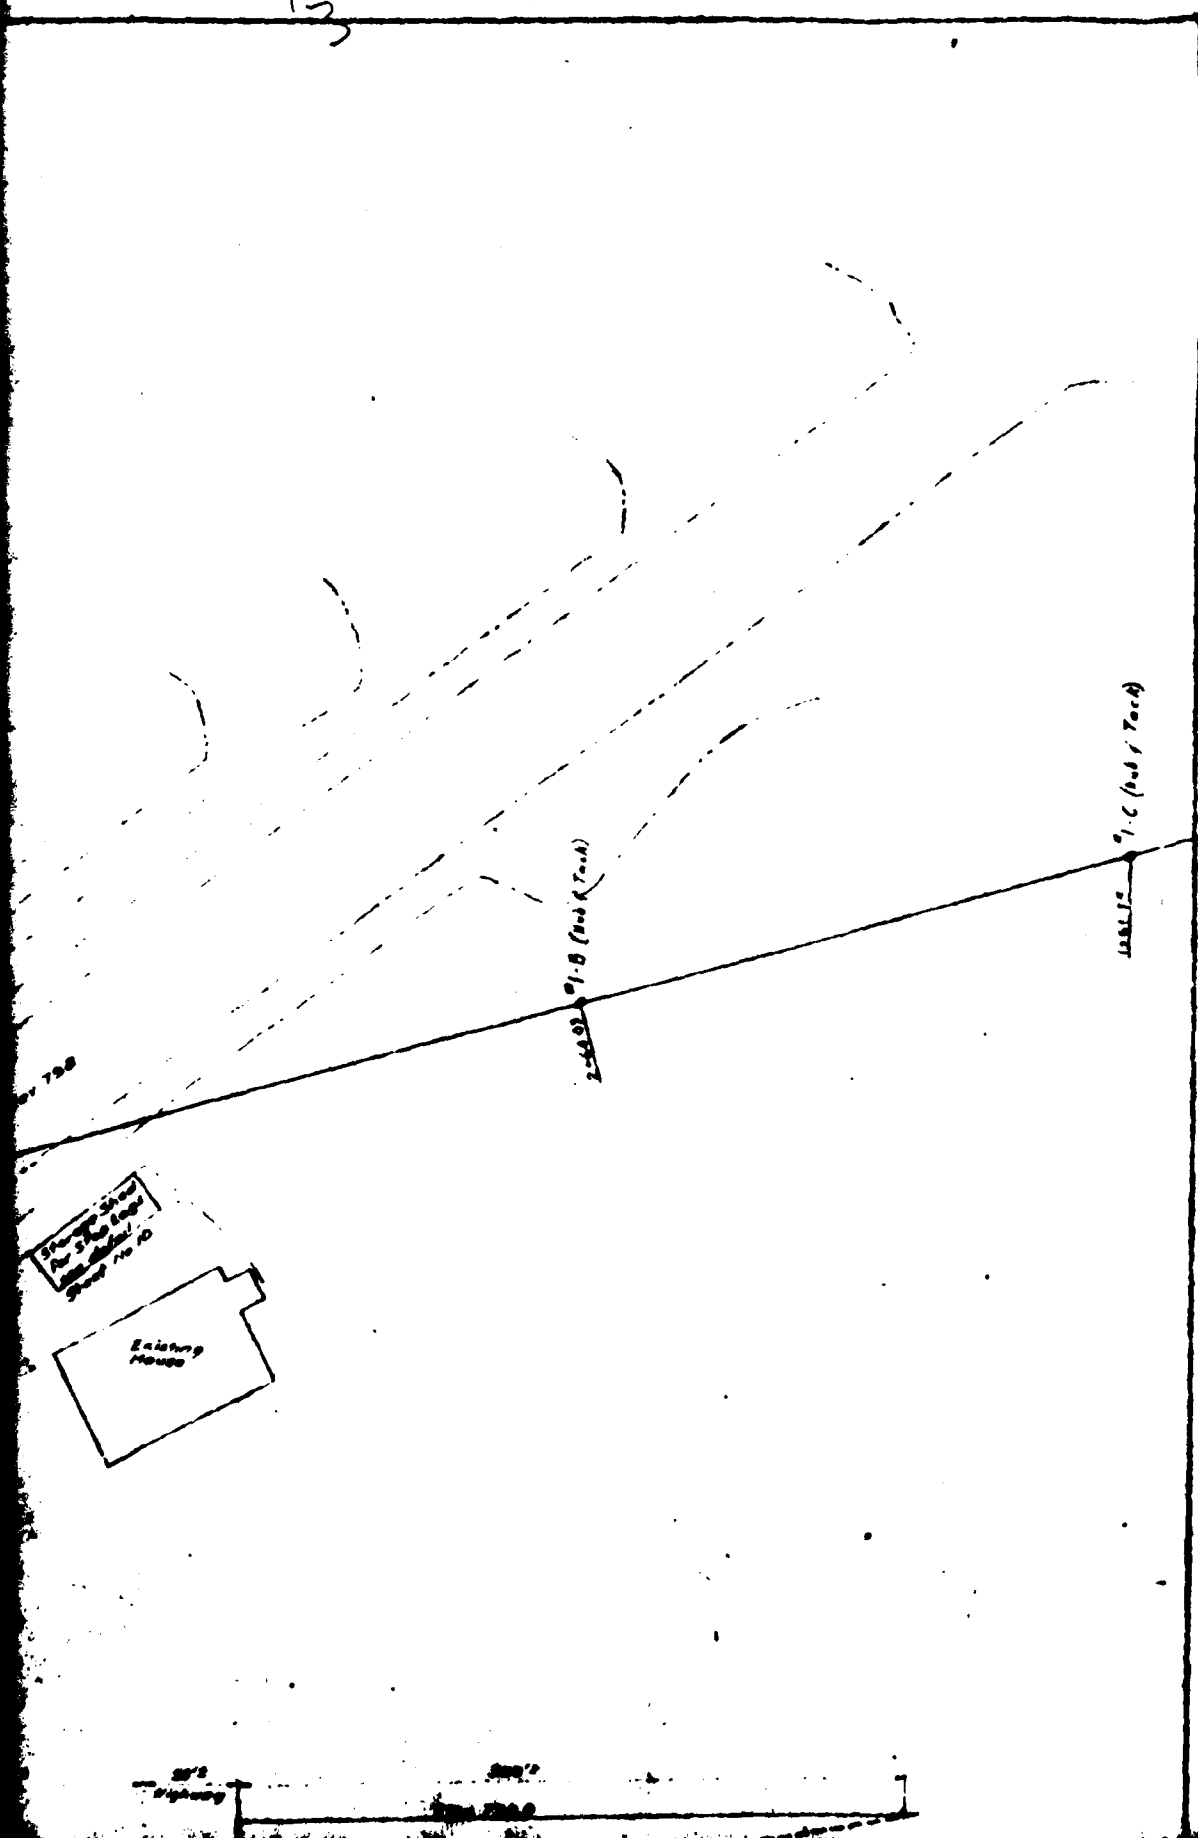

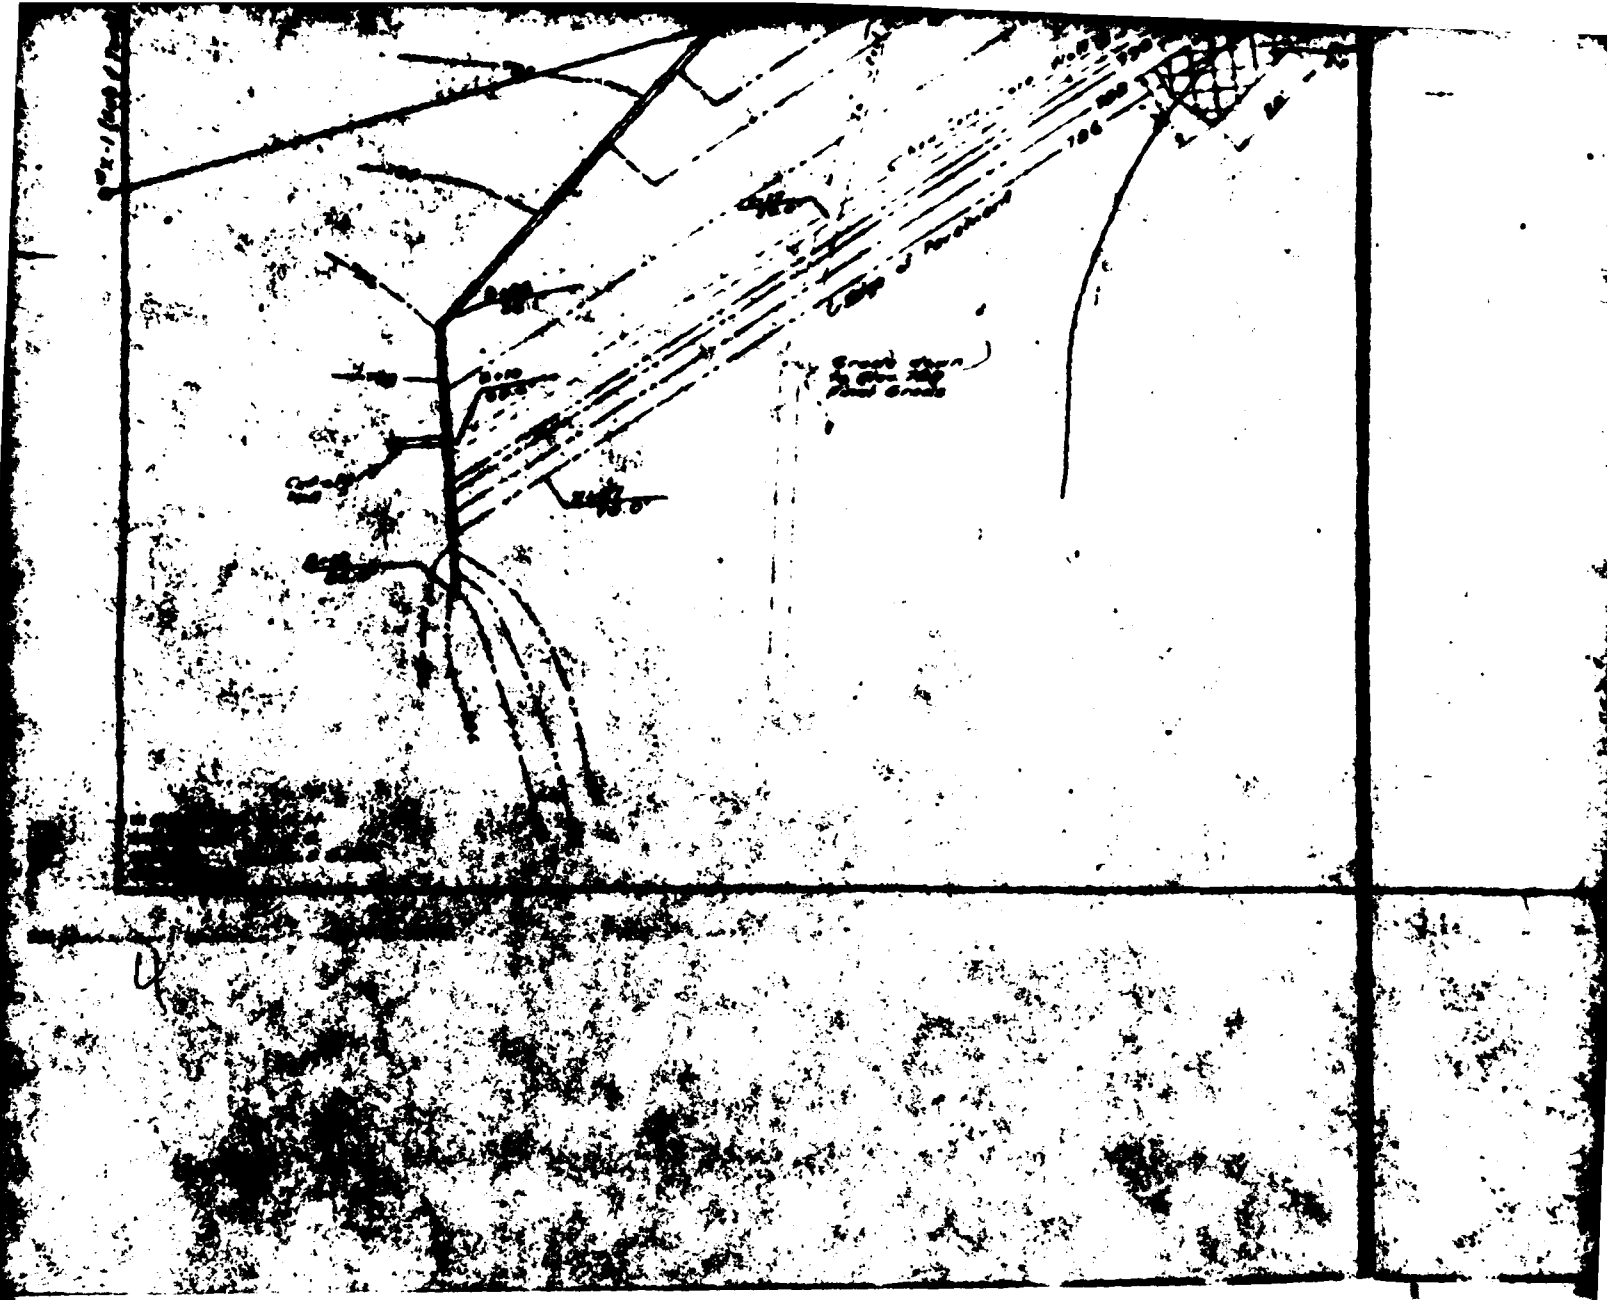



Scale: Horiz. - 1" = 50'
Vert. - 1" = 10'

NO LONGER
IN USE

Existing
House

110'±

35'±

300'±

Elev 728.0

Existing
Cut Off
Wall

Elev 722.0

Bottom of New Concrete
Core Wall

EMBANKMENTS

1973

(unpublished)

CHONDAGA COUNTY WATER AUTHORITY
OTISCO LAKE DAM MODIFICATIONS
FINAL CONTOUR PLAN

DATE MAY 15, 1988

BY [illegible]

FILE NO. 10-1-10-10


2

B 1 1

6


[illegible]

**TYPICAL TRANSVERSE JOINT
BETWEEN PAVEMENT SLABS**

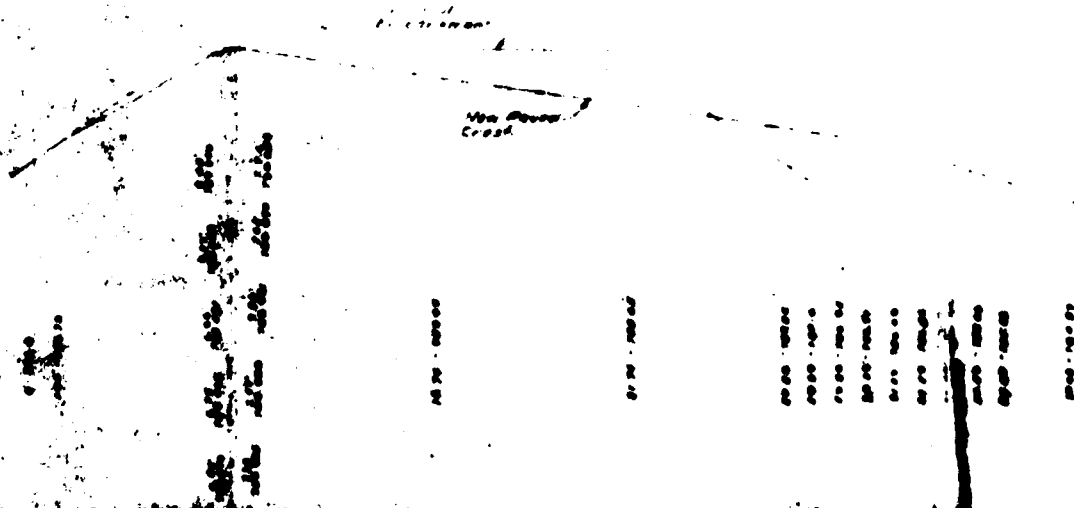



2007-08



Var 10 scalar

DETAIL OF NEW



**JOINT
SLABS**

AIR VENT DETAIL


**TYPICAL JOINT
WITH NEW MASONRY**

TAIL OF NEW EMBANKMENT

Not To Scale

The rest of the drawing is on the next page

CREST ELEVATIONS

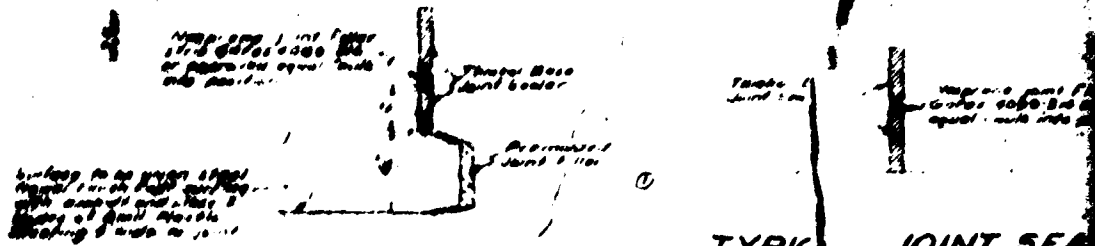

TYPICAL JOINT SEAL
W/ WALLS
OF 10.5.106



TYPICAL JOINT SEAL FOR
PAVEMENT SLAB
NOT TO SCALE

IN ACCORDANCE WITH
SPECIFICATIONS OF
AASHTO T 226
SECTION 2.01

See drawing
see notes
Sheet # 9

DETAIL OF NE

✓✓ ✓✓ ✓✓ ✓✓

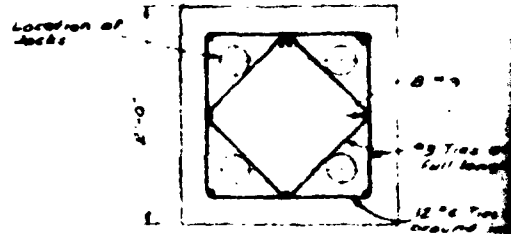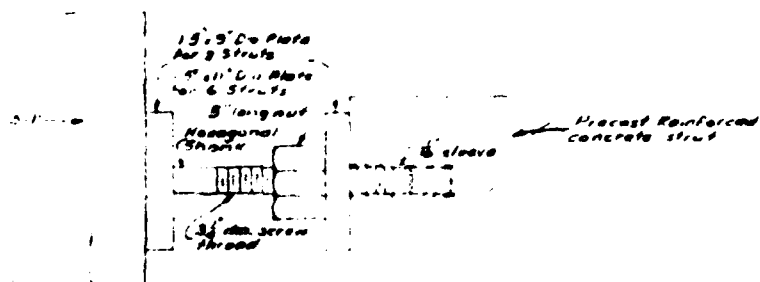

**TYPICAL DETAIL OF
REINFORCED STRUTS**

Use one joint filler strip
Grades 4099-3rd or approved
equal (cut into pos. then.


TYPICAL STRUT & JACK SCREW

**JOINT SEAL
WALLS**


to Score

REVISION

REVISED

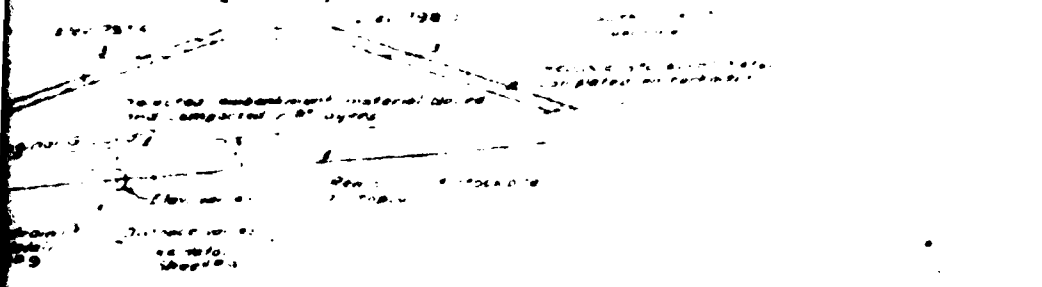

DETAIL OF NEW EMBANKMENT

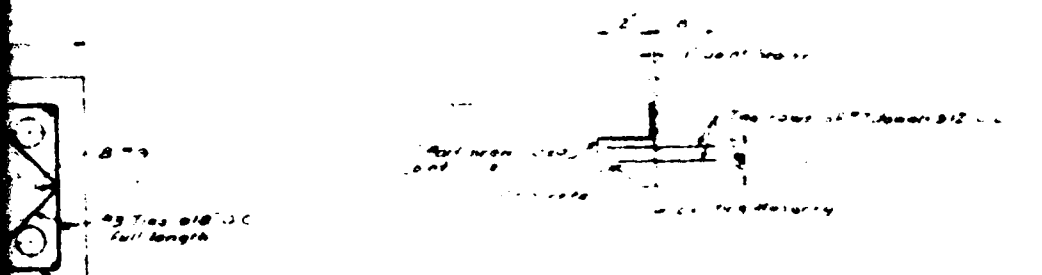


TYPICAL JOINT WITH EXIST. MASONRY


DETAIL OF STRUTS


REVISIONS 1 6	ONONDAGA COUNTY WATER AUTHORITY OTISCO LAKE DAM MODIFICATIONS TYPICAL EMBANKMENT & PAVING DETAILS		DATE MAY 15, 1961 SCALE AS SHOWN P.L.N. 209 5-15-18F	3
	O'BRIEN & GORE CONSULTING ENGINEERS & LAND SURVEYORS SYRACUSE, NEW YORK			
	<i>[Signature]</i>			
	16			

A

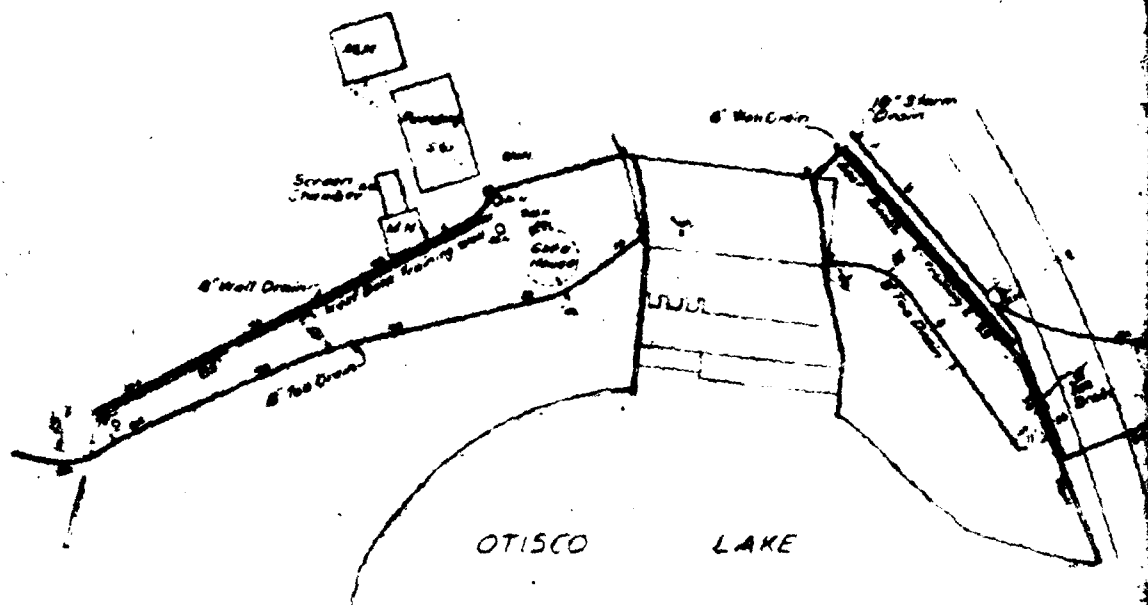


PLAN
Scale: 1" = 40'

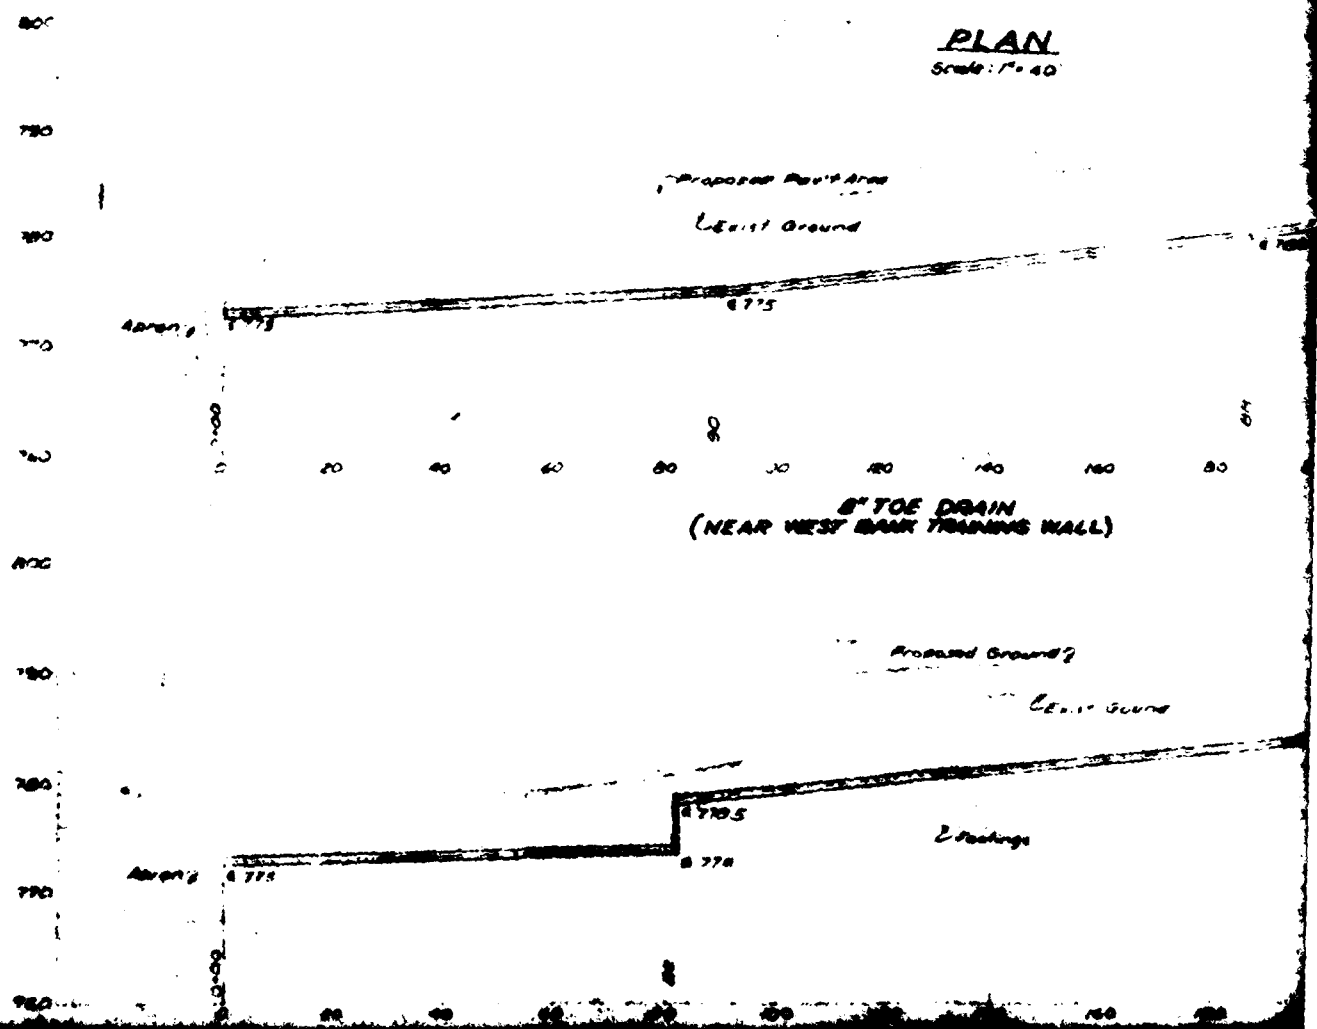


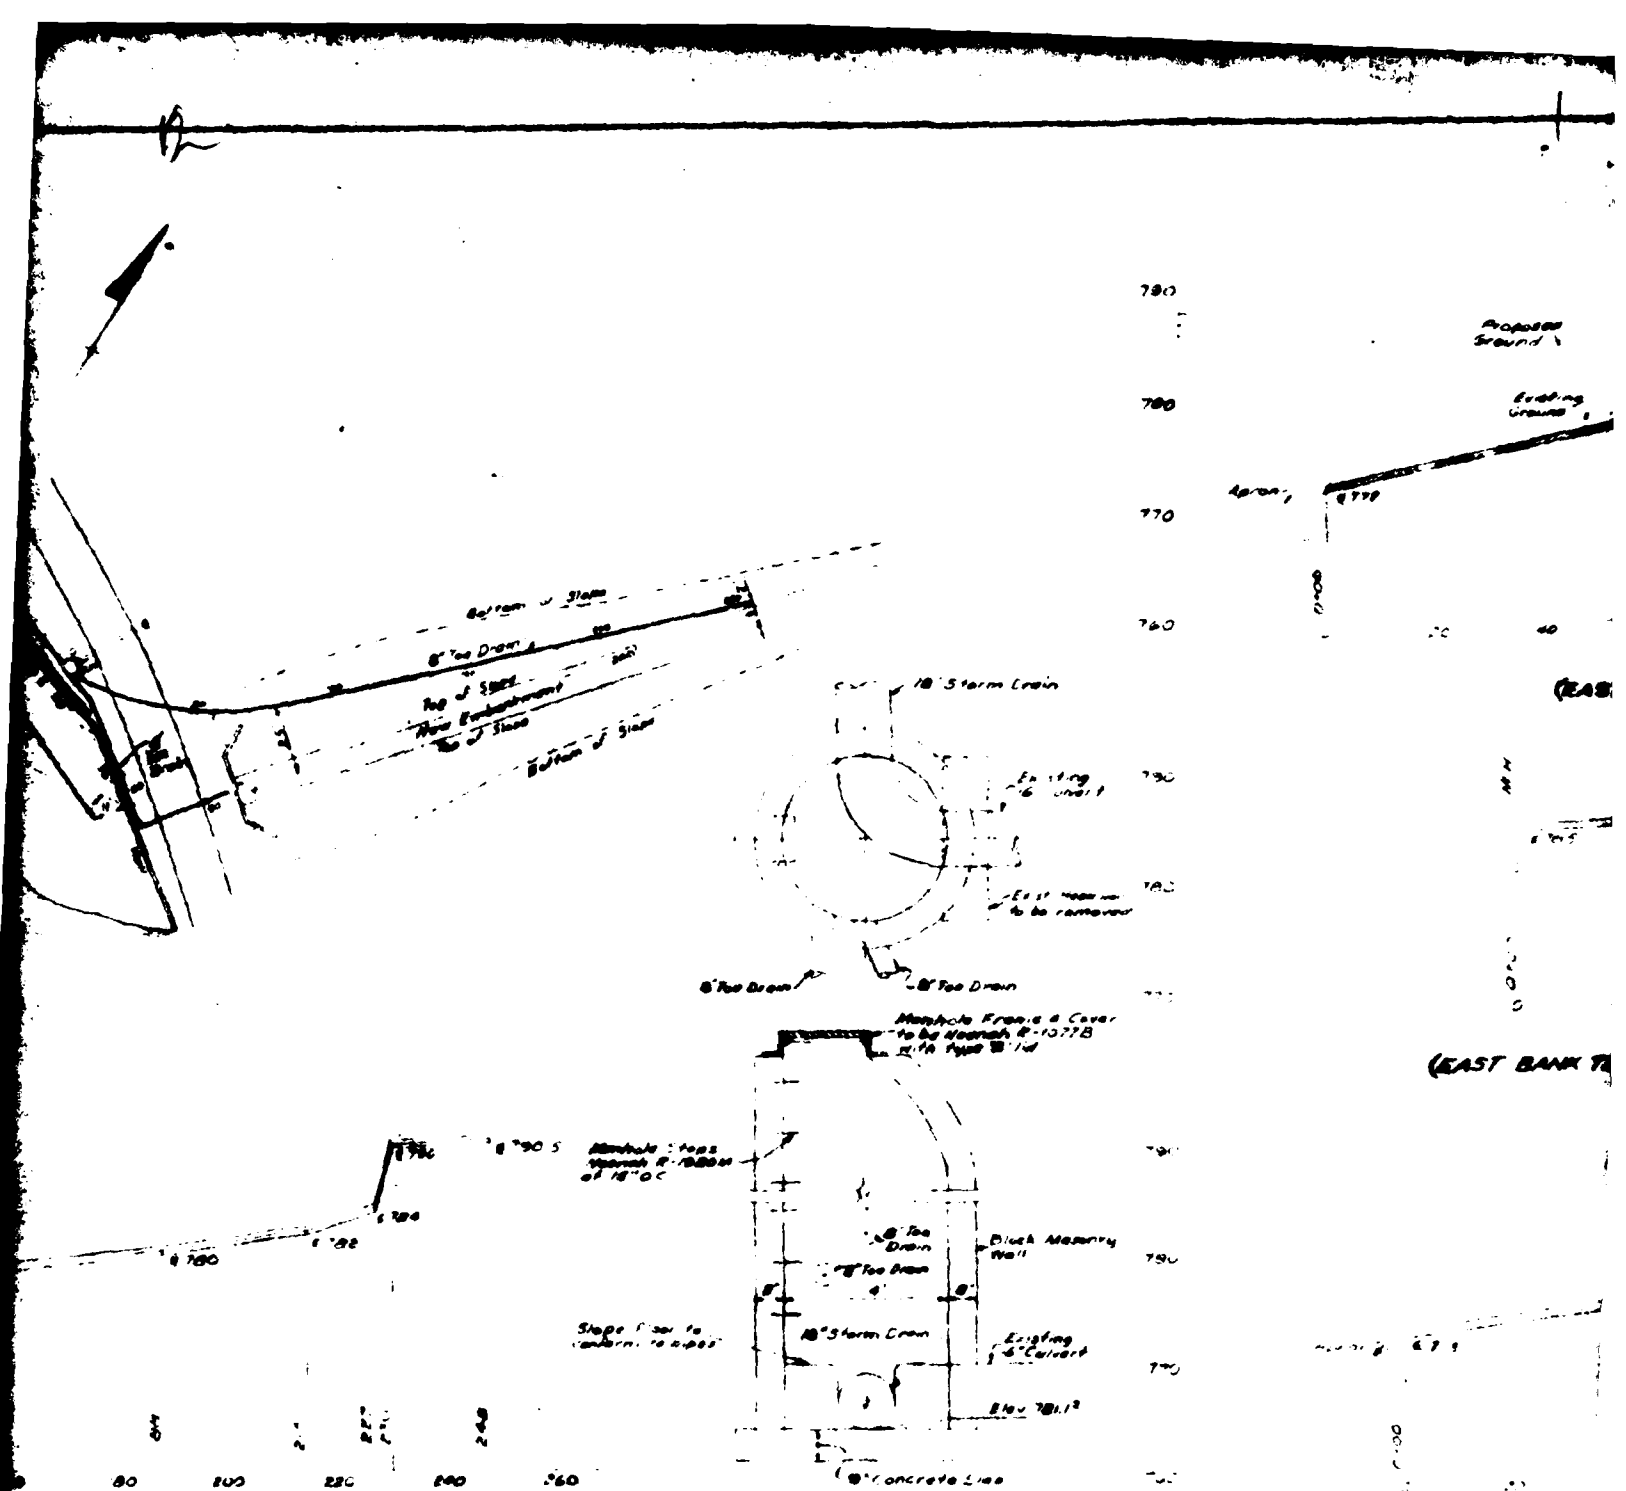

**TYPICAL SECTION THRU
MANHOLE**
Not To Scale

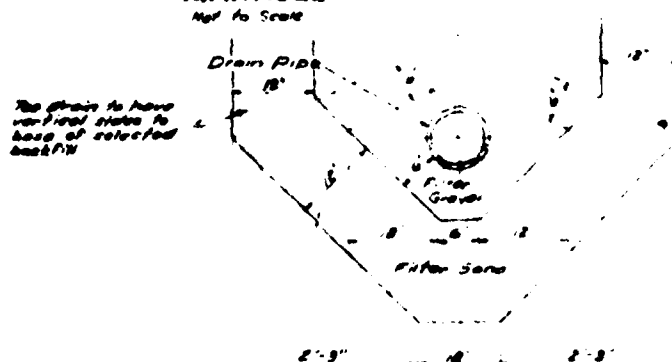

TYPICAL SECTION OF TOE DRAIN
Not To Scale

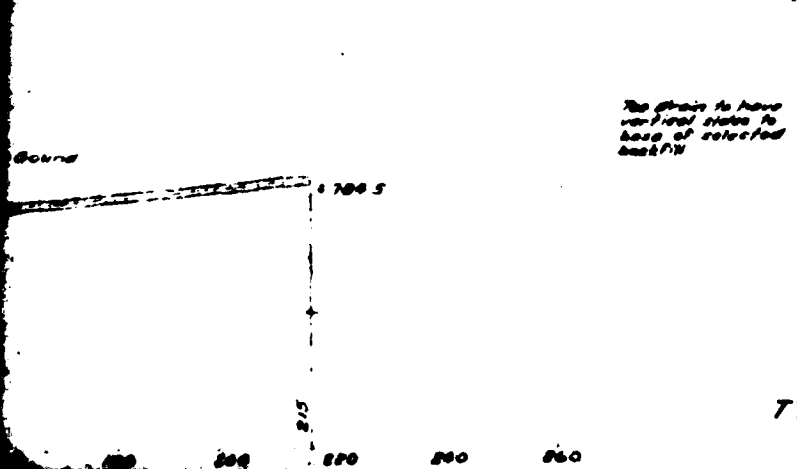

(BETWEEN DI

Top of toe drain
the embankment
past of highway

13

Proposed
Ground

Existing
Ground

2 feet

8" WALL DRAIN
(EAST BANK TRAINING WALL)


8" TOE DRAIN
(EAST BANK TRAINING WALL & UNDER HIGHWAY)

8" TOE DRAIN
(BETWEEN DAM & EAST BANK TRAINING WALL)

Top of toe drain
for embankment
east of highway



20' Horiz. to 1710 vert.

52
20' Horiz. to 1710 vert.

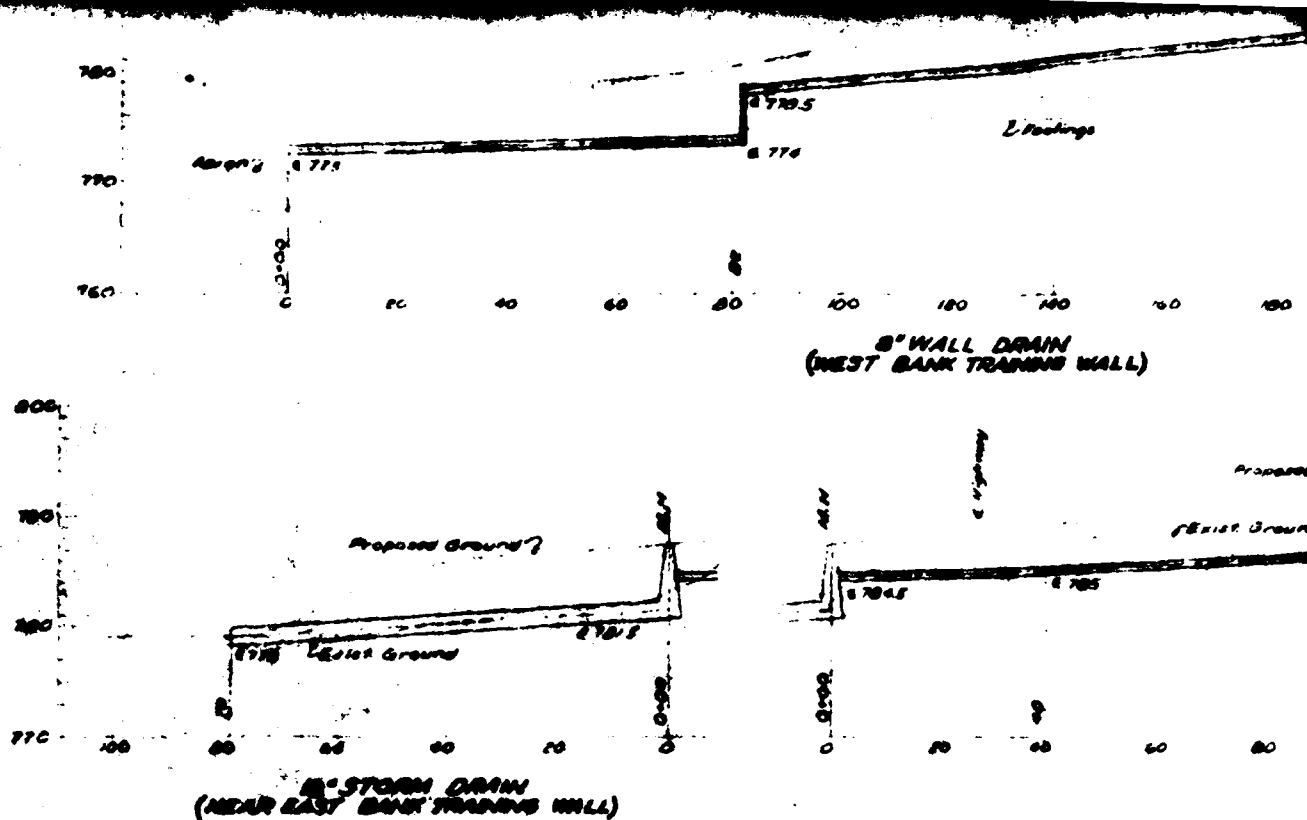

DESIGNED BY: J.E.H.
 CHECKED BY: J.E.H.
 DATE: 6.5.0
 DRAWN BY:

14

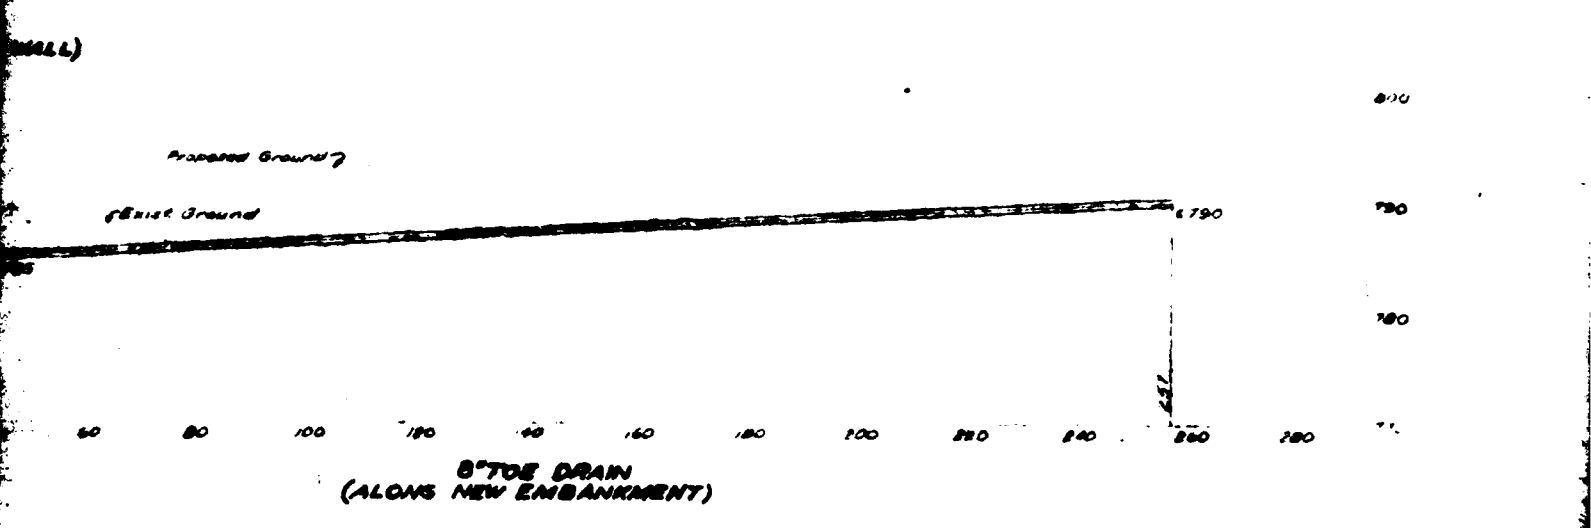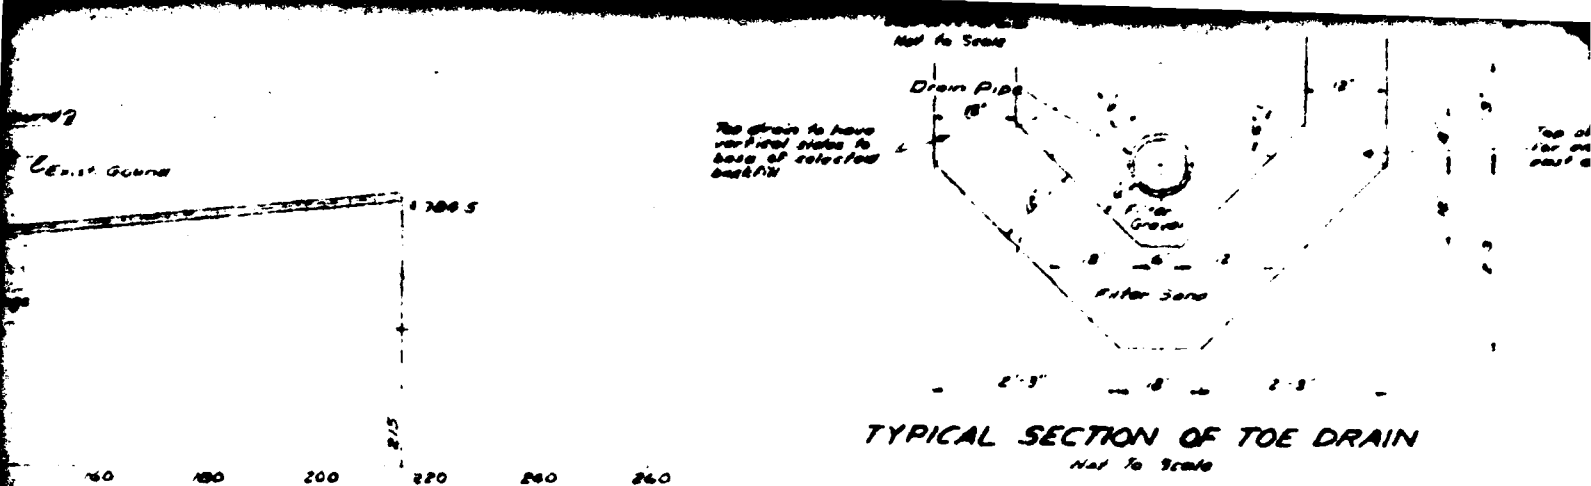

OF THE DRAIN
(BETWEEN DAM & EAST BANK TRAINING WALL)


Top of toe drain
for embankment
out of highway

Top of toe drain
for embankment
out of highway

DRAIN

TYPICAL SECTION OF WALL DRAIN


NOT TO SCALE

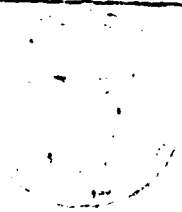
REVISIONS 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	ONONDAGA COUNTY WATER AUTHORITY OTISCO LAKE DAM MODIFICATIONS DRAINS			
	O'BRIEN & GERE CONSULTING ENGINEERS & LAND SURVEYORS 100 N. 1ST ST. SYRACUSE, N.Y. 13201			DATE MAY 15, 1961
				SCALE AS SHOWN
	FILE NO. 200.0-15-80F			


5

A 2

6

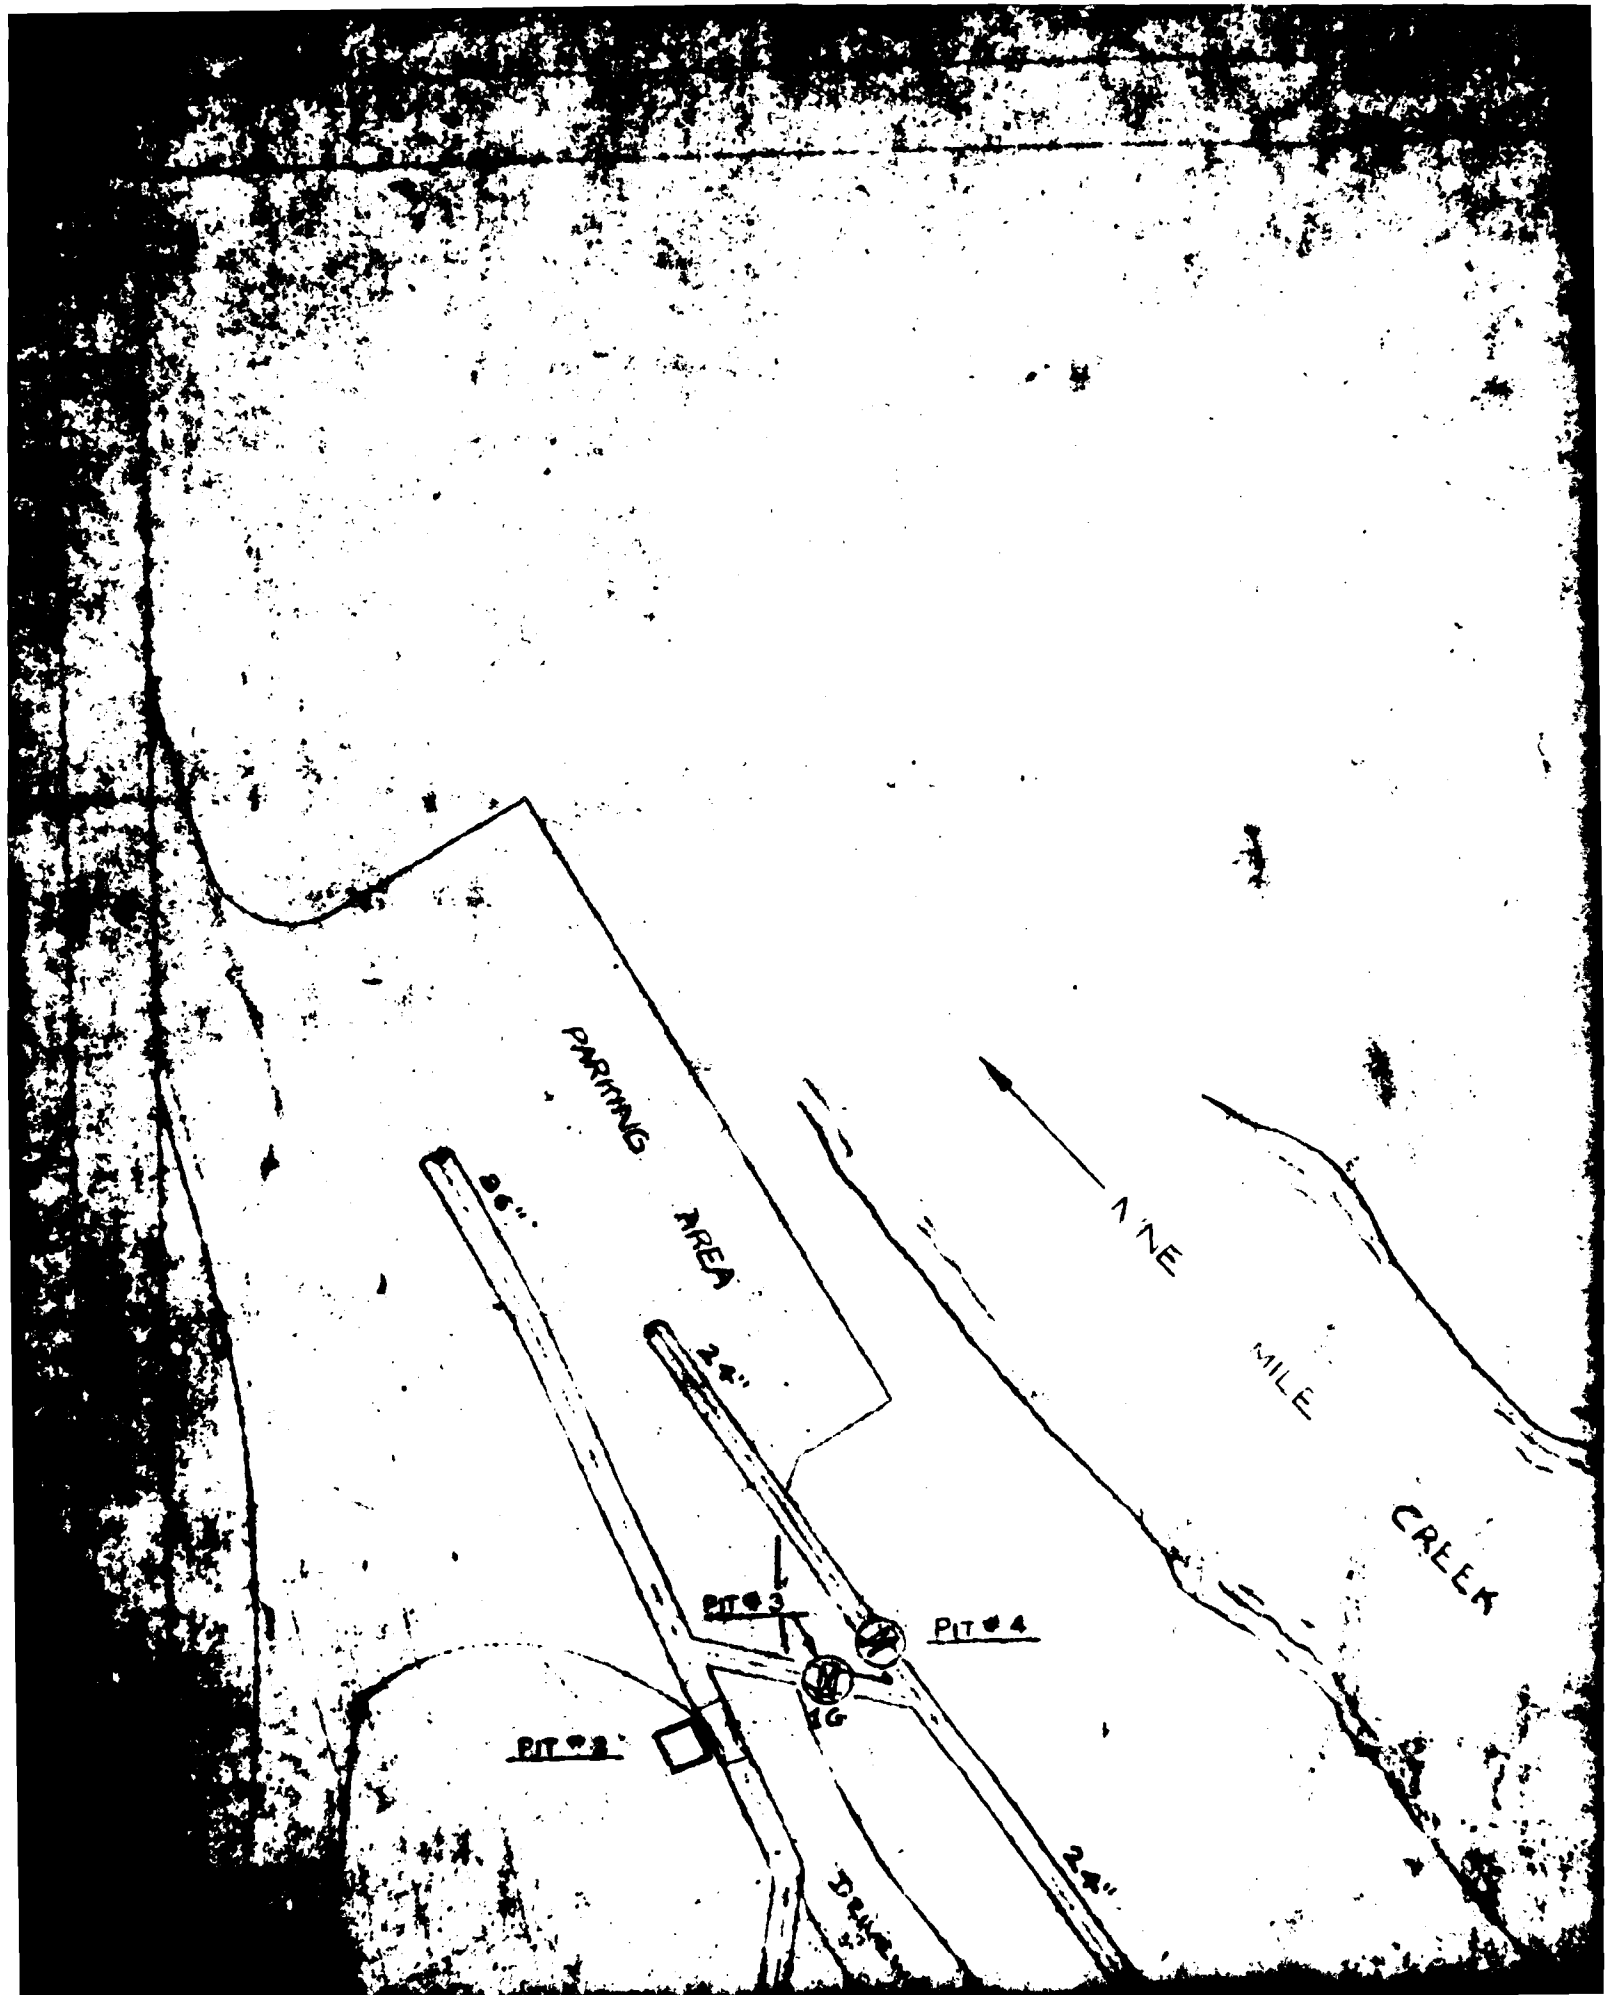

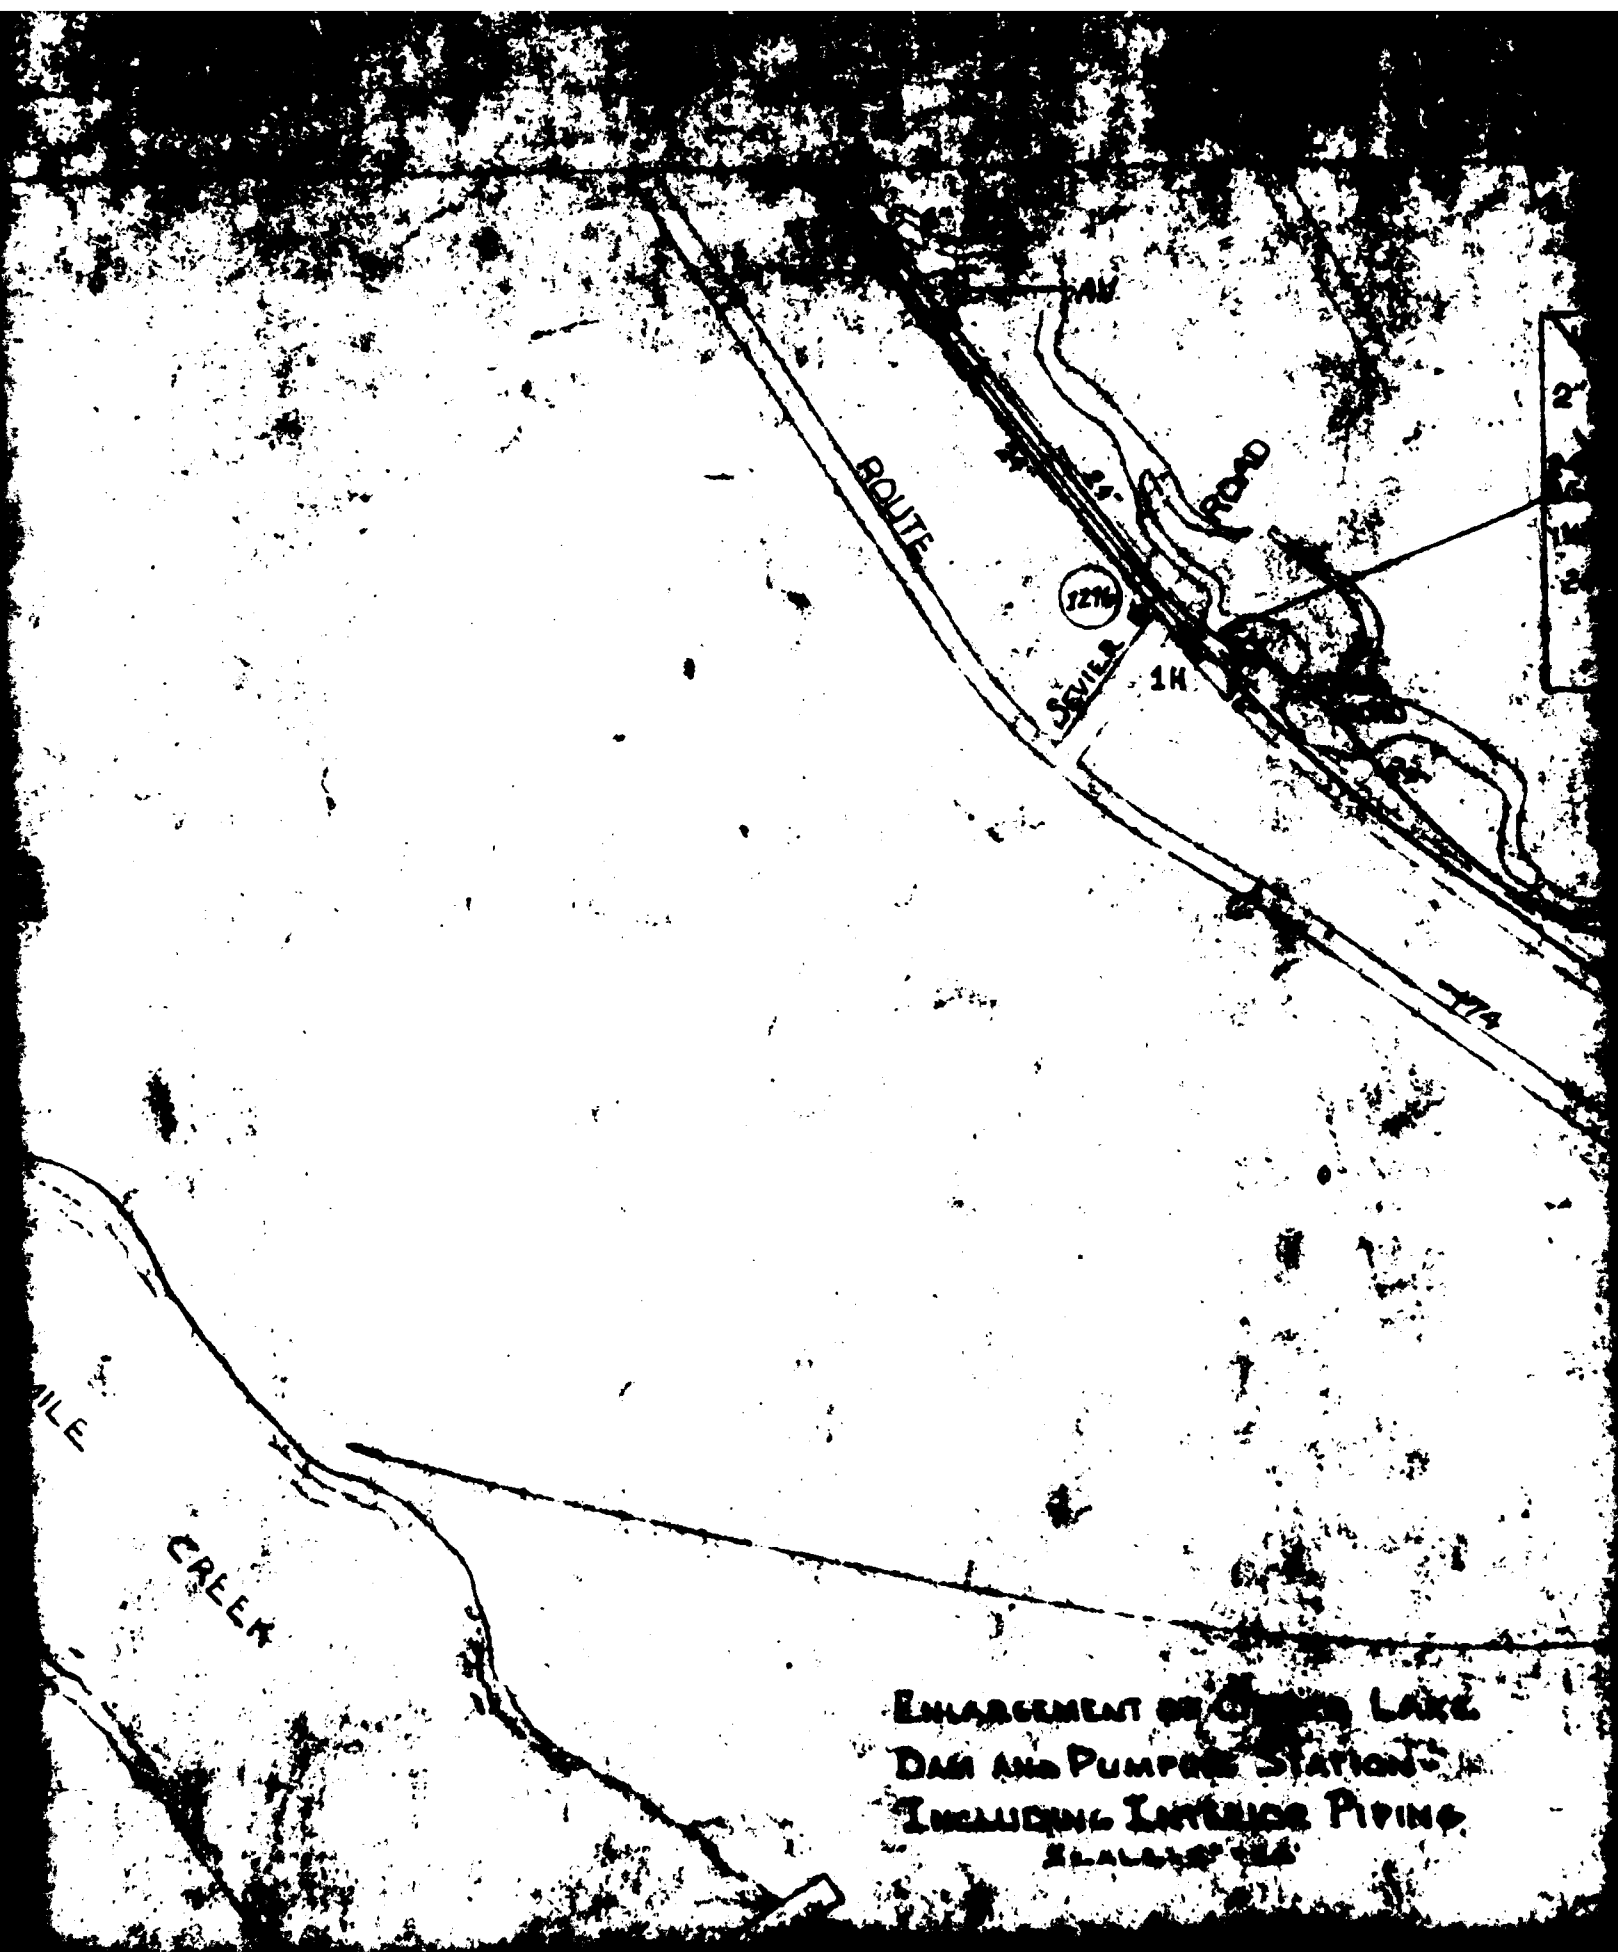

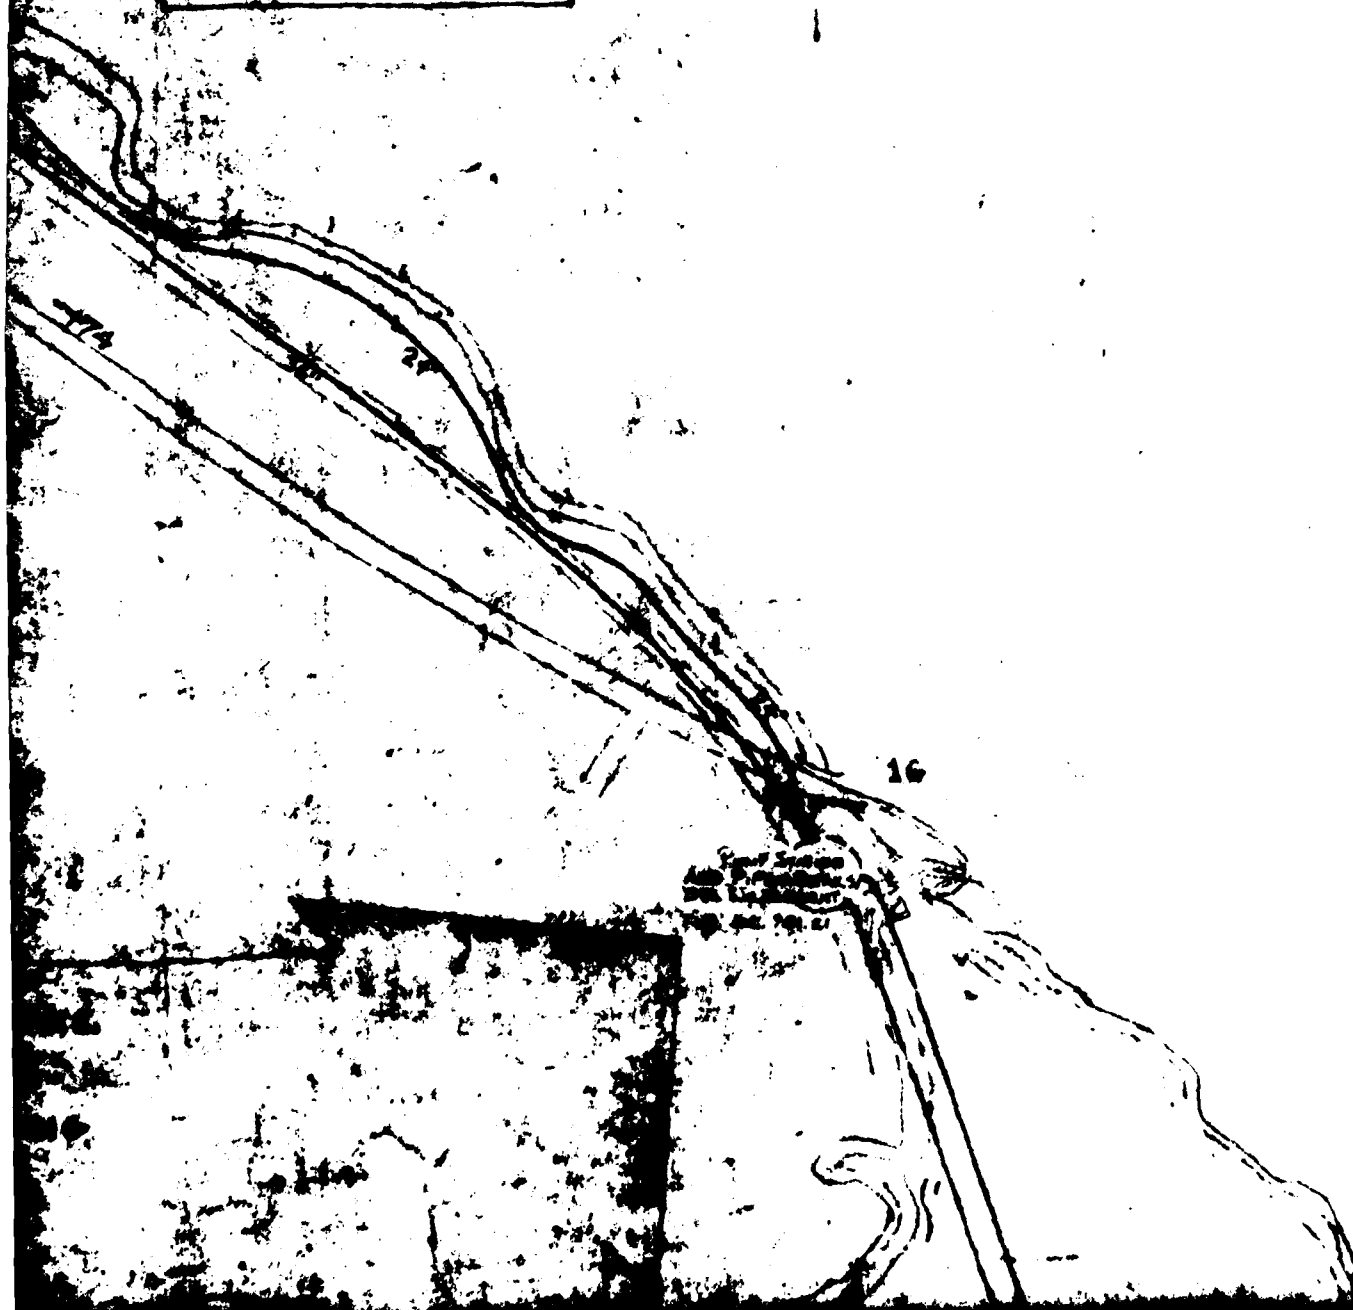

New Earth
Berm

PIT No.	Sample Room	PIT TYPE	Notes
1	YES	DISCHARGE PIT	24" DIA
			24" DIA
			24" DIA
2	YES	TRANSMITTER PIT	FLOW
3	NO	VALVE PIT	24" DIA
4	NO	VALVE PIT	24" DIA
5	YES	WELL PIT	AUXILIARY
			TENANT
6	NO	VENTURI PIT	24" DIA
7	NO	VALVE PIT	24" DIA
			24" DIA
			REF
8	NO	CHLORINE SOLUTION PIT	3 CORN
			11.5
9	NO	OLD VALVE HOUSE PIT	24" DIA
			4 CORN
			2 SCREEN
10	NO	VALVE PIT	24" DIA
11	NO	VALVE PIT	24" DIA
12	YES	JUNCTION MANHOLE	24" DIA
			BUTTER
			24" DIA
13	NO	CHLORINE SOLUTION LINE PIT	CHLORINE
			CONN
			SOL
14	ABOVE GROUND	SCREEN CHAMBER	SCREEN
			3

New Earth
Berm

Elev. 798.0


205' ±


21'

55'

110'

PIT TITLE	CONTENTS
CHARGE W	42" SUCTION VALVE, HYDRAULIC BUTTERFLY
	36" DISCHARGE VALVE, HYD. BUTTERFLY
	80" BY-PASS VALVE, HYD. BUTTERFLY-CLOSED
	90° CHECK VALVE
TRANSMITTER PIT	FLOW METER TRANSMITTER
VALVE PIT	24" DISCHARGE VALVE, MANUAL GATE-OPEN
VALVE PIT	24" DISCHARGE VALVE, MANUAL GATE-OPEN
WELL PIT	AUXILIARY CHLORINATOR SUPPLY WELL PUMP
	TENANT HOUSE WATER PUMP & TANK
VENTURI PIT	24" x 16" VENTURI, 1/2" SAMPLE PUMP
VALVE PIT	24" BY-PASS VALVE, MAN. GATE-CLOSED
	24" CHECK VALVE, CLAPPER ASSEMBLY
	REMOVED.
CHLORINE INJECTION PIT	3 CORPORATIONS & PIPING USED AS
	INJECTORS.
20 VALVE HOUSE PIT	8-24" SUCTION VALVES, MANUAL GATES
	4 OPEN, 1 CLOSED.
	2 SCREEN POTS, SCREENS REMOVED
VALVE PIT	24" DISCHARGE VALVE, MAN. GATE-OPEN
VALVE PIT	24" SUCTION VALVE, MAN. GATE-CLOSED
UNCTION MANHOLE	2-36" SUCTION VALVES, MANUAL
	BUTTERFLIES, OPEN-CHLORINE INJECTION
	24" SUCTION VALVE, MAN. BUTTERFLY-OPEN
CHLORINE SOLUTION LINE PIT	CHLORINE SOLUTION LINES WITH
	CONNECTIONS FOR FLUORIDE
	SOLUTION INJECTION.
SCREEN CHAMBER	SCREEN & MIXING CHAMBER WITH
	3 SCREENS AND ELECTRIC HOIST

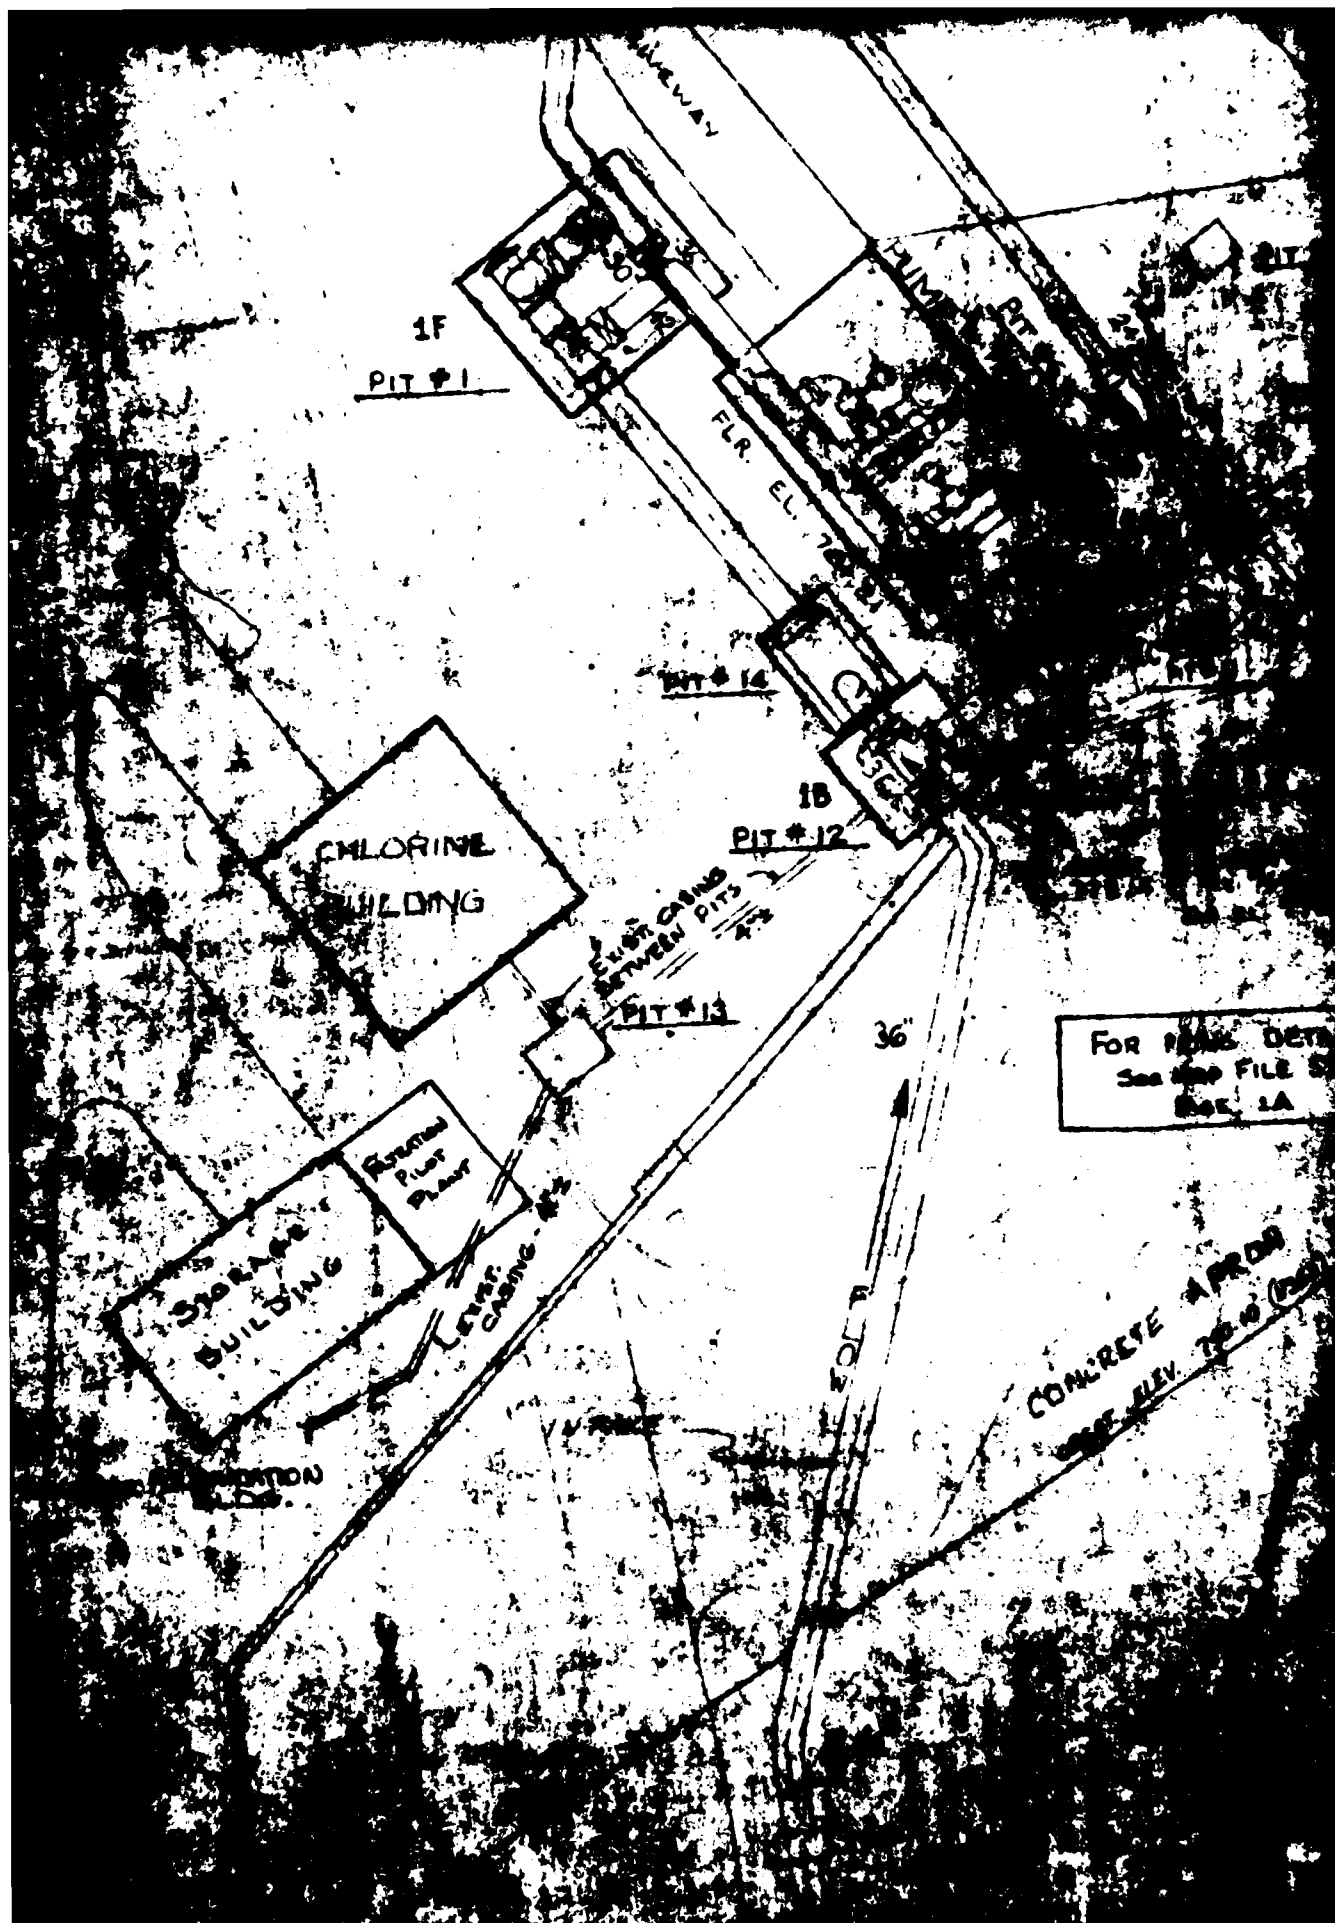

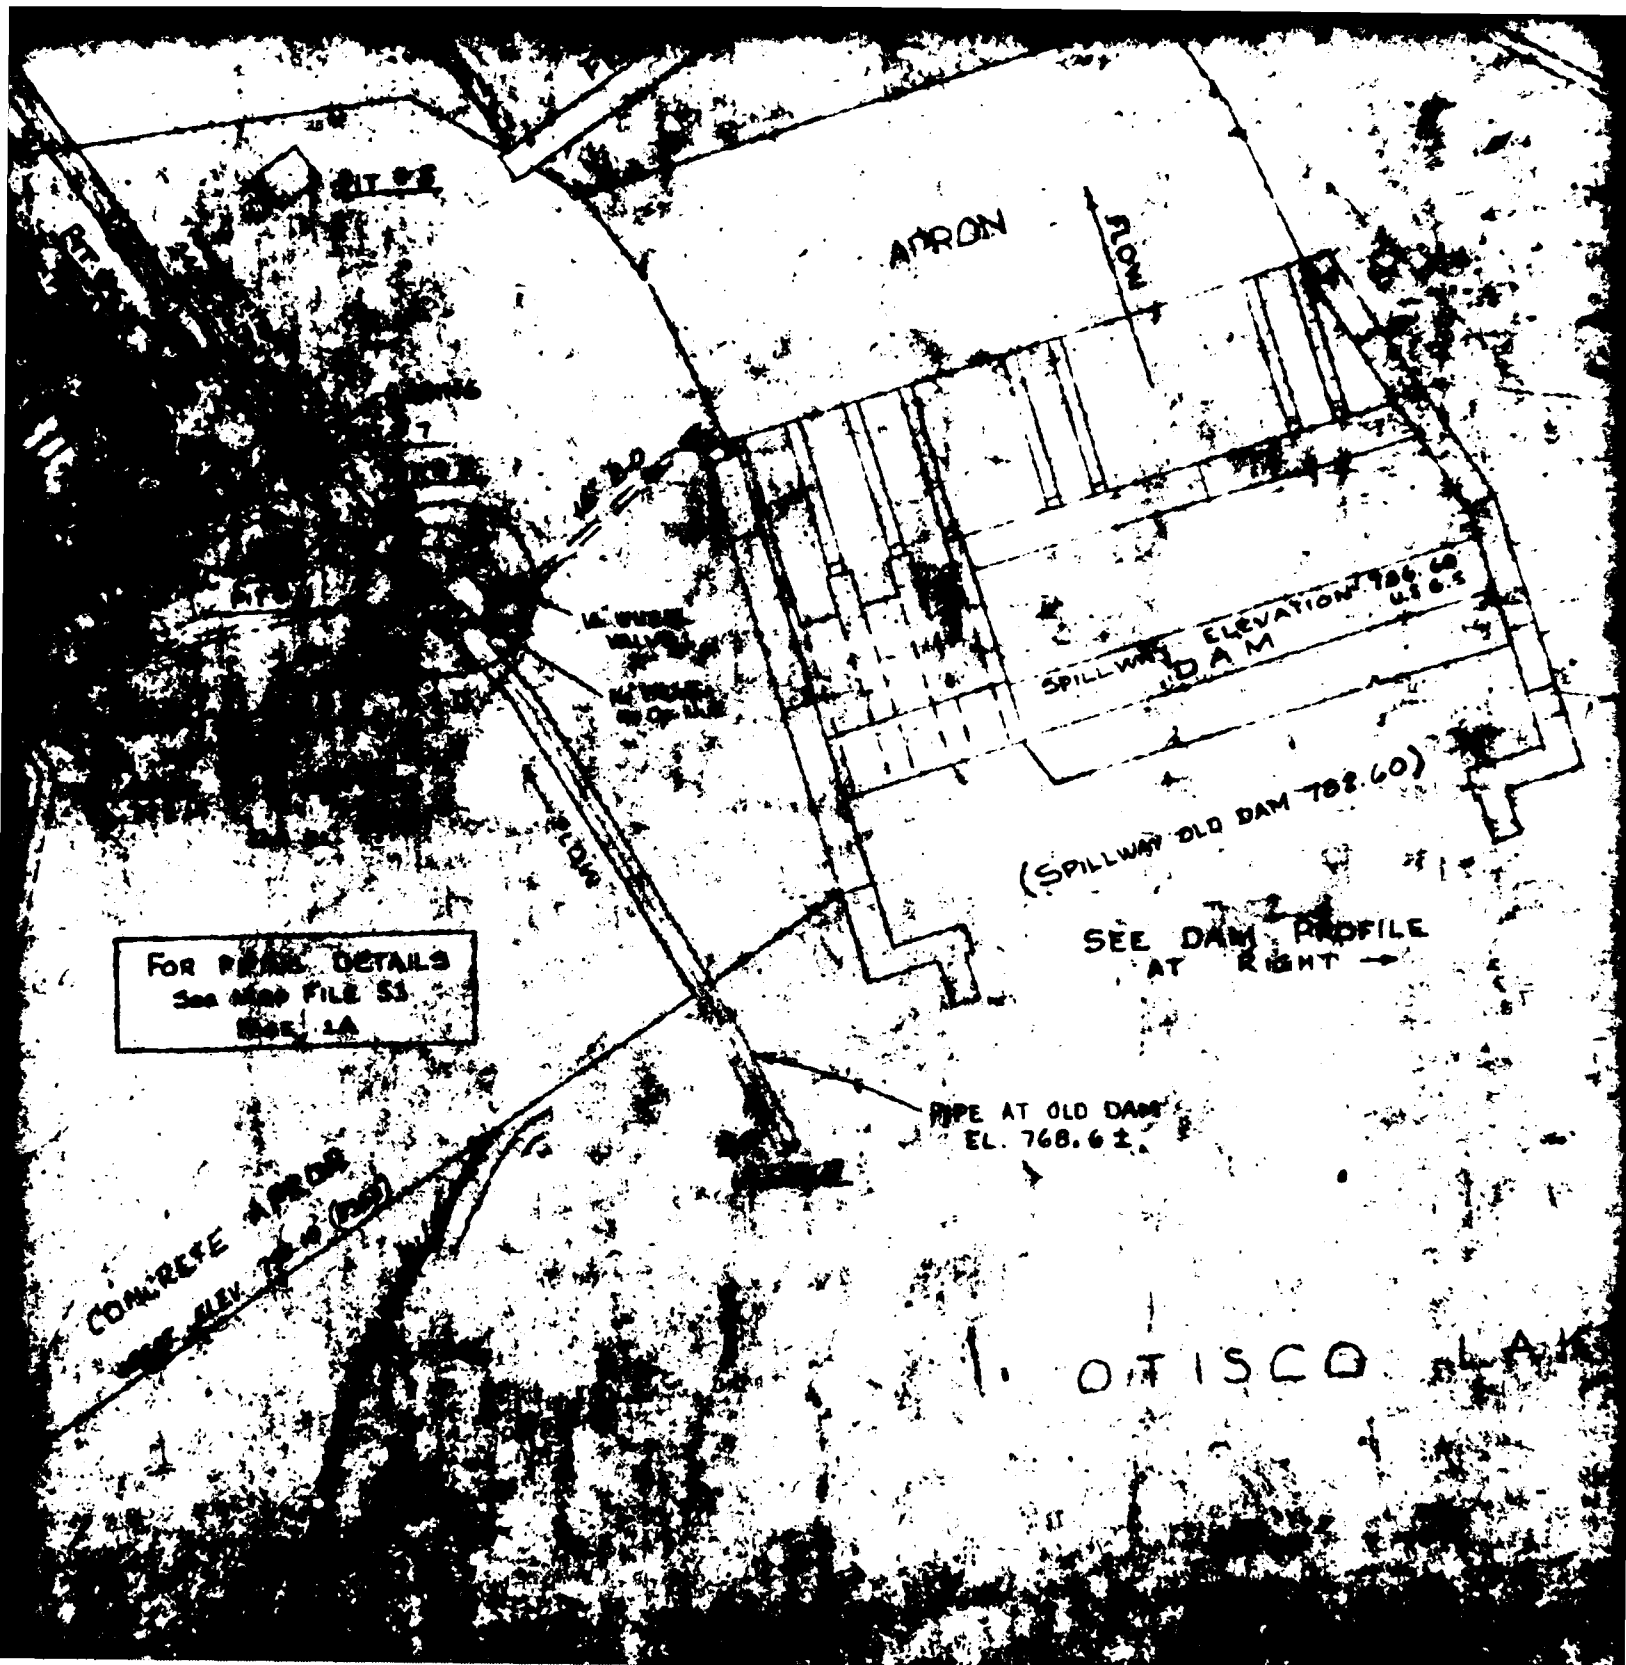

FOR P. 5 DETAILS
See MAP FILE 53
PAGE 1A

CONCRETE APRON
SEE REV. 7-6-65 (P. 5)

PIPE AT OLD DAM
EL. 768.62

(SPILLWAY OLD DAM 768.60)

SEE DAM PROFILE
AT RIGHT →

OTISCO LAKE

OTISCO LAKE

36"

NARROW

CONCRETE

CREST ROAD 270 10 (USGS)

42" INTAKE


24" INTAKE

100 60
U.S.G.

60)

FILE

LAKE

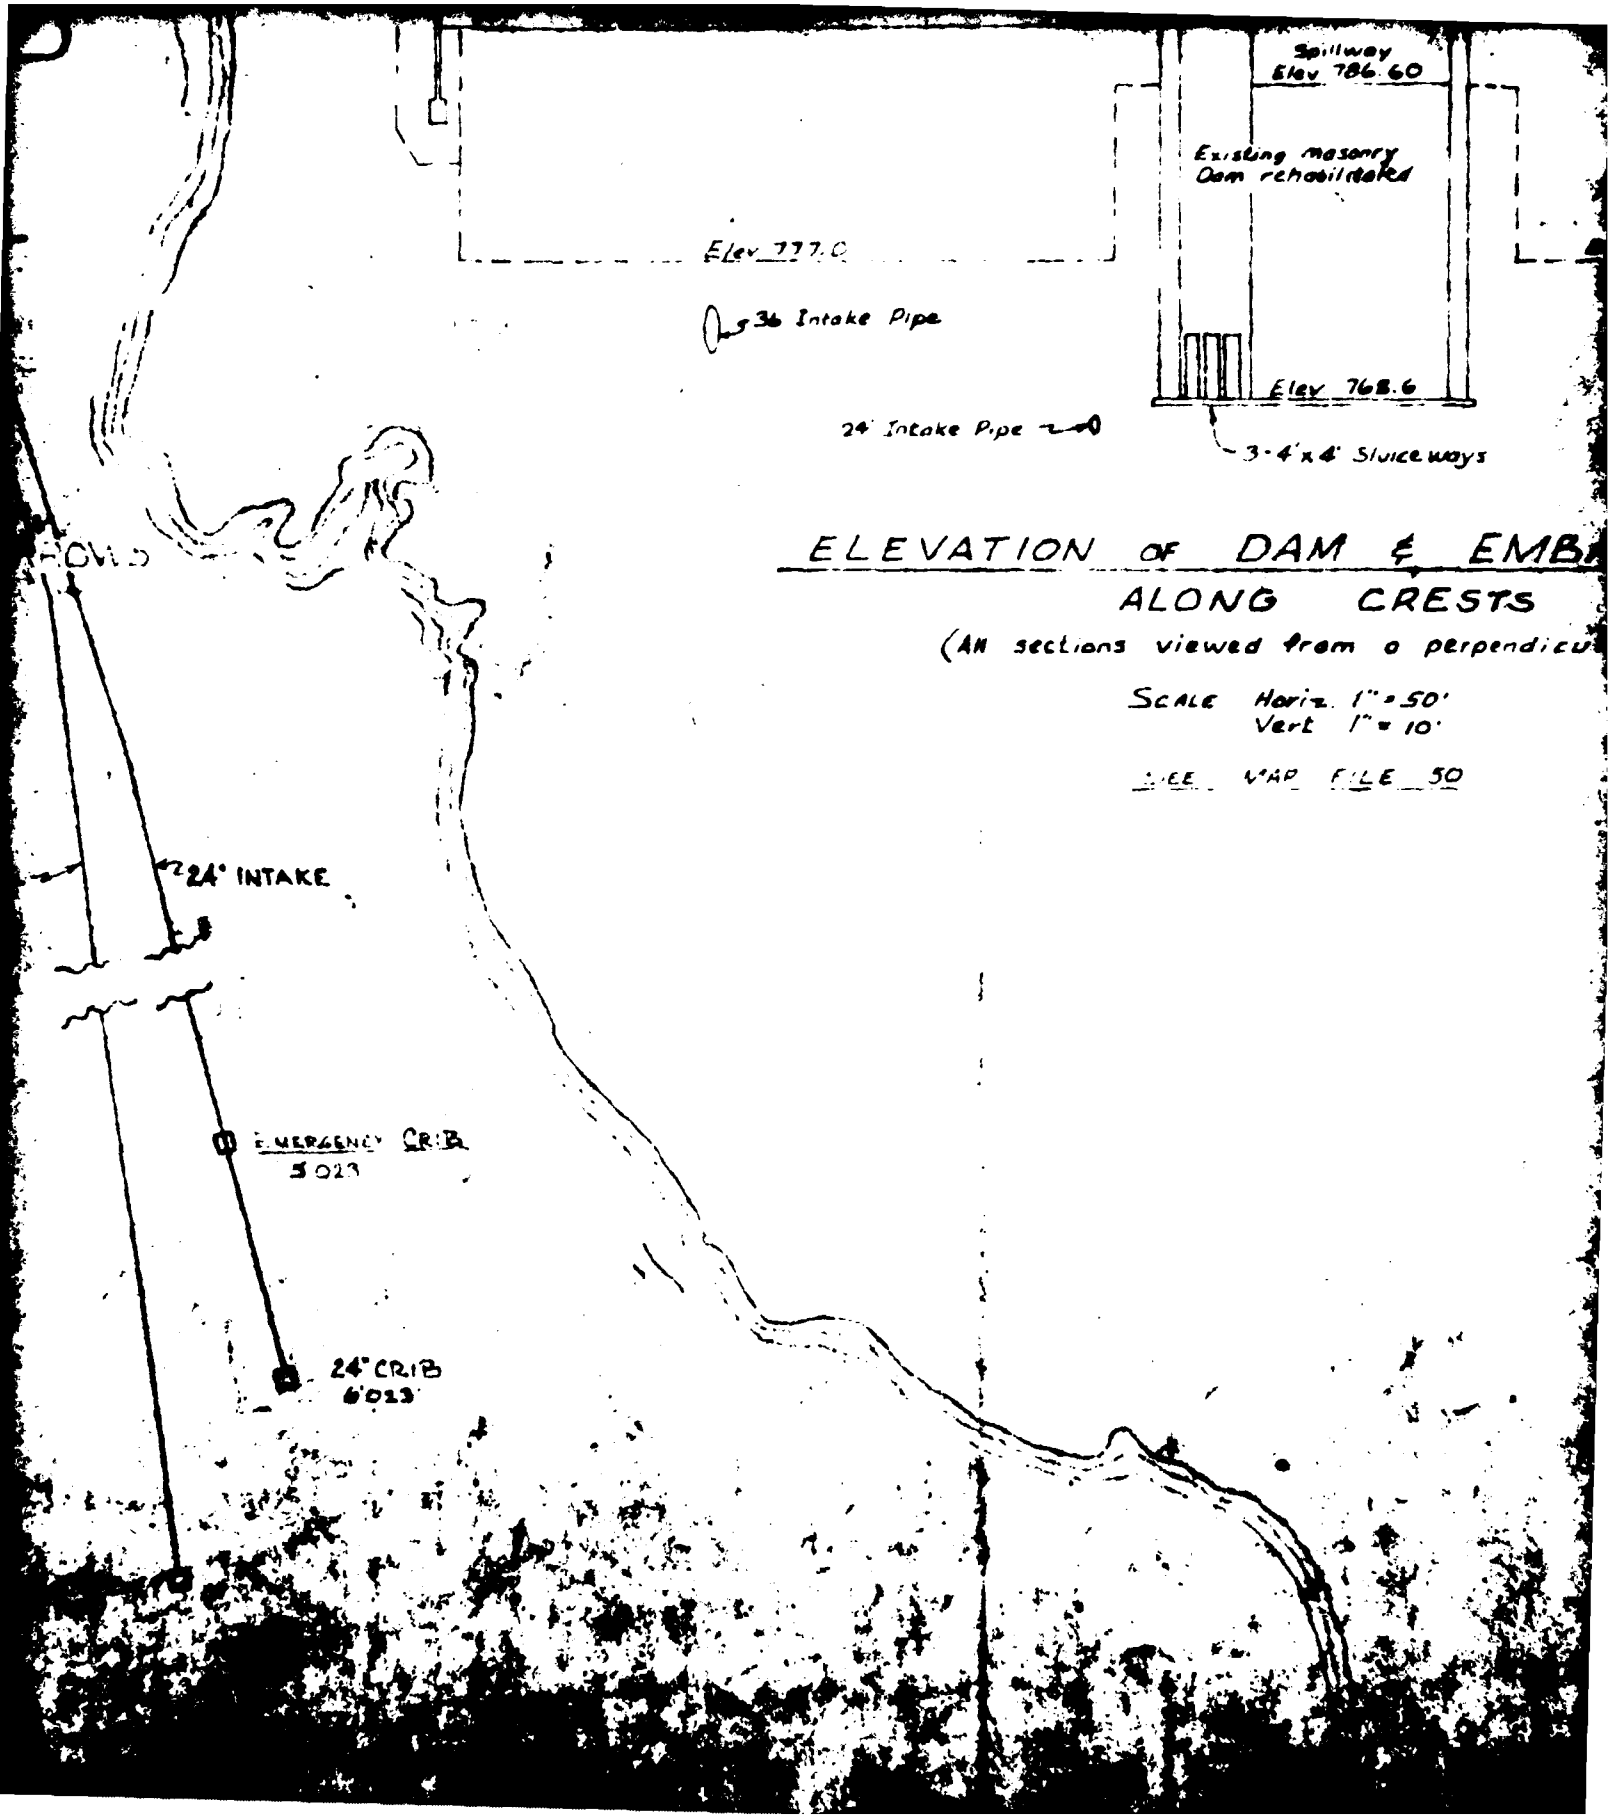

Elev 777.0

36 Intake Pipe

24 Intake Pipe

Existing masonry
Dam rehabilitated

Elev 768.6

3-4' x 4' Sluiceways

ELEVATION OF DAM & EMB ALONG CRESTS

(All sections viewed from a perpendicular)


Scale Horiz. 1" = 50'
Vert. 1" = 10'

SEE MAP FILE 50

24" INTAKE

EMERGENCY CRIB
5023

24" CRIB
6013

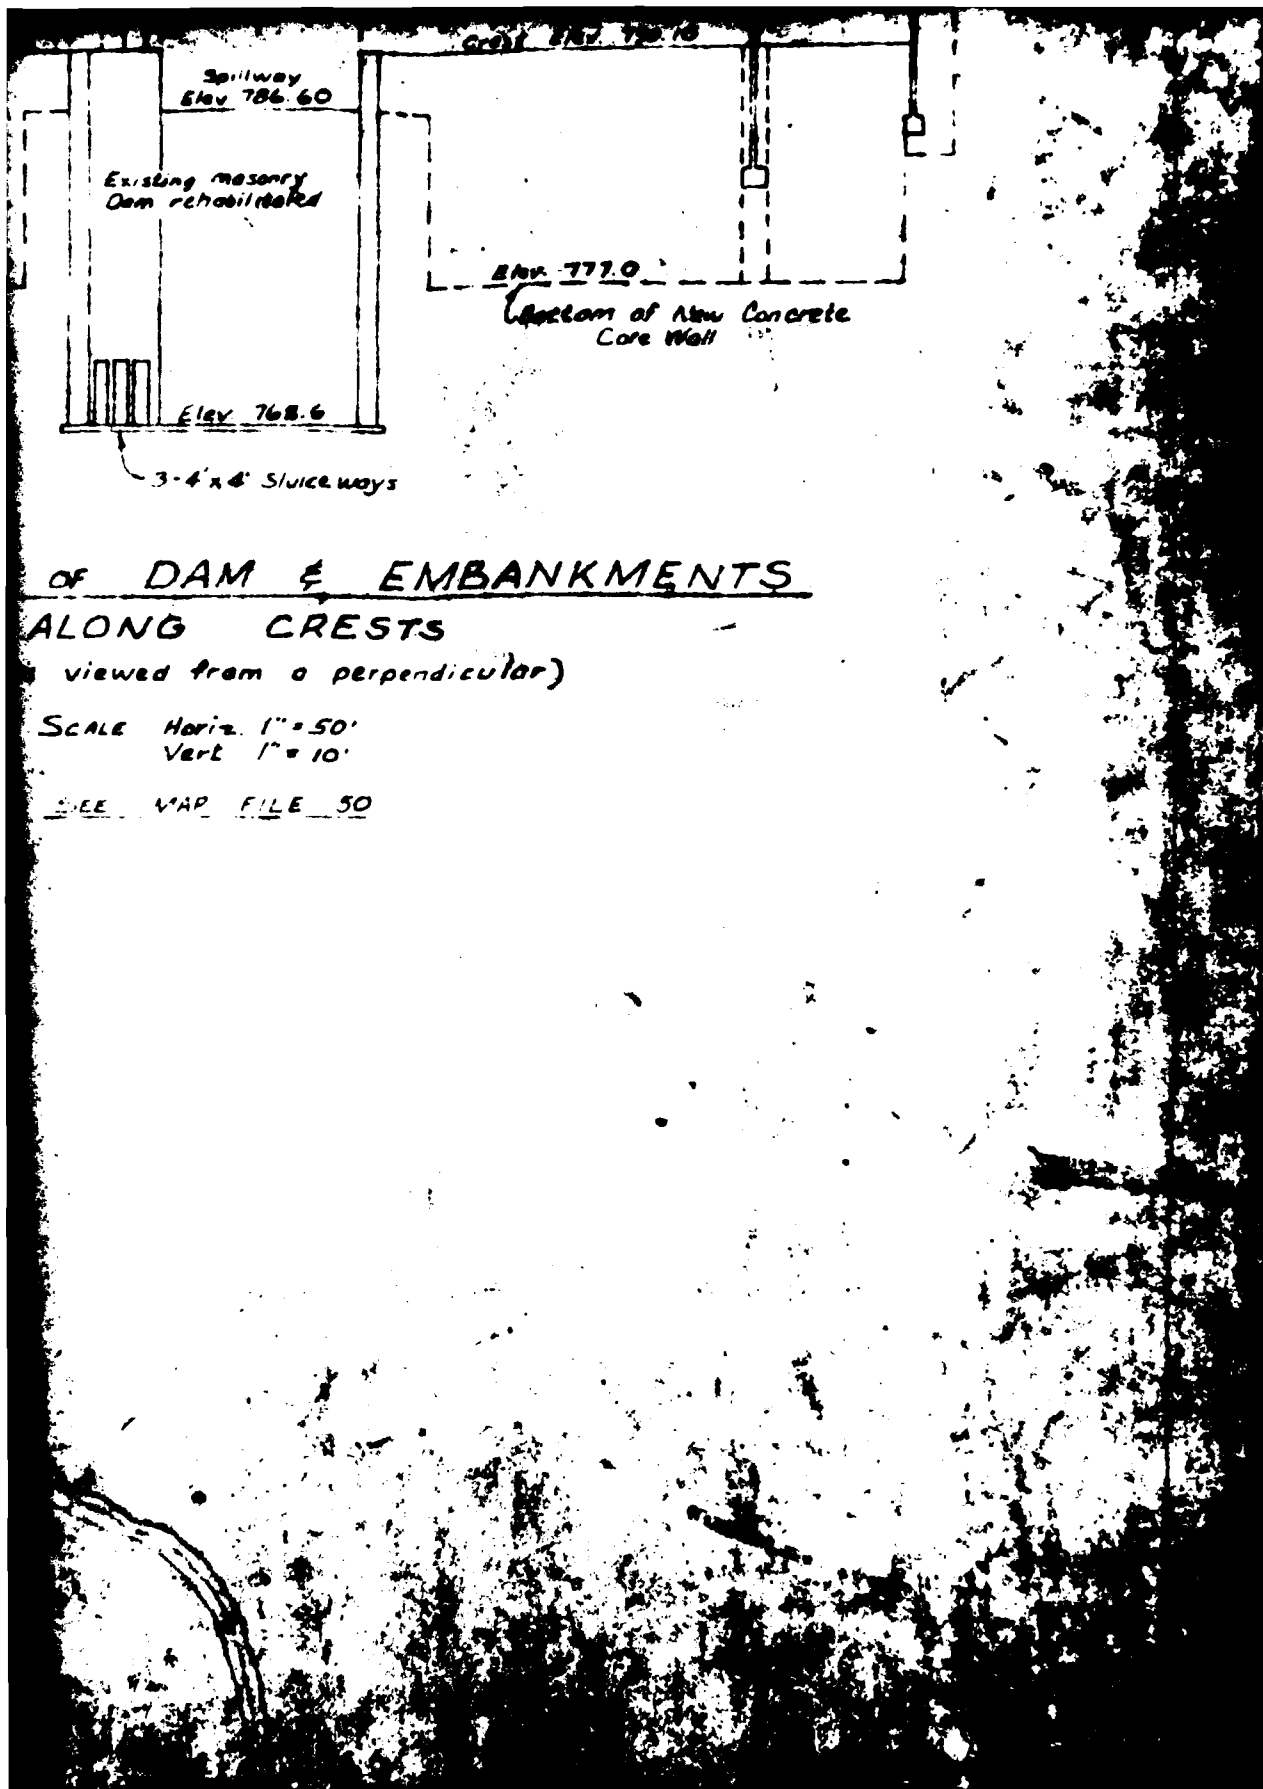

02